Issue	**1**
Factory ID	**25650**
Date of Issue	**16-Jun-2026**

Amtex Ltd.

5-Pullian Ismail Road, Tehsil Faisalabad City,
Faisalabad
Punjab Pakistan

Latitude: [31.45965], longitude: [73.0738]
Date of inspection: 13-Apr-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Kashif Riaz**
Reviewed by	**Qaseem Uz Zaman Khan**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 13-04-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 4
2. Building Extents 6
   2.1 Structural System 14
3. Documentation 16
4. Structural Safety Measures 17
5. Remediation Support 19
   5.1 Engineering Support 19
6. Cracking 20
   6.1 Beams 20
7. Other Damage/Defects 22
   7.1 Corrosion of reinforcement 22
   7.2 Spalling concrete 23
   7.3 Health and Safety 25
   7.4 Health and Safety 27
8. Structural Documentation 29
   8.1 Documentation unavailable 29
   8.2 Lack of safe load plans 30
9. Assessment Limitations and Assumptions 31

1. Executive Summary

On 13-Apr-2026, Haris Mahmood and Kashif Riaz on behalf of the Pakistan Accord carried out an initial structural inspection for Amtex Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Naveed Aslam (Compliance Manager), Mr. Faisal Ameer (Admin), Mr. Tajammul Hussain (Electrical Engineer) of Amtex Ltd. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Pakistan Accord were present.

The factory operates in single general shift for all the activities. Factory employs approximately 500 workers with approximately 20 workers being female.
The factory comprises of two main buildings and multiple ancillary structures, owned by Amtex Ltd. During the inspection, the buildings highlighted in Figure 1.1 were inspected, with the site boundary indicated in red.

- **Building 01** consist of three area:

o **Area 01** is a two-storey (Ground+1) structure consist of RC moment resisting frame (MRF) with infill brick masonry. The building is used for solar panels (Roof), stitching, checking (First Floor), offices, fabric store, stitching, sample room (Ground Floor). The construction date of building area is 2000.
o **Area 02** is a single-storey (Ground only) structure consist of Uni-directional RC moment resisting frame (MRF) supporting precast Double-Tee slab. The building is used for processing, stitching, checking (Ground Floor). The construction date of building area is 2000.
o **Area 03** is a single-storey (Ground only) structure consist of Uni-directional RC moment resisting frame (MRF) supporting steel trusses and PCC slab. The building is used for quilting, wadding (Ground Floor). The construction date of building area is 2000.

- **Building 02** is a single-storey (Ground only) consists of multiple structure. The structural system of the building comprises of multiple structural system which includes RC Moment resisting frame structure (MRF), uni- directional RC moment resisting frame supporting Double-Tee slab and steel portal frame shed with steel rafters. The building is used for solar at roof, printing, cutting, finishing, packing, warehouse, store, mosque at ground floor. The construction date of building is 2005 and the building was horizontally extended in 2020.
- **"Ancillary Structures"** consist of the following:

o **Toilet Block** is a single-storey (Ground only) consist of load bearing structure with precast slab. The building is used for washrooms. The construction year of the structure is 2000.
o **Dormitory 01** is a single-storey (Ground only) consist of load bearing brick masonry walls with precast slab resting on steel girders. The building is used for restrooms. The construction year of the structure is 2000.
o **Dormitory 02** is a single-storey (Ground only) structure consist of load bearing brick masonry walls supporting precast girders and slab panels. The

building is used for restrooms. The construction year of the structure is 2000.

We were presented with building layout only. Further details on documentation are provided in Table 2.

There is one Health and Safety issue which should be addressed immediately. It is related to the inadequate edge protection for the staff across the roofs of building 01 and 02.

A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:0

- Cracking in Beams has found in first and ground floor in building 01.
- Spalling Concrete was observed at roof of Building 01(Area 01).
- Structural and Architectural As-Built drawings of all buildings were not available
- Safe load plans for Building 01 (Area 01) needs to be prepared.

We see no reason to suspend operations in the facility due to these concerns.
Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1 - Building Summary

Building		Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / modifications	Engineer access issues
Building 01	Area 01	Solar (Roof) Stitching, checking (First Floor) Offices, fabric store, stitching, sample room (Ground Floor)	Two (G+1)	2000	RC moment resisting frame (MRF) with infill brick masonry	-	-	-
	Area 02	Processing, stitching, checking (Ground Floor)	One (Ground Only)	2000	Uni-directional RC moment resisting frame (MRF) supporting precast Tee slab	-	-	-

	Area 03	Quilting, wadding (Ground Floor)	One (Ground Only)	2000	Uni-directional RC moment resisting frame (MRF) supporting steel trusses and PCC slab	-	-	-
Building 02		Solar (Roof) Printing, cutting, finishing, packing, warehouse, store, mosque (Ground Floor)	One (Ground Only)	2005	RC Moment resisting frame structure (MRF), uni-directional RC moment resting frame supporting precast Tee slab, steel portal frame consists of streel trusses and girders.	-	Horizontally extended in 2020	-

Ancillary Structure	Toilet Block	Washrooms (Ground Only)	One (Ground Only)	2000	Load bearing structure with precast slab	-	-	-
	Dormitory 01	Rest rooms (Ground Floor)	One (Ground Only)	2000	Load bearing brick masonry walls with precast slab resting on steel girders	-	-	-
	Dormitory 02	Rest rooms (Ground Floor)	One (Ground Only)	2000	Load bearing brick masonry walls supporting precast girders and slab panels	-	-	-



Figure 1.1. Site plan (Satellite view) - Red dashed line indicates site boundary, highlighted (blue) area indicated area inspected.

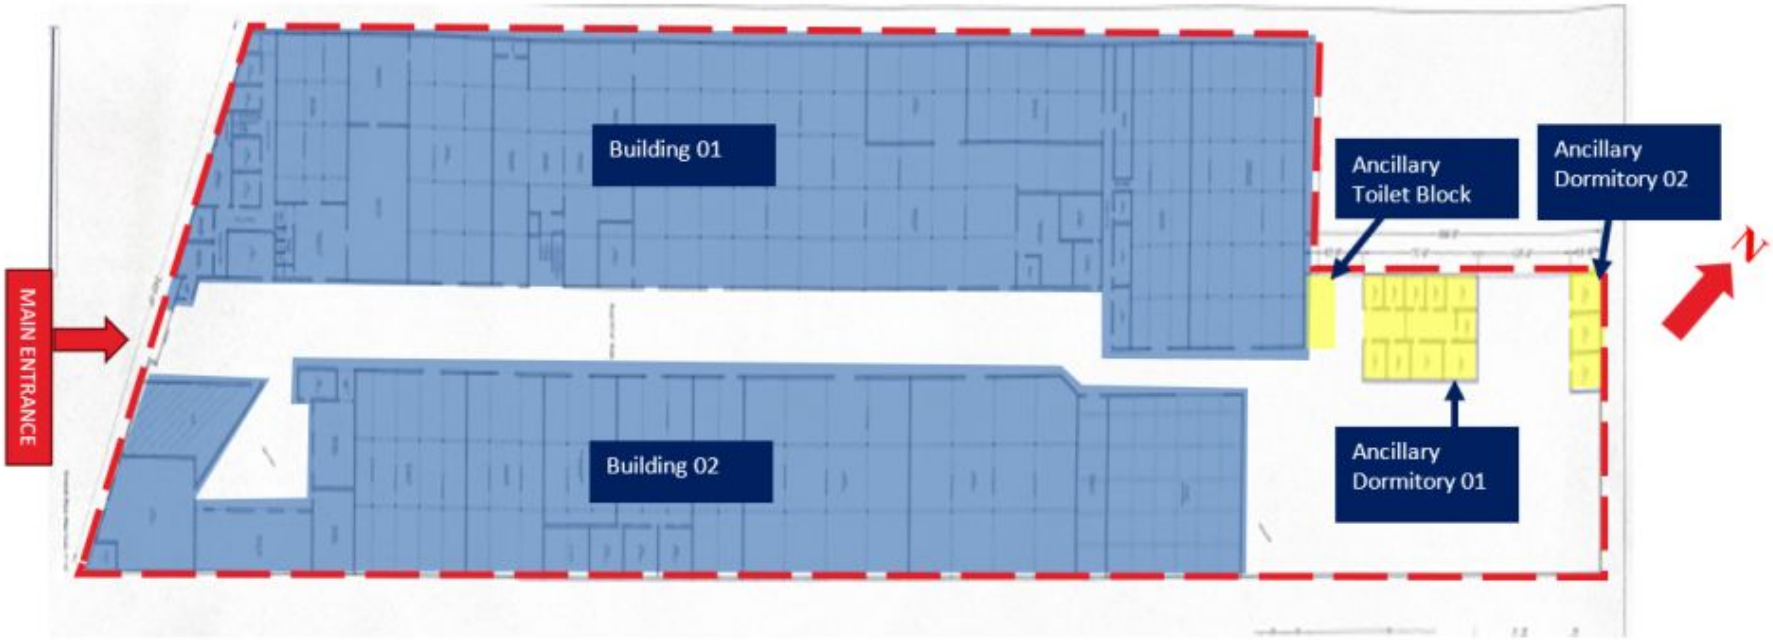


Figure 1.2. Site layout. Red dashed line indicates site boundary, highlighted area indicates buildings inspected.



Figure 1.3. Side elevation of Building 01



Figure 1.4. Side elevation of Building 02



Figure 1.5. Front Elevation of Ancillary Toilet Block



Figure 1.6. Side Elevation of Ancillary Dormitory 01



Figure 1.7. Front Elevation of Ancillary Dormitory 02



Figure 1.8. Roof Floor Activity at Building 01



Figure 1.9. First Floor Activity at Building 01



Figure 1.10. Ground Floor Activity at Building 01



Figure 1.11. Roof Floor Activity at Building 02



Figure 1.12. Ground Floor Activity at Building 02

2.1 Structural System

Building	Building 01
Stability system	RC MRF (Area 01) Uni directional RC moment resisting frame (MRF) supporting precast Double-Tee slab (Area 02) Uni-directional RC MRF supporting steel trusses and PCC slab(Area 03)
Column size (m)	0.45dia (Area01) 0.46x0.46 (Area01)
Grid (m)	6.45x9.15 (Area 01) 5.2x15.2(Area 02) 4.7x10.3 (Area 03)
Primary beam size (m)	0.3x0.4(Area 01) 0.3x0.75(Area 03)
Secondary beam size (m)	-
Slab depth (m)	0.15
Finishes depth (m)	0.15
Ceiling height (m)	3.7 (First Floor Area 01) 4.3 (Ground Floor Area 01) 4.3 (Ground Floor Area 02) 5.1 (Ground Floor Area 03)


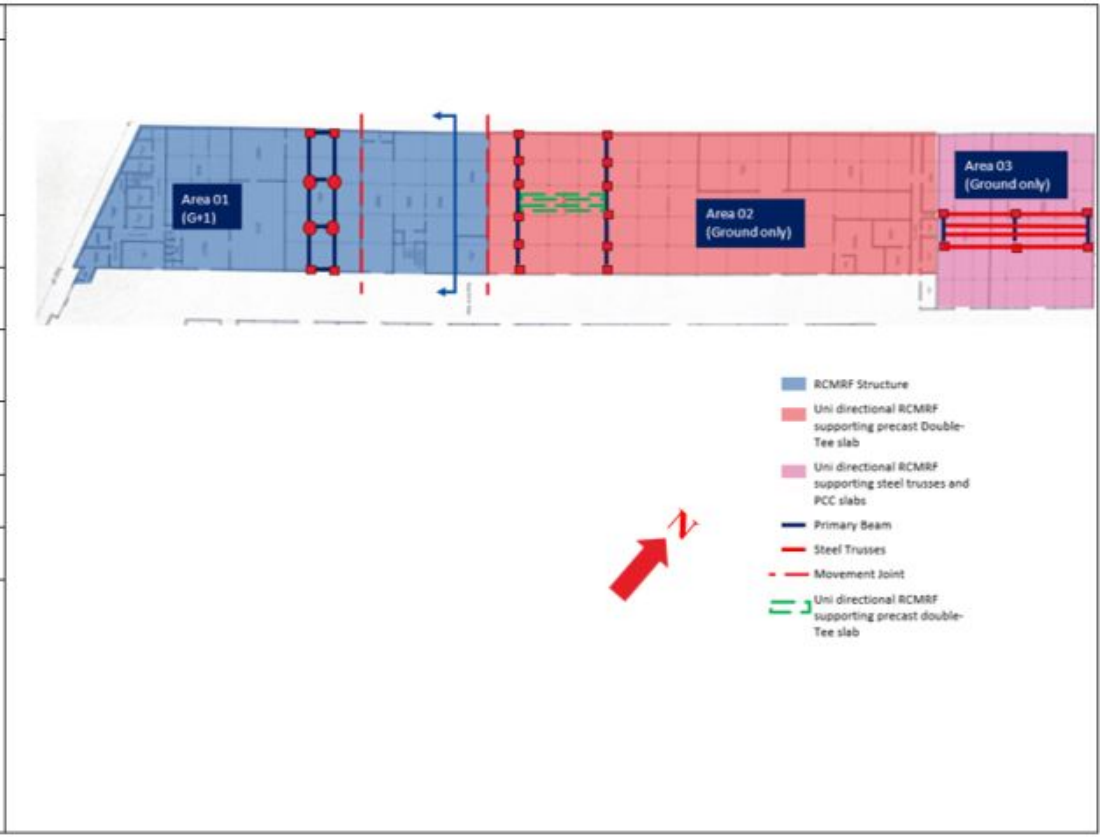


Figure 1.13. Typical Floor Framing Plan of Building 01

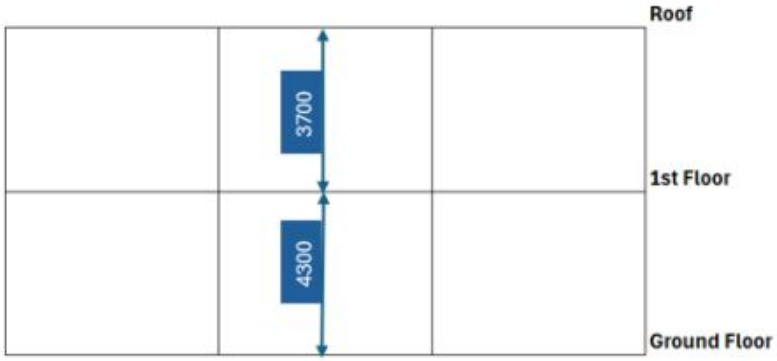

Structural System Notes

Column size is the structural dimension and include render thickness
Grid measurements are from centre of column to centre of column
Beam sizes do not include slab depth

Figure 1.14. Typical section of Building 01

3. Documentation

We were presented with the following documentation.

Table 2 - Documentation

Building		Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plan	Stability certificate	Inspection reports	Materials testing
Building 01	Area 01	Yes	No	No	No	No	No	No	No	No
	Area 02									
	Area 03									
Building 02		Yes	No	No	No	No	No	No	No	No
Ancillary Structures	Toilet Block	Yes	No	No	No	No	No	No	No	No
	Dormitory 01	Yes	No	No	No	No	No	No	No	No
	Dormitory 02	Yes	No	No	No	No	No	No	No	No

4. Structural Safety Measures

During our structural site inspection of Amtex Ltd., a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within Amtex Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3: Summary of issues by building

Building		Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Building 1	Area 1	-	-	Beam	-	Corrosion of Reinforcement Spalling Concrete Lack of edge protection	Documentation unavailable Lack of safe load plans
	Area 2	-	-	-	-	-	Documentation unavailable
	Area 3	-	-	-	-	-	Documentation unavailable

Building 2		-	-	-	-	Lack of edge protection Health and Safety	Documentation unavailable
Ancillary Structures	Toilet Block	-	-	-	-	-	Documentation unavailable
	Dormitory 01					-	Documentation unavailable
	Dormitory 02	-	-	-	-	-	Documentation unavailable

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support F-202604-065804

Timeline	Remediation Plan
Medium Term CAP-0078223	Factories should begin remediation of CAP items—such as surface cracks or non-structural repairs—using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Cracking

6.1 Beams

This issue refers to building 01, beam cracking at 1st and ground floor has been observed. These cracks might be due to inadequate shear reinforcement provided near the beam column joint F-202604-065784

Timeline	Remediation Plan
Medium Term CAP-0078218	Building Engineer to inspect the beams and confirm the source of the damage
Medium Term CAP-0078219	Propose the measures to prevent further damage
Medium Term CAP-0078220	Submit proposed remedial works of beams to Pakistan Accord for review.
Longer Term CAP-0078221	Implement remedial works.
Longer Term CAP-0078222	Continue to monitor for future signs of damage.



Figure 2.1 - Beam Cracking at 1st floor



Figure 2.2 - Beam Cracking at Ground foor



Figure 2.3 - Plan indicating location of beam cracking

7. Other Damage/Defects

7.1 Corrosion of reinforcement

This observation is related to roof of building 01(Area 01) where the column rebars are exposed and inadequately protected against corrosion at roof floor. This presents a high risk of reinforcement corrosion, which may compromise the structural integrity overtime. F-202604-065746

Timeline	Remediation Plan
Longer Term CAP-0078154	Propose measures to prevent further water ingress and inspect damage to the columns dowels and propose appropriate repairs to structure
Longer Term CAP-0078155	Implement approved remedial measures



Figure 2.4 - Corrosion of Dowel reinforcement at roof of Building 01(Area 01)

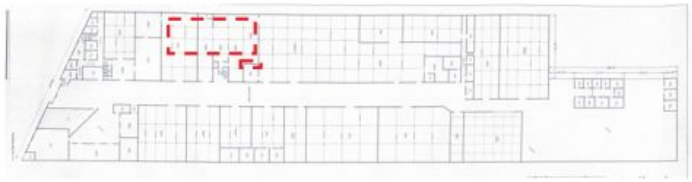


Figure 2.5 - Plan indicates location of Corrosion of reinforcement at roof of building 01(Area 01)

7.2 Spalling concrete

This issue refers to building 01 (Area 01) where spalling concrete in beam was observed. The cause of spalling is corrosion of reinforcement. The potential cause of corrosion of reinforcement is due to lack of waterproofing and exposed atmospheric weather condition. F-202605-066340

Timeline	Remediation Plan
Medium Term CAP-0079200	Inspect damage to the beam and propose repair to the structure. Submit report capturing above to Pakistan Accord for approval.
Longer Term CAP-0079201	Implement remedial works
Longer Term CAP-0079245	Continue to monitor for future signs of damage.



Figure 2.6 - Spalling Concrete at Roof of Building 01(Area 01)

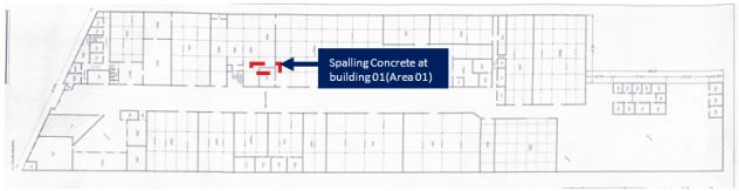


Figure 2.7 - Plan indicates location of spalling concrete

7.3 Health and Safety

This issue is related to roof and staircase of building 01 where there is no edge protection leaving open edges without proper guardrails or barriers. This creates a serious fall hazard for anyone working or walking near the roof edge. F-202604-065734

Timeline	Remediation Plan
Immediate CAP-0078123	Provide adequate edge protection on the roof, staircase and on any other part of the factory with the same issue.



Figure 2.8 - Lack of edge protection at building 01



Figure 2.9 - Missing handrails for staircase at building 01



Figure 2.10 - Plan indicates location of edge protection building 01

7.4 Health and Safety

This issue is related to roof and staircase of building 02 where there is no edge protection leaving open edges without proper guardrails or barriers. This creates a serious fall hazard for anyone working or walking near the roof edge. F-202604-065735

Timeline	Remediation Plan
Immediate CAP-0078129	Provide adequate edge protection on the roof, staircase and on any other part of the factory with the same issue.



Figure 2.11 - Lack of edge protection at building 02

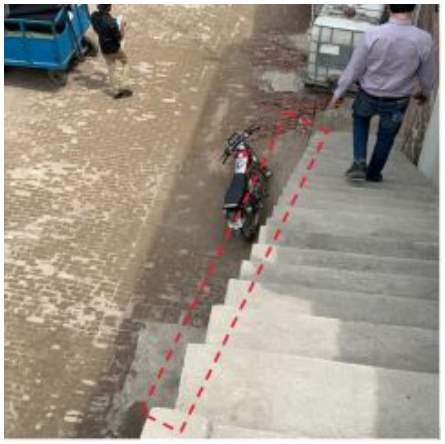


Figure 2.12 - Missing handrails for staircase at building 02

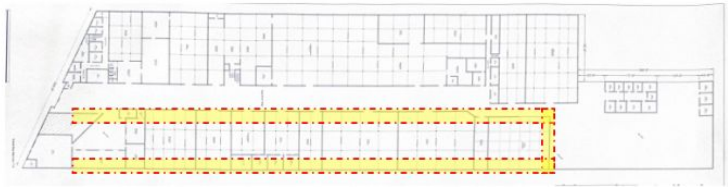


Figure 2.13 - Plan indicates location of edge protection at building 02

8. Structural Documentation

8.1 Documentation unavailable

Architectural and structural As-Built drawings were not available. F-202604-065157

Timeline	Remediation Plan
Longer Term CAP-0077131	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as-built documentation.

8.2 Lack of safe load plans

No safe load plans were posted in the Building 01 (Area 01). F-202604-065158

Timeline	Remediation Plan
Longer Term CAP-0077132	Building structural engineer to review design documentation to confirm load capacity of the structure of building 01 (Area 01).
Longer Term CAP-0077133	Develop safe load plans for Building 01(Area 01) and submit to Pakistan Accord for review.
Longer Term CAP-0077134	Factory to post safe load plans on each floor.

9. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.