Issue	**1**
Factory ID	**26207**
Date of Issue	**04-Jun-2026**

Arshad Corporation (Pvt.) Ltd. (Apparel Division)

4.5 KM Jaranwala Road, Khurrianwala
Faisalabad
Punjab Pakistan

Latitude: [31.471655], longitude: [73.309928]
Date of inspection: 21-Apr-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Muhammad Naseer**
Reviewed by	**Shehroz Javed**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 21-04-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 9
   - 3.1 Building Means of Egress Details 10
   - 3.2 Building Use 11
4. Documentation 12
5. Fire Safety Measures 13
6. Remediation Support 14
   - 6.1 Engineering Support 14
7. Means of Escape 15
   - 7.1 Escape doors 15
   - 7.2 Exit access 17
   - 7.3 Travel distance 19
   - 7.4 Protection of stairs 20
   - 7.5 Exit signage 22
8. Fire Rated Construction 24
   - 8.1 Separation of high-risk areas 24
   - 8.2 Separation of shafts 26
   - 8.3 Floor openings 28
   - 8.4 Separation of occupancies 30
   - 8.5 Storage 32
9. Fire Suppression 34

9.1 Fire extinguishers..... 34
10. Fire Safety Management..... 36
10.1 Fire drills..... 36
10.2 Records of system testing..... 37
10.3 Records of systems maintenance..... 38
10.4 Emergency Action Plan..... 39
11. Assessment Limitations and Assumptions..... 40

1. Executive Summary

On 21-Apr-2026, Abdul Hayee and Muhammad Naseer on behalf of the Pakistan Accord carried out an initial fire inspection for Arshad Corporation (Pvt.) Ltd. (Apparel Division), a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with Mr. Saleh Muhammad (Manager), Mr. Rizwan Akram (Deputy Manager – Electrical), Mr. Zeeshan Sajid (Compliance Officer), Mr. Muhammad Salman Sarwar (Civil Engineer) and other staff members of Arshad Corporation Pvt. Ltd. (Apparel Division). The assessment was conducted as a part of an overall Structural, Fire, and Electrical initial inspection. Team was lead by Abdul Hayee.
The factory operates in single general shift. Factory employs approximately 500 workers with approximately 6% female representation.
The factory comprises of two main buildings and five ancillary structures owned by Arshad Corporation (Pvt.) Ltd (Apparel Division). During the inspection, the building highlighted in blue in Figure 1.1 were surveyed with the site boundary indicated in red.
1 **Main Building –** is a 2 storey (G+1),RC MRF building with a covered area (footprint) of 4861 sq. m. 6 staircase serves the building, out of which 1 stair discharge internally. The building is used for unoccupied (roof) , stitching, workshops, sample room and offices(1st floor), offices, fabric store, cutting, accessory store , finishing hall, packing hall, sleeping area & warehouse (Ground floor).The building was constructed in 2009 (Ground floor) & 2021(1st floor).
2 **Canteen Building–** is a single storey (G only),load bearing walls with pre-cast girder & slabs building with a covered area (footprint) of 47 sq. m. The building is under construction intended to use cooking and dinning area (Ground floor). The building was constructed in 2026.

- **Ancillary Structures** consist of the following:
  - **Security Office** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting T-iron and brick slab. The structure is used for offices (Ground Floor). The construction year of the structure is 2021.
  - **Overhead Water Tank (OHWT)** is an elevated structure. The structural system comprises of RC MRF with RC retaining walls of water tank. The structure is used for water storage. The construction year of the structure is 2009.
  - **Office Block** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting T-iron and brick slab. The structure is used for offices, childcare room, female security room (Ground Floor). The construction year of the structure is 2021.
  - **Toilet Block 1** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting T-iron and brick slab. The structure is used for ladies / gents toilet (Ground Floor). The construction year of the toilet block 1 is 2021.
  - **Toilet Block 2** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting RC precast slab panels. The structure is used for gents toilet (Ground Floor). The construction year of the toilet block 2 is 2023.

We were presented with fire drill records, inspection record, emergency action plan, architectural layout and civil defence certificate.
A summary of the main concerns identified during the inspection includes (non-exhaustive):

- There is no fire separation between stairs and the rest of the building.
- Storage areas are not fire separated from rest of the building.
- Lockable exit doors found at most of the facility.

- The dormitory at Main Building (Ground floor) is not to be used until minimum requirements for sleeping occupancies have been provided

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes.)

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents



Figure 1.1. Satellite image – Red dashed line indicates site boundary

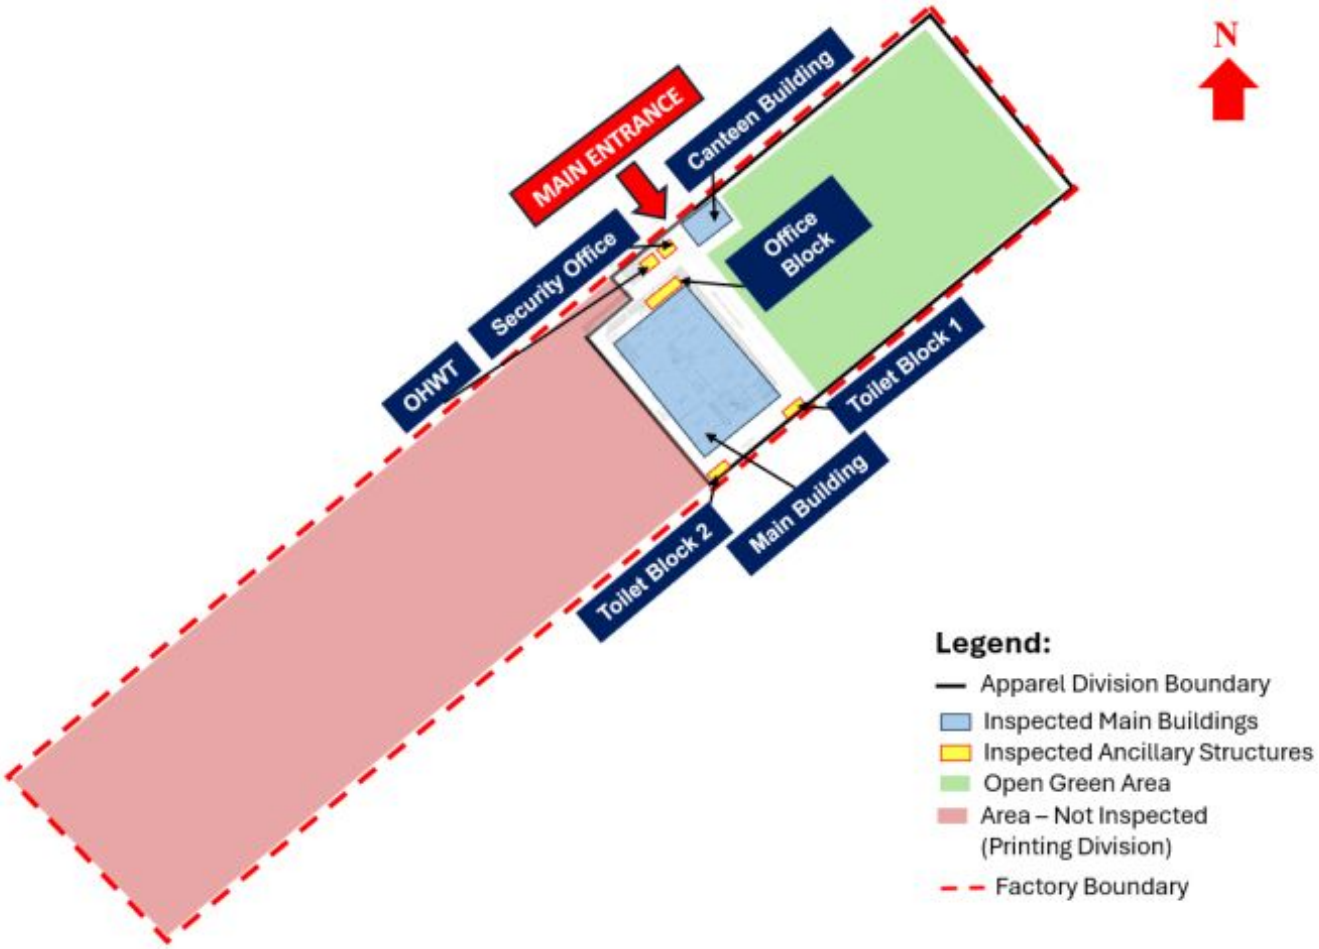


Figure 1.2. Site Layout Plan of the Factory Premises

3. Building Description

The factory comprises of two main buildings and five ancillary structures owned by Arshad Corporation (Pvt.) Ltd (Apparel Division). During the inspection, the building highlighted in blue in Figure 1.1 were surveyed with the site boundary indicated in red.

1 Main Building – is a 2 storey (G+1),RC MRF building with a covered area (footprint) of 4861 sq. m. 6 staircase serves the building, out of which 1 stair discharge internally. The building is used for unoccupied (roof) , stitching, workshops, sample room and offices(1st floor), offices, fabric store, cutting, accessory store , finishing hall, packing hall, sleeping area & warehouse (Ground floor).The building was constructed in 2009 (Ground floor) & 2021(1st floor).

2 Canteen Building– is a single storey (G only),load bearing walls with pre-cast girder & slabs building with a covered area (footprint) of 47 sq. m. The building is under construction intended to use cooking and dinning area (Ground floor). The building was constructed in 2026.

- **Ancillary Structures** consist of the following:
  - **Security Office** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting T-iron and brick slab. The structure is used for offices (Ground Floor). The construction year of the structure is 2021.
  - **Overhead Water Tank (OHWT)** is an elevated structure. The structural system comprises of RC MRF with RC retaining walls of water tank. The structure is used for water storage. The construction year of the structure is 2009.
  - **Office Block** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting T-iron and brick slab. The structure is used for offices, childcare room, female security room (Ground Floor). The construction year of the structure is 2021.
  - **Toilet Block 1** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting T-iron and brick slab. The structure is used for ladies / gents toilet (Ground Floor). The construction year of the toilet block 1 is 2021.
  - **Toilet Block 2** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting RC precast slab panels. The structure is used for gents toilet (Ground Floor). The construction year of the toilet block 2 is 2023.

3.1 Building Means of Egress Details

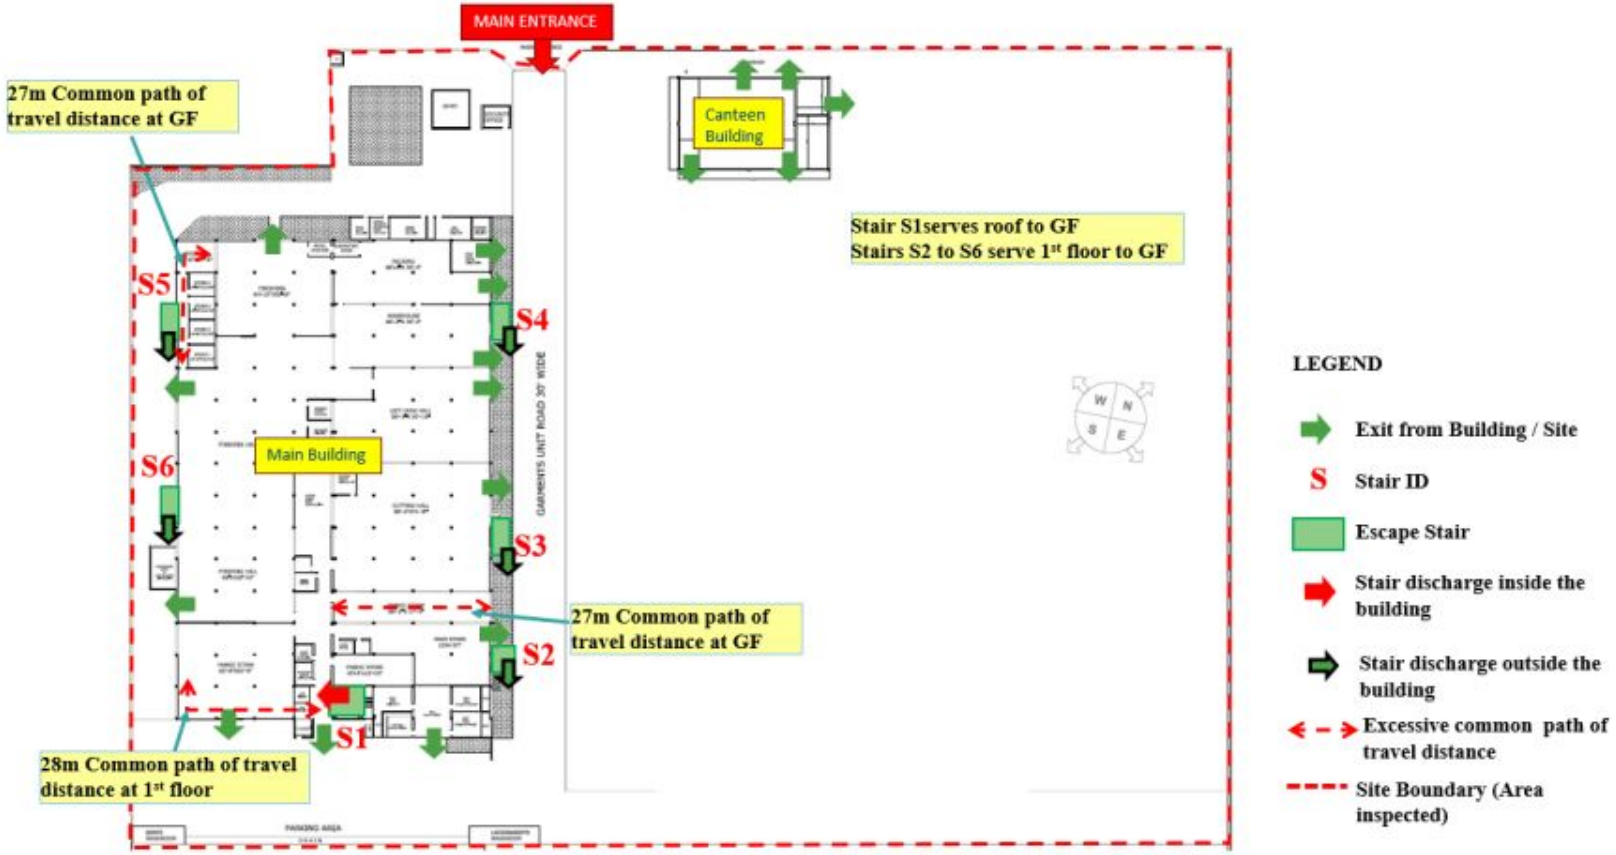


Figure 1.3. Egress layout- Main Building & Canteen Building (Ground floor)

3.2 Building Use

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Main Building						
Roof	Un-occupied	-	1	-	-	-
1st floor	Stitching, workshops, sample room and offices	150	6	-	28m	-
Ground floor	Offices, fabric store, cutting, accessory store , finishing hall, packing hall, sleeping area & warehouse	80	12	-	27m, 27m	-
Canteen Building						
Roof	Un-occupied	-	-	-	-	-
Ground floor	Intended to use cooking and dining area (Under construction)	_	5	-	-	-

The number of exits and exit capacity is sufficient for all floors & both buildings but common path of travel distance found at Ground & 1st floor of Main Building.

4. Documentation

This table shows the details about the documentation provided by the factory.

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		Yes	04-02-2026	-
2.	Architecture Layout		Yes	-	Not as per built structure
3.	Sectional Layout		No	-	-
4.	Evacuation Maps		Yes	-	On floors
5.	Emergency Action Plan		Yes	03-05-2018	Not as per Pakistan Accord Building Standard.
6.	Inspection	Fire extinguishers	Yes	04-02-2026	Not as per Pakistan Accord Building Standard.
		Exit signage	No	-	-
7.	Testing	Fire extinguishers	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Fire extinguishers	No	-	-
		Exit signage	No	-	-
9.	Evidence of Fire Drills		Yes	31-01-2026	Not as per Pakistan Accord Building Standard.
10.	Staff Training		Yes	07-05-2025	-

Table 1: Documentation

5. Fire Safety Measures

During our fire site inspection of Arshad Corporation (Pvt.) Ltd. (Apparel Division), a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Arshad Corporation (Pvt.) Ltd. (Apparel Division). Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-066131

Timeline	Remediation Plan
Immediate CAP-0078823	Factories should begin remediation of CAP items such as installing extinguishers, signage, and clearing escape routes using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Sliding doors shall not serve for escape from areas with more than 10 occupants

This is not always achieved, examples include (list not exhaustive):
- Most of the escape doors are lockable at the facility e.g. lockable door installed at entry into stair S2 (1st floor).
- Sliding doors serve for escape from areas with more than 10 occupants at both floors of Main Buildings e.g. at marketing office at Main Building (1st floor).

Recommended remedial actions are provided below.F-202604-065792

Timeline	Remediation Plan
Immediate CAP-0078275	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0078276	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5. Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, that are side swinging and open in the direction of travel to an exit.
Longer Term CAP-0078277	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Sliding door installed at marketing office at Main Building (1st floor)



Figure 2.2 - Lockable escape door installed at Main Building (Ground floor)



Figure 2.3 - Lockable & sliding door installed at entry into stair S2 (1st floor)

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.

This is not always achieved, examples include (list not exhaustive):
- Protected stair S1 discharges inside the building at a distance from building exit.

Recommended remedial actions are provided below.F-202604-065799

Timeline	Remediation Plan
Medium Term CAP-0078292	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks)
Longer Term CAP-0078293	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted.



Figure 2.4 - Stair S1 discharge inside the building at a distance from building exit

7.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Standard. The standard provides limitations on:
- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.

This is not always achieved, examples include (list not exhaustive):
- Common path of travel distances exceed permitted limits at Main Building (both floors) i-e office area found 28m (1st floor) and 27m in carton store & bond room (Ground floor).

Recommended remedial actions are provided below.F-202604-065796

Timeline	Remediation Plan
Medium Term CAP-0078285	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Standard.
Longer Term CAP-0078286	Implement the plan previous reviewed by Pakistan Accord and ensure all travel distances to emergency exits meet the requirements of the Pakistan Accord Standard.

7.4 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings (window/ exhaust fan) into stairs S2, S3, S4, S5 and S6 (both floors).
- Missing fire rated enclosure and fire doors in S1(all floors).
- Fire load in/under the stair S1 (both floors).

Recommended remedial actions are provided below.F-202604-065794

Timeline	Remediation Plan
Immediate CAP-0078280	Remove fire load and any other obstructions due to stored items from stairs
Medium Term CAP-0078281	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.
Longer Term CAP-0078282	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.5 - Fire load in Stair S1 (1st floor)



Figure 2.7 - Fire load under stair S1 (Ground floor)



Figure 2.6 - Unprotected openings (window/ exhaust fan) into stairs S2 (1st floor)



Figure 2.8 - Missing fire rated enclosure and fire doors in S1(1st floor)

7.5 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at entry into stair at S2 (1st floor).
- Electrically powered exit signs are not a tested and listed system at whole facility.

Recommended remedial actions are provided below.F-202604-065791

Timeline	Remediation Plan
Medium Term CAP-0078233	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0078234	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.9 - Electrically powered exit signs are not a tested and listed system at Main Building (1st floor)



Figure 2.10 - Missing exit signs at entry into stair at S2 (1st floor)

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Kitchen is not fire separated with fire rated construction from prayer area & sleeping rooms.

Recommended remedial actions are provided below.F-202604-065797

Timeline	Remediation Plan
Medium Term CAP-0078287	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0078288	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.11 - Kitchen is not fire separated with fire rated construction from prayer area & sleeping rooms

8.2 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):
- Lift shafts are not separated with fire rated construction (all floors) at Main Building.

Recommended remedial actions are provided below.F-202604-065789

Timeline	Remediation Plan
Medium Term CAP-0078227	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0078228	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.12 - Lift shafts are not separated with fire rated construction at Main Building (1st floor)

8.3 Floor openings

Per Pakistan Accord Standard, each floor should be fire separated using 2 hours fire resisting construction with 90 minutes fire rated door/shutter assemblies.

The following deficiencies have been observed on site, including (list not exhaustive):
- Floor opening connecting Ground & 1st floor at Main Building.

Recommended remedial actions are provided below.F-202604-065801

Timeline	Remediation Plan
Medium Term CAP-0078296	Prepare a plan and drawings showing the proposed fire separation details. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of floor openings - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0078297	Provide fire rated separation between floors by implementing the plan reviewed previously by Pakistan Accord.



Figure 2.13 - Floor opening connecting Ground & 1st floor at Main Building

8.4 Separation of occupancies

Residential sleeping areas should comply with special measures required for sleeping occupancies. Such measures include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key.
- Fire separation of dormitories from other occupancies
- Providing a minimum of 2 escape routes from the above ground levels
- Providing an automatic fire detection and alarm system
- Fire separation of cooking facilities/kitchens from the remainder of the dormitory

The following deficiencies have been observed on site, including (list not exhaustive):
- No adequate automatic fire detection and alarm system at Main Building (Ground floor).
- Cooking facilities and/or kitchens not adequately fire separated Main Building (Ground floor).

Recommended remedial actions are provided below.F-202604-065803

Timeline	Remediation Plan
Immediate CAP-0082385	The dormitory is not to be used until minimum requirements for sleeping occupancies have been provided. Alternative arrangements must be sought immediately for the dormitory as continuing the use of the building for this purpose is not appropriate. Dormitory not to be re-occupied until the minimum requirements have been implemented.
Medium Term CAP-0078300	Document proposals for design of remedial measures to ensure compliance with all fire safety requirements for sleeping occupancies to comply with Pakistan Accord Standard. Submit proposals to Pakistan Accord for review.
Longer Term CAP-0078301	Implement remediation measures to ensure full compliance with dormitory requirements of Pakistan Accord Standard and Pakistan Building Code in accordance with previously reviewed design.



Figure 2.14 - No adequate automatic fire detection and alarm system at Main Building (Ground floor)

8.5 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building e.g. machine storage from workshop area & stitching at Main Building (1st floor), fabric store and bond rooms are not separated from finishing area at Ground floor , accessories store, finished goods storage and leftover store from cutting area.
- Presence of areas where storage does not meet miscellaneous in-process storage requirements (listed above) at Main Building (Ground & 1st floor).

Recommended remedial actions are provided below.F-202604-065798

Timeline	Remediation Plan
Medium Term CAP-0078290	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction).
Longer Term CAP-0078291	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard.



Figure 2.15 - storage does not meet miscellaneous in-process storage requirements at Main Building (1st floor)



Figure 2.16 - Fabric store is not separated from finishing area at Ground floor

9. Fire Suppression

9.1 Fire extinguishers

Extinguisher coverage and type of extinguishers used should comply with NFPA 10.

The following deficiencies have been observed on site, including (list not exhaustive):
- Poor condition of fire extinguishers (missing fire extinguisher seal)at Main Building (1st floor).

Recommended remedial actions are provided below.F-202604-065802

Timeline	Remediation Plan
Medium Term CAP-0078298	Ensure that all building areas are protected using fire extinguishers. The coverage and type of extinguishers used should follow NFPA 10.
Longer Term CAP-0078299	Monitor fire extinguishers for coverage and extinguisher type to comply with NFPA 10.



Figure 2.17 - Missing fire extinguisher seal at Main Building (1st floor)

10. Fire Safety Management

10.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- No regular fire drills.
- Fire drill documentation is of poor standard.

Recommended remedial actions are provided below.F-202604-065793

Timeline	Remediation Plan
Medium Term CAP-0078278	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0078279	Ensure fire drills are performed a minimum of 2 times per year.

10.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire extinguishers.
- No records of testing of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202604-065795

Timeline	Remediation Plan
Medium Term CAP-0078283	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0078284	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

10.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of maintenance of Fire Extinguishers.
-No records of maintenance of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202604-065800

Timeline	Remediation Plan
Medium Term CAP-0078294	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0078295	Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

10.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):
- An EAP document is available; however, It was poor & not as per Pakistan Accord Standard .
Recommended remedial actions are provided below.F-202604-065788

Timeline	Remediation Plan
Medium Term CAP-0078225	Prepare an Emergency Action Plan report.
Longer Term CAP-0078226	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

11. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.