Issue	**1**
Factory ID	**26207**
Date of Issue	**04-Jun-2026**

Arshad Corporation (Pvt.) Ltd. (Apparel Division)

4.5 KM Jaranwala Road, Khurrianwala
Faisalabad
Punjab Pakistan

Latitude: [31.471655], longitude: [73.309928]
Date of inspection: 21-Apr-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Haris Mahmood**
Reviewed by	**Qaseem Uz Zaman Khan**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 21-04-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 4
2. Building Extents 6
   2.1 Structural System 17
3. Documentation 20
4. Structural Safety Measures 21
5. Remediation Support 23
   5.1 Engineering Support 23
6. Other Damage/Defects 24
   6.1 Corrosion of reinforcement 24
   6.2 Health and Safety 25
7. Structural Documentation 26
   7.1 Documentation unavailable 26
   7.2 Lack of safe load plans 27
8. Assessment Limitations and Assumptions 28

1. Executive Summary

On 21-Apr-2026, Haris Mahmood and Muhammad Asim on behalf of the Pakistan Accord carried out an initial structural inspection for Arshad Corporation (Pvt.) Ltd. (Apparel Division), a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with Mr. Saleh Muhammad (Manager), Mr. Rizwan Akram (Deputy Manager – Electrical), Mr. Zeeshan Sajid (Compliance Officer), Mr. Muhammad Salman Sarwar (Civil Engineer) and other staff members of Arshad Corporation (Pvt.) Ltd. (Apparel Division). The assessment was conducted as a part of an overall Structural, Fire, and Electrical initial inspection.
The factory operates in single general shift. Factory employs approximately 500 workers with approximately 6% female representation.
The factory comprises of two main buildings and five ancillary structures owned by Arshad Corporation (Pvt.) Ltd (Apparel Division). During the inspection, the building highlighted in blue in Figure 1.1 were surveyed, whereas the area highlighted in red was restricted from access by the factory and could not be inspected. It has been confirmed that this deferred portion of the site will be covered in a subsequent initial inspection, with the site boundary indicated in red.

- **Main Building** is a two-storey (Ground + 1) building. The structural system of the building is RC moment resisting frame system. The part roof structural system of the building is unidirectional RC MRF supporting Precast girders and slab panels. The building is used for stitching, workshops, sample room and offices (First Floor), and offices, fabric store, cutting, accessory store, finishing and packing hall, warehouse, rest areas (Ground Floor). The construction year of the building was 2009, however, the first floor of the building was horizontally extended in 2021.
- **Canteen Building** is a single-storey (Ground Only) building. The structural system of the building is mainly load bearing brick masonry walls at periphery with internal RC columns supporting precast girders and slab panels. The building finishing works are ongoing, and its future intended use is dining area and kitchen (Ground Floor). The construction year of the building is 2026.
- **Ancillary Structures** consist of the following:
  - **Security Office** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting T-iron and brick slab. The structure is used for offices (Ground Floor). The construction year of the structure is 2021.
  - **Overhead Water Tank (OHWT)** is an elevated structure. The structural system comprises of RC MRF with RC retaining walls of water tank. The structure is used for water storage. The construction year of the structure is 2009.
  - **Office Block** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting T-iron and brick slab. The structure is used for offices, childcare room, female security room (Ground Floor). The construction year of the structure is 2021.
  - **Toilet Block 1** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting T-iron and brick slab. The structure is used for ladies / gents toilet (Ground Floor). The construction year of the toilet block 1 is 2021.
  - **Toilet Block 2** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting RC precast slab panels. The structure is used for gents toilet (Ground Floor). The construction year of the toilet block 2 is 2023.

We were presented with the incomplete site layout plan / approved layout and stability certificate of the factory. For further details, refer to Table 2 of the documentation of this report.
There is a health and safety concern including the lack of edge protection at roof level of main building, which should be addressed immediately. For further details, refer Section 6 of this report.
A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- The column dowel reinforcement is exposed to atmospheric corrosion at the roof level of Main Building
- Architectural and structural (As-Built) drawings were unavailable

We see no reason to suspend operations in the facility due to these concerns.
Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1: Building Summary

Building	Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / modifications	Engineer access issues
Main Building	Stitching, workshops, sample room, offices (First Floor) Offices, fabric store, cutting, accessory store, finishing and packing hall, warehouse, rest areas (Ground Floor)	Two (Ground+1)	2009	RC moment resisting frame system	Unidirectional RC MRF supporting Precast girders and slab panels	Partial first floor extension in 2021	-

Canteen Building		Dining area and kitchen (Ground Floor)	One (Ground Only)	2026	Load bearing brick masonry walls at periphery with internal RC columns supporting precast girders and slab panels	-	-	-
Ancillary Structures	Security Office	Offices (Ground Floor)	One (Ground Only)	2021	Load bearing brick masonry walls supporting T-iron and brick slab	-	-	-
	OHWT	Water storage (Elevated Water Tank)	One (Ground Only)	2009	RC MRF with RC retaining walls of water tank	-	-	-
	Office Block	Offices, child care room, female security room (Ground Floor)	One (Ground Only)	2021	Load bearing brick masonry walls supporting T-iron and brick slab	-	-	-

	Toilet Block 1	Ladies / gents toilet (Ground Floor)	One (Ground Only)	2021	Load bearing brick masonry walls supporting T-iron and brick slab	-	-	-
	Toilet Block 2	Gents toilet (Ground Floor)	One (Ground Only)	2023	Load bearing brick masonry walls supporting RC Slab precast slab panels	-	-	-



Figure 1.1. Satellite View of the Factory Premises

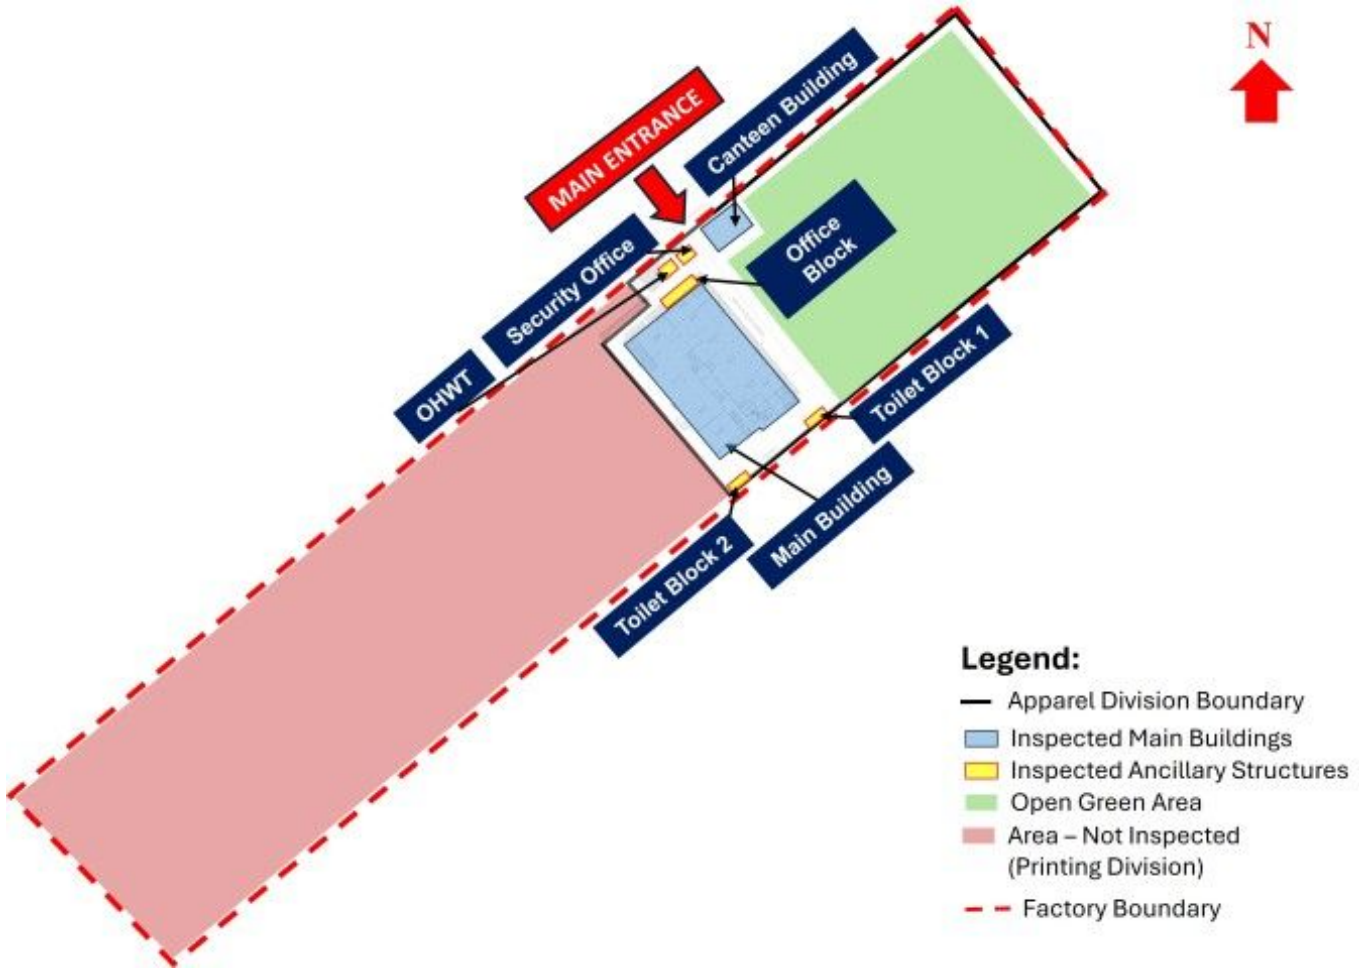


Figure 1.2. Site Layout of the Factory Premises



Figure 1.3. South East Elevation of Main Building



Figure 1.4. North East Elevation of Main Building



Figure 1.5. South West Elevation of Main Building



Figure 1.6. Front Elevation of Canteen Building



Figure 1.7. Front Elevation of Security Office



Figure 1.8. Front Elevation of OHWT



Figure 1.9. Front Elevation of Office Block



Figure 1.10. Front Elevation of Toilet Block 1



Figure 1.11. Front Elevation of Toilet Block 2



Figure 1.12. Stitching at First Floor of Main Building



Figure 1.13. Sampling at First Floor of Main Building



Figure 1.14. Electronics lab at First Floor of Main Building



Figure 1.15. Machinery workshop at First Floor of Main Building



Figure 1.16. Fabric Store at Ground Floor of Main Building



Figure 1.17. Cutting at Ground Floor of Main Building



Figure 1.18. Warehouse at Ground Floor of Main Building



Figure 1.19. Fabric Checking at Ground Floor of Main Building



Figure 1.20. Finishing and Packing at Ground Floor of Main Building



Figure 1.21. Ongoing finishing works at Ground Floor of Canteen Building



Figure 1.22. Office at Ground Floor of Security Office (Ancillary Structure)



Figure 1.23. Admin Office at Ground Floor of Office Block - Ancillary Structure



Figure 1.24. Childcare room at Ground Floor of Office Block - Ancillary Structure



Figure 1.25. Toilets at Toilet Block 1 - Ancillary Structure



Figure 1.26. Toilets at Toilet Block 2 - Ancillary Structure

2.1 Structural System

Building	Main Building
Stability system	RC moment resisting frame system
Column size (m)	0.350 x 0.350
Grid (m)	5.47 x 6.71
Primary beam size (m)	0.300 x 0.300
Secondary beam size (m)	-
Slab depth (m)	0.150 (Assumed)
Finishes depth (m)	0.100 (Assumed)
Ceiling height (m)	G to 1st Floor = 3.4 (Typical)

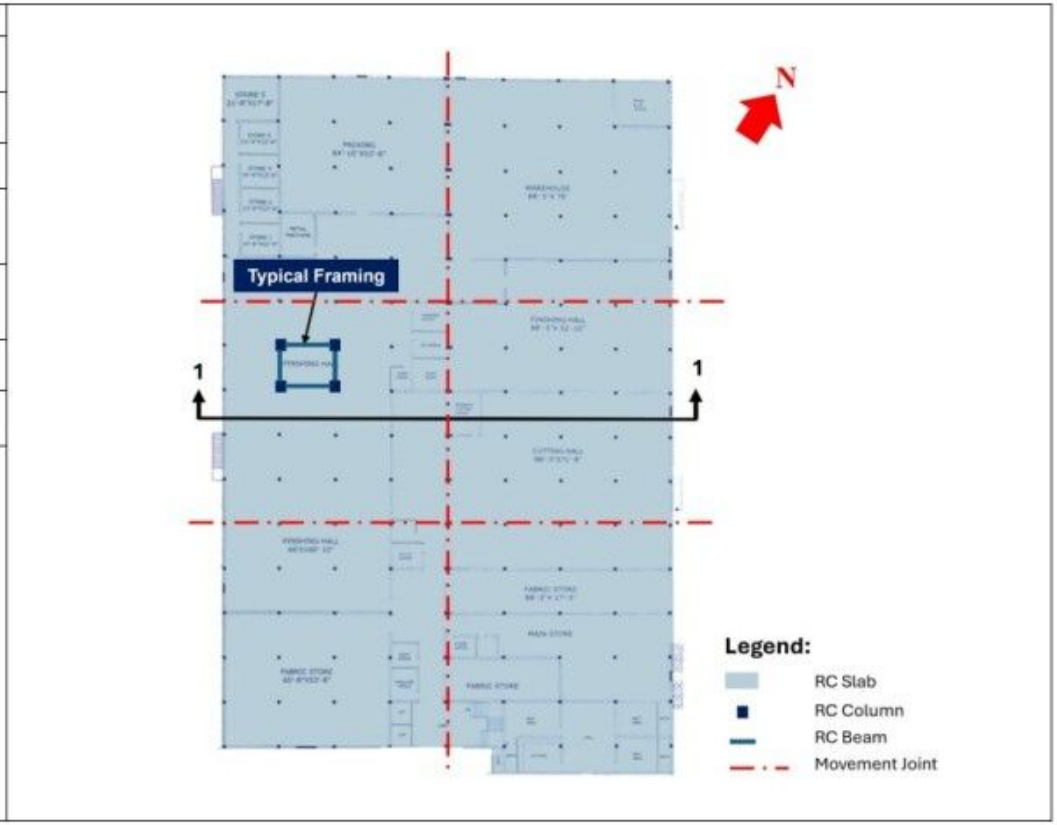


Figure 1.27. Ground Floor Framing Plan of Main Building

Building	Main Building
Stability system	RC moment resisting frame system, Uni-directional RC MRF supporting precast girders and slab panels
Column size (m)	0.350 x 0.350
Grid (m)	5.47 x 6.71
Primary beam size (m)	0.300 x 0.300 0.350 x 0.550 (In Precast slab panels area)
Secondary beam size (m)	-
Slab depth (m)	0.150 (Assumed)
Finishes depth (m)	0.100 (Assumed)
Ceiling height (m)	1st to Roof = 3.4, 3.8


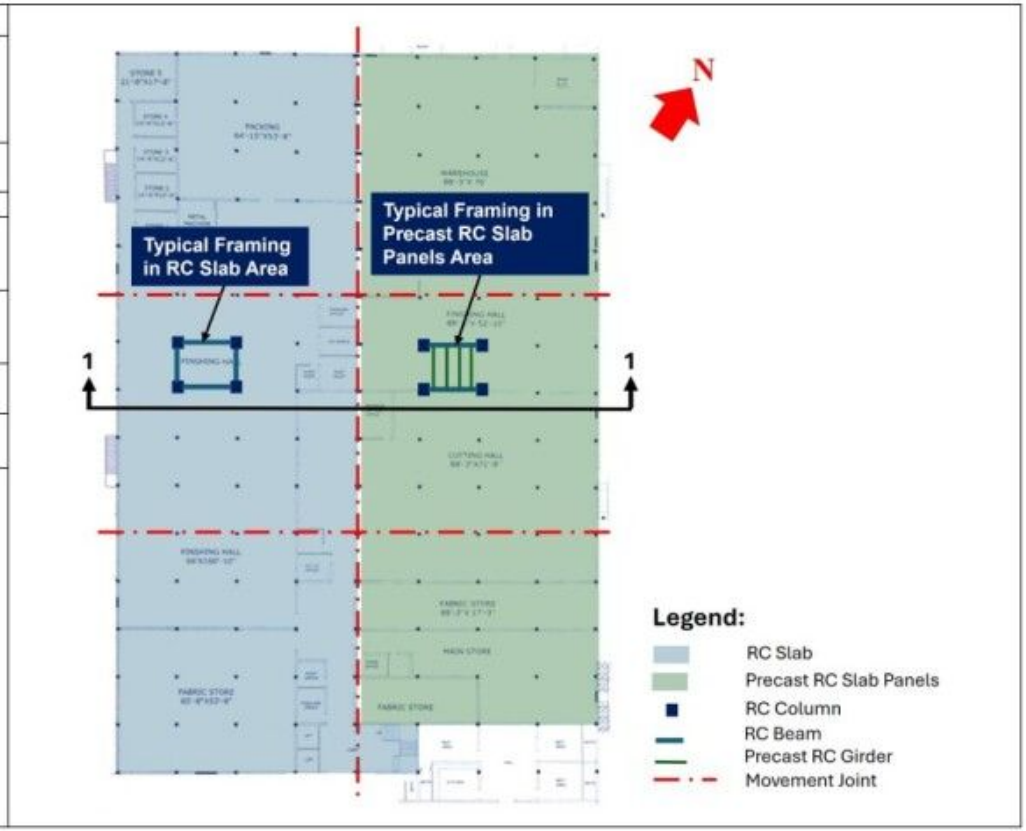


Figure 1.28. First Floor Framing Plan of Main Building

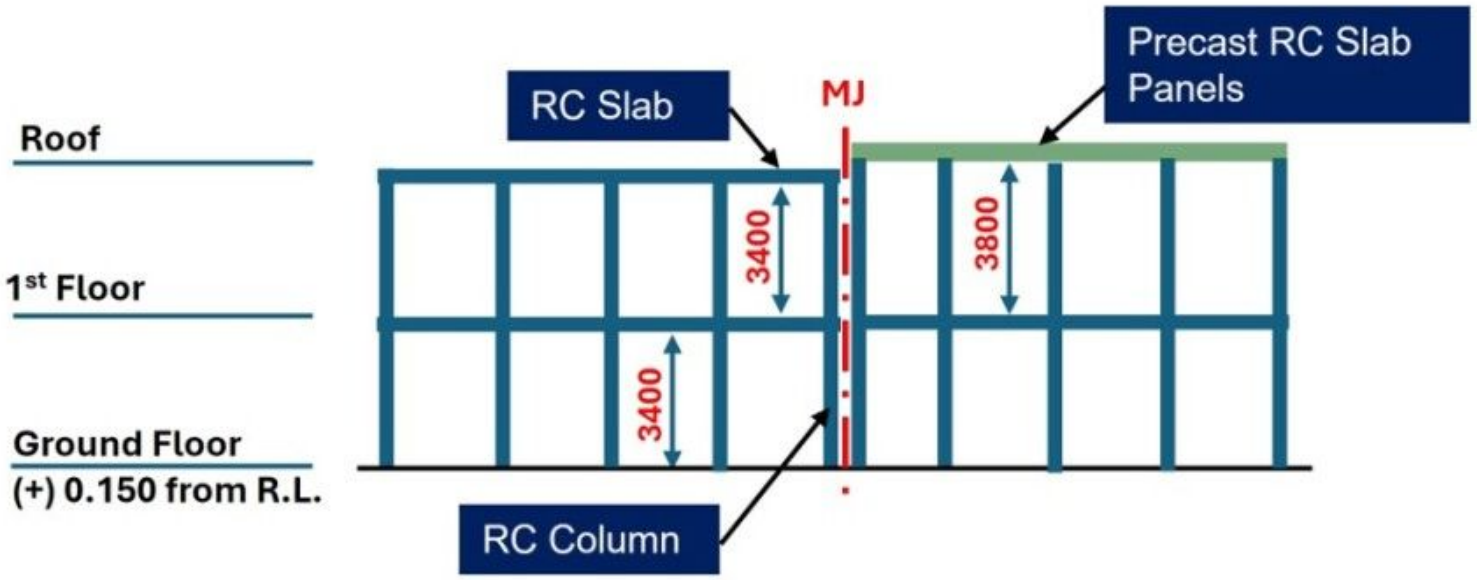

Structural System Notes

Column size is the structural dimension and excludes render thickness
Grid measurements are from centre of column to centre of column
Beam sizes do not include slab depth

Figure 1.29. Typical Section 1-1 of Main Building

3. Documentation

This table outlines the documentation details provided by the factory.

Table 2 – Documentation

Building		Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plans	Stability certificate	Inspection reports	Materials testing
Main Building		Yes (Incomplete)	Yes (Incomplete)	No	No	No	No	Yes	No	No
Canteen Building		Yes (Incomplete)	Yes (Incomplete)	No	No	No	No	No	No	No
Ancillary Structure	Security Office	Yes (Incomplete)	Yes (Incomplete)	No	No	No	No	No	No	No
	OHWT	Yes (Incomplete)	Yes (Incomplete)	No	No	No	No	No	No	No
	Office Block	Yes (Incomplete)	Yes (Incomplete)	No	No	No	No	No	No	No
	Toilet Block 1	Yes (Incomplete)	Yes (Incomplete)	No	No	No	No	No	No	No
	Toilet Block 2	Yes (Incomplete)	Yes (Incomplete)	No	No	No	No	No	No	No

4. Structural Safety Measures

During our structural site inspection of Arshad Corporation (Pvt.) Ltd. (Apparel Division), a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within Arshad Corporation (Pvt.) Ltd. (Apparel Division). Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3 Summary of issues by building:

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Main Building	-	-	-	-	Corrosion of Reinforcement Health and Safety – Lack of Edge Protection	Documentation Unavailable Lack of safe Load Plans
Canteen Building	-	-	-	-	-	Documentation Unavailable

Ancillary Structure	Security Office	-	-	-	-	-	Documentation Unavailable
	OHWT	-	-	-	-	-	Documentation Unavailable
	Office Block	-	-	-	-	-	Documentation Unavailable
	Toilet Block 1	-	-	-	-	-	Documentation Unavailable
	Toilet Block 2	-	-	-	-	-	Documentation Unavailable

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified Engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-066152

Timeline	Remediation Plan
Medium Term CAP-0078925	Factories should begin remediation of CAP items such as surface cracks or non-structural repairs using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Other Damage/Defects

6.1 Corrosion of reinforcement

The dowel reinforcement of the columns at the roof level of the main building has been significantly affected by atmospheric corrosion. This condition may compromise the structural integrity over time. F-202604-066156

Timeline	Remediation Plan
Medium Term CAP-0078927	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0078928	Implement the required remedial work.



Figure 2.1 - Location of corroded dowel reinforcement at roof of Main Building



Figure 2.2 - Corrosion of dowel reinforcement at roof of Main Building

6.2 Health and Safety

This refers to the Main Building.
Edge protection is not provided on the roof level of Main Building. Missing edge protection presents a risk of potential injury resulting from slip, trip or fall from the roof, while accessing and maintaining services on the roof. This is a Health and Safety Concern. F-202604-066153

Timeline	Remediation Plan
Immediate CAP-0078926	Provide adequate edge protection on the roof, and on any other part of the factory with the same issue.

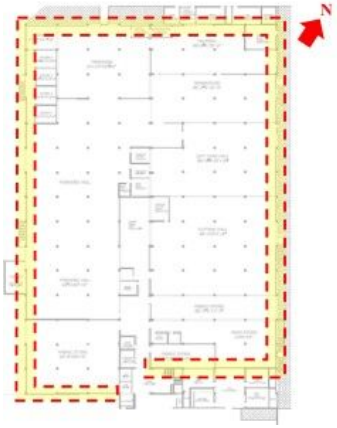


Figure 2.3 - Missing edge protection location at roof of Main Building



Figure 2.4 - Missing edge protection at roof of Main Building

7. Structural Documentation

7.1 Documentation unavailable

Following documents were unavailable:

- As-Built Architectural drawings of all the buildings (Main buildings and ancillary structures).
- As-Built Structural Drawings of all the buildings (Main buildings and ancillary structures). F-202604-066154

Timeline	Remediation Plan
Longer Term CAP-0078929	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete As-Built documentation.

7.2 Lack of safe load plans

No safe load plans were posted on the first floor of main building. F-202604-066155

Timeline	Remediation Plan
Longer Term CAP-0078930	Building Structural Engineer to review design documentation to confirm the load capacity of the structure.
Longer Term CAP-0078931	Develop safe load plans and submit to Pakistan Accord for review.
Longer Term CAP-0078932	Factory to post safe load plans on each floor.

8. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.