Issue	**1**
Factory ID	**25796**
Date of Issue	**30-Jan-2026**

Ebrahim Textile Mills Ltd.

Plot No. HX-2, Landhi Industrial Area
Karachi
Sindh Pakistan
Latitude: [24.840655], longitude: [67.239885]

Boiler Safety Inspection Report

Observations & Actions



Authors	Ibrar Ahmed
Reviewed by	Burkhard Hammel
Approved by	Paul Rigby

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 4
2. Boiler Data 6
2.1. Engineer Information 6
2.2. Operator Information 6
2.3. Boilers 7
3. Inspection Results Boiler: 33/358 10
3.1. External Visual Inspection 10
3.2. Internal Inspection & Hydrostatic Pressure Test 23
4. Inspection Results Boiler: S-3817 27
4.1. External Visual Inspection 27
4.2. Internal Inspection & Hydrostatic Pressure Test 34
5. Inspection Results Boiler: S-3964 37
5.1. External Visual Inspection 37
5.2. Internal Inspection & Hydrostatic Pressure Test 44
6. Assessment Limitations and Assumptions 48

1. Executive Summary

The inspection process was divided into two distinct parts. Firstly, an external visual inspection, an internal inspection and hydrostatic pressure test (commonly referred to as a hydrotest) inspection was conducted to assess the overall safety and structural integrity of the boiler. Sufficient time was allocated to allow the factory to prepare for the final inspection stage, which involved a functional test inspection. This stage required the boiler to be operational to enable the inspection team to verify the functionality of different safety circuits.

Inspection Date	Inspection completed	Accord Engineers	Factory Representatives	Results
2025-05-13	Boiler - External Visual Inspection	Ibrar Ahmed	Aqeel Mohsin Ms. Sidra Syed Hurr	The boiler safety inspection found that Boiler S-3817, Boiler 33/358, and Boiler S-3964 are in operable condition, but a few issues - outlined in this report, are to be addressed in a timely manner.
2025-10-22	Boiler - Internal Inspection & Hydrostatic Pressure Test	Ibrar Ahmed Malik Adil Ishaque Mirani	Aqeel Mohsin Ms. Sidra Syed Hurr	The boiler safety inspection found that Boiler 33/358, Boiler S-3817, and Boiler S-3964 are in operable condition, but a few issues - outlined in this report, are to be addressed in a timely manner.

Boiler Registration Number	External visual inspection		Internal & Hydrotest inspection		Functional test inspection	
	Date	Remarks	Date	Remarks	Date	Remarks
S-3817	2025-05-13	The external visual inspection did not result in any major non-conformity.	2025-11-04	None		
33/358	2025-05-21	The external visual inspection did not result in any major non-conformity.	2025-10-23	None		
S-3964	2025-05-13	The external visual inspection did not result in any major non-conformity.	2025-10-22	None		

4-25796						

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each boiler/steamer/steam generator issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Boiler Data

The following data table(s) summarizes important information regarding the respective boiler(s).

The maker's technical documentation has been prioritized among all available sources in case of conflicting information.

2.1. Engineer Information

Engineer	Certificate Number	Class / Grade
Anees Abbas	D-008	1st Class

2.2. Operator Information

Operator	Certificate Number	Class / Grade
Muhammad Ashraf	130/92	2nd Class
Saleem Raza	225	2nd Class
Saghir Ahmed	26602	2nd Class
Muhammad Shafique	002	1st Class
Shahid Mehmood	26001	3rd Class

2.3. Boilers

2.3.1. Boiler 33/358

Boiler Maker No.	Q-33/358	Heating Surface	224 m^2
CIoB Registration No.	33/358	Owner Details	Ebrahim Textile Mills Ltd.
Installation Location	Ebrahim Textile Mills Ltd.		
Boiler Manufacturer	Not Available	Boiler Type	Water Tube Boiler
Manufacturer's Serial No.	Not Available	Boiler Capacity	10000 kg/hr
Maximum Allowable Pressure	12.5 Bar	Country of Origin	China
		Design Standard	Chinese Standard (CNS)
Manufacturing Year	2009	Installation Year	2024
Heating Source	Solid fuel (biomass)	Feed Water Treatment	RO Water
		Manufacturer's Nameplate	Not Available
Construction Drawing	Not Available	Electrical Wiring Diagram	Not Available

2.3.2. Boiler S-3817

Boiler Maker No.	Not Available	Heating Surface	128 m^2
CIoB Registration No.	S-3817	Owner Details	Ebrahim Textile Mills Ltd.
Installation Location	Ebrahim Textile Mills Ltd.		
Boiler Manufacturer	Cannon Bono Energia	Boiler Type	Fire Tube Boiler - Wet Back
Manufacturer's Serial No.	Not Available	Boiler Capacity	15000 kg/hr
Maximum Allowable Pressure	12.0 Bar	Country of Origin	Italy
		Design Standard	European Standard (EN)
Manufacturing Year	2020	Installation Year	2022
Heating Source	Gas fuel (natural gas)	Feed Water Treatment	RO Water
		Manufacturer's Nameplate	Available
Construction Drawing	Available	Electrical Wiring Diagram	Available

2.3.3. Boiler S-3964

Boiler Maker No.	Not Available	Heating Surface	243 m^2
CIoB Registration No.	S-3964	Owner Details	Ebrahim Textile Mills Ltd.
Installation Location	Ebrahim Textile Mills Ltd.		
Boiler Manufacturer	Razzaq Associates	Boiler Type	Waste Heat Recovery Boiler
Manufacturer's Serial No.	Not Available	Boiler Capacity	1717 kg/hr
Maximum Allowable Pressure	12.0 Bar	Country of Origin	Pakistan
		Design Standard	ASME BPVC
Manufacturing Year	2021	Installation Year	2021
Heating Source	Exhaust Gas fuel	Feed Water Treatment	RO Water
		Manufacturer's Nameplate	Available
Construction Drawing	Available	Electrical Wiring Diagram	Available

3. Inspection Results Boiler: 33/358

3.1. External Visual Inspection

Inspection Date	Boiler Registration Number	Report Author
2025-05-21	33/358	Ibrar Ahmed

3.1.1. Inspection Conducted

Any major repair done:	No

3.1.2. Results of Inspection

The external visual inspection did not result in any major non-conformity.

Remarks:

None

3.1.3. Findings and Recommendations

Finding No	F-202509-022868
Category	Air vent
Subcategory	Exhaust Pipe
Boiler Reg. Number	33/358
Observation	Air vent valve exhaust pipeline height was insufficient.

CAP No	Recommendation	Priority	Timeframe
B13 - CAP-0031116	Air vent valve exhaust pipeline must be extended to a safe location with a minimum height of 6 feet, ensuring safe discharge away from the boiler and working area.	P1	1 week



Figure 1 - Air vent valve

Finding No	F-202509-022885
Category	Documentation
Subcategory	Technical Documents
Boiler Reg. Number	33/358
Observation	Technical documents were not available regarding design and operation parameters.

CAP No	Recommendation	Priority	Timeframe
B7 - CAP-0031133	Documentation including manufacturing drawings and calculations, Piping and Instrumentation diagram, electrical wiring diagram, commissioning documents, data sheets of mountings, accessories, and feedwater pump, boiler operational and maintenance logbook, operation and maintenance manual, water treatment design and calculation, flue gas analysis report and water treatment report shall be available to verify the present condition of the boiler.	P2	2 months

Finding No	F-202509-022886
Category	Documentation
Subcategory	Nameplate
Boiler Reg. Number	33/358
Observation	No Manufacturer Data Plate was found at the Boiler.

CAP No	Recommendation	Priority	Timeframe
B8 - CAP-0031134	The manufacture nameplate should be available which indicates its working pressure, capacity, manufacturing Year, Installation Year, hydrostatic test pressure, and design standard.	P2	2 months



Figure 2 - Boiler manufacturer data plate.

Finding No	F-202509-022887
Category	Electrical wiring system
Subcategory	Emergency Shutdown Button
Boiler Reg. Number	33/358
Observation	No emergency push button was installed on control panel.

CAP No	Recommendation	Priority	Timeframe
B9 - CAP-0031135	Emergency push button must be installed on control panel.	P1	1 week



Figure 3 - Electrical control panel

Finding No	F-202509-022865
Category	Monitoring and Controlling
Subcategory	Labelling and Marking
Boiler Reg. Number	33/358
Observation	Marking of critical low water level, low water level, and high water level was not found on boiler water level gauge glass.

CAP No	Recommendation	Priority	Timeframe
B10 - CAP-0031113	Critical low water level, low water level, and high water level must be marked and labelled on boiler water level gauge glass.	P2	1 month



Figure 4 - Water level gauge glass

Finding No	F-202509-022866
Category	Safety valve
Subcategory	Exhaust Line
Boiler Reg. Number	33/358
Observation	Safety valve exhaust pipeline height was insufficient.

CAP No	Recommendation	Priority	Timeframe
B11 - CAP-0031114	Safety valve exhaust pipeline must be extended to a safe location with a minimum height of 6 feet, ensuring safe discharge away from the boiler and working area.	P1	1 week



Figure 5 - Pressure safety valve

Finding No	F-202509-022867
Category	Safety valve
Subcategory	Calibration Tag
Boiler Reg. Number	33/358
Observation	The calibration tag was missing on the safety valve.

CAP No	Recommendation	Priority	Timeframe
B12 - CAP-0031115	Get the safety valve calibrated by an authorized testing agency.	P2	1 month



Figure 6 - Pressure safety valve

Finding No	F-202509-022873
Category	Support and access
Subcategory	Railing
Boiler Reg. Number	33/358
Observation	It was observed that the staircase provided for access to the boiler platform is not equipped with handrail and guardrail.

CAP No	Recommendation	Priority	Timeframe
B18 - CAP-0031121	it must be installed handrail and guardrail on the boiler access stairs to ensure safe access and prevent fall related accidents	P2	2 months



Figure 7 - Handrail and guardrail.

Finding No	F-202509-022872
Category	Thermal Insulation
Subcategory	Blow down line
Boiler Reg. Number	33/358
Observation	Insulation was found missing damaged on blowdown line.

CAP No	Recommendation	Priority	Timeframe
B17 - CAP-0031120	Insulation must be installed on blowdown line .	P2	1 month



Figure 8 - Blow down lines.

Finding No	F-202509-022869
Category	Safety Guards
Subcategory	Chain Sprocket Drive
Boiler Reg. Number	33/358
Observation	Safeguard was not installed on ash conveyor chain sprocket drive.

CAP No	Recommendation	Priority	Timeframe
B14 - CAP-0031117	Safeguard must be installed on ash conveyor chain sprocket drive.	P1	1 week



Figure 9 - Safety guard.

Finding No	F-202509-022870
Category	Safety Guards
Subcategory	Belt and Pulley Mechanism
Boiler Reg. Number	33/358
Observation	Safeguard was not installed on chain grate conveyor pulley belt drive.

CAP No	Recommendation	Priority	Timeframe
B15 - CAP-0031118	Safeguard must be installed on chain grate conveyor pulley belt drive.	P1	1 week



Figure 10 - Safety guard.

Finding No	F-202509-022871
Category	Safety Guards
Subcategory	Coupling Guard
Boiler Reg. Number	33/358
Observation	Safeguard was not installed on feedwater pump coupling.

CAP No	Recommendation	Priority	Timeframe
B16 - CAP-0031119	Safeguard must be installed on feedwater pump coupling	P1	1 week



Figure 11 - Safety guard

3.2. Internal Inspection & Hydrostatic Pressure Test

Inspection Date	Boiler Registration Number	Report Author
2025-10-23	33/358	Ibrar Ahmed

3.2.1. Inspection Conducted

Water/steam side was inspected through the	Manhole, handholes, mudholes, and other available inspection openings
Fire / smoke side was inspected through the openings by	other available openings and doors
Hydro Static Pressure Test witnessed	18.75 bar
Hydro Test Pressure Standing Time	15.0 minutes
1st safety valve was activated at	9.5 bar
2nd safety valve was activated at	9.0 bar

3.2.2. Results of Inspection

Boiler internal inspection result	Satisfactory
Boiler hydrostatic pressure test result	Satisfactory
Condition of internal scale formation	Satisfactory
Condition of welding joints	Satisfactory
Shell and tube metal thickness	Satisfactory
Leakage observed from fireside pressure parts?	No

Deformations observed in the inspected areas inside the boiler?	No
Safety valve 1 pressure test result	Satisfactory
Safety valve 2 pressure test result	Satisfactory
Outcome	No objection to operate the boiler
Remarks None	

3.2.3. Findings and Recommendations

Finding No	F-202512-042141
Category	Water Side
Subcategory	Corrosion
Boiler Reg. Number	33/358
Observation	Corrosion traces was found on lower drum from water side.

CAP No	Recommendation	Priority	Timeframe
B25 - CAP-0051649	Improve feedwater treatment and increase oxygen scavengers feeding by consulting chemical supplier.	P2	1 month



Figure 12 - Corrosion from water side

4. Inspection Results Boiler: S-3817

4.1. External Visual Inspection

Inspection Date	Boiler Registration Number	Report Author
2025-05-13	S-3817	Ibrar Ahmed

4.1.1. Inspection Conducted

Any major repair done:	No

4.1.2. Results of Inspection

The external visual inspection did not result in any major non-conformity.

Remarks:

None

4.1.3. Findings and Recommendations

Finding No	F-202509-022882
Category	Air vent
Subcategory	Exhaust Pipe
Boiler Reg. Number	S-3817
Observation	No air vent valve exhaust pipeline.

CAP No	Recommendation	Priority	Timeframe
B4 - CAP-0031130	Air vent valve exhaust pipeline must be installed and safely routed towards outside of boiler room and at a safe location.	P1	1 week



Figure 13 - Air vent valve

Finding No	F-202509-022884
Category	Fuel system
Subcategory	Gas Circuit
Boiler Reg. Number	S-3817
Observation	Unprotected open connection was found in gas line.

CAP No	Recommendation	Priority	Timeframe
B6 - CAP-0031132	Any gas line openings in boiler room shall be diverted outside of the boiler room or sealed off with a blind plug/ blind flange to prevent fuel leakage.	P1	1 week



Figure 14 - Gas line

Finding No	F-202509-022864
Category	Monitoring and Controlling
Subcategory	Labelling and Marking
Boiler Reg. Number	S-3817
Observation	Marking of low water level, and high water level was not found on boiler water level gauge glass.

CAP No	Recommendation	Priority	Timeframe
B1 - CAP-0031112	Low water level, and high water level must be marked and labelled on boiler water level gauge glass.	P2	1 month

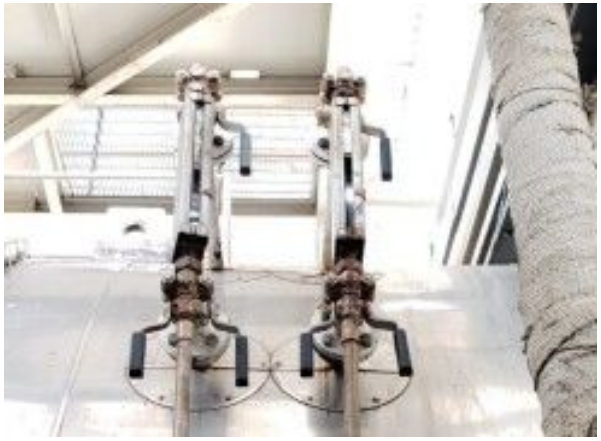


Figure 15 - Water level gauge glass

Finding No	F-202509-022875
Category	Safety valve
Subcategory	Drain Line
Boiler Reg. Number	S-3817
Observation	No drain line was found on safety valve.

CAP No	Recommendation	Priority	Timeframe
B2 - CAP-0031123	Drain line must be installed on safety valve as per standard.	P1	1 week



Figure 16 - Pressure safety valve

Finding No	F-202509-022881
Category	Safety valve
Subcategory	Exhaust Line
Boiler Reg. Number	S-3817
Observation	Safety valve exhaust pipeline was found inside the boiler room.

CAP No	Recommendation	Priority	Timeframe
B3 - CAP-0031129	Safety valve exhaust pipeline must be routed towards outside of boiler room, and it must be discharge at a safe location.	P1	1 week



Figure 17 - Pressure safety valve

Finding No	F-202509-022883
Category	Safety Guards
Subcategory	Coupling Guard
Boiler Reg. Number	S-3817
Observation	Safeguard was not installed on feedwater pump coupling.

CAP No	Recommendation	Priority	Timeframe
B5 - CAP-0031131	Safeguard must be installed on feedwater pump coupling.	P1	1 week



Figure 18 - Feed water pump

4.2. Internal Inspection & Hydrostatic Pressure Test

Inspection Date	Boiler Registration Number	Report Author
2025-11-04	S-3817	Ibrar Ahmed

4.2.1. Inspection Conducted

Water/steam side was inspected through the	Manhole, handholes, mudholes, and other available inspection openings
Fire / smoke side was inspected through the openings by	other available openings and doors
Hydro Static Pressure Test witnessed	15.0 bar
Hydro Test Pressure Standing Time	15.0 minutes
1st safety valve was activated at	8.9 bar
2nd safety valve was activated at	8.4 bar

4.2.2. Results of Inspection

Boiler internal inspection result	Satisfactory
Boiler hydrostatic pressure test result	Satisfactory
Condition of internal scale formation	Satisfactory
Condition of welding joints	Satisfactory
Shell and tube metal thickness	Satisfactory
Leakage observed from fireside pressure parts?	No

Deformations observed in the inspected areas inside the boiler?	No
Safety valve 1 pressure test result	Satisfactory
Safety valve 2 pressure test result	Satisfactory
Outcome	No objection to operate the boiler
Remarks	None

4.2.3. Findings and Recommendations

5. Inspection Results Boiler: S-3964

5.1. External Visual Inspection

Inspection Date	Boiler Registration Number	Report Author
2025-05-13	S-3964	Ibrar Ahmed

5.1.1. Inspection Conducted

Any major repair done:	No

5.1.2. Results of Inspection

The external visual inspection did not result in any major non-conformity.

Remarks:

None

5.1.3. Findings and Recommendations

Finding No	F-202509-022878
Category	Air vent
Subcategory	Exhaust Pipe
Boiler Reg. Number	S-3964
Observation	Air vent valve exhaust pipeline height was insufficient.

CAP No	Recommendation	Priority	Timeframe
B22 - CAP-0031126	Air vent valve exhaust pipeline must be extended to a safe location with a minimum height of 6 feet, ensuring safe discharge away from the boiler and working area.	P1	1 week



Figure 19 - Air vent valve

Finding No	F-202509-022874
Category	Monitoring and Controlling
Subcategory	Labelling and Marking
Boiler Reg. Number	S-3964
Observation	Marking of critical low water level, low water level, and high water level was not found on boiler water level gauge glass.

CAP No	Recommendation	Priority	Timeframe
B19 - CAP-0031122	Critical low water level, low water level, and high water level must be marked and labelled on boiler water level gauge glass.	P2	1 month



Figure 20 - Water level gauge glass

Finding No	F-202509-022877
Category	Safety valve
Subcategory	Exhaust Line
Boiler Reg. Number	S-3964
Observation	Safety valve exhaust pipeline height was insufficient.

CAP No	Recommendation	Priority	Timeframe
B21 - CAP-0031125	Safety valve exhaust pipeline must be extended to a safe location with a minimum height of 6 feet, ensuring safe discharge away from the boiler and working area.	P1	1 week



Figure 21 - Pressure safety valve

Finding No	F-202509-022876
Category	Safety valve
Subcategory	Calibration Tag
Boiler Reg. Number	S-3964
Observation	The calibration tag was missing on the safety valve.

CAP No	Recommendation	Priority	Timeframe
B20 - CAP-0031124	Get the safety valve calibrated by an authorized testing agency.	P2	1 month



Figure 22 - Pressure safety valve

Finding No	F-202509-022880
Category	Steam distribution system
Subcategory	Safety Valve
Boiler Reg. Number	S-3964
Observation	Steam header was found without safety valve.

CAP No	Recommendation	Priority	Timeframe
B24 - CAP-0031128	Install safety valve on steam header and safely route its exhaust lines towards outside of the boiler area.	P2	1 month



Figure 23 - Steam distribution system

Finding No	F-202509-022879
Category	Thermal Insulation
Subcategory	Blow down line
Boiler Reg. Number	S-3964
Observation	Insulation was found missing on blowdown line.

CAP No	Recommendation	Priority	Timeframe
B23 - CAP-0031127	Insulation must be installed on blowdown line .	P2	1 month



Figure 24 - Boiler blowdown line.

5.2. Internal Inspection & Hydrostatic Pressure Test

Inspection Date	Boiler Registration Number	Report Author
2025-10-22	S-3964	Ibrar Ahmed

5.2.1. Inspection Conducted

Water/steam side was inspected through the	Manhole, handholes, mudholes, and other available inspection openings
Fire / smoke side was inspected through the openings by	other available openings and doors
Hydro Static Pressure Test witnessed	15.0 bar
Hydro Test Pressure Standing Time	15.0 minutes
1st safety valve was activated at	10.2 bar
2nd safety valve was activated at	9.6 bar

5.2.2. Results of Inspection

Boiler internal inspection result	Satisfactory
Boiler hydrostatic pressure test result	Satisfactory
Condition of internal scale formation	Satisfactory
Condition of welding joints	Satisfactory
Shell and tube metal thickness	Satisfactory
Leakage observed from fireside pressure parts?	No

Deformations observed in the inspected areas inside the boiler?	No
Safety valve 1 pressure test result	Satisfactory
Safety valve 2 pressure test result	Satisfactory
Outcome	No objection to operate the boiler but the findings shall be remediated within the provided time frame
Remarks	None

5.2.3. Findings and Recommendations

Finding No	F-202510-027924
Category	Combustion system
Subcategory	Refractory
Boiler Reg. Number	S-3964
Observation	The refractory inlet chamber was damaged, which can lead to heat loss, reduced efficiency, and potential structural damage to the boiler.

CAP No	Recommendation	Priority	Timeframe
B26 - CAP-0036598	Repair or replace the damaged refractory to ensure proper heat retention, protect boiler components, and maintain operational efficiency.	P2	2 months



Figure 25 - Inlet chamber refractory

6. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the boilers / steamers / steam generators which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.