Issue	**01**
Factory ID	**25796**
Date of Issue	**29-Jul-2025**

Ebrahim Textile Mills

PLOT HX2,ZONE 2LANDHI INDUSTRIAL AREA KARACHI
Karachi
Sindh Pakistan

Latitude: [24.840655], longitude: [67.239885]
Date of inspection: 13-May-2025

Structural Safety Inspection Report

Observations & Actions



Authors	**Qaseem Uz Zaman Khan**
Reviewed by	**Talha Akram**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 13-05-2025 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Contents

1. Executive Summary 5
2. Building Extents 7
   2.1 Structural System 19
3. Documentation 28
4. Structural Safety Measures 29
5. Cracking 31
   5.1 Column 31
6. Other Damage/Defects 34
   6.1 Spalling concrete 34
   6.2 Spalling concrete 35
   6.3 Spalling concrete 37
   6.4 Column impact damage 39
   6.5 Column impact damage 41
   6.6 Excessive deflection or vibration 43
   6.7 Health and Safety 44
7. Structural Documentation 45
   7.1 Documentation unavailable 45
   7.2 Lack of safe load plans 46
8. Assessment Limitations and Assumptions 47

1. Executive Summary

On 13-May-2025, Qaseem Uz Zaman Khan and Muhammad Hasaan Tabassum on behalf of the Pakistan Accord carried out an initial structural inspection for Ebrahim Textile Mills, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Syed Hurr (Sr Manager Compliance), Mr. Aqeel Mohsin (G.M Engineering), Mr. Jamil Hussain (Electrical Manager), Mr Khobaib Javaid (Manager Civil) and other staff members of Ebrahim Textile Mills (Pvt) Ltd. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection.

The factory operates with one general shift and three shifts for processing only. Approximately 1380 workers (peak occupants) operate in the single shift of the factory. Factory employs 1380 workers out of which approximately 2% employees are female.

The factory comprises 6 buildings owned by Ebrahim Textile Mills (Pvt) Ltd. During the inspection, the buildings highlighted in Figure 1.1 were surveyed, with the site boundary indicated in red.The building highlighted with green in figure 1.1 was not inspected during the initial inspection. This building shall be included in future follow-up inspections.

- **Building 1-** a 1-storey and 2-storeys (Ground only and Ground + 1) multiple structures consists of RC moment resisting frame (MRF) and Steel Frame with masonry infill walls. The building is used for admin HR, godowns, chemical godown, warehouse, workshops, carton godowns (ground floor) and 1st floor of the building was empty at the time of inspection. The building was constructed in 1991.
- **Building 2-** • a 1-storey and 2-storeys (Ground only and Ground + 1) multiple structures consists of RC moment resisting frame, Steel truss and Precast Girder with asbestos sheets resting on RC moment resisting frame with masonry infill walls. The building is used for, marketing office (1st floor) and digital printing, embroidery, main store, local folding, masjid, workshops (ground floor). The building was constructed in 1991.
- **Building 3-** a 1-storey (Ground only) multiple structures consist of RC moment resisting frame and Precast Girder slab resting on RC moment resisting frame with masonry infill walls. The building is used for greige department and engineering offices (ground floor). The building was constructed in 1991.
- **Building 4-** is a 1-storey (Ground only) RC moment resisting frame with inverted beams at roof and masonry infill walls. The building is used for stitching and warehouse (ground floor). The year of construction of the building is 1991.
- **Building 5-** is consists of 5 different structures which are interconnected at ground level such that you can move freely between them. A part of the building extended horizontally in 2013 and vertically in 2022.
- **Structure 1** – 1-storey (Ground only) RC half shell structure, used for processing, folding, storage (ground floor). The building was constructed in 1991.
- **Structure 2** – 1-storey (Ground only) Steel Portal frame, used for washing and storage (ground floor). The building was constructed in 1991.
- **Structure 3** – 1-storey (Ground only) RC MRF structure and Precast slab resting on RC MRF, used for bleaching and labs (ground floor). The

building was constructed in 1991.

- **Structure 4** - 6-storey (G+M+4) RC moment frame building with masonry infill walls and roof is vertically extended with Steel portal frame, is used for cutting (4th floor), stitching (3rd and 2nd floor), engraving (1st floor), FGS storage (mezzanine) and processing and folding (ground floor). The building was constructed in 2013.
- **Structure 5** - 2-storeys (Ground +1) RC MRF and Steel portal frame structure is used for quilting (1st floor) and cutting (ground floor). The building was constructed in 1991.
- **Building 6-** is consist of 2 different structures.
- **Structure 1**- a 1-storey (Ground only) RC moment resisting frame with masonry infill walls. The building is used for local processing (ground floor). The building was constructed in 1991
- **Structure 2**- a 1-storey (Ground only) Steel Portal frame structure. The building is used for local processing (ground floor). The building was constructed in 2018.

We were presented with site layout and as-built Architectural drawings of all the buildings. Further details on documentation are provided in Table 2.

There are two health and safety issues that requires immediate attention one is related to inadequate edge protection around stairs for staff accessing the floor of the building 5 (Structure 4) and other is related to use asbestos sheets which is used as roofing material in building 2. There are health risks to people if any mishandling appears.

A summary of the main concerns identified during the inspection includes (non-exhaustive):

- Cracking in multiple columns was observed at multiple locations and levels in Building 1.
- Spalling of slab concrete was observed in Building 1, Building 5 (Structure 1 and 3) and Building 6.
- Visible deflection was observed in steel truss in workshop area of Building 2.

We see no reason to suspend operations in the facility due to these concerns. Actions with associated priorities and timeframes are given in the detailed section of this report. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.
Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1: Building Summary

Building	Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / modifications	Engineer access issues
Building 1	Empty (1st floor) and admin HR, godowns, chemical godown, warehouse, workshops, carton godowns (ground floor)	1-storey and 2-storeys (Ground only and Ground + 1)	1991	RC MRF and Steel Frame	-	-	-
Building 2	Marketing office (1st floor) and digital printing, embroidery, main store, local folding, masjid, workshops (ground floor)	1-storey and 2-storeys (Ground only and Ground + 1)	1991	RC Moment Resisting Frame, Steel Truss and Precast Girder with asbestos sheets	-	-	-

Building 3		Greige department and engineering offices (ground floor)	1-storey Ground only	1991	RC Moment Resisting Frame and Precast Girder slab	-	-	-
Building 4		Stitching and warehouse (ground floor)	1-storey Ground only	1991	RC moment resisting frame	RC inverted Beams	-	Roof of the building
Building 5	Structure 1	Processing, folding, storage (ground floor)	1-storey Ground only	1991	RC Half Shell Structure	-	Yes (Structure 4) Horizontally (RC MRF) in 2013 and vertically (RC MRF and Steel Portal Frame) in 2022.	-
	Structure 2	Washing and storage (ground floor).	1-storey Ground only	1991	Steel Portal frame	-		-
	Structure 3	Bleaching and labs (ground floor)	1-storey Ground only	1991	RC MRF structure and Precast slab resting on RC MRF	-		-

	Structure 4	Cutting (4th floor), stitching (3rd and 2nd floor), engraving (1st floor), fgs storage (mezzanine) and processing and folding (ground floor)	6-storey (G+M+4)	2013	RC MRF	Steel Portal frame		-
	Structure 5	Quilting (1st floor) and cutting (ground floor).	2-storeys (Ground+1)	1991	RC MRF and Steel portal frame	Steel portal frame		-
Building 6	Structure 1	Local processing (ground floor)	1-storey Ground only	1991	RC MRF	-	Yes (Structure 2) steel shed (Steel Portal Frame) in 2018 and 2021.	-
	Structure 2	Local processing (ground floor)	1-storey Ground only	2018	Steel portal frame	-		-



Figure 1.1. Site plan (Satellite view) Red dashed line indicates site boundary, and Yellow dashed line indicates building boundaries, highlighted (blue) area indicates buildings inspected and highlighted (green) will inspect in future follow-up inspection.

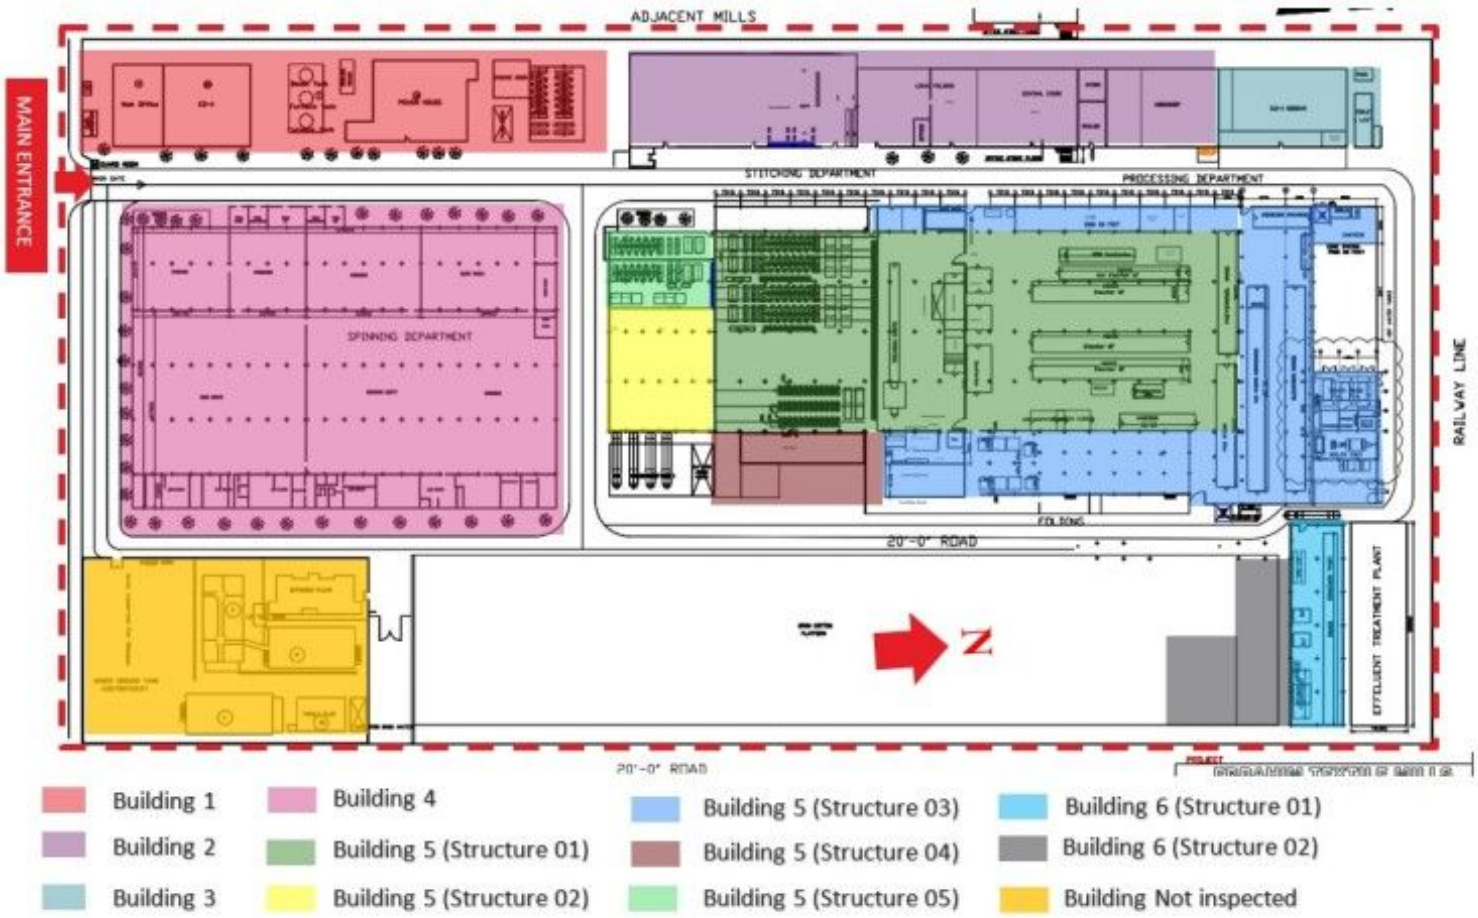


Figure 1.2. Site layout. Red dashed line indicates site boundary.



Figure 1.3. Building 1-Elevation of the building



Figure 1.4. Building 2-Elevation of the building



Figure 1.5. Building 3-Elevation of the building



Figure 1.6. Building 4-Elevation of the building.



Figure 1.7. Building 5 (Structure 4)-Elevation of the building



Figure 1.8. Building 6-Elevation of the building



Figure 1.9. Building 1 (Area A)-Typical activity at 1st floor



Figure 1.10. Building 1 (Area A)-Typical activity at ground floor



Figure 1.11. Building 1 (Area B)-Typical activity at ground floor



Figure 1.12. Building 1 (Area C)-Typical activity at ground floor



Figure 1.13. Building 2 -Typical activity at 1st floor



Figure 1.14. Building 2 -Storage at ground floor



Figure 1.15. Building 2 -Typical activity at ground floor



Figure 1.16. Building 2 -Printing activity at ground floor



Figure 1.17. Building 3 -Typical activity at ground floor



Figure 1.18. Building 4 -Typical activity at ground floor



Figure 1.19. Building 5 (Structure 4)-Typical activity at 4th floor



Figure 1.20. Building 5 (Structure 4)-Typical activity at 3rd floor



Figure 1.21. Building 5 (Structure 4)-Typical activity at 2nd floor



Figure 1.22. Building 5 (Structure 4)-Typical activity at mezzanine floor



Figure 1.23. Building 5 (Structure 4)-Typical activity at 1st floor



Figure 1.24. Building 5 (Structure 4)-Typical activity at ground floor



Figure 1.25. Building 5 (Structure 3)-Typical activity at ground floor



Figure 1.26. Building 5 (Structure 2)-Typical activity at ground floor



Figure 1.27. Building 5 (Structure 1)-Typical activity at ground floor



Figure 1.28. Building 6 (Structure 1)-Typical activity at ground floor



Figure 1.29. Building 6 (Structure 1)-Typical framing at ground floor



Figure 1.30. Building 6 (Structure 2)-Typical activity at ground floor

2.1 Structural System

Building	Building 1
Stability system	RC MRF and Steel Frame with asbestos sheets
Column size (m)	A=0.41x0.41 C=0.3x0.5
Grid (m)	A=12.13x4.91 C=20x7.30
Primary beam size (m)	A=0.3x0.82 C=0.3 x0.6
Secondary beam size (m)	A=0.3x0.78
Slab depth (m)	A&C=0.150
Finishes depth (m)	A&C=0.075
Ceiling height (m)	A=GF 4.32 A=1st Floor 3.4 C=GF 7.5

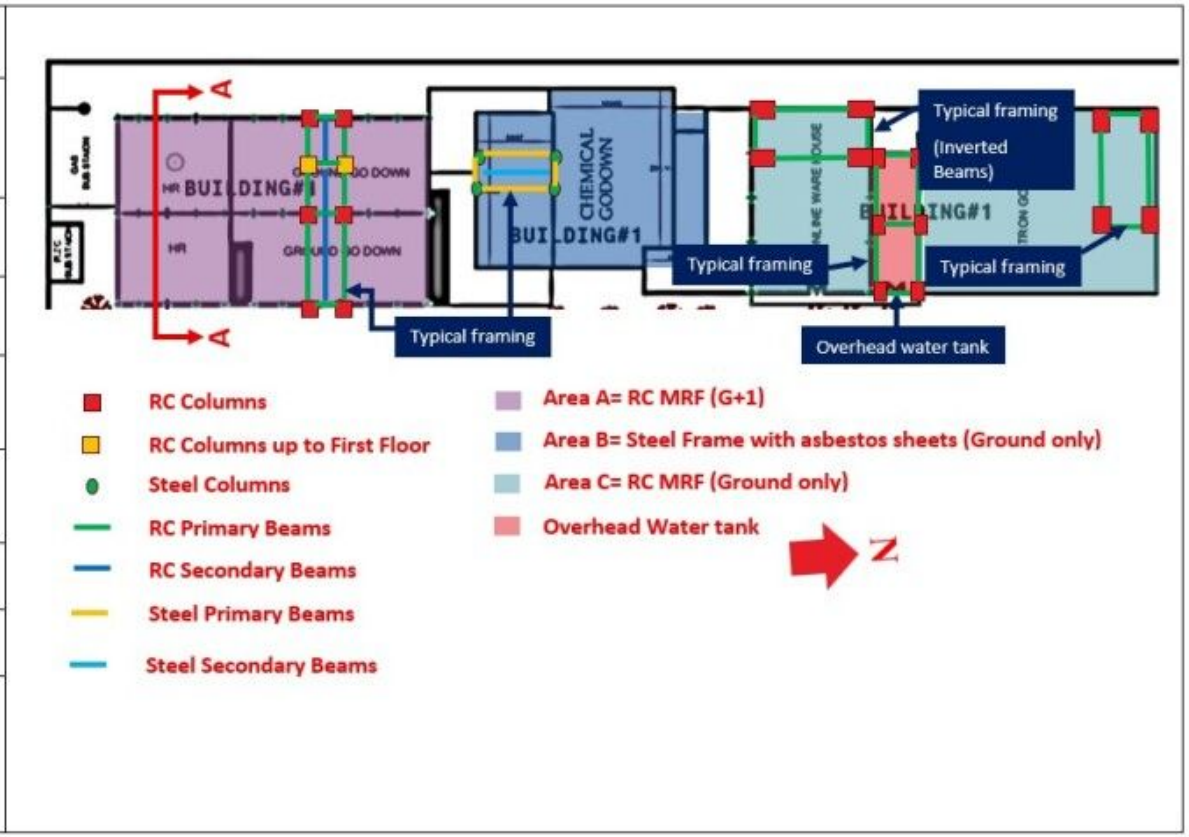


Figure 1.31. Building 1 - Typical framing of the building.

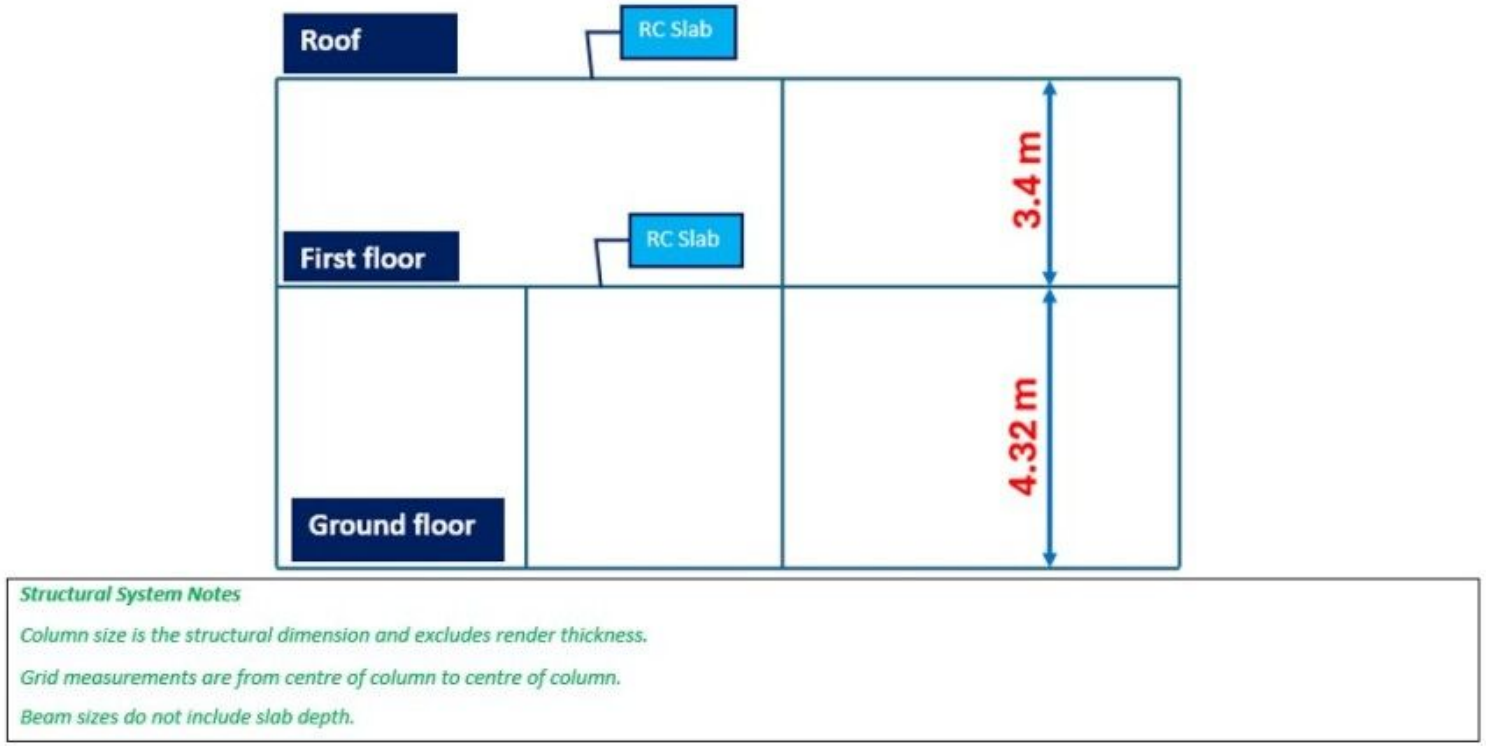


Figure 1.32. Building 1- Section A-A.

Building	Building 4
Stability system	RC MRF Structure with Inverted beams
Column size (m)	0.450
Grid (m)	15.95x5.6 max
Primary beam size (m)	inverted beams not accessible
Secondary beam size (m)	-
Slab depth (m)	0.150
Finishes depth (m)	0.075
Ceiling height (m)	GF 4.36


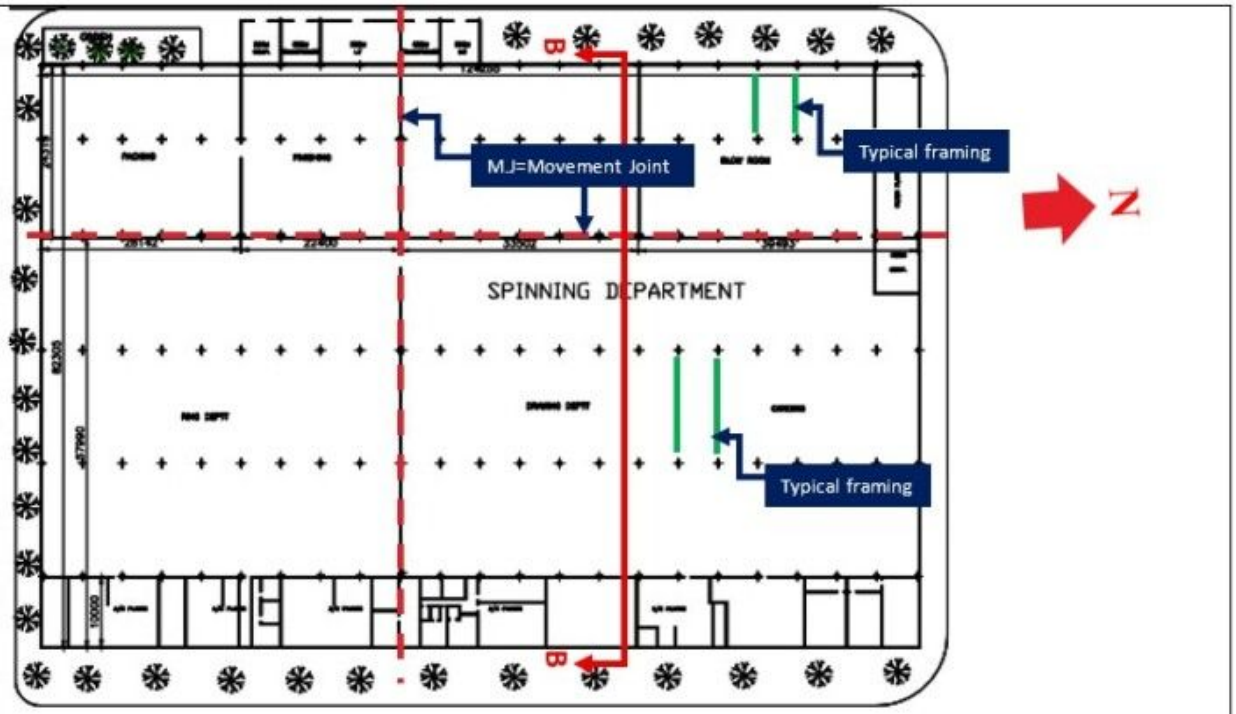


Figure 1.33. Building 4- Typical framing plan.

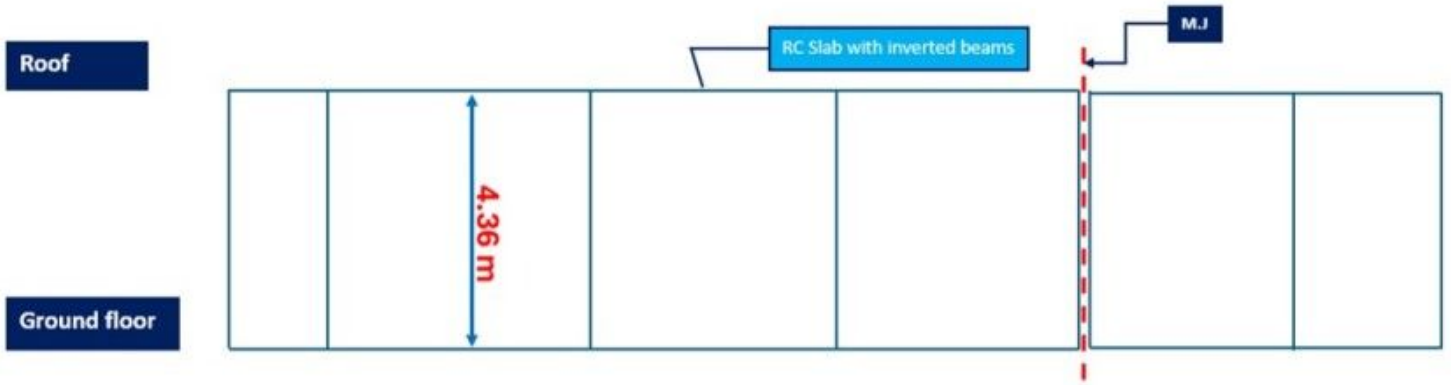

Structural System Notes

Column size is the structural dimension and excludes render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.34. Building 4 – Section B-B

Building	Building 5 (Structure 1,2,3 &5)
Stability system	Structure 1=RC half Shell Structure 2= Steel Portal Frame Structure 3= RC MRF Structure 5= RC MRF
Column size (m)	Structure 1= 0.35x0.71 Structure 3= 0.65x0.65 Structure 5= 0.3 x 0.3
Grid (m)	Structure 1= 14.66x6.96 Structure 2= 14.3x6.6 Structure 3= 12.65x7.35 max Structure 5= 7.5x4.5
Primary beam size (m)	Structure 1= 0.3 x 0.6 Structure 3= 0.3 x 0.79 Structure 5= 0.3 x 0.6
Secondary beam size (m)	Structure 3= 0.3 x 0.79
Slab depth (m)	Structure 3&5 = 0.150
Finishes depth (m)	Structure 3&5 = 0.075
Ceiling height (m)	Structure 1= GF 7.22 Structure 2= GF 6.1 Structure 3= GF 11 Structure 5= GF 4


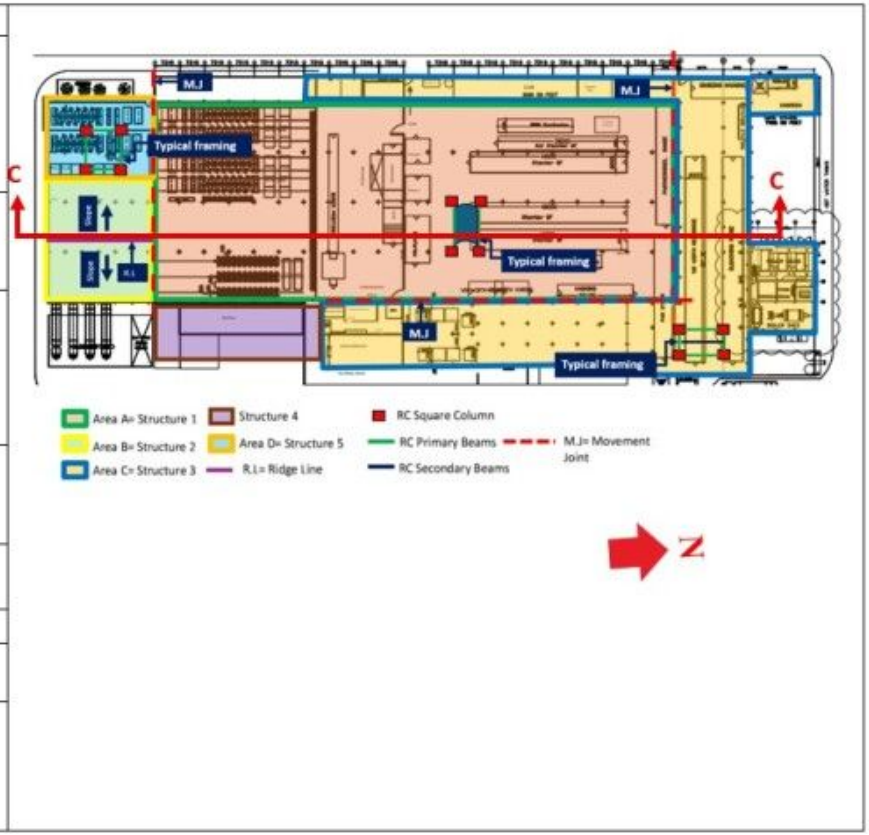


Figure 1.35. Building 5 (Structure 1,2,3 & 5)- Typical framing plan.

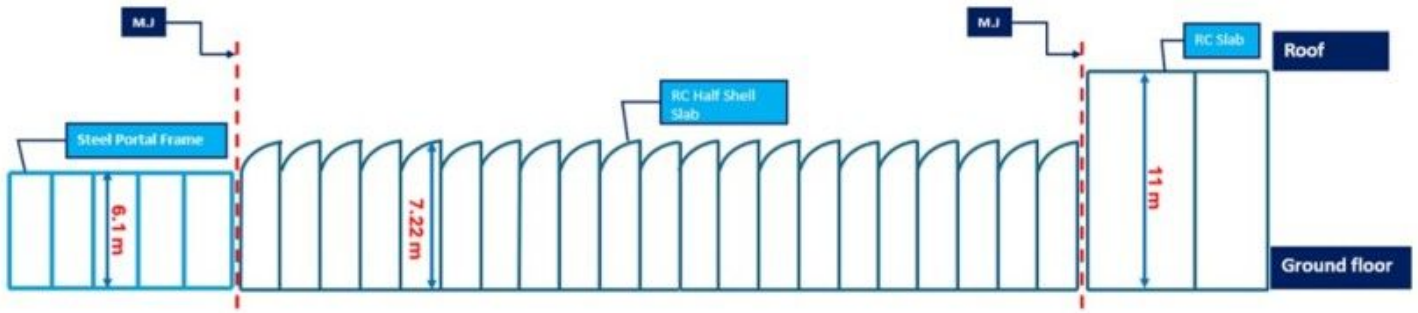

Structural System Notes

Column size is the structural dimension and excludes render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.36. Building 5 (Structure 1,2,3 & 5)- Section C-C

Building	Building 5 (Structure 4)
Stability system	Steel Portal frame
Column size (m)	0.61x0.61
Grid (m)	13.33x7.16
Primary beam size (m)	--
Secondary beam size (m)	-
Slab depth (m)	-
Finishes depth (m)	-
Ceiling height (m)	6.2

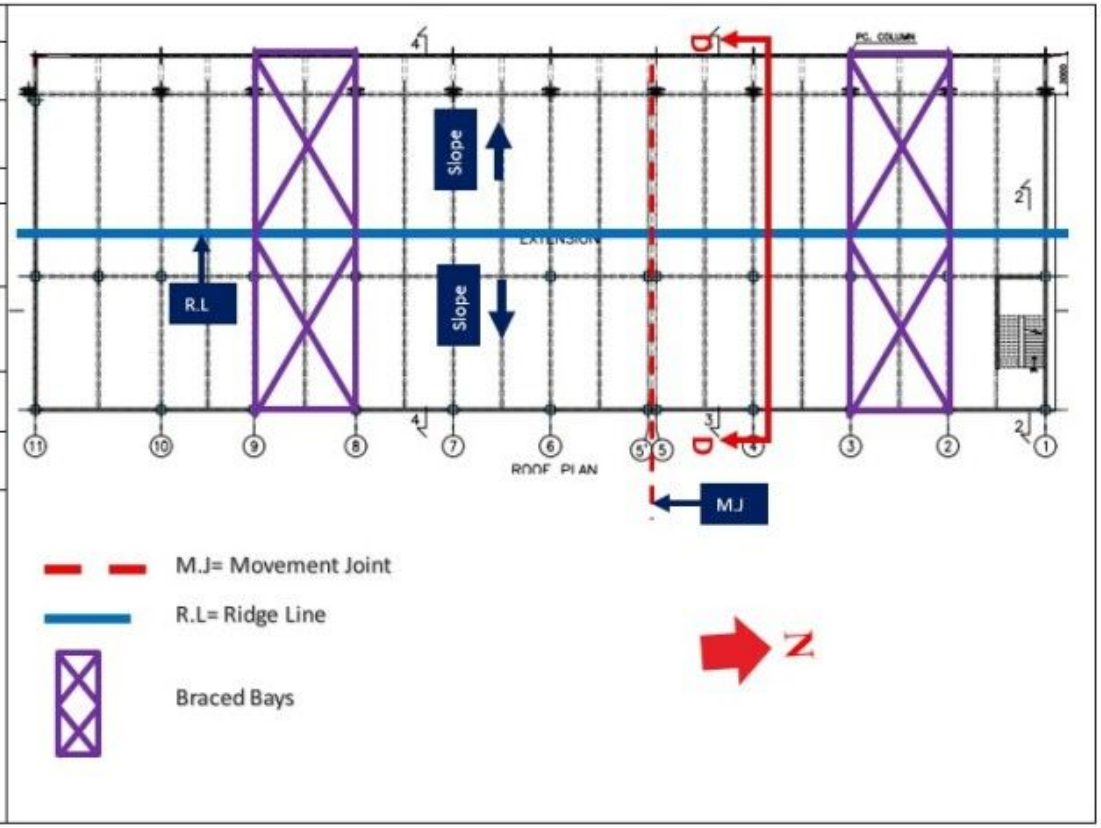


Figure 1.37. Building 5 (Structure 4)- Roof framing plan

Building	Building 5 (Structure 4)
Stability system	RC MRF
Column size (m)	0.61x0.61
Grid (m)	13.33x7.16
Primary beam size (m)	0.3x0.61
Secondary beam size (m)	0.3x0.61
Slab depth (m)	0.150
Finishes depth (m)	0.075
Ceiling height (m)	GF= 4.0 1F= 3.7 Mezz= 3.0 2F= 4.75 3F= 4.8


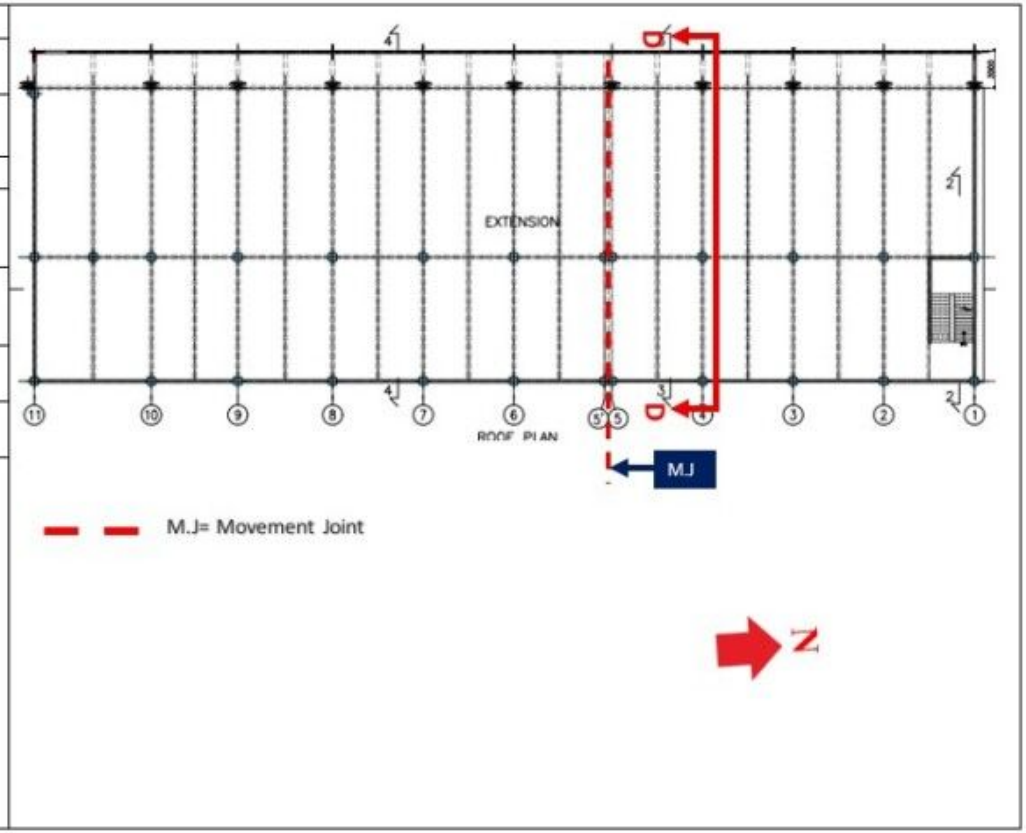


Figure 1.38. Building 5 (Structure 4)- Typical framing plan.

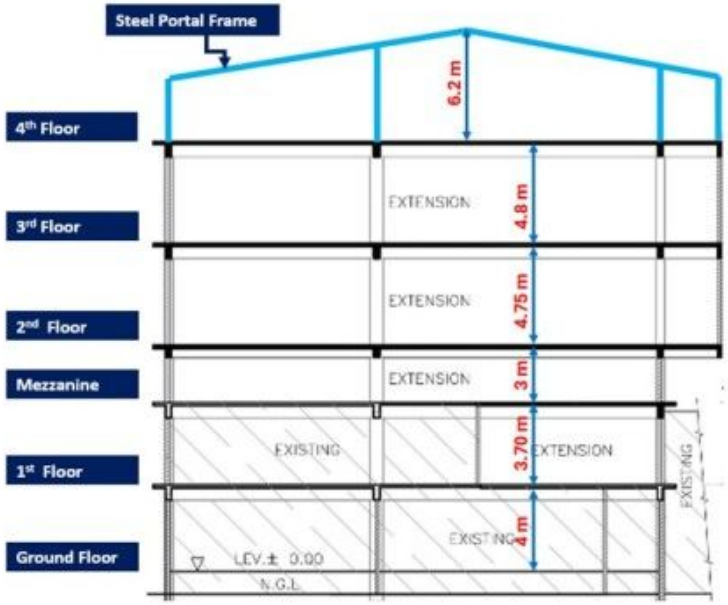

Structural System Notes

Column size is the structural dimension and excludes render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.39. Building 5 (Structure 4)- Section D-D

3. Documentation

This table shows the details about the documentation provided by the factory.

Table 2: Documentation

Building		Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plan	Stability certificate	Inspection reports	Materials testing
Building 1		Yes	Yes	Yes	No	No	No	No	No	No
Building 2					No	No			No	No
Building 3					No	No		No	No	No
Building 4					Yes	No		No	No	No
Building 5	Structure 1				No	No		Yes	No	No
	Structure 2				No	No		Yes		No
	Structure 3				No	No		Yes		No
	Structure 4				Yes	Yes		Yes		Yes(32.6 MPa cube)
	Structure 5				No	No		Yes		No
Building 6	Structure 1				No	No		No	No	No
	Structure 2				No	No				

4. Structural Safety Measures

During our structural site inspection of Ebrahim Textile Mills, a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within Ebrahim Textile Mills. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3 Summary of issues by building:

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Building 1	-	-	Column	-	Spalling Concrete	Documentation Unavailable Lack of safe load plans
Building 2	-	-	-	-	Excessive deflection or vibration	Documentation Unavailable
Building 3	-	-	-	-	-	Documentation Unavailable

Building 4		-	-	-	-	-	Documentation Unavailable
Building 5	Structure 1	-	-	-	-	Spalling Concrete	Documentation Unavailable
	Structure 2	-	-	-			Documentation Unavailable
	Structure 3	-	-	-	-	Spalling Concrete	Documentation Unavailable
	Structure 4	-	-	-	-	Column impact damage Health and Safety- Inadequate edge protection	Lack of safe load plans
	Structure 5	-	-	-	-	-	Documentation Unavailable
Building 6	Structure 1	-	-	-	-	Column impact damage Spalling Concrete	Documentation Unavailable
	Structure 2	-	-	-	-	-	

5. Cracking

5.1 Column

This refers to Building 1 where cracking in multiple columns was observed at multiple locations and levels. The column was found to have cracks penetrating through the concrete, potential cause for damage is due to the water ingress which causes corrosion of reinforcement present in the column resulting expansion in steel bar which is damaging concrete at multiple levels. Although columns are not overstressed, corrosion can compromise the integrity and safety of structure. F-202506-017631

Timeline	Remediation Plan
Medium Term FIN-0022566	Structural engineer to carry out a detailed assessment of the column to identify the cause of the cracking and the residual load capacity including condition of concrete and rebar. Structural Engineer to investigate whether such cracks exist in any other columns, particularly at Ground floor level. Propose measures to prevent future damage and to repair the existing damage / strengthen the column as required and submit to Pakistan Accord for approval.
Longer Term FIN-0022567	Carry out the remedial works.



Figure 2.1 - Building 01 - Column crack in OHWT

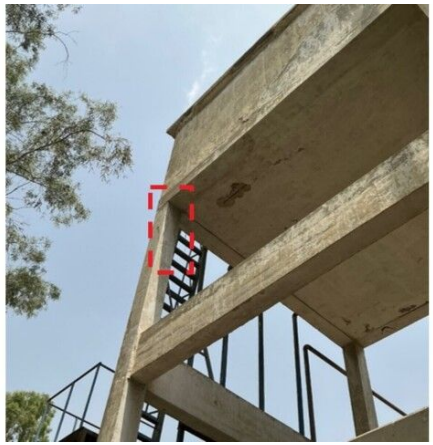


Figure 2.2 - Building 01 - Column crack in OHWT



Figure 2.3 - Building 01 - Column crack warehouse area

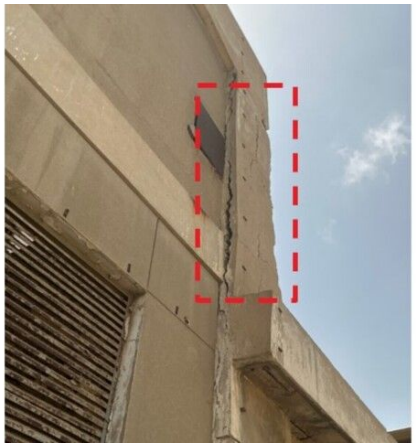


Figure 2.4 - Building 01 - Column crack in warehouse area

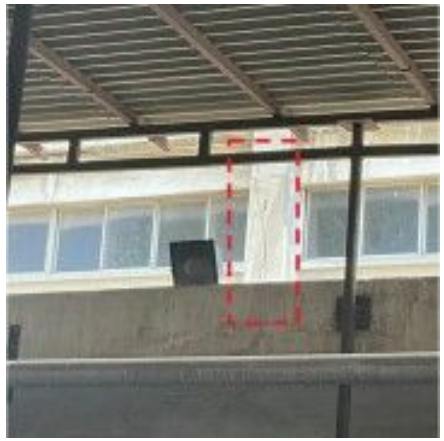


Figure 2.5 - Building 01 - Column crack in warehouse area

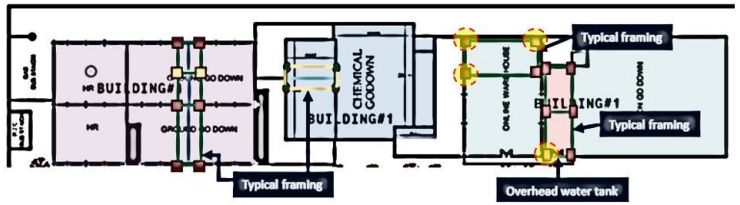


Figure 2.6 - Building 01- Location of columns cracking in overhead water tank and warehouse

6. Other Damage/Defects

6.1 Spalling concrete

This refers to the 1st floor cantilever slab of Building B1, the concrete of cantilever slab was spalling. The potential cause of the spalling might be the lack of waterproofing of the slab. F-202506-017636

Timeline	Remediation Plan
Medium Term FIN-0022570	Identify the cause of the damage / source of water ingress and propose measures to prevent further water damage Inspect damage to the slab and propose repairs to structure Submit report capturing above to Pakistan Accord for approval
Longer Term FIN-0022571	Implement remedial works Continue to monitor for future signs of water ingress/damage



Figure 2.7 - Building 1- Spalling in the cantilever slab of the building

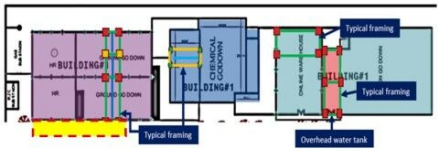


Figure 2.8 - Building 1- Location of spalling in cantilever slab

6.2 Spalling concrete

This refers to the roof floor slab of Building B6 (Structure 1), the concrete of roof slab was spalling. The potential cause of the spalling might be the steam coming out from the mercerize and dryer machines. F-202506-017637

Timeline	Remediation Plan
Medium Term FIN-0022572	Identify the cause of the damage and propose measures to prevent further water damage Inspect damage to the slab and propose repairs to structure Submit report capturing above to Pakistan Accord for approval
Longer Term FIN-0022573	Implement remedial works Continue to monitor for future signs of water ingress/damage



Figure 2.9 - Building 6 (Structure 1)- Spalling in the roof slab of the building



Figure 2.10 - Building 6 (Structure 1)- Spalling in the roof slab of the building

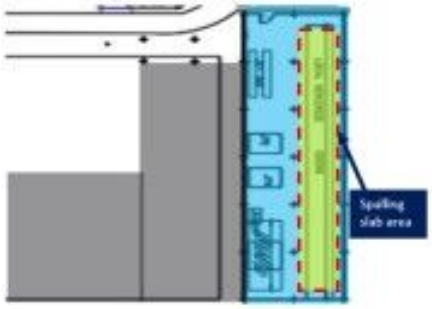


Figure 2.11 - Building B6 (Structure 1)- Location of spalling in roof slab

6.3 Spalling concrete

This refers to the roof floor slab of Building B5 (Structure 1 and 3), the concrete of roof slab was spalling. The potential cause of the spalling for structure 5 might be the steam coming out from the mercerize and bleaching machines and for structure 3 is the lack of waterproofing of the shell slab. F-202506-017638

Timeline	Remediation Plan
Medium Term FIN-0022574	Identify the cause of the damage / source of water ingress and propose measures to prevent further water damage Inspect damage to the slab and propose repairs to structure Submit report capturing above to Pakistan Accord for approval
Longer Term FIN-0022575	Implement remedial works Continue to monitor for future signs of water ingress/damage



Figure 2.12 - Building 5 (Structure 3)- Spalling in the roof slab of the building



Figure 2.13 - Building 5 (Structure 3)- Spalling in the roof slab of the building



Figure 2.14 - Building 5 (Structure 1)- Spalling in the shell slab of the building



Figure 2.15 - Building 5 (Structure 1)- Spalling in the shell slab of the building

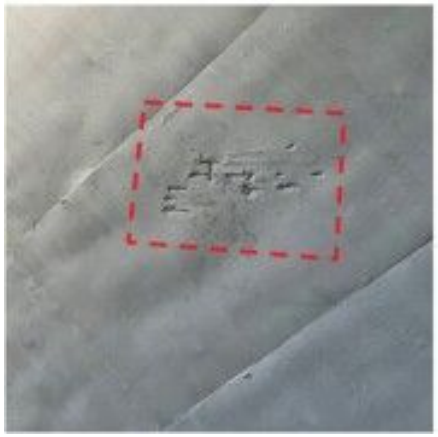


Figure 2.16 - Building 5 (Structure 1)- Spalling in the shell slab of the building

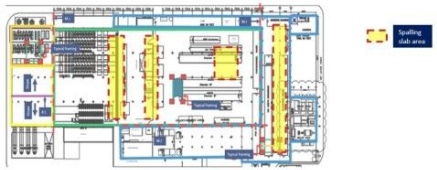


Figure 2.17 - Building 5- Location of spalling in shell slab

6.4 Column impact damage

This observation relates to the multiple columns at roof of Building 5 (Structure 4), which was found to be damaged due to impact of trollies at the roof level. F-202506-017639

Timeline	Remediation Plan
Medium Term FIN-0022576	Repair damage to column corners and external faces
Longer Term FIN-0022577	Install protective measures to prevent damage recurring and submit the pictorial evidence to Pakistan Accord. Continue to monitor condition of columns in highly trafficked areas



Figure 2.18 - Building 5 (Structure 4) - Signs of impact damage in column at roof

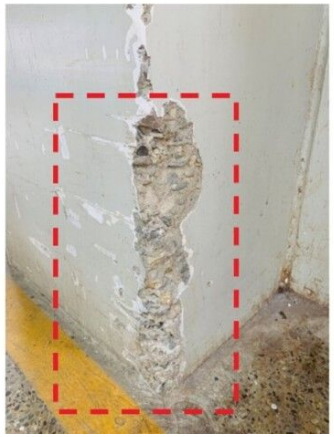


Figure 2.19 - Building 5 (Structure 4) - Signs of impact damage in column at roof



Figure 2.20 - Building 5 (Structure 4) - Signs of impact damage in column at roof

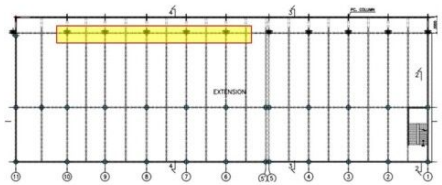


Figure 2.21 - Building 5 (Structure 4) - Location of the damaged columns at roof

6.5 Column impact damage

This observation relates to the multiple columns at roof of Building 6 (Structure 1), which was found to be damaged due to impact of trollies at the ground floor level. F-202506-017640

Timeline	Remediation Plan
Medium Term FIN-0022578	Repair damage to column corners and external faces
Longer Term FIN-0022579	Install protective measures to prevent damage recurring and submit the pictorial evidence to Pakistan Accord. Continue to monitor condition of columns in highly trafficked areas



Figure 2.22 - Building 6 (Structure 1) - Signs of impact damage in column at ground floor

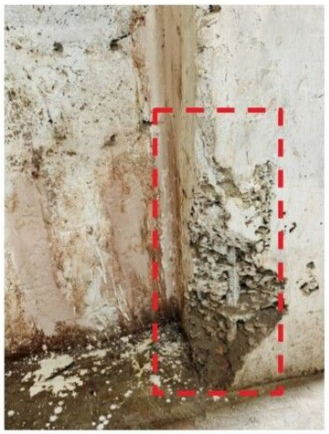


Figure 2.23 - Building 6 (Structure 1) - Signs of impact damage in column at ground floor

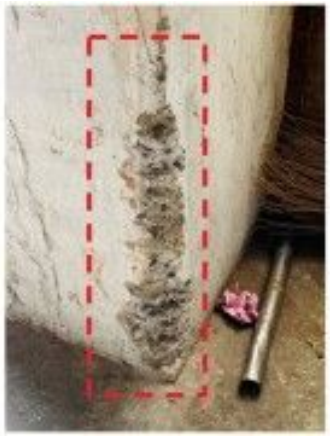


Figure 2.24 - Building 6 (Structure 1) - Signs of impact damage in column at ground floor

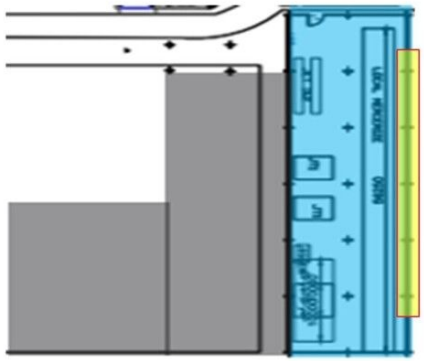


Figure 2.25 - Building 6 (Structure 1) - Location of the damaged columns at ground floor

6.6 Excessive deflection or vibration

This refer to Building 2 (workshop area) where steel truss resting on load bearing walls have visible deflection, the potential cause of deflection might be poor connection details between the structural members and use of under size steel section. F-202506-017641

Timeline	Remediation Plan
Medium Term FIN-0022580	Structural Engineer to review design, loads and columns stresses in column throughout the structure. Safe loading plan to be developed having regard for the capacity of the as-built structure. Loading to be actively managed by Factory Management.
Longer Term FIN-0022581	Carry out any remediation/ strengthening work identified in the assessment.



Figure 2.26 - Building 2-Deflection in steel truss



Figure 2.27 - Building 2 - Location of deflected steel truss

6.7 Health and Safety

This observation relates to Building 5 (Structure 4), which concerns inadequate edge protection around opening of stairs that presents a risk of potential injury from slips, trips, or falls from the floor during access the area.
There was lack of edge protection on the floor of Building 05 (Structure 4).F-202506-017642

Timeline	Remediation Plan
Immediate FIN-0022582	Provide adequate edge protection on the buildings, and on any other part of the factory with the same issue.



Figure 2.28 - Building 5 (Structure 4)- Lack of edge protection on 1st floor

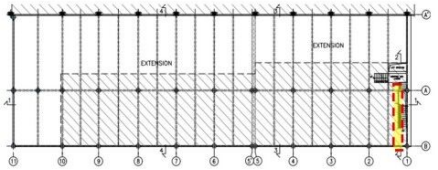


Figure 2.29 - Building 5 (Structure 4)- Location of lack of edge protection on 1st floor

7. Structural Documentation

7.1 Documentation unavailable

This observation relates to documentation of the factory; the architectural and structural drawings of all buildings (except structure 4 of building 5) are not available. F-202506-017632

Timeline	Remediation Plan
Longer Term FIN-0022568	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as-built structural documentation.

7.2 Lack of safe load plans

This refers to building 1 (part A) and building 5 (structure 4) of the facility. No safe Loading plans were posted on any floor of the building. F-202506-017633

Timeline	Remediation Plan
Longer Term FIN-0022569	Building structural engineer to review design documentation to confirm load capacity of the structure. Develop safe load plans and submit to Pakistan Accord for review Factory to post safe load plans on each floor

8. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.