Issue	**1**
Factory ID	**26326**
Date of Issue	**04-Jun-2026**

Eclipse Sports (Pvt.) Ltd.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Raypur Stop, Wazirabad Road,
51310 Sialkot
Punjab Pakistan

Latitude: [32.477965], longitude: [74.427812]
Date of inspection: 11-Mar-2026

Electrical Safety Inspection Report

Observations & Actions



Authors	**Sarah Aiman**
Reviewed by	**Muhammad Asif**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 11-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
   - 2.1 Building Use 9
   - 2.2 Utility Source 10
   - 2.3 Backup source 11
3. Documentation 12
4. Electrical Safety Measures 13
5. Remediation Support 14
   - 5.1 Engineering Support 14
6. Diagrams & Drawings 15
   - 6.1 Sub-station room layout drg 15
   - 6.2 Single Line Diagram (SLD) 16
   - 6.3 Electrical layout drawing 17
7. DBs & Elec Protection Systems 18
   - 7.1 Circuit breakers 18
   - 7.2 Hot Spots 21
   - 7.3 Earthing system 25
   - 7.4 Panel/cabling/busbar 28
   - 7.5 Loop Connection 31
   - 7.6 Multiple Connections 33
   - 7.7 Openings 35
   - 7.8 Adequate accessibility 37

7.9 Lint & dust inside panel board 39
7.10 Lightning Protection System (LPS) 41
8. Fire Alarm & Detection System (FADS) 43
8.1 Non-functional or incomplete 43
9. Emergency Lighting 46
9.1 Provided but non-functional 46
9.2 Provided but insufficient 48
9.3 Independent power source 51
9.4 General Lighting 52
10. Generator, Transformer & Sub-Station Room 54
10.1 Working clearance 54
10.2 Battery 56
11. Cabling & Wiring 58
11.1 Cable support and protection 58
11.2 Cable trench and channel cleanliness 60
11.3 Splicing of cables 62
11.4 Colour coding 66
11.5 Fixtures 68
12. Assessment Limitations and Assumptions 70

1. Executive Summary

On 11-Mar-2026, Sarah Aiman and Azka Riaz on behalf of the Pakistan Accord carried out an initial electrical inspection for Eclipse Sports (Pvt.) Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with Mr. Akbar Khan (Manager Compliance), Mr. Khurram Rasheed (Compliance Consultant) and other staff members of Eclipse Sports (Pvt.) Ltd. The assessment was conducted as a part of an overall Structural, Fire, and Electrical initial inspection.
The factory operates in single general shift. Factory employs approximately 70 workers with approximately 7% female representation.
The factory comprises of a main building in which two floors (3rd and 4th) were rented by Eclipse Sports (Pvt.) Ltd, rest of the floors were occupied by a surgical instruments manufacturing company. During the inspection, the building highlighted in blue in Figure 1.1 was surveyed with the site boundary indicated in red.
• **Main Building** is mainly a five-storey (G+4) building. The building is used for surgical instruments manufacturing (Ground, First and Second Floors), cutting, finishing, printing, packing, guesthouse, sublimation, heat-transfer (Third floor), Fabric Store, Kitchen, Open-gymnasium, solar Inverter, steamer (Fourth Floor) and workers residence, birds cages, water tank (Roof).

A summary of the main concerns in relation to life safety systems identified during the inspection (non-exhaustive) that should be actioned is as follows:

• **Abnormal Temperature**: Within the electrical panels abnormal temperature was recorded (refer to section 7.2 for further details). Hotspots within panels can cause short circuits and fire due to insulation damage and overheating of cables and electrical components.
• **Fire Alarm and Detection System**: The fire alarm control panel was found non-operational, and alarm devices were installed only at limited locations on the third floor. It has major deficiencies like non-addressable devices, insufficient notification devices, missing call points, and non–fire-rated cables, creating a serious life-safety risk in a fire.
• **Emergency lighting System**: The emergency lighting system had inadequate coverage and non-functional lights, hindering safe evacuation during power outages and increasing the risk of accidents.
• **Earthing system**: The earthing system was found to be missing throughout the facility. No earth distribution was available in the electrical panels and machines. The lack of a proper earthing system poses significant safety risks, such as electric shocks, fire hazards, and potential equipment damage.

We see no reason to suspend operations in the facility due to these concerns, subject to the actions identified being addressed within the specified timeframes.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents



Figure 1.1. Site plan (Satellite view). Red dashed line indicates site boundary, highlighted (blue) area indicates buildings inspected.

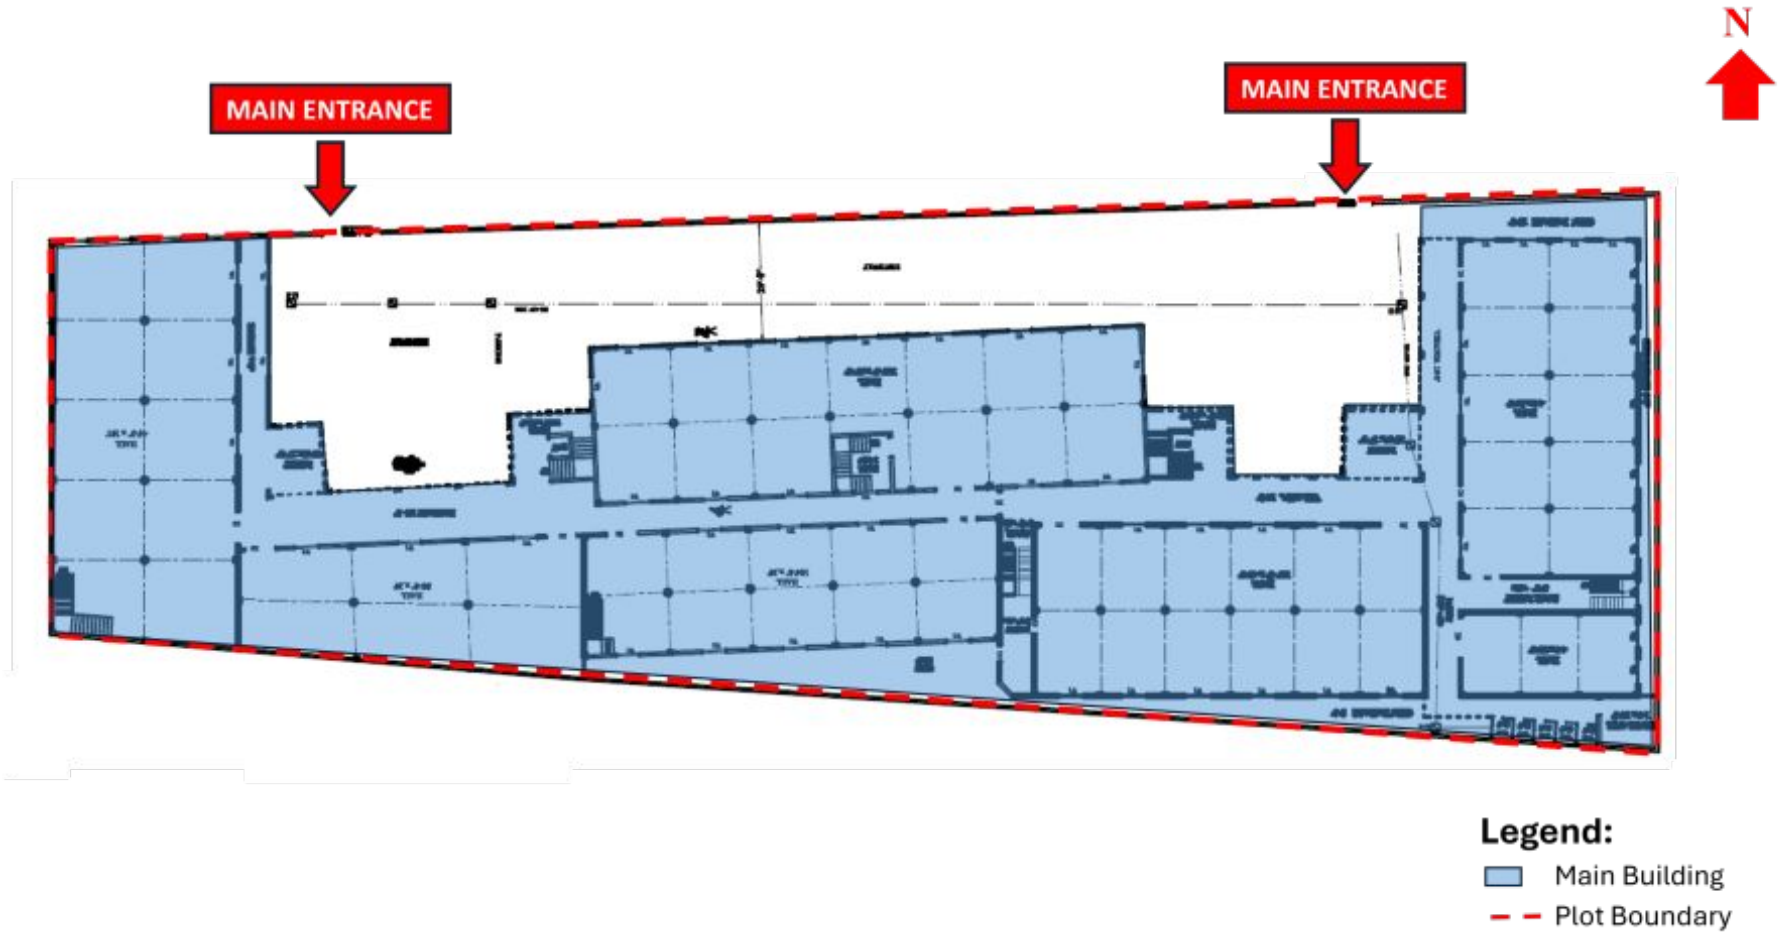


Figure 1.2. Site Layout Plan of the Factory Premises - Red dashed lines indicates site boundary

2.1 Building Use

The factory comprises one main building

Main Building
L00 – Ground Floor: Surgical instruments manufacturing
L01 – First Floor: Surgical instruments manufacturing
L02 – Second Floor: Surgical instruments manufacturing
L03 – Third Floor: Cutting, finishing, printing, packing, guesthouse, sublimation, heat-transfer area
L99 – Roof : Workers residence, birds cages, water tank

2.2 Utility Source

The facility receives two independent 400 V utility feeders from Gujranwala Electric Power Company (GEPCO) via two GEPCO-owned step-down transformers (100 kVA, 400 kVA) located outside the main gate. One feeder (100 kVA) supplies the Eclipse sports area and the other(400 kVA) supplies the surgical manufacturing areas, with both feeders entering their respective zones at the ground and third floors and then distributing power through cables to multiple distribution boards across the facility.

2.3 Backup source

Two diesel generators rated 250 kVA and 500 kVA provide backup power for the Eclipse sports and surgical manufacturing areas.
In addition, the smoke detection system and emergency lighting system for eclipse sports are each equipped with independent, built-in battery backup supplies.
However, no fire alarm and detection system or emergency lighting system was installed in surgical manufacturing areas.

3. Documentation

This table shows the details of the documentation provided by the factory.

S.NO	Description	Available (Y/N)	Created Date	Status / Remarks
1	Electrical Layout Drawing	No		
2	Single Line Diagrams	No		
3	Fire Alarm Drawing	No		
4	Earth Test Report	No		
5	Thermographic Test Report	No		
6	Insulation Resistance Test Report	No		
7	LPS Risk Assessments	No		
8	Periodic Maintenance Record	No		
9	Transformer Oil Testing Report	N/A		

4. Electrical Safety Measures

During our electrical site inspection of Eclipse Sports (Pvt.) Ltd., a number of electrical issues were identified.

It is essential to address these electrical safety issues promptly to enhance safety and compliance within Eclipse Sports (Pvt.) Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

All survey, testing, and design activities specified in this report shall be performed by a qualified electrical engineer. The recommended installation and modification tasks should be executed by a licensed professional electrician.

Before commencing any installation and/or modification works, the proposed design must be submitted to the Pakistan Accord for approval.

Upon completion of the works, the necessary evidence required to verify that the tasks have been completed to the agreed standards will be determined during the development of the Corrective Action Plan (CAP).

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202603-064347

Timeline	Remediation Plan
Medium Term CAP-0075760	Factories should begin remediation of CAP items such as cleaning, cable organisation, and basic corrections using internal resources. For systems or design-related remediation, engagement of a qualified Electrical Engineer is required.

6. Diagrams & Drawings

6.1 Sub-station room layout drg

This section refers to the electrical rooms within the facility.

During the inspection conducted, it was observed that there were no substation room layout drawings available for the factory.

There are no visible indications of substation equipment locations or pathways for maintenance and emergency access.

The absence of substation room layout drawings poses significant risks to life and fire safety within the factory premises. Without these critical documents, emergency responders and maintenance personnel may face difficulties in locating and isolating electrical faults during emergencies. This delay can result in prolonged exposure to electrical hazards, increasing the risk of electrical fires and endangering lives. Furthermore, the lack of layout drawings complicates routine maintenance, potentially leading to undetected faults and increased likelihood of equipment failure. F-202603-064345

Timeline	Remediation Plan
Medium Term CAP-0075763	Develop detailed substation room layout drawings in accordance with the requirements outlined in Sections 132.12 and 132.13 of BS7671 18th Edition + A2 (2022). Ensure that all critical equipment and pathways are accurately documented. Retain the drawings along with all O&M information for the facility.
Longer Term CAP-0075764	Regularly update and review the substation room layout drawings to reflect any changes in equipment or configuration. Provide training sessions for maintenance personnel and emergency responders on how to interpret and utilize the layout drawings.

6.2 Single Line Diagram (SLD)

This section refers to the entire facility.

It was found that the electrical single line diagrams (SLDs) for the factory were missing.

This deficiency was noted in all electrical rooms and areas where SLDs should be prominently displayed.

The factory lacks documented diagrams that illustrate the electrical distribution system, including the connection and configuration of all electrical components.

Single line diagrams are crucial for understanding the electrical distribution network and for troubleshooting issues effectively. Without these diagrams, maintenance personnel and emergency responders lack critical information necessary for isolating faults and managing power during emergencies. This can lead to delays in addressing electrical issues, increasing the risk of electrical fires and potential harm to personnel. Moreover, the lack of SLDs complicates routine maintenance and inspection processes, potentially resulting in undetected electrical faults and system inefficiencies.F-202603-064346

Timeline	Remediation Plan
Medium Term CAP-0075765	Develop comprehensive electrical single line diagrams for the entire facility in accordance with the requirements outlined in Section 514.9.1 of BS7671 18th Edition + A2 (2022). Ensure all components and connections are accurately represented. Retain the drawings along with all O&M information for the facility.
Longer Term CAP-0075766	Implement a regular review and update process for the single line diagrams to reflect any changes in the electrical system. Conduct training sessions for maintenance personnel and emergency responders on interpreting and using the diagrams.

6.3 Electrical layout drawing

This section refers to the entire facility.

During the survey, it was noted that the factory lacked electrical layout drawings - including small power layouts, lighting layouts, and containment layouts.

This absence was consistent across all areas where such documentation should be available.

These drawings are vital for understanding the placement and connections of electrical systems, which is crucial for identifying and mitigating potential hazards. In emergencies, the lack of detailed layouts can delay the identification and isolation of electrical faults, increasing the risk of fire and electrical accidents. Additionally, without proper layout drawings, routine inspections and maintenance may overlook critical issues, potentially leading to system failures and safety breaches.F-202603-064344

Timeline	Remediation Plan
Medium Term CAP-0075761	Develop comprehensive electrical layout drawings in accordance with the requirements outlined in Sections 132.12 and 132.13 of BS7671 18th Edition + A2 (2022). To avoid drawings becoming overcrowded, separate drawings shall be prepared for each electrical system. Retain the drawings along with all O&M information for the facility.
Longer Term CAP-0075762	Implement a regular review and update process for the electrical layout drawings to reflect any changes in the system. Conduct training sessions for maintenance personnel and emergency responders on interpreting and using the layouts.

7. DBs & Elec Protection Systems

7.1 Circuit breakers

This section refers to the entire facility.

During the survey the circuit breakers installed throughout the facility inside the electrical panels and distribution boards were inspected.

i. It was observed that the circuit breakers were installed in the sublimation bed hall near heat emitting machine without proper fixing supports and protective enclosures. This inadequate fixing could lead to poor connections, arcing, short circuits, or other electrical faults.

ii. It was found that a single-phase load was fed from a three-pole breaker. Using a single phase of a three-pole breaker can lead to unbalanced load conditions. This can cause the breaker to trip unexpectedly or, in some cases, fail to trip when necessary, compromising the safety of the system. This issue was observed in the distribution board of the forceps assembling area.

iii. It was observed that multiple circuit breakers had ratings that were not appropriate for the connected cable sizes.
- In the main distribution board on third floor, 100A circuit breakers were connected to 16 mm^2 and
- In the surgical machines control panel, a 100A circuit breaker was connected to 16 mm^2 PVC cables.
- In the forceps assembling area distribution board, a 100A circuit breaker was connected to 16 mm^2 PVC cables.

Specifically, some circuit breakers had higher ratings than the cables could safely handle, which poses a significant risk of overheating and potential fire hazards. Conversely, other circuit breakers had lower ratings than necessary, resulting in frequent and unnecessary tripping. To ensure both safety and operational efficiency, corrective action is required to align the circuit breaker ratings with the cable capacities. This adjustment will mitigate the risks associated with overheating and improve the reliability of the electrical system. F-202603-064046

Timeline	Remediation Plan
Medium Term CAP-0075728	i. Secure all loosely installed circuit breakers with proper mounting and enclose them in compliant metallic or insulated enclosures, in accordance with BS 7671 Section 416 (Barriers and Enclosures for Basic Protection).Replace old obsolete circuit breakers (CB) and mount them properly within the panel.

Medium Term CAP-0075729	ii. Remove single-phase connections from three-pole breakers and replace them with appropriate single-pole breakers, ensuring compliance with standard current-carrying capacities and preventing load imbalance.
Medium Term CAP-0075730	iii. Evaluate the breaker ratings and cable sizes for all circuits in the facility according to Section 433.1.1 and Appendix 4 of BS 7671 18th Edition + A2 (2022). Ensure that the breaker rating does not exceed the cable's current-carrying capacity. If the breaker has adjustable settings, they must be configured to allow current within the cable's ampacity after applying derating factors.



Figure 2.1 - Circuit breaker installed without protected enclosure in sublimation hall on third floor



Figure 2.2 - 100 A circuit breaker connected to 16 sq mm cable in main distribution board on third floor



Figure 2.3 - Two single phase load fed from three-pole breaker at forceps assembling area

7.2 Hot Spots

This relates to the entire facility.

During the inspection, Thermographic surveys were conducted on the electrical boards.

The survey identified numerous hot spots within panels and distribution boards. Hot spots in electrical distribution systems can be caused by several factors, including:

> Loose connections
> Overloaded circuits
> Faulty components
> Improper sized cable
> Insulation degradation

It was also found that the thermographic report was not available at the site. Without thermography testing, faults such as overheating components or loose connections may go unnoticed, which increases the risk of fire. Early detection through thermography can prevent fire incidents.

The categories of identified hot spots have been evaluated as per the ANSI NETA MTS 2019 standard, Table 100.18. Hot spots were observed, particularly at the following locations:

i. 108°C at the yellow bus bar in PFI (power factor improvement) panel on ground floor
ii. 103°C and 61°C on the cable connection of the main breaker in sublimation bed hall
iii. 89.3°C at the PCB board of the capacitor in PFI (power factor improvement) panel on ground floor
iv. 53.2°C on the red cable connection of main breaker of office distribution board on third floor

Circuit breakers are typically designed to operate safely within an ambient temperature range of -20°C to 40°C. Commonly used PVC insulated cables typically have a maximum operating temperature of 70°C. Prolonged exposure to temperatures above these can degrade the insulation of the breaker as well as the cable and result in reduced performance.

Hot spots in electrical systems pose significant life safety risks due to several factors. Overheated components can ignite surrounding materials, leading to electrical fires. This is particularly dangerous in densely packed panels and distribution boards where flammable materials may be present. Hot spots can degrade insulation on wires and components, increasing the risk of electrical shock to personnel who might come into

contact with exposed conductive parts. Overheating can contribute to conditions that might trigger an arc flash, a dangerous high-temperature event that can cause severe injuries or fatalities to personnel working near the affected equipment. F-202603-064043

Timeline	Remediation Plan
Immediate CAP-0075711	Any circuits identified on site with temperatures exceeding 40°C above the ambient temperature, operating above 90°C or exhibiting visual signs of burning must be immediately isolated and taken out of service. These circuits should remain de-energized until a thorough review has been conducted and appropriate remedial actions have been implemented to resolve the underlying issues.
Medium Term CAP-0075712	During the inspection, several circuits were identified where the temperature was exceeding 20°C above ambient temperature. It is recommended that the factory conducts comprehensive thermographic surveys of all electrical panels to detect similar issues. Identified hot spots should be thoroughly reviewed to determine their underlying causes. Corrective actions must be taken to address and resolve these issues, ensuring safe and reliable operation of the electrical systems.
Longer Term CAP-0075713	Regular thermographic inspections should be incorporated into the maintenance schedule to proactively manage and mitigate the risks associated with overheating.

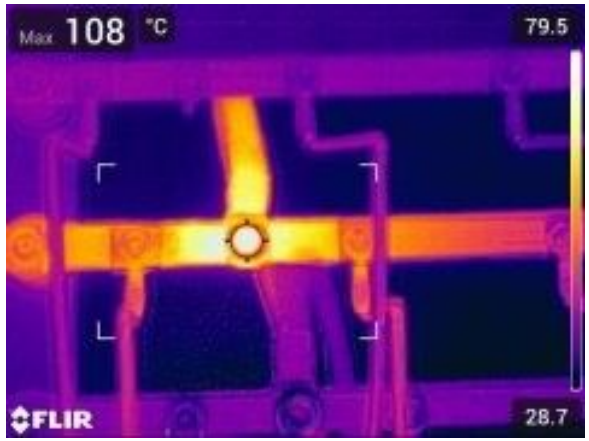


Figure 2.4 - Hot spot found on the yellow bus bar in PFI (power factor improvement) panel ground floor



Figure 2.5 - Hot spot found on the yellow bus bar in PFI (power factor improvement) panel ground floor



Figure 2.6 - Hot spot found on the circuit breaker cable connection in sublimation bed hall



Figure 2.7 - Hot spot found on the circuit breaker cable connection in sublimation bed hall



Figure 2.8 - Hot spot found on PCB board of capacitor in PFI (power factor improvement) panel at ground floor



Figure 2.9 - Hot spot found on PCB board of capacitor in PFI (power factor improvement) panel at ground floor

7.3 Earthing system

This relates to the entire facility.

During the inspection of the facility's electrical panels, distribution boards, and machinery, several observations with the earthing system were identified.

i. No earthing system design documentation was provided by the factory, indicating a lack of verification of the earthing system’s compliance and ongoing performance in accordance with relevant standards.

ii. The earth pits were inaccessible and unsuitably located. The earth pit testing and maintenance records were not provided either.

iii. The earthing system was almost absent in the overall facility. All distribution boards lacked earthing cables, and electrical machines did not have proper earth connections.

iv. Equipotential bonding for the cable trays and metallic panel covers was missing. This issue was observed in all areas of the facility.

The lack of proper earthing system throughout the facility poses substantial safety risks, such as electric shocks, fires, and equipment damage. Implementing appropriate earthing measures is crucial to prevent hazardous voltage levels and ensure operational safety. F-202603-064047

Timeline	Remediation Plan
Medium Term CAP-0075737	i. Design and evaluate the facility's earthing system, and develop layout drawings in accordance with BS 7671 18th Edition + A2 (2022). Submit the earthing layout drawings to the Pakistan Accord for review.
Medium Term CAP-0075738	ii. Relocate and redesign earth pits to make them easily accessible for maintenance and inspection, complying with BS 7671 18th Edition + A2 (2022) Chapter 54. Implement periodic earth testing per BS 7671 Regulation 643.7.1 to verify grounding effectiveness and submit testing record to Pakistan Accord for review.
Medium Term CAP-0075739	iii. Install earthing systems where absent, ensuring compliance with BS 7671 18th Edition + A2 (2022) Chapter 54. Fit all electrical boards with the required earthing cables. Ensure that earthing conductors are properly connected and comply with BS 7671 18th Edition + A2 (2022) Section 543.1.

Medium Term CAP-0075740	iv. Implement equipotential bonding for all cable trays to comply with BS 7671 Regulation 411.3.1.2. Ensure all exposed conductive parts are bonded to the main earthing terminal.
Longer Term CAP-0075741	Establish a schedule for regular maintenance and inspection of the earthing system and protective devices as per BS 7671 Regulation 651.2. Document all inspections and maintenance activities to ensure ongoing compliance. Provide training to facility maintenance personnel on proper earthing practices and the importance of maintaining electrical safety standards in line with BS 7671 requirements.



Figure 2.10 - Equipotential bonding is missing for cable tray



Figure 2.11 - Earth connection missing in the distribution board1 of stitching machines on third floor



Figure 2.12 - Inaccessible earth pit near main gate



Figure 2.13 - Earth connection missing for the stitching machine

7.4 Panel/cabling/busbar

This relates to the entire facility.

The visual site inspection included an examination of the electrical panels, cables and busbars throughout the facility.

i. Combustible material was found in the cable tray near main distribution board on the third floor. This creates a significant fire hazard, as these materials could ignite from electrical faults, arcing, or overheating cables, allowing flames to spread rapidly along the tray and compromise the entire electrical distribution system.

ii. Phase separators were missing in the main distribution board and most of the distribution boards throughout the facility, increasing the risk of accidental contact between phases.

iii. There were visible signs of damage to panels, cables, and busbars, cable trays, including broken panel locks, and non-functional voltmeters and ammeters. These defects compromise the ability to accurately monitor system voltage, current and status, increasing the risk of undetected faults or hazardous conditions. This issue was specifically observed in the packing of surgical manufacturing and main distribution board of third floor.

iv. Cables were not dressed adequately in the stitching distribution board on the third floor, the cargo lift panel and the milling hall panel on the ground floor. Several cables were found loosely hanging and not routed through proper cable management systems. This may lead to physical damage or pose safety hazards.

The utilization of electrical equipment that is either unsuitable for its operating environment or physically damaged poses significant safety risks. These risks include potential electrical failures, increased likelihood of short circuits, and the heightened risk of fire and electrical shock. F-202603-064045

Timeline	Remediation Plan
Immediate CAP-0075939	i. Conduct immediate clearance of all combustible materials from the cable trays.

Medium Term CAP-0075721	ii. Phase separators should be installed between adjacent live conductors of different phases within the distribution boards to ensure safe segregation and protection against direct contact, in accordance with BS 7671 Regulation 416.2.
Medium Term CAP-0075722	iii. Inspect and repair or replace all damaged panels, damaged cable insulation, and faulty instruments to ensure the integrity of the electrical system, in accordance with Section 522 of BS 7671 18th Edition + A2 (2022).
Medium Term CAP-0075723	iv. Ensure proper cable management by organizing and securing cables within the panels using cable ties, clips, or ducting. Verify that all components and connections are securely mounted, neatly arranged, and labelled to improve safety, ease of maintenance, and compliance with electrical standards such as BS 7671.
Longer Term CAP-0075724	Establish a schedule for regular maintenance and inspection of the panel, cabling, and busbars. Document all inspections and maintenance activities to ensure ongoing compliance. Provide training to facility maintenance personnel on the importance of maintaining electrical safety standards in line with BS 7671 requirements.



Figure 2.14 - Combustible material found in cable tray near main distribution on third floor



Figure 2.15 - Inadequate cable dressing found in the distribution board of cargo lift



Figure 2.16 - Phase separators missing in main distribution board on third floor



Figure 2.17 - Inadequate cable dressing found in the distribution board of milling hall

7.5 Loop Connection

This relates to the entire facility.

During the inspection loop connections were identified within the electrical panels. This issue was specifically observed in the distribution board of the store on the fourth floor and surgical machines panel on first floor.

In these loop connections, one circuit breaker is energised by the live part of another circuit breaker, creating loops within the panel instead of using a busbar system.

Avoiding loop connections is crucial due to several significant risks. Loop connections can complicate maintenance activities, making it difficult to trace and isolate circuits. These connections can lead to increased resistance and overheating, potentially damaging components. Loop connections raise the risk of accidental phase mixing, which can result in short circuits. The above issues compromise personal safety and significantly increase the risk of fire.F-202603-064041

Timeline	Remediation Plan
Medium Term CAP-0075748	All electrical panels shall be modified to eliminate loop connections. A busbar system within the electrical panels shall be utilized to provide each circuit with the required live, neutral, and earth connections.



Figure 2.18 - Loop connections found in surgical machines panel on first floor



Figure 2.19 - Loop connections found in garments storage on fourth floor

7.6 Multiple Connections

This relates to the whole facility.

During our inspection, multilooping was observed in a number of electrical panels across the facility. This issue was specifically observed in the distribution board of packing, finishing, stitching, forceps assembling and main electrical panel on third floor.

In these cases, multiple circuits were being protected by a single circuit breaker.

Multilooping can result in improper distribution of electrical current, leading to voltage drops and potential electrical hazards. To mitigate these risks and ensure the safety and reliability of the electrical system, it is essential to adhere to proper installation practices. This includes using appropriate dedicated circuit breakers for each circuit.F-202603-064040

Timeline	Remediation Plan
Medium Term CAP-0075742	The electrical installation throughout the facility shall be modified to ensure each circuit is protected by a dedicated circuit breaker of a suitable type and rating for each individual circuit in accordance with Section 430 of BS 7671 18th Edition + A2 (2022).

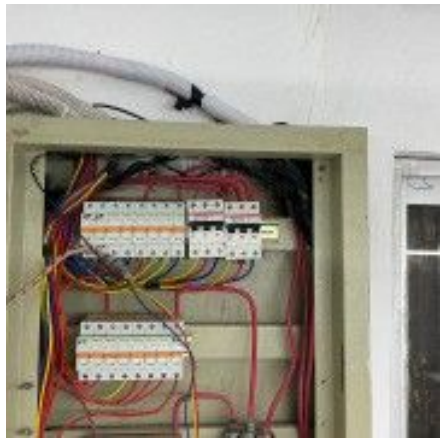


Figure 2.20 - Multiple connections found in electrical panel of stitching machines on third floor

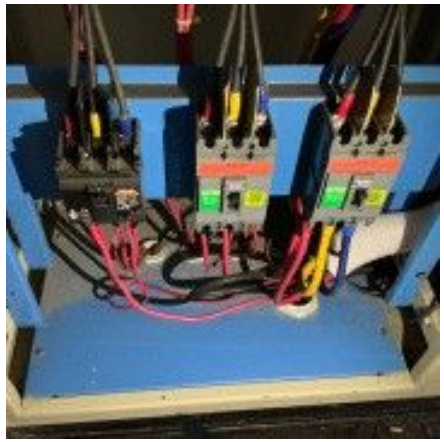


Figure 2.22 - Multiple connections found in the main electrical panel on third floor



Figure 2.21 - Multiple connections found in forceps assembling area



Figure 2.23 - Multiple connections found in the packing distribution board

7.7 Openings

This relates to the entire facility of the factory.

During the visual inspection, the electrical panels and distribution boards were examined for unsealed openings to ensure compliance with the IP rating requirements.

Unsealed openings and missing base plates were discovered in the main distribution board on the 3rd floor, and in the distribution boards for finishing, stitching, and surgical manufacturing on the 2nd and 1st floors.

These deficiencies pose multiple hazards. Unsealed openings and missing panels expose live electrical components, significantly increasing the risk of accidental contact and electric shock to personnel working nearby. The unsealed openings allow dust, debris, and moisture to enter, which can lead to short circuits and increase the risk of fire. The absence of proper sealing compromises the IP rating of the panels, which is crucial for ensuring safety and protection against environmental factors.F-202603-064048

Timeline	Remediation Plan
Medium Term CAP-0075697	Corrective actions are required to seal all openings and replace missing panels to restore the integrity and safety of the electrical systems. The electrical system shall ensure compliance with Sections 614.2.1, 412.2.2, and 512.2 of BS 7671 18th Edition + A2 (2022).
Longer Term CAP-0075698	Conduct regular maintenance and maintain comprehensive records for all electrical panels to ensure there are no openings and that the IP ratings of the panels remain uncompromised.



Figure 2.24 - Unsealed openings observed in main distribution board on second floor



Figure 2.25 - Base plate missing in distribution board of surgical manufacturing on first floor



Figure 2.26 - Unsealed openings observed in distribution board of stitching on third floor



Figure 2.27 - Unsealed openings observed in distribution board of finishing on third floor

7.8 Adequate accessibility

This relates to the entire facility.

During the visit, the electrical panels and distribution boards were examined for adequate accessibility.

At numerous locations, it was found that the electrical panels do not possess the required space for inspection or easy access to the panels and their components.

In several instances, the placement of electrical panels adjacent to machines that continuously reject heat has caused the surrounding temperature to exceed ambient levels by several degrees. This temperature rise further increases the temperature of the panels and boards nearby.

This issue was observed for finishing the distribution board on third floor and the distribution board on ground floor.

Limited accessibility to distribution panels and machine panels hampers effective maintenance and inspection procedures. This can potentially cause delays in addressing emergencies and troubleshooting electrical problems. These accessibility challenges could compromise the operational reliability and safety of the premises, as prompt maintenance and emergency responses are hindered. F-202603-064049

Timeline	Remediation Plan
Medium Term CAP-0075688	Electrical equipment shall be arranged to provide sufficient space for the initial installation and later replacement of individual items of electrical equipment. Sufficient allowance shall also be made for sufficient space for the initial installation and later replacement of individual items of electrical equipment in accordance with Section 132.12 of BS7671 18th Edition + A2 (2022).



Figure 2.28 - Inadequate accessibility for finishing distribution board on third floor



Figure 2.29 - Inadequate accessibility for distribution board on third floor

7.9 Lint & dust inside panel board

This relates to the entire facility.

During the inspection, the cleanliness of electrical panels, distribution boards and electrical containment was assessed.

The inspection revealed a significant accumulation of lint and dust in most of the distribution boards, panels and trunking systems. This issue was specifically observed in main distribution board on the second floor and surgical machines panel on first floor.

The presence of lint and dust inside distribution boards poses several hazards. Accumulated lint and dust can act as fuel for fires if exposed to electrical currents or sparks, significantly increasing the risk of electrical fires. The cooling capacity of electrical components can also be impaired by the presence of dust and lint, leading to overheating.

Additionally, the accumulation of dust and lint can obstruct proper operation and maintenance, thereby impairing the functionality of the electrical components.F-202603-064042

Timeline	Remediation Plan
Medium Term CAP-0075709	All electrical panels and trunking runs shall be inspected and cleaned of any dust or lint in accordance with Section 522.4.2 of BS7671 18th Edition + A2 (2022).
Longer Term CAP-0075710	A regular maintenance procedure shall be established to ensure routine inspection and cleaning of all electrical panels and trunking runs. This will prevent the accumulation of lint and dust, thereby maintaining the safety and efficiency of the electrical systems.



Figure 2.30 - Lint & Dust inside distribution board on second floor



Figure 2.31 - Lint & Dust inside surgical machines panel on first floor

7.10 Lightning Protection System (LPS)

During the inspection, the lightning protection strategy of the factory was assessed.

It was observed that a lightning protection system was provided; however, no risk assessment was conducted, and no study was available to confirm its adequacy.

Lightning strikes can cause significant damage to buildings, primarily through the ignition of fires. When lightning strikes a structure, it can cause an electrical surge that ignites flammable materials. Without a proper lightning protection system (LPS), the energy from a lightning strike can travel through the building's electrical and plumbing systems, creating sparks and starting fires. F-202603-064044

Timeline	Remediation Plan
Medium Term CAP-0075716	Engage a qualified lightning protection specialist to perform a comprehensive risk assessment according to BS EN 62305 (Protection against Lightning) standard. This assessment will determine the necessity of a lightning protection system (LPS) based on factors such as building height, location, occupancy, and the presence of sensitive electronic equipment.
Longer Term CAP-0075717	If the risk assessment concludes that an LPS is necessary, then hire a qualified engineer to perform an adequacy study of the existing LPS. This study should evaluate whether the current system meets the necessary design and performance standards according to BS EN 62305. If the study finds that the current LPS is inadequate, make the necessary upgrades to bring the system up to standard.



Figure 2.32 - Lightning protection system installed at the rooftop of main building

8. Fire Alarm & Detection System (FADS)

8.1 Non-functional or incomplete

This section refers to the entire facility.

During the inspection, the Fire Alarm and Detection System (FADS) for the facility was evaluated.

This section refers to the entire facility.

A conventional but non-operational fire alarm system is installed on the ground floor. Manual call points and smoke detectors were present only at limited locations on the third floor, and the fire alarm system was found missing on the remaining floors. Multiple deficiencies were noted in the installed system, including non-addressable equipment, inadequate detection and visual notification coverage, inadequate placement of manual call points, and the use of non–fire-rated cables, all of which create a significant life-safety risk during a fire emergency.

A non-functional/incomplete FADS significantly increases the risk of worker injury or fatality, substantial property damage, operational disruptions, legal liabilities, reputational damage, and environmental harm.A delayed response during a fire event can significantly increase the impact on personnel, goods, and property.F-202603-064054

Timeline	Remediation Plan
Immediate CAP-0075671	Ensure the functionality and performance of the existing alarm and detection system within the building.
Medium Term CAP-0075672	i. Submit design documentation for the new replacement of FADS system to Pakistan Accord for review before purchasing any new equipment. Design documentation to include drawings, technical data sheets, and product certifications of all listed equipment to show full compliance with the Fire Alarm and Detection System (FADS) with NFPA 72.
Longer Term CAP-0075673	ii. Submit documentation to the Pakistan Accord showing that an L/C has been opened for import of any components required for the FADS design submitted earlier.

Longer Term CAP-0075676	v. Factory to advise Pakistan Accord when FADS installation is fully completed and ready for review. Pakistan Accord will then arrange a verification inspection to ensure that the installation fully complies with the previously reviewed design documentation.
Longer Term CAP-0075674	iii. Submit documentation to the Pakistan Accord demonstrating that all materials, both imported and locally procured, have been purchased and are available on-site for installation.
Longer Term CAP-0075675	iv. Once installation of the FADS system is complete, the factory is to submit full "as-built" documentation of the system to the Pakistan Accord for review.
Longer Term CAP-0075677	vi. Provide full testing and commissioning (T&C) certification from the FADS system installer and make provision for attendance of the system installer, factory technical personnel, and Pakistan Accord technical team to witness a final T&C demonstration verification on site. On successful completion of this T&C verification inspection, remediation of the FADS system will be complete.



Figure 2.33 - Manual call point blocked at stitching on third floor



Figure 2.34 - Fire alarm detection system missing at fourth floor



Figure 2.35 - Fire alarm detection system missing at packing on ground floor



Figure 2.36 - Non operational fire alarm control panel observed at ground floor



Figure 2.37 - Non fire rated cables used for fire alarm devices



Figure 2.38 - Fire alarm detection system missing at export office

9. Emergency Lighting

9.1 Provided but non-functional

The section refers to the entire facility.

During the inspection it was observed that emergency lighting was provided but not functional in the cutting area, heat transfer area, stitching area, printing room, and stairs at third floor.

Functional emergency lighting is critical for providing illumination in the event of a power failure or other emergencies, ensuring that workers can safely evacuate the facility.F-202603-064050

Timeline	Remediation Plan
Medium Term CAP-0075241	Conduct a thorough inspection of all emergency lighting units throughout the facility to identify specific locations and units that are non-functional. This involves checking both the lights and the power sources, including batteries and wiring connections. Repair any faulty emergency lighting units immediately. If repair is not feasible, replace the defective units with new, compliant emergency lighting fixtures to ensure they provide adequate illumination during an emergency.
Longer Term CAP-0075242	Establish a regular maintenance and testing schedule to routinely check the functionality of emergency lighting systems. This should include periodic tests, inspections, and prompt maintenance actions to address any issues. Maintain detailed records of all inspections, tests, repairs, and maintenance activities. Train facility maintenance staff on the procedures for inspecting and maintaining emergency lighting systems to ensure ongoing reliability and compliance with safety standards.



Figure 2.39 - Non-functional emergency sign found in heat transfer area at third floor



Figure 2.40 - Non-functional emergency light found in stitching area at third floor



Figure 2.41 - Non-functional emergency light found in printing room



Figure 2.42 - Non-functional emergency light found at stairs of third floor

9.2 Provided but insufficient

The section refers to the entire facility.

During the inspection, the emergency lighting arrangement throughout the facility was assessed.

The following observations were made:

i. The layouts for emergency lighting were missing. The absence of emergency lighting layouts throughout the facility raises concerns regarding the adequacy of illumination provided during power failures or emergencies.

ii. Several areas lack sufficient emergency lighting and exit signage coverage, particularly along egress routes, stairways, and exit doors. Additionally, non-illuminated exit signs were observed without nearby emergency lights. These issues were specifically observed at the stitching department third floor, storage fourth floor, ground floor stairs, corridors at all floors and accessory store.

iii. External emergency lighting was not provided, preventing people from reaching a place of safety outside the facility during nighttime evacuations.

Adequate and functional emergency lighting throughout the facility is crucial for providing necessary illumination during power failures or other emergencies, ensuring the safe evacuation of workers.F-202603-064051

Timeline	Remediation Plan
Medium Term CAP-0075122	i. Emergency lighting layouts must be developed according to the Building Code of Pakistan Fire Safety Provisions 2016and submitted to Pakistan Accord for review.
Medium Term CAP-0075123	ii. Conduct a comprehensive survey to identify areas lacking adequate emergency lighting. Install additional emergency luminaires and exit directional signage in these areas to meet the coverage requirements specified in the Building Code of Pakistan Fire Safety Provisions 2016, ensuring sufficient illumination for safe evacuation.
Medium Term CAP-0075124	iii. Install external emergency luminaires to enable safe evacuation during hours of darkness, all the way to a safe place outside the building(s).

Longer Term CAP-0075125	Establish a regular maintenance and testing schedule to routinely check the functionality of emergency lighting systems. This should include periodic tests, inspections, and prompt maintenance actions to address any issues. Maintain detailed records of all inspections, tests, repairs, and maintenance activities. Train facility maintenance staff on the procedures for inspecting and maintaining emergency lighting systems to ensure ongoing reliability and compliance with safety standards.



Figure 2.43 - Emergency light and exit sign missing in the corridor of third floor



Figure 2.45 - Emergency light and exit sign missing on the first floor



Figure 2.44 - Emergency light missing at the storage of fourth floor



Figure 2.46 - External emergency lights not provided in the assembly area

9.3 Independent power source

The section refers to the entire facility.

During the inspection, it was observed that the emergency lighting within the facility was not connected in a manner that would ensure automatic activation upon the loss of power to the general lighting in various spaces.

Proper circuitry is crucial to ensure that emergency lighting is automatically activated when general lighting fails. This automatic activation is essential for maintaining sufficient illumination, allowing for the safe evacuation of occupants and preventing panic during power outages. Further the emergency lights and exit signs should be reconfigured to be connected on a dedicated single circuit, which must not include any other load except for the emergency lighting system. According to the Building Code of Pakistan Fire Safety Provisions 2016, emergency lighting systems must be designed to provide immediate illumination in the event of power loss to ensure a clear and safe path for evacuation.

Ensuring that the emergency lighting is integrated with the facility's power system to activate automatically during power failures is critical for life safety. This integration helps prevent hazardous conditions that can arise in the dark, such as trips, falls, and confusion, thereby facilitating orderly and efficient evacuation during emergencies.F-202603-064052

Timeline	Remediation Plan
Medium Term CAP-0075214	Reconfigure the emergency lighting circuitry to ensure that emergency lights activate immediately upon failure of general lighting power, and provide an independent circuit for the emergency lighting system, as required by the Building Code of Pakistan Fire Safety Provisions 2016.
Longer Term CAP-0075215	Establish a regular maintenance and testing schedule to routinely check the functionality of emergency lighting systems. This should include periodic tests, inspections, and prompt maintenance actions to address any issues. Maintain detailed records of all inspections, tests, repairs, and maintenance activities. Train facility maintenance staff on the procedures for inspecting and maintaining emergency lighting systems to ensure ongoing reliability and compliance with safety standards.

9.4 General Lighting

The section refers to the entire facility.

During the inspection, the general lighting throughout the facility was assessed.

Insufficient general lighting was observed on the ground floor.

Insufficient general lighting in several locations can increase the risk of accidents and impede safe evacuation during emergencies, while controlling general lighting via breakers instead of light switches poses operational inefficiencies and safety hazards. This setup can delay emergency responses and heighten the risk of electrical faults or fires due to frequent breaker use. Addressing these issues is crucial for enhancing everyday safety and ensuring effective emergency preparedness in the facility.F-202603-064056

Timeline	Remediation Plan
Medium Term CAP-0075223	Conduct a thorough assessment of lighting throughout the facility to find areas with insufficient illumination. Install additional lighting fixtures in these spots to ensure adequate brightness. Ensure the new lighting design meets safety and efficiency guidelines to provide clear visibility for all tasks and emergency situations.



Figure 2.47 - Insufficient general lighting on ground floor

10. Generator, Transformer & Sub-Station Room

10.1 Working clearance

This sections refers to the electrical switchrooms, generator room(s) and transformer room(s).

During our inspection the working clearances surrounding key electrical equipment was assessed.

It was observed that the main distribution board for Eclipse Sports was installed so close to the adjacent wall that safe access to its components is restricted, especially during operation, maintenance, or emergency shutdown.

Proper working clearance is crucial for ensuring life and fire safety. Adequate clearance allows personnel to safely access and maintain equipment, thereby reducing the risk of accidents or injuries caused by cramped conditions. Insufficient working clearance increases the risk of equipment failure due to limited maintenance access, which can lead to fires or other hazardous situations. F-202603-064053

Timeline	Remediation Plan
Medium Term CAP-0075937	Reorganize the equipment layout to ensure adequate clearance, remove obstructions in pathways, and implement clear floor markings and signage to designate working areas and pathways.
Longer Term CAP-0075938	Conduct regular workspace audits to maintain clearances, update maintenance protocols to include clearance checks, provide personnel training on maintaining clearances, and consider installing adjustable equipment to accommodate flexible positioning.



Figure 2.48 - Insufficient working clearance for main distribution board

10.2 Battery

During the inspection of the battery system, the battery cells, connections, and enclosures were thoroughly examined.

It was observed that several battery terminals were exposed and not properly insulated, increasing the risk of electrical shock or short circuits. This issue was observed on generator batteries, batteries placed on third floor stairs, the corridor of product development department and batteries for surgical manufacturing on first floor.

Proper monthly and annual maintenance of the battery system is crucial for fire safety. Spilled fluid can cause corrosion and fires, while bare terminals increase the risk of electrical shocks and short circuits, potentially igniting fires or explosions. Non-compliant battery placement can obstruct ventilation, leading to hazardous gas buildup and fire risks. Addressing these issues is essential to prevent fires and ensure battery system safety.F-202603-064055

Timeline	Remediation Plan
Medium Term CAP-0075700	Insulate exposed battery terminals using appropriate insulating materials to prevent electrical shock and short circuits. Conduct a thorough inspection of all connections to ensure that there are no immediate risks of exposure.
Longer Term CAP-0075701	Establish a routine inspection and maintenance protocol to regularly check and maintain proper insulation of all battery terminals.



Figure 2.49 - Exposed terminals observed for the batteries of UPS on the ground floor



Figure 2.51 - Exposed terminals observed in product development department on third floor

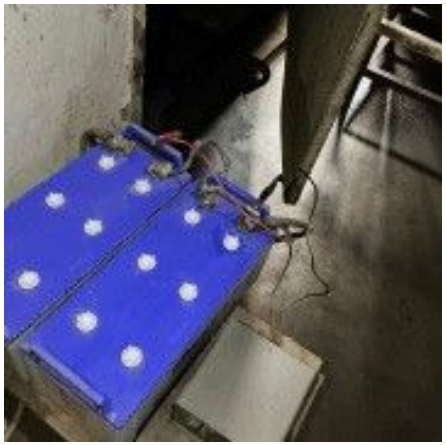


Figure 2.50 - Exposed terminals observed on the generator batteries



Figure 2.52 - Exposed terminals of battery was observed on third floor

11. Cabling & Wiring

11.1 Cable support and protection

This section refers to the entire facility.

During the inspection of the entire facility, a visual survey of the cable containment system was conducted.

Proper supports were not provided for cables; they were laid directly on the ground and hung along the walls. Additionally, several locations had open and exposed electrical connections. Inadequate cable support results in sagging or stress on cables, which can lead to damage or failure. These issues were observed at ground floor in generator room and LT panel area.F-202603-063998

Timeline	Remediation Plan
Medium Term CAP-0075096	Secure cables with appropriate supports and insulate any exposed connections to prevent sagging, stress, and potential hazards. (Reference: BS 7671 18th Edition + A2 (2022) Regulation 522.8.5 for mechanical support and 526.5 for proper terminations).
Longer Term CAP-0075097	Implement a comprehensive cable management system with regular inspections to ensure cables remain properly supported and insulated over time.



Figure 2.53 - Inadequately supported cables laying on the ground in generator area



Figure 2.54 - Inadequately supported cables in the LT panel area

11.2 Cable trench and channel cleanliness

This related to the whole facility.

During the inspection of the facility, it was observed that the cleanliness of the cable trunking system had not been maintained. Numerous trunking systems were found to be filled with a significant amount of fluff and dust, which poses a serious fire risk.

This issue was observed in stitching area at third floor, LT panel area at ground floor and heat transfer area.

Accumulated dust and fluff can ignite when exposed to sparks or high temperatures, potentially leading to a fire hazard. Maintaining a clean cable trunking system is essential to minimise fire risks associated with accumulated debris.F-202603-063994

Timeline	Remediation Plan
Medium Term CAP-0075106	Clean all cable trunking systems to remove accumulated dust and fluff, ensuring that any potential fire hazards are mitigated.
Longer Term CAP-0075107	Implement a regular maintenance schedule that includes routine inspections and cleaning of the cable trunking systems to prevent future accumulation of dust and fluff, thereby maintaining a safe environment and complying with safety standards.



Figure 2.55 - Cable tray filled with dust and debris in stitching on third floor



Figure 2.56 - Cable trench filled with dust and debris in the heat transfer area

11.3 Splicing of cables

This relates to the whole facility.

During the inspection the cable installation was visually surveyed throughout the facility.

The following observations were noted:

i. Cables terminations within panels and switchgears were made without cable lugs, resulting in breaking strands and loose connections. This presents a significant fire risk due to the potential for electrical arcing and overheating, which can ignite nearby materials and cause a fire. Furthermore, loose connections can cause voltage drops and equipment malfunctions, posing a life safety hazard. This issue was observed in distribution boards of cutting, packing and lift.

ii. PVC tape joints were found for the connection of UPS and in distribution board of cargo lift where cables were either damaged or two cables were being joined together. This method of jointing is unreliable and can deteriorate over time, increasing the risk of electrical shorts and fires. The adhesive on PVC tape can degrade, leading to exposed conductors that can spark and ignite surrounding materials, presenting both fire and life safety risks.

iii. Machine power wires were inserted directly into power receptacles without a power plug. This practice is highly dangerous as it can lead to loose connections, electrical shocks, and short circuits. Direct insertion bypasses proper safety mechanisms, significantly increasing the risk of fire and electrical hazards, thereby endangering life safety. This issue was observed at ground floor and at laser cutting area.

iv. Open, exposed, and idle cable connections were found inside the distribution board of the stitching machine at third floor, posing a risk of electric shock, short circuit, and fire.

v. Machine plugs were installed directly into incompatible sockets, creating unsafe electrical connections and increasing the risk of overheating, arcing, and fire. This issue was observed for thread sucker machines and stitching machines.

For any future electrical work, the termination of stranded cables must be done with cable lugs and PVC tape joints shall not be utilized. Proper termination ensures secure and reliable connections, reducing the risk of electrical failures and enhancing overall safety.F-202603-063996

Timeline	Remediation Plan

Medium Term CAP-0075008	i. Install cable lugs on all improperly terminated cables within panels and switchgears to secure connections and prevent breaking strands and loose connections in accordance with Regulation 526.1 of BS7671 18th Edition + A2 (2022).
Medium Term CAP-0075009	ii. Replace all PVC tape joints with proper terminal blocks or connectors to ensure secure and stable connections in accordance with Regulation 526.1 of BS7671 18th Edition + A2 (2022). Replace all damaged cabling with new wiring.
Medium Term CAP-0075010	iii. Replace the directly inserted power wires with proper power plugs to ensure safe and secure connections.
Medium Term CAP-0075011	iv. Remove unused cables or properly terminate and insulate open and exposed connections to eliminate the risk of sparks and potential fires. (Reference: BS 7671 18th Edition + A2 (2022) Regulation 416.1 for basic insulation of live parts).
Medium Term CAP-0075012	v. Stop the use of unsafe plug-in arrangements, provide compatible dedicated sockets for machines (preferably industrial sockets), and enforce safe electrical connection practices.
Longer Term CAP-0075013	i. Implement a standard operating procedure (SOP) requiring the use of cable lugs for all future cable terminations. Regularly train and audit personnel to ensure compliance with this procedure, thus maintaining safe and reliable electrical connections.
Longer Term CAP-0075014	ii. Establish a policy prohibiting the use of PVC tape for electrical jointing. Regularly inspect and maintain electrical installations to ensure compliance, and provide continuous training for staff on proper jointing techniques.
Longer Term CAP-0075015	iii. Develop and enforce a facility-wide electrical safety protocol that mandates the use of power plugs for all equipment. Conduct regular safety audits and provide training sessions to staff to reinforce the importance of using proper power plugs and adherence to electrical safety standards.
Longer Term CAP-0075016	iv. Establish routine inspections to ensure all electrical terminations remain properly insulated and protected from exposure, especially in high-risk operational areas.
Longer Term CAP-0075017	v. Conduct regular safety audits and provide training sessions to staff to reinforce the importance of using proper power plugs and adherence to electrical safety standards.



Figure 2.57 - PVC tape joint observed for conection of UPS



Figure 2.58 - Cable termination without lugs and idle cables observed in stitching distribution board



Figure 2.59 - Machine wires directly inserted into socket at first floor



Figure 2.60 - PVC tape joints observed for cargo lift panel



Figure 2.61 - Improper plug-in connection observed for thread sucker machine at third floor



Figure 2.62 - Bare wires directly inserted into power plug at laser cutting area

11.4 Colour coding

This relates to the whole facility.

During the inspection of several distribution boards, deviations from standard cable colour coding practices were identified. Such deviations pose significant risks, as they can lead to the misinterpretation and misidentification of cables. This misidentification can result in incorrect connections, potentially causing unsafe working conditions and increasing the likelihood of electrical accidents, such as shocks or fires.

This issue was observed in distribution board of packing at third floor, storage at second floor, stitching machines at third floor and cargo lift panel.

To mitigate these risks, it is imperative that all future electrical work strictly adheres to standardized colour coding as prescribed by BS 7671. This will ensure accurate identification of conductors, thereby enhancing overall safety and operational efficiency. F-202603-063997

Timeline	Remediation Plan
Medium Term CAP-0075020	Conduct a comprehensive audit of all distribution boards to identify and correct any deviations from the standard cable colour coding. This involves re-labelling or re-insulating the cables with the appropriate colour codes as specified in BS 7671. Specifically, adhere to BS 7671 Regulation 514.3.1, which mandates the correct identification of conductors.
Longer Term CAP-0075021	Develop and enforce a strict protocol for cable colour coding to be followed for all future installations and maintenance activities. This protocol should include regular training sessions for electricians and maintenance personnel to keep them updated on the latest standards and practices. Additionally, periodic audits should be conducted to ensure ongoing compliance with the standardized colour coding system, thereby preventing future deviations and ensuring sustained safety and operational efficiency.



Figure 2.63 - Incorrect color coding found in the cargo lift panel



Figure 2.64 - Incorrect color coding found in the stitching machine distribution board at third floor



Figure 2.65 - Incorrect color coding found in the distribution board of storage at second floor



Figure 2.66 - Incorrect color coding found in the packing distribution board

11.5 Fixtures

This relates to the whole facility.

During the inspection, the electrical fixtures throughout the facility were visually surveyed.

Broken lighting fixtures were observed on the ground floor. Damaged receptacles with exposed parts can lead to loose connections and increased electrical resistance. This condition can cause overheating, potentially igniting surrounding materials and increasing the risk of electrical fires, posing a serious life safety threat.F-202603-063993

Timeline	Remediation Plan
Medium Term CAP-0074944	Replace or repair broken and exposed lighting fixtures immediately to restore safe and secure connections.
Longer Term CAP-0074945	Implement a preventive maintenance program that includes periodic checks and timely replacement of damaged electrical components to maintain safety standards.



Figure 2.67 - Broken lighting fixture observed on ground floor

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.