Issue	**1**
Factory ID	**26326**
Date of Issue	**28-May-2026**

Eclipse Sports (Pvt.) Ltd.

Pakistan ACCORD
for Health and Safety in the Garment and Textile Industry

Raypur Stop, Wazirabad Road,
51310 Sialkot
Punjab Pakistan

Latitude: [32.477965], longitude: [74.427812]
Date of inspection: 11-Mar-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Ghulam Azam**
Reviewed by	**Shehroz Javed**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 11-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 10
   - 3.1 Building Means of Egress Details 11
   - 3.2 Building Use 12
4. Documentation 14
5. Fire Safety Measures 15
6. Remediation Support 16
   - 6.1 Engineering Support 16
7. Means of Escape 17
   - 7.1 Escape doors 17
   - 7.2 Exit access 19
   - 7.3 Travel distance 22
   - 7.4 Number of exits 23
   - 7.5 Protection of stairs 24
   - 7.6 Escape stair condition 27
   - 7.7 Exit signage 29
8. Fire Rated Construction 31
   - 8.1 Separation of high-risk areas 31
   - 8.2 Separation of shafts 34
   - 8.3 Separation of occupancies 36
   - 8.4 Separation of occupancies 38

8.5 Storage 40
9. Fire Suppression 42
9.1 Standpipe system 42
9.2 Fire pumps 44
9.3 Fire extinguishers 45
10. Hazardous Materials 47
10.1 Chemicals handling 47
10.2 Chemicals storage 49
10.3 Gas storage 51
11. Fire Safety Management 53
11.1 Fire drills 53
11.2 Records of system testing 54
11.3 Records of systems maintenance 55
11.4 Emergency Action Plan 56
12. Assessment Limitations and Assumptions 57

1. Executive Summary

On 11-Mar-2026, Ghulam Azam and Abdul Hayee on behalf of the Pakistan Accord carried out an initial fire inspection for Eclipse Sports (Pvt.) Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Akbar Afridi (Compliance Manager) Mr. Khurram Rasheed (Consultant), along with other staff members of the factory. As the assessment was being conducted as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Accord were also present and the team was led by Haris Mahmood of Pakistan Accord.

The factory operates in single general shift. Factory employs approximately 70 workers with approximately 7% female representation. The factory comprises of a main building in which two floors (3rd and 4th) were rented to Eclipse Sports (Pvt.) Ltd on a tenancy basis, rest of the floors were occupied by a surgical instruments manufacturing company. During the inspection, the building highlighted in blue in Figure 1.1 was surveyed with the site boundary indicated in red.

Main Building is a 6 story above grade plane (B+G+5), basement is not counted as a story, with a covered area (footprint) of 6789 sq. m and with the height of 18 m measured from the fire department vehicle access to the topmost occupied floor. Building has 4 staircases out of which 3 discharge internally. The structural system of the building is a combination of RC moment resisting frame system and structural steel shed. The building is used for security personnel dormitory (basement) surgical instruments manufacturing (Ground, First and Second Floors), cutting, finishing, printing, packing, guesthouse, sublimation, heat-transfer (Third floor), Fabric Store, Kitchen, Open-gymnasium, solar Inverter, steamer (Fourth Floor) and workers residence, birds cages, water tank (Roof). The construction year of the building is 2014.

We were not presented with any documents except site Layouts, documents listed in Table 2.
A summary of the main concerns identified during the inspection includes (non-exhaustive):
- Lockable mechanisms observed in escape route across the whole facility.
- Travel Distances exceeding permitted limits.
- There is no fire separation between stairs, lift shafts and the rest of the building.
- Escape routes are not adequately fire separated from adjoining high-risk areas.
- Storage areas are not fire separated from the rest of the building.
- Sleeping areas found inside facility.
- Main Building is not protected by Standpipe system.
- Fire pumps set is not installed.

Note: As per factory, Eclipse sport is tenant to the surgicon business. From Fire safety the entire building will be in scope of this inspection report.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes).

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents



Figure 1.1. Site plan (Satellite view) - Red dashed line indicates site boundary, highlighted (blue) area indicated area inspected

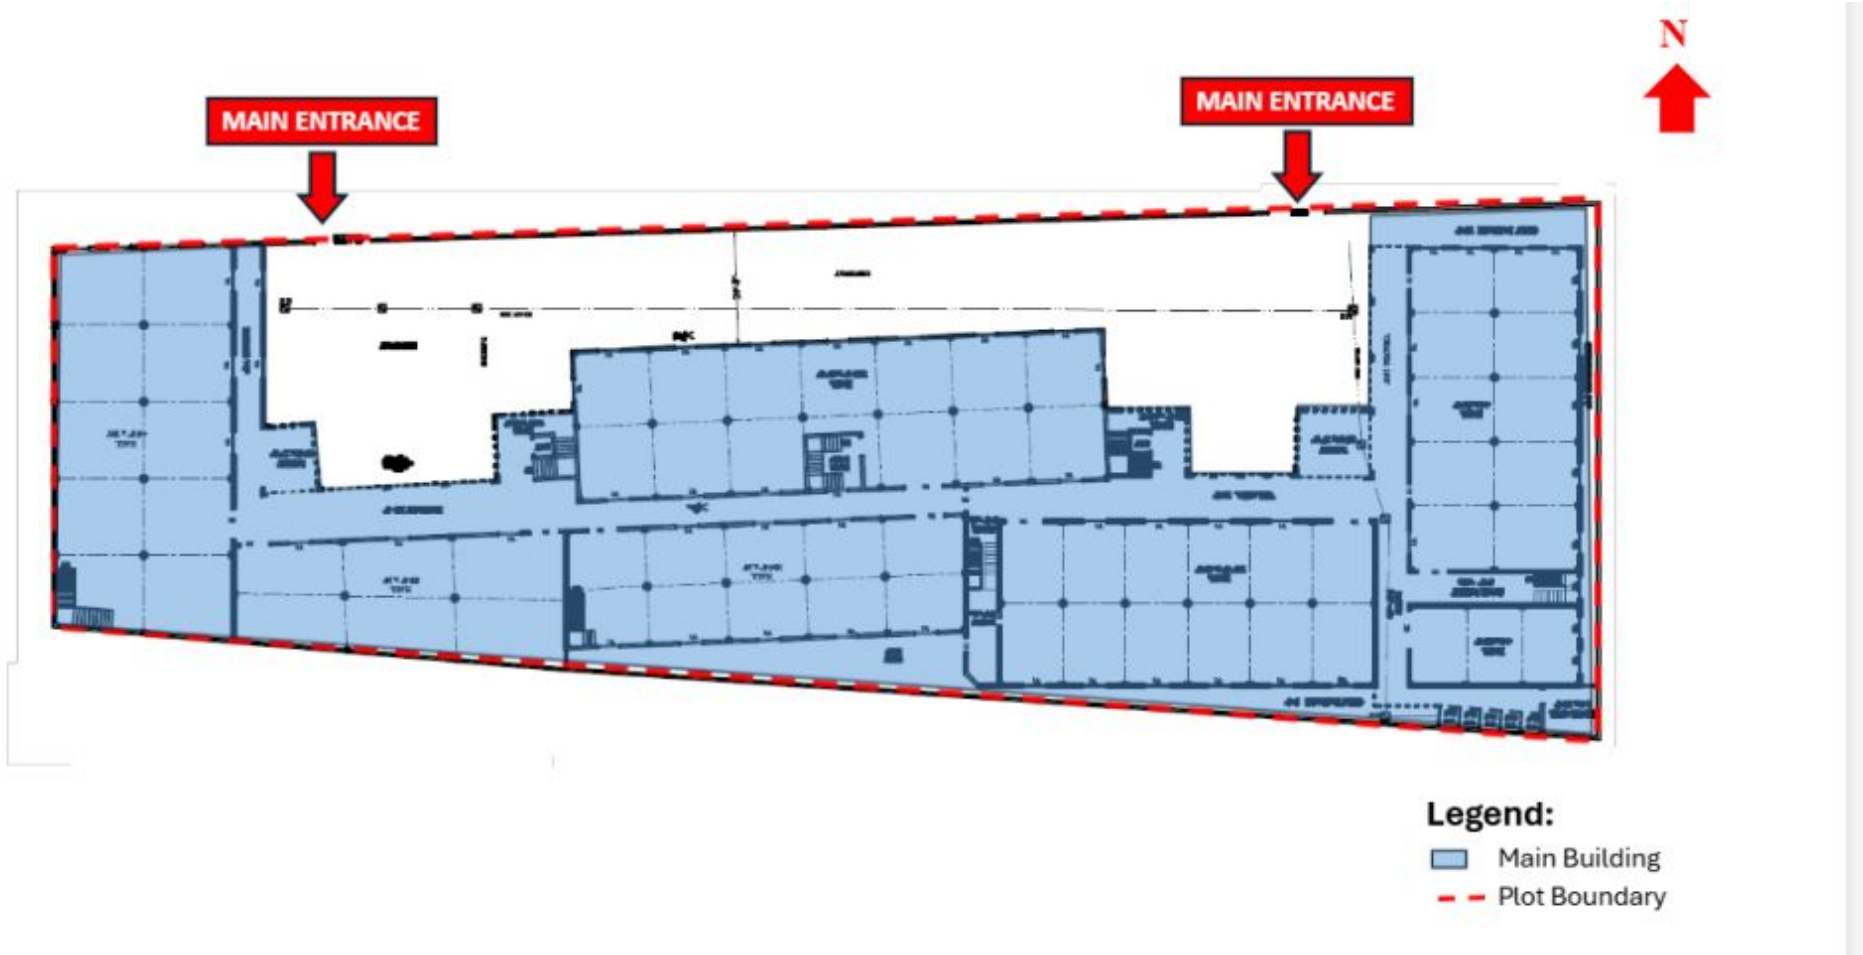


Figure 1.2. Site Layout

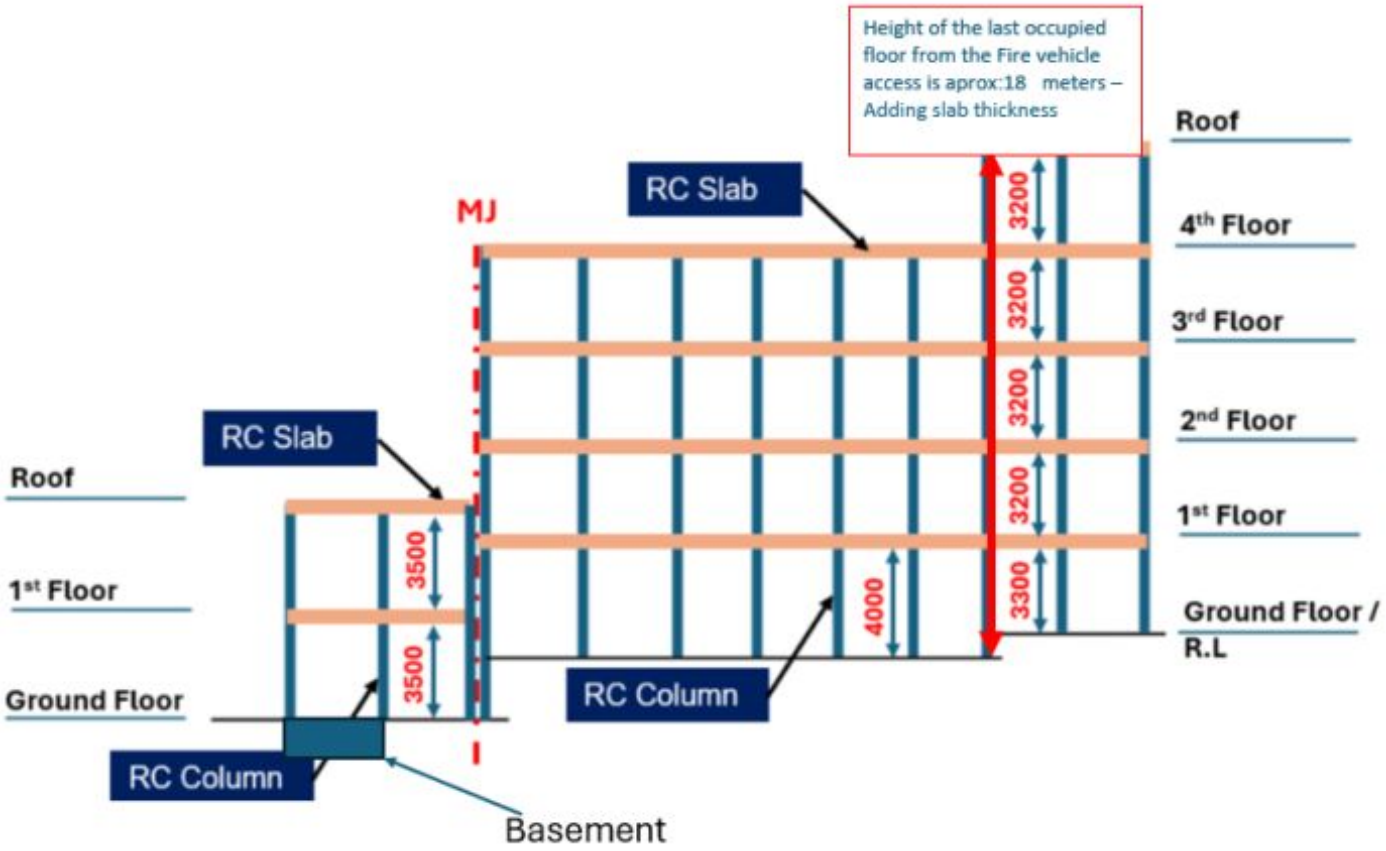


Figure 1.3. Section layout-Main building

3. Building Description

Main Building is a 6 story above grade plane (B+G+5), basement is not counted as a story, with a covered area (footprint) of 6789 sq. m and with the height of 18 m measured from the fire department vehicle access to the topmost occupied floor. Building has 4 staircases out of which 3 discharge internally. The structural system of the building is a combination of RC moment resisting frame system and structural steel shed. The building is used for security personnel dormitory (basement) surgical instruments manufacturing (Ground, First and Second Floors), cutting, finishing, printing, packing, guesthouse, sublimation, heat-transfer (Third floor), Fabric Store, Kitchen, Open-gymnasium, solar Inverter, steamer (Fourth Floor) and workers residence, birds cages, water tank (Roof). The construction year of the building is 2014.

Note: As per factory, Eclipse sport is tenant to the surgicon business. From Fire safety the entire building will be in scope of this inspection report.

3.1 Building Means of Egress Details

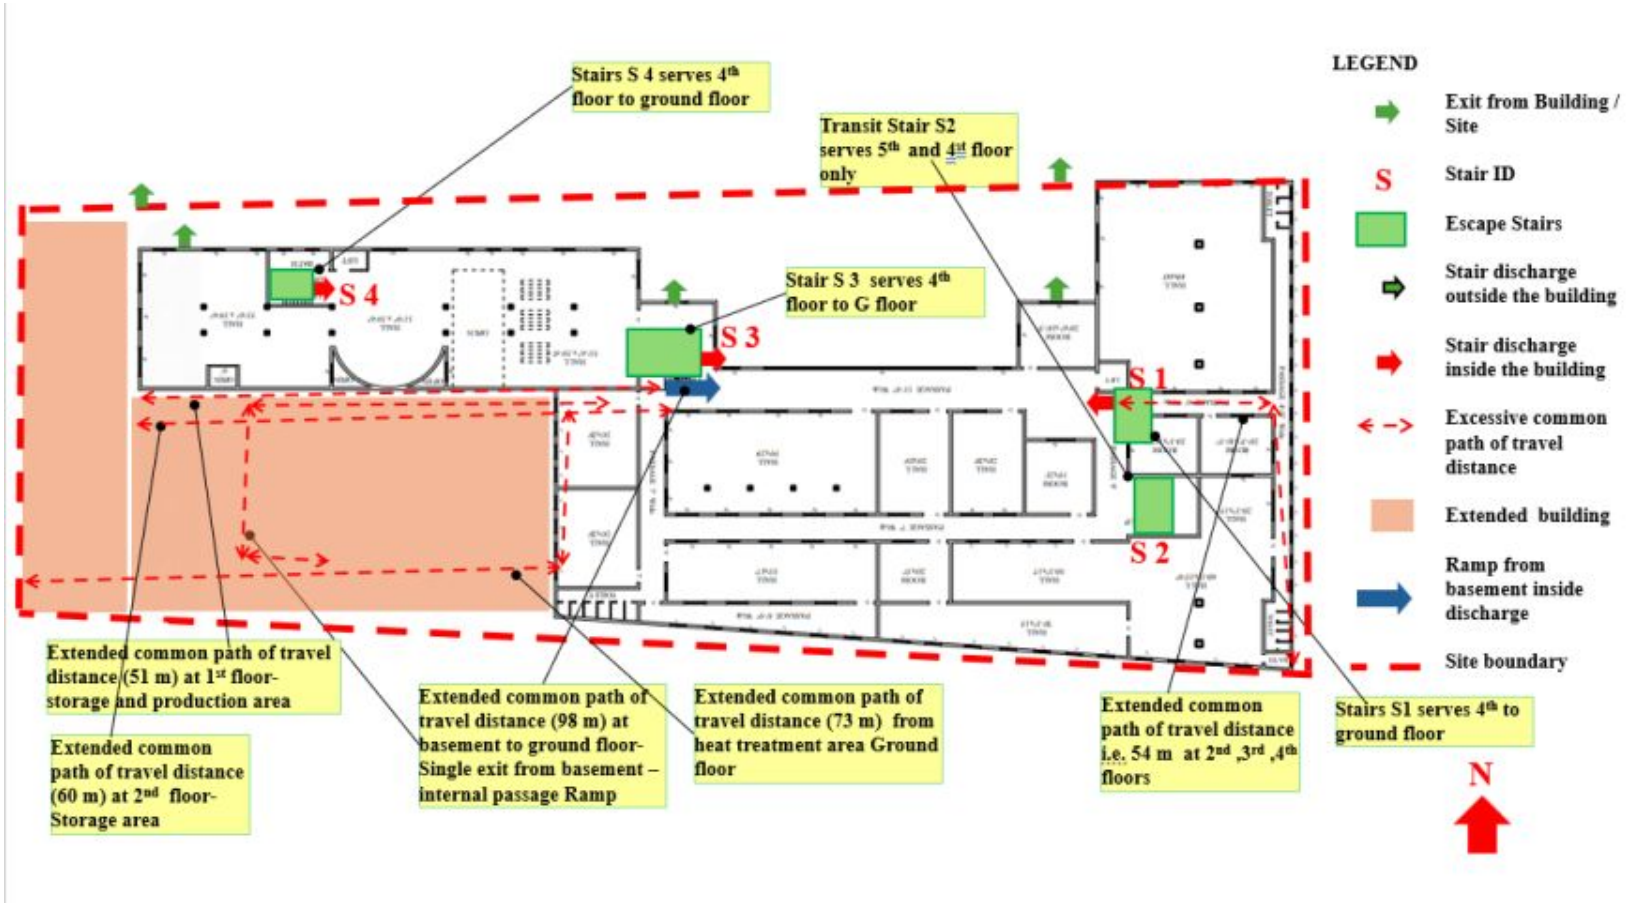


Figure 1.4. Main building-Means of Egress

3.2 Building Use

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Main building- Basement floor	Sleeping	10	1	-	-	-
	Surgical manufacturing, Storage	50	1	-	98m.73m	-
Main Building- Ground Floor	Surgical manufacturing, Offices,milling, dispatch, QC, Packing, Store	100	3	-	-	-
Main Building- 1st floor	Surgical manufacturing, Forgery store	50	3	-	51m	-
Main Building- 2nd floor	Store,filing of surgical instrument	50	3	-	60m, 54m	-
Main Building- 3rd Floor	Cut to pack, Guest house, Sublimation, Printing, Heat transfer	100	3	-	54m	-
Main Building- 4th Floor	Fabric store,canteen, kitchen	20	3	-	54m	-

Main Building- Roof /5th Floor	Dormitory,birds nest	5	1	-	-	-

There is sufficient exit capacity and number of exits along with travel distance issues observed in the building-Mentioned in table above.

4. Documentation

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defense Certificate (NOC)		No	-	-
2.	Architecture Layout		No	-	-
3.	Sectional Layout		No	-	-
4.	Evacuation Maps		No	-	-
5.	Emergency Action Plan		No	-	-
6.	Inspection	Fire extinguishers	No	-	-
		Exit signage	No	-	-
7.	Testing	Fire extinguishers	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Fire extinguishers	No	-	-
		Exit signage	No	-	-
9.	Evidence of Fire Drills		No	-	-
10.	Staff Training		No	-	-

5. Fire Safety Measures

During our fire site inspection of Eclipse Sports (Pvt.) Ltd., a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Eclipse Sports (Pvt.) Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-065500

Timeline	Remediation Plan
Immediate CAP-0077544	Factories should begin remediation of CAP items—such as installing extinguishers, signage, and clearing escape routes—using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Sliding doors shall not serve for escape from areas with more than 10 occupants

This is not always achieved, examples include (list not exhaustive):
- Escape doors are lockable- Main building all floors.
- Sliding doors serve for escape from areas with more than 10 occupants. Main building-3rd floor.

Recommended remedial actions are provided below.F-202603-064171

Timeline	Remediation Plan
Immediate CAP-0075415	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0075416	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5. Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, which are side swinging and open in the direction of travel to an exit.
Longer Term CAP-0075417	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Main building-3rd floor-lockable and sliding door .



Figure 2.2 - Main building-2nd floor-lockable door.

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.

This is not always achieved, examples include (list not exhaustive):
- Obstructions on escape route-Main building-3rd floor-production area,2nd floor, Ground floor-security room -High step approx.:0.3 m high.
-Trip hazards on escape route-Main building-4th floor.
- Protected stair discharges inside the building at a distance from building exit-Main building -Stair S1,S-3,S-4.

Recommended remedial actions are provided below.F-202603-064184

Timeline	Remediation Plan
Immediate CAP-0075343	-Remove obstructions on escape routes and keep them clear for escape. -Remove trip hazards from escape routes and keep them clear.
Medium Term CAP-0075344	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks).

Longer Term CAP-0075345	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted.



Figure 2.3 - Main building-Stair S-1 discharge inside building.



Figure 2.4 - Main building -Ground floor-Security room -Exit access obstruction due to high step aprox: 0.3 m high



Figure 2.5 - Main building-4th floor-trip hazard



Figure 2.6 - Main building -3rd floor-Obstruction due to door



Figure 2.7 - Main building -3rd floor -Obstructions in exit access.



Figure 2.8 - Main building-4th floor-trip hazard .

7.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Standard. The standard provides limitations on:
- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.

This is not always achieved, examples include (list not exhaustive):
- Common path of travel distances exceed permitted limits-Main building-Basement storage -98 m basement, Ground floor-73 m common path from heat treatment area,2nd floor -Storage-60 m, 3rd floor-Packing rear side -wash room area-54 m ,2nd floor ,1st floor, storage side near S-4-common path is 54 m,1st floor near to S-3 -Common path is 51m.

Recommended remedial actions are provided below.F-202603-064181

Timeline	Remediation Plan
Immediate CAP-0075412	Reduce the common path of travel distance to a maximum of 46 m in the areas with higher common path of travel or vacate the area until the travel distance is reduced.
Medium Term CAP-0075413	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Standard.
Longer Term CAP-0075414	Implement the plan previous reviewed by Pakistan Accord and ensure all travel distances to emergency exits meet the requirements of the Pakistan Accord Standard.

7.4 Number of exits

Per Pakistan Accord Standard, the exit provisions should meet the following:
- Minimum 2 exits from every occupied floor.

This is not always achieved, examples include (list not exhaustive):
- Single exit from some of the occupied floors- Main building -basement and 5th floor.

Recommended remedial actions are provided below.F-202603-064180

Timeline	Remediation Plan
Medium Term CAP-0075352	Review each floor and area to ensure that the number of exits complies with Pakistan Accord Standard. Develop plans and drawings to provide additional exits where necessary. Submit the plan and drawings to Pakistan Accord for review and approval prior to commencing rectification works.
Longer Term CAP-0075353	Implement the above plan as agreed with Pakistan Accord. Number of exits from all floors and parts of the building should comply with Pakistan Accord Standard.

7.5 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- Stair discharge routes should be protected to the same level of safety as the stair.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Missing fire rated enclosure and fire doors in stair-Main building-All stairs.
- Fire load in stairs-Main building -S-1-4th floor.
-Unprotected openings -Main building-Stair S-4.
-Main building-3rd floor-Fire load and electric services passing through stairs .

Recommended remedial actions are provided below.F-202603-064183

Timeline	Remediation Plan
Immediate CAP-0075346	Remove fire load and any other obstructions due to stored items from stairs
Medium Term CAP-0075347	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.
Longer Term CAP-0075348	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.9 - Main building-3rd floor-Fire load and electric services passing through stairs .



Figure 2.10 - Main building-Stair S-1 -Missing fire rated enclosure.



Figure 2.11 - Main building-Stair S-4-Unprotected openings

7.6 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):

- There are no handrails-Main building-Stair S-4.S-3,S-1
- Stair steps are not as per standard-Main building-Stair S-4.

Recommended remedial actions are provided below.F-202603-064185

Timeline	Remediation Plan
Medium Term CAP-0075342	Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height. Ensure stairs steps as per standard .



Figure 2.12 - Main building-Stair S-4-broken steps and missing hand rails.

7.7 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at entry into stairs-Main building.
- Missing exit signs at stair discharge routes-Main building.
- Missing exit signs in corridors and circulation areas-Main building.
- Missing exit signs in production areas-Main building.
- Missing exit signs at roof

Recommended remedial actions are provided below.F-202603-064182

Timeline	Remediation Plan
Medium Term CAP-0075350	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0075351	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.13 - Main building-3rd floor-Production area-Missing exit signs.



Figure 2.14 - Main building -3rd floor-Missing exit signs -Entry into stairs-Circulatory areas-Production areas.



Figure 2.15 - Main building-Missing exit signs at roof .

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Electrical rooms are not fire separated from Storage Block and production-Main building -3rd floor, Ground floor.
-UPS & Batteries not fire separated from production- Main building-3rd floor.
- Generator room is not fire separated- Main building-Ground floor.
-Mechanical plant is not fire separated from adjoining areas- Main building-1st floor-Electric welding plant not fire separated from adjoining areas. Main building-3rd floor-Air Compressor not fire separated from production, Main building-Ground floor-Heat treatment area - Not fire separated from production.
Kitchen is not fire separated from rest of building-Main building-4th floor,Main building-Ground floor-Security room sleeping area .

Recommended remedial actions are provided below.F-202603-064161

Timeline	Remediation Plan
Medium Term CAP-0075380	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g. storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms. - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction).
Longer Term CAP-0075381	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.16 - Main building-1st floor-Electric welding plant not fire separated from adjoining areas



Figure 2.18 - Main building-3rd floor-UPS-Batteries storage not fire separated from production.



Figure 2.17 - Main building-Ground floor-Security room -Kitchen is not fire separated from rest of the building.



Figure 2.19 - Main building-1st floor -Air compressor area is not fire separated from production.



Figure 2.20 - Main building-Ground floor -High voltage electric panel not fire separated from office .



Figure 2.22 - Main building-3rd floor-Electric panels not fire separated from production.



Figure 2.21 - Main building-Ground floor-Generators not fire separated .

8.2 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):

- Lift shafts are not separated with fire rated construction-Main building
- Duct shafts are not fire separated-Main building

Recommended remedial actions are provided below.F-202603-064162

Timeline	Remediation Plan
Medium Term CAP-0075384	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction).
Longer Term CAP-0075385	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.23 - Main building-Duct shafts are not fire separated.



Figure 2.24 - Main building lift shafts are not fire separated .

8.3 Separation of occupancies

Residential sleeping areas should comply with special measures required for sleeping occupancies. Such measures include:
- Fire separation of dormitories from other occupancies.
- Providing a minimum of 2 escape routes from the above ground levels.
- Providing an automatic fire detection and alarm system.
- Fire separation of cooking facilities/kitchens from the remainder of the dormitory.

The following deficiencies have been observed on site, including (list not exhaustive):
- Locking devices on doors do not allow for free escape under all circumstances- Main building-2nd floor,5th floor,1st floor, Ground floor-security.
- No adequate automatic fire detection and alarm system-Main building-2nd floor,5th floor,1st floor, Ground floor-security.
- Above ground levels lack an alternative escape route-Main building-2nd floor,5th floor,1st floor, Ground floor-security.
- Cooking facilities and/or kitchens not adequately fire separated-Main building-2nd floor,5th floor,1st floor, Ground floor-security.
- Lack of fire rated separation between the dormitory and other occupancy types-Main building-2nd floor,5th floor,1st floor, Ground floor-security.

Recommended remedial actions are provided below.F-202603-064160

Timeline	Remediation Plan
Immediate CAP-0075338	The dormitory is not to be used until minimum requirements for sleeping occupancies have been provided. Alternative arrangements must be sought immediately for the dormitory as continuing the use of the building for this purpose is not appropriate. Dormitory not to be re-occupied until the minimum requirements have been implemented.
Medium Term CAP-0075339	Document proposals for design of remedial measures to ensure compliance with all fire safety requirements for sleeping occupancies to comply with Pakistan Accord Standard. Submit proposals to Pakistan Accord for review.
Longer Term CAP-0075340	Implement remediation measures to ensure full compliance with dormitory requirements of Pakistan Accord Standard and Pakistan Building Code in accordance with previously reviewed design.



Figure 2.25 - Main building-5th floor -sleeping area



Figure 2.26 - Main building-2nd floor- sleeping area

8.4 Separation of occupancies

Pakistan Accord Standard requires different occupancy types to be fire separated from each other. The aim is to limit the fire to only one occupancy type.

The following deficiencies have been observed on site, including (list not exhaustive):
- Basement is not fire separated from the rest of the building-Main building.
- Car park areas are not fire separated from the rest of the building-Main building-Ground floor.
- Large office areas not fire separated from the production areas-Main building-3rd floor.

Recommended remedial actions are provided below.F-202603-064163

Timeline	Remediation Plan
Medium Term CAP-0075388	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Different occupancy types in the building. - Proposed fire separation details (including fire rating of walls and doors).
Longer Term CAP-0075389	Provide fire rated separation between occupancies as per proposal reviewed by Pakistan Accord.



Figure 2.27 - Main building-Ground floor -Car parking is not fire separated from production .



Figure 2.28 - Main building-3rd floor -Offices and production areas not fire separated .

8.5 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area.
- Storage height is less than 2.45m.
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building- Main building -3rd floor Accessory, 2nd floor -cutting area-waste storage not fire separated from production.
- Presence of areas where storage does not meet miscellaneous in-process storage requirements (listed above)-2nd floor -Cutting area

Recommended remedial actions are provided below.F-202603-064158

Timeline	Remediation Plan
Medium Term CAP-0075330	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction).
Longer Term CAP-0075331	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard.



Figure 2.29 - Main building-2nd floor- Excess storage in cutting area



Figure 2.30 - Main building -3rd floor- Accessory store is not fire separated from production

9. Fire Suppression

9.1 Standpipe system

Per Pakistan Accord Standard a Class-I standpipe systems is required in the building. The system should be designed and installed in accordance with NFPA 14.
Main Building requires standpipe system due to height of the topmost occupied floor exceeding 15m.

The following deficiencies have been observed on site, including (list not exhaustive):
- There are no standpipes in the building-Main building -

Recommended remedial actions are provided below.F-202603-064172

Timeline	Remediation Plan
Medium Term CAP-0078760	(1) Submit design documentation for a standpipe system (along with required pump system) and supporting infrastructure to Pakistan Accord for review before purchasing any new equipment. Design documentation to include drawings, technical data sheets, and product certification of all listed equipment to show full compliance of the Suppression System (SUPS) with NFPA 13, NFPA 14, 20, 22, and 24
Medium Term CAP-0078660	(2) Submit documentation to Pakistan Accord showing that an L/C has been opened for import of any components required for the SUPS design submitted earlier.
Longer Term CAP-0078661	(3) Submit documentation to Pakistan Accord demonstrating that all materials, both imported and locally procured, have been purchased and are available on site for installation of the SUPS.
Longer Term CAP-0078662	(4) Once installation of the SUPS system is complete, factory to submit full "as-built" documentation of the system to Pakistan Accord for review.
Longer Term CAP-0078663	(5) Factory to advise Pakistan Accord when SUPS installation is fully completed and fully functional. Pakistan Accord will then arrange a verification inspection to ensure that the installation fully complies with the previously reviewed design documentation.

Longer Term CAP-0078664	(6) Provide full testing and commissioning (T&C) certification from the SUPS system installer and make provision for attendance of the system installer, factory technical personnel, and Pakistan Accord technical team to witness a final T&C demonstration verification on site. On successful completion of this T&C verification inspection, remediation of the SUPS system will be complete.

9.2 Fire pumps

Per Pakistan Accord Standard, a complete fire pump set is required. The pump set should be designed and installed in accordance with NFPA 20. The system should comprise of a) Electric pump (Main), b) Diesel Pump (Back-Up), and c) Jockey Pump. Each pump should be provided with individual drivers and controllers. Pumps shall be installed with positive suction. These measures are intended to provide a level of resilience whereby a failure of a pump or lack of power in the building will not compromise fire water supply in the building.

The following deficiencies have been observed on site, including (list not exhaustive):

- There is no diesel pump.
- There is no main electric pump.
- There is no jockey pump.

Recommended remedial actions are provided below.F-202603-064169

Timeline	Remediation Plan
Longer Term CAP-0075371	Provide electric duty pump, diesel backup fire pumps, and jockey pumps, together with individual drivers and controllers, in accordance with NFPA 20 as part of the supporting infrastructure to the SUPS system by following the steps (1) to (6) above.

9.3 Fire extinguishers

Extinguisher coverage and type of extinguishers used should comply with NFPA 10.

The following deficiencies have been observed on site, including (list not exhaustive):
- Insufficient coverage of fire extinguishers-Main building-3rd floor,2nd floor.

Recommended remedial actions are provided below.F-202603-064175

Timeline	Remediation Plan
Medium Term CAP-0075368	Ensure that all building areas are protected using fire extinguishers. The coverage and type of extinguishers used should follow NFPA 10.
Longer Term CAP-0075369	Monitor fire extinguishers for coverage and extinguisher type to comply with NFPA 10.



Figure 2.31 - Main building-3rd floor-Screen printing area -Fire extinguisher not installed.



Figure 2.32 - Main building-3rd floor-Screen printing area -Fire extinguisher not installed.

10. Hazardous Materials

10.1 Chemicals handling

Chemical handling procedures should follow the best international practice.

The following deficiencies have been observed on site, including (list not exhaustive):
- Unsafe handling procedures-Main building-3rd floor-screen printing area.
Recommended remedial actions are provided below."F-202603-064179

Timeline	Remediation Plan
Medium Term CAP-0075354	Develop a chemical handling strategy for the building. Identify dangerous chemicals, how they will be used and handled, the standards that will be followed, and the people responsible for the implementation of the strategy. Submit to Accord for review.
Longer Term CAP-0075355	Implement the chemical handling strategy on site as agreed with Accord.



Figure 2.33 - Main building-3rd floor- Lack of chemicals handling SOPs

10.2 Chemicals storage

This relates to storage, handling, and use of flammable chemicals and combustible liquids and solids.
Chemical storage areas should be fire separated from the rest of the building. Adequate ventilation should be provided.

The following deficiencies have been observed on site, including (list not exhaustive):
- Flammable materials are not stored in a fire separated room-Main building -2nd floor.
- Inadequate ventilation of chemical storage areas-Main building -2nd floor.

Recommended remedial actions are provided below.F-202603-064177

Timeline	Remediation Plan
Medium Term CAP-0075372	Factory to collect MSDS sheets for all chemicals stored, classify materials, and propose storage arrangements to meet NFPA 30 requirements. Prepare drawings showing the proposed chemical storage areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all chemical storage areas - Locations of fire rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction) - Ventilation provisions to each of these rooms
Longer Term CAP-0075373	Implement the above plan on site. All chemical storage areas to be compliant with Pakistan Accord Standard.



Figure 2.34 - Main building-2nd floor-Chemicals storage is not as per standard.

10.3 Gas storage

Flammable gas storage areas should be fire separated from the rest of the building. Adequate ventilation should be provided.

The following deficiencies have been observed on site, including (list not exhaustive):
- Gas storage areas are not fire separated from the rest of the building-Main building-Ground floor-Heat treatment area, Near Generator area,1st floor.
- Inadequate ventilation of Gas storage areas-Main building-Ground floor-Heat treatment area, Near Generator area.1st floor.

Recommended remedial actions are provided below.F-202603-064174

Timeline	Remediation Plan
Medium Term CAP-0075382	Prepare drawings showing gas storage areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of gas storage areas - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction) - Ventilation provisions to each of these rooms
Longer Term CAP-0075383	Implement the above plan on site. All gas storage areas to be compliant with Pakistan Accord Standard.



Figure 2.35 - Main building-Ground floor-Gas storage inside building,



Figure 2.36 - Main building-Ground floor-Heat treatment area -Gas storage.

11. Fire Safety Management

11.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- No evidence of fire drills.

Recommended remedial actions are provided below.F-202603-064166

Timeline	Remediation Plan
Medium Term CAP-0075400	Conduct a fire drill and make records, including findings and recommend future improvements.
Longer Term CAP-0075401	Ensure fire drills are performed at a minimum of 2 times per year.

11.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire Extinguishers.
- No records of testing of Exit signage.

Recommended remedial actions are provided below.F-202603-064170

Timeline	Remediation Plan
Medium Term CAP-0075410	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0075411	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

11.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of maintenance of Fire Extinguishers.
-No records of maintenance of exit signs.
Recommended remedial actions are provided below.F-202603-064168

Timeline	Remediation Plan
Medium Term CAP-0075419	Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Pakistan Accord for review and approval.
Longer Term CAP-0075420	Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

11.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023. Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid firefighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):
- Escape diagrams are missing on some levels-Main building.
- There is no EAP document which details procedures, roles and responsibilities in the event of fire.
Recommended remedial actions are provided below.F-202603-064176

Timeline	Remediation Plan
Medium Term CAP-0075378	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0075379	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.