Issue	**1**
Factory ID	**25959**
Date of Issue	**28-May-2026**

FA Bhatti Industries


Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

4 Norgate Street Cantt Road
51310 Sialkot
Punjab Pakistan

Latitude: [32.506017], longitude: [74.553019]
Date of inspection: 16-Mar-2026

Fire Safety Inspection Report

Observations & Actions

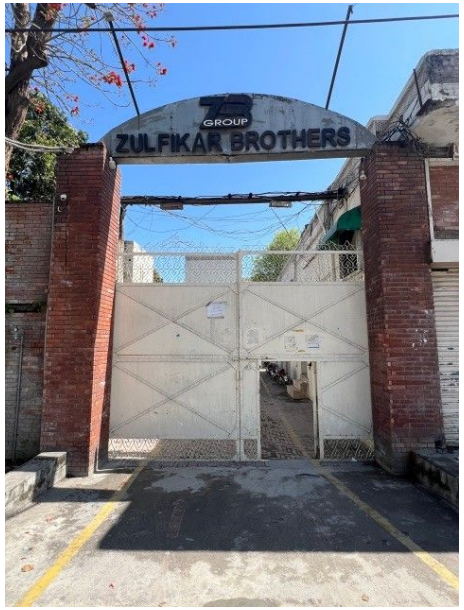

Authors	**Shehroz Javed**
Reviewed by	**Muhammad Imran**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 16-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 8
3. Building Description 10
   - 3.1 Building Means of Egress Details 12
   - 3.2 Building Use 13
4. Documentation 16
5. Fire Safety Measures 17
6. Remediation Support 18
   - 6.1 Engineering Support 18
7. Means of Escape 19
   - 7.1 Escape doors 19
   - 7.2 Exit access 22
   - 7.3 Travel distance 25
   - 7.4 Number of exits 26
   - 7.5 Protection of stairs 27
   - 7.6 Escape stair condition 30
   - 7.7 Exit discharge 32
   - 7.8 Exit signage 34
8. Fire Rated Construction 36
   - 8.1 Separation of high-risk areas 36
   - 8.2 Separation of occupancies 38
   - 8.3 Separation of occupancies 40

8.4 Separation of occupancies..... 42
8.5 Storage..... 44
9. Fire Suppression..... 46
9.1 Fire extinguishers..... 46
10. Fire Safety Management..... 48
10.1 Fire drills..... 48
10.2 Records of system testing..... 49
10.3 Records of systems maintenance..... 50
10.4 Emergency Action Plan..... 51
11. Assessment Limitations and Assumptions..... 52

1. Executive Summary

On 16-Mar-2026, Shehroz Javed and Muhammad Naseer on behalf of the Pakistan Accord carried out an initial fire inspection for FA Bhatti Industries, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with Mr. Azhar Iqbal (General Manager), Mr. Muhammad Afzal (Manager HR) and other staff members of F. A. Bhatti Industries. As the assessment was being carried out as part of an overall Structural, Fire, and Electrical initial inspection, other representatives from Accord were also present and the team was led by Engr. Haris Mahmood of Pakistan Accord.
The complete facility comprises of nine main buildings and three ancillary structures. Out of nine, two main buildings are owned by F. A. Bhatti Industries while the rest of the buildings are owned by ZB (Zulfiqar Brothers) Group. During the inspection, the buildings highlighted in blue in Figure 1.1 were surveyed with the site boundary indicated in red.

- **Main Buildings:**

Building 1 is a single-storey (Ground Only) building. The structural system of the building is load bearing brick masonry walls supporting RC Slab and precast girders and slab panels. The building has covered area (footprint) of 317 sq. m. The building is used for offices, pattern R&D section (Ground Floor). The construction year of the building is 1995.
Building 2 is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting RC Slab and precast girders and slab panels. The building has covered area (footprint) of 469 sq.m. Building has 3 staircases among which one discharges internally. The building is used for office, storage, cutting, pressing & raw store (Ground Floor) and stitching, checking, packing (1st Floor). The construction year of the building is 1995. However, an extension (horizontal and vertical) was done in 2020.
Building 3 is a single-storey (Ground Only) building. The structural system of the building is load bearing brick masonry walls supporting RC Slab and precast girders and slab panels. The building has covered area (footprint) of 90 sq. m. The building is used for mini-accessory store, conference room and offices (Ground Floor). The construction year of the building is 1995.
Building 4 is a single-storey (Ground Only) building. The structural system of the building is load bearing brick masonry walls supporting fibreglass sheeting. The building has covered area (footprint) of 256 sq. m. The building is used for Stitching (Ground Floor). The construction year of the building is 1995.
Building 5 is a single-storey (Ground Only) building. The structural system of the building is a load bearing brick masonry walls supporting precast girders and slab panels, and T-iron and brick slab. The building has covered area (footprint) of 30 sq. m. The building is used for offices & kitchen (Ground Floor). The construction year of the building is 1995.
Building 6 is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting steel, wooden batten and brick slab. The building has covered area (footprint) of 140 sq. m. Building has 1 staircase which discharges externally. The building is used for cutting (Ground Floor) and stitching (1st Floor). The ground floor of the building was constructed in 1995 and 1st floor was constructed in 1997.
Building 7 is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting steel,

wooden batten and brick slab. The building has covered area (footprint) of 108.18 sq. m. Building has 2 staircases which discharge externally. The building is used for cutting (Ground Floor) and waste storage(1st Floor) . The ground floor of the building was constructed in 1995 and 1st floor was constructed in 1998.

Building 8 is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting precast girders and slab panels. The building has covered area (footprint) of 203.67 sq. m. Building has 1 staircase which discharges internally. The building is used for packing, checking (Ground Floor) and stitching (1st Floor). The ground floor of the building was constructed in 1995 and 1st floor was constructed in 1998.

Building 9 is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting precast girders and slab panels mainly and some portion consist of T-iron and brick slab. The building has covered area (footprint) of 189 sq. m. Building has 2 staircases among which one discharge externally. The building is used for packing, checking, storage, generator & LT room (Ground floor) and stitching (1st Floor). The ground floor of the building was constructed in 1995 and 1st floor was constructed in 1998.

- **Ancillary Structures**:

Toilet Block is a single storey (Ground Only) structure. The structural system of the structure is load bearing brick masonry walls supporting RC Slab. The structure is used as a toilets. The construction year of the structure is unknown.

Parking / Storage Shed is a single storey (Ground only) structural steel shed. The structure is used for parking, waste storage and steamer. The construction year of the structure is unknown.

Prayer Area is a single storey (Ground only) structural steel shed. The structure is used for prayer. The construction year of the structure is unknown.

The factory operates in single general shift. Factory employs approximately 150 workers with no female representation.

We were presented with site layout which were not duly signed by the Authority Having Jurisdiction and floor and section layouts were also missing. No data regarding evacuation plan, emergency action plan, inspection record of fire extinguisher and fire drill record was provided at the time of the inspection.

A summary of the main concerns identified during the inspection includes (non-exhaustive):

- Lockable mechanisms observed in escape route across the whole facility.
- Travel Distance exceeding permitted limits in Building 4.
- There is no fire separation between stairs and the rest of the building.
- Multiple stairs discharge inside the building.
- Escape routes are not adequately fire separated from adjoining high-risk areas.
- Storage areas are not fire separated from rest of the building.
- Sleeping areas were found in Building 3 & Building 9.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes.)

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents



Figure 1.1. Satellite View

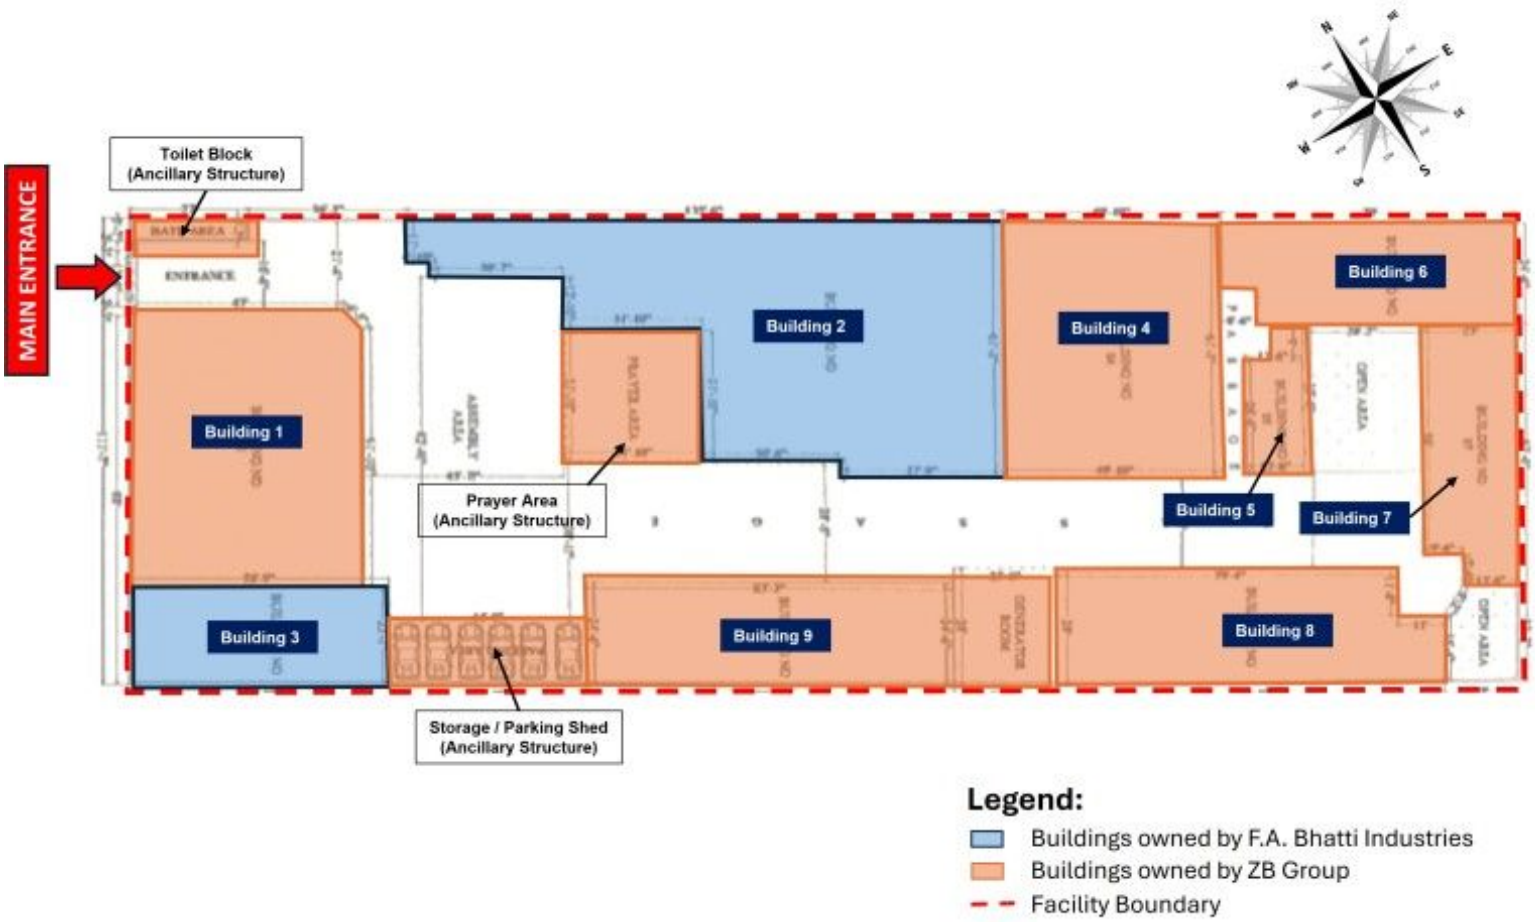


Figure 1.2. Site layout

3. Building Description

The complete facility comprises of nine main buildings and three ancillary structures. Out of nine, two main buildings are owned by F. A. Bhatti Industries while the rest of the buildings are owned by ZB (Zulfiqar Brothers) Group.

- **Main Buildings:**

Building 1 is a single-storey (Ground Only) building. The structural system of the building is load bearing brick masonry walls supporting RC Slab and precast girders and slab panels. The building has covered area (footprint) of 317 sq. m. The building is used for offices, pattern R&D section (Ground Floor). The construction year of the building is 1995.

Building 2 is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting RC Slab and precast girders and slab panels. The building has covered area (footprint) of 469 sq. m. Building has 3 staircases among which one discharges internally. The building is used for office, storage, cutting, pressing & raw store (Ground Floor) and stitching, checking, packing (1st Floor). The construction year of the building is 1995. However, an extension (horizontal and vertical) was done in 2020.

Building 3 is a single-storey (Ground Only) building. The structural system of the building is load bearing brick masonry walls supporting RC Slab and precast girders and slab panels. The building has covered area (footprint) of 90 sq. m. The building is used for mini-accessory store, conference room and offices (Ground Floor). The construction year of the building is 1995.

Building 4 is a single-storey (Ground Only) building. The structural system of the building is load bearing brick masonry walls supporting fibreglass sheeting. The building has covered area (footprint) of 256 sq. m. The building is used for Stitching (Ground Floor). The construction year of the building is 1995.

Building 5 is a single-storey (Ground Only) building. The structural system of the building is a load bearing brick masonry walls supporting precast girders and slab panels, and T-iron and brick slab. The building has covered area (footprint) of 30 sq. m. The building is used for offices & kitchen (Ground Floor). The construction year of the building is 1995.

Building 6 is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting steel, wooden batten and brick slab. The building has covered area (footprint) of 140 sq. m. Building has 1 staircase which discharges externally. The building is used for cutting (Ground Floor) and stitching (1st Floor). The ground floor of the building was constructed in 1995 and 1st floor was constructed in 1997.

Building 7 is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting steel, wooden batten and brick slab. The building has covered area (footprint) of 108.18 sq. m. Building has 2 staircases which discharge externally. The building is used for cutting (Ground Floor) and waste storage(1st Floor) . The ground floor of the building was constructed in 1995 and 1st floor was constructed in 1998.

Building 8 is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting precast girders and slab panels. The building has covered area (footprint) of 203.67 sq. m. Building has 1 staircase which discharges internally. The building is used

for packing, checking (Ground Floor) and stitching (1st Floor). The ground floor of the building was constructed in 1995 and 1st floor was constructed in 1998.

Building 9 is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting precast girders and slab panels mainly and some portion consist of T-iron and brick slab. The building has covered area (footprint) of 189 sq. m. Building has 2 staircases among which one discharge externally. The building is used for packing, checking, storage, generator & LT room (Ground floor) and stitching (1st Floor). The ground floor of the building was constructed in 1995 and 1st floor was constructed in 1998.

· **Ancillary Structures**:

Toilet Block is a single storey (Ground Only) structure. The structural system of the structure is load bearing brick masonry walls supporting RC Slab. The structure is used as a toilets. The construction year of the structure is unknown.

Parking / Storage Shed is a single storey (Ground only) structural steel shed. The structure is used for parking, waste storage and steamer. The construction year of the structure is unknown.

Prayer Area is a single storey (Ground only) structural steel shed. The structure is used for prayer. The construction year of the structure is unknown.

3.1 Building Means of Egress Details

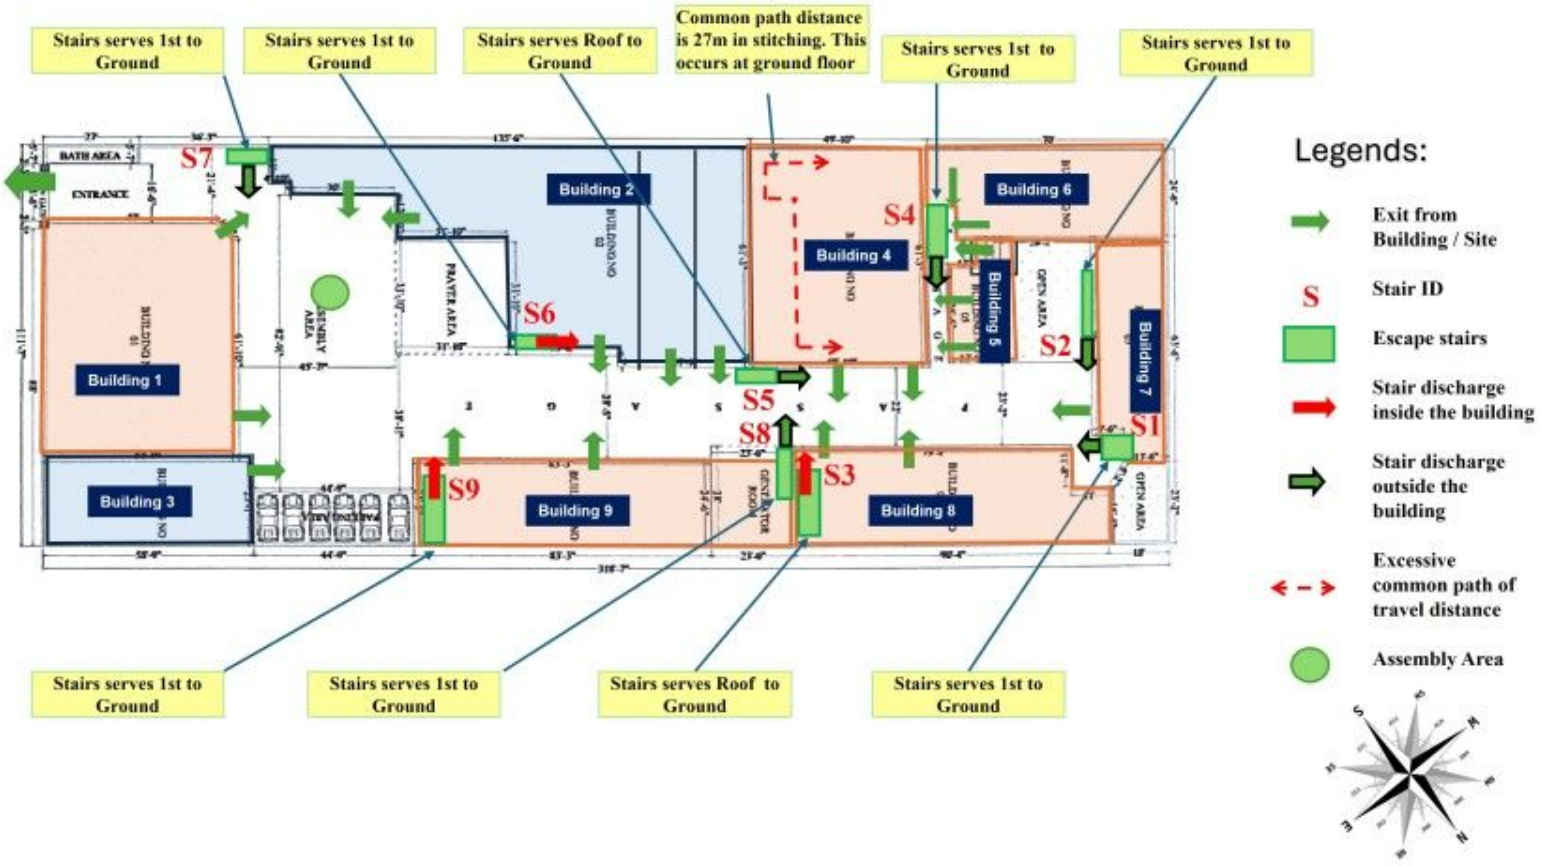


Figure 1.3. Egress Layout of Main Buildings.

3.2 Building Use

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Total Travel Distance	Common Path	Dead End
Building 1						
Ground Floor	Offices, pattern R&D section	15	2	-	-	-
Roof	Unoccupied	-	-	-	-	-
Building 2						
Ground Floor	Store	10	1	-	-	-
	Cutting	15	1	-	-	-
	Press cutting	15	1	-	-	-
	Raw store	8	1	-	-	-
	Office	3	1	-	-	-
1st Floor	Stitching, checking & packing	70	3	-	-	
Roof	Unoccupied	-	1	-	-	-
Building 3						

Ground Floor	Office, mini accessory store & conference room	10	1	-	-	-
Roof	Unoccupied	-	-	-	-	-
Building 4						
Ground Floor	Stitching	50	2	-	27 m	-
Roof	Unoccupied	-	-	-	-	-
Building 5						
Ground Floor	Offices	10	2	-	-	-
	Kitchen	3	1			
Roof	Unoccupied	-	-	-	-	-
Building 6						
Ground Floor	Cutting	5	2	-	-	-
1st floor	Stitching	10	1	-	-	-
Roof	Unoccupied	-	-	-	-	-
Building 7						
Ground Floor	Cutting	15	1	-	-	-
1st Floor	Waste Storage	5	2	-	-	-

Roof	Unoccupied	-	-	-	-	-
Building 8						
Ground Floor	Packing & checking	50	2	-	-	-
1st Floor	Stitching	55	1	-	-	-
Roof	Unoccupied	-	1	-	-	-
Building 9						
Ground Floor	Checking, packing, storage	60	2	-	-	-
	Generator & LT room	4	2	-	-	-
1st Floor	Stitching	50	2	-	-	-
Roof	Unoccupied	-	-	-	-	-

The number of exits is insufficient at 1st floor of Building 8. Excessive travel distance issue was found at stitching (ground floor) Building 4.

4. Documentation

This table shows the details about the documentation provided by the factory.

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		No	-	-
2.	Architecture Layout		Yes	-	Only Building layout provided (not as built)
3.	Sectional Layout		No	-	
4.	Evacuation Maps		No	-	-
5.	Emergency Action Plan		No	-	-
6.	Inspection	Fire extinguishers	No	-	-
		Exit signage	No	-	-
7.	Testing	Fire extinguishers	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Fire extinguishers	No	-	-
		Exit signage	No	-	-
9.	Evidence of Fire Drills		No	-	-
10.	Staff Training		No	-	-

5. Fire Safety Measures

During our fire site inspection of FA Bhatti Industries, a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within FA Bhatti Industries. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-064914

Timeline	Remediation Plan
Immediate CAP-0076826	Factories should begin remediation of CAP items—such as installing extinguishers, signage, and clearing escape routes—using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape
- Sliding doors shall not serve for escape from areas with more than 10 occupants

This is not always achieved, examples include (list not exhaustive):
- Escape doors are lockable in whole facility e.g. lockable doors at S2 entrance from the first floor of the Building 7, main door at ground floor of Building 7 and main door of ground floor in Building 4.
- Doors serving areas with over 50 occupants swing against the direction of escape such as escape door at ground floor of Building 8.
- Doors into stairs swing against the direction of escape such as escape door leading to S3 at first floor and at entrance of S4 from 1st floor Building 6.
- Sliding doors serve for escape from areas with more than 10 occupants such as at ground floor of building 7, at escape route from 1st floor of Building 9 and main entrance door at ground floor of Building 4.
-Shutter door serve for escape from areas with more than 10 occupants such as at escape from S9 and at escape from Building 1.

Recommended remedial actions are provided below.F-202604-064656

Timeline	Remediation Plan
Immediate CAP-0076631	Remove all locking devices from doors on all egress routes that could prevent opening from inside.

Medium Term CAP-0076632	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5. Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, that are side swinging and open in the direction of travel to an exit.
Longer Term CAP-0076633	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Sliding door at ground floor of Building 4.



Figure 2.2 - Lockable door at S2 entrance from first floor of Building 7.



Figure 2.3 - Door swing against the direction of escape at ground floor of Building 8.



Figure 2.5 - Shutter door at escape route of S9.



Figure 2.4 - Sliding and lockable door at ground floor of Building 7.



Figure 2.6 - Escape door swing inside at entrance into S3 from first floor of Building 8.

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.
- Headroom along escape route should be more than 2.05m.
-Stair width should be sufficient as per standard for escape.

This is not always achieved, examples include (list not exhaustive):
-Trip hazards on escape route such as at S5 on first floor of Building 4 and at exit of raw store (ground floor) of Building 2.
- Protected stairs S3, S6 & S9 discharges inside the building at a distance from building exit .
- Insufficient headroom along escape route (i.e. headroom height is less than 2.05m) such as 1.93m at the exit of S3 and 1.7m at S6 (ground floor).
-0.7m clear width was found at S8 which is not as per standard.

Recommended remedial actions are provided below.F-202604-064655

Timeline	Remediation Plan
Immediate CAP-0076615	Remove obstructions on escape routes and keep them clear for escape. Provide warning signs where headroom height is less than 2.05 m on escape routes.
Medium Term CAP-0076616	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks) Propose modifications to ensure 2.05m headroom height is achieved along the escape routes or propose alternative egress routes that comply. Submit the proposal to Pakistan Accord for review. Propose modifications to ensure minimum clear width required for escape stairs is achieved along the escape routes. Submit the proposal to Pakistan Accord for review.

Longer Term CAP-0076617	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted. Implement measures to ensure adequate clear head height is achieved along all escape routes. Implement measures to ensure minimum clear width of stairs is achieved along all escape routes.



Figure 2.7 - Trip hazard at exit of raw store (ground floor) Building 2.



Figure 2.9 - Trip hazard at first floor S5.



Figure 2.8 - 1.7m at S6 intermediate landing in Building 2.



Figure 2.10 - 0.7m clear width was found at S8.

7.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Standard. The standard provides limitations on:
- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.
This is not always achieved, examples include (list not exhaustive):
- Common path of travel distances exceed permitted limits such as 27m common path travel distance was found at stitching (ground floor) Building 4.

Recommended remedial actions are provided below.F-202604-064915

Timeline	Remediation Plan
Medium Term CAP-0076824	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Standard.
Longer Term CAP-0076825	Implement the plan previous reviewed by Pakistan Accord and ensure all travel distances to emergency exits meet the requirements of the Pakistan Accord Standard.

7.4 Number of exits

Per Pakistan Accord Standard, the exit provisions should meet the following:
- Minimum 2 exits from every occupied area with more than 50 occupants.

This is not always achieved, examples include (list not exhaustive):
- There are areas with over 50 occupants that are served by only 1 exit such as 1st floor of Building 8 has only one exit.

Recommended remedial actions are provided below.F-202604-064661

Timeline	Remediation Plan
Medium Term CAP-0076807	Review each floor and area to ensure that the number of exits complies with Pakistan Accord Standard. Develop plans and drawings to provide additional exits where necessary. Submit the plan and drawings to Pakistan Accord for review and approval prior to commencing rectification works.
Longer Term CAP-0076808	Implement the above plan as agreed with Pakistan Accord. Number of exits from all floors and parts of the building should comply with Pakistan Accord Standard.

7.5 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- Stair discharge routes should be protected to the same level of safety as the stair.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings into stairs such as unprotected opening into S2 from Building 7, S3 from generator area, S4 from Building 4, 5 & 6 and S5 from Building 4.
- Missing fire rated enclosure and fire doors in stair S6, S8 and S9.
- Fire load under stairs S1 & S4, fire load and obstruction in S3 first floor.

Recommended remedial actions are provided below.F-202604-064657

Timeline	Remediation Plan
Immediate CAP-0076759	Remove fire load and any other obstructions due to stored items from stairs.
Medium Term CAP-0076760	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.
Longer Term CAP-0076761	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.11 - Fire load under S3



Figure 2.13 - Fire load under S4



Figure 2.12 - Obstruction due to compressor in (1st floor) S3.



Figure 2.14 - Missing fire rated enclosure of S8.



Figure 2.15 - Unprotected opening into S2 from Building 7.

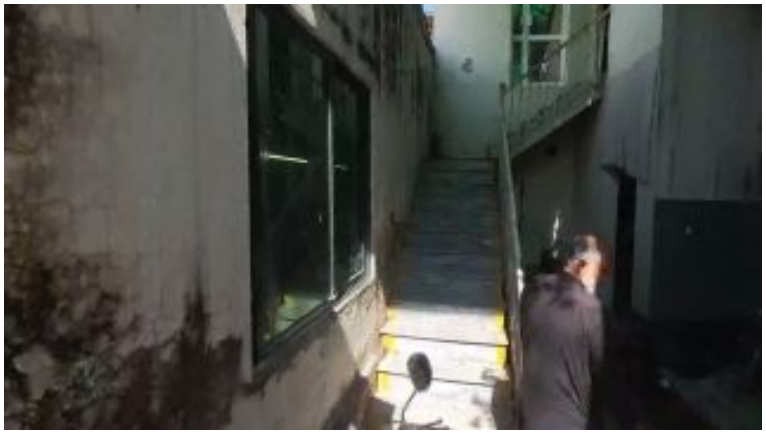


Figure 2.16 - Unprotected opening into S4 from Building 4,5 &6.

7.6 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):
- There are no handrails in S6 and S3 (from roof to 1st floor) and single side handrail is missing in S2 , S3 (from 1st floor to ground floor), S4 and S8.
- The tread, riser and clear width of spiral staircases S1 & S7 are not as per standard.

Recommended remedial actions are provided below.F-202604-064663

Timeline	Remediation Plan
Medium Term CAP-0076815	Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height. Ensure all stairs tread, riser & clear width are as per standard.



Figure 2.17 - Single handrail is missing at S2.



Figure 2.19 - S1 spiral staircase is not as per standard.



Figure 2.18 - Both side handrails are missing at S3 (from roof to 1st floor).

7.7 Exit discharge

Exit discharge routes outside the building should be sufficiently protected so that people can escape safely in the event of a fire anywhere in the building. This includes:
- External escape routes should not lead via high-risk areas.
- Where there is no safe assembly point on site, the final egress routes from site should be sufficiently wide and open in the direction of escape to enable escape to public way. Exits from site should be arranged so that a single fire event will not compromise all site exits.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings from building in the external discharge route of S4 from Building 4 and Builidng 5.
- The assembly area is located less than 15 m from nearby buildings.

Recommended remedial actions are provided below.F-202604-064920

Timeline	Remediation Plan
Medium Term CAP-0076835	Prepare drawings showing proposed fire separating construction to exit discharge routes. These shall be submitted to Accord for review and approval prior to commencing rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge routes - Details of proposed fire resisting walls and fire door assemblies required to protect discharge routes Provide additional exits from site.
Longer Term CAP-0076836	- Ensure external exit discharge routes are adequately fire separated from the rest of the building. - Ensure external escape routes do not pass close to unprotected high-risk areas



Figure 2.20 - Unprotected openings in external discharge route of S4 from Building 4 and Building 5.

7.8 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at entry into S3 from 1st floor.
- Missing exit signs in production areas in Building 2, Building 4, Building 7, Building 8 & Building 9.
- Missing exit signs at stair discharge routes in whole facility.
- Electrically powered exit signs are not a tested and listed system

Recommended remedial actions are provided below.F-202604-064662

Timeline	Remediation Plan
Medium Term CAP-0076813	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3.
Longer Term CAP-0076814	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.21 - Exit signage is missing at stitching (1st floor) of Building 8.



Figure 2.23 - Exit signage is missing at entrance into stair S3 from stitching (1st floor) of Building 8.



Figure 2.22 - Missing exit signage at stair discharge route (S4).



Figure 2.24 - Exit sign is missing at exit from (ground floor) Building 7.

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Generator room is not fire separated from LT room, Building 5,Building 9 and S8.
- Gas steam generator is not fire separated from parking and storage.
-Compressors are not fire separated from other occupancies in multiple locations such as from S1 & S3 and from (ground floor) Builidng 5 etc.

Recommended remedial actions are provided below.F-202604-064664

Timeline	Remediation Plan
Medium Term CAP-0076816	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0076817	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.25 - Gas steam generator is not fire separated from parking and storage.



Figure 2.27 - Generator room is not fire seperated from LT panels.



Figure 2.26 - Compressor is not fire separated from Building 8.

8.2 Separation of occupancies

Residential sleeping areas should comply with special measures required for sleeping occupancies. Such measures include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key.
- Fire separation of dormitories from other occupancies.
- Providing a minimum of 2 escape routes from the above ground levels.
- Providing an automatic fire detection and alarm system.

The following deficiencies have been observed on site, including (list not exhaustive):
- Locking devices on doors do not allow for free escape under all circumstances such as sleeping room at first floor of Building 9 is lockable.
- No adequate automatic fire detection and alarm system in sleeping areas at cutting hall (ground floor) Building 2 & near S9 (1st floor) Building 9.
- Above ground levels lack an alternative escape route at sleeping area near S9 (1st floor) Building 9.
- Lack of fire rated separation between the dormitory and other occupancy types such as sleeping area at cutting hall (ground floor) Building 2 & near S9 (1st floor) Building 9.

Recommended remedial actions are provided below.F-202604-064654

Timeline	Remediation Plan
Immediate CAP-0076677	The dormitory is not to be used until minimum requirements for sleeping occupancies have been provided. Alternative arrangements must be sought immediately for the dormitory as continuing the use of the building for this purpose is not appropriate. Dormitory not to be re-occupied until the minimum requirements have been implemented.
Medium Term CAP-0076678	Document proposals for design of remedial measures to ensure compliance with all fire safety requirements for sleeping occupancies to comply with Pakistan Accord Standard. Submit proposals to Pakistan Accord for review.
Longer Term CAP-0076679	Implement remediation measures to ensure full compliance with dormitory requirements of Pakistan Accord Standard and Pakistan Building Code in accordance with previously reviewed design.



Figure 2.28 - Lockable escape door at sleeping area near S9 (1st floor) Building 9.



Figure 2.29 - No automatic fire alarm & detection system in sleeping area at cutting hall (ground floor) Building 2.

8.3 Separation of occupancies

Pakistan Accord Standard requires different occupancy types to be fire separated from each other. The aim is to limit the fire to only one occupancy type.

The following deficiencies have been observed on site, including (list not exhaustive):
- Car park areas are not fire separated from the rest of the building such as parking garage is not fire separated from Building 9.

Recommended remedial actions are provided below.F-202604-064666

Timeline	Remediation Plan
Medium Term CAP-0076822	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Different building with their occupancy - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0076823	Provide fire rated separation between Buildings as per proposal reviewed by Pakistan Accord.



Figure 2.30 - Car parking is not fire separated from Building 9.

8.4 Separation of occupancies

Pakistan Accord Standard requires Buildings fire separation from one another to avoid fire proximity risk.
The following deficiencies have been observed on site, including (list not exhaustive):
- Building 4 is not fire separated with fire rated construction from Building 2, Building 5 and Buidling 6. Similarly, Building 6 is not fire separated from Building 7 and Building 1 from Building 3

Recommended remedial actions are provided below.F-202604-064913

Timeline	Remediation Plan
Medium Term CAP-0076820	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Proposed fire separation details (including fire rating of walls and doors).
Longer Term CAP-0076821	Provide fire rated separation between Buildings as per proposal reviewed by Pakistan Accord.



Figure 2.31 - Building 2 and Building 4 are not fire separated with each other.

8.5 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building such as storage area is not fire separated from cutting and raw store is also not fire separated from cutting at (ground floor) Building 2.
- Presence of areas where storage does not meet miscellaneous in-process storage requirements (listed above) such as in-process storage at cutting (ground floor) exceeds permitted limits.

Recommended remedial actions are provided below.F-202604-064658

Timeline	Remediation Plan
Medium Term CAP-0076805	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0076806	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard.



Figure 2.32 - Storage area is not fire separated from cutting in (ground floor) Building 2.



Figure 2.33 - In-process storage at cutting (ground floor) of Building 2 is not as per standard.

9. Fire Suppression

9.1 Fire extinguishers

Extinguisher coverage and type of extinguishers used should comply with NFPA 10.

The following deficiencies have been observed on site, including (list not exhaustive):
- Insufficient coverage of fire extinguishers such as at (1st floor) Building 8 and at (ground floor) Building 6.
- Poor condition of fire extinguishers such as expired fire extinguiishers were found at S4 and outside near entrance of Building 1. Moreover, rusted fire extinguisher was found outside at Building 1.

Recommended remedial actions are provided below.F-202604-064665

Timeline	Remediation Plan
Medium Term CAP-0076818	Ensure that all building areas are protected using fire extinguishers. The coverage and type of extinguishers used should follow NFPA 10.
Longer Term CAP-0076819	Monitor fire extinguishers for coverage and extinguisher type to comply with NFPA 10.



Figure 2.34 - Expired fire extinguisher was found near S4.



Figure 2.35 - Rusted fire extinguisher was found outside near entrance of Building 1.

10. Fire Safety Management

10.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- No evidence of fire drills presented.

Recommended remedial actions are provided below.F-202604-064916

Timeline	Remediation Plan
Medium Term CAP-0076833	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0076834	Ensure fire drills are performed a minimum of 2 times per year.

10.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire Extinguishers.
- No records of testing of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202604-064917

Timeline	Remediation Plan
Medium Term CAP-0076831	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0076832	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

10.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of maintenance of Fire Extinguishers.
-No records of maintenance of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202604-064918

Timeline	Remediation Plan
Medium Term CAP-0076829	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0076830	- Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

10.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid fire fighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):

- Escape diagrams are missing on all floors.
- There is no EAP document which details procedures, roles and responsibilities in the event of fire.

Recommended remedial actions are provided below.F-202604-064919

Timeline	Remediation Plan
Medium Term CAP-0076827	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0076828	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

11. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.