Issue	**1**
Factory ID	**25959**
Date of Issue	**28-May-2026**

FA Bhatti Industries


Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

4 Norgate Street Cantt Road
51310 Sialkot
Punjab Pakistan

Latitude: [32.506017], longitude: [74.553019]
Date of inspection: 16-Mar-2026

Structural Safety Inspection Report

Observations & Actions

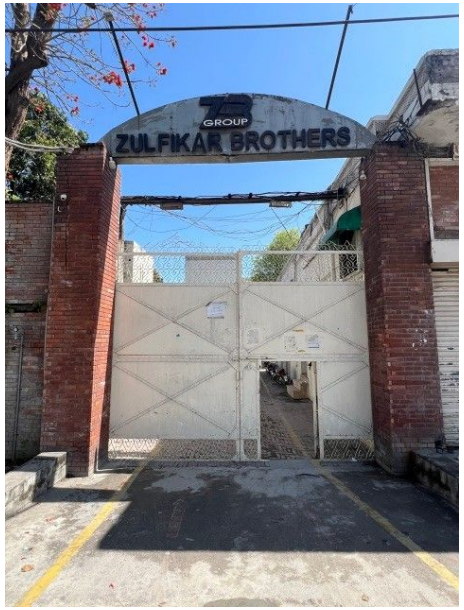

Authors	**Haris Mahmood**
Reviewed by	**Ausama Iqbal**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 16-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 4
2. Building Extents 6
   2.1 Structural System 21
3. Documentation 24
4. Structural Safety Measures 25
5. Remediation Support 28
   5.1 Engineering Support 28
6. Other Damage/Defects 29
   6.1 Spalling concrete 29
   6.2 Spalling concrete 31
   6.3 Health and Safety 33
   6.4 Health and Safety 35
   6.5 Health and Safety 36
   6.6 Health and Safety 37
7. Structural Documentation 39
   7.1 Documentation unavailable 39
   7.2 Lack of safe load plans 40
8. Assessment Limitations and Assumptions 41

1. Executive Summary

On 16-Mar-2026, Haris Mahmood and Muhammad Asim on behalf of the Pakistan Accord carried out an initial structural inspection for FA Bhatti Industries, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with Mr. Azhar Iqbal (General Manager), Mr. Muhammad Afzal (Manager HR) and other staff members of F. A. Bhatti Industries. The assessment was conducted as a part of an overall Structural, Fire, and Electrical initial inspection.
The factory operates in single general shift. The entire facility employs approximately 150 workers with no female representation.
The complete facility comprises of nine main buildings and four ancillary structures. Out of nine, two main buildings (Building 2 and Building 3) are owned by FA Bhatti Industries while the rest of the buildings are owned by ZB (Zulfikar Brothers) Group. During the inspection, the buildings highlighted in blue in Figure 1.1 were surveyed with the site boundary indicated in red.

- **Building 1** is a single-storey (Ground Only) building. The structural system of the building is load bearing brick masonry walls supporting RC Slab and precast girders and slab panels. The building is used for offices, pattern R&D section (Ground Floor). The construction year of the building is 1995.
- **Building 2** is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting RC Slab and precast girders and slab panels. The roof structural system of the building consists of load bearing brick masonry walls supporting precast girders and slab panels. The building is used for storage, cutting, pressing (Ground Floor) and stitching, checking, packing (First Floor). The construction year of the building is 1995. However, an extension (horizontal and vertical) was done in 2020.
- **Building 3** is a single-storey (Ground Only) building. The structural system of the building is load bearing brick masonry walls supporting RC Slab and precast girders and slab panels. The building is used for mini-accessory store, conference room and offices (Ground Floor). The construction year of the building is 1995.
- **Building 4** is a single storey (Ground Only) building. The structural system of the building is load bearing brick masonry walls and steel pipe sections supporting steel truss with fibreglass sheeting. The building is used for Stitching (Ground Floor). The construction year of the building is 1995.
- **Building 5** is a single storey (Ground Only) building. The structural system of the building is a load bearing brick masonry walls supporting precast girders and slab panels, and T-iron and brick slab. The building is used for offices, canteen (Ground Floor). The construction year of the building is 1995.
- **Building 6** is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting steel, wooden batten and brick slab. The roof structural system of the building is load bearing brick masonry walls supporting precast girders and slab panels. The building is used for cutting (Ground floor) and stitching (First Floor). The ground floor of the building was constructed in 1995 and first floor was constructed in 1997.
- **Building 7** is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting steel,

wooden batten and brick slab. The roof structural system of the building is load bearing brick masonry walls supporting precast girders and slab panels. The building is used for cutting (Ground Floor). The first floor of the building is currently vacant. The ground floor of the building was constructed in 1995 and first floor was constructed in 1998.

- **Building 8** is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting precast girders and slab panels. The building is used for packing, checking (Ground floor) and stitching (First Floor). The ground floor of the building was constructed in 1995 and first floor was constructed in 1998.
- **Building 9** is a two-storey (Ground + 1) building. The structural system of the building is load bearing brick masonry walls supporting precast girders and slab panels. The building is used for packing, checking, storage (Ground floor) and stitching (First Floor). The ground floor of the building was constructed in 1995 and first floor was constructed in 1998.
- **Ancillary Structures** consist of the following:
  - **Toilet Block** is a single storey (Ground Only) structure. The structural system of the structure is load bearing brick masonry walls supporting T-iron and brick slab. The structure is used for toilets. The construction year of the structure is unknown.
  - **Parking / Storage Shed** is a single storey (Ground only) structural steel truss shed with fiberglass sheeting. The structure is used for parking, waste storage and steamer. The construction year of the structure is unknown.
  - **Generator Room** is a single storey (Ground Only) structure. The structural system of the structure is load bearing brick masonry walls supporting T-iron and brick slab. The structure is used for generators, batteries and panels. The construction year of the structure is unknown.
  - **Prayer Area** is a single storey (Ground Only) structural steel truss shed with fiberglass sheeting. The structure is used for prayer area. The construction year of the structure is unknown.

Only the site layout plan was presented. For further details, refer to Table 2 of the documentation of this report.
There is a health and safety concern including the lack of edge protection at roof level of all multi-stories' buildings, which should be addressed immediately. For further details, refer to Section 6 of this report.
A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

· Spalling of concrete at first floor precast slab panels in Building 6 and 7 was observed.
· No safe load plans were posted in any of the floor of the main building
· No documentation (As-Built Architectural and Structural Drawings) was available

We see no reason to suspend operations in the facility due to these concerns.
Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1: Building Summary

Building	Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / modifications	Engineer access issues
Building 1	Offices, pattern R&D section (Ground Floor)	One (Ground Only)	1995	Load bearing brick masonry walls supporting RC Slab and precast girders and slab panels	-	-	-
Building 2	Storage, cutting, pressing (Ground Floor) Stitching, checking, packing (First Floor)	Two (Ground + 1)	1995	Load bearing brick masonry walls supporting RC Slab and precast girders and slab panels	Load bearing brick masonry walls supporting precast girders and slab panels	Horizontal and Vertical Extension in 2020	-

Building 3	Mini-accessory store, conference room and offices (Ground Floor)	One (Ground Only)	1995	Load bearing brick masonry walls supporting RC Slab and precast girders and slab panels	-	-	-
Building 4	Stitching (Ground Floor)	One (Ground Only)	1995	load bearing brick masonry walls & Steel pipe sections supporting Steel trusses with fibreglass sheeting	-	-	-
Building 5	Offices, canteen (Ground Floor)	One (Ground Only)	1995	Load bearing brick masonry walls supporting precast girders and slab panels, and T-iron and brick slab	-	-	-

Building 6	Cutting (Ground Floor) Stitching (First Floor)	Two (Ground + 1)	1995	Load bearing brick masonry walls supporting steel girders, wooden batten and brick slab	Load bearing brick masonry walls supporting precast girders and slab panels	First floor was constructed in 1997	-
Building 7	Cutting (Ground Floor) Currently vacant (First Floor)	Two (Ground + 1)	1995	Load bearing brick masonry walls supporting steel girder, wooden batten and brick slab	Load bearing brick masonry walls supporting precast girders and slab panels	First floor was constructed in 1998	-
Building 8	Packing, checking (Ground floor) Stitching (First Floor)	Two (Ground + 1)	1995	Load bearing brick masonry walls supporting precast girders and slab panels	-	First floor was constructed in 1998	-

Building 9		Packing, checking, storage (Ground floor) Stitching (First Floor)	Two (Ground + 1)	1995	Load bearing brick masonry walls supporting precast girders and slab panels	-	First floor was constructed in 1998	-
Ancillary Structures	Toilet Block	Toilets (Ground) Water tanks (Roof)	One (Ground Only)	Unknown	Load bearing brick masonry walls supporting T-iron and brick slab	-	-	-
	Parking / Storage Shed	Parking, waste storage, steamer (Ground)	One (Ground Only)	Unknown	Structural steel truss shed with fiberglass sheeting	-	-	-
	Generator Room	Generator, batteries and panels (Ground)	One (Ground Only)	Unknown	Load bearing brick masonry walls supporting steel T-iron and brick slab	-	-	-
	Prayer Area	Prayer area	One (Ground Only)	Unknown	Structural steel truss shed with fiberglass	-	-	-

					sheeting			



Figure 1.1. Satellite View of the factory premises

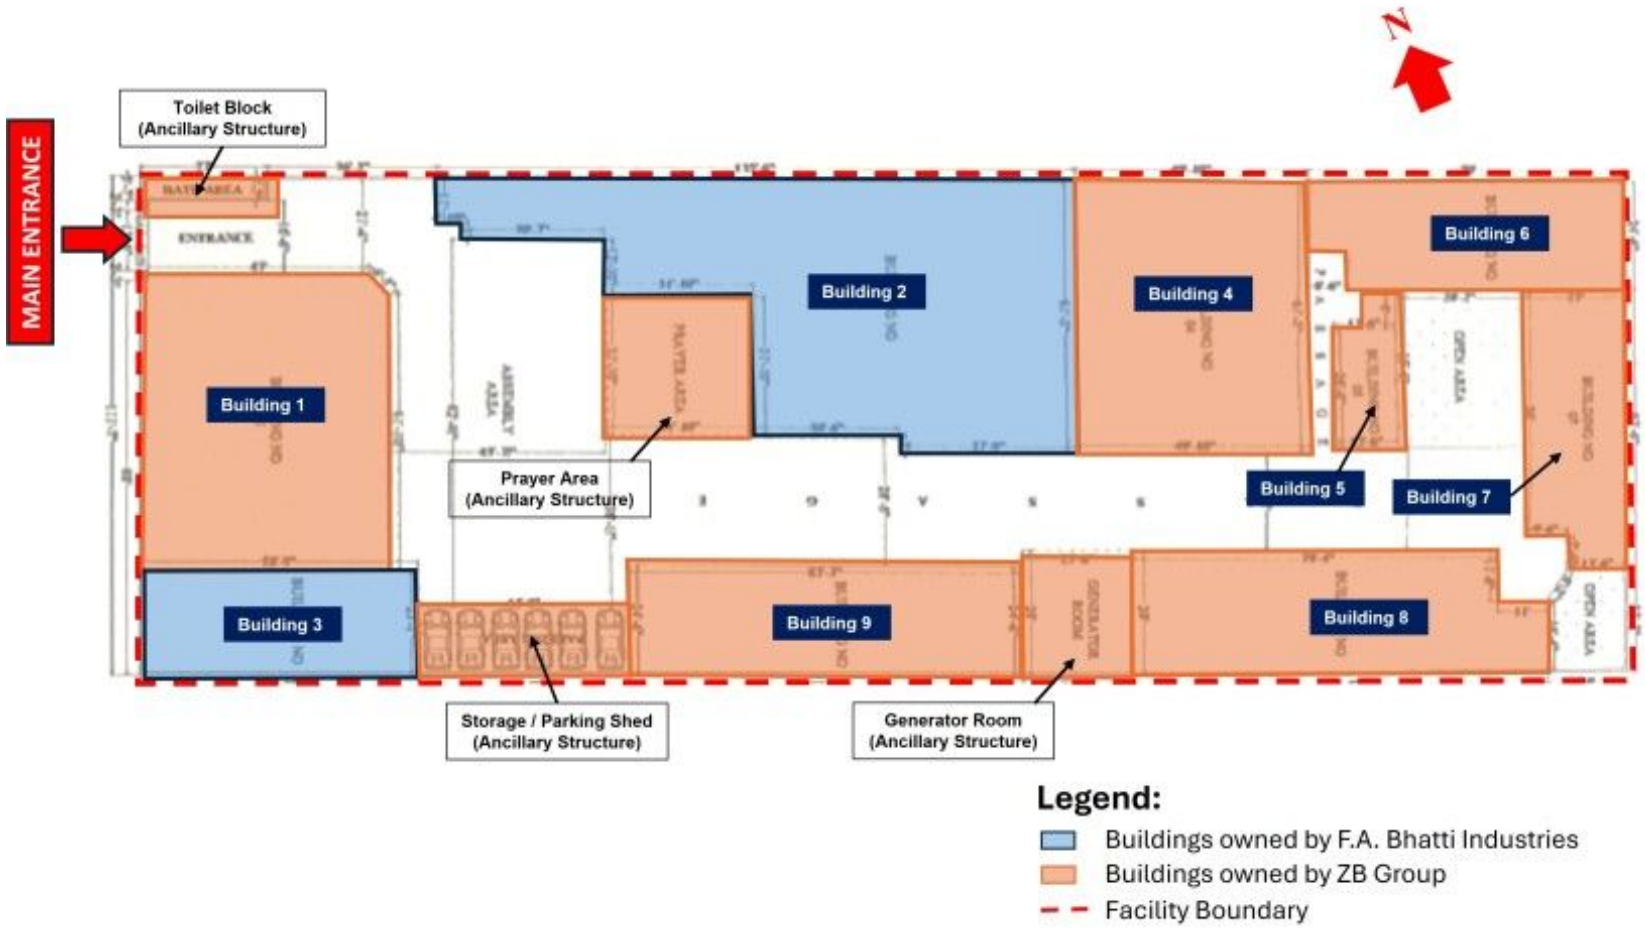


Figure 1.2. Site Layout of the factory premises



Figure 1.3. Elevation of Building 1



Figure 1.4. Front Elevation of Building 2



Figure 1.5. Front Elevation of Building 3



Figure 1.6. Front Elevation of Building 4



Figure 1.7. Front Elevation of Building 5



Figure 1.8. Front Elevation of Building 6



Figure 1.9. Front Elevation of Building 7



Figure 1.10. Front Elevation of Building 8



Figure 1.11. Front Elevation of Building 9



Figure 1.12. Front Elevation of Toilet Block - Ancillary Structure



Figure 1.13. Front Elevation of Parking & Storage Shed - Ancillary Structure



Figure 1.14. Front Elevation of Generator Room



Figure 1.15. Front Elevation of Prayer Area



Figure 1.16. Office at Ground Floor of Building 1



Figure 1.17. R&D Section at Ground floor of Building 1



Figure 1.18. Storage at Ground Floor of Building 2



Figure 1.19. Cutting at Ground Floor of Building 2



Figure 1.20. Stitching Tables at First Floor of Building 2



Figure 1.21. Storage at Mini Accessory Store at Ground Floor of Building 3



Figure 1.22. Conference Room at Ground Floor of Building 3



Figure 1.23. Stitching at Ground Floor of Building 4



Figure 1.24. Canteen Area at Ground Floor of Building 5



Figure 1.25. Typical activity at Ground floor of Building 6



Figure 1.26. Stitching Tables at First Floor of Building 6



Figure 1.27. Cutting at Ground Floor of Building 7



Figure 1.28. Vacant First Floor of Building 7



Figure 1.29. Checking and Packing at Ground Floor of Building 8



Figure 1.30. Stitching at First Floor of Building 8



Figure 1.31. Storage at Ground Floor of Building 9



Figure 1.32. Stitching at First Floor of Building 9

2.1 Structural System

Building	Building 2
Stability system	Load Bearing Brick Masonry Walls supporting RC Slab, Precast girders and Slab Panels
Column size (m)	-
Grid (m)	-
Primary beam size (m)	-
Secondary beam size (m)	-
Slab depth (m)	0.150
Finishes depth (m)	0.075
Ceiling height (m)	Ground to First: 2.82, 3.5

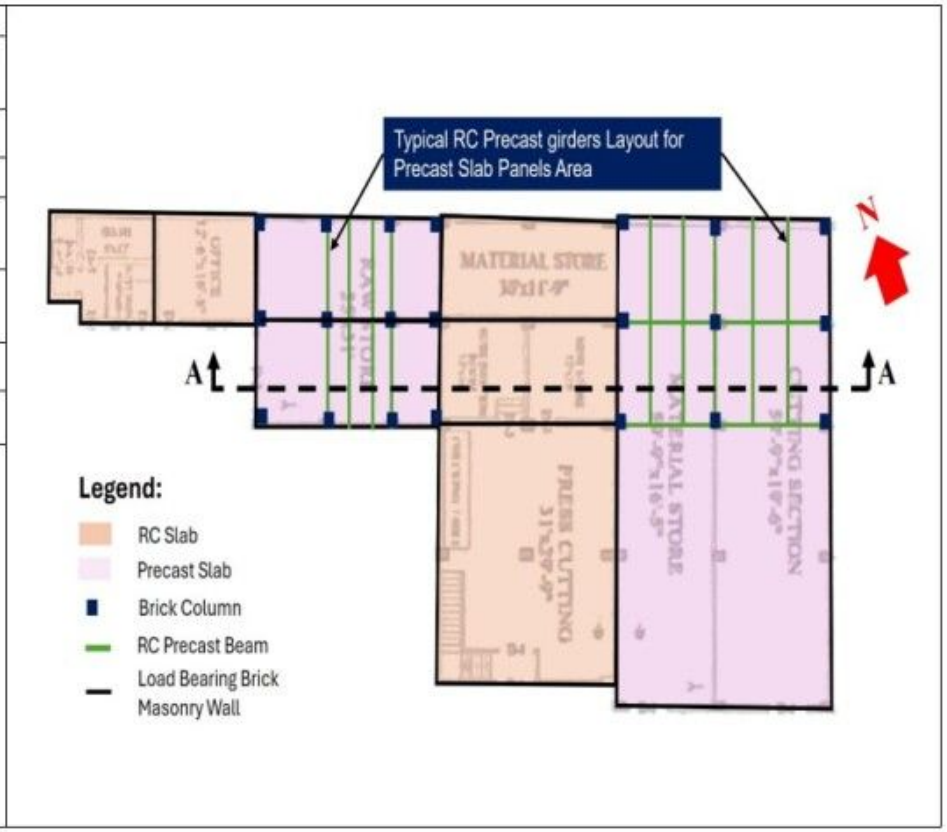


Figure 1.33. Ground Floor Layout Plan of Building 2

Building	Building 2
Stability system	Load Bearing Brick Masonry Walls supporting RC Slab, Precast girders and Slab Panels
Column size (m)	-
Grid (m)	-
Primary beam size (m)	-
Secondary beam size (m)	-
Slab depth (m)	0.150
Finishes depth (m)	0.075
Ceiling height (m)	First to Roof: 3.6, 4.3

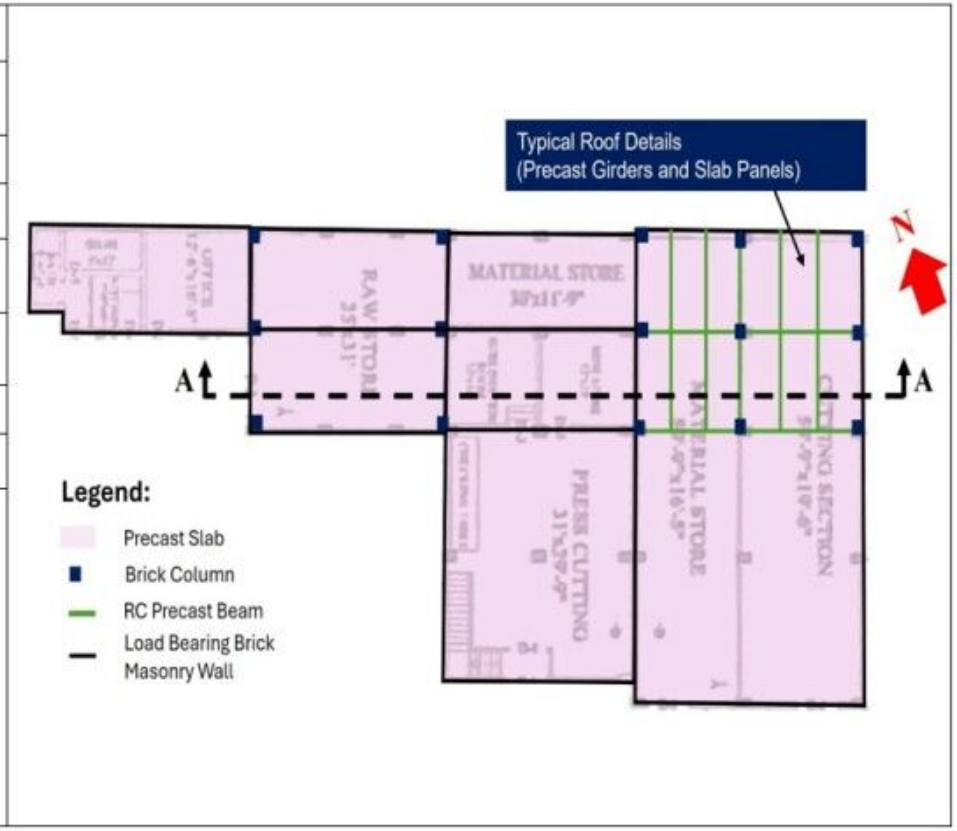


Figure 1.34. First Floor Layout Plan of Building 2

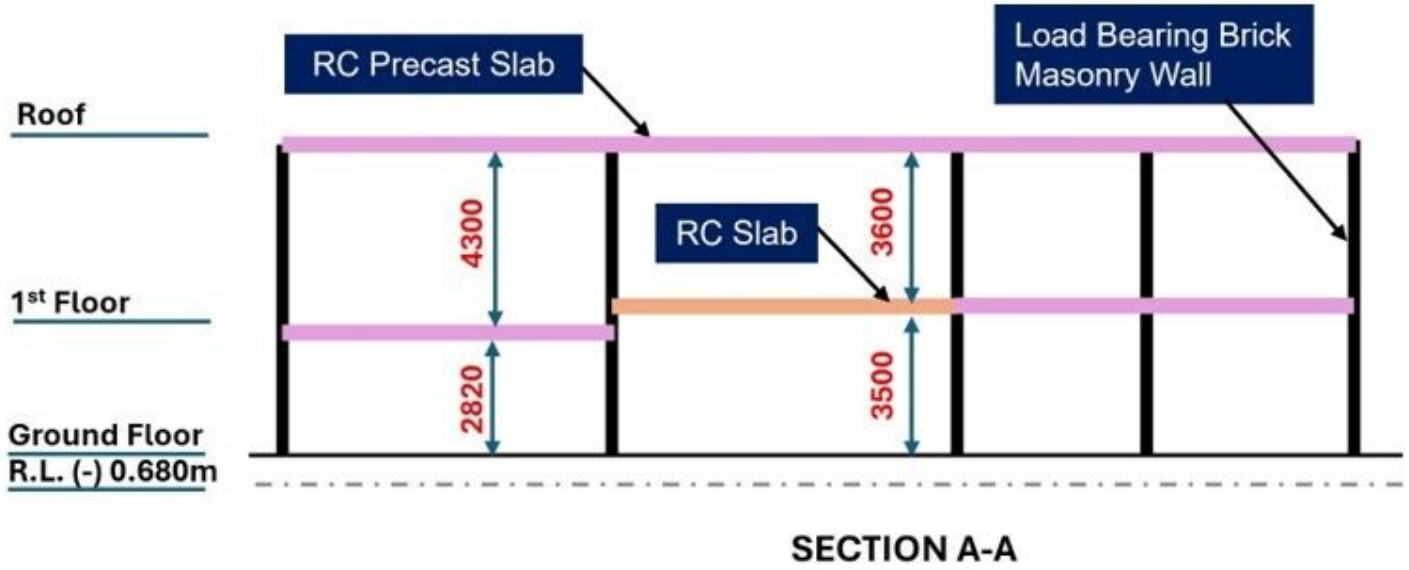


Figure 1.35. Section A-A of Building 2

3. Documentation

This table outlines the documentation details provided by the factory.

Table 2 – Documentation

Building		Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plans	Stability certificate	Inspection reports	Materials testing
Building 1		Yes	No	No	No	No	No	No	No	No
Building 2		Yes	No	No	No	No	No	No	No	No
Building 3		Yes	No	No	No	No	No	No	No	No
Building 4		Yes	No	No	No	No	No	No	No	No
Building 5		Yes	No	No	No	No	No	No	No	No
Building 6		Yes	No	No	No	No	No	No	No	No
Building 7		Yes	No	No	No	No	No	No	No	No
Building 8		Yes	No	No	No	No	No	No	No	No
Building 9		Yes	No	No	No	No	No	No	No	No
Ancillary Structures	Toilet Block	Yes	No	No	No	No	No	No	No	No
	Parking / Storage Shed									
	Generator Room									
	Prayer Area									

4. Structural Safety Measures

During our structural site inspection of FA Bhatti Industries, a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within FA Bhatti Industries. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3 Summary of issues by building:

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Building 1	-	-	-	-	-	Documentation Unavailable
Building 2	-	-	-	-	Health & Safety – Lack of Edge Protection	Documentation Unavailable Lack of Safe Load Plans
Building 3	-	-	-	-	-	Documentation Unavailable
Building 4	-	-	-	-	-	Documentation

							Unavailable
Building 5		-	-	-	-	-	Documentation Unavailable
Building 6		-	-	-	-	Spalling Concrete Health & Safety – Lack of Edge Protection	Documentation Unavailable Lack of Safe Load Plans
Building 7		-	-	-	-	Spalling Concrete Health & Safety – Lack of Edge Protection	Documentation Unavailable Lack of Safe Load Plans
Building 8		-	-	-	-	Health & Safety – Lack of Edge Protection	Documentation Unavailable Lack of Safe Load Plans
Building 9		-	-	-	-	-	Documentation Unavailable Lack of Safe Load Plans
Ancillary Structures	Toilet Block	-	-	-	-		Documentation Unavailable
	Parking / Storage Shed	-	-	-	-	-	Documentation Unavailable
	Generator Room	-	-	-	-	-	Documentation Unavailable

	Prayer Area	-	-	-	-	-	Documentation Unavailable

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified Engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-064984

Timeline	Remediation Plan
Medium Term CAP-0076914	Factories should begin remediation of CAP items—such as surface cracks or non-structural repairs—using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Other Damage/Defects

6.1 Spalling concrete

This issue refers to the building 6, where spalling of Concrete was observed at the first-floor slab (Precast Panels).
This is likely due to the moisture ingress and lack of water proofing, which may have caused the corrosion of the reinforcing steel, leading to the spalling of concrete cover.F-202604-064987

Timeline	Remediation Plan
Medium Term CAP-0076920	Identify the cause of the damage and propose measures to prevent further damage.
Medium Term CAP-0076921	Inspect damage to the slab and propose repair to structure.
Medium Term CAP-0078353	Submit report capturing above to Pakistan Accord for approval.
Longer Term CAP-0076922	Implement the required remedial work.
Longer Term CAP-0076923	Continue to Monitor further damage.

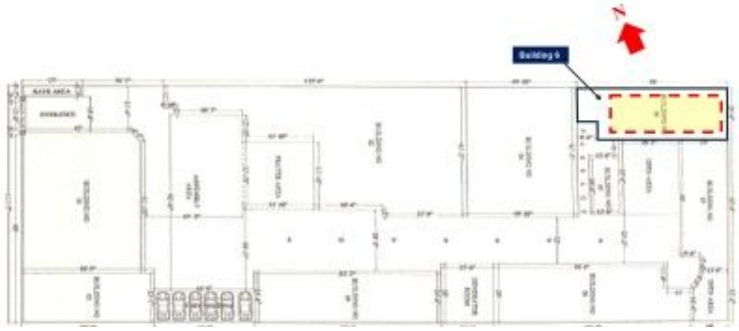


Figure 2.1 - Location of concrete spalling at first floor slab of Building 6



Figure 2.2 - Concrete spalling at first floor slab of Building 6

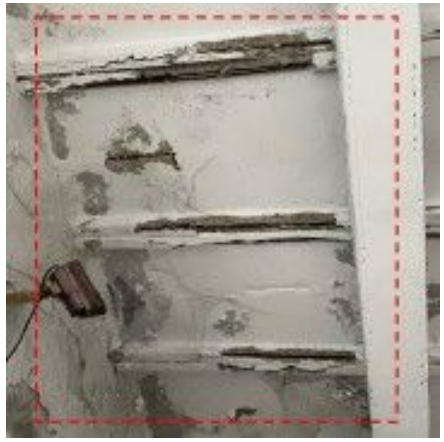


Figure 2.3 - Concrete spalling at first floor slab of Building 6

6.2 Spalling concrete

This issue refers to the building 7, where spalling of Concrete was observed at the first-floor slab (Precast Panels).
This is likely due to the moisture ingress and lack of water proofing, which may have caused the corrosion of the reinforcing steel, leading to the spalling of concrete cover.F-202604-064988

Timeline	Remediation Plan
Medium Term CAP-0076924	Identify the cause of the damage and propose measures to prevent further damage.
Medium Term CAP-0076925	Inspect damage to the slab and propose repairs to structure.
Medium Term CAP-0078354	Submit report capturing above to Pakistan Accord for approval.
Longer Term CAP-0076926	Implement the required remedial work.
Longer Term CAP-0076927	Continue to Monitor further damage.

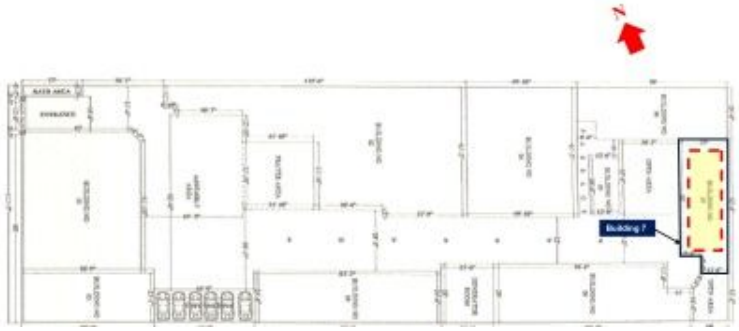


Figure 2.4 - Location of Concrete spalling at first floor slab of Building 7



Figure 2.5 - Concrete spalling at first floor slab of Building 7

6.3 Health and Safety

This refers to Building 2.
Edge protection is not provided on the roof level of Building 2. Missing edge protection presents a risk of potential injury resulting from slip, trip or fall from the roof while accessing and maintaining services on the roof. This is a Health and Safety Concern. F-202604-064989

Timeline	Remediation Plan
Immediate CAP-0076928	Provide adequate edge protection on the roof, and on any other part of the factory with the same issue.



Figure 2.6 - Location of Missing edge protection at roof of Building 2



Figure 2.7 - Missing edge protection at roof of Building 2



Figure 2.8 - Missing edge protection at roof of Building 2

6.4 Health and Safety

This refers to Building 6.
Edge protection is not provided on the roof level of Building 6. Although the roof was inaccessible, the air-conditioning outdoor unit was found on the roof. Missing edge protection presents a risk of potential injury resulting from slip, trip or fall from the roof while accessing and maintaining services on the roof. This is a Health and Safety Concern.F-202604-064990

Timeline	Remediation Plan
Immediate CAP-0076929	Provide adequate edge protection and safe access on the roof, and on any other part of the factory with the same issue.

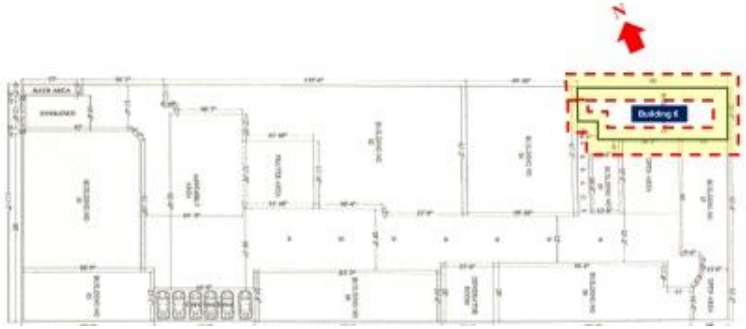


Figure 2.9 - Location of Missing edge protection at roof of Building 6



Figure 2.10 - Missing edge protection at roof of Building 6

6.5 Health and Safety

This refers to Building 7.
Edge protection is not provided on the roof level of Building 7. Although, the roof was inaccessible, water tank was witnessed. Missing edge protection presents a risk of potential injury resulting from slip, trip or fall from the roof while accessing and maintaining services on the roof. This is a Health and Safety Concern.F-202604-064991

Timeline	Remediation Plan
Immediate CAP-0076930	Provide adequate edge protection and safe access on the roof, and on any other part of the factory with the same issue.

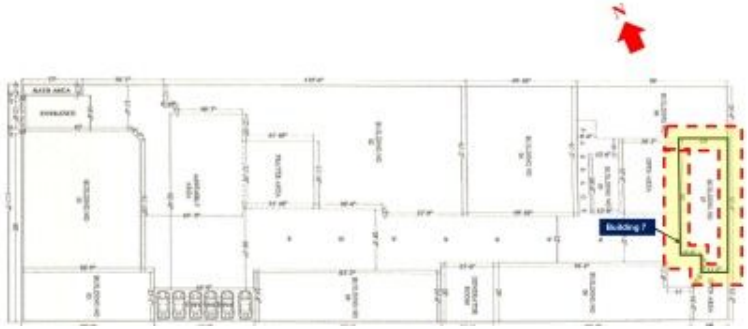


Figure 2.11 - Location of Missing edge protection at roof of Building 7



Figure 2.12 - Missing edge protection at roof of Building 7

6.6 Health and Safety

This refers to the Building 8.
Edge protection is not provided on the roof level of Building 8. Furthermore, the internal staircase of Building 8 is also missing an edge protection/safety handrail. Missing edge protection presents a risk of potential injury resulting from slip, trip of fall from the stairs or roof, while accessing and maintaining services on the roof. This is a Health and Safety Concern.F-202604-064992

Timeline	Remediation Plan
Immediate CAP-0076931	Provide adequate edge protection on the roof, and on any other part of the factory with the same issue.

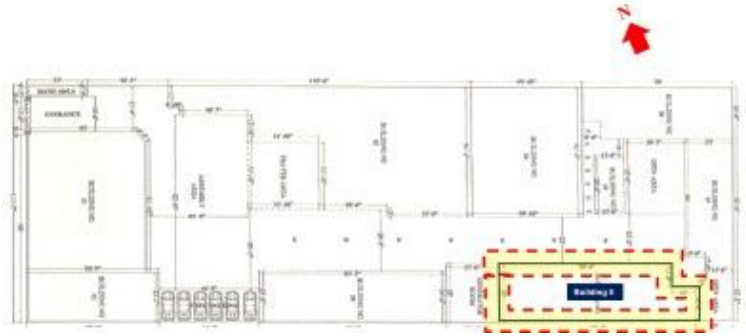


Figure 2.13 - Location of Missing Edge Protection at roof of Building 8



Figure 2.14 - Missing Edge Protection at roof of Building 8



Figure 2.15 - Missing Edge Protection at Internal staircase of Building 8

7. Structural Documentation

7.1 Documentation unavailable

Following documents were unavailable:

- As-Built Architectural drawings of all the buildings (Main buildings and ancillary structures).
- Structural Drawings of all the buildings (Main buildings and ancillary structures). F-202604-064985

Timeline	Remediation Plan
Longer Term CAP-0076916	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete As-built documentation.

7.2 Lack of safe load plans

No safe load plans were posted in any of the multi-storey buildings of the factory. F-202604-064986

Timeline	Remediation Plan
Longer Term CAP-0076917	Building Structural Engineer to review design documentation to confirm load capacity of the structure.
Longer Term CAP-0076918	Develop safe load plans and submit to Pakistan Accord for review.
Longer Term CAP-0076919	Factory to post safe load plans on all floors.

8. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.