| | |
|---|---|
| **Issue** | **1** |
| **Factory ID** | **26329** |
| **Date of Issue** | **22-Apr-2026** |

# Fashion Knits

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

8000 Opposite Canal Road, Near Zeeshan Shah (Ex-MPA) Rd, Mian Pind, Mansoorabad
38000 Faisalabad
Punjab Pakistan

Latitude: [ 31.441207 ], longitude: [ 73.120085 ]
Date of inspection: 11-Mar-2026

# Fire Safety Inspection Report

## Observations & Actions




| | |
|---|---|
| Authors | **Muhammad Naseer** |
| Reviewed by | **Naveed Anjum** |
| Approved by | **Paul Rigby** |

# Pakistan Accord Initial Safety Inspection Report

**About this report:**

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 11-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

**Applied Standards:**

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

# Contents


1. Executive Summary ..... 5
2. Building Extents ..... 6
3. Building Description ..... 8
   - 3.1 Building Means of Egress Details ..... 9
   - 3.2 Building Use ..... 10
4. Documentation ..... 11
5. Fire Safety Measures ..... 12
6. Remediation Support ..... 13
   - 6.1 Engineering Support ..... 13
7. Means of Escape ..... 14
   - 7.1 Escape doors ..... 14
   - 7.2 Exit access ..... 16
   - 7.3 Number of exits ..... 18
   - 7.4 Protection of stairs ..... 19
   - 7.5 Escape stair condition ..... 21
   - 7.6 Exit signage ..... 22
8. Fire Rated Construction ..... 24
   - 8.1 Separation of high-risk areas ..... 24
   - 8.2 Separation of occupancies ..... 26
   - 8.3 Storage ..... 28
9. Fire Safety Management ..... 30
   - 9.1 Fire drills ..... 30

9.2 Records of system testing ..... 31
9.3 Records of systems maintenance ..... 32
9.4 Emergency Action Plan ..... 33
10. Assessment Limitations and Assumptions ..... 34

# 1. Executive Summary

On 11-Mar-2026, Shehroz Javed and Muhammad Naseer on behalf of the Pakistan Accord carried out an initial fire inspection for Fashion Knits, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Umair Hafeez (Owner), Mr. Waseeq (Compliance advisor), Mr. Rafiq Khan (Compliance Advisor) and other staff members of Fashion knits.

The factory operates in one general shift, with approximately 50 workers operate in the factory, with 10 workers being females.

The factory comprises one main building rented by Fashion knits. During the inspection, the building highlighted in Figure 1.1 was inspected, with the site boundary indicated in red.

**Main Building –** is mainly a 2 storey (B+G+1) above grade plane, RC MRF building with infill masonry panels and with a covered area (footprint) of 703 sq. m. 6 staircase serves the building, out of which 5 stairs discharge internally. The building is used for stitching, packing and finishing (1st floor), finished goods store, cutting, fabric store and admin block (Ground floor) and stitching, office, workshop and accessory store (Basement). The building was constructed in 2022.

We were presented with Architectural Layouts, Civil Defence Certificate, fire drill records, and Staff Training documents.

A summary of the main concerns identified during the inspection includes (non-exhaustive):

- Lockable mechanisms observed in escape route across the whole facility.-
-Basement is not fire separated from rest of the building.
-There is no fire separation between stairs and the rest of the building.
-Most of the stairs discharge inside the building.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

# 2. Building Extents




Figure 1.1. Satellite image – Red dashed line indicates site boundary

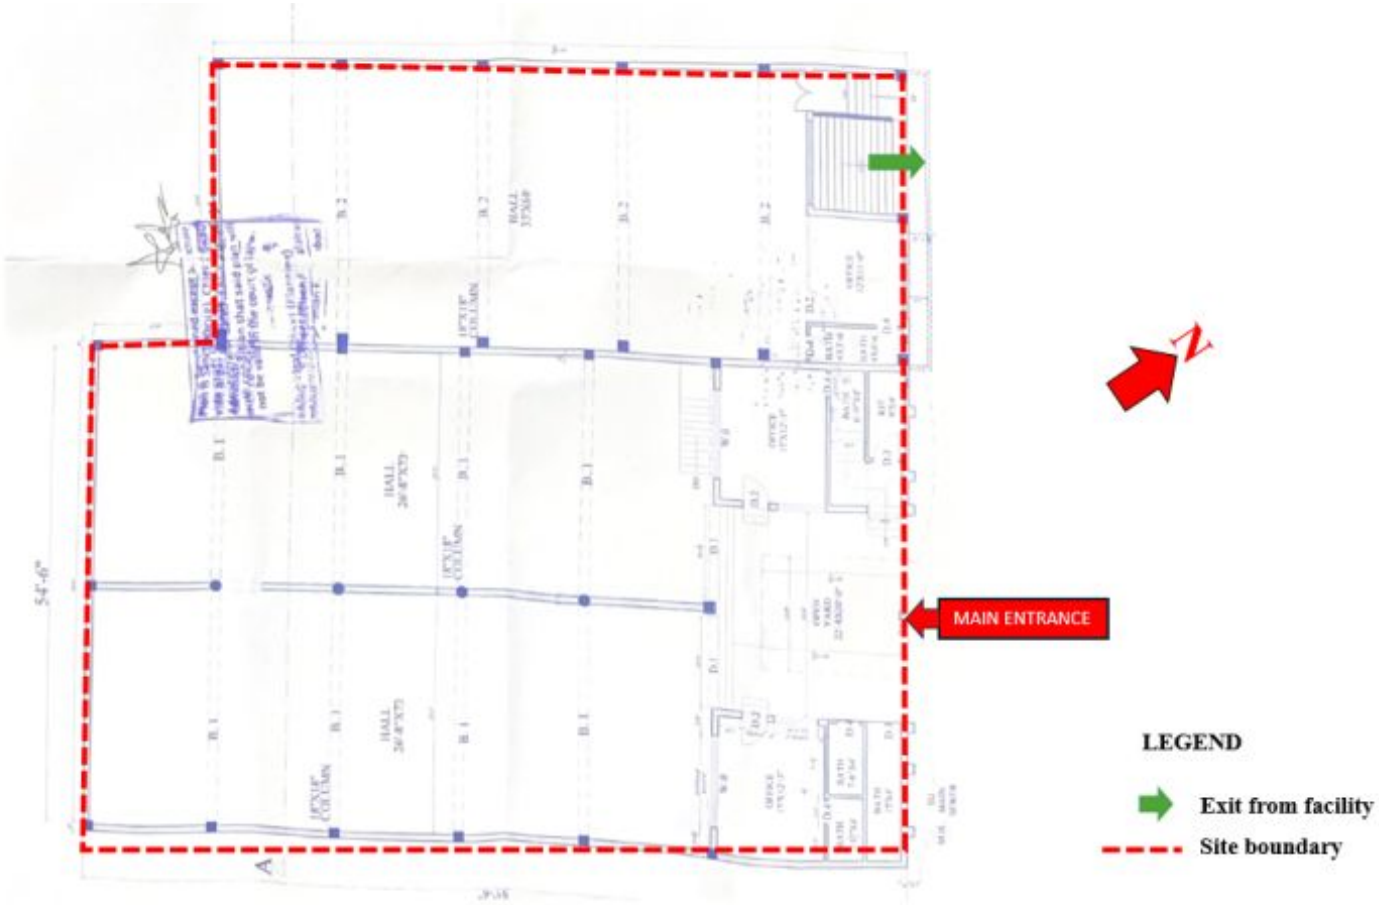



Figure 1.2. Site layout of the factory

# 3. Building Description

The factory comprises one main building rented by Fashion knits. During the inspection, the building highlighted in Figure 1.1 was inspected, with the site boundary indicated in red.

**Main Building –** is mainly a 2 storey (B+G+1) above grade plane, RC MRF building with infill masonry panels and with a covered area (footprint) of 703 sq. m. 6 staircase serves the building, out of which 5 stairs discharge internally. The building is used for stitching, packing and finishing (1st floor), finished goods store, cutting, fabric store and admin block (Ground floor) and stitching, office, workshop and accessory store (Basement). The building was constructed in 2022.

## 3.1 Building Means of Egress Details

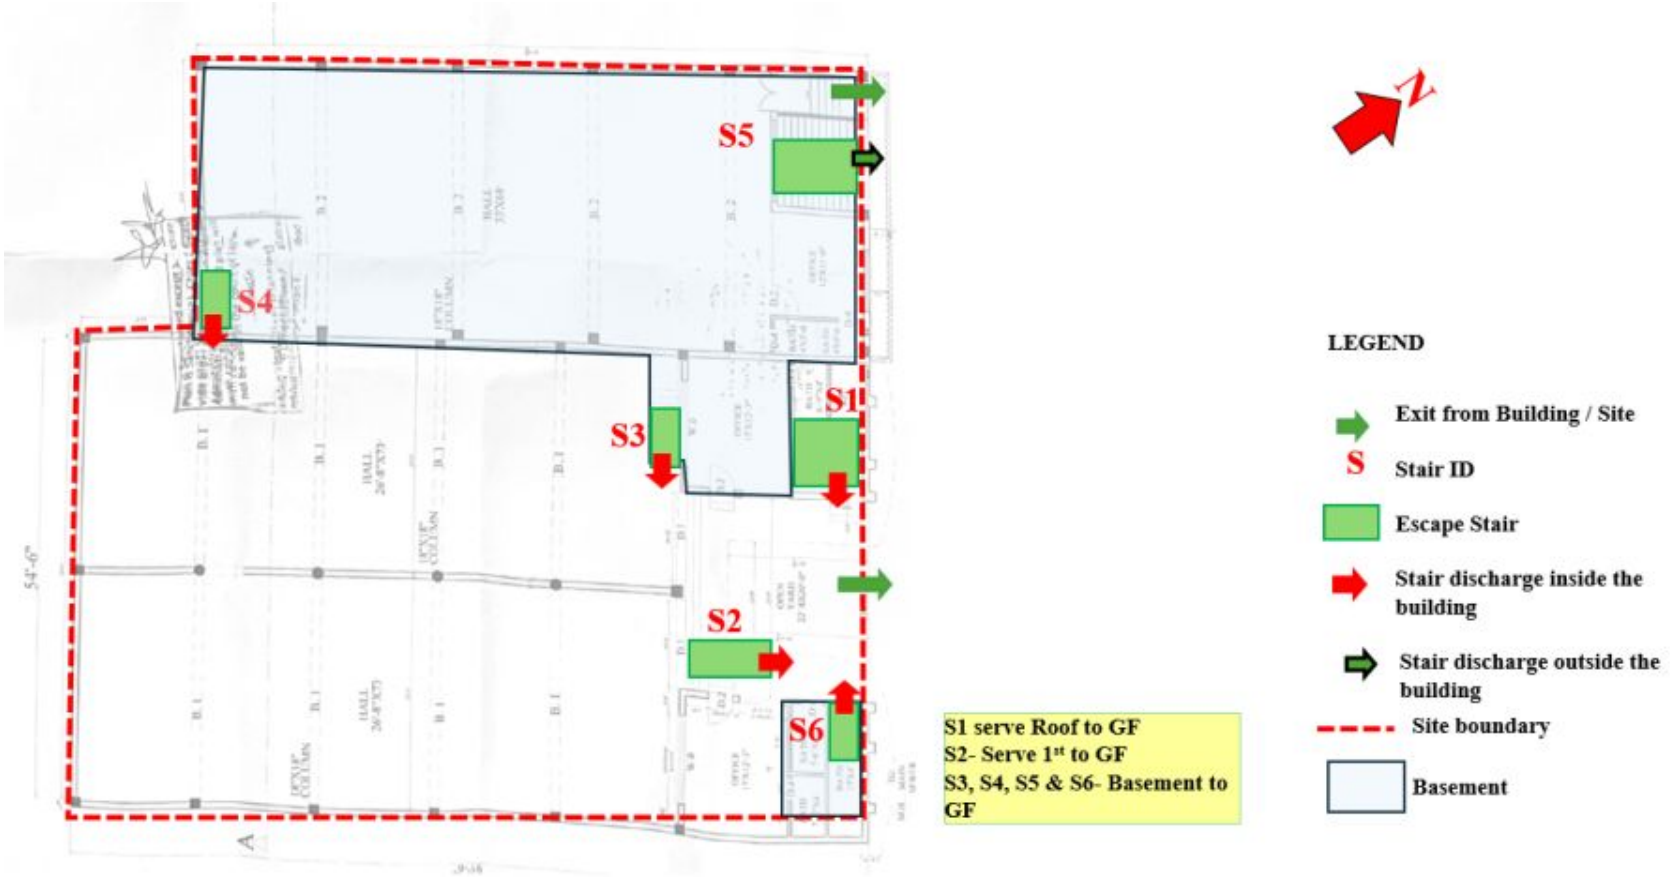



Figure 1.3. Egress layout- Ground floor

## 3.2 Building Use

| Floor level | Occupancy | Occupant Load | No. of Exits | Excessive travel distance | | |
|---|---|---|---|---|---|---|
| | | | | Alternatives | Common path | Dead End |
| Main Building | | | | | | |
| Roof | Un-occupied | - | 1 | - | - | - |
| 1st floor | Stitching, packing and finishing | 70 | 1 | - | - | - |
| Ground floor | Finish good store, cutting, fabric store and admin block | 50 | 2 | - | - | - |
| Basement floor | Stitching, office, workshop and accessory store | 30 | 4 | - | - | - |

The number of exits are not sufficient first floor (since stair S1 & S2 do not meet the remoteness criteria and taken as single exit).

# 4. Documentation

This table shows the details about the documentation provided by the factory.

| No. | Description | | Availability Yes/No | Created/ Updated | Status/Remarks |
|---|---|---|---|---|---|
| 1. | Civil Defence Certificate (NOC) | | Yes | 7-03-2026 | - |
| 2. | Architecture Layout | | Yes | - | - |
| 3. | Sectional Layout | | Yes | - | - |
| 4. | Evacuation Maps | | Yes | - | Missing on entrance into stairs at some floors |
| 5. | Emergency Action Plan | | No | - | - |
| 6. | Inspection | Fire extinguishers | No | - | - |
| | | Exit signage | No | - | - |
| 7. | Testing | Fire extinguishers | No | - | - |
| | | Exit signage | No | - | - |
| 8. | Maintenance | Fire extinguishers | No | - | - |
| | | Exit signage | No | - | - |
| 9. | Evidence of Fire Drills | | Yes | 8-10-2025, 24-02-2026 | Date, time & location missing in fire drill pictures, attendance sheet was not as per standard as no sign of individual (only tick against their names) |
| 10. | Staff Training | | Yes | 6-10-2025, 18-2-2026 | First aid & firefighting training |

Table 1: Documentation

# 5. Fire Safety Measures

During our fire site inspection of Fashion Knits, a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Fashion Knits. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

**Immediate**: These recommendations address safety and compliance concerns that require immediate attention.

**Medium term** (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

**Longer term** (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

# 6. Remediation Support

## 6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202603-064479

| Timeline | Remediation Plan |
|---|---|
| Immediate<br>CAP-0076110 | Factories should begin remediation of CAP items such as installing extinguishers, signage, and clearing escape routes using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required. |

# 7. Means of Escape

## 7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape
- Sliding doors shall not serve for escape from areas with more than 10 occupants

This is not always achieved, examples include (list not exhaustive):
- Escape doors are lockable at all over the facility e.g. main facility exit door and door connecting basement workshop area.
- Doors serving areas with over 50 occupants swing against the direction of escape i-e main facility exit door swing against the direction of escape.

- Sliding doors serve for escape from areas with more than 10 occupants at Ground floor.

Recommended remedial actions are provided below.F-202603-064492

| Timeline | Remediation Plan |
|---|---|
| Immediate<br>CAP-0076161 | Remove all locking devices from doors on all egress routes that could prevent opening from inside. |
| Medium Term<br>CAP-0076162 | Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5.<br>Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, that are side swinging and open in the direction of travel to an exit. |
| Longer Term<br>CAP-0076163 | Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits. |



Figure 2.1 - Sliding doors serve for escape from areas with more than 10 occupants at Ground floor



Figure 2.2 - Lockable main facility exit door swing against the direction of escape

## 7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.

This is not always achieved, examples include (list not exhaustive):
-Trip hazards on escape route at entry into S1 (roof ).
- Stairs S1 to S4 and S6 discharges inside the building at a distance from building exit
Recommended remedial actions are provided below.F-202603-064491

| Timeline | Remediation Plan |
|---|---|
| Immediate<br>CAP-0076151 | Clear the uneven areas in escape routes. |
| Medium Term<br>CAP-0076152 | For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover:<br>- Layout showing the location of fire rated walls/doors to protect stair discharge corridors<br>- Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks) |
| Longer Term<br>CAP-0076153 | Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard.<br>Some of the key requirements include:<br>- All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times.<br>- All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted. |



Figure 2.3 - Trip hazards on escape route at entry into S1 (roof )



Figure 2.4 - Stair S1 discharges inside the building

## 7.3 Number of exits

Per Pakistan Accord Standard, the exit provisions should meet the following:
- Minimum 2 exits from every occupied floor.
- Minimum 2 exits from every occupied area with more than 50 occupants.

This is not always achieved, examples include (list not exhaustive):
- Exits via S1 & S2 from 1st floor do not meet the remoteness criteria and considered as single exit.

Recommended remedial actions are provided below.F-202603-064493

| Timeline | Remediation Plan |
|---|---|
| Medium Term<br>CAP-0076164 | Review each floor and area to ensure that the number of exits complies with Pakistan Accord Standard.<br>Develop plans and drawings to provide additional exits where necessary. Submit the plan and drawings to Pakistan Accord for review and approval prior to commencing rectification works. |
| Longer Term<br>CAP-0076165 | Implement the above plan as agreed with Pakistan Accord.<br>Number of exits from all floors and parts of the building should comply with Pakistan Accord Standard. |

## 7.4 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Missing fire rated enclosure and fire doors in all stairs (all floors) except S1 (roof).
- Fire load in stair S1(Ground floor).
- Services passing through stair S1 (cables & AC pipes) at Ground floor.

Recommended remedial actions are provided below.F-202603-064482

| Timeline | Remediation Plan |
|---|---|
| Immediate<br>CAP-0076114 | Remove fire load and any other obstructions due to stored items from stairs |
| Medium Term<br>CAP-0076115 | Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover:<br>- Layout showing the location of fire rated walls /doors to protect the stairs.<br>- Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks).<br>- Location of stair discharge routes and details of fire resisting construction to protect that route. |
| Longer Term<br>CAP-0076116 | Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include:<br>- All doors into stairs should be fire resisting doors with self-closing mechanisms.<br>- Penetrations through doors are not permitted.<br>- Doors into stairs should be kept closed (but not locked) at all times. |



Figure 2.5 - Missing fire rated enclosure and fire doors in stair S4 (all floors)



Figure 2.6 - Services passing through stair S1 (cables & AC pipes) at Ground floor



Figure 2.7 - Fire load in S1 (Ground floor)

## 7.5 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):
- There are no handrails/missing on one side handrail in stair S1, S3, S4, S5 and S6.

Recommended remedial actions are provided below.F-202603-064487

| Timeline | Remediation Plan |
|---|---|
| Medium Term<br>CAP-0076136 | Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height. |



Figure 2.8 - There are no handrails in stair S6



Figure 2.9 - There are no handrails in stair S4

## 7.6 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at exits from site.
- Electrically powered exit signs are not a tested and listed system at whole facility.

Recommended remedial actions are provided below.F-202603-064485

| Timeline | Remediation Plan |
|---|---|
| Medium Term<br>CAP-0076132 | Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3 |
| Longer Term<br>CAP-0076133 | Ensure that all exit signage is checked periodically and in good working condition. |



Figure 2.10 - Exit signs are not tested and listed at 1st floor



Figure 2.11 - Missing exit signs at exits from site

# 8. Fire Rated Construction

## 8.1 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Gas steam generator is not fire separated with fire rated construction at Ground floor.

Recommended remedial actions are provided below.F-202603-064483

| Timeline | Remediation Plan |
|---|---|
| Medium Term<br>CAP-0076125 | Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover:<br>- Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.)<br>- Locations of fire- rated walls and doors to protect these rooms<br>- Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction) |
| Longer Term<br>CAP-0076126 | Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord. |



Figure 2.12 - Gas steam generator is not fire separated from rest of the building at Ground floor

## 8.2 Separation of occupancies

Pakistan Accord Standard requires different occupancy types to be fire separated from each other. The aim is to limit the fire to only one occupancy type.

The following deficiencies have been observed on site, including (list not exhaustive):
- Basement is not fire separated from the rest of the building with fire rated construction.

Recommended remedial actions are provided below.F-202603-064484

| Timeline | Remediation Plan |
|---|---|
| Medium Term<br>CAP-0076127 | Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover:<br>- Different occupancy types in the building<br>- Proposed fire separation details (including fire rating of walls and doors) |
| Longer Term<br>CAP-0076128 | Provide fire rated separation between occupancies as per proposal reviewed by Pakistan Accord |



Figure 2.13 - Basement is not fire separated from the rest of the building with fire rated construction

## 8.3 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building e.g. accessories store not separated from stitching at 1st floor, finished goods store and fabric store not separated from cutting at Ground floor.

Recommended remedial actions are provided below.F-202603-064486

| Timeline | Remediation Plan |
|---|---|
| Medium Term<br>CAP-0076134 | Identify all designated storage areas.<br>Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building.<br>For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover:<br>- Locations of fire rated walls and doors.<br>- Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction). |
| Longer Term<br>CAP-0076135 | Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard. |



Figure 2.14 - Finished goods store not fire separated from cutting at Ground floor

# 9. Fire Safety Management

## 9.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Fire drill documentation is of poor standard (Date, time & location missing in fire drill pictures, attendance sheet was not as per standard).

Recommended remedial actions are provided below.F-202603-064480

| Timeline | Remediation Plan |
|---|---|
| Medium Term<br>CAP-0076111 | Conduct a fire drill and make records, including findings and recommended future improvements. |
| Longer Term<br>CAP-0076112 | Ensure fire drills are performed a minimum of 2 times per year. |

## 9.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire Extinguishers
- No records of testing of Emergency Exit Signage

Recommended remedial actions are provided below.F-202603-064489

| Timeline | Remediation Plan |
|---|---|
| Medium Term<br>CAP-0076147 | - Prepare a schedule of proposed system testing.<br>- Identify how systems will be tested and who is responsible.<br>- The schedule is to be submitted to the Accord for review and approval. |
| Longer Term<br>CAP-0076148 | - Ensure all systems are being tested as per the schedule agreed with Accord.<br>- Keep testing records. |

## 9.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
-No records of maintenance of Fire Extinguishers
-No records of maintenance of Emergency Exit Signage

Recommended remedial actions are provided below.F-202603-064488

| Timeline | Remediation Plan |
|---|---|
| Medium Term<br>CAP-0076142 | - Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details.<br>- Identify how systems will be maintained and who is responsible.<br>- The schedule is to be submitted to the Accord for review and approval. |
| Longer Term<br>CAP-0076143 | - Ensure all systems are being maintained as per the schedule agreed with Accord.<br>- Keep maintenance records. |

## 9.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid firefighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):

- Escape diagrams are missing on some levels.
- There is no EAP document which details procedures, roles and responsibilities in the event of fire.

Recommended remedial actions are provided below.F-202603-064490

| Timeline | Remediation Plan |
|---|---|
| Medium Term<br>CAP-0076149 | Ensure that evacuation plans are provided on each level.<br>Prepare an Emergency Action Plan report. |
| Longer Term<br>CAP-0076150 | Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills. |

# 10. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.