Issue	**1**
Factory ID	**26329**
Date of Issue	**22-Apr-2026**

Fashion Knits

8000 Opposite Canal Road, Near Zeeshan Shah (Ex-MPA) Rd, Mian Pind, Mansoorabad
38000 Faisalabad
Punjab Pakistan

Latitude: [31.441207], longitude: [73.120085]
Date of inspection: 11-Mar-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Ausama Iqbal**
Reviewed by	**Talha Akram Khan**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 11-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 4
2. Building Extents 6
   2.1 Structural System 11
3. Documentation 13
4. Structural Safety Measures 14
5. Remediation Support 15
   5.1 Engineering Support 15
6. Other Damage/Defects 16
   6.1 Corrosion of reinforcement 16
   6.2 Health and Safety 18
7. Structural Documentation 20
   7.1 Documentation unavailable 20
   7.2 Lack of safe load plans 21
8. Assessment Limitations and Assumptions 22

1. Executive Summary

On 11-Mar-2026, Ausama Iqbal and Muhammad Asim on behalf of the Pakistan Accord carried out an initial structural inspection for Fashion Knits, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Umair Hafeez (Owner), Mr. Waseeq (Compliance advisor), Mr. Rafiq Khan (Compliance Advisor) and other staff members of Fashion knits.

The factory operates in one general shift, with approximately 50 workers operate in the factory, with 10 workers being females.

The factory comprises one main building rented by Fashion knits. During the inspection, the building highlighted in Figure 1.1 was inspected, with the site boundary indicated in red.

- **Main building** is a primarily 2 storey with locally 3 storey (basement + ground, ground + 1 and locally basement + ground + 1), RC Moment resisting frame with infill masonry panels. The building is used for stitching, packing and finishing (1st floor), finish good store, cutting, fabric store and admin block (ground floor) and stitching, office and accessory store (basement). The construction date of building is 2022.

We were presented with approved architectural layout plan and site plan, details are listed in Table 2.

There is a Health & safety issue regarding edge protection at roof and staircase which present a risk of potential injury resulting from slip, trip or fall from building. For further details, please refer to section 6.

A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Corrosion of reinforcement in dowel bars of columns at roof.
- As-built structural drawings are unavailable.

We see no reason to suspend operations in the facility due to these concerns, subject to the actions identified being addressed within the specified timeframes.
Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1 - Building Summary

Building	Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / modifications	Engineer access issues
Main Building	Stitching, packing and finishing (1st floor) Finish good store, cutting, fabric store and admin block (ground floor) Stitching, office and accessory store (basement)	3 storey (Basement + Ground + 1)	2022	RC moment resisting frame with infill masonry panels	-	-	-



Figure 1.1. Site plan (Satellite view) - Red dashed line indicates site boundary, highlighted (blue) area indicated area inspected.

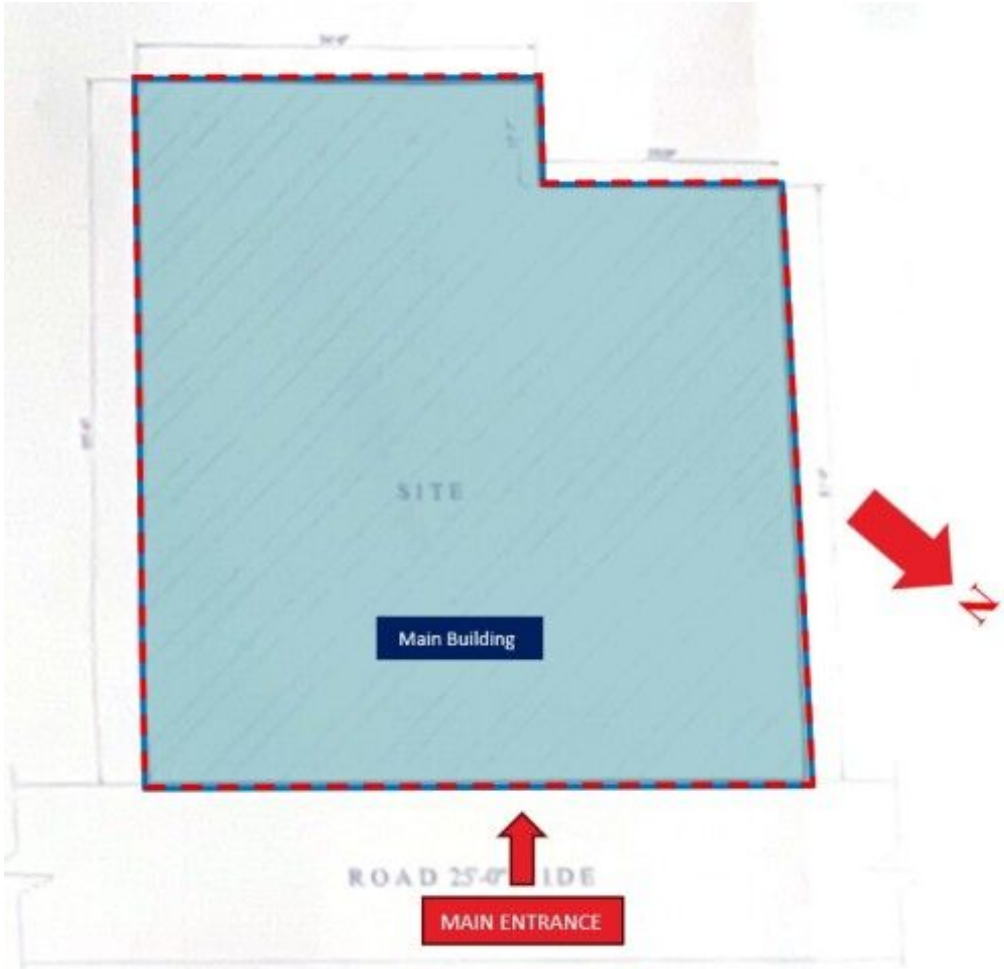


Figure 1.2. Site layout. Red dashed line indicates site boundary, highlighted area (blue) indicates buildings inspected.



Figure 1.3. Front elevation of the building



Figure 1.4. Roof of the main building



Figure 1.5. Typical activity at 1st floor in main building



Figure 1.6. Typical activity at ground floor in main building



Figure 1.7. Typical activity at basement in main building

2.1 Structural System

Building	Main Building
Stability system	RC Moment Resisting Frame with infill masonry panels
Column size (m)	0.4 dia (internal) 0.4 x 0.4 (external)
Grid (m)	8.15 x 4.5 9.95 x 4.1 (basement area)
Primary beam size (m)	0.3 x 0.6 0.43 x 0.63 (basement area)
Secondary beam size (m)	-
Slab depth (m)	0.2
Finishes depth (m)	0.1
Ceiling height (m)	3.4 (basement) 4.25 (ground floor) 3.5 (1st floor)


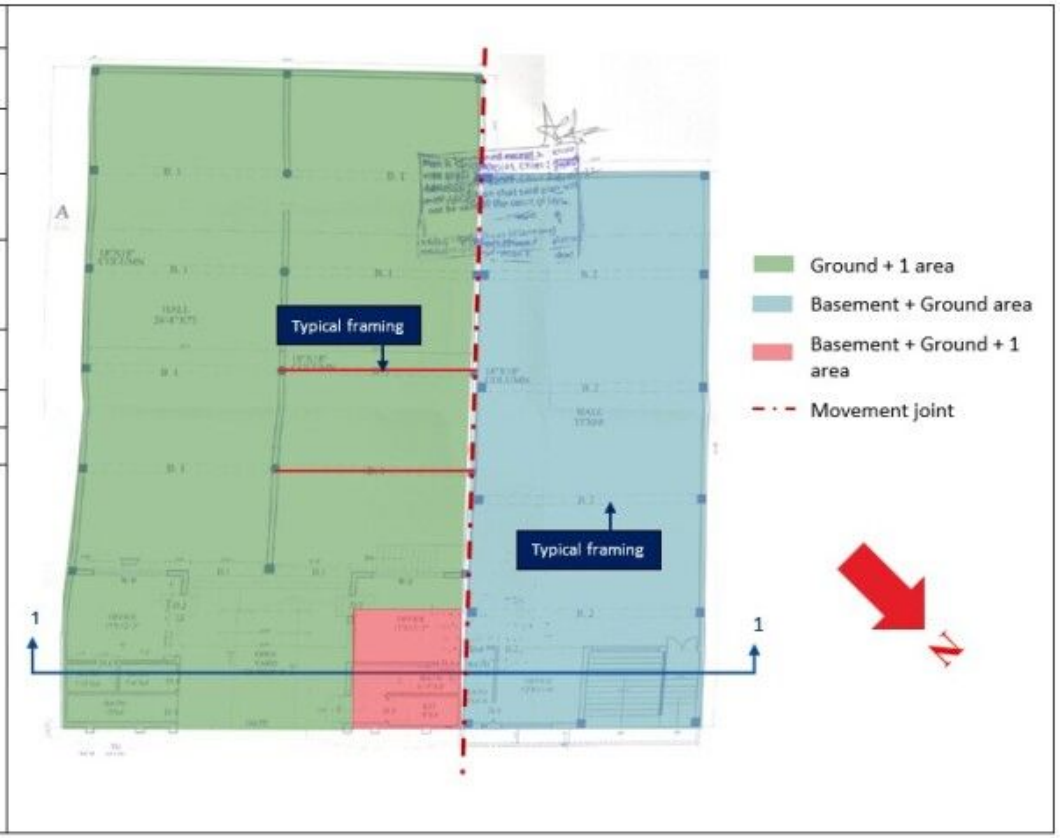


Figure 1.8. Typical framing layout of main building

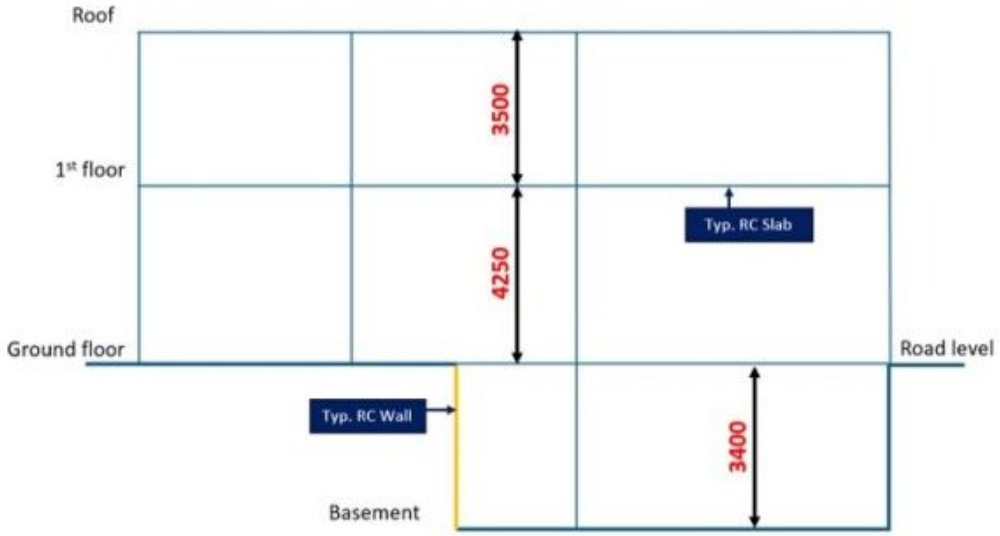

Structural System Notes

Column size is the structural dimension and excludes render thickness

Grid measurements are from centre of column to centre of column

Beam sizes do not include slab depth

Figure 1.9. Section 1-1 of main building

3. Documentation

We were presented with the following documentation.

Table 2 - Documentation

Building	Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plan	Stability certificate	Inspection reports	Materials testing
Main Building	Yes	Yes	No	No	No	No	No	No	No

4. Structural Safety Measures

During our structural site inspection of Fashion Knits, a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within Fashion Knits. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3: Summary of issues by building

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Main building	-	-	-	-	Corrosion of reinforcement Health & Safety -Edge protection	Lack of safe load plan Documentation unavailable

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-064912

Timeline	Remediation Plan
Medium Term CAP-0076812	Factories should begin remediation of CAP items—such as surface cracks or non-structural repairs using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Other Damage/Defects

6.1 Corrosion of reinforcement

This refers to the exposed rebars on the roof of main building, where the rebars were corroded because of being exposed to the atmosphere. This corrosion can lead to reduction in the capacity of the rebars overtime. F-202604-064910

Timeline	Remediation Plan
Medium Term CAP-0076809	Building Engineer to inspect areas with exposed rebars and protect it from the weathering effects, also propose the remedial solution to further reduce the effect of corrosion and present to Pakistan Accord for review.
Longer Term CAP-0076810	Implement the remedial works.



Figure 2.1 - Corroded dowel bars at roof of main building



Figure 2.2 - Corroded dowel bars at roof of main building

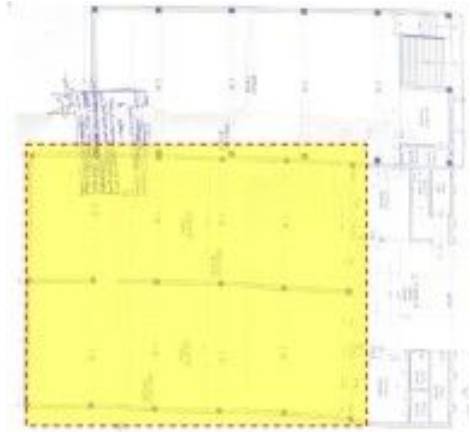


Figure 2.3 - Plan showing location of the area

6.2 Health and Safety

It concerns with inadequate edge protection which present a risk of potential injury resulting from slip, trip or fall from roof of main building where height of parapet wall is insufficient, also staircase leading to roof lacking handrails – Health & Safety concern F-202604-064911

Timeline	Remediation Plan
Immediate CAP-0076811	Provide adequate edge protection at roof and staircase, and on any other part of the factory with the same issue.



Figure 2.4 - Insufficient wall height at roof of main building



Figure 2.5 - No edge protection at staircase at roof in main building



Figure 2.6 - Plan showing location of the area

7. Structural Documentation

7.1 Documentation unavailable

As-built structural drawings of main building are unavailable F-202604-064909

Timeline	Remediation Plan
Longer Term CAP-0076802	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as-built documentation

7.2 Lack of safe load plans

No safe loading plans were posted on the floors on any floor of main building F-202604-064908

Timeline	Remediation Plan
Longer Term CAP-0076800	Building structural engineer to review design documentation to confirm load capacity of the structure. Develop safe load plans and submit to Pakistan Accord for review
Longer Term CAP-0076801	Factory to post safe load plans on each floor

8. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.