Issue	**1**
Factory ID	**26328**
Date of Issue	**26-Mar-2026**

Fashion & Styles

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Chak 117/JB, (Dhanola) Millat Industrial Estate Road
37600 Faisalabad
Punjab Pakistan

Latitude: [31.501775], longitude: [73.101816]
Date of inspection: 12-Mar-2026

Electrical Safety Inspection Report

Observations & Actions



Authors	**Syed Hassan Hussain**
Reviewed by	**Muhammad Asif**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 12-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
   - 2.1 Building Use 9
   - 2.2 Utility Source 10
   - 2.3 Backup source 11
3. Documentation 12
4. Electrical Safety Measures 13
5. Remediation Support 14
   - 5.1 Engineering Support 14
6. Diagrams & Drawings 15
   - 6.1 Sub-station room layout drg 15
   - 6.2 Single Line Diagram (SLD) 16
   - 6.3 Electrical layout drawing 17
7. DBs & Elec Protection Systems 18
   - 7.1 Circuit breakers 18
   - 7.2 Hot Spots 20
   - 7.3 Earthing system 23
   - 7.4 Panel/cabling/busbar 26
   - 7.5 Loop Connection 28
   - 7.6 Multiple Connections 30
   - 7.7 Openings 32
   - 7.8 Adequate accessibility 34

7.9 Lint & dust inside panel board 36
7.10 Lightning Protection System (LPS) 38
8. Fire Alarm & Detection System (FADS) 40
8.1 Non-functional or incomplete 40
9. Emergency Lighting 43
9.1 Provided but insufficient 43
9.2 Independent power source 46
10. Generator, Transformer & Sub-Station Room 47
10.1 Battery 47
11. Cabling & Wiring 49
11.1 Cable support and protection 49
11.2 Cable trench and channel cleanliness 51
11.3 Splicing of cables 53
11.4 Fixtures 56
12. Assessment Limitations and Assumptions 58

1. Executive Summary

On 12-Mar-2026, Syed Hassan Hussain and Zeeshan Haider on behalf of the Pakistan Accord carried out an initial electrical inspection for Fashion & Styles, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Muhammad Nadeem Ashraf (HR), Mr. Muhammad Waqas (Civil representative), and other staff members of Fashion & Styles.

The factory comprises of two main building and four ancillary structures owned by Fashion & Styles. During the inspection, the area highlighted in blue in Figure 1.1 was inspected, with the site boundary indicated in red.

Building 01: A four-storey (Basement+Ground+2) building used for solar panels (Roof), cutting, printing, and sublimation machine area (second floor), stitching, pressing, finishing, packing, Schmidt storage, washing area, audit room and sample room (first floor), stitching, packing, finishing, Q.A department, storage and offices (ground floor) and cutting and storage area (basement).

Building 02: A single-storey (Ground only) building used for solar panels (roof), embroidery hall, offices, and warehouse (ground floor).

There are four ancillary structures, details of which are given below:

Gate office 1: A two-storey (Ground+1) structure used for offices (first floor) and an electric room (ground floor).
Gate office 2: A single-storey (Ground only) structure used for gate office purposes and an electric room (ground floor).
Prayer area: A single-storey (Ground only) structure used for prayer area (ground floor).
Mess and Canteen: A single-storey (Ground only) structure used for mess and canteen purposes (ground floor).

A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned is as follows:

Hotspots: Within electrical panels at cable termination points, there were signs of hotspots exceeding safe operating limits. Immediate measures are necessary to ensure safe operations.
Earthing: The factory does not have an earthing system installed for the electrical installation. The absence of a proper earthing system poses a significant safety risk, including potential electric shock, fire hazards, and damage to electrical equipment.
Insufficient Emergency Lighting: Several areas lack sufficient emergency lighting and exit sign coverage, which may create hazardous conditions during an emergency. Poor illumination along walkways can increase the risk of trips and falls, while unclear or inadequately marked exit routes may cause confusion and panic among workers attempting to evacuate.

We see no reason to suspend operations in the facility due to these concerns, subject to the actions identified being addressed within the specified timeframes.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents



Figure 1.1. Site plan (Satellite View) – Red dashed line indicates site boundary, highlighted area (blue) indicates buildings inspected



Figure 1.2. Site layout Plan; Red dashed line indicates site boundary, highlighted area indicates buildings inspected

2.1 Building Use

The factory comprises two buildings and building use per floor is as follows:

Building 1:
B00- Basement is used as cutting and storage area.
L00- Ground floor is used as stitching, packing, finishing, Q.A department, storage and offices.
L01- First floor is used as stitching, pressing, finishing, packing, Schmidt storage, washing area, audit room and sample room.
L02- Second floor is used as cutting, printing and sublimation machine area.
L99- Roof is used for solar panels.

Building 2:
L00- Ground floor is used as warehouse, offices, and embroidery department.
L99- Roof is used for solar panels.

2.2 Utility Source

This factory utilizes a low-voltage 400V connection supplied from FESCO as its primary source. This connection is terminated in their electric room located on the ground floor of building 1. Further distribution is done from their main LT panel throughout the facility. Furthermore, a 70kW solar system is also installed in the factory, serving as a primary source as well.

2.3 Backup source

This factory utilizes a 50kVA diesel generator as its backup source. Emergency lighting and Fire alarm and detection system has its own standalone battery backup.

3. Documentation

This table shows the details of the documentation provided by the factory.

S.NO	Description	Available (Y/N)	Created Date	Status / Remarks
1	Electrical Layout Drawing	No	-	-
2	Single Line Diagrams	No	-	-
3	Fire Alarm Drawing	No	-	-
4	Earth Test Report	No	-	-
5	Thermographic Test Report	No	-	-
6	Insulation Resistance Test Report	No	-	-
7	LPS Risk Assessments	No	-	-
8	Periodic Maintenance Record	No	-	-
9	Transformer Oil Testing Report	N/A	-	-

4. Electrical Safety Measures

During our electrical site inspection of Fashion & Styles, a number of electrical issues were identified.

It is essential to address these electrical safety issues promptly to enhance safety and compliance within Fashion & Styles. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

All survey, testing, and design activities specified in this report shall be performed by a qualified electrical engineer. The recommended installation and modification tasks should be executed by a trained professional electrician.

Before commencing any installation and/or modification works, the proposed design must be submitted to the Pakistan Accord for approval.

Upon completion of the works, the necessary evidence required to verify that the tasks have been completed to the agreed standards will be determined during the development of the Corrective Action Plan (CAP).

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202603-064114

Timeline	Remediation Plan
Medium Term CAP-0075183	Factories should begin remediation of CAP items - such as cleaning, cable organization, and basic corrections - using internal resources. For systems or design-related remediation, engagement of a qualified Electrical Design Engineer is required.

6. Diagrams & Drawings

6.1 Sub-station room layout drg

This section refers to the electrical rooms within the facility.

During the inspection conducted, it was observed that there were no substation room layout drawings available for the factory.

There are no visible indications of substation equipment locations or pathways for maintenance and emergency access.

The absence of substation room layout drawings poses significant risks to life and fire safety within the factory premises. Without these critical documents, emergency responders and maintenance personnel may face difficulties in locating and isolating electrical faults during emergencies. This delay can result in prolonged exposure to electrical hazards, increasing the risk of electrical fires and endangering lives. Furthermore, the lack of layout drawings complicates routine maintenance, potentially leading to undetected faults and increased likelihood of equipment failure. F-202603-063930

Timeline	Remediation Plan
Immediate CAP-0074904	Develop detailed substation room layout drawings in accordance with the requirements outlined in Sections 132.12 and 132.13 of BS7671 18th Edition + A2 (2022). Ensure that all critical equipment and pathways are accurately documented. Retain the drawings along with all O&M information for the facility.
Longer Term CAP-0074905	Regularly update and review the substation room layout drawings to reflect any changes in equipment or configuration. Provide training sessions for maintenance personnel and emergency responders on how to interpret and utilize the layout drawings.

6.2 Single Line Diagram (SLD)

This section refers to the entire facility.

It was found that the electrical single line diagrams (SLDs) for the factory were missing. This deficiency was noted in all electrical rooms and areas where SLDs should be prominently displayed.

The factory lacks documented diagrams that illustrate the electrical distribution system, including the connection and configuration of all electrical components.

Single line diagrams are crucial for understanding the electrical distribution network and for troubleshooting issues effectively. Without these diagrams, maintenance personnel and emergency responders lack critical information necessary for isolating faults and managing power during emergencies. This can lead to delays in addressing electrical issues, increasing the risk of electrical fires and potential harm to personnel. Moreover, the lack of SLDs complicates routine maintenance and inspection processes, potentially resulting in undetected electrical faults and system inefficiencies.F-202603-063934

Timeline	Remediation Plan
Medium Term CAP-0074921	Develop comprehensive electrical single line diagrams for the entire facility in accordance with the requirements outlined in Section 514.9.1 of BS7671 18th Edition + A2 (2022). Ensure all components and connections are accurately represented. Retain the drawings along with all O&M information for the facility.
Longer Term CAP-0074922	Implement a regular review and update process for the single line diagrams to reflect any changes in the electrical system. Conduct training sessions for maintenance personnel and emergency responders on interpreting and using the diagrams.

6.3 Electrical layout drawing

This section refers to the entire facility.

During the survey, it was noted that the factory lacked electrical layout drawings - including small power layouts, lighting layouts, and containment layouts.

This absence was consistent across all areas where such documentation should be available.

These drawings are vital for understanding the placement and connections of electrical systems, which is crucial for identifying and mitigating potential hazards. In emergencies, the lack of detailed layouts can delay the identification and isolation of electrical faults, increasing the risk of fire and electrical accidents. Additionally, without proper layout drawings, routine inspections and maintenance may overlook critical issues, potentially leading to system failures and safety breaches.F-202603-063946

Timeline	Remediation Plan
Medium Term CAP-0074961	Develop comprehensive electrical layout drawings in accordance with the requirements outlined in Sections 132.12 and 132.13 of BS7671 18th Edition + A2 (2022). To avoid drawings becoming overcrowded, separate drawings shall be prepared for each electrical system. Retain the drawings along with all O&M information for the facility.
Longer Term CAP-0074962	Implement a regular review and update process for the electrical layout drawings to reflect any changes in the system. Conduct training sessions for maintenance personnel and emergency responders on interpreting and using the layouts.

7. DBs & Elec Protection Systems

7.1 Circuit breakers

This section refers to the entire facility.

During the survey the circuit breakers installed throughout the facility inside the electrical panels and distribution boards were inspected.

It was observed that multiple circuit breakers had ratings that were not appropriate for the connected cable sizes. Issues observed are as follows:

i. 250A circuit breaker on 25sq.mm cable observed in main LT panel at ground floor of building 1.
ii. 100A circuit breaker on 4sq.mm cable observed in main distribution board at first floor of building 1.

Specifically, some circuit breakers had higher ratings than the cables could safely handle, which poses a significant risk of overheating and potential fire hazards. Conversely, other circuit breakers had lower ratings than necessary, resulting in frequent and unnecessary tripping. To ensure both safety and operational efficiency, corrective action is required to align the circuit breaker ratings with the cable capacities. This adjustment will mitigate the risks associated with overheating and improve the reliability of the electrical system. F-202603-063920

Timeline	Remediation Plan
Medium Term CAP-0074809	Evaluate the breaker ratings and cable sizes for all circuits in the facility according to Section 433.1.1 and Appendix 4 of BS 7671 18th Edition + A2 (2022). Ensure that the breaker rating does not exceed the cable's current-carrying capacity. If the breaker has adjustable settings, they must be configured to allow current within the cable's ampacity after applying derating factors.

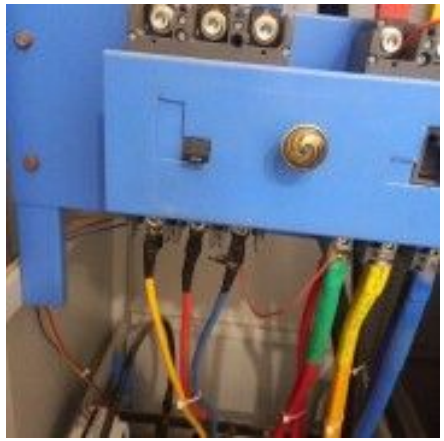


Figure 2.1 - 250A circuit breaker on 25sq.mm cable observed in main LT panel at ground floor of building 1



Figure 2.2 - 100A on 4sq.mm cable observed in main distribution board at first floor of building 1

7.2 Hot Spots

This relates to the entire facility.

During the inspection, Thermographic surveys were conducted on the electrical boards.

The survey identified numerous hot spots within panels and distribution boards. Hot spots in electrical distribution systems can be caused by several factors, including:

> Loose connections
> Overloaded circuits
> Faulty components
> Improper sized cable
> Insulation degradation

Circuit breakers are typically designed to operate safely within an ambient temperature range of -20°C to 40°C. Commonly used PVC-insulated cables typically have a maximum operating temperature of 70°C. Prolonged exposure to temperatures above these can degrade the insulation of the breaker as well as the cable and result in reduced performance. Hotspots observed are as follows:

i. Hotspot of 78 °C was observed in main distribution board at second floor of building 1.
ii. Hotspot of 54 °C observed in main distribution board at first floor of building 1.
iii. Hotspot of 53 °C was observed in lighting distribution board at ground floor of building 1.

All temperature-related assessments are based on Table 100.18 of ANSI Standard 2019.
It was also observed that the thermography report for the factory was not available at the time of inspection.

Hot spots in electrical systems pose significant life safety risks due to several factors. Overheated components can ignite surrounding materials, leading to electrical fires. This is particularly dangerous in densely packed panels and distribution boards where flammable materials may be present. Hot spots can degrade insulation on wires and components, increasing the risk of electrical shock to personnel who might come into contact with exposed conductive parts. Overheating can contribute to conditions that might trigger an arc flash, a dangerous high-temperature event that can cause severe injuries or fatalities to personnel working near the affected equipment. F-202603-063924

Timeline	Remediation Plan
Immediate CAP-0074880	Any circuits identified on site with temperatures exceeding 40°C above the ambient temperature, operating above 90°C or exhibiting visual signs of burning must be immediately isolated and taken out of service. These circuits should remain de-energized until a thorough review has been conducted and appropriate remedial actions have been implemented to resolve the underlying issues.
Medium Term CAP-0074881	During the inspection, several circuits were identified where the temperature was exceeding 20°C above ambient temperature, as illustrated in the example images below. It is recommended that the factory conducts comprehensive thermographic surveys of all electrical panels to detect similar issues. Identified hot spots should be thoroughly reviewed to determine their underlying causes. Corrective actions must be taken to address and resolve these issues, ensuring safe and reliable operation of the electrical systems.
Longer Term CAP-0074882	Regular thermographic inspections should be incorporated into the maintenance schedule to proactively manage and mitigate the risks associated with overheating.

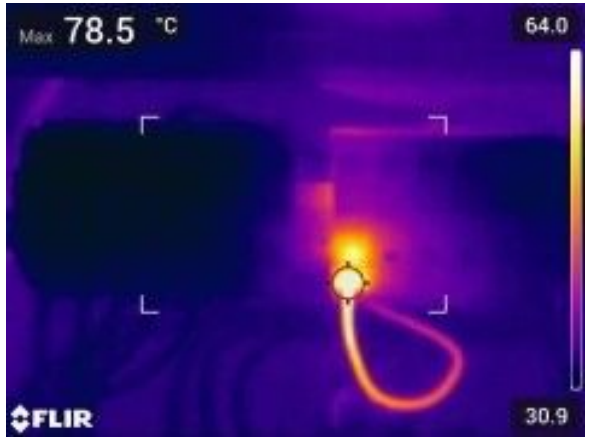




Figure 2.3 - Hotspot observed in main distribution board at second floor of building 1

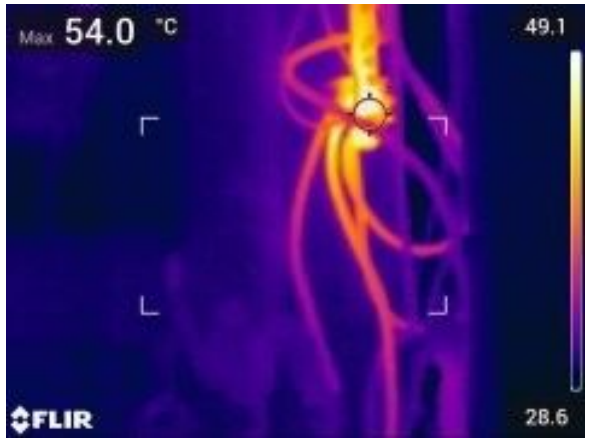


Figure 2.4 - Hotspot observed in main distribution board at second floor of building 1



Figure 2.5 - Hotspot observed in main distribution board at first floor of building 1



Figure 2.6 - Hotspot observed in main distribution board at first floor of building 1



Figure 2.7 - Hotspot observed in lighting distribution board at ground floor of building 1

Figure 2.8 - Hotspot observed in lighting distribution board at ground floor of building 1

7.3 Earthing system

This relates to the entire facility.
During the inspection of the facility's electrical panels, distribution boards, and machinery, several observations with the earthing system were identified.

It was observed that the factory does not have an earthing system installed. There is no earth pit provided, nor is there any earthing distribution network established throughout the facility. This issue was observed in both building 1&2.

The lack of a proper earthing system throughout the facility poses substantial safety risks, such as electric shocks, fires, and equipment damage. Implementing appropriate earthing measures is crucial to prevent hazardous voltage levels and ensure operational safety. F-202603-063935

Timeline	Remediation Plan
Medium Term CAP-0074934	i. Develop a detailed earth layout drawing for the factory and submit it to Pakistan Accord for review.
Medium Term CAP-0074935	ii. Install earthing systems where absent, ensuring compliance with BS 7671 18th Edition + A2 (2022) Chapter 54. Fit all electrical boards with the required earthing cables. Ensure that earthing conductors are properly connected and comply with BS 7671 18th Edition + A2 (2022) Section 543.1.
Medium Term CAP-0074936	iii. Implement equipotential bonding for all cable trays to comply with BS 7671 Regulation 411.3.1.2. Ensure all exposed conductive parts are bonded to the main earthing terminal.
Medium Term CAP-0074937	iv. Provide earth pit ohmic values test result as per IEC 60364 & IEC 61557-5 for testing method; fall of potential method.
Longer Term CAP-0074938	Establish a schedule for regular maintenance and inspection of the earthing system and protective devices as per BS 7671 Regulation 651.2. Document all inspections and maintenance activities to ensure ongoing compliance. Provide training to facility maintenance personnel on proper earthing practices and the importance of maintaining electrical safety standards in line with BS 7671 requirements.



Figure 2.9 - No earth connection observed in DC panel in LT room at ground floor of building 1



Figure 2.10 - Empty earth bar observed for main LT panel at ground floor of building 1



Figure 2.11 - No equipotential bonding observed in main distribution board of basement in building 1



Figure 2.12 - No earth connection provided in main distribution board at first floor of building 1



Figure 2.13 - No earth connection provided in main distribution board at ground floor of building 2



Figure 2.14 - No earth connection provided in main distribution board at ground floor of building 2

7.4 Panel/cabling/busbar

This relates to the entire facility.

The visual site inspection included an examination of the electrical panels, cables and busbars throughout the facility.

In a number of external areas it was observed that electrical components were not suitable for the environmental conditions in which they were installed. This issue was observed at several locations including in embroidery department at ground floor of building 2.

The utilisation of electrical equipment that is either unsuitable for its operating environment or physically damaged poses significant safety risks. These risks include potential electrical failures, increased likelihood of short circuits, and the heightened risk of fire and electrical shock. F-202603-063918

Timeline	Remediation Plan
Medium Term CAP-0074804	Identify and replace electrical circuits that are not suitable for the environmental conditions in which they are installed in accordance with Section 512.2 of BS 7671 18th Edition + A2 (2022).



Figure 2.15 - Circuit breaker installed openly & on wooden backsupport in embroidery department at ground floor of building 2

7.5 Loop Connection

This relates to the entire facility.

During the inspection, loop connections were identified within the electrical panels.

In these loop connections, one circuit breaker is energised by the live part of another circuit breaker, creating loops within the panel instead of using a busbar system. This issue was observed at several locations in building 1 & 2.

Avoiding loop connections is crucial due to several significant risks. Loop connections can complicate maintenance activities, making it difficult to trace and isolate circuits. These connections can lead to increased resistance and overheating, potentially damaging components. Loop connections raise the risk of accidental phase mixing, which can result in short circuits. The above issues compromise personal safety and significantly increase the risk of fire.F-202603-063932

Timeline	Remediation Plan
Medium Term CAP-0074914	All electrical panels shall be modified to eliminate loop connections. A busbar system within the electrical panels shall be utilised to provide each circuit with the required live, neutral, and earth connections.



Figure 2.16 - Loop connection observed in main distribution board at second floor of building 1



Figure 2.17 - Loop connection observed in main dsitribution board at ground floor of building 2

7.6 Multiple Connections

This relates to the whole facility.

During our inspection, multilooping was observed in a number of electrical panels across the facility.

In these cases, multiple circuits were being protected by a single circuit breaker. This issue was observed at several locations at ground and first floors in building 1.

Multilooping can result in improper distribution of electrical current, leading to voltage drops and potential electrical hazards. To mitigate these risks and ensure the safety and reliability of the electrical system, it is essential to adhere to proper installation practices. This includes using appropriate dedicated circuit breakers for each circuit.F-202603-063922

Timeline	Remediation Plan
Medium Term CAP-0074814	The electrical installation throughout the facility shall be modified to ensure each circuit is protected by a dedicated circuit breaker of a suitable type and rating for each individual circuit in accordance with Section 430 of BS 7671 18th Edition + A2 (2022)



Figure 2.18 - Multiple connections observed in main distribution board of accessory store at ground floor of building 1



Figure 2.19 - Multiple connections observed in main distribution board at first floor of building 1

7.7 Openings

This relates to the entire facility of the factory.

During the visual inspection, the electrical panels and distribution boards were examined for unsealed openings to ensure compliance with the IP rating requirements.

It was observed that unsealed openings were discovered in the panels and distribution boards incuding ground floor of building 1 and 2.

These deficiencies pose multiple hazards. Unsealed openings and missing panels expose live electrical components, significantly increasing the risk of accidental contact and electric shock to personnel working nearby. The unsealed openings allow dust, debris, and moisture to enter, which can lead to short circuits and increase the risk of fire. The absence of proper sealing compromises the IP rating of the panels, which is crucial for ensuring safety and protection against environmental factors.F-202603-063925

Timeline	Remediation Plan
Medium Term CAP-0074883	Corrective actions are required to seal all openings and replace missing panels to restore the integrity and safety of the electrical systems. The electrical system shall ensure compliance with Sections 614.2.1, 412.2.2, and 512.2 of BS 7671 18th Edition + A2 (2022).
Longer Term CAP-0074884	Conduct regular maintenance and maintain comprehensive records for all electrical panels to ensure there are no openings and that the IP ratings of the panels remain uncompromised.



Figure 2.20 - Unsealed opening observed in main LT panel at ground floor of building 1



Figure 2.21 - Unsealed opening observed in main panel at ground floor of building 2

7.8 Adequate accessibility

This relates to the entire facility.

During the visit, the electrical panels and distribution boards were examined for adequate accessibility.

At numerous locations, it was found that the electrical panels do not possess the required space for inspection or easy access to the panels and their components. This issue was observed in the electric room near building 2.

In several instances, the placement of electrical panels adjacent to machines that continuously reject heat has caused the surrounding temperature to exceed ambient levels by several degrees. This temperature rise further increases the temperature of the panels and boards nearby.

Limited accessibility to distribution panels and machine panels hampers effective maintenance and inspection procedures. This can potentially cause delays in addressing emergencies and troubleshooting electrical problems. These accessibility challenges could compromise the operational reliability and safety of the premises, as prompt maintenance and emergency responses are hindered. F-202603-063915

Timeline	Remediation Plan
Medium Term CAP-0074795	Electrical equipment shall be arranged to provide sufficient space for the initial installation and later replacement of individual items of electrical equipment. Sufficient allowance shall also be made for sufficient space for the initial installation and later replacement of individual items of electrical equipment in accordance with Section 132.12 of BS7671 18th Edition + A2 (2022).



Figure 2.22 - Inadequate accessibility for distribution board observed in electric room near building 2

7.9 Lint & dust inside panel board

This relates to the entire facility.

During the inspection, the cleanliness of electrical panels, distribution boards, and electrical containment was assessed.

The inspection revealed a significant accumulation of lint and dust in most of the distribution boards, panels, and trunking systems. This issue was observed at several locations, including cable trunks on the first floor of building 1 and main distribution panel on the ground floor in main gate office 2 near building 2.

The presence of lint and dust inside distribution boards poses several hazards. Accumulated lint and dust can act as fuel for fires if exposed to electrical currents or sparks, significantly increasing the risk of electrical fires. The cooling capacity of electrical components can also be impaired by the presence of dust and lint, leading to overheating.

Additionally, the accumulation of dust and lint can obstruct proper operation and maintenance, thereby impairing the functionality of the electrical components.F-202603-063937

Timeline	Remediation Plan
Medium Term CAP-0074942	All electrical panels and trunking runs shall be inspected and cleaned of any dust or lint in accordance with Section 522.4.2 of BS7671 18th Edition + A2 (2022)
Longer Term CAP-0074943	A regular maintenance procedure shall be established to ensure routine inspection and cleaning of all electrical panels and trunking runs. This will prevent the accumulation of lint and dust, thereby maintaining the safety and efficiency of the electrical systems.



Figure 2.23 - Lint and fluff observed in cable trunks at first floor of building 1



Figure 2.24 - Lint and fluff observed in main distribution board at ground floor of building 2

7.10 Lightning Protection System (LPS)

During the inspection, the lightning protection strategy of the factory was assessed.

The following observations were identified with the current lightning protection system:

i. A lightning protection system was provided, however, there was no study available to confirm its adequacy.
ii. No test results were provided for the lightning protection system, making it difficult to verify its effectiveness and compliance with relevant standards.

Lightning strikes can cause significant damage to buildings, primarily through the ignition of fires. When lightning strikes a structure, it can cause an electrical surge that ignites flammable materials. Without a proper lightning protection system (LPS), the energy from a lightning strike can travel through the building's electrical and plumbing systems, creating sparks and starting fires. F-202603-063927

Timeline	Remediation Plan
Medium Term CAP-0074897	Engage a qualified lightning protection specialist to perform a comprehensive risk assessment in accordance with IEC-62305. This assessment will determine the necessity of a lightning protection system (LPS) based on factors such as building height, location, occupancy, and the presence of sensitive electronic equipment.
Longer Term CAP-0074898	If the risk assessment concludes that an LPS is necessary, proceed with the design and installation of an appropriate system in compliance with relevant standards such as BS EN 62305 (Protection against Lightning).



Figure 2.25 - Lightning arrestor installed at roof of building 1

8. Fire Alarm & Detection System (FADS)

8.1 Non-functional or incomplete

This section refers to the entire facility.

During the inspection, the Fire Alarm and Detection System (FADS) for the facility was evaluated.

It was observed that before testing of the FADS, the fire alarm control panel was at fault condition. Several areas of the factory lacked sufficient detection coverage, Although an addressable fire alarm system was installed however, the listing documentation for the system was missing. Additionally, during testing several areas lacked sufficient audibilityand visual alarm coverage including first and second floor of building 1 and ground floor of building 2.

A non-functional/incomplete FADS significantly increases the risk of worker injury or fatality, substantial property damage, operational disruptions, legal liabilities, reputational damage, and environmental harm.F-202603-063940

Timeline	Remediation Plan
Immediate CAP-0074954	Ensure the functionality of the existing mechanism to notify occupants timely for safe evacuation.
Medium Term CAP-0074955	1. Submit design documentation for the new FADS system to Pakistan Accord for review before purchasing any new equipment. Design documentation to include drawings, technical data sheets, and product certifications of all listed equipment to show full compliance with the Fire Alarm and Detection System (FADS) with NFPA 72.
Longer Term CAP-0074956	2. Submit documentation to the Pakistan Accord showing that an L/C has been opened for the import of any components required for the FADS design submitted earlier.
Longer Term CAP-0074957	3. Submit documentation to the Pakistan Accord demonstrating that all materials, both imported and locally procured, have been purchased and are available on-site for installation.
Longer Term CAP-0074958	4. Once installation of the FADS system is complete, the factory is to submit full "as-built" documentation of the system to the Pakistan Accord for review.

Longer Term CAP-0074959	5. Factory to advise Pakistan Accord when FADS installation is fully completed and ready for review. Pakistan Accord will then arrange a verification inspection to ensure that the installation fully complies with the previously reviewed design documentation.
Longer Term CAP-0074960	6. Provide full testing and commissioning (T&C) certification from the FADS system installer and make provision for attendance of the system installer, factory technical personnel, and Pakistan Accord technical team to witness a final T&C demonstration verification on site. On successful completion of this T&C verification inspection, remediation of the FADS system will be complete.



Figure 2.26 - Incorrect installation of detector in LT room of building 1



Figure 2.27 - No detector coverage in offices at ground floor of building 1



Figure 2.28 - Fire alarm control panel installed near main gate

9. Emergency Lighting

9.1 Provided but insufficient

The section refers to the entire facility.

During the inspection the emergency lighting arrangement throughout the facility was assessed.

The following observations were made:

i. Emergeny light and exit signage layout was missing for the factory.
ii. Several areas lack sufficient emergency lighting and exit signage coverage.
iii. External emergency lighting was not provided, preventing people from reaching a place of safety outside the facility during nighttime evacuations.

Adequate and functional emergency lighting throughout the facility is crucial for providing necessary illumination during power failures or other emergencies, ensuring the safe evacuation of workers.F-202603-063923

Timeline	Remediation Plan
Medium Term CAP-0074874	i. Conduct a comprehensive survey to identify areas lacking adequate emergency lighting specified in the Building Code of Pakistan Fire Safety Provisions 2016, ensuring sufficient illumination for safe evacuation.
Medium Term CAP-0074875	ii. Once the means of egress layouts have been finalised, develop a detailed emergency lighting and exit signage layout as per Building Code of Pakistan Fire Safety Provisions 2016 and submit it to Pakistan Accord for review.
Medium Term CAP-0074876	iii. Install emergency luminaires to enable safe evacuation during hours of darkness all the way to a safe place outside the building(s).

Longer Term CAP-0074877	Establish a regular maintenance and testing schedule to check the functionality of emergency lighting systems routinely. This should include periodic tests, inspections, and prompt maintenance actions to address any issues. Maintain detailed records of all inspections, tests, repairs, and maintenance activities. Train facility maintenance staff on the procedures for inspecting and maintaining emergency lighting systems to ensure ongoing reliability and compliance with safety standards.



Figure 2.29 - No emergecny light observed on building 1 stair case

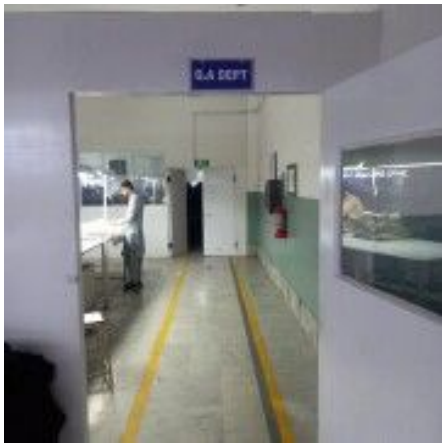


Figure 2.30 - No exit signage observed at ground floor of building 1





Figure 2.31 - No emergency light observed on second floor of building 1



Figure 2.33 - No emergecny light observed at ground floor of building 2

Figure 2.32 - Lack of external emergency lighting observed outside building 2

9.2 Independent power source

The section refers to the entire facility.

During the inspection, it was observed that the emergency lighting within the facility was not connected in a manner that would ensure automatic activation upon the loss of power to the general lighting in various spaces.

Proper circuitry is crucial to ensure that emergency lighting is automatically activated when general lighting fails. This automatic activation is essential for maintaining sufficient illumination, allowing for the safe evacuation of occupants and preventing panic during power outages. Further, the emergency lights and exit signs be reconfigured to be connected on an independent single circuit, which must not include any other load except for the emergency lighting system according to the Building Code of Pakistan Fire Safety Provisions 2016, emergency lighting systems must be designed to provide immediate illumination in the event of power loss to ensure a clear and safe path for evacuation.

Ensuring that the emergency lighting is integrated with the facility's power system to activate automatically during power failures is critical for life safety. This integration helps prevent hazardous conditions that can arise in the dark, such as trips, falls, and confusion, thereby facilitating orderly and efficient evacuation during emergencies.F-202603-063928

Timeline	Remediation Plan
Medium Term CAP-0074902	Reconfigure the emergency lighting circuitry to ensure that emergency lights activate immediately upon failure of general lighting power, and provide an independent circuit for the emergency lighting system, as required by the Building Code of Pakistan Fire Safety Provisions 2016.
Longer Term CAP-0074903	Establish a regular maintenance and testing schedule to routinely check the functionality of emergency lighting systems. This should include periodic tests, inspections, and prompt maintenance actions to address any issues. Maintain detailed records of all inspections, tests, repairs, and maintenance activities. Train facility maintenance staff on the procedures for inspecting and maintaining emergency lighting systems to ensure ongoing reliability and compliance with safety standards.

10. Generator, Transformer & Sub-Station Room

10.1 Battery

During the inspection of the battery system, the battery cells, connections, and enclosures were thoroughly examined.

The following observations were noted with the battery system:

i. Several battery terminals were exposed and not properly insulated, increasing the risk of electrical shock or short circuits. This issue was observed in IT office at first floor of building 1.
ii. The placement of some batteries did not comply with safety regulations, potentially hindering safe access and proper ventilation. This issue was observed at second floor of building 1.

Proper monthly and annual maintenance of the battery system is crucial for fire safety. Spilled fluid can cause corrosion and fires, while bare terminals increase the risk of electrical shocks and short circuits, potentially igniting fires or explosions. Non-compliant battery placement can obstruct ventilation, leading to hazardous gas buildup and fire risks. Addressing these issues is essential to prevent fires and ensure battery system safety.F-202603-063921

Timeline	Remediation Plan
Medium Term CAP-0074810	i. Insulate exposed battery terminals using appropriate insulating materials to prevent electrical shock and short circuits. Conduct a thorough inspection of all connections to ensure that there are no immediate risks of exposure.
Medium Term CAP-0074811	ii. Reposition batteries that are improperly placed to ensure they comply with safety regulations, allowing for safe access and adequate ventilation. Mark and clear pathways around battery installations to ensure easy and safe access for maintenance and emergencies in accordance with the applicable standards.
Longer Term CAP-0074812	i. Establish a routine inspection and maintenance protocol to regularly check and maintain proper insulation of all battery terminals.
Longer Term CAP-0074813	ii. Conduct regular audits of battery placements to ensure ongoing compliance with safety standards and regulations.



Figure 2.34 - Inadequate placement of battery observed at second floor of building 1



Figure 2.35 - Missing terminal caps observed in IT office at first floor of building 1

11. Cabling & Wiring

11.1 Cable support and protection

This section refers to the entire facility.

During the inspection of the entire facility, a visual survey of the cable containment system was conducted.

It was observed that proper supports were not provided for cables; they were laid directly on the ground and hung along the walls. Inadequate cable support results in sagging or stress on cables, which can lead to damage or failure. This issue was observed at several locations, including building 1 and 2.F-202603-063933

Timeline	Remediation Plan
Medium Term CAP-0074919	Secure cables with appropriate supports and insulate any exposed connections to prevent sagging, stress, and potential hazards. (Reference: BS 7671 18th Edition + A2 (2022) Regulation 522.8.5 for mechanical support and 526.5 for proper terminations)
Longer Term CAP-0074920	Implement a comprehensive cable management system with regular inspections to ensure cables remain properly supported and insulated over time.



Figure 2.36 - No cable support provided for machine in basement of building 1



Figure 2.37 - No cable support provided outside building 2.

11.2 Cable trench and channel cleanliness

This related to the whole facility.

During the inspection of the facility, it was observed that the cleanliness of the cable trunking system had not been maintained. Numerous trunking systems were found to be filled with a significant amount of fluff and dust, which poses a serious fire risk. This issue was observed in main LT room of building 1.

Accumulated dust and fluff can ignite when exposed to sparks or high temperatures, potentially leading to a fire hazard. Maintaining a clean cable trunking system is essential to minimise fire risks associated with accumulated debris.F-202603-063936

Timeline	Remediation Plan
Medium Term CAP-0074939	Clean all cable trunking systems to remove accumulated dust and fluff, ensuring that any potential fire hazards are mitigated.
Longer Term CAP-0074940	Implement a regular maintenance schedule that includes routine inspections and cleaning of the cable trunking systems to prevent future accumulation of dust and fluff, thereby maintaining a safe environment and complying with safety standards.



Figure 2.38 - Cable trench not maintained in LT room of building 1

11.3 Splicing of cables

This relates to the whole facility.

During the inspection the cable installation was visually surveyed throughout the facility.

The following observations were noted:

i. Cables terminations within panels and switchgears were made without cable lugs, resulting in breaking strands and loose connections. This presents a significant fire risk due to the potential for electrical arcing and overheating, which can ignite nearby materials and cause a fire. Furthermore, loose connections can cause voltage drops and equipment malfunctions, posing a life safety hazard. This issue was observed in both building 1 & 2.
ii. PVC tape joints were found in several locations - including within distribution boards - where cables were either damaged or two cables were being joined together. This method of jointing is unreliable and can deteriorate over time, increasing the risk of electrical shorts and fires. The adhesive on PVC tape can degrade, leading to exposed conductors that can spark and ignite surrounding materials, presenting both fire and life safety risks. This issue was observed in both building 1 & 2.
iii. Machine power wires were inserted directly into power receptacles without a power plug. This practice is highly dangerous as it can lead to loose connections, electrical shocks, and short circuits. Direct insertion bypasses proper safety mechanisms, significantly increasing the risk of fire and electrical hazards, thereby endangering life safety. This issue was observed in both building 1 & 2.

For any future electrical work, the termination of stranded cables must be done with cable lugs and PVC tape joints shall not be utilised. Proper termination ensures secure and reliable connections, reducing the risk of electrical failures and enhancing overall safety. F-202603-063916

Timeline	Remediation Plan
Medium Term CAP-0074796	i. install cable lugs on all improperly terminated cables within panels and switchgears to secure connections and prevent breaking strands and loose connections in accordance with Regulation 526.1 of BS7671 18th Edition + A2 (2022)
Medium Term CAP-0074797	ii. Replace all PVC tape joints with proper terminal blocks or connectors to ensure secure and stable connections in accordance with Regulation 526.1 of BS7671 18th Edition + A2 (2022). Replace all damaged cabling with new wiring.

Medium Term CAP-0074798	iii. Replace the directly inserted power wires with proper power plugs to ensure safe and secure connections.
Longer Term CAP-0074799	i. Implement a standard operating procedure (SOP) requiring the use of cable lugs for all future cable terminations. Regularly train and audit personnel to ensure compliance with this procedure, thus maintaining safe and reliable electrical connections.
Longer Term CAP-0074800	ii. Establish a policy prohibiting the use of PVC tape for electrical jointing. Regularly inspect and maintain electrical installations to ensure compliance, and provide continuous training for staff on proper jointing techniques.
Longer Term CAP-0074801	iii. Develop and enforce a facility-wide electrical safety protocol that mandates the use of power plugs for all equipment. Conduct regular safety audits and provide training sessions to staff to reinforce the importance of using proper power plugs and adherence to electrical safety standards.



Figure 2.39 - Taped joints observed in main distribution board at ground floor stitching department of building 1



Figure 2.40 - Cables directly inserted in switch board in mechnical workshop at first floor of building 1



Figure 2.41 - No lugs observed in main distribution board at first floor of building 1

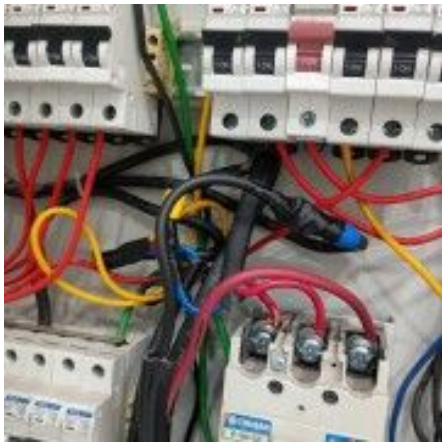


Figure 2.42 - Taped joints observed in main distribution board of office area at ground floor of building 2



Figure 2.43 - No lugs observed in main electric panel at ground floor for building 2



Figure 2.44 - Grinder cables directly inserted in switch board in embroidery department at ground floor of building 2

11.4 Fixtures

This relates to the whole facility.

During the inspection, the electrical fixtures throughout the facility were visually surveyed.

It was observed that power receptacles were mounted on combustible wooden ply. Installing receptacles on combustible materials like wooden ply increases the risk of fire if a short circuit or overheating occurs. Combustible materials can easily ignite, leading to potential fire hazards and endangering life safety. This issue was observed at ground floor and first floor of building 1 and ground floor of building 2. F-202603-063926

Timeline	Remediation Plan
Medium Term CAP-0074895	Replace combustible wooden ply backings with non-combustible materials to reduce fire risk.
Longer Term CAP-0074896	Establish a facility-wide standard to use only non-combustible materials for mounting electrical components, and conduct regular audits for compliance.



Figure 2.45 - Wooden back supported fixture observed in main LT room at ground floor of building 1



Figure 2.46 - Wooden back supported fixture observed in IT office at first floor of building 1



Figure 2.47 - Wooden ply back supported fixture observed in embroidery department at ground floor of building 2

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.