Issue	**1**
Factory ID	**26328**
Date of Issue	**22-Apr-2026**

Fashion & Styles

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Chak 117/JB, (Dhanola) Millat Industrial Estate Road
37600 Faisalabad
Punjab Pakistan

Latitude: [31.502287], longitude: [73.10175]
Date of inspection: 12-Mar-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Shehroz Javed**
Reviewed by	**Ghulam Azam**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 12-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 10
   - 3.1 Building Means of Egress Details 11
   - 3.2 Building Use 13
4. Documentation 15
5. Fire Safety Measures 16
6. Remediation Support 17
   - 6.1 Engineering Support 17
7. Means of Escape 18
   - 7.1 Escape doors 18
   - 7.2 Exit access 20
   - 7.3 Travel distance 23
   - 7.4 Number of exits 24
   - 7.5 Protection of stairs 25
   - 7.6 Escape stair condition 27
   - 7.7 Exit discharge 28
   - 7.8 Exit signage 30
8. Fire Rated Construction 32
   - 8.1 Separation of high-risk areas 32
   - 8.2 Separation of high-risk areas 34
   - 8.3 Separation of shafts 36

8.4 Separation of occupancies..... 38
8.5 Storage..... 40
9. Fire Suppression..... 42
9.1 Fire extinguishers..... 42
10. Hazardous Materials..... 44
10.1 Chemicals handling..... 44
10.2 Chemicals storage..... 46
10.3 Gas storage..... 48
11. Fire Safety Management..... 50
11.1 Fire drills..... 50
11.2 Records of system testing..... 51
11.3 Records of systems maintenance..... 52
11.4 Emergency Action Plan..... 53
12. Assessment Limitations and Assumptions..... 55

1. Executive Summary

On 12-Mar-2026, Shehroz Javed and Muhammad Naseer on behalf of the Pakistan Accord carried out an initial fire inspection for Fashion & Styles, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Muhammad Nadeem Ashraf (HR), Mr. Muhammad Waqas (Civil representative), and other staff members of Fashion & Styles. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Accord were also present and the team was led by Mr. Muhammad Naseer of Pakistan Accord.
The factory comprises of two main buildings and four ancillary structures owned by Fashion & Styles, details of which are provided below:
Main Buildings:

- **Building 01** is a three storey (Basement+Ground+2) building above grade plane. The structural system of the building consists of an RC moment-resisting frame system with load bearing brick masonry wall at periphery and RC retaining wall at basement level. The building has covered area of 1911 sq.m. and with the height of 8.05 m measured from the fire department vehicle access to the topmost occupiable floor. Building has 4 staircases out of which 2 staircases discharge internally. The building is used for solar panels (roof), colour room, exposing room, printing office, printing hall and printing machine hall (second floor) offices, packing, stitching, pressing, finishing, sample room, storage and washing area (first floor), storage, packing, Q.A department, stitching hall, offices and meeting room (ground floor), and storage, (basement). The construction year of the building is 2023.
- **Building 02** is a single storey (Ground only) building. The structural system of the building consists of an RC moment-resisting frame system supporting precast double tee slab. The building has covered area of 987 sq.m. Building has 1 staircase which discharges externally. The building is used for solar panels (roof), embroidery hall, offices, warehouse (ground floor). The construction year of the building is 2023.

Ancillary Structures:
There are four ancillary structures details of which are given below:
o **Gate office 1** is a two storey (Ground+1) structure having load bearing brick masonry wall supporting RC slab. The structure is used for offices (first and ground floor). The construction year of building is 2023.
o **Gate office 2** is a single storey (Ground only) structure having load bearing brick masonry wall RC slab. The structure is used for gate office purpose (ground floor). The construction year of structure is unknown.
o **Prayer area** is a single storey (Ground only) structure having fibre sheet supported by steel sections. The structure is used for prayer area (ground floor). The construction year of building is unknown.
o **Mess and Canteen area** is a single storey (Ground only) structure having load bearing brick masonry walls supporting brick slab with irons resting on I girders. The structure is used for mess and canteen purpose (ground floor). The construction year of building is unknown.

The factory operates in a general single shift for all the activities. Approximately 240 workers operate in the factory with 20 workers being females.

We were presented with civil defence certificate, incomplete architectural and sectional layouts, evacuation maps, inspection record of fire extinguisher, staff training and fire drill record.

A summary of the main concerns identified during the inspection includes (non-exhaustive):

- Lockable mechanism observed in escape route of all over the facility.
- There is no fire separation between stairs, cargo lift and the rest of the building.
- Stair S1 & S4 discharge inside the building.
- Escape routes are not adequately fire separated from adjoining high-risk areas.
- Storage areas are not fire separated from rest of the building.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes.)

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents



Figure 1.1. Satellite View



Figure 1.2. Site layout

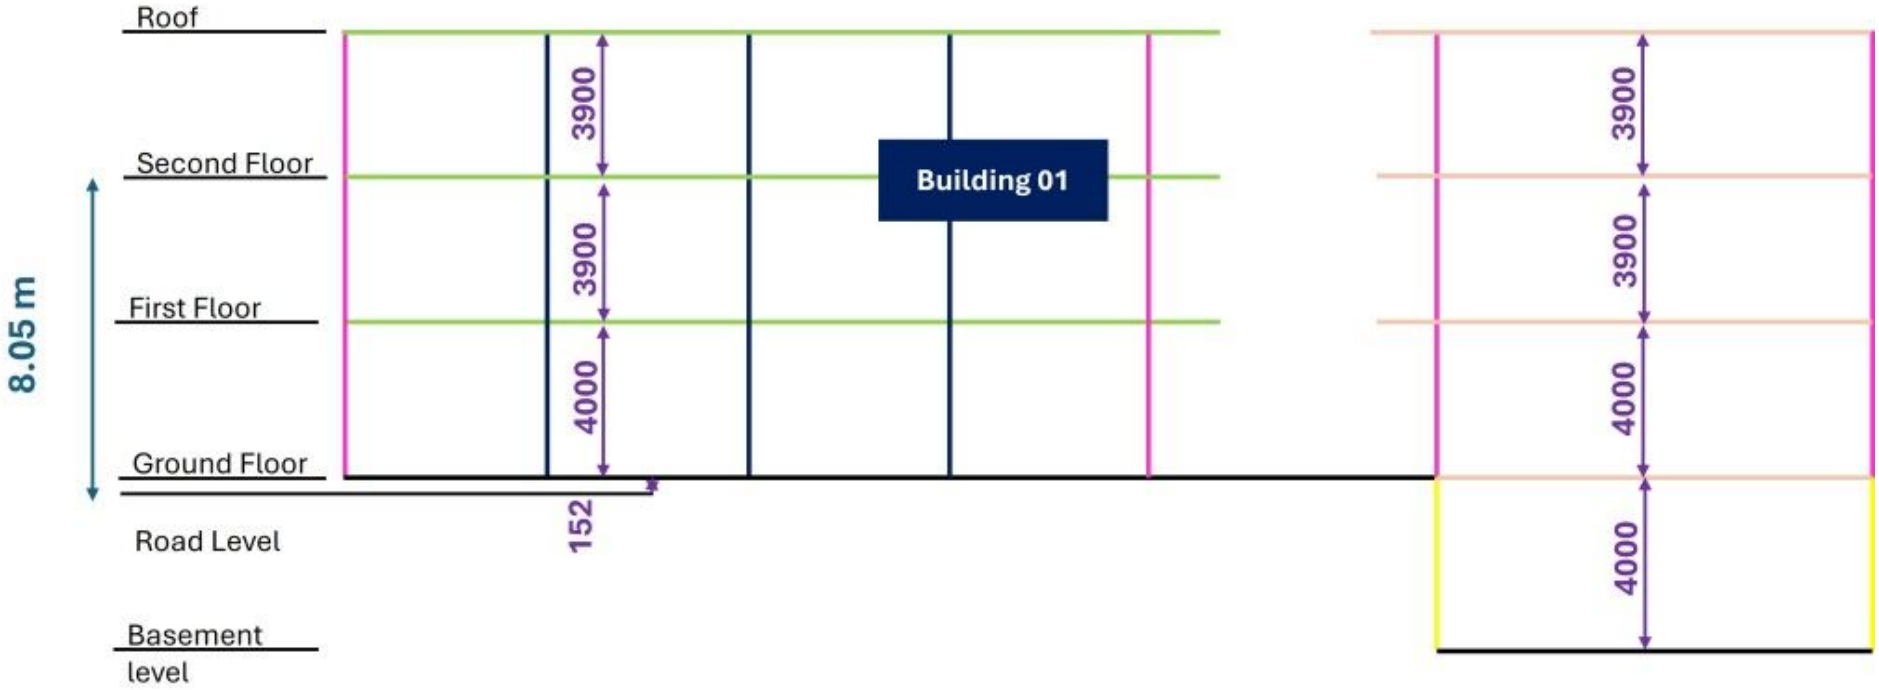


Figure 1.3. Section Layout of Building 1.

3. Building Description

The factory comprises of two main buildings and four ancillary structures owned by Fashion & Styles, details of which are provided below:

Main Buildings:

· **Building 01** is a three storey (Basement+Ground+2) building above grade plane. The structural system of the building consists of an RC moment-resisting frame system with load bearing brick masonry wall at periphery and RC retaining wall at basement level. The building has covered area of 1911 sq.m. and with the height of 8.05 m measured from the fire department vehicle access to the topmost occupiable floor. Building has 4 staircases out of which 2 staircases discharge internally. The building is used for solar panels (roof), colour room, exposing room, printing office, printing hall and printing machine hall (second floor) offices, packing, stitching, pressing, finishing, sample room, storage and washing area (first floor), storage, packing, Q.A department, stitching hall, offices and meeting room (ground floor), and storage, (basement). The construction year of the building is 2023.

· **Building 02** is a single storey (Ground only) building. The structural system of the building consists of an RC moment-resisting frame system supporting precast double tee slab. The building has covered area of 987 sq.m. Building has 1 staircase which discharges externally. The building is used for solar panels (roof), embroidery hall, offices, warehouse (ground floor). The construction year of the building is 2023.

Ancillary Structures:

There are four ancillary structures details of which are given below:

o **Gate office 1** is a two storey (Ground+1) structure having load bearing brick masonry wall supporting RC slab. The structure is used for offices (first and ground floor). The construction year of building is 2023.

o **Gate office 2** is a single storey (Ground only) structure having load bearing brick masonry wall RC slab. The structure is used for gate office purpose (ground floor). The construction year of structure is unknown.

o **Prayer area** is a single storey (Ground only) structure having fibre sheet supported by steel sections. The structure is used for prayer area (ground floor). The construction year of building is unknown.

o **Mess and Canteen area** is a single storey (Ground only) structure having load bearing brick masonry walls supporting brick slab with irons resting on I girders. The structure is used for mess and canteen purpose (ground floor). The construction year of building is unknown.

3.1 Building Means of Egress Details

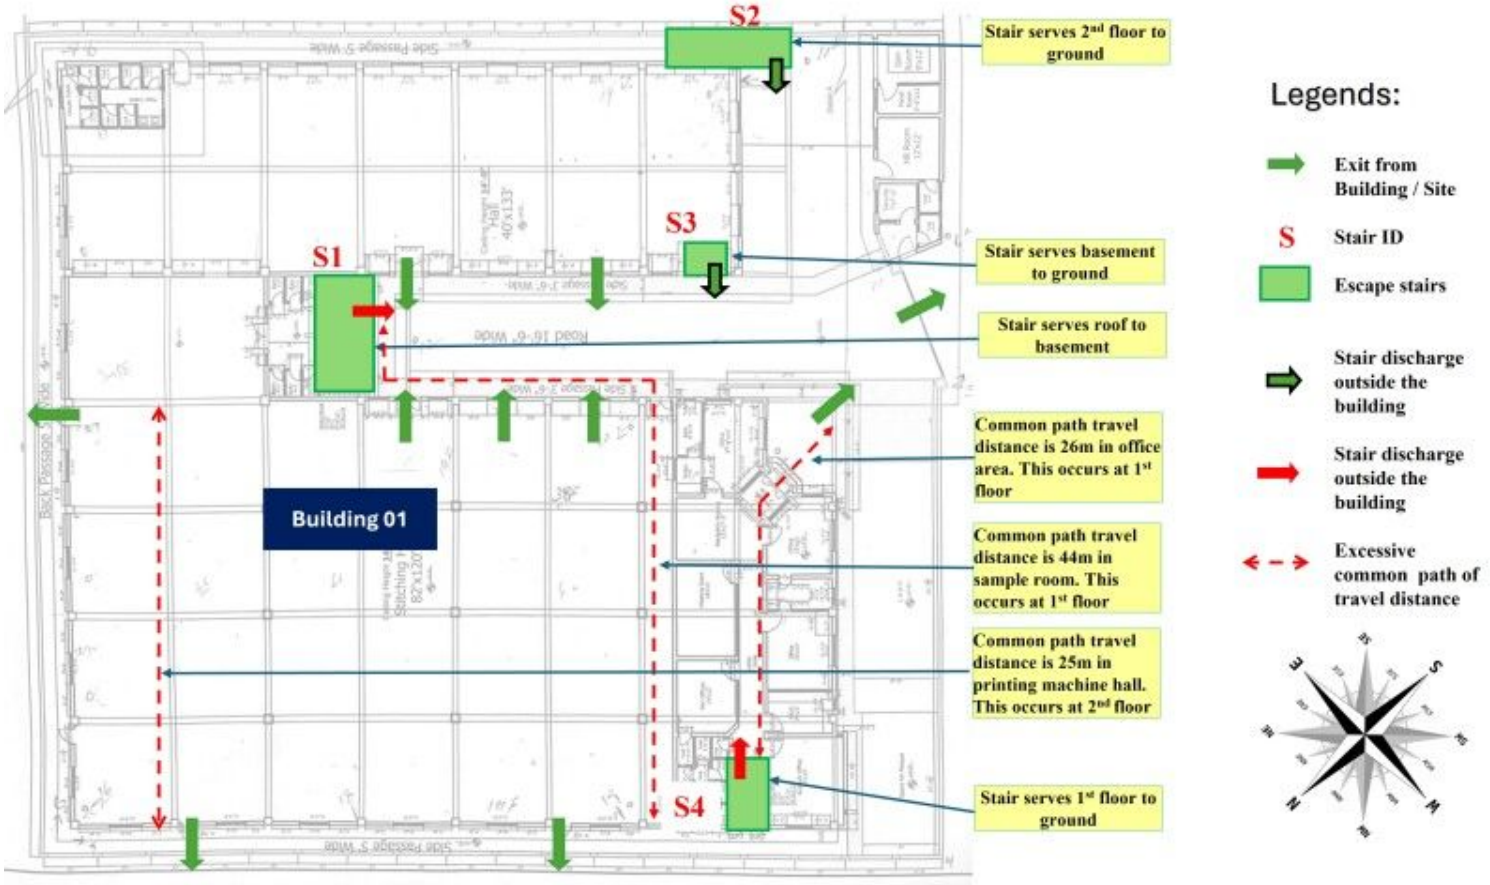


Figure 1.4. Egress Layout of Building 1.

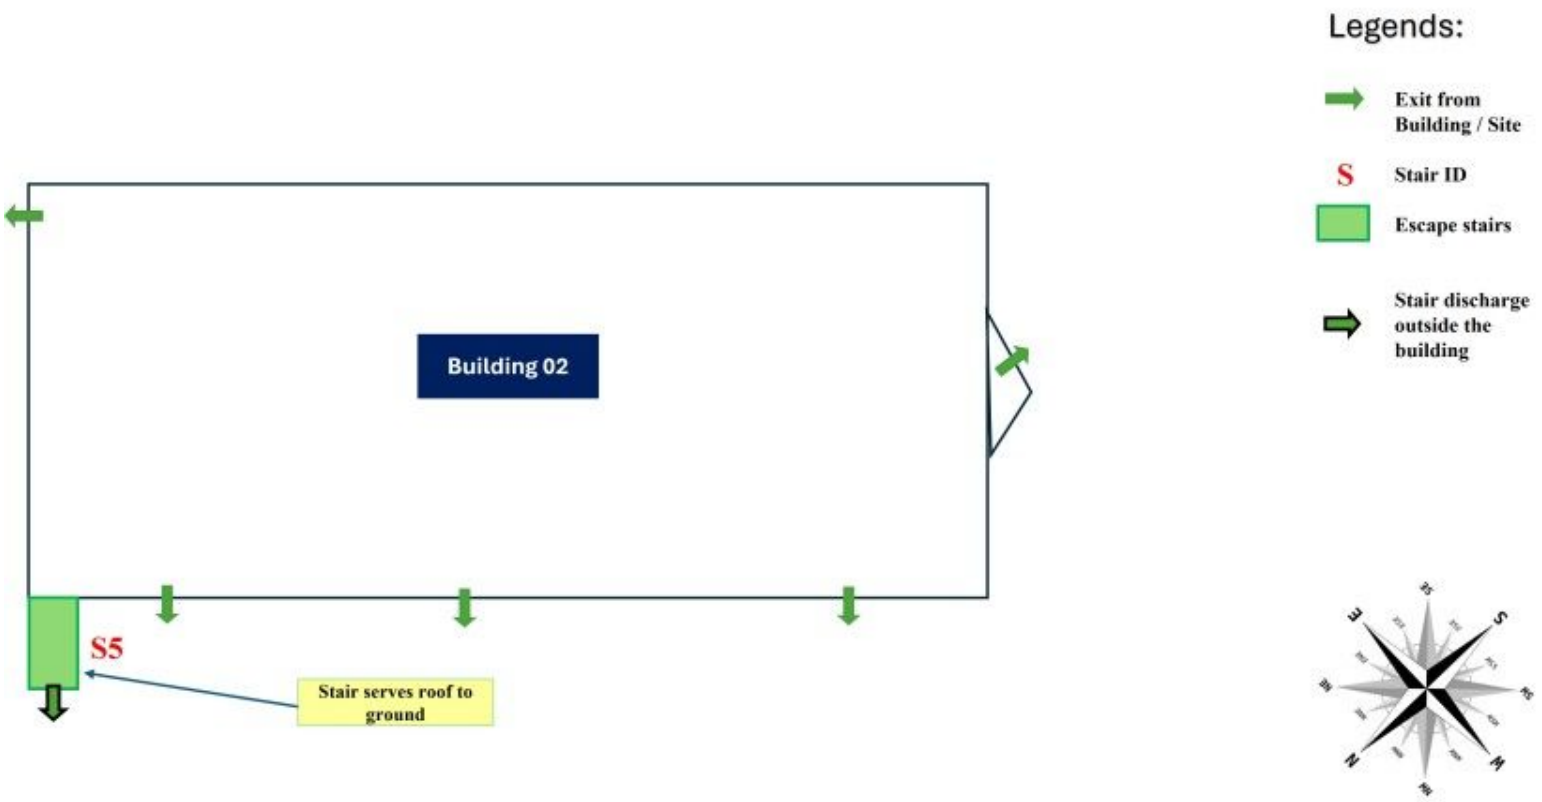


Figure 1.5. Egress Layout of Building 2.

3.2 Building Use

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Total Travel Distance	Common Path	Dead End
Building 1						
Roof	Solar Panels	-	1	-	-	-
2nd Floor	Colour room, exposing room, printing office, printing hall and printing machine hall	100	2	-	25m	-
1st Floor	Packing, stitching, pressing, finishing, sample room, storage and washing area	150	2	-	44m	-
	Offices	55	1	-	26m	-
Ground Floor	Storage, packing, Q.A department, stitching hall, offices and meeting room	150	9	-	-	-
Basement	Storage	15	2	-	-	-
Building 2						
Roof	Unoccupied	-	1	-	-	-

Ground Floor	Embroidery hall, offices, warehouse	70	5	-	-	-

The number of exits is insufficient at offices(1st floor) Building 1. Excessive common path of 25m, 26m and 44m were found at printing machine hall (2nd floor), office area and sample room (1st floor) of Building 1.

4. Documentation

This table shows the details about the documentation provided by the factory.

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		Yes	11-03-2026	-
2.	Architecture Layout		Yes	Not mentioned	Incomplete
3.	Sectional Layout		Yes	Not mentioned	Incomplete
4.	Evacuation Maps		Yes	Not mentioned	Missing on entrance into stairs at some floors
5.	Emergency Action Plan		No	-	-
6.	Inspection	Fire extinguishers	Yes	05-03-2026, 02-02-2026	Not as per Pakistan Accord Building Standards
		Exit signage	No	-	-
7.	Testing	Fire extinguishers	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Fire extinguishers	No	-	-
		Exit signage	No	-	-
9.	Evidence of Fire Drills		Yes	13-01-2026	Date, time & location missing in fire drill pictures, no attendance sheet attached.
10.	Staff Training		Yes	25-11-2025	Firefighting
				10-03-2026	First aid

5. Fire Safety Measures

During our fire site inspection of Fashion & Styles, a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Fashion & Styles. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-064615

Timeline	Remediation Plan
Immediate CAP-0076324	Factories should begin remediation of CAP items—such as installing extinguishers, signage, and clearing escape routes—using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape
- There should be no fall hazard while passing through escape door.

This is not always achieved, examples include (list not exhaustive):
- Fall risk as no stairs at exit from second floor towards Terrace at Building 1.
- Escape doors are lockable in whole facility such as at entrance into stair S1 from 2nd & 1st floor and exits from Building 1 & Building 2.
- Doors into stair S1 from 2nd & 1st floor at Building 1 swing against the direction of escape

Recommended remedial actions are provided below.F-202603-064397

Timeline	Remediation Plan
Immediate CAP-0076306	Remove all locking devices from doors on all egress routes that could prevent opening from inside. Install stair or permanently block exit /barricading from second floor towards Terrace.
Medium Term CAP-0076307	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5. Prepare drawings showing proposed mechanism to prevent fall hazard from exits.
Longer Term CAP-0076308	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits. Ensure no fall hazard from exits.



Figure 2.1 - Main exit of office area of Building 1 is lockable.



Figure 2.2 - Door into stair S1 from 1st floor at Building 1 swing against the direction of escape



Figure 2.3 - No stairs at exit from second floor towards Terrace at Building 1.

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.
- Headroom along escape route should be more than 2.05m.

This is not always achieved, examples include (list not exhaustive):
- Obstructions on escape route due to LPG cylinder which reduces clear width to 0.54m and 0.77m at printing hall (2nd floor) Building 1 and 0.3m clear width due to machinery obstruction at embroidery hall (ground floor) Building 2.
- Stair S1 & S4 discharges inside the Building 1 at a distance from building exit .
- Insufficient headroom along escape route (i.e. headroom height is less than 2.05m) such as 1.83m at exit from stitching towards north-east side of Building 1.

Recommended remedial actions are provided below.F-202603-064395

Timeline	Remediation Plan
Immediate CAP-0076291	Remove obstructions on escape routes and keep them clear for escape. Provide warning signs where headroom height is less than 2.05 m on escape routes.
Medium Term CAP-0076292	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks) Propose modifications to ensure 2.05m headroom height is achieved along the escape routes or propose alternative egress routes that comply. Submit the proposal to Pakistan Accord for review.

Longer Term CAP-0076293	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted. Implement measures to ensure adequate clear head height is achieved along all escape routes.



Figure 2.4 - 1.83m headroom height at exit from stitching towards north-east side of Building 1.



Figure 2.5 - Obstructions on escape route due to LPG cylinder which reduces clear width to 0.54m.



Figure 2.6 - Stair S4 discharge inside the Building 1.

7.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Standard. The standard provides limitations on:
- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.

This is not always achieved, examples include (list not exhaustive):
- Common path of travel distances exceed permitted limits such as 25m was found at printing machine hall (2nd floor) and 26m & 44m were found at office area and sample room at 1st floorof Building 1 respectively.

Recommended remedial actions are provided below.F-202603-064391

Timeline	Remediation Plan
Medium Term CAP-0076276	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Standard.
Longer Term CAP-0076277	Implement the plan previous reviewed by Pakistan Accord and ensure all travel distances to emergency exits meet the requirements of the Pakistan Accord Standard.

7.4 Number of exits

Per Pakistan Accord Standard, the exit provisions should meet the following:
- Minimum 2 exits from every occupied area with more than 50 occupants.

This is not always achieved, examples include (list not exhaustive):
- There are areas with over 50 occupants that are served by only 1 exit such as offices in (1st floor) Building 1.

Recommended remedial actions are provided below.F-202604-064930

Timeline	Remediation Plan
Medium Term CAP-0076855	Review each floor and area to ensure that the number of exits complies with Pakistan Accord Standard. Develop plans and drawings to provide additional exits where necessary. Submit the plan and drawings to Pakistan Accord for review and approval prior to commencing rectification works.
Longer Term CAP-0076856	Implement the above plan as agreed with Pakistan Accord. Number of exits from all floors and parts of the building should comply with Pakistan Accord Standard.

7.5 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- Stair discharge routes should be protected to the same level of safety as the stair.
- There should be no fire load and/or services passing through a stair.
- Stairs should not be discharged to a roof.

This is not always achieved, examples include (list not exhaustive):
- Missing fire rated enclosure and fire doors in stair S1, S2, S3 and S4.
- Fire load in stairs S1 &S3 (basement).

Recommended remedial actions are provided below.F-202603-064400

Timeline	Remediation Plan
Immediate CAP-0076321	Remove fire load and any other obstructions due to stored items from stairs.
Medium Term CAP-0076322	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.
Longer Term CAP-0076323	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.7 - Missing fire rated enclosure and fire doors in stair S1.



Figure 2.8 - Fire load under stair S3 (basement).

7.6 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):
- One side handrail is missing at S1, S2 & S4.
- Handrails are too low as 0.85m handrail height was found at S1.

Recommended remedial actions are provided below.F-202603-064398

Timeline	Remediation Plan
Medium Term CAP-0076310	Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height.



Figure 2.9 - One side handrail is missing at S1.

7.7 Exit discharge

Exit discharge routes outside the building should be sufficiently protected so that people can escape safely in the event of a fire anywhere in the building. This includes:
- Headroom along external escape route should be more than 2.05m.
- Escape discharge route should be free of obstruction and trip hazards.
- External escape routes should not lead via high-risk areas.

This is not always achieved, examples include (list not exhaustive):
- Exit discharge route from Building 2 towards Building 1 has headroom clearance issue as 1.87m headroom clearance was found.
- Obstructions on external escape route from north-east side of the building towards south-west side also reduces clear width.
- External escape routes are through high-risk areas such as passing near gas steamer at back side of Building 1 which also reduces its clear width.
- Unprotected openings from basement and ground floor of Building 1 towards exit discharge route at backside of the building.

Recommended remedial actions are provided below.F-202603-064401

Timeline	Remediation Plan
Immediate CAP-0076266	Remove obstructions on external escape routes and keep them clear for escape.
Medium Term CAP-0076267	Prepare drawings showing proposed fire separating construction to exit discharge routes. These shall be submitted to Accord for review and approval prior to commencing rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge routes - Details of proposed fire resisting walls and fire door assemblies required to protect discharge routes Propose modifications to ensure 2.05m headroom height is achieved along the escape routes or propose alternative egress routes that comply. Submit the proposal to Pakistan Accord for review.
Longer Term CAP-0076268	- Ensure external exit discharge routes are adequately fire separated from the rest of the building. - Ensure external escape routes do not pass close to unprotected high-risk areas -Implement measures to ensure adequate clear head height is achieved along all escape routes.



Figure 2.10 - Unprotected openings from basement and ground floor of Building 1 towards exit discharge route at north-east side of the building.



Figure 2.12 - 1.87m headroom clearance at exit of Building 2 towards back side of Building 1.



Figure 2.11 - Obstructions on external escape route from north-east side of the Building 1 towards south-west side.



Figure 2.13 - External escape routes are passing near gas steamer at north-east side of Building 1 which reduces clear width..

7.8 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at entry into stair S4 from 1st floor.
- Missing exit signs in production areas at printing hall (2nd floor) Building 1.
- Missing exit signs in office area (ground floor) at Building 1.
- Exit signs are not clear / misleading such as misleading emergency exit sign at cutting area (2nd floor) as it leads towards the closed door installed at balcony.
-Electrically powered exit signs are not a tested and listed system.

Recommended remedial actions are provided below.F-202603-064399

Timeline	Remediation Plan
Immediate CAP-0076316	Remove misleading directional escape signs.
Medium Term CAP-0076317	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0076318	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.14 - Misleading emergency exit sign at cutting area (2nd floor) as it leads towards the closed door installed at balcony



Figure 2.16 - Missing exit signage at stitching area (ground floor) Building 1.



Figure 2.15 - Missing exit signage in office area at (ground floor) Building 1.

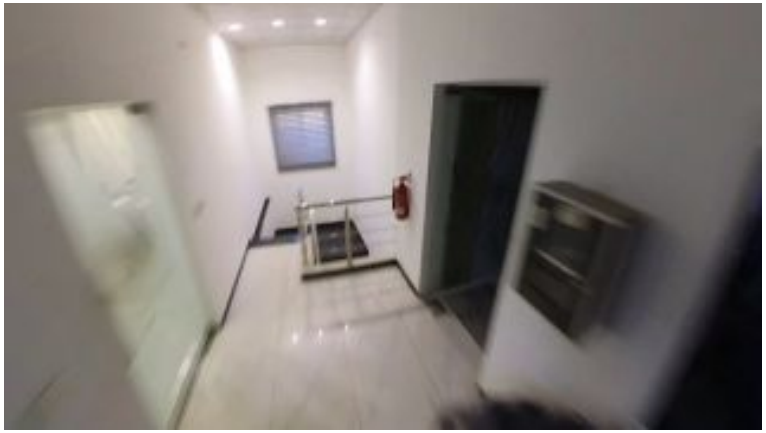


Figure 2.17 - Missing exit signs at entry into stair S4 from 1st floor of Building 1.

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, electric steam generators (pressure vessels) in occupied areas require blast protection consisting of:
- Minimum 3 m high reinforced concrete/ block masonry wall to separate it from the rest of the occupied portions of the building.
- Door to be solid steel door with a self-closer and a positive latch.
- Opening from the steam generator room to outside the building to release the blast out from the building.
The aim of these provisions is to protect the occupants nearby from the effects of a potential blast.

The following deficiencies have been observed on site, including (list not exhaustive):

- Steam generator door is not a sturdy door at stitching area (ground floor) and sample room (1st floor) at Building 1.
- Steam generator doors do not have a self-closer and/or a latch at stitching area (ground floor) and sample room (1st floor) at Building 1.
- Steam generator rooms are not enclosed in minimum 3m high sturdy construction to separate them from occupied areas at stitching area (ground floor) and sample room (1st floor) at Building 1.
- Steam generator rooms do not have a permanent opening outside the building at stitching area (ground floor) and sample room (1st floor) at Building 1.

Recommended remedial actions are provided below.F-202603-064387

Timeline	Remediation Plan
Medium Term CAP-0076300	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Separation to electric steam generator up to 3 m above the finished floor level. This should be achieved using reinforced concrete / masonry walls with solid steel doors. - The door must have a self-closer and a positive latch. - Blast vent should be provided to outside the building.
Longer Term CAP-0076301	Implement the above plan on site. All buildings to be compliant with Pakistan Accord Standard.



Figure 2.18 - Electric steam generator at sample room (1st floor) at Building 1.

8.2 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Gas steam generator is not fire separated from escape route (north-east side) and from Building 1.

Recommended remedial actions are provided below.F-202603-064390

Timeline	Remediation Plan
Medium Term CAP-0076274	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0076275	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.19 - Gas steam generator is not fire separated from escape route and Building 1.

8.3 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):

- Lift shaft is not separated with fire rated construction in Building 1 (on all floors).

Recommended remedial actions are provided below.F-202603-064393

Timeline	Remediation Plan
Medium Term CAP-0076285	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0076286	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.20 - Lift shaft is not separated with fire rated construction in Building 1 (on all floors).

8.4 Separation of occupancies

Pakistan Accord Standard requires Buildings fire separation from one another to avoid fire proximity risk.
The following deficiencies have been observed on site, including (list not exhaustive):
- Building 1 is not fire separated with fire rated construction from Building 2.

Recommended remedial actions are provided below.F-202604-064937

Timeline	Remediation Plan
Medium Term CAP-0076868	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Proposed fire separation details (including fire rating of walls and doors).
Longer Term CAP-0076869	Provide fire rated separation between Buildings as per proposal reviewed by Pakistan Accord.



Figure 2.21 - Building 1 & Building 2 are not fire separated from each other.

8.5 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from packing area (ground & 1st floor) and from cutting (basement) at Building 1.

Recommended remedial actions are provided below.F-202603-064388

Timeline	Remediation Plan
Medium Term CAP-0076302	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0076303	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard.



Figure 2.22 - Storage is not fire separated from packing area (ground floor) at Building 1.

9. Fire Suppression

9.1 Fire extinguishers

Extinguisher coverage and type of extinguishers used should comply with NFPA 10.

The following deficiencies have been observed on site, including (list not exhaustive):
- Poor condition of fire extinguishers such as expired fire extinguisher found at 1st floor Gate Office 1 and missing label of fire extinguisher near gents washroom area at Building 1.

Recommended remedial actions are provided below.F-202604-064660

Timeline	Remediation Plan
Medium Term CAP-0076481	Ensure that all building areas are protected using fire extinguishers. The coverage and type of extinguishers used should follow NFPA 10.
Longer Term CAP-0076482	Monitor fire extinguishers for coverage and extinguisher type to comply with NFPA 10.



Figure 2.23 - Expired fire extinguisher was found at 1st floor of Gate Office 1.



Figure 2.24 - Missing label of type of extinguisher was missing at fire extinguisher installed near gents washroom area at Building 1.

10. Hazardous Materials

10.1 Chemicals handling

Chemical handling procedures should follow the best international practice.

The following deficiencies have been observed on site, including (list not exhaustive):
- Unsafe handling procedures in printing hall (2nd floor) Building 1.

Recommended remedial actions are provided below.F-202604-064931

Timeline	Remediation Plan
Medium Term CAP-0076852	Develop a chemical handling strategy for the building. Identify dangerous chemicals, how they will be used and handled, the standards that will be followed, and the people responsible for the implementation of the strategy. Submit to Accord for review.
Longer Term CAP-0076853	Implement the chemical handling strategy on site as agreed with Accord.



Figure 2.25 - Unsafe chemical handling at printing hall (2nd floor) Building 1.

10.2 Chemicals storage

This relates to storage, handling, and use of flammable chemicals and combustible liquids and solids.
Chemical storage areas should be fire separated from the rest of the building. Adequate ventilation should be provided.

The following deficiencies have been observed on site, including (list not exhaustive):
- Flammable materials are not stored in a fire separated room e.g. ink store at printing hall (2nd floor) Building 1.

Recommended remedial actions are provided below.F-202604-064639

Timeline	Remediation Plan
Medium Term CAP-0076386	Factory to collect MSDS sheets for all chemicals stored, classify materials, and propose storage arrangements to meet NFPA 30 requirements. Prepare drawings showing the proposed chemical storage areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all chemical storage areas - Locations of fire rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction) - Ventilation provisions to each of these rooms
Longer Term CAP-0076387	Implement the above plan on site. All chemical storage areas to be compliant with Pakistan Accord Standard.



Figure 2.26 - Ink store is not fire separated from printing hall (2nd floor) Building 1.

10.3 Gas storage

Flammable gas storage areas should be fire separated from the rest of the building. Adequate ventilation should be provided.

The following deficiencies have been observed on site, including (list not exhaustive):
- Gas storage areas at escape route near Building 1 is not fire separated from the rest of the building.

Recommended remedial actions are provided below.F-202603-064392

Timeline	Remediation Plan
Medium Term CAP-0076278	Prepare drawings showing gas storage areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of gas storage areas - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction) - Ventilation provisions to each of these rooms
Longer Term CAP-0076279	Implement the above plan on site. All gas storage areas to be compliant with Pakistan Accord Standard.



Figure 2.27 - LPG cylinder at north-west side of Building 1 is not fire separated from rest of the building.

11. Fire Safety Management

11.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- No regular fire drills as only single drill record was presented.
- Fire drill documentation is of poor standard as date, time & location stamp missing in fire drill pictures.

Recommended remedial actions are provided below.F-202603-064386

Timeline	Remediation Plan
Medium Term CAP-0076296	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0076297	Ensure fire drills are performed a minimum of 2 times per year.

11.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire Extinguishers.
- No records of testing of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202603-064389

Timeline	Remediation Plan
Medium Term CAP-0076304	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0076305	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

11.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of maintenance of Fire Extinguishers.
-No records of maintenance of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202603-064394

Timeline	Remediation Plan
Medium Term CAP-0076287	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0076288	- Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

11.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid firefighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):
- Escape diagrams are missing on some levels such as at entrance into S1 from 1st floor.
- There is no standard EAP document which details procedures, roles and responsibilities in the event of fire.

Recommended remedial actions are provided below.F-202603-064396

Timeline	Remediation Plan
Medium Term CAP-0076294	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0076295	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.



Figure 2.28 - Escape diagram is missing at entrance into S1 from 1st floor.

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.