Issue	**1**
Factory ID	**26328**
Date of Issue	**22-Apr-2026**

Fashion & Styles

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Chak 117/JB, (Dhanola) Millat Industrial Estate Road
37600 Faisalabad
Punjab Pakistan

Latitude: [31.502287], longitude: [73.10175]
Date of inspection: 12-Mar-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Muhammad Asim**
Reviewed by	**Talha Akram Khan**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 12-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
   2.1 Structural System 21
3. Documentation 23
4. Structural Safety Measures 24
5. Remediation Support 26
   5.1 Engineering Support 26
6. Potential Overstress 27
   6.1 Highly stressed columns 27
7. Cracking 29
   7.1 Walls 29
8. Other Damage/Defects 31
   8.1 Corrosion of reinforcement 31
   8.2 Health and Safety 33
   8.3 Health and Safety 35
9. Structural Documentation 37
   9.1 Documentation unavailable 37
   9.2 Lack of safe load plans 38
10. Assessment Limitations and Assumptions 39

1. Executive Summary

On 12-Mar-2026, Ausama Iqbal and Muhammad Asim on behalf of the Pakistan Accord carried out an initial structural inspection for Fashion & Styles, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Muhammad Nadeem Ashraf (HR), Mr. Muhammad Waqas (Civil representative), and other staff members of Fashion & Styles.
The factory operates in a general single shift. Approximately 240 workers operate in the factory with 20 workers being females.
The factory comprises of two main building and four ancillary structures owned by Fashion & Styles. During the inspection, the area highlighted in blue in Figure 1.1 were inspected, with the site boundary indicated in red.

- **Building 01** comprises of three areas details of which are given below:
  - **Area 1** is a four storey (Basement+Ground+2) building. The structural system of the building consists of an RC moment-resisting frame system with load bearing brick masonry wall at periphery and RC retaining wall at basement level. The building is used for solar panels (roof), colour room, exposing room, printing office, printing hall (second floor) offices, packing (first floor), storage, packing, Q.A department, (ground floor), and storage, (basement). The construction year of the building is 2023.
  - **Area 2** is a three storey (Ground+2) building. The structural system of the building consists of an RC moment-resisting frame system with load bearing brick masonry wall at periphery. The building is used for printing machine hall, (second floor), stitching, pressing, finishing, sample room, (first floor), stitching hall, offices (ground floor). The construction year of the building is 2023.
  - **Area 3** is a two storey (Ground+1) building. The structural system of the building consists of combination of an RC moment-resisting frame system and load bearing brick masonry wall. The building is used for storage, washing area, offices (first floor), offices and meeting room (ground floor). The construction year of the building is 2023.
- **Building 02** is a single storey (Ground only) building. The structural system of the building consists of an RC moment-resisting frame system supporting precast double tee slab. The building is used for solar panels (roof), embroidery hall, offices, warehouse (ground floor). The construction year of the building is 2023.
- **Ancillary Structure** there are four ancillary structures details of which are given below:
  - **Gate office 1** is a two storey (Ground+1) structure having load bearing brick masonry wall supporting RC slab. The structure is used for offices (first and ground floor). The construction year of building is unknown.
  - **Gate office 2** is a single storey (Ground only) structure having load bearing brick masonry wall supporting RC slab. The structure is used for gate office purpose (ground floor). The construction year of structure is unknown.
  - **Prayer area** is a single storey (Ground only) structure having steel truss shed. The structure is used for prayer area (ground floor). The construction year of building is unknown.
  - **Mess and Canteen area** is a single storey (Ground only) structure having load bearing brick masonry walls supporting brick slab with

T-irons resting on steel I girders. The structure is used for mess and canteen purpose (ground floor). The construction year of building is unknown.

Incomplete site layout, incomplete structural drawings of building 01 and stability certificate was provided at the factory. For further details, refer to table 2 of the documentation.

There is one Health and Safety issue which should be addressed immediately, regarding the lack of edge protection at the roof of building 01, building 02 and at projection at second and first floor of building 01. Further details are provided in Section 8.

A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Internal columns of building 01 (area 1) at basement level are observed to be overstressed.
- Internal columns of building 01 (area 2) at ground level are observed to be overstressed.
- Exposed and corroded reinforcement was observed at roof level of building 02.

We see no reason to suspend operations in the facility due to these concerns, subject to the actions identified being addressed within the specified timeframes.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1 - Building Summary

Building	Use	No. of stories	Year of construction	Structural System	Roof structure system	Any extension/Modification	Engineer access issue
Building 01							
Area 1	Solar panels (roof), colour room, exposing room, printing office, printing hall (second floor) offices, packing (first floor), storage, packing, Q.A department, (ground floor), and storage, (basement).	Four storeys (Basement + Ground + 2)	2023	RC moment-resisting frame system with load bearing brick masonry wall at periphery and RC retaining wall at basement level.	-	-	-

Area 2	Printing machine hall, (second floor), stitching, pressing, finishing, sample room, (first floor), stitching hall, offices (ground floor).	Three storeys (Ground + 2)	2023	RC moment-resisting frame system with load bearing brick masonry wall at periphery.	-	-	-
Area 3	Storage, washing area, offices (first floor), offices and meeting room (ground floor).	Two storeys (Ground + 1)	2023	Combination of an RC moment-resisting frame system and load bearing brick masonry wall.	-	-	No safe roof access
Building 02	Solar panels (roof), embroidery hall, offices, warehouse (ground floor).	Single storey (Ground only)	2023	RC moment-resisting frame system supporting precast double tee slab.	-	-	-
Ancillary Structure							

Gate office 1	Offices (first and ground floor).	Two storeys (Ground + 1)	Unknown	Load bearing brick masonry wall supporting RC slab	-	-	-
Gate office 2	Gate office purpose (ground floor).	Single storey (Ground only)	Unknown	Load bearing brick masonry wall supporting RC slab	-	-	-
Prayer area	Prayer area (ground floor).	Single storey (Ground only)	Unknown	Steel truss shed	-	-	-
Mess and Canteen area	Mess and canteen purpose (ground floor).	Single storey (Ground only)	Unknown	Load bearing brick masonry walls supporting brick slab with T-irons resting on steel I girders	-	-	-



Figure 1.1. Site plan (Satellite View) – Red dashed line indicates site boundary, highlighted area (blue) indicates buildings inspected



Figure 1.2. Site layout Plan; Red dashed line indicates site boundary, highlighted area indicates buildings inspected



Figure 1.3. Building 02 - Side elevation of the building



Figure 1.4. Ancillary structure (gate office 2) - Front elevation of the structure



Figure 1.5. Building 01 (area 1) - Solar panels at roof level



Figure 1.6. Building 01 (area 1) - Colour room at second floor



Figure 1.7. Building 01 (area 1) - Exposing room at second floor



Figure 1.8. Building 01 (area 1) - Printing office at second floor



Figure 1.9. Building 01 (area 1) - Printing hall at second floor



Figure 1.10. Building 01 (area 2) - Printing machine hall at second floor



Figure 1.11. Building 01 (area 1) - Offices at first floor



Figure 1.12. Building 01 (area 1) - Packing at first floor



Figure 1.13. Building 01 (area 2) - Stitching at first floor



Figure 1.14. Building 01 (area 2) - Pressing at first floor



Figure 1.15. Building 01 (area 2) - Finishing hall at first floor


Figure 1.16. Building 01 (area 2) - Sample room at first floor


Figure 1.17. Building 01 (area 3) - Storage at first floor


Figure 1.18. Building 01 (area 3) - Washing area at first floor



Figure 1.19. Building 01 (area 3) - Offices at first floor



Figure 1.20. Building 01 (area 1) - Storage at ground floor



Figure 1.21. Building 01 (area 1) - Packing at ground floor



Figure 1.22. Building 01 (area 1) - Q.A department at ground floor



Figure 1.23. Building 01 (area 2) - Stitching hall at ground floor



Figure 1.24. Building 01 (area 2) - Offices at ground floor



Figure 1.25. Building 01 (area 3) - Meeting room at ground floor



Figure 1.26. Building 01 (area 1) - Storage at basement level



Figure 1.27. Building 02 - Solar panels at roof level



Figure 1.28. Building 02 - Embroidery hall at ground floor



Figure 1.29. Building 02 - Offices at ground floor



Figure 1.30. Building 02 - Warehouse at ground floor



Figure 1.31. Ancillary structure (gate office 1) - Office at first floor



Figure 1.32. Ancillary structure (gate office 1) - Office at ground floor



Figure 1.33. Ancillary structure (prayer area) - Prayer area at ground floor



Figure 1.34. Ancillary structure (mess and canteen area) - Mess area at ground floor



Figure 1.35. Ancillary structure (mess and canteen area) - Canteen at ground floor

2.1 Structural System

Building	Building 01
Stability System	RC moment resisting frame system with load bearing brick masonry walls at periphery (Area 1, Area 2). Combination of RC moment resisting frame system and load bearing brick masonry wall system (Area 3).
Column Size (m)	0.46x0.46 (area 1) 0.51x0.51 (area 2)
Grid (m)	12.19x5.89 (Max grid, area 1) 11.64x5.94 (Max grid, area 2)
Primary Beam Size (m)	0.40x0.47 0.35x0.32
Secondary Beam Size (m)	0.35x0.32
Slab Depth (m)	0.15
Finishes Depth (m)	0.100 (typical) 0.135 (roof)
Floor to Ceiling Height (m)	4.0 (Basement – Ground, Ground - First) 3.9 (Typical)

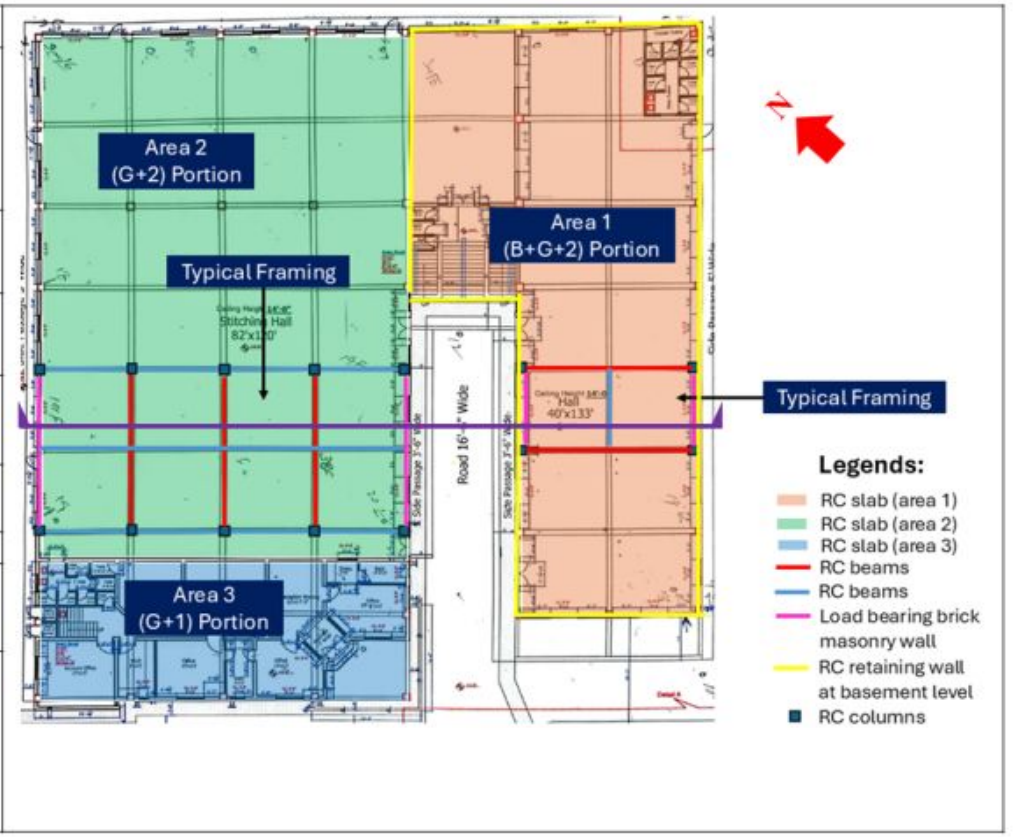


Figure 1.36. Typical floor framing plan detail of building 01

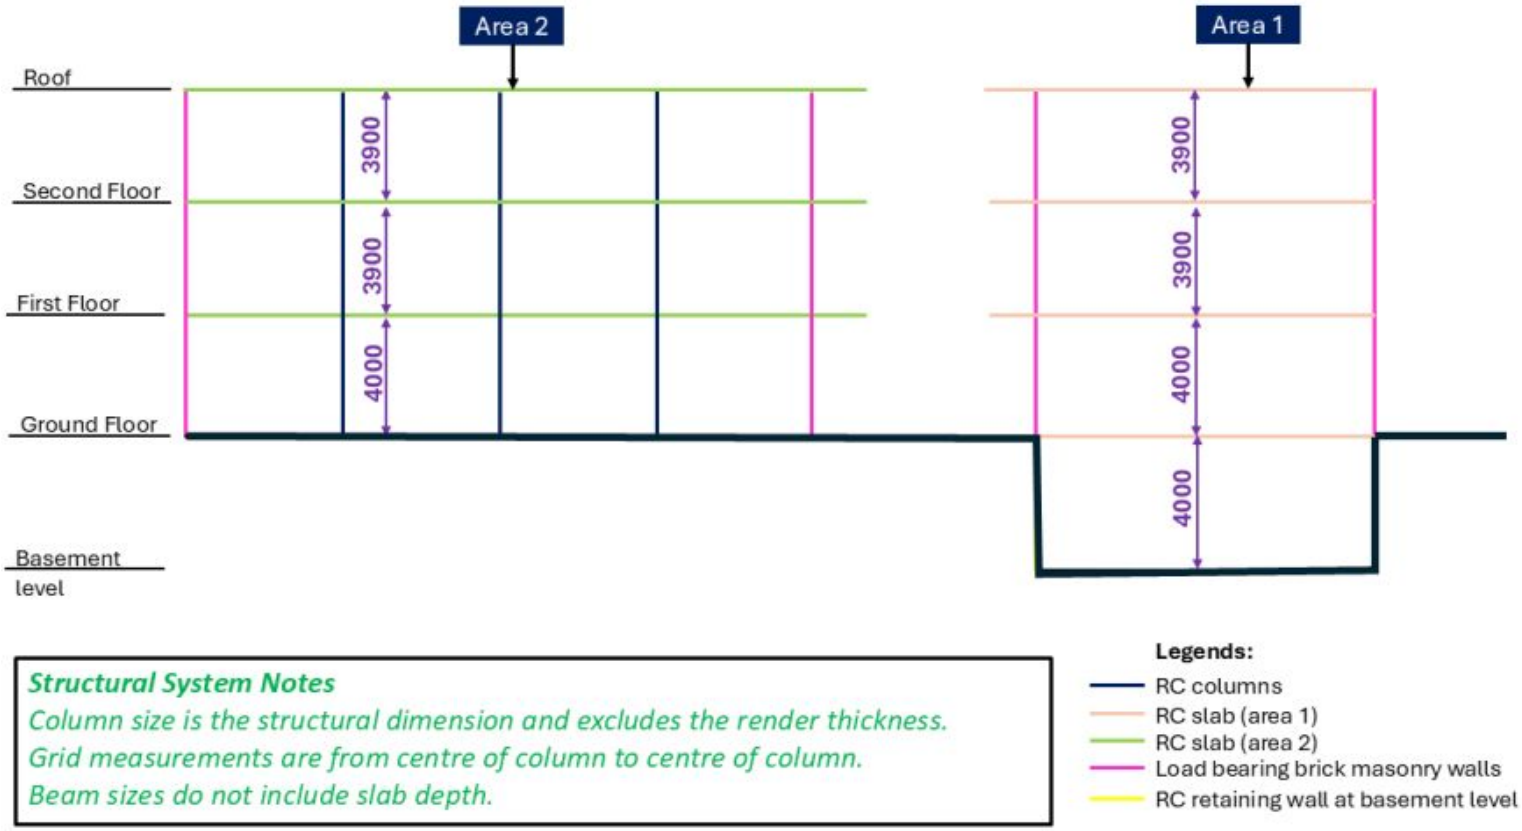


Figure 1.37. Typical section of building 01

3. Documentation

We were presented with a stability certificate, incomplete architectural and structural drawings of building 01 at the factory. However, the factory has still not shared these documents in soft form for review.

Table 2 - Documentation

Building	Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plan	Stability certificate	Inspection reports	Materials testing
Building 01									
Area 1	No	No	No	Yes (Incomplete)	Yes (architectural only)	No	Yes	No	No
Area 2	No	No	No	Yes	Yes (architectural only)	No	Yes	No	No
Area 3	No	No	No	No	Yes (architectural only)	No	Yes	No	No
Building 02	No	No	No	No	No	-	Yes	No	No
Ancillary Structure									
Gate office 1	No	No	No	No	No	-	Yes	No	No
Gate office 2	No	No	No	No	No	-	Yes	No	No
Prayer area	No	No	No	No	No	-	Yes	No	No
Mess and Canteen area	No	No	No	No	No	-	Yes	No	No

4. Structural Safety Measures

During our structural site inspection of Fashion & Styles, a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within Fashion & Styles. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3: Summary of issues by building

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage & defects	Structural documentation
Building 01						
Area 1	Highly stressed column	-	-	-	Health and safety issues – lack of edge protection	Lack of safe load plans. Documentation unavailable
Area 2	Highly stressed column	-	-	-	Health and safety issues – lack of edge protection at roof level.	Lack of safe load plans. Documentation unavailable

Area 3	-	-	-	-	Health and safety issues – lack of edge protection at roof level.	Lack of safe load plans. Documentation unavailable
Building 02	-	-	-	-	Health and safety issues – lack of edge protection at roof level. Corrosion of reinforcement	Documentation unavailable
Ancillary Structure						
Gate office 1	-	-	Wall	-	-	Documentation Unavailable
Gate office 2	-	-	-	-	-	Documentation Unavailable
Prayer area	-	-	-	-	-	Documentation Unavailable
Mess and Canteen area	-	-	-	-	-	Documentation Unavailable

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202603-064104

Timeline	Remediation Plan
Medium Term CAP-0075132	Factories should begin remediation of CAP items such as surface cracks or non-structural repairs using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Potential Overstress

6.1 Highly stressed columns

The internal columns of the building 01 are observed to be highly stressed in following areas:

- In area 1 at basement level due to the greater number of storeys(B+G+2), unavailability of concrete data and relatively large grid spacing (12.19x5.89m) in proportion to their section sizes (0.46x0.46m).
- In area 2 at ground level due to the greater number of storeys(G+2), unavailability of concrete data and relatively large grid spacing (11.64x5.94m) in proportion to their section sizes (0.51x0.51m).F-202603-064105

Timeline	Remediation Plan
Immediate CAP-0075133	Verify the thickness and type of floor finishes at all super structural levels. Submit pictorial evidence to Pakistan Accord.
Immediate CAP-0075134	Verify insitu reinforcement by removing cover and confirming no. and diameter of bars and submit results to Pakistan Accord.
Immediate CAP-0075135	Verify in-situ concrete strength for the identified columns either by 100mm dia. cores from at least 4 columns or existing cylinder strength data and submit results to Pakistan Accord.
Immediate CAP-0075136	Factory Engineer to review design, loads and columns stresses in area identified and submit to Pakistan Accord for review.
Immediate CAP-0075138	(1) Appoint a qualified and competent Structural Engineer to carry out DEA on the full building, in accordance with the DEA scope and minimum requirements set out in the Initial Inspection report.
Medium Term CAP-0075139	(2) Submit accurate As-built Drawings showing structure, loading, elements, dimensions, levels, foundations and framing on Plan, Section and Elevation drawings and a report on Engineering tests carried out to justify material strengths and reinforcement content in all key elements studied, to Pakistan Accord for review

Medium Term CAP-0075140	(3) Submit structural engineering assessment with supporting calculations based on the as-built drawing and material strengths along with safe load plans reviewed previously using a model-based design that justifies the safety and serviceability of the building against loading as set out in Building Code of Pakistan.
Medium Term CAP-0075141	(4) Submit proposals for any retrofitting works that may be needed to demonstrate the adequacy of the structure to Pakistan Accord for review.
Longer Term CAP-0075142	(5) Carry out all retrofitting works if needed as proposed and previously reviewed by Pakistan Accord.
Longer Term CAP-0075143	(6) Factory to advise Pakistan Accord when all retrofitting works are complete and make provision for a verification inspection attended by the factory Structural Engineer. Once Pakistan Accord has verified retrofitting works in accordance with previously reviewed proposals, then this item will be complete.

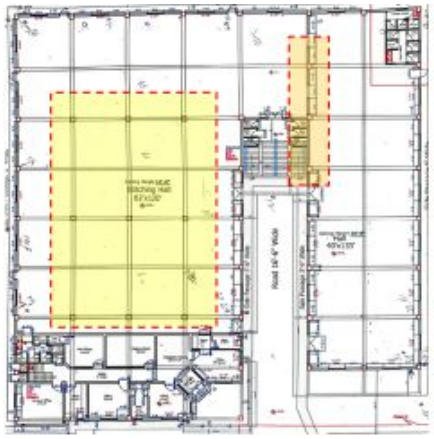


Figure 2.1 - Identified location of highly overstressed internal column at basement level of building 01 (area1)

7. Cracking

7.1 Walls

Cracking was observed in the boundary wall located between Building 01 and Gate Office 1. The potential cause can be due to additional imposed load by the steel stair resting directly on wall. F-202603-064125

Timeline	Remediation Plan
Medium Term CAP-0075228	Building Engineer to inspect the wall and confirm the source of the cracking.
Medium Term CAP-0075229	Propose the remedial work and submit to Pakistan Accord for review.
Longer Term CAP-0075230	Implement the required remedial works.

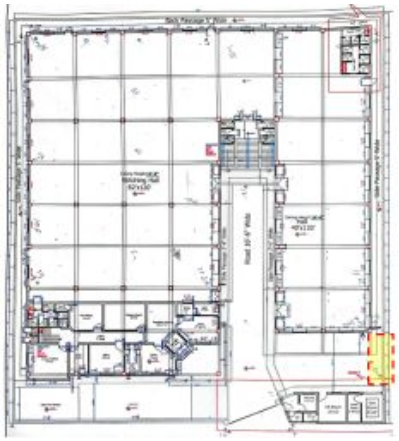


Figure 2.2 - Identified location of craking in boundary wall at ground floor.



Figure 2.3 - Craking in boudary wall at ground floor located in between gate office 1 and building 01



Figure 2.4 - Cracking in boudary wall at ground floor located in between gate office 1 and building 01

8. Other Damage/Defects

8.1 Corrosion of reinforcement

This refers to the exposed rebars on the roof level of building 02 where the rebars were corroded because of being exposed to the atmosphere. This corrosion can lead to reduction in the capacity of the rebars over time F-202603-064121

Timeline	Remediation Plan
Medium Term CAP-0075185	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0075186	Implement the required remedial work.



Figure 2.5 - Building 02 - Identified location corrosion of dowel reinforcement at roof level.



Figure 2.6 - Building 02 - Corrosion of dowel reinforcement at roof level.



Figure 2.7 - Building 02 - Corrosion of dowel reinforcement at roof level.

8.2 Health and Safety

It concerns with lack of edge protection on the roof of building 01 in all three areas (area 1, area2 and area 3), and at the projection at second and first floor in area 2 of building 01, which present a risk of potential injury resulting from slip, trip or fall from roof during the access and maintenance of services – Health & Safety concern. F-202603-064109

Timeline	Remediation Plan
Immediate CAP-0075157	Provide adequate edge protection at the identified locations, and on any other part of the factory with the same issue.



Figure 2.8 - Identified location of lack of edge protection at roof level of building 01



Figure 2.9 - Building 01 - Lack of edge protection at roof level.



Figure 2.10 - Building 01 - Lack of edge protection at roof level.



Figure 2.12 - Building 01 - Lack of edge protection at projection on second and first floor of building 01 (area2).

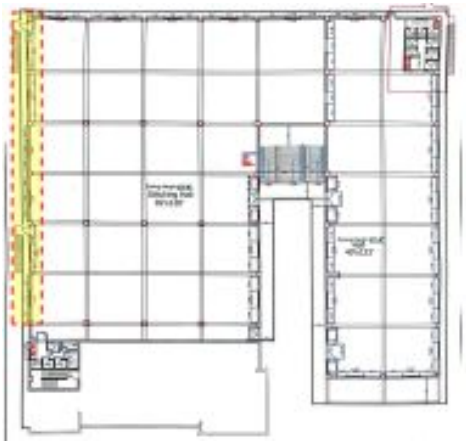


Figure 2.11 - Identified location of lack of edge protection at projection on second and first floor of building 01 (area 2)

8.3 Health and Safety

It concerns with lack of edge protection on the roof of building 02 , which present a risk of potential injury resulting from slip, trip or fall from roof during the access and maintenance of services – Health & Safety concern. F-202603-064112

Timeline	Remediation Plan
Immediate CAP-0075166	Provide adequate edge protection on the roof, and on any other part of the factory with the same issue.



Figure 2.13 - Building 02 - Identified location of lack of edge protection at roof level.



Figure 2.14 - Building 02 - Lack of edge protection at roof level.



Figure 2.15 - Building 02 - Lack of edge protection at roof level.

9. Structural Documentation

9.1 Documentation unavailable

Following documents were unavaiable:

- Site layout plan of building 02, gate office 2, prayers area, mess and canteen area.
- Approved site layout plan of whole factory.
- As built architectural and structural drawings of building 01 (basement area), building 02 and ancillary structures. F-202603-064123

Timeline	Remediation Plan
Longer Term CAP-0075200	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as built documentation.

9.2 Lack of safe load plans

No safe load plans were posted on any floor of building 01 in all three areas (area 1, area 2 and area3). F-202603-064124

Timeline	Remediation Plan
Longer Term CAP-0075204	Building structural engineer to review design documentation to confirm load capacity of the structure.
Longer Term CAP-0075205	Develop safe load plans and submit to Pakistan Accord for review.
Longer Term CAP-0075206	Factory to post safe load plans on each floor.

10. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.