Issue	**1**
Factory ID	**25334**
Date of Issue	**11-Jun-2026**

First American Corporation (Pvt.) Ltd.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

19 Km Main Daska Road, Ghuinke
51310 Sialkot
Punjab Pakistan

Latitude: [32.42408], longitude: [74.46865]
Date of inspection: 09-Mar-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Ghulam Azam**
Reviewed by	**Fraz Hayder**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 09-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 8
3. Building Description 15
   3.1 Building Means of Egress Details 18
   3.2 Building Use 29
4. Documentation 38
5. Fire Safety Measures 39
6. Remediation Support 40
   6.1 Engineering Support 40
7. Means of Escape 41
   7.1 Escape doors 41
   7.2 Exit access 43
   7.3 Travel distance 46
   7.4 Number of exits 47
   7.5 Protection of stairs 49
   7.6 Escape stair condition 51
   7.7 Exit discharge 52
   7.8 Exit signage 54
8. Fire Rated Construction 57
   8.1 Separation of high-risk areas 57
   8.2 Separation of high-risk areas 59
   8.3 Separation of shafts 61

8.4 Separation of occupancies..... 63
8.5 Separation of occupancies..... 65
8.6 Storage..... 67
9. Fire Suppression..... 69
9.1 Fire extinguishers..... 69
10. Hazardous Materials..... 70
10.1 Chemicals handling..... 70
10.2 Chemicals storage..... 72
11. Fire Safety Management..... 74
11.1 Fire drills..... 74
11.2 Records of system testing..... 75
11.3 Records of systems maintenance..... 76
11.4 Emergency Action Plan..... 77
12. Assessment Limitations and Assumptions..... 78

1. Executive Summary

On 09-Mar-2026, Ghulam Azam and Abdul Hayee on behalf of the Pakistan Accord carried out an initial fire inspection for First American Corporation (Pvt.) Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Kahlid Malik (Director Operations) Mr. Nadir Ashfaq (Manager Compliance), Mr. Farooq Mirza (Manager Admin), Muhammad Owais (Structure surveyor), Muhammad Asif (Electrical representative) along with other staff members of the factory. As the assessment was being conducted as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Accord were also present and the team was led by Abdul Hayee Pakistan Accord.

The factory consists of 12 buildings and 4 ancillaries structures owned by First American Corporation Pvt Ltd. During the inspection, the areas highlighted in Figure 1.1 were surveyed, with the site boundary indicated in red dashed line.:

Admin Block is a two story (Ground + 1) building having a load bearing brick masonry system. The building is used for offices (Ground Floor), offices, sleeping areas (First Floor) and PV panels (Roof). The building was constructed in 2002. With a covered area (footprint) of 652 sq. m. Building has 2 staircases out of which 1 discharge internally.

Garment Building is a four story (Ground + 3) building having a RC moment resisting frame system. The building's roof structural system consists of steel portal frame shed. The building is used for storage (Ground Floor), stitching hall (First and Second Floor), screen printing area, storage and PV panels (Third Floor), unoccupied Roof. The building was constructed in 2002 while the construction date of the steel shed is unknown. With a covered area (footprint) of 1135 sq. m and with the height of 12.15 m measured from the fire department vehicle access to the topmost occupied floor. Building has 4 staircases out of which 2 discharge internally.

Belt Stitching and Packing Department Building is a three story (Ground + 2) building having a RC moment resisting frame system. The building roof's structural system consists of steel portal frame shed. The building is used for packing area (Ground Floor), garments packing (First Floor), belt stitching (Second Floor), unoccupied Roof. The building was constructed in 2002 while the steel shed was constructed in 2023. With a covered area (footprint) of 519 sq. m and with the height of 8.4 m measured from the fire department vehicle access to the topmost occupied floor. Building has 4 staircases out of which 1 discharge internally.

Hummel Building is a three story (Ground + 2) building having a RC moment resisting frame system. The building roof's structural system consists of steel portal frame shed. The building is used for cutting, packing, office (Ground Floor), stitching (First Floor), finishing and packing (Second Floor), unoccupied Roof. The building was constructed in 2002 while the steel shed was constructed in 2014.With a covered area (footprint) of 1387 sq. m and with the height of 7.55 m measured from the fire department vehicle access to the topmost occupied floor. Building has 4 staircases out of

which 1 discharge internally.

Heat Transfer / Bag Production Building is a two story (Ground + 1) building having a RC moment resisting frame system. The building is used for heat transfer department (Ground Floor), bag stitching (First Floor) and PV panels (Roof). The building was constructed in 2002.With a covered area (footprint) of 244 sq. m. Building has 2 external discharge staircases,

Pad Store / Bag Packing / Embroidery Building is a two story (Ground + 1) building having a RC moment resisting frame system. The building is used for pad store (Ground Floor), screen printing (First Floor) and PV panels (Roof). The building was constructed in 2016.With a covered area (footprint) of 341sq. m. Building has 2 external discharge staircases.

Canteen / Sublimation Building is a two story (Ground + 1) building having a RC moment resisting frame system. The building is used for labor canteen (Ground Floor) and sublimation hall (First Floor), unoccupied Roof. The building was constructed in 2018. With a covered area (footprint) of 195 sq. m and with the height of 5 m aprox. measured from the fire department vehicle access to the topmost occupied floor. Building has 2 external discharge staircases.

Gloves Store and Guest Room Building is a two story (Ground + 1) building having a load bearing brick masonry system supporting RC slab. The building is used for storage (Ground Floor), carton storage and guest room (First Floor), unoccupied Roof. The building was constructed in 2007. With a covered area (footprint) of 388 sq. m. Building has 2 external discharge staircases.

Pad Production Hall is a single story (Ground only) building having a load bearing brick masonry system supporting precast girder and slab panels. The building is used for pad production (Ground Floor). The building was constructed in 2018. With a covered area (footprint) of 294 sq. m.

Belt / Accessories Production Building is a two story (Ground + 1) building having a RC moment resisting frame system. The building is used for belt production, gloves cutting (Ground Floor) and gloves stitching (First Floor), unoccupied Roof. The building was constructed in 2023. With a covered area (footprint) of 435 sq. m. The building has two external discharge stairs.

HR Office is a two story (Ground + 1) building having a load bearing brick masonry system supporting RC slab. The building is used for offices (Both Floors), unoccupied Roof. The building was constructed in 2021. With a covered area (footprint) of 42 sq. m. The building has one internal discharge stair.

Mosque is a two story (Ground + 1) building having a load bearing brick masonry system supporting RC slab. The building is used for prayer area (Both Floors). The building was constructed in 2002.With a covered area (footprint) of 73 sq. m . The building has one external discharge stair.

Security Office-Ancillary is a multiple single story (Ground only) structures having a load bearing brick masonry system supporting RC slab. The structures are used for offices (Ground Floor). The structures were constructed in 2002. With a covered area (footprint) of 32 sq.

Water Filtration Plant-Ancillary is a single story (Ground only) structure having a load bearing brick masonry system supporting RC slab. The structure is used for water filtration (Ground Floor). The structure was constructed in 2015. with a covered area (footprint) of 32 sq. m.

Pad Store Shed -Ancillary is a single story (Ground only) structure having a steel shed consists of steel frame sections covered with corrugated sheet. The structure is used for storage (Ground Floor). The structure was constructed in 2010., with a covered area (footprint) of 291 sq. m.

Generator Shed-Ancillary is a single story (Ground only) structure having a steel shed consists of steel frame sections covered with corrugated sheet. The structure is used for generator operations (Ground Floor). The construction date of structure is unknown.

The factory complex is entirely occupied by First American Corporation Limited as an owner. The factory operates in one general shift. Approximately 1400 workers operate in the factory with 20 female workers.

We were presented with site Layouts, Civil Defense Certificate, Fire Drills and Staff Training documents listed in Table 2.
A summary of the main concerns identified during the inspection includes (non-exhaustive):
- Lockable mechanisms observed in escape route across the whole facility.
- Travel Distances exceeding permitted limits.
- There is no fire separation between stairs, lift shafts and the rest of the building.
- Escape routes are not adequately fire separated from adjoining high-risk areas.
- Storage areas are not fire separated from the rest of the building.
- Sleeping areas found inside facility-Immediately remove sleeping areas from site and ensure in future as well.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes).

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents



Figure 1.1. Satellite view - Red dashed line indicates site boundary highlighted (blue) area indicates building inspected

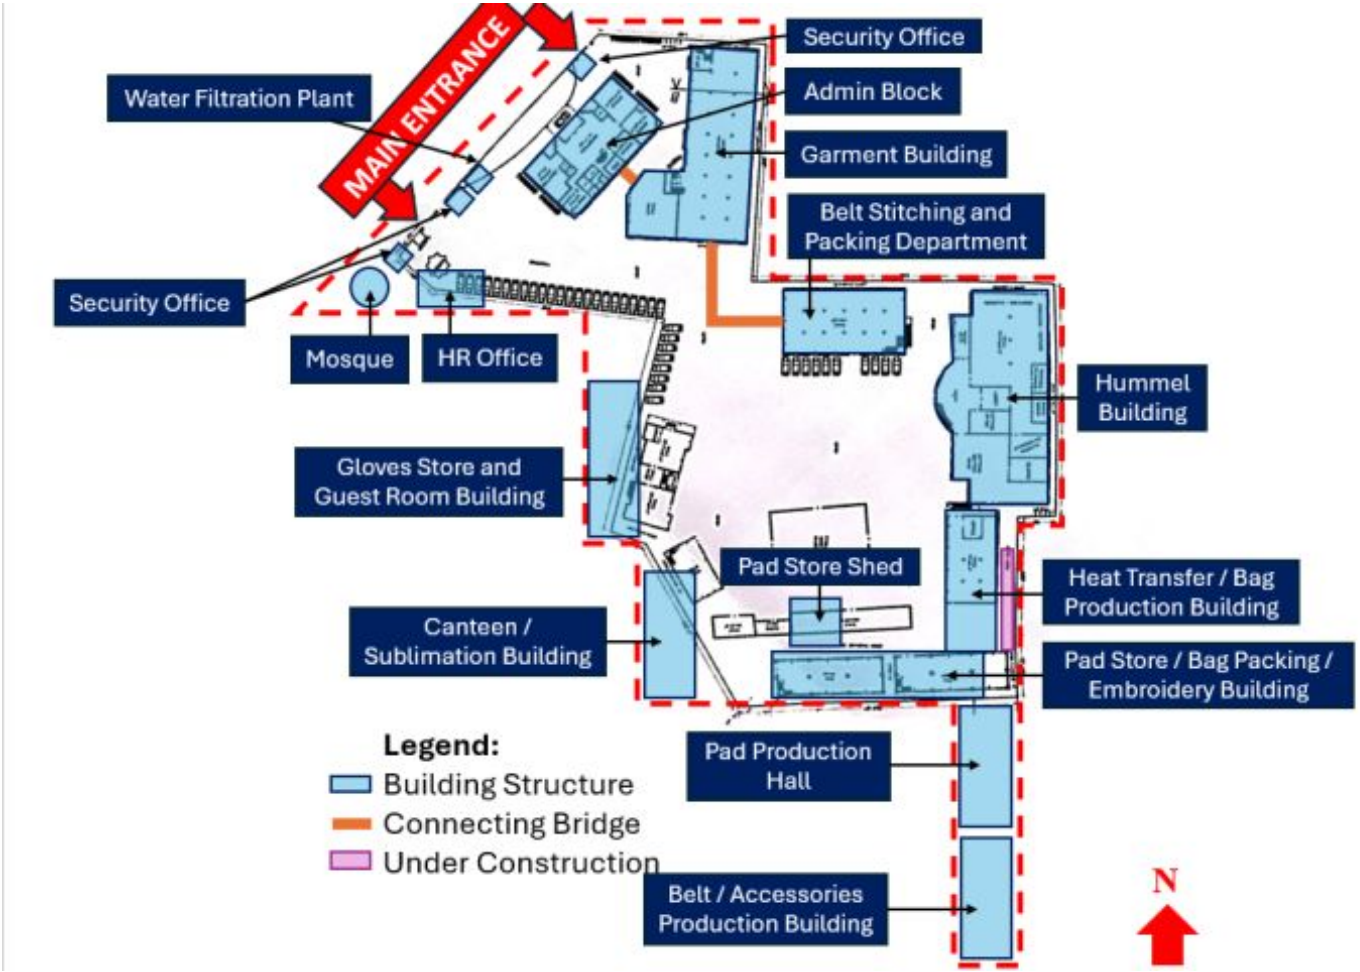


Figure 1.2. Site Layout - Red dashed line indicates site boundary highlighted (blue) area indicates building inspected..

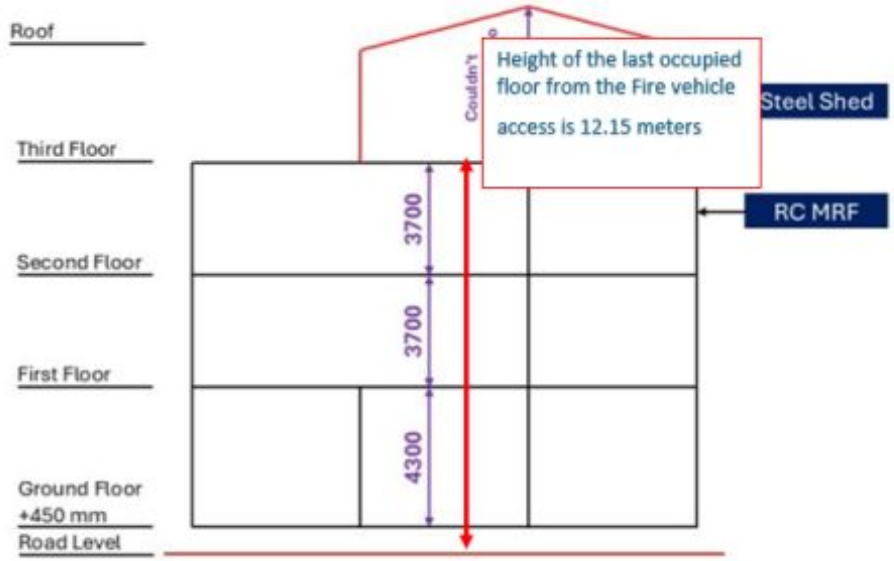


Figure 1.3. Section layout -Garment building

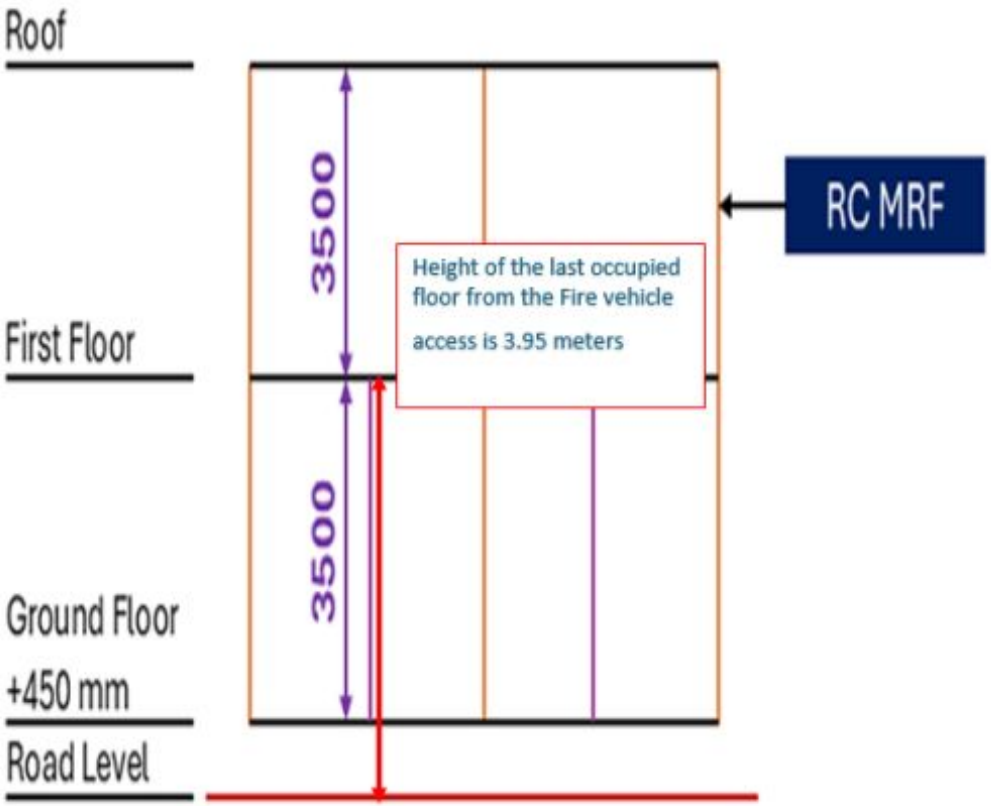


Figure 1.4. Section layout Belt and Accessories Production Building.

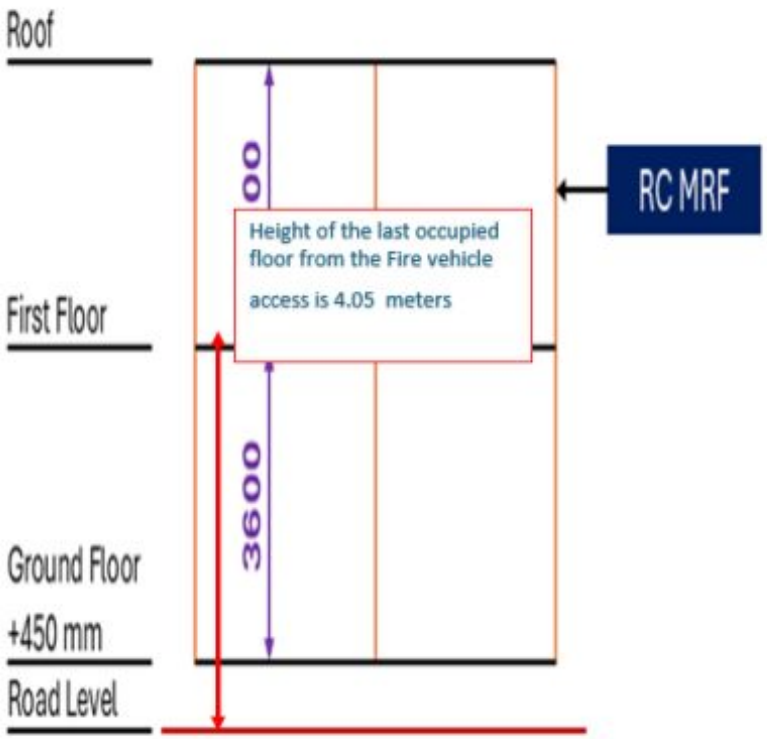


Figure 1.5. Section layout-Heat Transfer and Bag Production Building

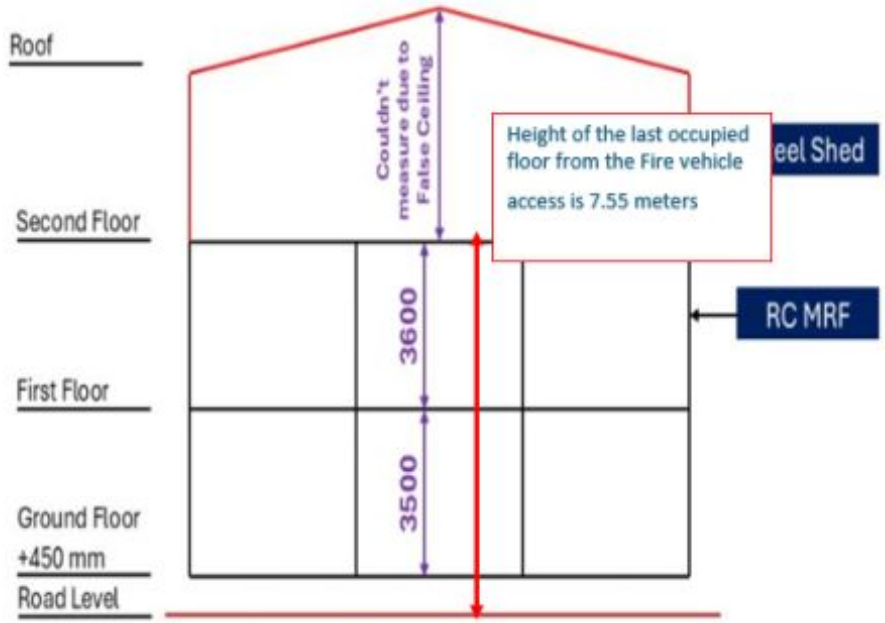


Figure 1.6. Section layout-Hummel Building

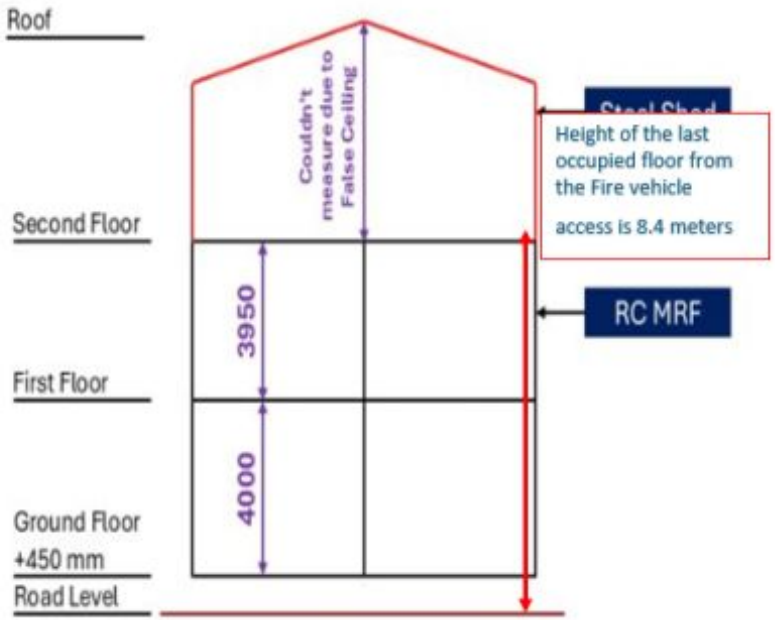


Figure 1.7. Section layout-Belt Stitching and Packing Department Building

3. Building Description

The factory consists of 12 buildings and 4 ancillaries structures owned by First American Corporation Pvt Ltd. During the inspection, the areas highlighted in Figure 1.1 were surveyed, with the site boundary indicated in red dashed line.:

Admin Block is a two story (Ground + 1) building having a load bearing brick masonry system. The building is used for offices (Ground Floor), offices, sleeping areas (First Floor) and PV panels (Roof). The building was constructed in 2002. With a covered area (footprint) of 652 sq. m. Building has 2 staircases out of which 1 discharge internally.

Garment Building is a four story (Ground + 3) building having a RC moment resisting frame system. The building's roof structural system consists of steel portal frame shed. The building is used for storage (Ground Floor), stitching hall (First and Second Floor), screen printing area, storage and PV panels (Third Floor), unoccupied Roof. The building was constructed in 2002 while the construction date of the steel shed is unknown. With a covered area (footprint) of 1135 sq. m and with the height of 12.15 m measured from the fire department vehicle access to the topmost occupied floor. Building has 4 staircases out of which 2 discharge internally.

Belt Stitching and Packing Department Building is a three story (Ground + 2) building having a RC moment resisting frame system. The building roof's structural system consists of steel portal frame shed. The building is used for packing area (Ground Floor), garments packing (First Floor), belt stitching (Second Floor), unoccupied Roof. The building was constructed in 2002 while the steel shed was constructed in 2023. With a covered area (footprint) of 519 sq. m and with the height of 8.4 m measured from the fire department vehicle access to the topmost occupied floor. Building has 4 staircases out of which 1 discharge internally.

Hummel Building is a three story (Ground + 2) building having a RC moment resisting frame system. The building roof's structural system consists of steel portal frame shed. The building is used for cutting, packing, office (Ground Floor), stitching (First Floor), finishing and packing (Second Floor), unoccupied Roof. The building was constructed in 2002 while the steel shed was constructed in 2014.With a covered area (footprint) of 1387 sq. m and with the height of 7.55 m measured from the fire department vehicle access to the topmost occupied floor. Building has 4 staircases out of which 1 discharge internally.

Heat Transfer / Bag Production Building is a two story (Ground + 1) building having a RC moment resisting frame system. The building is used for heat transfer department (Ground Floor), bag stitching (First Floor) and PV panels (Roof). The building was constructed in 2002.With a covered area (footprint) of 244 sq. m. Building has 2 external discharge staircases,

Pad Store / Bag Packing / Embroidery Building is a two story (Ground + 1) building having a RC moment resisting frame system. The building is used for pad store (Ground Floor), screen printing (First Floor) and PV panels (Roof). The building was constructed in 2016.With a covered area (footprint) of 341sq. m. Building has 2 external discharge staircases.

Canteen / Sublimation Building is a two story (Ground + 1) building having a RC moment resisting frame system. The building is used for labor canteen (Ground Floor) and sublimation hall (First Floor), unoccupied Roof. The building was constructed in 2018. With a covered area (footprint) of 195 sq. m and with the height of 5 m aprox. measured from the fire department vehicle access to the topmost occupied floor. Building has 2 external discharge staircases.

Gloves Store and Guest Room Building is a two story (Ground + 1) building having a load bearing brick masonry system supporting RC slab. The building is used for storage (Ground Floor), carton storage and guest room (First Floor), unoccupied Roof. The building was constructed in 2007. With a covered area (footprint) of 388 sq. m. Building has 2 external discharge staircases.

Pad Production Hall is a single story (Ground only) building having a load bearing brick masonry system supporting precast girder and slab panels. The building is used for pad production (Ground Floor). The building was constructed in 2018. With a covered area (footprint) of 294 sq. m.

Belt / Accessories Production Building is a two story (Ground + 1) building having a RC moment resisting frame system. The building is used for belt production, gloves cutting (Ground Floor) and gloves stitching (First Floor), unoccupied Roof. The building was constructed in 2023. With a covered area (footprint) of 435 sq. m. The building has two external discharge stairs.

HR Office is a two story (Ground + 1) building having a load bearing brick masonry system supporting RC slab. The building is used for offices (Both Floors), unoccupied Roof. The building was constructed in 2021. With a covered area (footprint) of 42 sq. m. The building has one internal discharge stair.

Mosque is a two story (Ground + 1) building having a load bearing brick masonry system supporting RC slab. The building is used for prayer area (Both Floors). The building was constructed in 2002.With a covered area (footprint) of 73 sq. m . The building has one external discharge stair.

Security Office-Ancillary is a multiple single story (Ground only) structures having a load bearing brick masonry system supporting RC slab. The structures are used for offices (Ground Floor). The structures were constructed in 2002. With a covered area (footprint) of 32 sq.

Water Filtration Plant-Ancillary is a single story (Ground only) structure having a load bearing brick masonry system supporting RC slab. The structure is used for water filtration (Ground Floor). The structure was constructed in 2015. with a covered area (footprint) of 32 sq. m.

Pad Store Shed -Ancillary is a single story (Ground only) structure having a steel shed consists of steel frame sections covered with corrugated sheet. The structure is used for storage (Ground Floor). The structure was constructed in 2010., with a covered area (footprint) of 291 sq. m.

Generator Shed-Ancillary is a single story (Ground only) structure having a steel shed consists of steel frame sections covered with corrugated sheet. The structure is used for generator operations (Ground Floor). The construction date of structure is unknown.

The factory complex is entirely occupied by First American Corporation Limited as an owner. The factory operates in one general shift. Approximately 1400 workers operate in the factory with 20 female workers.

3.1 Building Means of Egress Details

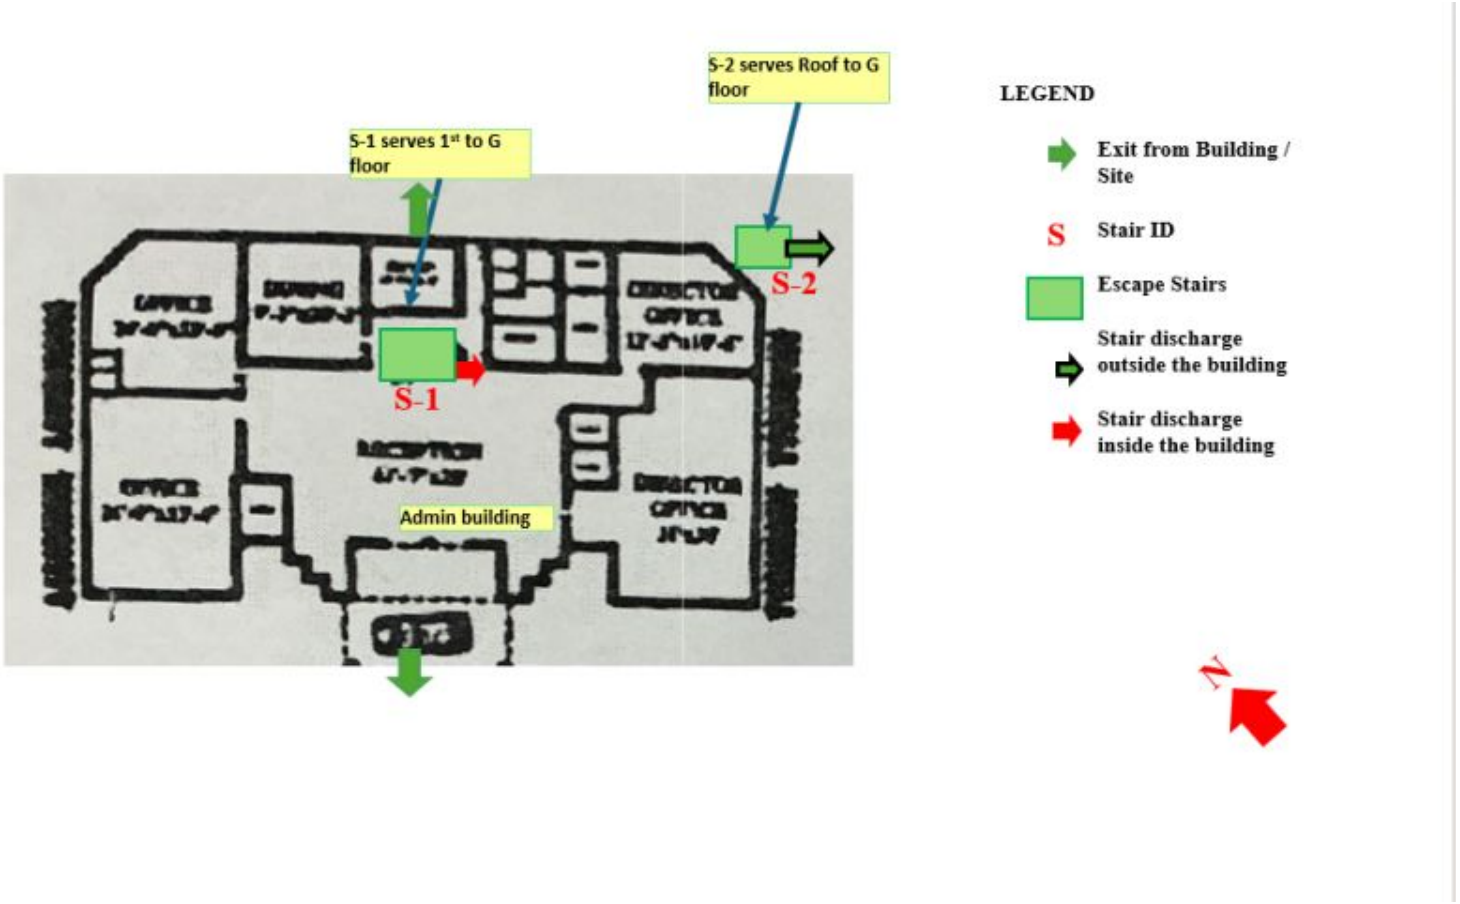


Figure 1.8. Means of Egress- Admin building

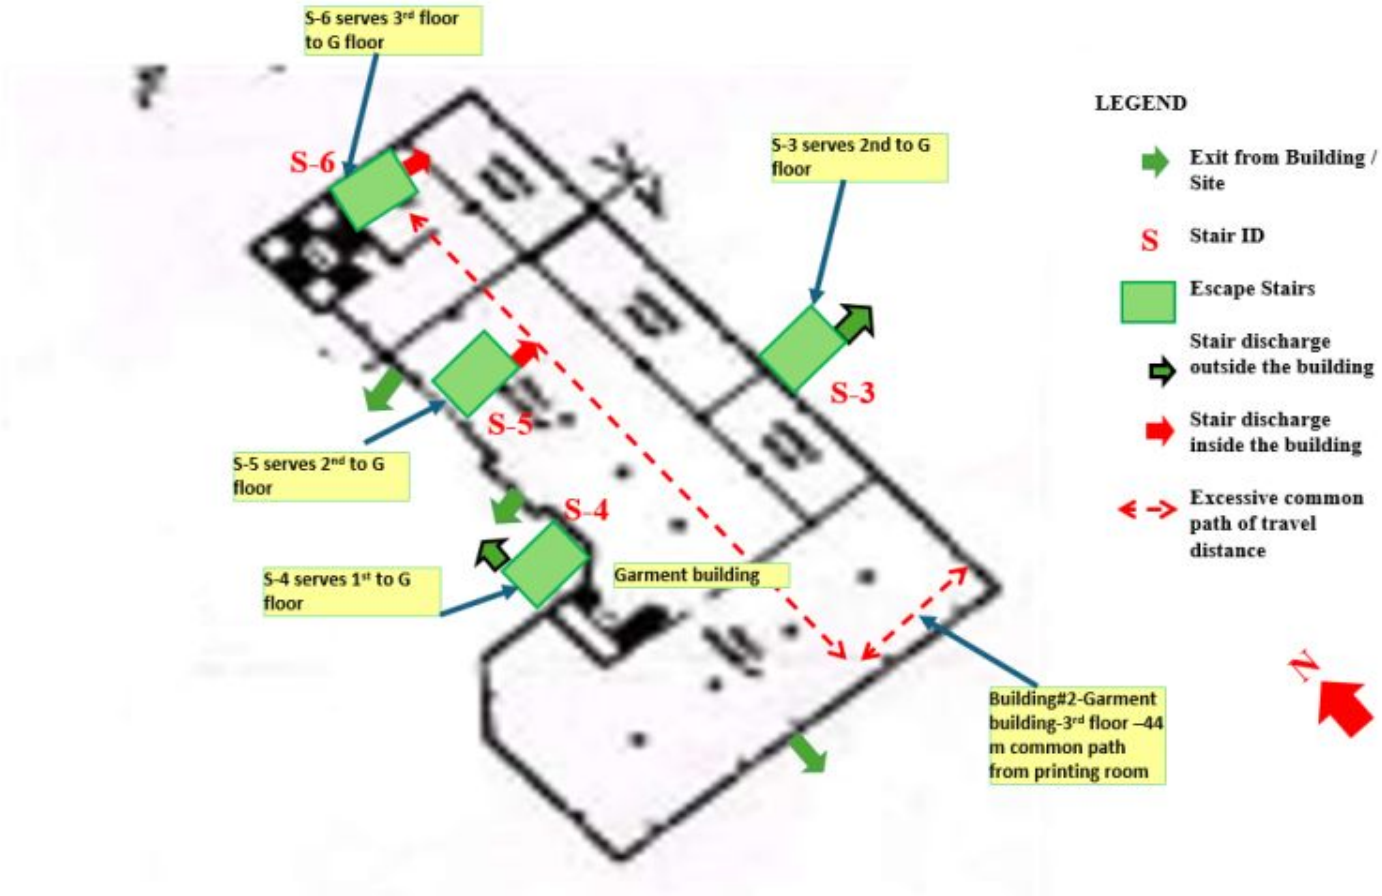


Figure 1.9. Means of Egress -Garment building

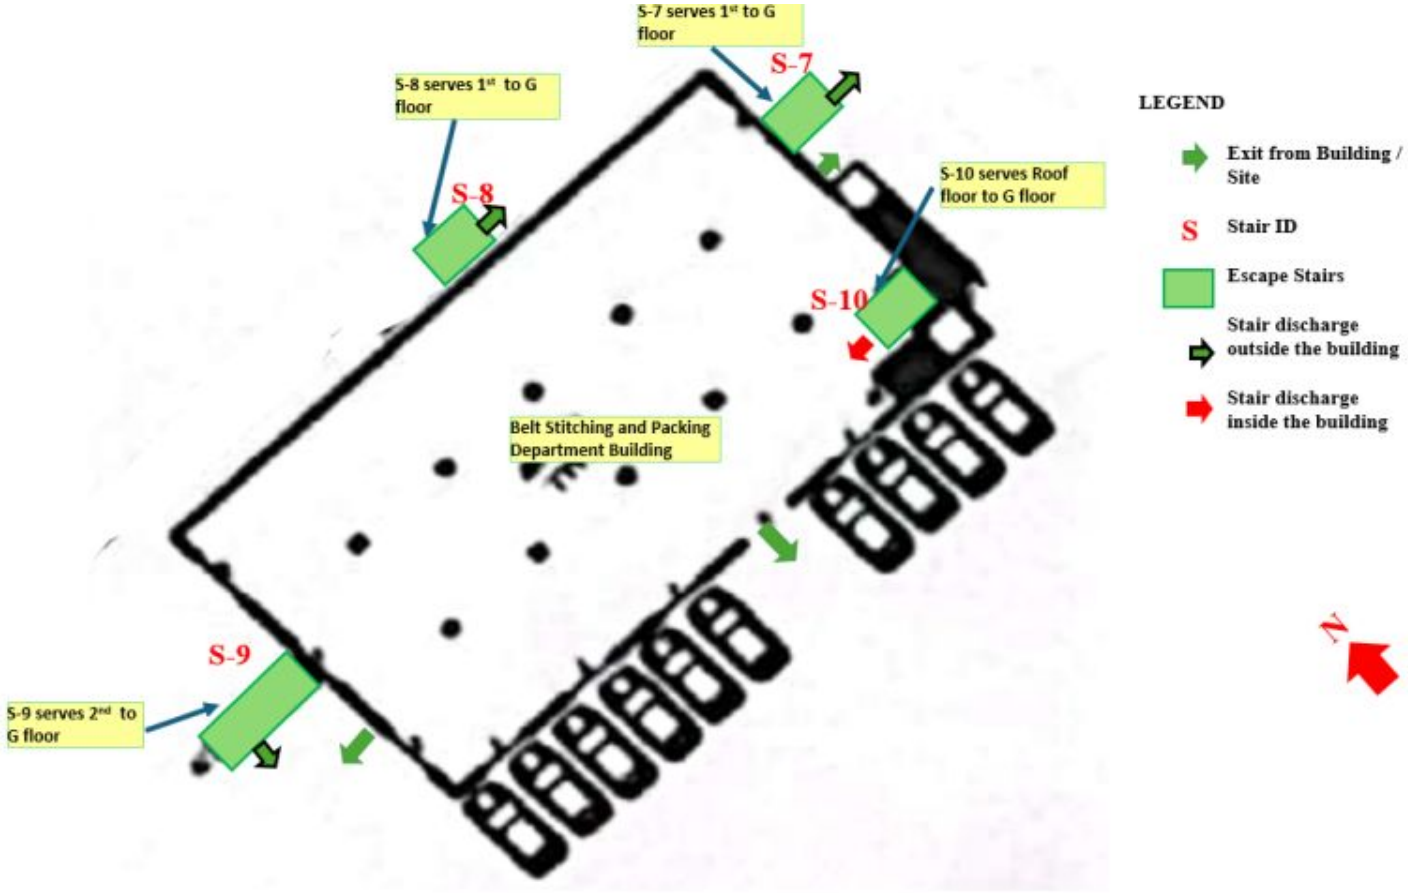


Figure 1.10. Means of Egress -Belt Stitching and Packing Department Building

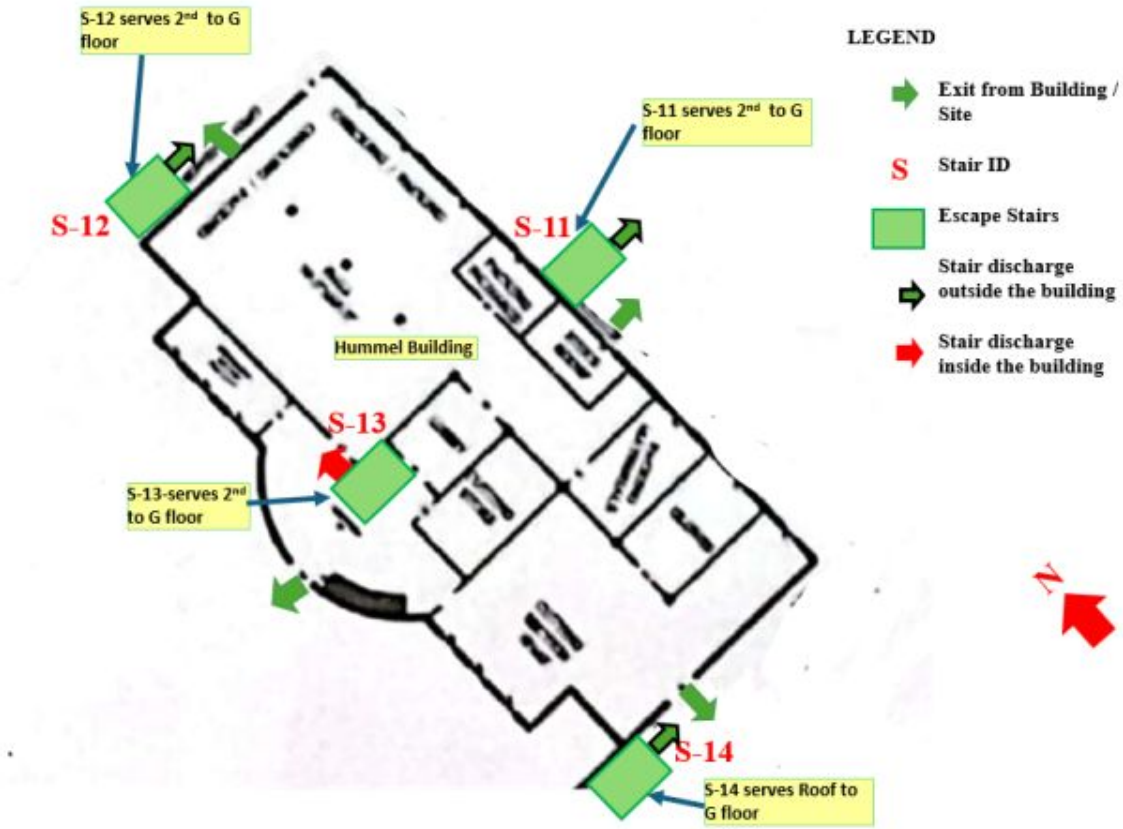


Figure 1.11. Means of Egress -Hummel Building

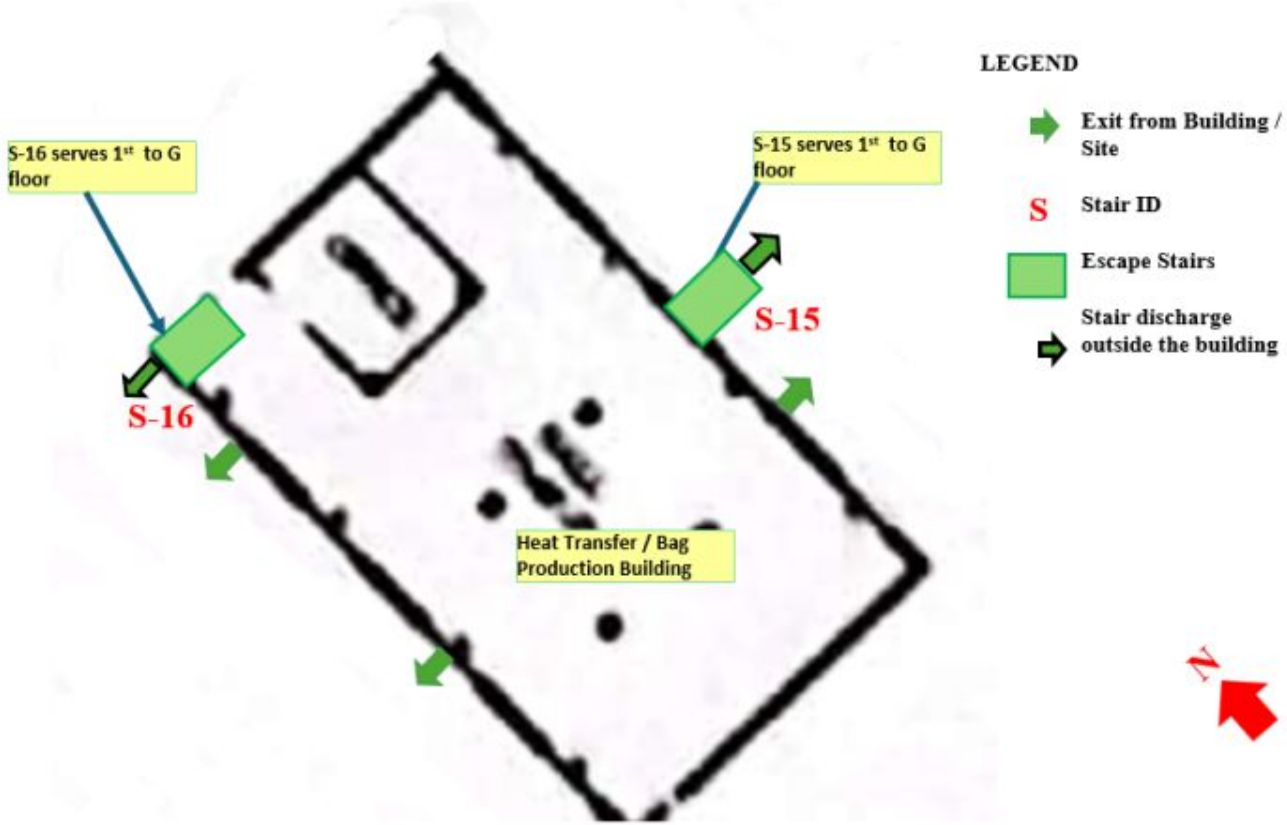


Figure 1.12. Means of Egress -Heat Transfer / Bag Production Building

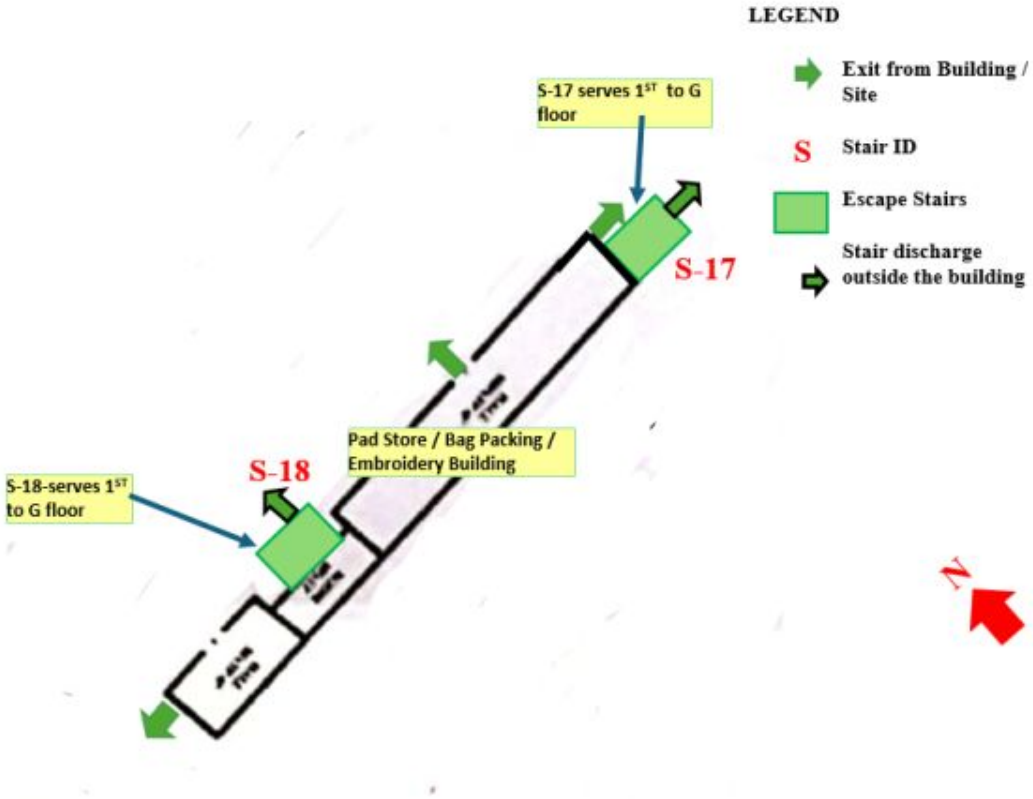


Figure 1.13. Means of Egress -Pad Store / Bag Packing / Embroidery Building

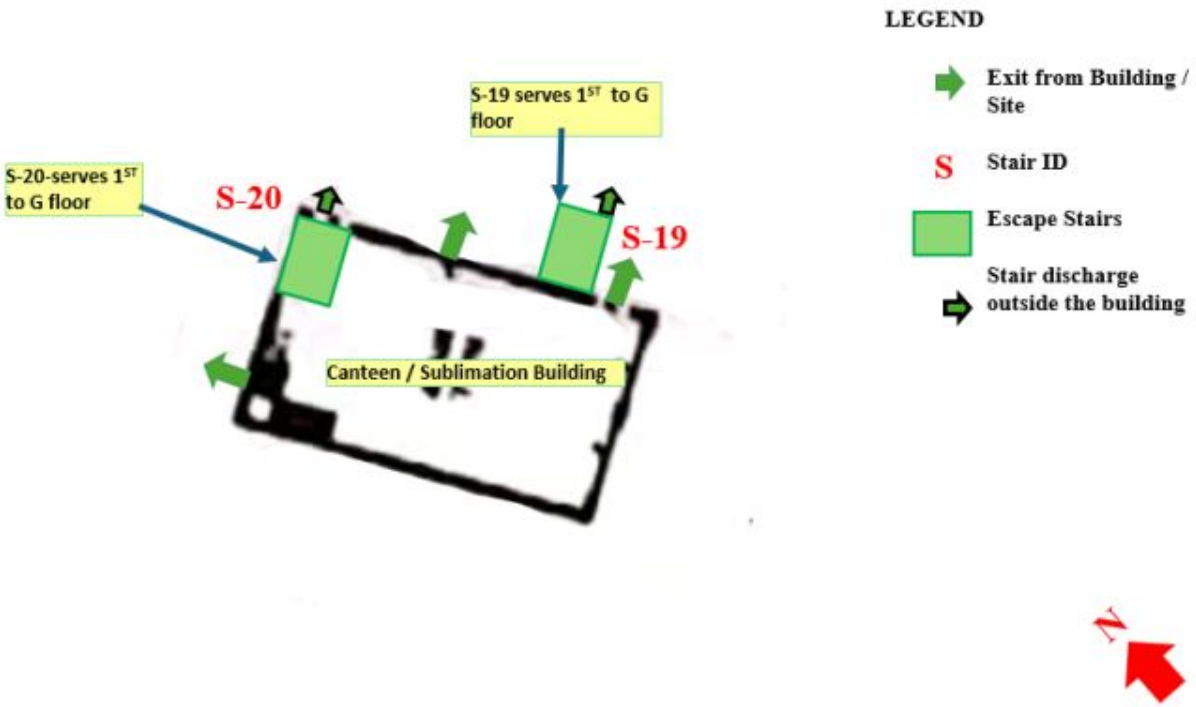


Figure 1.14. Means of Egress -Canteen / Sublimation Building



Figure 1.15. Means of Egress -Gloves Store and Guest Room Building

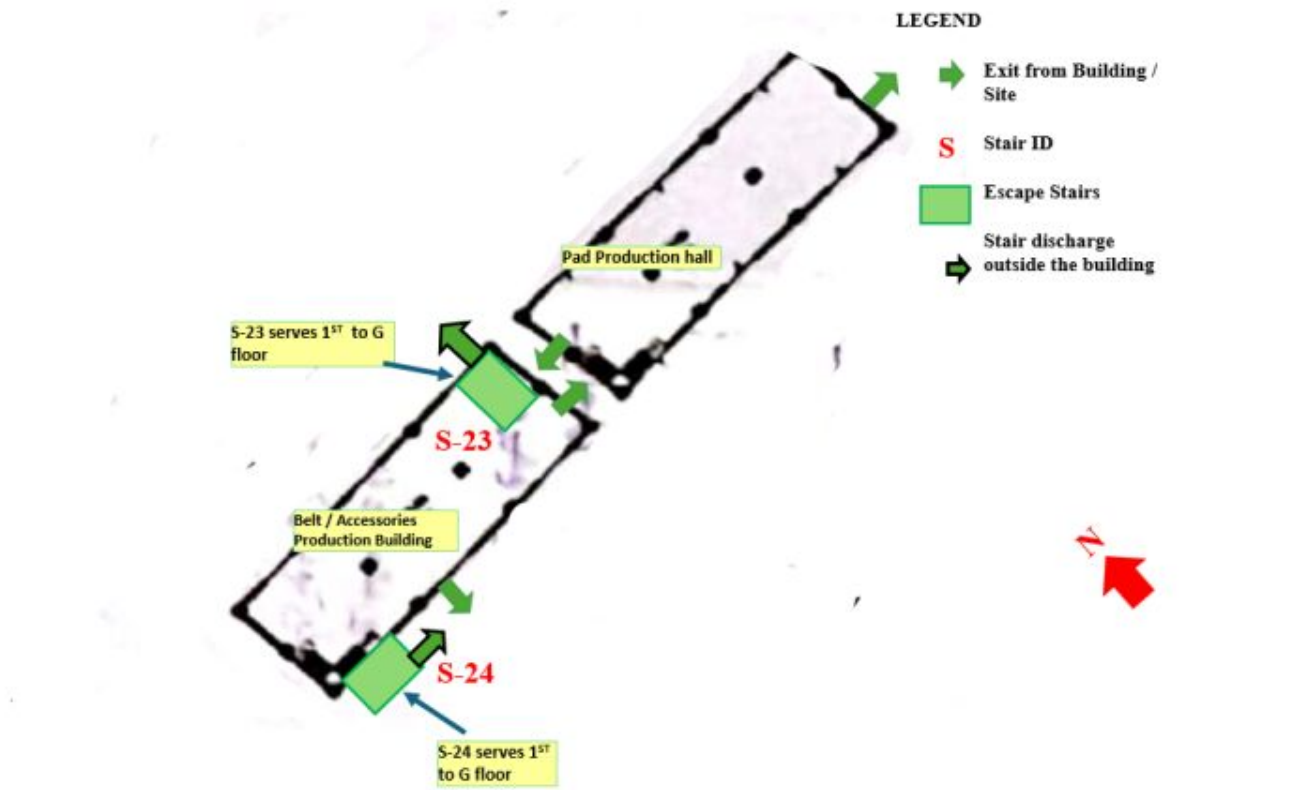


Figure 1.16. Means of Egress -Pad Production Hall & Belt / Accessories Production Building



Figure 1.17. Means of Egress -HR Office

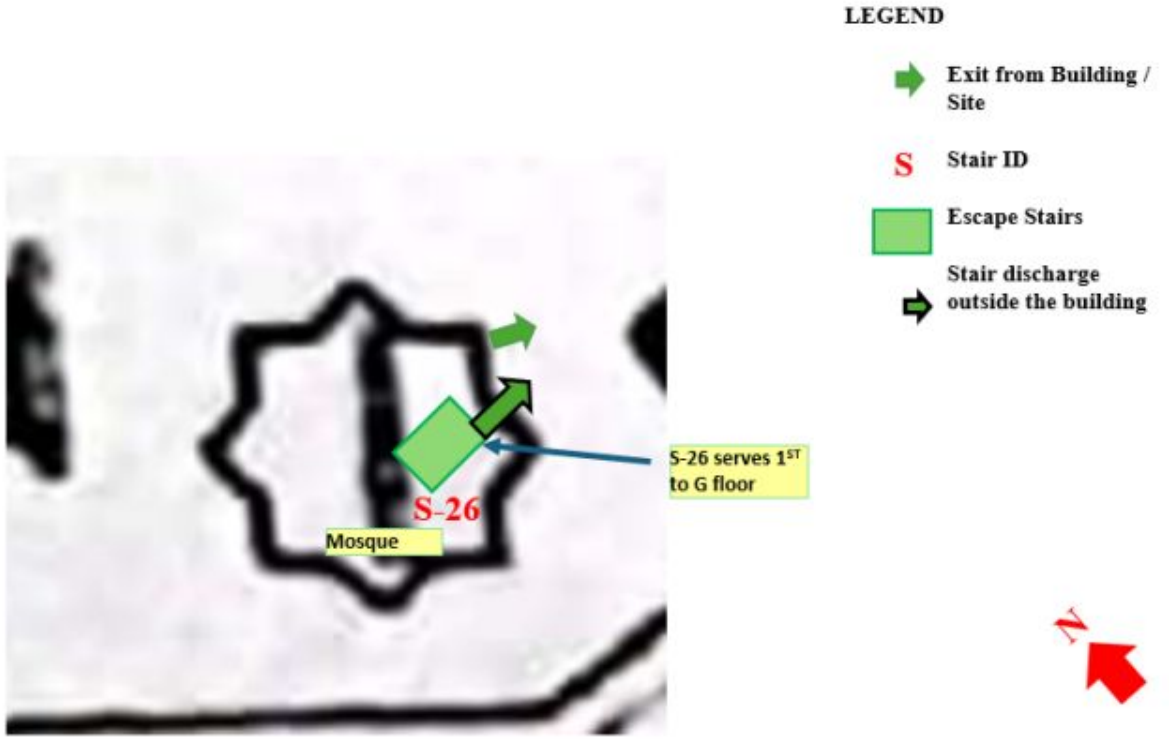


Figure 1.18. Means of Egress -Mosque

3.2 Building Use

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Admin block- Ground Floor	Offices	20	2	_	_	_
Admin block- 1st floor	Offices, sleeping areas	25	2	_	_	_
Admin block- Roof floor	PV panels	Un Occupied	1	_	_	_
There is sufficient exit capacity in the building and there are no travel distance issues.						
Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Garment building- Ground Floor	Storage	30	3	_	_	_
Garment building- 1st floor	Stitching	140	4	_	_	_
Garment building- 2nd floor	Stitching	200	3	_	_	_

Garment building- 3rd floor	Screen printing-Storage-PV panels	20	1	_	44m	_
Garment building-Roof floor	Unoccupied	-	-	-	-	-
There is sufficient exit capacity. Single exit is observed from the third floor of the Building.Travel distance exceeds the permitted limit on the third floor.						
Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Belt Stitching and Packing Department Building- Ground Floor	Packing area	43	3	_	_	_
Belt Stitching and Packing Department Building- 1st floor	Garments packing	50	4	_	_	_

Belt Stitching and Packing Department Building- 2nd floor	Belt Stitching	56	2	_	_	_
Belt Stitching and Packing Department Building- Roof floor	Unoccupied	-	1	-	-	-
There is sufficient exit capacity in building and no travel distance issues observed						
Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Hummel Building- Ground Floor	Cutting, Packing, Offices	90	4	_	_	_
Hummel Building- - 1st floor	Stitching	150	4	_	_	_
Hummel Building- 2nd floor	Finishing, packing	250	4	_	_	_
Hummel Building- Roof floor	Unoccupied	-	1	-	-	-

There is sufficient exit capacity in building and no travel distance issues observed						
Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Heat Transfer / Bag Production Building-Ground Floor	Heat transfer department	50	3	–	–	–
Heat Transfer / Bag Production Building-1st floor	Bag stitching	30	2	–	–	–
Heat Transfer / Bag Production Building-Roof floor	PV panels	Unoccupied	-	–	–	–

There is sufficient exit capacity in building and no travel distance issues observed						
Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End

Pad Store / Bag Packing / Embroidery Building-Ground Floor	Pad store	20	3	–	–	–
Pad Store / Bag Packing / Embroidery Building-1st floor	Screen printing	50	2	–	–	–
Pad Store / Bag Packing / Embroidery Building - Roof floor	Solar panels	Un occupied	-	–	–	–
There is sufficient exit capacity in building and no travel distance issues observed						
Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Canteen / Sublimation Building - Ground Floor	Labor Canteen	60	3	–	–	–
Canteen / Sublimation Building - 1st floor	Sublimation hall	15	2	–	–	–

Canteen / Sublimation Building - Roof floor	Unoccupied	-	-	-	-	-
There is sufficient exit capacity in building and no travel distance issues observed						
Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Gloves Store and Guest Room Building- Ground Floor	Storage	20	3	–	–	–
Gloves Store and Guest Room Building- 1st floor	Carton storage	30	1	–	–	–
	Guest room	10	1	-	-	-
Gloves Store and Guest Room Building- Roof floor	Unoccupied	-	-	-	-	-
There is sufficient exit capacity. Single exit is observed from the 1st floor of the Building.Travel distance does not exceed the permitted limit.						
Floor level	Occupancy	Occupant Load	No. of	Excessive travel distance		

			Exits	Alternatives	Common path	Dead End
Pad Production Hall - Ground Floor	Pad Production	40	2	–	–	–
There is sufficient exit capacity in building and no travel distance issues observed						
Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Belt / Accessories Production Building- Ground Floor	Belt production, Gloves cutting	40	2	–	–	–
Belt / Accessories Production Building- 1st floor	Gloves stitching	30	2	–	–	–
Belt / Accessories Production Building- Roof floor	Unoccupied	-	-	-	-	-
There is sufficient exit capacity in building and no travel distance issues observed						
Floor level	Occupancy	Occupant Load	No. of	Excessive travel distance		

			Exits	Alternatives	Common path	Dead End
HR Office- Ground Floor	Offices	15	1	_	_	_
HR Office- 1st floor	Offices	10	1	_	_	_
HR Office- Roof floor	Unoccupied	-	-	-	-	
There is sufficient exit capacity. Single exit is observed from the 1st floor of the Building.Ttravel distance does not exceed the permitted limit.						
Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Mosque- Ground Floor	Prayer area	70	1	_	_	_
Mosque- 1st floor	Prayer area	70	1	_	_	_
There is sufficient exit capacity. Single exit is observed from the 1st floor & ground floor of the building.Travel distance does not exceed the permitted limit.						
Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Security office - Ground Floor	Office	3	1	_	_	_
There is sufficient exit capacity in building and no travel distance issues observed						
Floor level	Occupancy	Occupant Load	No. of	Excessive travel distance		

			Exits	Alternatives	Common path	Dead End
Water Filtration Plant - Ground Floor	Water filtration	1	1	_	_	_
There is sufficient exit capacity in building and no travel distance issues observed						

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Pad Store Shed - Ground Floor	Storage	1	2	_	_	_
There is sufficient exit capacity in building and no travel distance issues observed						

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Generator Shed - Ground Floor	Generator	2	2	_	_	_
There is sufficient exit capacity in building and no travel distance issues observed						

4. Documentation

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defense Certificate (NOC)		Yes	11-12-2025	-
2.	Architecture Layout		No	-	-
3.	Sectional Layout		No	-	-
4.	Evacuation Maps		No	-	-
5.	Emergency Action Plan		No	-	-
6.	Inspection	Fire extinguishers	No	-	-
		Exit signage	No	-	-
7.	Testing	Fire extinguishers	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Fire extinguishers	No	-	-
		Exit signage	No	-	-
9.	Evidence of Fire Drills		Yes	11-12-2025	Not as per Pakistan Accord Building Standard.
10.	Staff Training		Yes	11-12-2025	Firefighting Training

5. Fire Safety Measures

During our fire site inspection of First American Corporation (Pvt.) Ltd., a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within First American Corporation (Pvt.) Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202603-064110

Timeline	Remediation Plan
Immediate CAP-0075173	Factories should begin remediation of CAP items—such as installing extinguishers, signage, and clearing escape routes—using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Sliding doors shall not serve for escape from areas with more than 10 occupants.

This is not always achieved, examples include (list not exhaustive):
- Escape doors are lockable i.e. Throughout site.
- Sliding doors serve for escape from areas with more than 10 occupants- Belt stitching and Packing department building-Main exit, Garment building-1st floor-Concertina door.

Recommended remedial actions are provided below.F-202603-064012

Timeline	Remediation Plan
Immediate CAP-0074973	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0074974	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Pakistan Accord Building Standard Section 1 Clauses 1.4 and 1.5. Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, that are side swinging and open in the direction of travel to an exit.
Longer Term CAP-0074975	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Garment building-Main exit door is lockable.



Figure 2.2 - Garment building-2nd floor-Lockable door



Figure 2.3 - Belt stitching & packing building -Main exit is sliding door.



Figure 2.4 - Garment building-2nd floor-Concertina door + lockable .

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.
- Headroom along escape route should be more than 2.05m.

This is not always achieved, examples include (list not exhaustive):
- Obstructions on escape route-Garment building-1st floor,Hummel building-2nd floor
- Protected stair discharges inside the building at a distance from building exit-Stairs-S-1, S-6, S-5, S-10, S-13,S-25
- Insufficient headroom along escape route (i.e. headroom height is less than 2.05m)-Hummel building-2nd floor head height is 1.1 m.

Recommended remedial actions are provided below.F-202603-064017

Timeline	Remediation Plan
Immediate CAP-0075098	Remove obstructions on escape routes and keep them clear for escape. Provide warning signs where headroom height is less than 2.05 m on escape routes.
Medium Term CAP-0075099	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks) Propose modifications to ensure 2.05m headroom height is achieved along the escape routes or propose alternative egress routes that comply. Submit the proposal to Pakistan Accord for review.

Longer Term CAP-0075100	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. Implement measures to ensure adequate clear head height is achieved along all escape routes.



Figure 2.5 - Garment building-1st floor -Obstructions and blockage of exit access



Figure 2.6 - Garment building-Ground floor-Obstruction and blockage of exit access



Figure 2.7 - Admin building-Stair S-1 discharge inside building



Figure 2.8 - CEO room -Exit access blockage



Figure 2.9 - Hummel building-2nd floor- head height is 1.1 m

7.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Standard. The standard provides limitations on:
- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.

This is not always achieved, examples include (list not exhaustive):
- Common path of travel distances exceed permitted limits-Garment building-3rd floor-44 m.

Recommended remedial actions are provided below.F-202603-064016

Timeline	Remediation Plan
Medium Term CAP-0075090	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Standard.
Longer Term CAP-0075091	Implement the plan previous reviewed by Pakistan Accord and ensure all travel distances to emergency exits meet the requirements of the Pakistan Accord Standard.

7.4 Number of exits

Per Pakistan Accord Standard, the exit provisions should meet the following:
- Minimum 2 exits from every occupied floor.
- Minimum 2 exits from every occupied area with more than 50 occupants.
- Exits to be sufficiently spaced apart to be classed as alternative exits.

This is not always achieved, examples include (list not exhaustive):
- Single exit from some of the occupied floors-HR building, Garment building-3rd floor.
- There are areas with over 50 occupants that are served by only 1 exit-Mosque building-1st & 2nd floor.
- Exits do not meet the remoteness criteria- Admin building-1st floor- Exits are 2 m apart.

Recommended remedial actions are provided below.F-202603-064010

Timeline	Remediation Plan
Medium Term CAP-0074969	Review each floor and area to ensure that the number of exits complies with Pakistan Accord Standard. Develop plans and drawings to provide additional exits where necessary. Submit the plan and drawings to Pakistan Accord for review and approval prior to commencing rectification works.
Longer Term CAP-0074970	Implement the above plan as agreed with Pakistan Accord. Number of exits from all floors and parts of the building should comply with Pakistan Accord Standard.



Figure 2.10 - Admin building-1st floor - Exits do not meet the remoteness criteria

7.5 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- Stair discharge routes should be protected to the same level of safety as the stair.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings into stairsi.e.Hummel building -S-14, Garment building-S-2, Belt stitching & Packing department building-S-9.
- Missing fire rated enclosure and fire doors in stair-All stairs.
- Fire load in stairs-All stairs

Recommended remedial actions are provided below.F-202603-064015

Timeline	Remediation Plan
Immediate CAP-0075084	Remove fire load and any other obstructions due to stored items from stairs
Medium Term CAP-0075085	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route
Longer Term CAP-0075086	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms.



Figure 2.11 - Hummel building-Stair S-14 -Unprotected openings along stairs



Figure 2.12 - Hummel building-Stair S-14-Fire load under stairs



Figure 2.13 - Garment building-S-6-Fire load under stairs-Missing fire rated enclosure and fire doors

7.6 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):
- There are no handrails-Stair S-5, S-6, S-10, Broken / missing handrails stair S-11.

Recommended remedial actions are provided below.F-202603-064019

Timeline	Remediation Plan
Medium Term CAP-0075114	Handrails are to be provided on both sides of each stair. Ensure the handrails are at an appropriate height.



Figure 2.14 - Belt stitching and packing department -S-10 missing handrails



Figure 2.15 - Heat transfer / Bag production building-Stair S-11 - Broken / missing hand rails

7.7 Exit discharge

Exit discharge routes outside the building should be sufficiently protected so that people can escape safely in the event of a fire anywhere in the building. This includes:
- Escape discharge route should be free of obstruction and trip hazards.
- External escape routes should not lead via high-risk areas.

This is not always achieved, examples include (list not exhaustive):
- Obstructions on escape route-Hummel building-Ground floor, Garment Building-Ground floor, Gloves store & guest room building-Ground floor.
- External escape routes are through high-risk areas-Hummel building, Garment building.

Recommended remedial actions are provided below.F-202603-064020

Timeline	Remediation Plan
Immediate CAP-0075119	Remove obstructions on external escape routes and keep them clear for escape.
Medium Term CAP-0075120	Prepare drawings showing proposed fire separating construction to exit discharge routes. These shall be submitted to Accord for review and approval prior to commencing rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge routes - Details of proposed fire resisting walls and fire door assemblies required to protect discharge routes Provide additional exits from site.
Longer Term CAP-0075121	Ensure external exit discharge routes are adequately fire separated from the rest of the building. - Ensure external escape routes do not pass close to unprotected high-risk areas



Figure 2.16 - Hummel building-Ground floor-Escape route obstructed



Figure 2.17 - Garment building-Escape route passing through generator area-High risk areas

7.8 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at entry into stairs-Garment building-S-5, S-6, Admin building S-1, Hummel building-S-13.
- Missing exit signs in production areas-Hummel building -1st floor.
- Missing exit signs in offices and back of house areas-Throughout site.
- Missing exit signs at roof-Garment building.
- Exit signs are not clear / misleading-Garment building-1st floor.

Recommended remedial actions are provided below.F-202603-064018

Timeline	Remediation Plan
Immediate CAP-0075111	Remove misleading directional escape signs.
Medium Term CAP-0075112	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3.
Longer Term CAP-0075113	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.18 - Admin building-Missing exit signages in office areas



Figure 2.20 - Garment building-Missing exit sign on roof and production area



Figure 2.19 - Garment building-Ground floor -Missing exit signs



Figure 2.21 - Garment building-1st floor -Misleading exit sign



Figure 2.22 - Hummel building-Missing exit sign in production area and Stair S-13

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, electric steam generators (pressure vessels) in occupied areas require blast protection consisting of:
- Minimum 3 m high reinforced concrete/ block masonry wall to separate it from the rest of the occupied portions of the building.
- Door to be solid steel door with a self-closer and a positive latch.
- Opening from the steam generator room to outside the building to release the blast out from the building.

The aim of these provisions is to protect the occupants nearby from the effects of a potential blast.

The following deficiencies have been observed on site, including (list not exhaustive):
- Electric steam generator rooms are not enclosed in minimum 3m high sturdy construction to separate them from occupied areas- Hummel building-Ground floor, Garment building-Ground floor.

Recommended remedial actions are provided below.F-202603-064003

Timeline	Remediation Plan
Medium Term CAP-0075047	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Separation to electric steam generator up to 3 m above the finished floor level. This should be achieved using reinforced concrete / masonry walls with solid steel doors. - The door must have a self-closer and a positive latch. - Blast vent should be provided to outside the building.
Longer Term CAP-0075048	Implement the above plan on site. All buildings to be compliant with Pakistan Accord Standard.



Figure 2.23 - Hummel building-Ground floor -Electric Steam Generator

8.2 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Electrical panels are not fire separated from adjoining areas-All buildings
- Generator room is not fire separated-Garment building-Ground floor
-Kitchen is not fire separated from canteen & offices, Canteen building-Ground floor -Kitchen is not separated from canteen.Admin building-Ground floor
- Lab is not fire separated from offices- Admin building-Ground floor.

Recommended remedial actions are provided below.F-202603-064113

Timeline	Remediation Plan
Medium Term CAP-0075174	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc). - Locations of fire- rated walls and doors to protect these rooms. - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction).
Longer Term CAP-0075175	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.24 - Admin building-Ground floor-Kitchen is not fire separated from canteen & offices



Figure 2.25 - Admin building-Ground floor-Lab is not fire separated from offices.



Figure 2.26 - Garment building-Ground floor-Generator room and electrical panel room not fire separated

8.3 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):

- Lift shafts are not separated with fire rated construction-Garment building +throughout site.

Recommended remedial actions are provided below.F-202603-063999

Timeline	Remediation Plan
Medium Term CAP-0074989	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction).
Longer Term CAP-0074990	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.27 - Garment building-Lift shafts are not fire separated from rest of building

8.4 Separation of occupancies

Pakistan Accord Standard requires different occupancy types to be fire separated from each other. The aim is to limit the fire to only one occupancy type.

The following deficiencies have been observed on site, including (list not exhaustive):
- Car park areas are not fire separated from the rest of the building- HR office building.
- Large office areas-216 sq-m with 50 people aprox. not fire separated from the production areas- Hummel building-Ground floor.
- Day care is not fire separated from the rest of the building-Gloves store and gest room building-1st floor.
- Areas with above 50 occupants is not fire separated from the rest of the building (canteen, prayer area etc.)-Admin building-1st floor+ ground floor.

Recommended remedial actions are provided below.F-202603-064000

Timeline	Remediation Plan
Medium Term CAP-0074993	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Different occupancy types in the building. - Proposed fire separation details (including fire rating of walls and doors).
Longer Term CAP-0074994	Provide fire rated separation between occupancies as per proposal reviewed by Pakistan Accord.



Figure 2.28 - Hummel building-Ground floor -Offices not fire separated from production



Figure 2.29 - HR office building-Car park area is not fire separated from building



Figure 2.30 - Gloves store and guest room building-Child care is not fire separated from storage

8.5 Separation of occupancies

Residential sleeping areas should comply with special measures required for sleeping occupancies. Such measures include:
- Fire separation of dormitories from other occupancies
- Providing a minimum of 2 escape routes from the above ground levels
- Providing an automatic fire detection and alarm system
- Fire separation of cooking facilities/kitchens from the remainder of the dormitory

The following deficiencies have been observed on site, including (list not exhaustive):
- Locking devices on doors do not allow for free escape under all circumstances-Gloves store building-1st floor,Admin building-1st floor, Garment building-3rd floor.
- No adequate automatic fire detection and alarm system-Gloves store building-1st floor,Admin building-1st floor, Garment building-3rd floor.
- Above ground levels lack an alternative escape route-Gloves store building-1st floor,Admin building-1st floor, Garment building-3rd floor.
- Cooking facilities and/or kitchens not adequately fire separated-Gloves store building-1st floor,Admin building-1st floor, Garment building-3rd floor.
- Lack of fire rated separation between the dormitory and other occupancy types--Gloves store building-1st floor,Admin building-1st floor, Garment building-3rd floor.

Recommended remedial actions are provided below.F-202603-064004

Timeline	Remediation Plan
Immediate CAP-0075055	The dormitory is not to be used until minimum requirements for sleeping occupancies have been provided. Alternative arrangements must be sought immediately for the dormitory as continuing the use of the building for this purpose is not appropriate. Dormitory not to be re-occupied until the minimum requirements have been implemented.
Medium Term CAP-0075056	Document proposals for design of remedial measures to ensure compliance with all fire safety requirements for sleeping occupancies to comply with Pakistan Accord Standard. Submit proposals to Pakistan Accord for review.
Longer Term CAP-0075057	Implement remediation measures to ensure full compliance with dormitory requirements of Pakistan Accord Standard and Pakistan Building Code in accordance with previously reviewed design.



Figure 2.31 - Gloves store & guest room building-1st floor -Sleeping area

8.6 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area.
- Storage height is less than 2.45m.
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building-Garment building-2nd floor,Hummel building-Ground floor.
- Presence of areas where storage does not meet miscellaneous in-process storage requirements (listed above)-Garment building-2nd floor
- Storage in exit stairs and/or stair discharge routes-Garment building-Stair S-6 all levels.

Recommended remedial actions are provided below.F-202603-064001

Timeline	Remediation Plan
Medium Term CAP-0074999	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction).
Longer Term CAP-0075000	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard.



Figure 2.32 - Garment building-2nd floor-storage is not fire separated from production



Figure 2.33 - Garment building-2nd floor- excess storage in production area



Figure 2.34 - Hummel building-Ground floor-Excess storage + storage is not fire separated from production.

9. Fire Suppression

9.1 Fire extinguishers

Extinguisher coverage and type of extinguishers used should comply with NFPA 10.

The following deficiencies have been observed on site, including (list not exhaustive):
- Insufficient coverage of fire extinguishers- Throughout site .

Recommended remedial actions are provided below.F-202603-064009

Timeline	Remediation Plan
Medium Term CAP-0074965	Ensure that all building areas are protected using fire extinguishers. The coverage and type of extinguishers used should follow NFPA 10.
Longer Term CAP-0074966	Monitor fire extinguishers for coverage and extinguisher type to comply with NFPA 10.

10. Hazardous Materials

10.1 Chemicals handling

Chemical handling procedures should follow the best international practice.
The following deficiencies have been observed on site, including (list not exhaustive):
- Unsafe handling procedures / Non availability of handling procedures-Canteen building-1st floor , Belt/ Accessories Production building-Ground floor.
- Large amounts of chemicals in production areas-Canteen building-1st floor , Belt/ Accessories Production building-Ground floor.
- Inadequate ventilation of areas with chemical handling-Canteen building-1st floor , Belt/ Accessories Production building-Ground floor.

Recommended remedial actions are provided below.F-202603-064014

Timeline	Remediation Plan
Medium Term CAP-0074985	Develop a chemical handling strategy for the building. Identify dangerous chemicals, how they will be used and handled, the standards that will be followed, and the people responsible for the implementation of the strategy. Submit to Pakistan Accord for review.
Longer Term CAP-0074986	Implement the chemical handling strategy on site as agreed with Pakistan Accord.



Figure 2.35 - Belt/ Accessories Production building-Ground floor.- Large amounts of chemicals in production area.



Figure 2.36 - Belt/ Accessories Production building-Ground Floor-Inadequate ventilation of areas with chemical handling

10.2 Chemicals storage

This relates to storage, handling, and use of flammable chemicals and combustible liquids and solids.
Chemical storage areas should be fire separated from the rest of the building. Adequate ventilation should be provided.

The following deficiencies have been observed on site, including (list not exhaustive):
- Flammable materials are not stored in a fire separated room-Canteen & Sublimation building-Flammable chemicals not stored in fire separated room.

Recommended remedial actions are provided below.F-202603-064013

Timeline	Remediation Plan
Medium Term CAP-0074983	Factory collect MSDS sheets for all chemical stored, classify materials, and proposes storage arrangements to meet NFPA 30 requirements. Prepare drawings showing the proposed chemical storage areas. These shall be submitted to the Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all chemical storage areas. - Locations of fire rated walls and doors to protect these rooms. - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction). - Ventilation provisions to each of these rooms.
Longer Term CAP-0074984	Implement the above plan on site. All chemical storage areas to be compliant with Pakistan Accord Standard.



Figure 2.37 - Garment building-3rd floor -Chemical storage not as per standard.



Figure 2.38 - Canteen building-Ground floor-Flammable chemicals storage is not as per standard

11. Fire Safety Management

11.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Fire drills and record keeping is not as per standard.

Recommended remedial actions are provided below.F-202603-064005

Timeline	Remediation Plan
Medium Term CAP-0075066	Conduct a fire drill and make records, including findings and recommend future improvements.
Longer Term CAP-0075067	Ensure fire drills are performed at a minimum of 2 times per year.

11.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire Extinguishers.
- No records of testing of exit signage

Recommended remedial actions are provided below.F-202603-064007

Timeline	Remediation Plan
Medium Term CAP-0075074	Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Pakistan Accord for review and approval.
Longer Term CAP-0075075	Ensure all systems are being tested as per the schedule agreed with Pakistan Accord. - Keep testing records.

11.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of maintenance of Fire Extinguishers.
-No records of maintenance of exit signage are provided.

Recommended remedial actions are provided below.F-202603-064006

Timeline	Remediation Plan
Medium Term CAP-0075070	Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Pakistan Accord for review and approval.
Longer Term CAP-0075071	Ensure all systems are being maintained as per the schedule agreed with Pakistan Accord. - Keep maintenance records.

11.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023. Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid fire fighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):
- Escape diagrams are missing on some levels.
- There is no EAP document which details procedures, roles and responsibilities in the event of fire.
Recommended remedial actions are provided below.F-202603-064008

Timeline	Remediation Plan
Medium Term CAP-0075078	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0075079	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.