Issue	**1**
Factory ID	**25334**
Date of Issue	**22-Apr-2026**

First American Corporation (Pvt.) Ltd.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

19 Km Main Daska Road, Ghuinke
51310 Sialkot
Punjab Pakistan

Latitude: [32.42408], longitude: [74.46865]
Date of inspection: 09-Mar-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Owais Raza**
Reviewed by	**Qaseem Uz Zaman Khan**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 09-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
   2.1 Structural System 27
3. Documentation 39
4. Structural Safety Measures 41
5. Remediation Support 44
   5.1 Engineering Support 44
6. Cracking 45
   6.1 Walls 45
7. Structural System 47
   7.1 Lack of local stability 47
8. Other Damage/Defects 49
   8.1 Corrosion of reinforcement 49
   8.2 Corrosion of reinforcement 50
   8.3 Corrosion of reinforcement 51
   8.4 Corrosion of reinforcement 52
   8.5 Health and Safety 53
   8.6 Health and Safety 54
   8.7 Health and Safety 55
   8.8 Health and Safety 56
9. Structural Documentation 57
   9.1 Documentation unavailable 57

9.2 Non-engineered structure..... 58
9.3 Non-engineered structure..... 60
9.4 Non-engineered structure..... 62
9.5 Non-engineered structure..... 64
9.6 Lack of safe load plans..... 66
10. Assessment Limitations and Assumptions..... 67

1. Executive Summary

On 09-Mar-2026, Haris Mahmood and Owais Raza on behalf of the Pakistan Accord carried out an initial structural inspection for First American Corporation (Pvt.) Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with Imran Malik (Director), Khalid Malik (Director Operations), Hamid Mustafa (Civil Engineer), Muhammad Awais (Surveyor) and other staff members of First American Corporation Pvt Ltd. The assessment was conducted as part of an overall Structural, Fire, and Electrical initial inspection.

The factory operates in single shift. Approximately 1400 workers operate in the factory with 20 workers being females.

The factory consists of 16 structures owned by First American Corporation Pvt Ltd. During the inspection, the areas highlighted in Figure 1.1 were surveyed, with the site boundary indicated in red dashed line.

- **Admin Block** is a two storey (Ground + 1) building having a load bearing brick masonry system. The building is used for offices (Ground Floor), offices, sleeping areas (First Floor) and solar panels (Roof). The building was constructed in 2002.
- **Garment Building** is a four storey (Ground + 3) building having a RC moment resisting frame system. The building's roof structural system consists of steel portal frame shed. The building is used for storage (Ground Floor), stitching hall (First and Second Floor), screen printing area, storage and solar panels (Third Floor). The building was constructed in 2002 while the construction date of the steel shed is unknown.
- **Belt Stitching and Packing Department Building** is a three storey (Ground + 2) building having a RC moment resisting frame system. The building roof's structural system consists of steel portal frame shed. The building is used for packing area (Ground Floor), garments packing (First Floor), belt stitching (Second Floor). The building was constructed in 2002 while the steel shed was constructed in 2023.
- **Hummel Building** is a three story (Ground + 2) building having a RC moment resisting frame system. The building roof's structural system consists of steel portal frame shed. The building is used for cutting, packing, office (Ground Floor), stitching (First Floor), finishing and packing (Second Floor). The building was constructed in 2002 while the steel shed was constructed in 2014.
- **Heat Transfer / Bag Production Building** is a two storey (Ground + 1) building having a RC moment resisting frame system. The building is used for heat transfer department (Ground Floor), bag stitching (First Floor) and solar panels (Roof). The building was constructed in 2002.
- **Pad Store / Bag Packing / Embroidery Building** is a two storey (Ground + 1) building having a RC moment resisting frame system. The building is used for pad store (Ground Floor), screen printing (First Floor) and solar panels (Roof). The building was constructed in 2016.
- **Canteen / Sublimation Building** is a two storey (Ground + 1) building having a RC moment resisting frame system. The building is used for labour canteen (Ground Floor) and sublimation (First Floor). The building was constructed in 2018.
- **Gloves Store and Guest Room Building** is a two storey (Ground + 1) building having a load bearing brick masonry system supporting RC slab. The building is used for storage (Ground Floor), carton storage and guest room (First Floor). The building was constructed in 2007.
- **Pad Production Hall** is a single storey (Ground only) building having a load bearing brick masonry system supporting precast girder and slab panels. The building is used for pad production (Ground Floor). The building was constructed in 2018.

- **Belt / Accessories Production Building** is a two storey (Ground + 1) building having a RC moment resisting frame system. The building is used for belt production, gloves cutting (Ground Floor) and gloves stitching (First Floor). The building was constructed in 2023.
- **HR Office** is a two storey (Ground + 1) building having a load bearing brick masonry system supporting RC slab. The building is used for offices (Both Floors). The building was constructed in 2021.
- **Mosque** is a two storey (Ground + 1) building having a load bearing brick masonry system supporting RC slab. The building is used for prayer area (Both Floors). The building was constructed in 2002.
- **Security Office** is a multiple single storey (Ground only) structures having a load bearing brick masonry system supporting RC slab. The structures are used for offices (Ground Floor). The structures were constructed in 2002.
- **Water Filtration Plant** is a single storey (Ground only) structure having a load bearing brick masonry system supporting RC slab. The structure is used for water filtration (Ground Floor). The structure was constructed in 2015.
- **Pad Store Shed** is a single storey (Ground only) structure having a steel shed consists of steel frame sections covered with corrugated sheet. The structure is used for storage (Ground Floor). The structure was constructed in 2010.
- **Generator Shed** is a single storey (Ground only) structure having a steel shed consists of steel frame sections covered with corrugated sheet. The structure is used for generator operations (Ground Floor). The construction date of structure is unknown.

The Admin Block, Garment Building, and Belt Stitching and Packing Department Building are interconnected through connecting bridges at the first and second floors.

An incomplete site layout plan was presented. For further details, refer to Table 2 of the documentation.

There is a health and safety concern including the lack of edge protection at the roof of Admin Block, Heat Transfer / Bag Production Building, Pad Store / Bag Packing / Embroidery Building, Belt / Accessories Production Building which should be addressed immediately. For Further details refer to section 8 of this report.

A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Cracking has been observed in the RC retaining walls, columns, and beams of the overhead water tank (OHWT) of the Garment Building.
- One bracing member is missing in the steel shed of the Belt Stitching and Packing Department Building.
- The column dowel reinforcement is exposed to atmospheric corrosion in the Admin Block, Pad Store / Bag Packing / Embroidery Building, Canteen / Sublimation Building, and Belt / Accessories Production Building.
- The steel staircases have structural strength and stability issues in the Admin Block, Belt Stitching and Packing Department Building, Hummel Building, and Canteen / Sublimation Building.

We see no reason to suspend operations in the facility due to these concerns.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1: Building Summary

Building	Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / modifications	Engineer access issues
Admin Block	Offices (Ground Floor) Offices, sleeping areas (First Floor) Solar panels (Roof)	Two storey (Ground + 1)	2002	Load bearing brick masonry system	-	-	-
Garment Building	Storage (Ground Floor) Stitching hall (First and Second Floor) Screen printing area, storage and solar panels (Third Floor)	Four storey (Ground + 3)	2002	RC moment resisting frame system	Steel portal frame shed	-	-

Belt Stitching and Packing Department Building	Packing area (Ground Floor) Garments packing (First Floor) Belt stitching (Second Floor)	Three storey (Ground + 2)	2002	RC moment resisting frame system	Steel portal frame shed	The steel shed was constructed in 2023	-
Hummel Building	Cutting, packing, office (Ground Floor) Stitching (First Floor) Finishing and packing (Second Floor)	Three storey (Ground + 2)	2002	RC moment resisting frame system	Steel portal frame shed	The steel shed was constructed in 2014	-
Heat Transfer / Bag Production Building	Heat transfer department (Ground Floor) Bag stitching (First Floor) Solar panels (Roof)	Two storey (Ground + 1)	2002	RC moment resisting frame system	-	-	-

Pad Store / Bag Packing / Embroidery Building	Pad store (Ground Floor) Screen printing (First Floor) Solar panels (Roof)	Two storey (Ground + 1)	2016	RC moment resisting frame system	-	-	-
Canteen / Sublimation Building	Labour canteen (Ground Floor) Sublimation (First Floor)	Two storey (Ground + 1)	2018	RC moment resisting frame system	-	-	No access to the roof
Gloves Store and Guest Room Building	Storage (Ground Floor) Carton storage and guest room (First Floor)	Two storey (Ground + 1)	2007	Load bearing brick masonry system supporting RC slab	-	-	No access to the roof
Pad Production Hall	Pad production (Ground Floor)	Single storey (Ground only)	2018	Load bearing brick masonry system supporting precast girder and slab panels	-	-	-

Belt / Accessories Production Building	Belt production, gloves cutting (Ground Floor) Gloves stitching (First Floor)	Two storey (Ground + 1)	2023	RC moment resisting frame system	-	-	-
HR Office	Offices (Both Floors)	Two storey (Ground + 1)	2021	Load bearing brick masonry system supporting RC slab	-	-	-
Mosque	Prayer Area (Both Floors)	Two storey (Ground + 1)	2002	Load bearing brick masonry system supporting RC slab	-	-	-
Security Office	Offices (Ground Floor)	Single storey (Ground only)	2002	Load bearing brick masonry system supporting RC slab	-	-	-
Water Filtration Plant	Water filtration (Ground Floor)	Single storey (Ground only)	2015	Load bearing brick masonry system supporting RC slab	-	-	-

Pad Store Shed	Storage (Ground Floor)	Single storey (Ground only)	2010	Steel shed consists of steel frame sections covered with corrugated sheet	-	-	-
Generator Shed	Generator Operations (Ground Floor)	Single storey (Ground only)	Unknown	Steel shed consists of steel frame sections covered with corrugated sheet	-	-	-

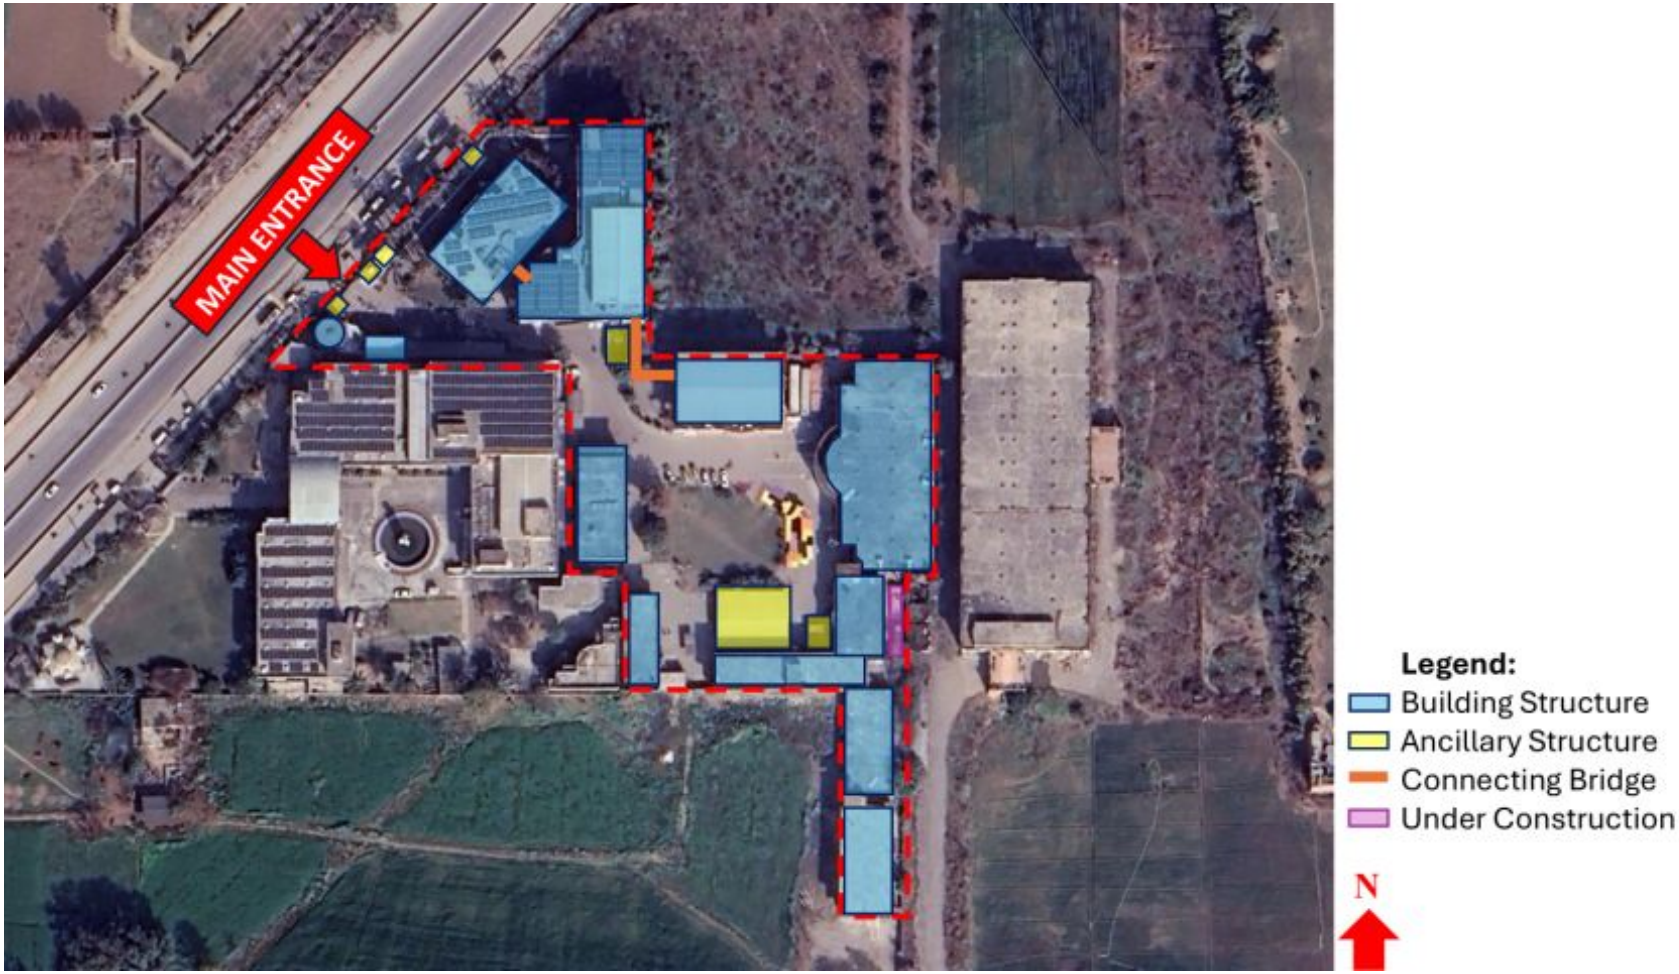


Figure 1.1. Satellite View of the Factory Premises; Red Dashed Line Indicates Site Boundary and Highlighted Area Indicates Buildings Inspected

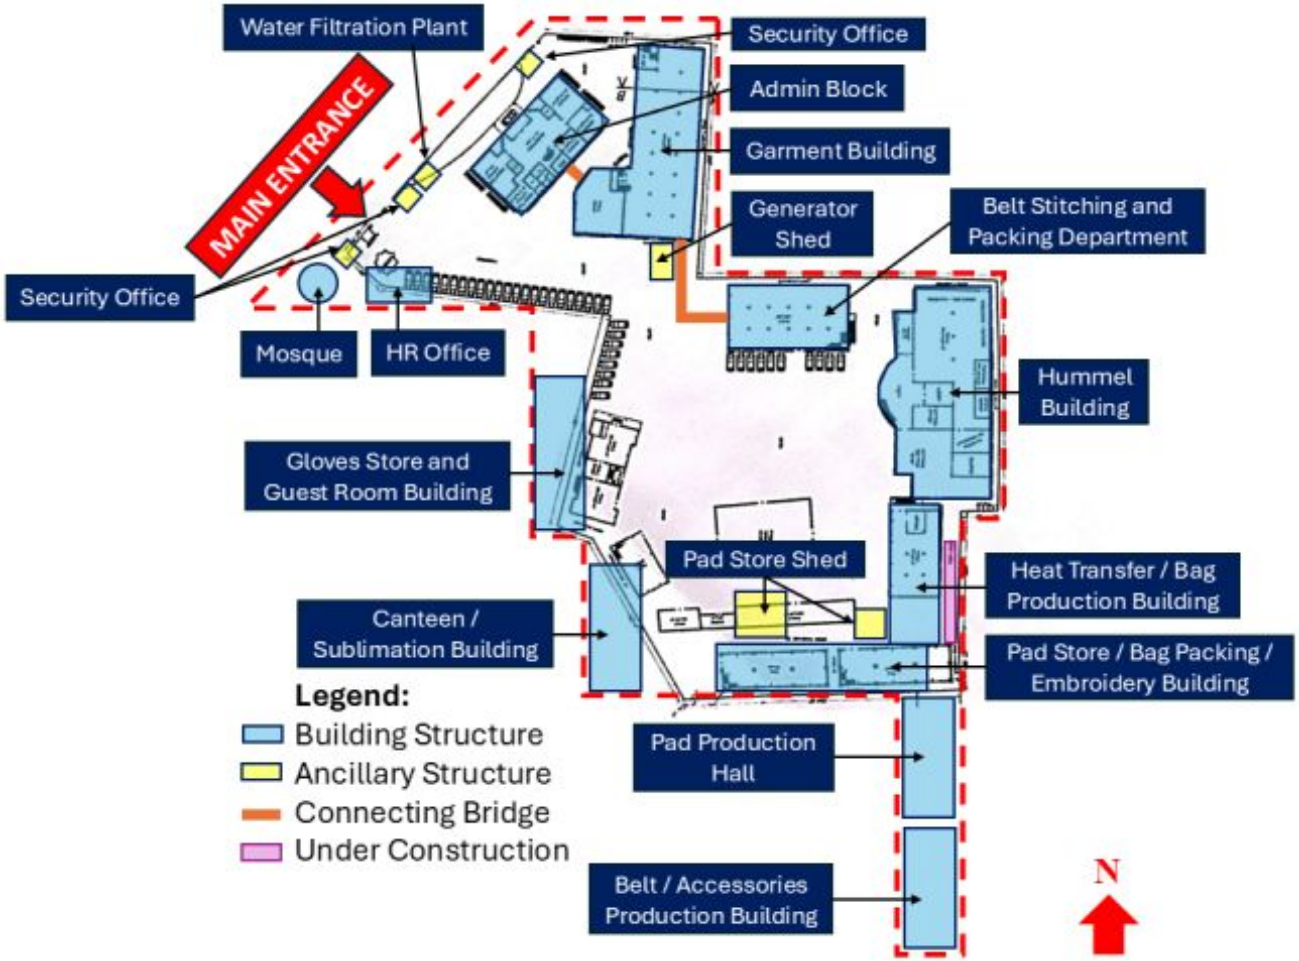


Figure 1.2. Site Layout Plan of the Factory Premises; Red Dashed Line Indicates Site Boundary and Highlighted Area Indicates Buildings Inspected



Figure 1.3. Admin Block - Front Elevation



Figure 1.4. Garment Building - Front Elevation



Figure 1.5. Belt Stitching and Packing Department - Front Elevation



Figure 1.6. Hummel Building - Front Elevation



Figure 1.7. Heat Transfer and Bag Production Building - Front Elevation



Figure 1.8. Pad Store, Bag Packing and Embroidery Building - Front Elevation



Figure 1.9. Canteen and Sublimation Building



Figure 1.10. Gloves Store and Guest Room Building



Figure 1.11. Pad Production Hall - Side Elevation



Figure 1.12. Belt, Accessories Production Building - Side Elevations



Figure 1.13. HR Office - Front Elevation



Figure 1.14. Mosque - Front Elevation



Figure 1.15. Security Office - Front Elevation



Figure 1.16. Security Office - Front Elevation



Figure 1.17. Pad Store Shed - Front Elevation



Figure 1.18. Water Filtration Plant - Front Elevation



Figure 1.19. Security Office - Front Elevation



Figure 1.20. Admin Block - Office at Ground Floor



Figure 1.21. Admin Block - Residency at First Floor



Figure 1.22. Admin Block - Solar Panels at Roof



Figure 1.23. Garment Building - Storage at Ground Floor



Figure 1.24. Garment Building - Stitching at First and Second Floor



Figure 1.25. Garment Building - Screen Printing Area at Third Floor



Figure 1.26. Garment Building - Storage and Solar Panels at Third Floor



Figure 1.27. Belt Stitching and Packing Department - Packing Area at Ground Floor



Figure 1.28. Belt Stitching and Packing Department - Garment Packing at First Floor



Figure 1.29. Belt Stitching and Packing Department - Belt Stitching at Second Floor



Figure 1.30. Hummel Building - Cutting at Ground Floor



Figure 1.31. Hummel Building - Packing at Ground Floor



Figure 1.32. Hummel Building - Stitching at First Floor



Figure 1.33. Hummel Building - Finishing and Packing at Second Floor



Figure 1.34. Heat Transfer and Bag Production Building - Heat Transfer Department at Ground Floor



Figure 1.35. Heat Transfer and Bag Production Building - Bag Stitching at First Floor



Figure 1.36. Heat Transfer and Bag Production Building - Solar Panels at Roof



Figure 1.37. Pad Store, Bag Packing and Embroidery Building - Pad Store at Ground Floor



Figure 1.38. Pad Store, Bag Packing and Embroidery Building - Embroidery at Ground Floor



Figure 1.39. Pad Store, Bag Packing and Embroidery Building - Screen Printing at First Floor



Figure 1.40. Canteen and Sublimation Building - Canteen at Ground Floor



Figure 1.41. Canteen and Sublimation Building - Sublimation at First Floor



Figure 1.42. Gloves Store and Guest Room Building - Storage at Ground Floor



Figure 1.43. Gloves Store and Guest Room Building - Guest Room at First Floor

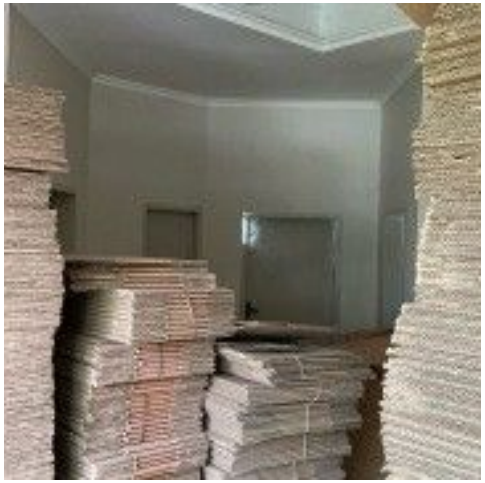


Figure 1.44. Gloves Store and Guest Room Building - Carton Storage at First Floor



Figure 1.45. Pad Production Hall - Pad Production at Ground Floor



Figure 1.46. Belt and Accessories Production Building - Belt Production at Ground Floor



Figure 1.47. Belt and Accessories Production Building - Gloves Stitching at First Floor



Figure 1.48. Belt and Accessories Production Building - Roof



Figure 1.49. HR Office - Offices at First and Second Floor



Figure 1.50. Security Office - Office at Ground Floor



Figure 1.51. Water Filtration Plant - Water Filtration at Ground Floor



Figure 1.52. Pad Store Shed - Storage at Ground Floor

2.1 Structural System

Building	Garment Building
Stability System	RC moment resisting frame and steel portal frame shed at roof level
Column Size (m)	0.44 x 0.44
Grid (m)	10.44 x 5.44 (Max.)
Primary Beam Size (m)	0.44 x 0.38 0.44 x 0.30
Secondary Beam Size (m)	0.44 x 0.38
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	3.7 (Typical) 4.3 (Ground Floor)


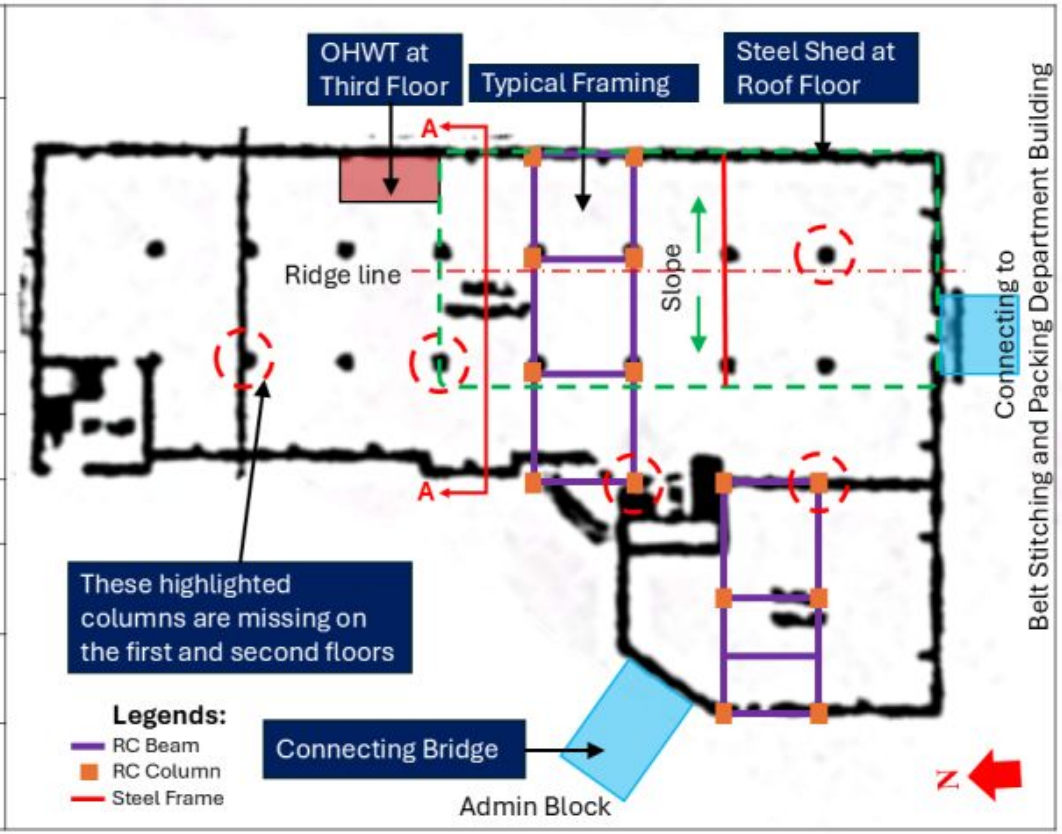


Figure 1.53. Typical Floor Framing Plan of Garment Building

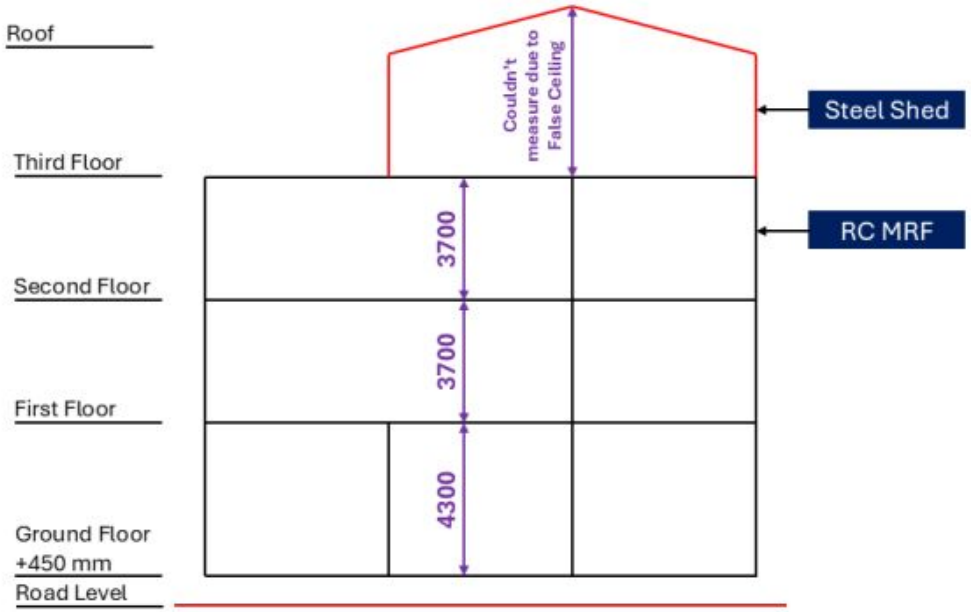

Structural System Notes

Column size includes the render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.54. Section A-A of Garment Building

Building	Belt Stitching and Packing Department Building
Stability System	RC moment resisting frame and steel portal frame shed at roof level
Column Size (m)	0.52 x 0.52
Grid (m)	6.82 x 8.92
Primary Beam Size (m)	0.5 x 0.62
Secondary Beam Size (m)	-
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	3.95 (First Floor) 4.0 (Ground Floor)


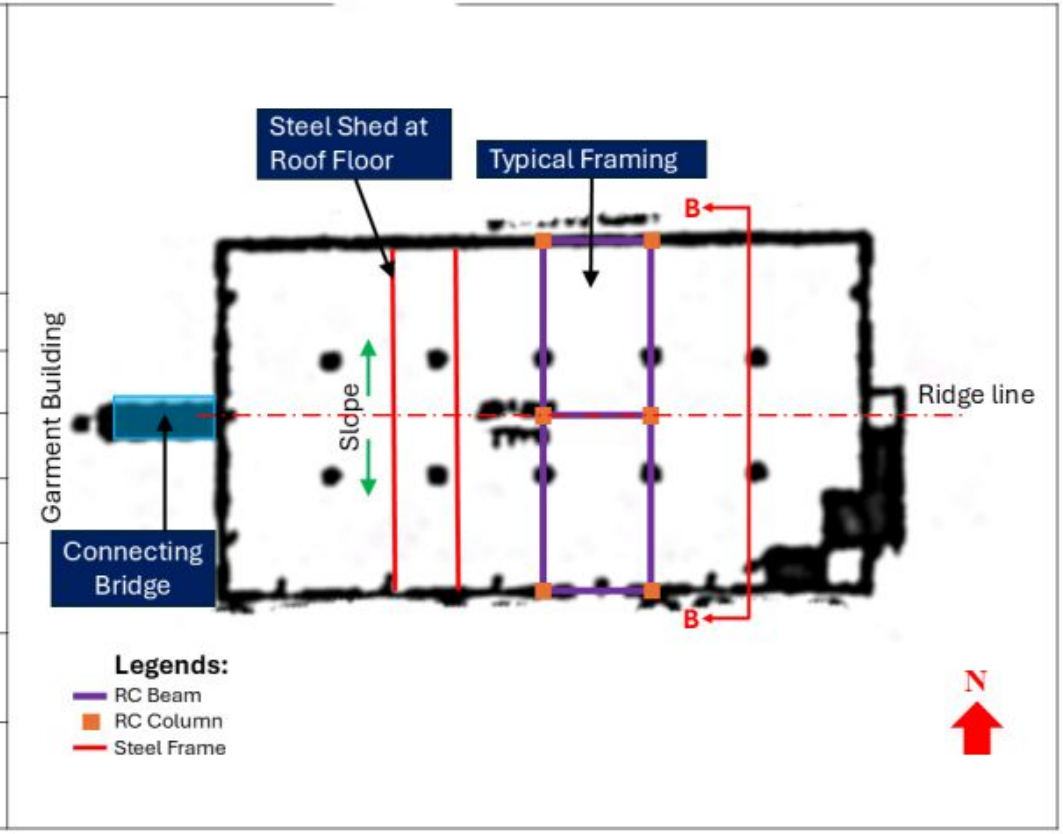


Figure 1.55. Typical Floor Framing Plan of Belt Stitching and Packing Department Building

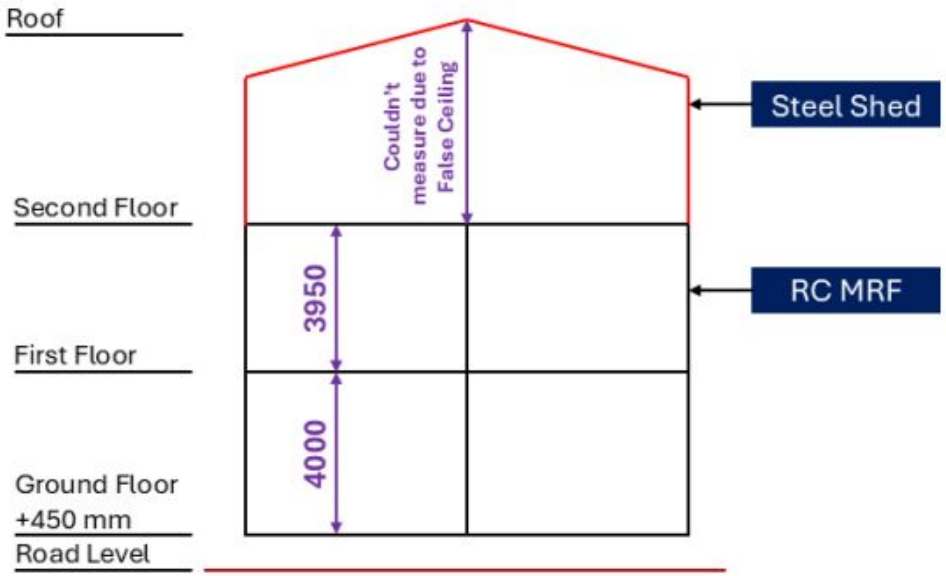

Structural System Notes

Column size includes the render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.56. Section B-B of Belt Stitching and Packing Department Building

Building	Hummel Building
Stability System	RC moment resisting frame and steel portal frame shed at roof level
Column Size (m)	0.42 x 0.42
Grid (m)	5.92 x 9.22
Primary Beam Size (m)	0.42 x 0.46
Secondary Beam Size (m)	-
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	3.6 (First Floor) 3.5 (Ground Floor)


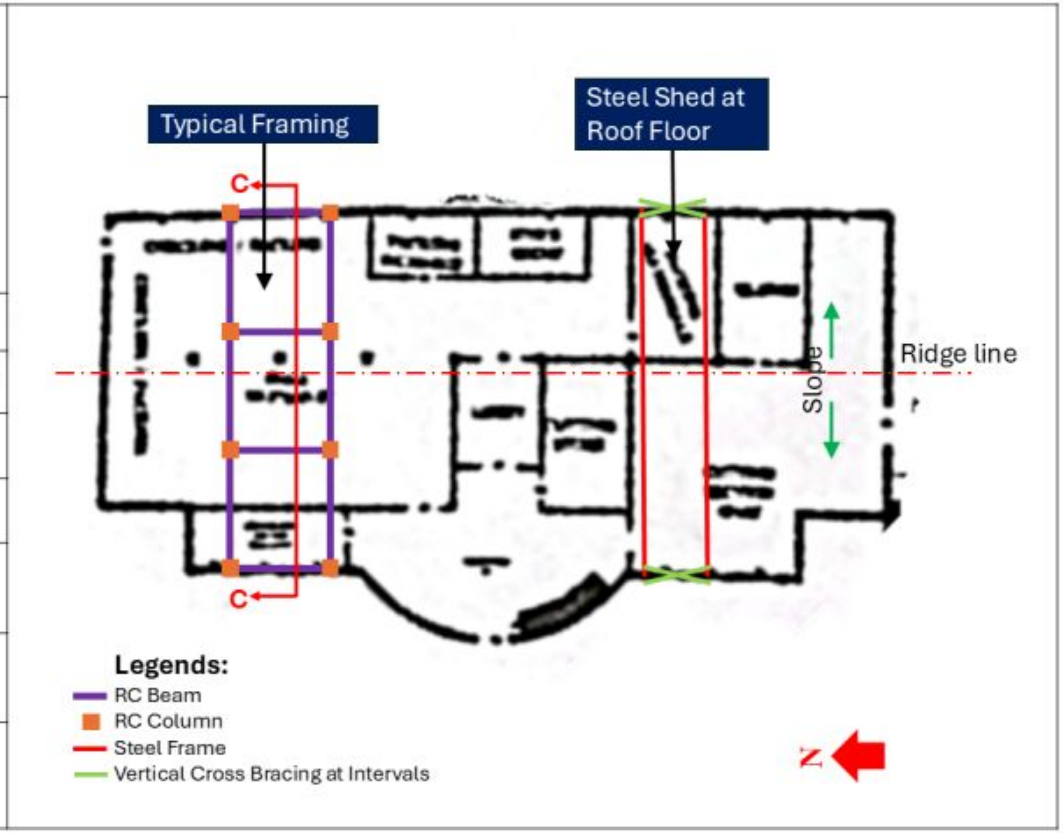


Figure 1.57. Typical Floor Framing Plan of Hummel Building

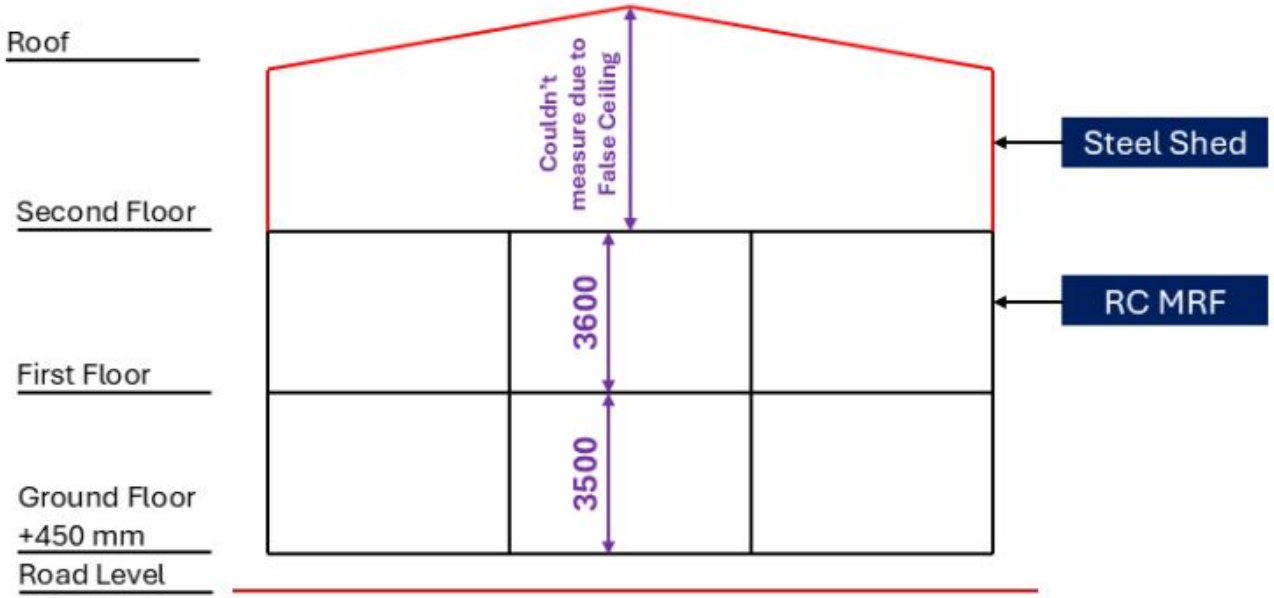

Structural System Notes

Column size includes the render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.58. Section C-C of Hummel Building

Building	Heat Transfer / Bag Production Building
Stability System	RC moment resisting frame
Column Size (m)	0.4 x 0.4
Grid (m)	5.6 x 6.1
Primary Beam Size (m)	0.40 x 0.33
Secondary Beam Size (m)	-
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	3.5 (Typical)


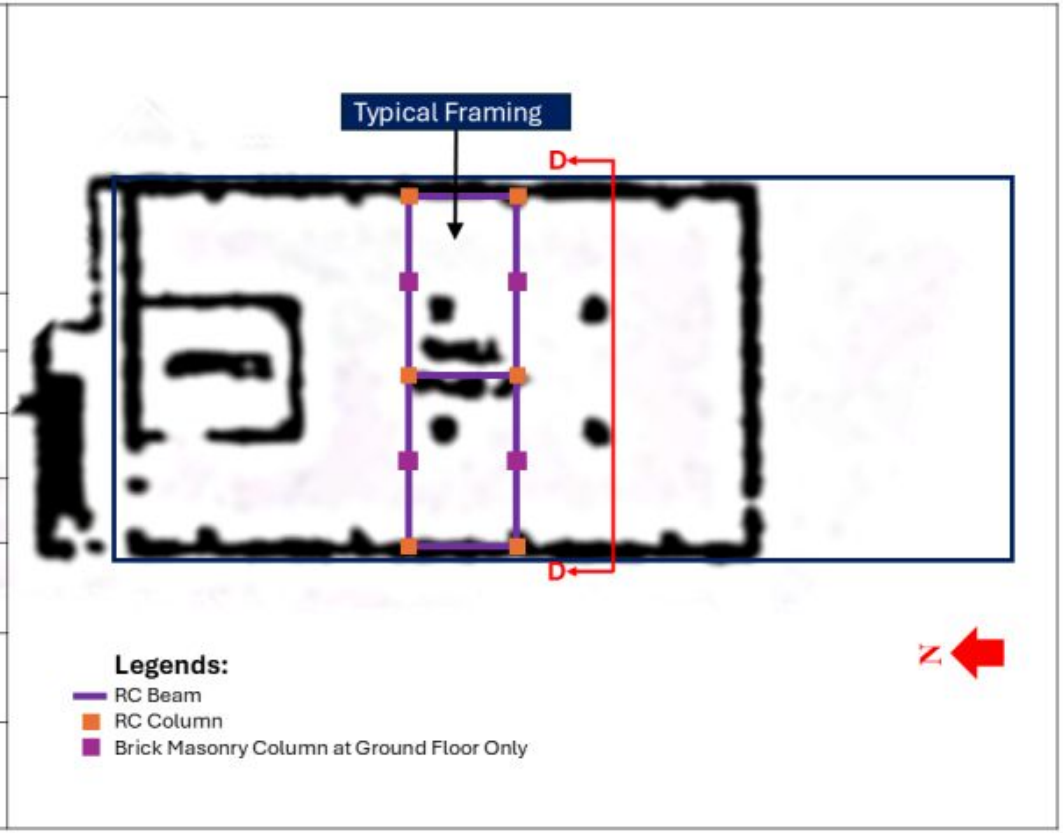


Figure 1.59. Typical Floor Framing Plan of Heat Transfer and Bag Production Building

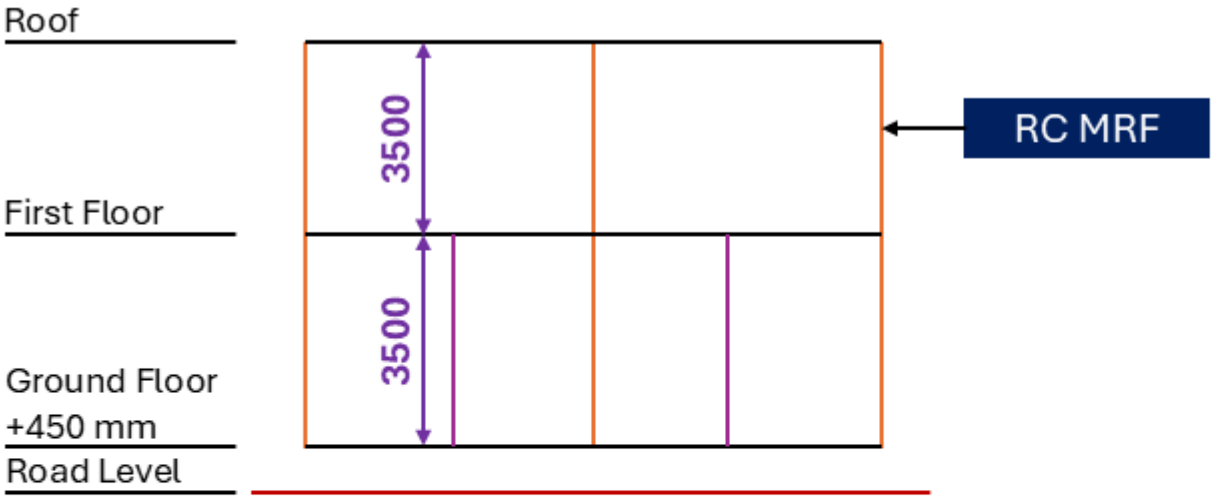

Structural System Notes

Column size includes the render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.60. Section D-D of Heat Transfer and Bag Production Building

Building	Pad Store / Bag Packing / Embroidery Building
Stability System	RC moment resisting frame
Column Size (m)	0.4 x 0.4
Grid (m)	5.6 x 6.1 (Max)
Primary Beam Size (m)	0.40 x 0.33
Secondary Beam Size (m)	-
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	3.5 (Typical)


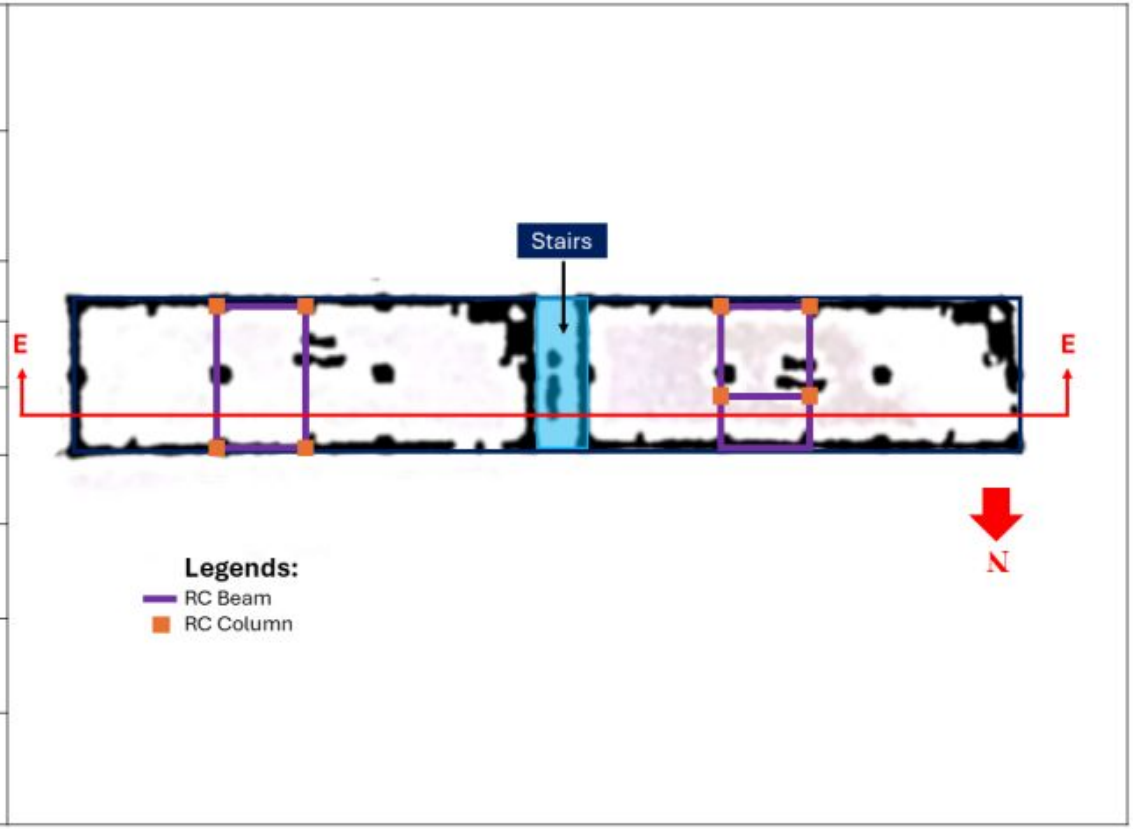


Figure 1.61. Typical Floor Framing Plan of Pad Store, Bag Packing and Embroidery Building

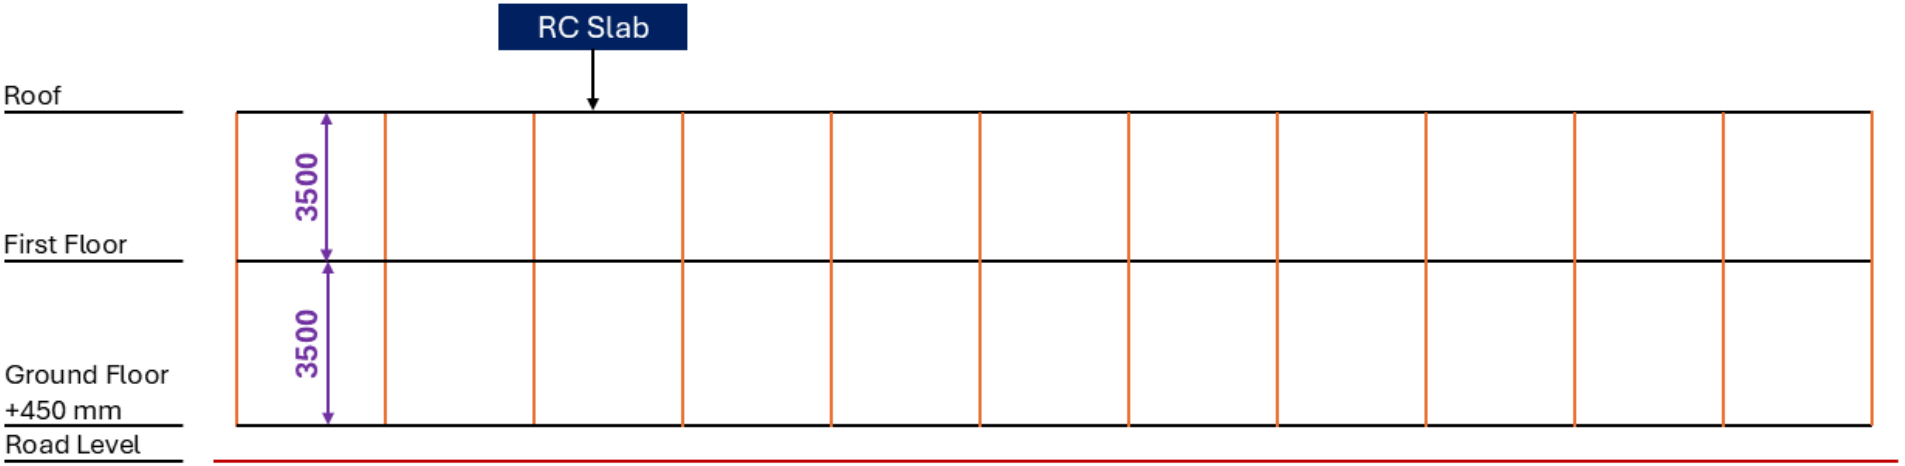

Structural System Notes

Column size includes the render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.62. Section E-E of Pad Store, Bag Packing and Embroidery Building

Building	Belt / Accessories Production Building
Stability System	RC moment resisting frame
Column Size (m)	0.4 x 0.4
Grid (m)	5.9 x 5.4
Primary Beam Size (m)	0.4 x 0.32
Secondary Beam Size (m)	-
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	3.3 (First Floor) 3.6 (Ground Floor)


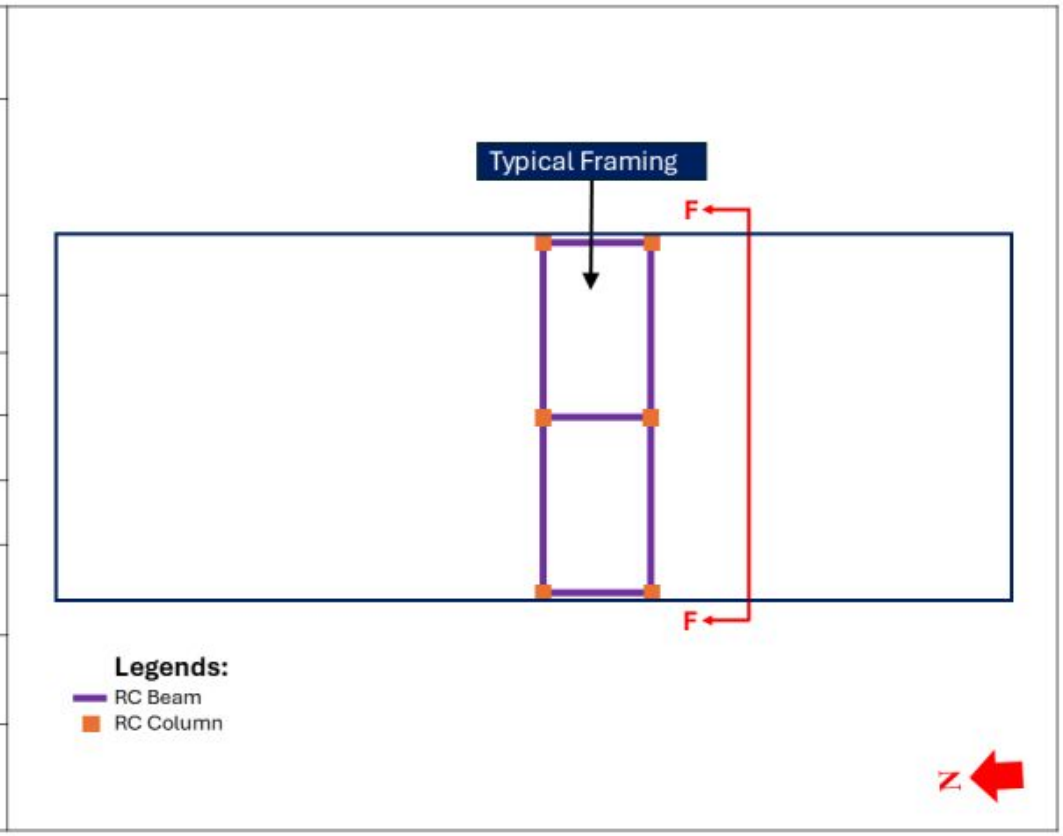


Figure 1.63. Typical Floor Framing Plan of Belt and Accessories Production Building

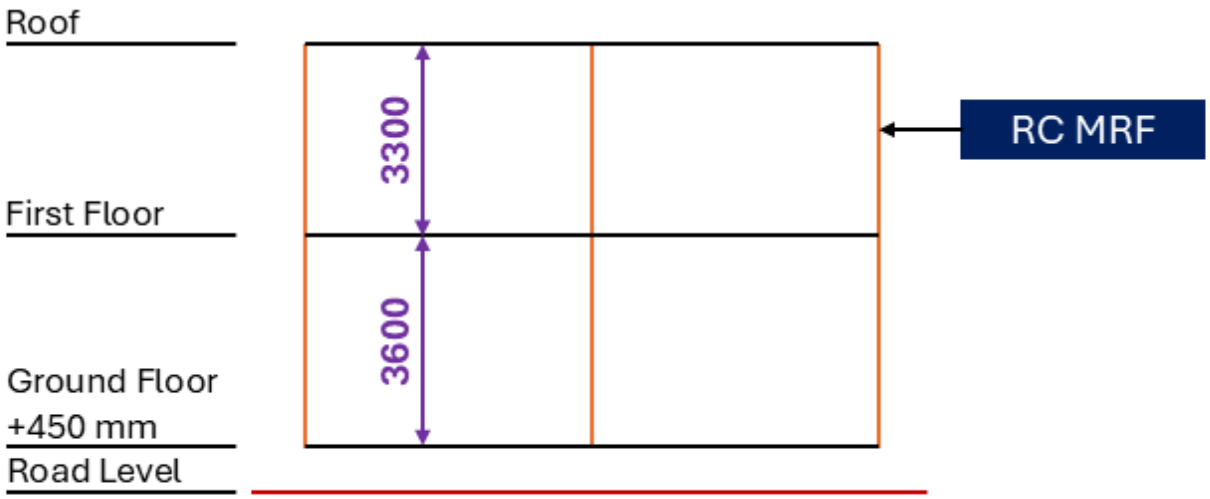

Structural System Notes

Column size includes the render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.64. Section F-F of Belt and Accessories Production Building

3. Documentation

This table outlines the documentation details provided by the factory.

Table 2 - Documentation

Building	Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plans	Stability certificate	Inspection reports	Materials testing
Admin Block	Yes (Incomplete)	Yes (Incomplete)	No	No	No	No	No	No	No
Garment Building			No	No	No	No	No	No	No
Belt Stitching and Packing Department Building			No	No	No	No	No	No	No
Hummel Building			No	No	No	No	No	No	No
Heat Transfer / Bag Production Building			No	No	No	No	No	No	No
Pad Store / Bag Packing / Embroidery Building			No	No	No	No	No	No	No
Canteen / Sublimation			No	No	No	No	No	No	No

Building									
Gloves Store and Guest Room Building			No	No	No	No	No	No	No
Pad Production Hall			No	No	No	No	No	No	No
Belt / Accessories Production Building			No	No	No	No	No	No	No
HR Office			No	No	No	No	No	No	No
Mosque			No	No	No	No	No	No	No
Security Office			No	No	No	No	No	No	No
Water Filtration Plant			No	No	No	No	No	No	No
Pad Store Shed			No	No	No	No	No	No	No
Generator Shed			No	No	No	No	No	No	No

4. Structural Safety Measures

During our structural site inspection of First American Corporation (Pvt.) Ltd., a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within First American Corporation (Pvt.) Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3 Summary of issues by building:

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Admin Block	-	-	-	-	Corrosion of Reinforcement Health and Safety – Lack of Edge Protection	Documentation Unavailable Non-engineered structure Lack of Safe Load Plan
Garment Building	-	-	Wall – RC Wall of OHWT	-	-	Documentation Unavailable Lack of Safe Load Plan

Belt Stitching and Packing Department Building	-	Lack of Local Stability	-	-	-	Documentation Unavailable Non-engineered structure Lack of Safe Load Plan
Hummel Building	-	-	-	-	-	Documentation Unavailable Non-engineered structure Lack of Safe Load Plan
Heat Transfer / Bag Production Building	-	-	-	-	Health and Safety – Lack of Edge Protection	Documentation Unavailable Lack of Safe Load Plan
Pad Store / Bag Packing / Embroidery Building	-	-	-	-	Corrosion of Reinforcement Health and Safety – Lack of Edge Protection	Documentation Unavailable Lack of Safe Load Plan
Canteen / Sublimation Building	-	-	-	-	Corrosion of Reinforcement	Documentation Unavailable Non-engineered structure Lack of Safe Load Plan

Gloves Store and Guest Room Building	-	-	-	-	-	Documentation Unavailable Lack of Safe Load Plan
Pad Production Hall	-	-	-	-	-	Documentation Unavailable
Belt / Accessories Production Building	-	-	-	-	Corrosion of Reinforcement Health and Safety – Lack of Edge Protection	Documentation Unavailable Lack of Safe Load Plan
HR Office	-	-	-	-	-	Documentation Unavailable
Mosque	-	-	-	-	-	Documentation Unavailable
Security Office	-	-	-	-	-	Documentation Unavailable
Water Filtration Plant	-	-	-	-	-	Documentation Unavailable
Pad Store Shed	-	-	-	-	-	Documentation Unavailable
Generator Shed	-	-	-	-	-	Documentation Unavailable

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-065459

Timeline	Remediation Plan
Medium Term CAP-0077407	Factories should begin remediation of CAP items such as surface cracks or non-structural repairs using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Cracking

6.1 Walls

This issue refers to the third floor of the Garment Building, where the Overhead Water Tank (OHWT) is located. Cracks have been observed in the RC retaining walls of the tank and the supporting beams and columns. The reinforcement is severely corroded and exposed due to concrete spalling at several locations. This condition may reduce the structural capacity of the tank and its supporting elements. The deterioration may also be associated with moisture ingress from the tank, which can accelerate corrosion in the supporting structural components beneath the floor. F-202603-064366

Timeline	Remediation Plan
Medium Term CAP-0075842	Identify the cause of the damage / source of water ingress and propose measures to prevent further water damage .
Medium Term CAP-0075843	Inspect damage to the RC walls, beams and columns and propose repairs to structure.
Medium Term CAP-0075844	Submit report capturing above to Pakistan Accord for review.
Longer Term CAP-0075845	Implement the required remedial works.
Longer Term CAP-0075846	Continue to monitor for future signs of water ingress/damage.

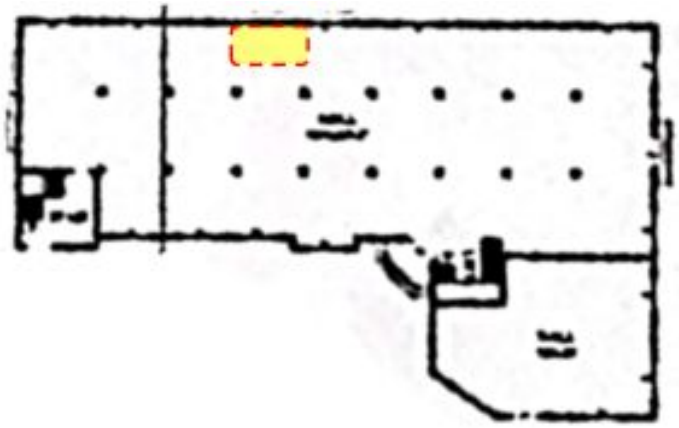


Figure 2.1 - Location of OHWT at the Third Floor of Garment Building



Figure 2.3 - Cracking and Exposed Corroded Reinforcement in the OHWT Walls



Figure 2.2 - Damaged RC Column and Beam Supporting OHWT



Figure 2.4 - Cracking in the Wall of OHWT

7. Structural System

7.1 Lack of local stability

This issue refers to the Second Floor of the Belt Stitching and Packing Department Building. The vertical cross bracing appears to be missing due to the presence of a door opening, which may compromise the lateral load resistance and overall structural stability of the steel shed. As the structural design documentation for the shed is not available, the adequacy of the existing lateral stability system cannot be verified. F-202603-064367

Timeline	Remediation Plan
Medium Term CAP-0075849	Building structural engineer to review the as-built design for code compliance (vertical and lateral loads) and confirm if it is adequate.
Medium Term CAP-0075850	Propose strengthening works as required and submit to Pakistan Accord for review.
Longer Term CAP-0075851	Implement strengthening works as required.

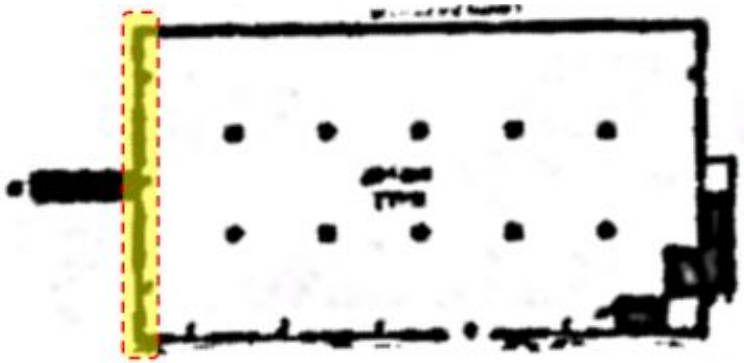


Figure 2.5 - Location of Missing Bracing at the Second Floor of Belt Stitching and Packing Department Building

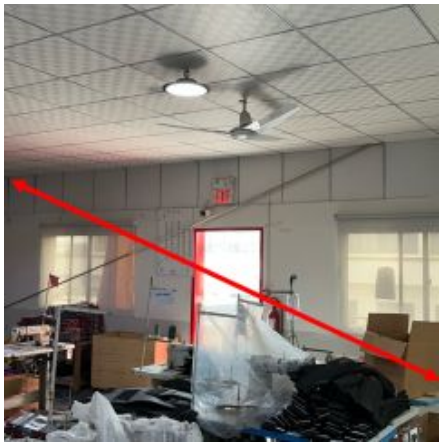


Figure 2.6 - Missing Bracing at the Second Floor of Belt Stitching and Packing Department Building

8. Other Damage/Defects

8.1 Corrosion of reinforcement

The dowel reinforcement of the column at the roof level of the Admin Block has been significantly affected by atmospheric corrosion. This condition may compromise the structural integrity over time. F-202603-064368

Timeline	Remediation Plan
Medium Term CAP-0075854	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0075855	Implement the required remedial work.



Figure 2.7 - Location of Exposed Column Dowel Reinforcement at the Roof of Admin Block



Figure 2.8 - Exposed Column Dowel Reinforcement at the Roof of Admin Block

8.2 Corrosion of reinforcement

The dowel reinforcement of the column at the roof level of the Pad Store / Bag Packing / Embroidery Building has been significantly affected by atmospheric corrosion. This condition may compromise the structural integrity over time. F-202603-064374

Timeline	Remediation Plan
Medium Term CAP-0075866	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0075867	Implement the required remedial work.

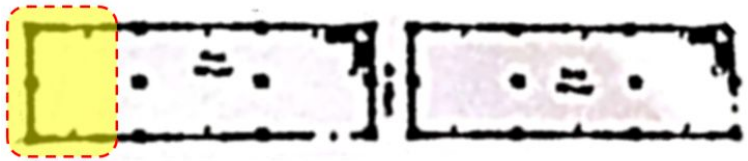


Figure 2.9 - Location of Exposed Column Dowel Reinforcement at the Roof of Pad Store, Bag Packing and Embroidery Building



Figure 2.10 - Exposed Column Dowel Reinforcement at the Roof of Pad Store, Bag Packing and Embroidery Building

8.3 Corrosion of reinforcement

The dowel reinforcement of the column at the roof level of the Canteen / Sublimation Building has been significantly affected by atmospheric corrosion. This condition may compromise the structural integrity over time. F-202603-064376

Timeline	Remediation Plan
Medium Term CAP-0075868	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0075869	Implement the required remedial work.



Figure 2.11 - Location of Exposed Column Dowel Reinforcement at the Roof of Canteen and Sublimation Building



Figure 2.12 - Exposed Column Dowel Reinforcement at the Roof of Canteen and Sublimation Building

8.4 Corrosion of reinforcement

The dowel reinforcement of the column at the roof level of the Belt / Accessories Production Building has been significantly affected by atmospheric corrosion. This condition may compromise the structural integrity over time. F-202603-064381

Timeline	Remediation Plan
Medium Term CAP-0075871	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0075872	Implement the required remedial work.



Figure 2.13 - Location of Exposed Column Dowel Reinforcement at the Roof of Canteen and Sublimation Building



Figure 2.14 - Exposed Column Dowel Reinforcement at the Roof of Belt and Accessories Production Building

8.5 Health and Safety

It concerns with inadequate edge protection at the roof of the Admin Block which present a risk of potential injury resulting from slip, trip or fall from roof during the access and maintenance of services – Health & Safety concern. F-202603-064369

Timeline	Remediation Plan
Immediate CAP-0075878	Provide adequate edge protection on the roof, and on any other part of the factory with the same issue.

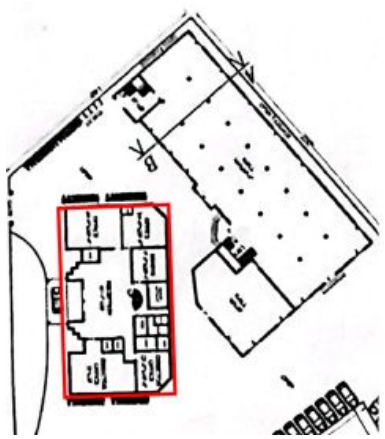


Figure 2.15 - Red Line Indicated Missing Edge Protection Boundary at the Roof of Admin Block



Figure 2.16 - Missing Edge Protection at the Roof of Admin Block

8.6 Health and Safety

It concerns with inadequate edge protection at the roof of the Heat Transfer / Bag Production Building which present a risk of potential injury resulting from slip, trip or fall from roof during the access and maintenance of services – Health & Safety concern. F-202603-064375

Timeline	Remediation Plan
Immediate CAP-0075879	Provide adequate edge protection on the roof, and on any other part of the factory with the same issue.

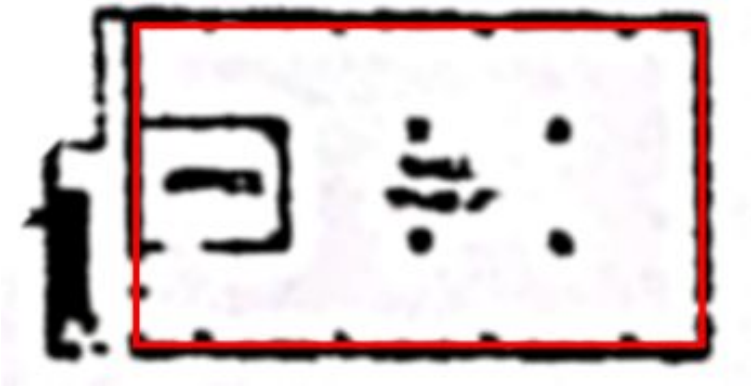


Figure 2.17 - Red Line Indicated Missing Edge Protection Boundary at the Roof of Heat Transfer and Bag Production Building



Figure 2.18 - Missing Edge Protection at the Roof of Heat Transfer and Bag Production Building

8.7 Health and Safety

It concerns with inadequate edge protection at the roof of Pad Store / Bag Packing / Embroidery Building which present a risk of potential injury resulting from slip, trip or fall from roof during the access and maintenance of services – Health & Safety concern. F-202603-064377

Timeline	Remediation Plan
Immediate CAP-0075880	Provide adequate edge protection on the roof, and on any other part of the factory with the same issue.



Figure 2.19 - Red Line Indicated Missing Edge Protection Boundary at the Roof of Pad Store, Bag Packing and Embroidery Building



Figure 2.20 - Missing Edge Protection at the Roof of Pad Store, Bag Packing and Embroidery Building

8.8 Health and Safety

It concerns with inadequate edge protection at the roof of Belt / Accessories Production Building which present a risk of potential injury resulting from slip, trip or fall from roof during the access and maintenance of services – Health & Safety concern. F-202603-064382

Timeline	Remediation Plan
Immediate CAP-0075882	Provide adequate edge protection on the roof, and on any other part of the factory with the same issue.



Figure 2.21 - Red Line Indicated Missing Edge Protection Boundary at the Roof of Belt and Accessories Production Building



Figure 2.22 - Missing Edge Protection at the Roof of Belt and Accessories Production Building

9. Structural Documentation

9.1 Documentation unavailable

A complete site layout plan, approved site layout plan, structural drawings and as-built architectural drawings were unavailable. F-202603-064370

Timeline	Remediation Plan
Longer Term CAP-0075887	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as-built documentation.

9.2 Non-engineered structure

The steel staircase is used as an emergency exit from the Admin Block at the ground floor near the bridge connection to the Garment Building has a supporting steel column consisting of an undersized angle section that has completely bent/buckled. This may be due to vehicle impact or loading from the staircase. F-202603-064285

Timeline	Remediation Plan
Immediate CAP-0075594	Provide adequate temporary supports using properly sized structural members and appropriate connections to ensure safe evacuation.
Medium Term CAP-0075836	Building structural engineer to review the as-built design for code compliance (vertical and lateral loads) and confirm if it is adequate
Medium Term CAP-0075837	Propose strengthening works as required and submit to Pakistan Accord for review.
Longer Term CAP-0075838	Implement strengthening works as required.



Figure 2.23 - Location of Steel Staircase in the Admin Block Ground Floor



Figure 2.24 - Bent or Buckled Steel Column of Steel Staircase at the Ground Floor of Admin Block

9.3 Non-engineered structure

This issue refers to the steel stairs in the Belt Stitching and Packing Department Building. The stairs have undersized structural elements and lack proper bracing, making them highly vulnerable. F-202603-064372

Timeline	Remediation Plan
Medium Term CAP-0075888	Building structural engineer to review the as-built design for code compliance (vertical and lateral loads) and confirm if it is adequate.
Medium Term CAP-0075889	Propose strengthening works as required and submit to Pakistan Accord for review.
Longer Term CAP-0075890	Implement strengthening works as required.



Figure 2.25 - Location of Steel Staircase in the Belt Stitching and Packing Department Building



Figure 2.26 - Structural Stability and Strength Issue in the Steel Staircase of Belt Stitching and Packing Department Building

9.4 Non-engineered structure

This issue refers to the steel stairs in the Hummel Building. The stairs have undersized structural elements and lack proper bracing, making them highly vulnerable. F-202603-064373

Timeline	Remediation Plan
Medium Term CAP-0075891	Building structural engineer to review the as-built design for code compliance (vertical and lateral loads) and confirm if it is adequate.
Medium Term CAP-0075892	Propose strengthening works as required and submit to Pakistan Accord for review.
Longer Term CAP-0075893	Implement strengthening works as required.

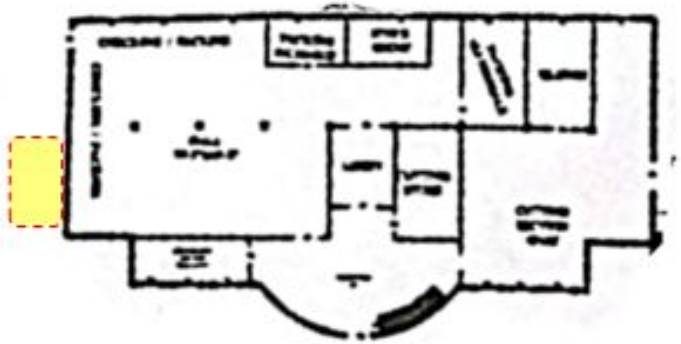


Figure 2.27 - Location of Steel Staircase in the Hummel Building



Figure 2.28 - Structural Stability and Strength Issue in the Steel Staircase of Hummel Building

9.5 Non-engineered structure

This issue refers to the steel stairs in the Canteen / Sublimation Building. The stairs have undersized structural elements and lack proper bracing, making them highly vulnerable. F-202603-064378

Timeline	Remediation Plan
Medium Term CAP-0075894	Building structural engineer to review the as-built design for code compliance (vertical and lateral loads) and confirm if it is adequate.
Medium Term CAP-0075895	Propose strengthening works as required and submit to Pakistan Accord for review.
Longer Term CAP-0075896	Implement strengthening works as required.



Figure 2.29 - Location of Steel Staircase in the Canteen and Sublimation Building



Figure 2.30 - Structural Stability and Strength Issue in the Steel Staircase of Canteen and Sublimation Building

9.6 Lack of safe load plans

No safe load plans were posted in the Admin Block, Garment Building, Belt Stitching and Packing Department Building, Hummel Building, Heat Transfer / Bag Production Building, Pad Store / Bag Packing / Embroidery Building, Canteen / Sublimation Building, Gloves Store and Guest Room Building and Belt / Accessories Production Building. F-202603-064371

Timeline	Remediation Plan
Longer Term CAP-0075884	Building structural engineer to review design documentation to confirm load capacity of the structure.
Longer Term CAP-0075885	Develop safe load plans and submit to Pakistan Accord for review.
Longer Term CAP-0075886	Factory to post safe load plans on each floor.

10. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.