Issue	1
Factory ID	25130
Date of Issue	27-May-2026

Interloop Ltd. (HD05) co-located w/Interloop Ltd. Apparel Park

Bypass Khurrianwala Jaranwala Road, Khurrianwala, Tehsil Jaranwala, District Faisalabad
38000 Faisalabad
Punjab Pakistan

Latitude: [31.452469], longitude: [73.281943]
Date of inspection: 06-Apr-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Abdul Hayee**
Reviewed by	**Naveed Anjum**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 06-04-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 10
3. Building Description 17
   - 3.1 Building Means of Egress Details 22
   - 3.2 Building Use 42
4. Documentation 47
5. Fire Safety Measures 49
6. Remediation Support 50
   - 6.1 Engineering Support 50
7. Means of Escape 51
   - 7.1 Escape doors 51
   - 7.2 Exit access 54
   - 7.3 Travel distance 56
   - 7.4 Number of exits 58
   - 7.5 Protection of stairs 60
   - 7.6 Exit discharge 62
   - 7.7 Exit signage 64
8. Fire Rated Construction 66
   - 8.1 Structural fire rating 66
   - 8.2 Separation of high-risk areas 68
   - 8.3 Separation of shafts 72
   - 8.4 Floor openings 74

8.5 Atrium 76
8.6 Separation of occupancies 78
8.7 Separation of occupancies 80
8.8 Separation of occupancies 82
8.9 Storage 84
9. Fire Suppression 87
9.1 Standpipe system 87
9.2 Fire pumps 89
9.3 Water supply 91
10. Hazardous Materials 92
10.1 Chemicals storage 92
11. Fire Safety Management 94
11.1 Fire drills 94
11.2 Records of system testing 95
11.3 Records of systems maintenance 96
11.4 Emergency Action Plan 97
12. Assessment Limitations and Assumptions 98

1. Executive Summary

On 06-Apr-2026, Abdul Hayee and Muhammad Naseer on behalf of the Pakistan Accord carried out an initial fire inspection for Interloop Ltd. (HD05) co-located w/Interloop Ltd. Apparel Park, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Naveed-Ur-Rehman (DGM EHS), Mr. Muhammad Ghayas (Manager EHS), Mr. Muhammad Abbas (Sr. Manager Electrical), Mr. Zaheer Ahmad (Civil Engineer) along with other staff members of the factory. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Accord were also present and the team was led by Mr. Bilal Butt Pakistan Accord.

The factory comprises of 26 buildings and 33 ancillary structures details of which are provided below:

Buildings:

Hosiery Division 5:

1. Office Block Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 1,560 sq. m. Building has 2 staircases out of which 1 discharge internally. The building is used for unoccupied (roof); offices and meeting room (first floor); offices, meeting room and kitchen (ground floor). The building was constructed in 2021.
2. Canteen Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 460 sq. m. Building has 3 staircases, all discharge externally. The building is used for unoccupied (roof); dining area (first floor); dining (differently abled), prayer area-male, prayer area- female and kitchen (ground floor). The building was constructed in 2021.
3. Processing lab Building is a ground only Pre-Engineered Building (PEB) Shed, with a covered area (footprint) of 2,050 sq. m. The building is used for unoccupied (roof); accessory stores, sampling area, waste management area, processing area, labs, offices and chemical storage (ground floor). The building was constructed in 2021.
4. Value stream unit 2 Building – HD 5 is a ground only Pre-Engineered Building (PEB) Shed, with a covered area (footprint) of 9,150 sq. m. The building is used for unoccupied (roof); electronic lab, control room, AHU, LT room, store, offices, knitting, finishing, metal free zone finish good store, accessory store (ground floor). The building was constructed in 2021.
5. Value stream unit 1 Building – HD 5 is a ground only Pre-Engineered Building (PEB) Shed, with a covered area (footprint) of 9,150 sq. m. The building is used for unoccupied (roof); electronic lab, red tag 1 area, control room, AHU, LT room, store, offices, knitting, finishing, metal free zone finish good store, spare store, red tag 2 area, charging point , chemical store (ground floor). The building was constructed in 2021.

Hosiery Division 6:

1. Value stream unit 1 Building – HD 6 is a ground only Pre-Engineered Building (PEB) Shed, with a covered area (footprint) of 10,860 sq. m. The building is used for unoccupied (roof); AHU, LT room, store, finishing, offices, electronic lab, finish good store, office, prayer area, sampling and accessory store (ground floor). The building was constructed in 2025.
2. Value stream unit 2 Building – HD 6 is a ground only Pre-Engineered Building (PEB) Shed, with a covered area (footprint) of 10,860 sq. m. The building is used for unoccupied (roof); AHU, LT room, store, finishing, offices, electronic lab, finish good store, office, prayer area, sampling, dining, kitchen and store (ground floor). The building was constructed in 2025.

Yarn Dying Area:

1. Yarn Dying Building is a ground only G+M RC moment resisting frame building, with a covered area (footprint) of 6,030 sq. m. Building has 5 staircases out of which 4 serve mezzanine. The building is used for unoccupied (roof); lab, office and under construction area dying machines (mezzanine); yarn dying, store, AHU, prayer area, LT room and RO Plant (ground floor). The building was constructed in 2025.
2. Yarn Dying- Chemical Store Building is a ground only RC moment resisting frame building, with a covered area (footprint) of 590 sq. m. The building is used for unoccupied (roof); chemical store and workshop (ground floor). The building was constructed in 2025.

Apparel Plant 2:

1. Garments Block Building is a 3 storey G+2 RC moment resisting frame building, with a covered area (footprint) of 27,700 sq. m and with the height of 12.8m measured from the fire department vehicle access to the topmost occupied floor. Building has 13 staircases out of which 3 discharge internally. The building is used for unoccupied (roof); stitching, dining, kitchen, mosques, storage & offices (second floor); stitching, dining, kitchen, mosques, storage & offices (first floor); cutting, store, embroidery and offices (ground floor). The building was constructed in 2023.
2. Dye House Building is a ground only G+M Pre-Engineered Building (PEB) Shed, with a covered area (footprint) of 35,000 sq. m. Building has 4 staircases, all serve mezzanine out of which 2 discharge externally. The building is used for unoccupied (roof); lab and offices (mezzanine); dying, finishing, washing, chemical, dispensing and storage, LT room (1), LT room (2) and Thermal oil heaters (ground floor). The building was constructed in 2023.
3. Utility Area Apparel Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 3,020 sq. m. Building has 2 staircases both discharge externally. The building is used for unoccupied (roof); offices (first floor); chiller & compressor area, electric panels, RO Plant, electrical workshop, mechanical workshop 1, mechanical workshop 2, waste store, leftover store, HVAC workshop (ground floor). The building was constructed in 2023.
4. Marketing Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 3,560 sq. m. Building has 3 staircases all discharge externally. The building is used for unoccupied (roof); sampling, embroidery and offices (first floor); under-construction (ground floor). The building was constructed in 2025.

Common area:

1. Technical Training School Building is a 4 storey G+3 RC moment resisting frame building, with a covered area (footprint) of 1,180 sq. m and with the height of 16.1m measured from the fire department vehicle access to the topmost occupied floor. Building has 3 staircases out of which 1 discharge internally. The building is used for unoccupied (roof); under construction (third floor); training halls, dining area, rest area, offices and storage (second floor); training halls, dining area, rest area, offices and storage (first floor);Training halls, lockers, rest area, offices, LT room and storage (ground floor). The building was constructed in 2021.
2. Workshop Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 670 sq. m. Building has 2 staircases all discharge externally. The building is used for unoccupied (roof); offices (first floor); workshop 1, workshop 2, store, workshop 3 (ground floor). The building was constructed in 2021.
3. Main Gate Office Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 1,590 sq. m. Building has 2 staircases all discharge externally. The building is used for unoccupied (roof); offices and under construction area (first floor); control room, HR & requirement Offices, time office, security offices, driver sitting , rest area and TUC shop (ground floor). The building was constructed in 2021.

Club & Hostel area:

1. Central Block 1 & Central Block 2 Buildings are typical 3 storey G+2 RC moment resisting frame buildings, with a covered area (footprint) of 1,045 sq. m and with the height of 8m measured from the fire department vehicle access to the topmost occupied floor. Building has 3 staircases out of which one discharge internally. The building is used for solar (roof); dormitories (second & first floor); dormitories, kitchen and dining (ground floor). The building was constructed in 2025.
2. Outer block 1, Outer block 2, Outer block 3, Outer block 4 & Outer block 5 Buildings are typical 3 storey G+2 RC moment resisting frame buildings, with a covered area (footprint) of 1,045 sq. m and with the height of 8m measured from the fire department vehicle access to the topmost occupied floor. Building has 3 staircases all discharge externally. The building is used for solar (roof); dormitories (second, first and ground floor). The building was constructed in 2025.

3. Executive Hostel (Male) & Executive Hostel (Female) Buildings are typical 3 storey G+2 RC moment resisting frame buildings, with a covered area (footprint) of 1,350 sq. m and with the height of 8m measured from the fire department vehicle access to the topmost occupied floor. Building has 4 staircases out of which 2 discharge internally. The building is used for unoccupied (roof); dormitories (second, first and ground floor). The building was constructed in 2025.
4. Club Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 370 sq. m. Building has 3 staircases out of which 1 discharge internally. The building is used for unoccupied (roof); gym and rest room (first floor); dining and sitting (ground floor). The building was constructed in 2025.

Ancillaries structures:

Hosiery Division 5:

1. Utility 1 is a ground only Pre-Engineered Building (PEB) Shed. The building is used for unoccupied (roof); chillers, compressors and workshops (ground floor). The building was constructed in 2021.
2. Utility 2 is a ground only Pre-Engineered Building (PEB) Shed. The building is used for unoccupied (roof); RO plant and workshop (ground floor). The building was constructed in 2021.
3. Engineering offices is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); offices (ground floor). The building was constructed in 2021.
4. Storage is a ground only having load bearing brick masonry wall supporting precast double tee slab.. The building is used for unoccupied (roof); storage (ground floor). The building was constructed in 2021.
5. Carpenter & Fire boost workshop is a ground having load bearing brick masonry wall supporting precast girders and slab panels. The building is used for unoccupied (roof); workshop and fire equipment store (ground floor). The building was constructed in 2021.

Hosiery Division 6:

1. Time office is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); offices (ground floor). The building was constructed in 2025.

Apparel Plant 2:

1. Wastewater treatment plant is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); MBR, Lab, electric panels and blower area (ground floor). The building was constructed in 2023.
2. Chemical store apparel is a ground only Pre-Engineered Building (PEB) Shed. The building is used for unoccupied (roof); chemical store, scrap store and hazardous material store (ground floor). The building was constructed in 2023.

Common area:

1. Apparel gate office is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); offices (ground floor). The building was constructed in 2023.
2. Fair price shop is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); shop and atms (ground floor). The building was constructed in 2021.
3. Dispensary is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); medical health unit (ground floor). The building was constructed in 2021.
4. Storage/ Locker room is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); storage (ground floor). The building was constructed in 2024.
5. Masjid is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); prayer area (ground floor). The building was constructed in 2021.
6. Daycare is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); daycare activities and store

(ground floor). The building was constructed in 2021.
7. LT room and OHWT is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for water storage (roof); LT panels (ground floor). The building was constructed in 2021.
8. Hydrant room is a basement only RC moment resisting frame building. The building is used for unoccupied (roof); pumping system (ground floor). The building was constructed in 2021.
9. Hosiery gate office is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); offices (ground floor). The building was constructed in 2021.

Club & Hostel area:

1. Colony gate office is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); offices (ground floor). The building was constructed in 2023.
2. Security office & ATM is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); offices and ATM (ground floor). The building was constructed in 2024.
3. Colony workshops is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); workshops and LT room (ground floor). The building was constructed in 2024.
4. Drivers room is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); waiting area (ground floor). The building was constructed in 2024.
5. Colony OHWT is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); RO Plant (ground floor). The building was constructed in 2024.
6. Colony Masjid is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); prayer area (ground floor). The building was constructed in 2024.
7. Cafeteria and squash is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); canteen, dining and squash court (ground floor). The building was constructed in 2026.
8. Apartments is a 2 storey G+1 RC moment resisting frame building. The building is used for unoccupied (roof); sleeping area (first floor & ground floor).The building was constructed in 2026.

Utilities:

1. Parking shed is a ground only Pre-Engineered Building (PEB) Shed. The building is used for solar (roof); car parking (ground floor). The building was constructed in 2021.
2. Boiler gate office is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); offices (ground floor). The construction year of the structure is unknown.
3. Generator room 1 is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); generators (ground floor). The construction year of the structure is unknown.
4. Generator room 2 is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); generators (ground floor). The construction year of the structure is unknown.
5. Transformer room is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); transformers (ground floor). The construction year of the structure is unknown.
6. Gas boiler area is a ground only (G+M) Pre-Engineered Building (PEB) Shed. The building is used for unoccupied (roof); storage (mezzanine); gas boilers and control room (ground floor). The building was constructed in 2023.
7. Biomass boiler area is a 2 storey G+1 Pre-Engineered Building (PEB) Shed with Load bearing brick masonry wall system . The building is used for unoccupied

(roof); control room (first floor), boiler and electric panels (ground floor). The building was constructed in 2023.
8. Storage shed area is a ground only Pre-Engineered Building (PEB) Shed. The building is used for unoccupied (roof); biomass storage (ground floor). The construction year of the structure is unknown.
The factory complex is entirely occupied by Interloop Apparel Park as owner.
The factory operates with five shifts including general shift. Approximately 13,000 workers operate in the factory out of which approximately 12% employees are female.
We were presented with Architectural Layouts, Evacuation Maps, Emergency Action Plan, Civil Defence Certificate, Inspection record, Fire Drills and Staff Training documents.

A summary of the main concerns identified during the inspection includes (non-exhaustive):
- Lockable mechanisms observed in escape route across the whole facility.
- Travel Distances exceeding permitted limits.
- There is no fire separation between stairs, lift shafts and the rest of the building.
- Multiple stairs discharge inside the multiple buildings.
- Escape routes are not adequately fire separated from adjoining high-risk areas.
- Storage areas are not fire separated from rest of the building.
- Standpipe system is missing in the staircases of Technical Training School Building.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes.)

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

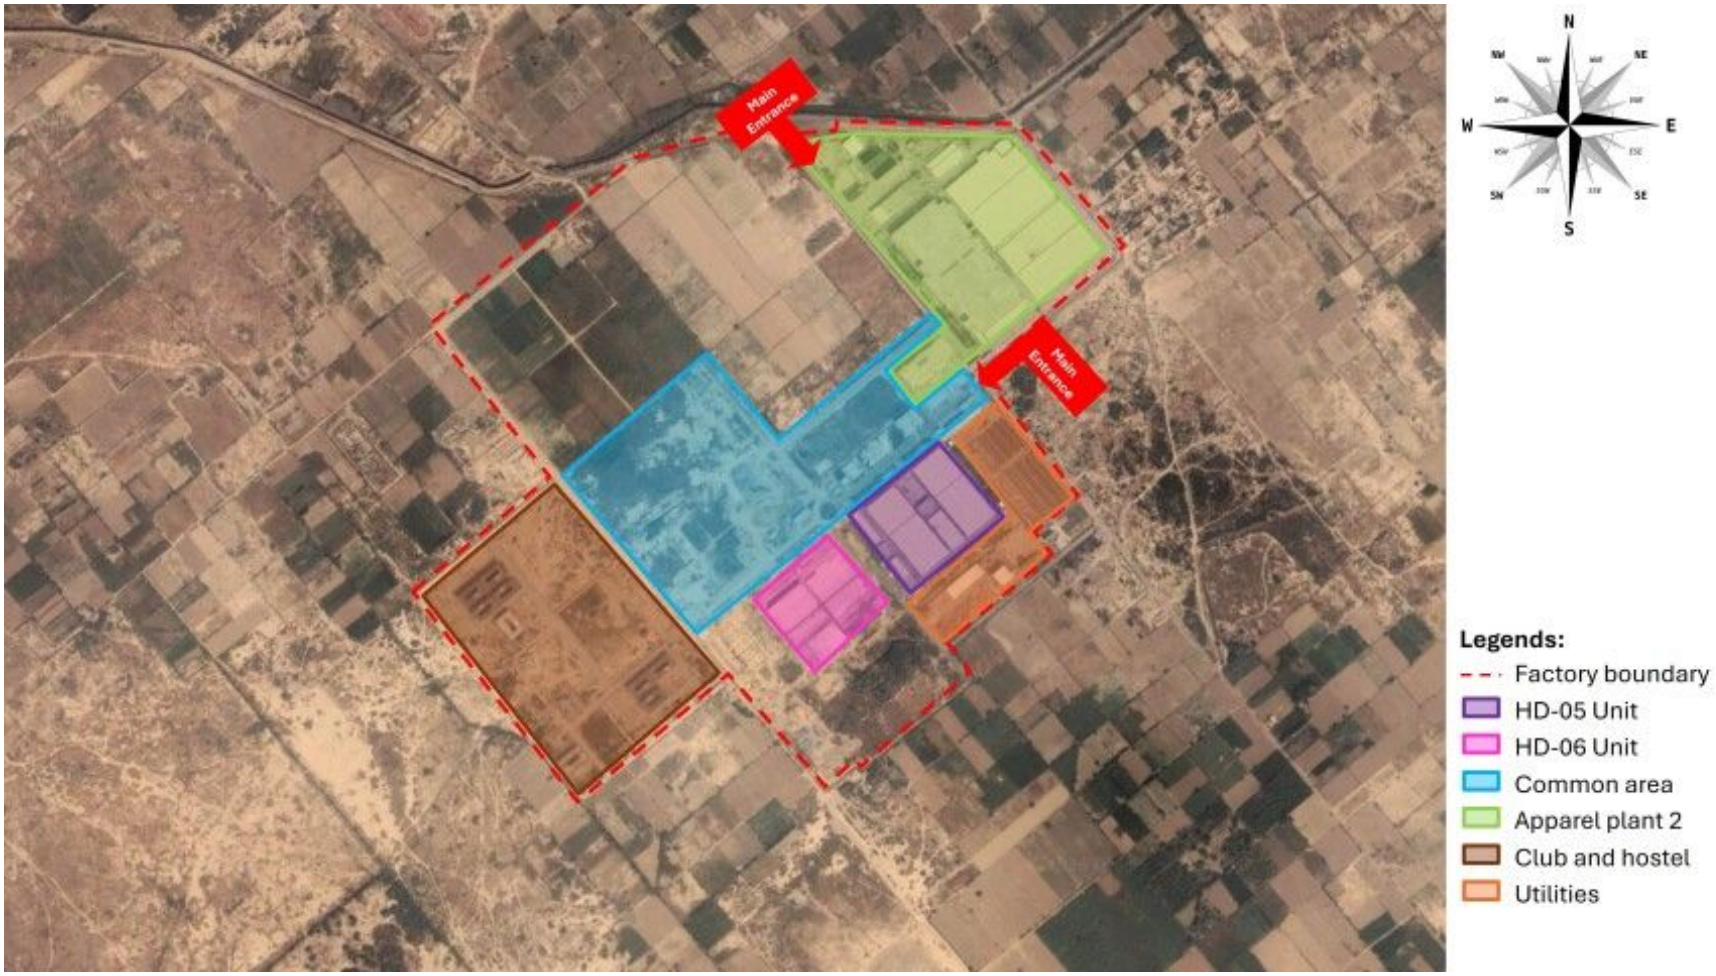


Figure 1.1. Satellite View of the Factory Premises

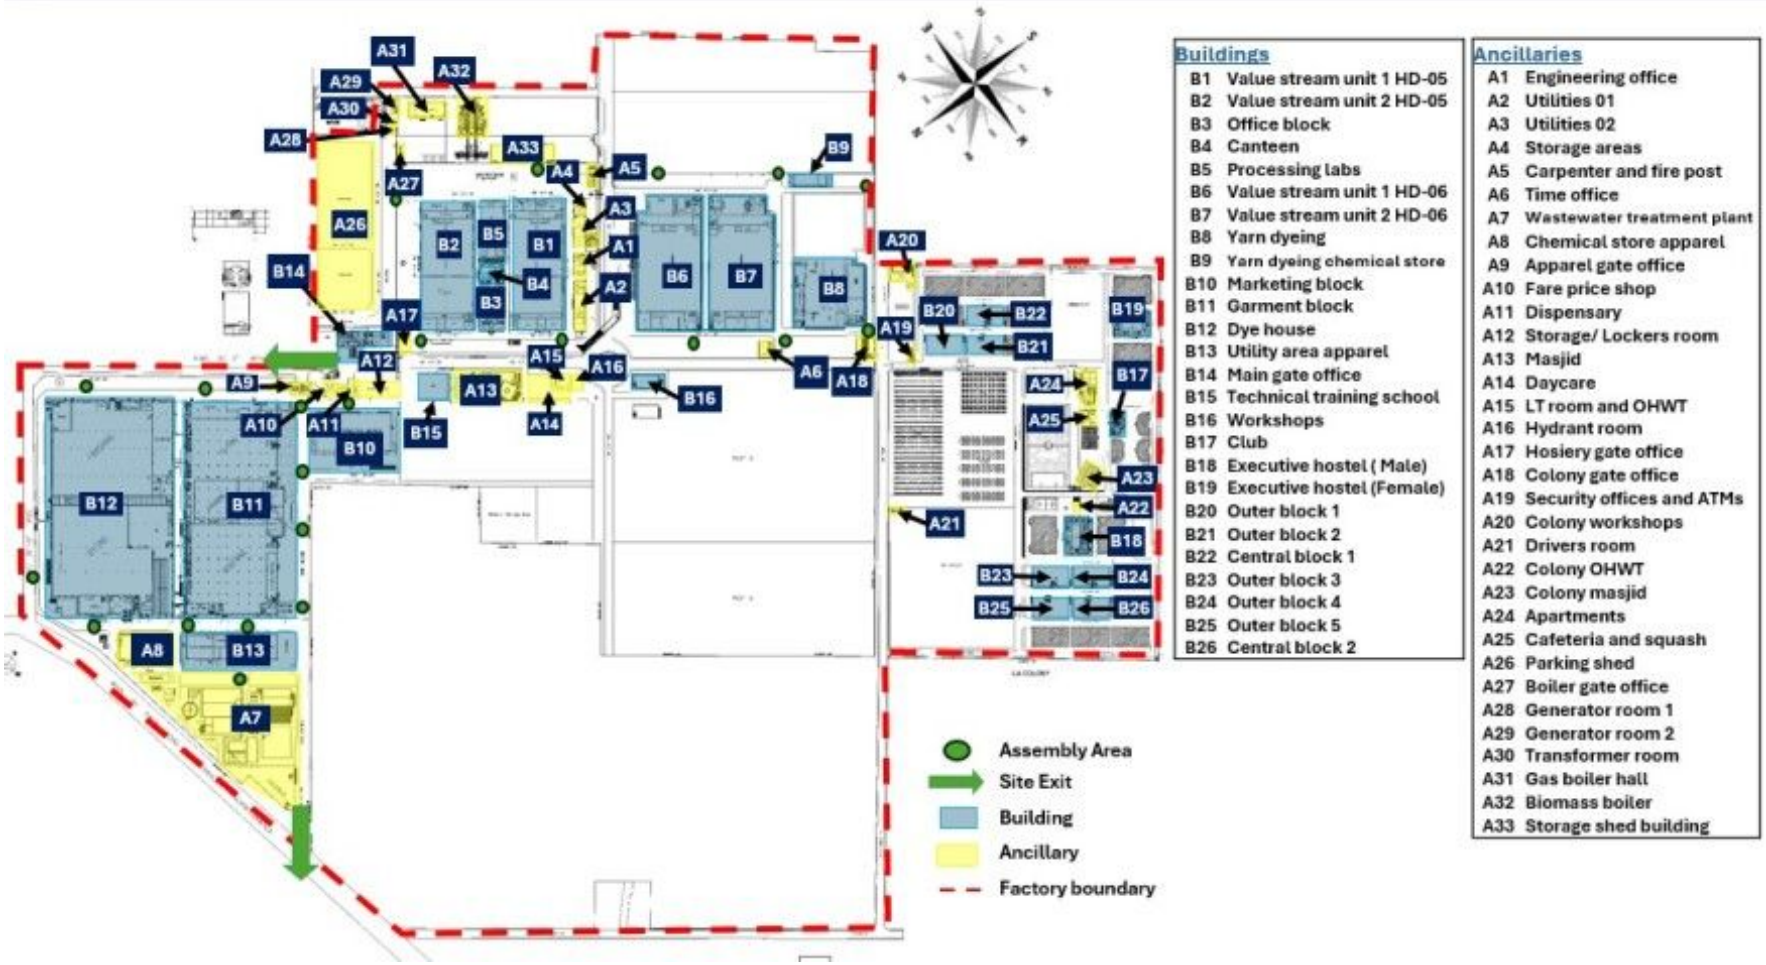


Figure 1.2. Site layout plan

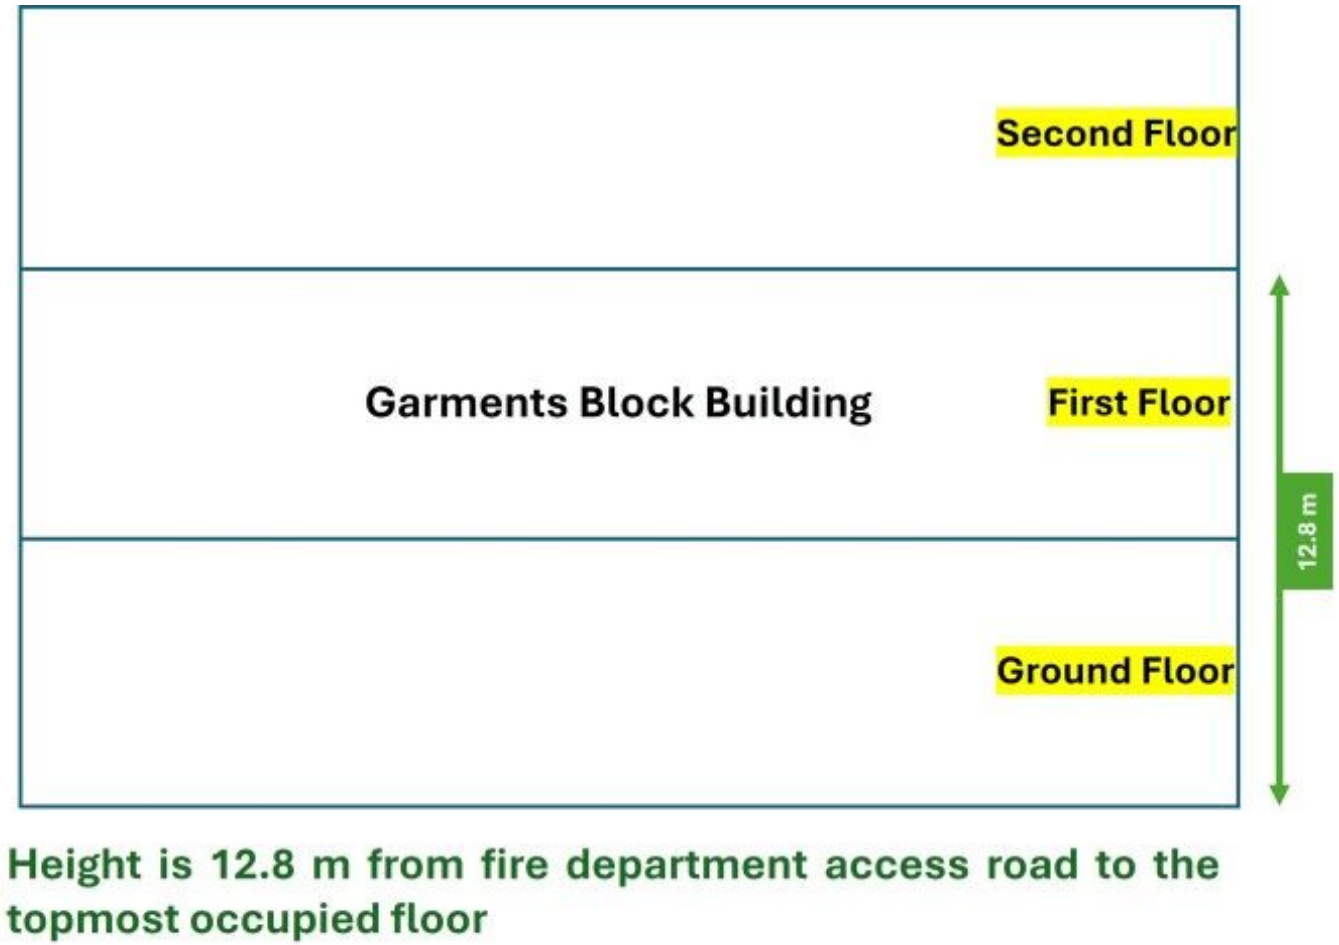


Figure 1.3. Sectional layout of Garments Block Building

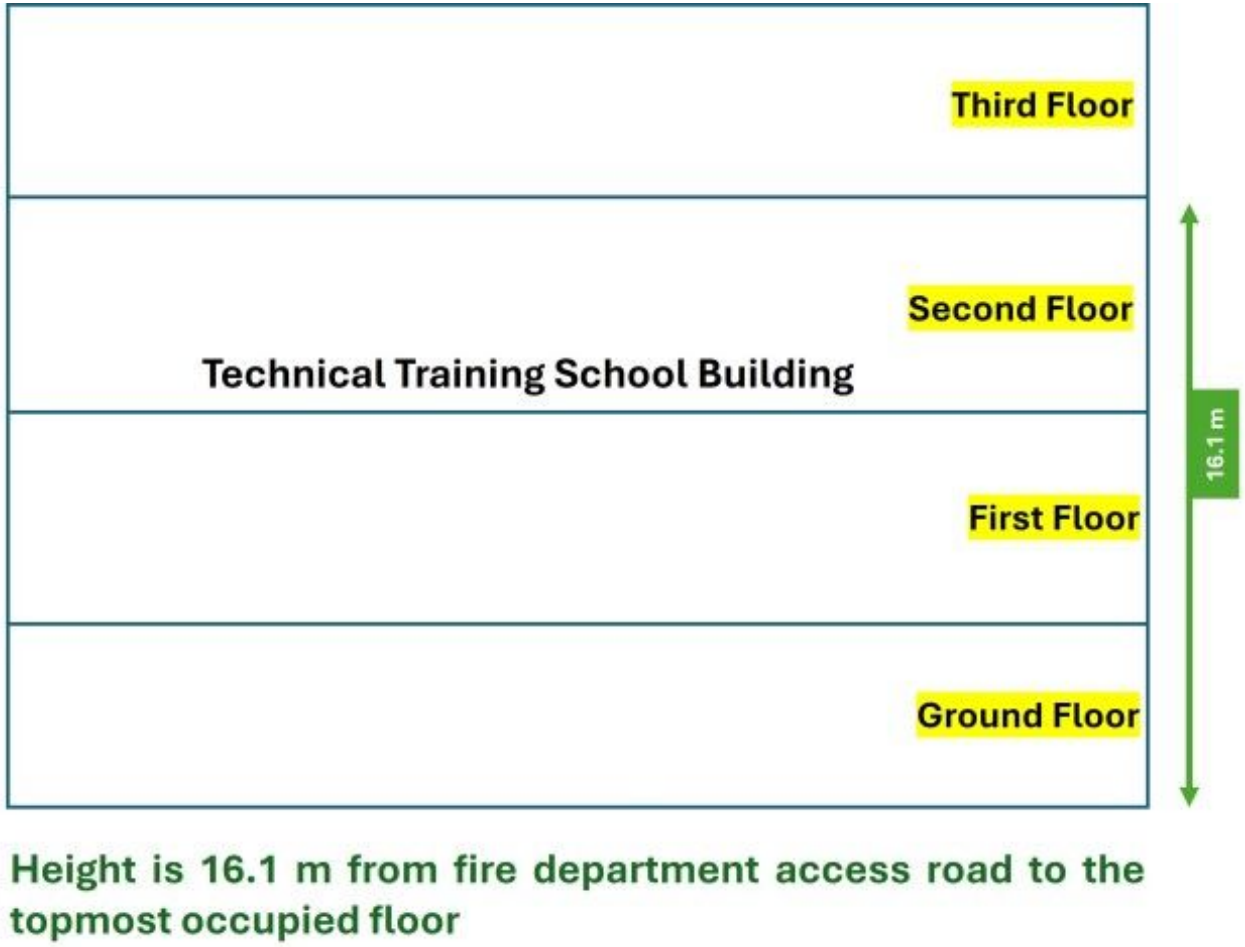


Figure 1.4. Sectional layout of Technical Training School Building

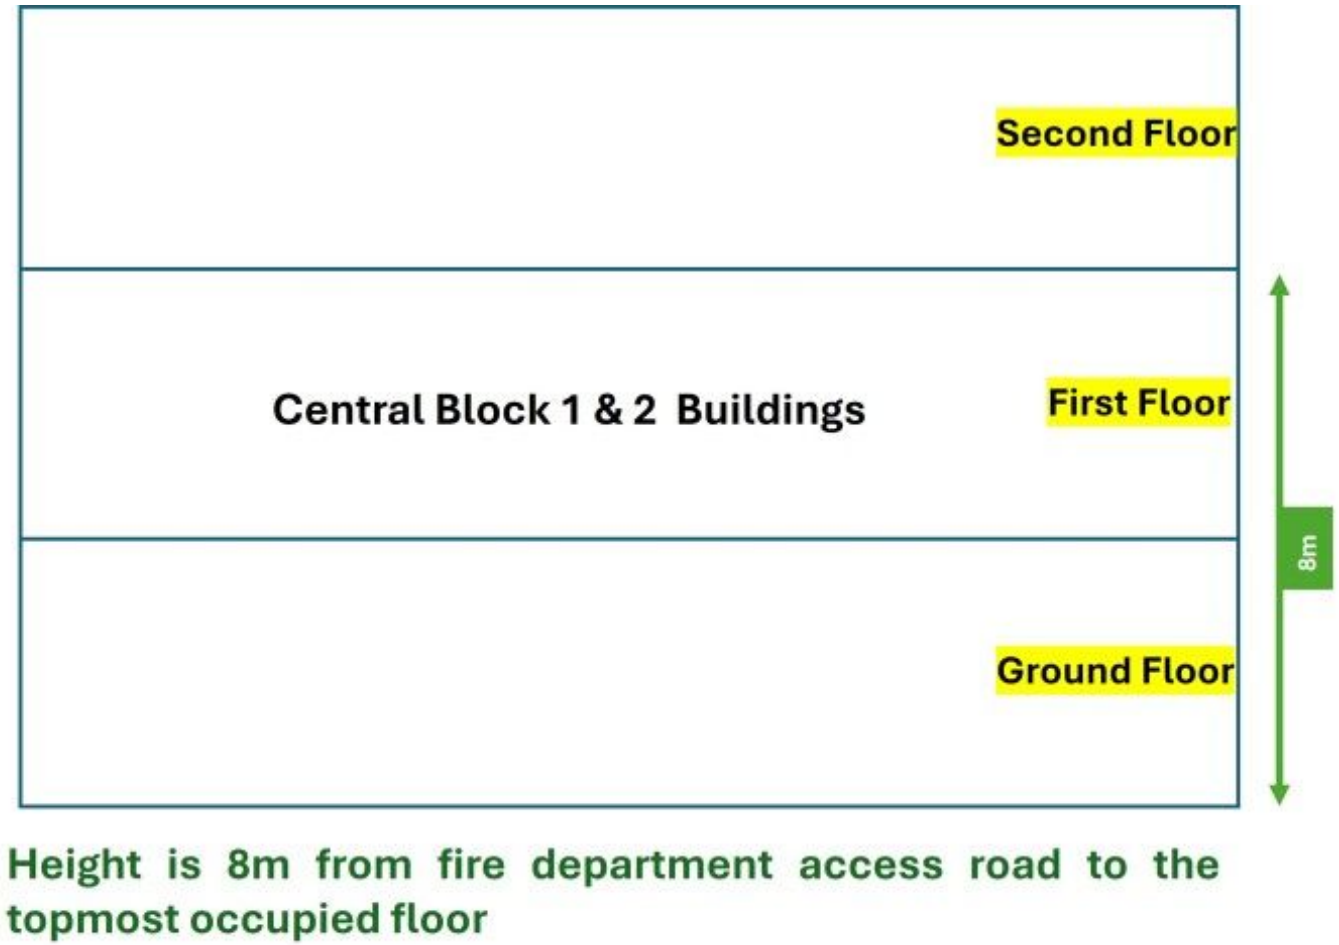


Figure 1.5. Sectional layout of Central Block 1 & 2 Buildings (Typical Buildings)

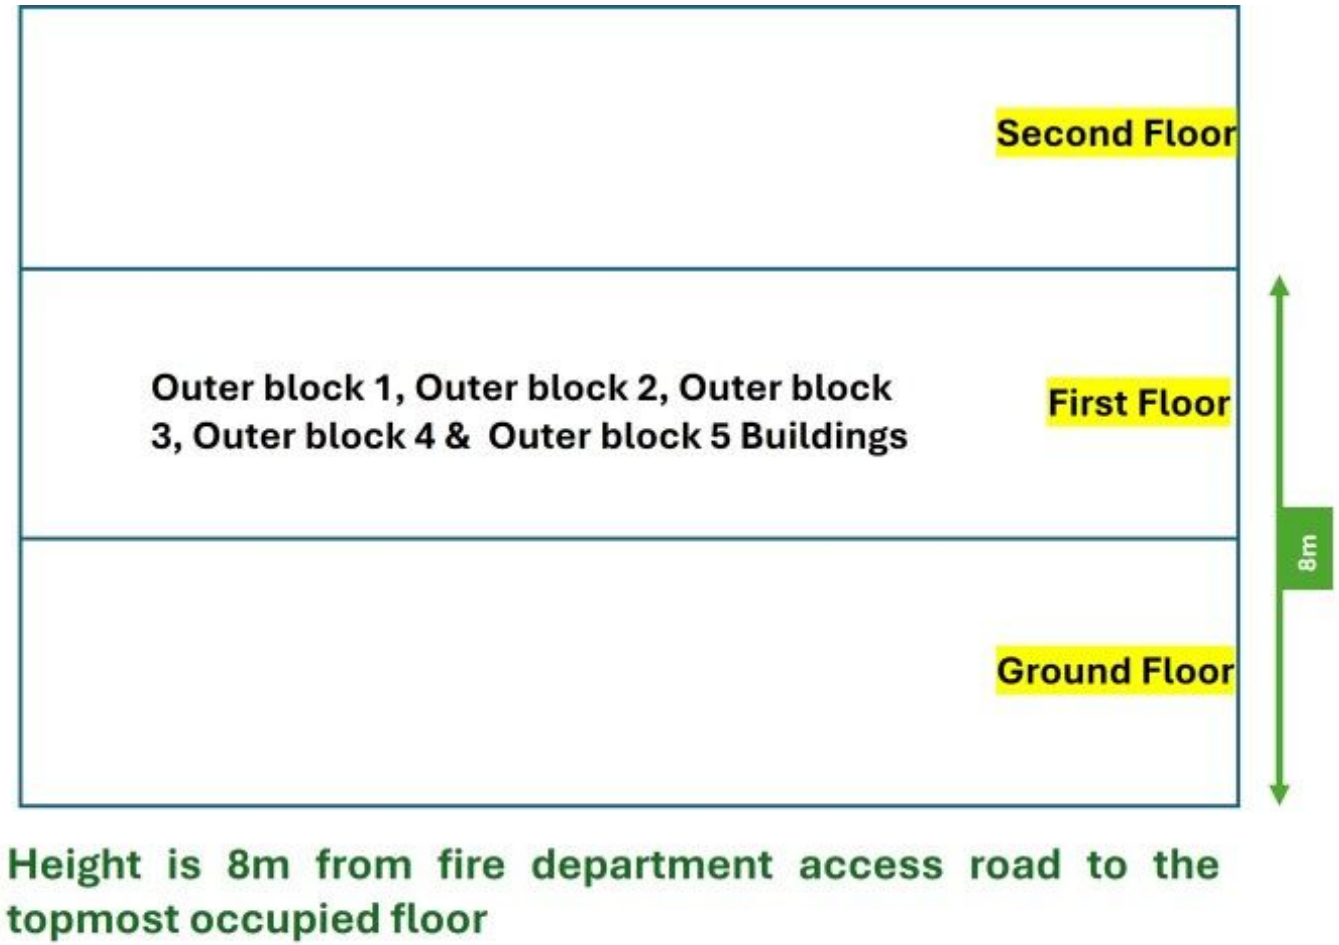


Figure 1.6. Sectional layout of Outer block 1, 2,3,4 & 5 Buildings (Typical Buildings)



Figure 1.7. Sectional layout of Executive Hostel (male) & Executive Hostel (female) Buildings (Typical Buildings)

3. Building Description

The factory comprises of 26 buildings and 33 ancillary structures details of which are provided below:

Buildings:

Hosiery Division 5:

1. Office Block Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 1,560 sq. m. Building has 2 staircases out of which 1 discharge internally. The building is used for unoccupied (roof); offices and meeting room (first floor); offices, meeting room and kitchen (ground floor). The building was constructed in 2021.
2. Canteen Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 460 sq. m. Building has 3 staircases, all discharge externally. The building is used for unoccupied (roof); dining area (first floor); dining (differently abled), prayer area-male, prayer area-female and kitchen (ground floor). The building was constructed in 2021.
3. Processing lab Building is a ground only Pre-Engineered Building (PEB) Shed, with a covered area (footprint) of 2,050 sq. m. The building is used for unoccupied (roof); accessory stores, sampling area, waste management area, processing area, labs, offices and chemical storage (ground floor). The building was constructed in 2021.
4. Value stream unit 2 Building – HD 5 is a ground only Pre-Engineered Building (PEB) Shed, with a covered area (footprint) of 9,150 sq. m. The building is used for unoccupied (roof); electronic lab, control room, AHU, LT room, store, offices, knitting, finishing, metal free zone finish good store, accessory store (ground floor). The building was constructed in 2021.
5. Value stream unit 1 Building – HD 5 is a ground only Pre-Engineered Building (PEB) Shed, with a covered area (footprint) of 9,150 sq. m. The building is used for unoccupied (roof); electronic lab, red tag 1 area, control room, AHU, LT room, store, offices, knitting, finishing, metal free zone finish good store, spare store, red tag 2 area, charging point , chemical store (ground floor). The building was constructed in 2021.

Hosiery Division 6:

1. Value stream unit 1 Building – HD 6 is a ground only Pre-Engineered Building (PEB) Shed, with a covered area (footprint) of 10,860 sq. m. The building is used for unoccupied (roof); AHU, LT room, store, finishing, offices, electronic lab, finish good store, office, prayer area, sampling and accessory store (ground floor). The building was constructed in 2025.
2. Value stream unit 2 Building – HD 6 is a ground only Pre-Engineered Building (PEB) Shed, with a covered area (footprint) of 10,860 sq. m. The building is used for unoccupied (roof); AHU, LT room, store, finishing, offices, electronic lab, finish good store, office, prayer area, sampling, dining, kitchen and store (ground floor). The building was constructed in 2025.

Yarn Dying Area:

1. Yarn Dying Building is a ground only G+M RC moment resisting frame building, with a covered area (footprint) of 6,030 sq. m. Building has 5 staircases out of which 4 serve mezzanine. The building is used for unoccupied (roof); lab, office and under construction area dying machines (mezzanine); yarn dying, store, AHU, prayer area, LT room and RO Plant (ground floor). The building was constructed in 2025.

2. Yarn Dying- Chemical Store Building is a ground only RC moment resisting frame building, with a covered area (footprint) of 590 sq. m. The building is used for unoccupied (roof); chemical store and workshop (ground floor). The building was constructed in 2025.

Apparel Plant 2:

1. Garments Block Building is a 3 storey G+2 RC moment resisting frame building, with a covered area (footprint) of 27,700 sq. m and with the height of 12.8m measured from the fire department vehicle access to the topmost occupied floor. Building has 13 staircases out of which 3 discharge internally. The building is used for unoccupied (roof); stitching, dining, kitchen, mosques, storage & offices (second floor); stitching, dining, kitchen, mosques, storage & offices (first floor); cutting, store, embroidery and offices (ground floor). The building was constructed in 2023.
2. Dye House Building is a ground only G+M Pre-Engineered Building (PEB) Shed, with a covered area (footprint) of 35,000 sq. m. Building has 4 staircases, all serve mezzanine out of which 2 discharge externally. The building is used for unoccupied (roof); lab and offices (mezzanine); dying, finishing, washing, chemical, dispensing and storage, LT room (1), LT room (2) and Thermal oil heaters (ground floor). The building was constructed in 2023.
3. Utility Area Apparel Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 3,020 sq. m. Building has 2 staircases both discharge externally. The building is used for unoccupied (roof); offices (first floor); chiller & compressor area, electric panels, RO Plant, electrical workshop, mechanical workshop 1, mechanical workshop 2, waste store, leftover store, HVAC workshop (ground floor). The building was constructed in 2023.
4. Marketing Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 3,560 sq. m. Building has 3 staircases all discharge externally. The building is used for unoccupied (roof); sampling, embroidery and offices (first floor); under-construction (ground floor). The building was constructed in 2025.

Common area:

1. Technical Training School Building is a 4 storey G+3 RC moment resisting frame building, with a covered area (footprint) of 1,180 sq. m and with the height of 16.1m measured from the fire department vehicle access to the topmost occupied floor. Building has 3 staircases out of which 1 discharge internally. The building is used for unoccupied (roof); under construction (third floor); training halls, dining area, rest area, offices and storage (second floor); training halls, dining area, rest area, offices and storage (first floor);training halls, lockers, rest area, offices, LT room and storage (ground floor). The building was constructed in 2021.
2. Workshop Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 670 sq. m. Building has 2 staircases all discharge externally. The building is used for unoccupied (roof); offices (first floor); workshop 1, workshop 2, store, workshop 3 (ground floor). The building was constructed in 2021..
3. Main Gate Office Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 1,590 sq. m. Building has 2 staircases all discharge externally. The building is used for unoccupied (roof); offices and under construction area (first floor); control room, HR & requirement Offices, time office, security offices, driver sitting , rest area and TUC shop (ground floor). The building was constructed in 2021.

Club & Hostel area:

1. Central Block 1 & Central Block 2 Buildings are typical 3 storey G+2 RC moment resisting frame buildings, with a covered area (footprint) of 1,045 sq. m and with the height of 8m measured from the fire department vehicle access to the topmost occupied floor. Building has 3 staircases out of which one discharge internally. The building is used for solar (roof); dormitories (second & first floor); dormitories, kitchen and dining (ground floor). The building was constructed in 2025.
2. Outer block 1, Outer block 2, Outer block 3, Outer block 4 & Outer block 5 Buildings are typical 3 storey G+2 RC moment resisting frame buildings, with a covered area (footprint) of 1,045 sq. m and with the height of 8m measured from the fire department vehicle access to the topmost occupied floor. Building has 3 staircases all discharge externally. The building is used for solar (roof); dormitories (second, first and ground floor). The building was constructed in 2025.
3. Executive Hostel (Male) & Executive Hostel (Female) Buildings are typical 3 storey G+2 RC moment resisting frame buildings, with a covered area (footprint) of 1,350 sq. m and with the height of 8m measured from the fire department vehicle access to the topmost occupied floor. Building has 4 staircases out of which 2 discharge internally. The building is used for unoccupied (roof); dormitories (second, first and ground floor). The building was constructed in 2025.
4. Club Building is a 2 storey G+1 RC moment resisting frame building, with a covered area (footprint) of 370 sq. m. Building has 3 staircases out of which 1 discharge internally. The building is used for unoccupied (roof); gym and rest room (first floor); dining and sitting (ground floor). The building was constructed in 2025.

Ancillaries structures:

Hosiery Division 5:

1. Utility 1 is a ground only Pre-Engineered Building (PEB) Shed. The building is used for unoccupied (roof); chillers, compressors and workshops (ground floor). The building was constructed in 2021.
2. Utility 2 is a ground only Pre-Engineered Building (PEB) Shed. The building is used for unoccupied (roof); RO plant and workshop (ground floor). The building was constructed in 2021.
3. Engineering offices is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); offices (ground floor). The building was constructed in 2021.
4. Storage is a ground only having load bearing brick masonry wall supporting precast double tee slab.. The building is used for unoccupied (roof); storage (ground floor). The building was constructed in 2021.
5. Carpenter & Fire boost workshop is a ground having load bearing brick masonry wall supporting precast girders and slab panels. The building is used for unoccupied (roof); workshop and fire equipment store (ground floor). The building was constructed in 2021.

Hosiery Division 6:

1. Time office is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); offices (ground floor). The building was constructed in 2025.

Apparel Plant 2:

1. Wastewater treatment plant is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); MBR, Lab, electric panels and blower area (ground floor). The building was constructed in 2023.
2. Chemical store apparel is a ground only Pre-Engineered Building (PEB) Shed. The building is used for unoccupied (roof); chemical store, scrap store and hazardous material store (ground floor). The building was constructed in 2023.

Common area:

1. Apparel gate office is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); offices (ground floor). The building was constructed in 2023.
2. Fair price shop is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); shop and atms (ground floor). The building was constructed in 2021.
3. Dispensary is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); medical health unit (ground floor). The building was constructed in 2021.
4. Storage/ Locker room is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); storage (ground floor). The building was constructed in 2024.
5. Masjid is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); prayer area (ground floor). The building was constructed in 2021.
6. Daycare is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); daycare activities and store (ground floor). The building was constructed in 2021.
7. LT room and OHWT is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for water storage (roof); LT panels (ground floor). The building was constructed in 2021.
8. Hydrant room is a basement only RC moment resisting frame building. The building is used for unoccupied (roof); pumping system (ground floor). The building was constructed in 2021.
9. Hosiery gate office is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); offices (ground floor). The building was constructed in 2021.

Club & Hostel area:

1. Colony gate office is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); offices (ground floor). The building was constructed in 2023.
2. Security office & ATM is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); offices and ATM (ground floor). The building was constructed in 2024.
3. Colony workshops is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); workshops and LT room (ground floor). The building was constructed in 2024.
4. Drivers room is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); waiting area (ground floor). The building was constructed in 2024.

5. Colony OHWT is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); RO Plant (ground floor). The building was constructed in 2024.
6. Colony Masjid is a ground only RC moment resisting frame building. The building is used for unoccupied (roof); prayer area (ground floor). The building was constructed in 2024.
7. Cafeteria and squash is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); canteen, dining and squash court (ground floor). The building was constructed in 2026.
8. Apartments is a 2 storey G+1 RC moment resisting frame building. The building is used for unoccupied (roof); sleeping area (first floor & ground floor).The building was constructed in 2026.

Utilities:

1. Parking shed is a ground only Pre-Engineered Building (PEB) Shed. The building is used for solar (roof); car parking (ground floor). The building was constructed in 2021.
2. Boiler gate office is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); offices (ground floor). The construction year of the structure is unknown.
3. Generator room 1 is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); generators (ground floor). The construction year of the structure is unknown.
4. Generator room 2 is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); generators (ground floor). The construction year of the structure is unknown.
5. Transformer room is a ground only Load bearing brick masonry wall supporting RC slab structure. The building is used for unoccupied (roof); transformers (ground floor). The construction year of the structure is unknown.
6. Gas boiler area is a ground only (G+M) Pre-Engineered Building (PEB) Shed. The building is used for unoccupied (roof); storage (mezzanine); gas boilers and control room (ground floor). The building was constructed in 2023.
7. Biomass boiler area is a 2 storey G+1 Pre-Engineered Building (PEB) Shed with Load bearing brick masonry wall system . The building is used for unoccupied (roof); control room (first floor), boiler and electric panels (ground floor). The building was constructed in 2023.
8. Storage shed area is a ground only Pre-Engineered Building (PEB) Shed. The building is used for unoccupied (roof); biomass storage (ground floor). The construction year of the structure is unknown.

3.1 Building Means of Egress Details

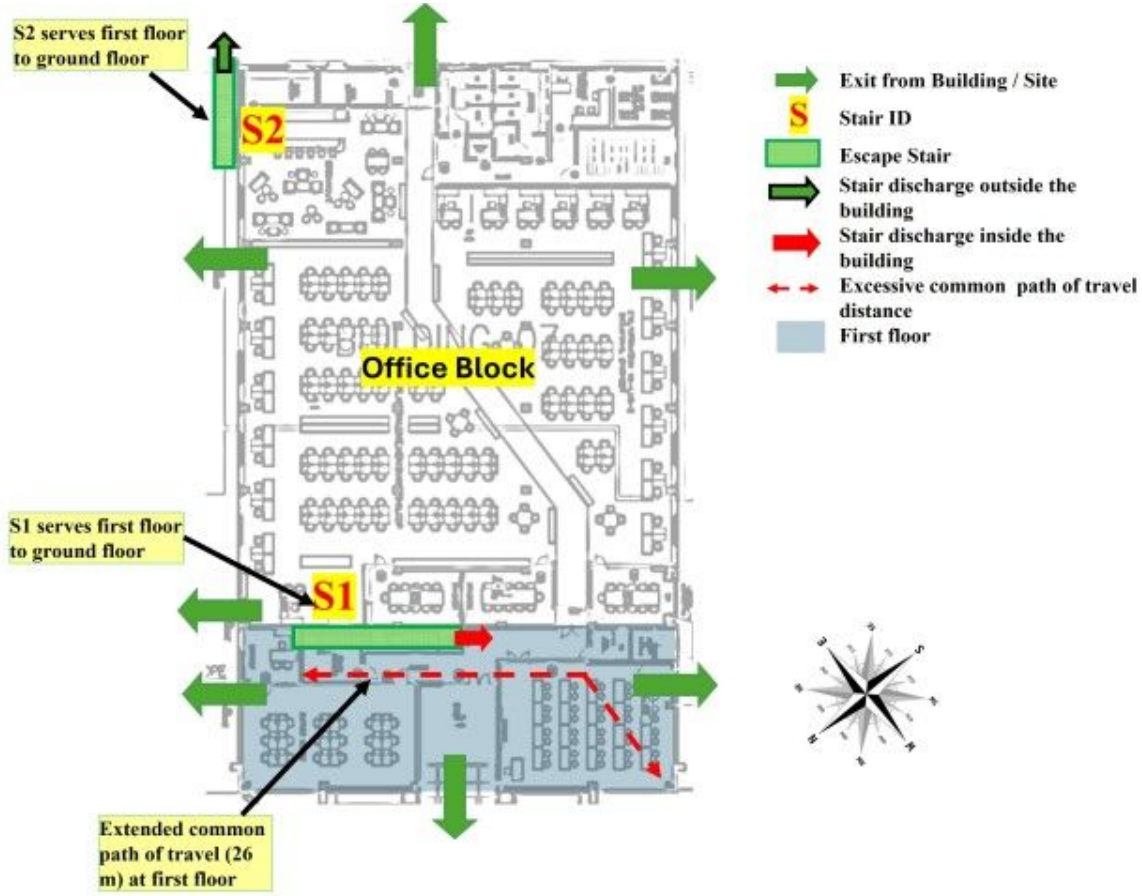


Figure 1.8. Egress layout for Office Block Building

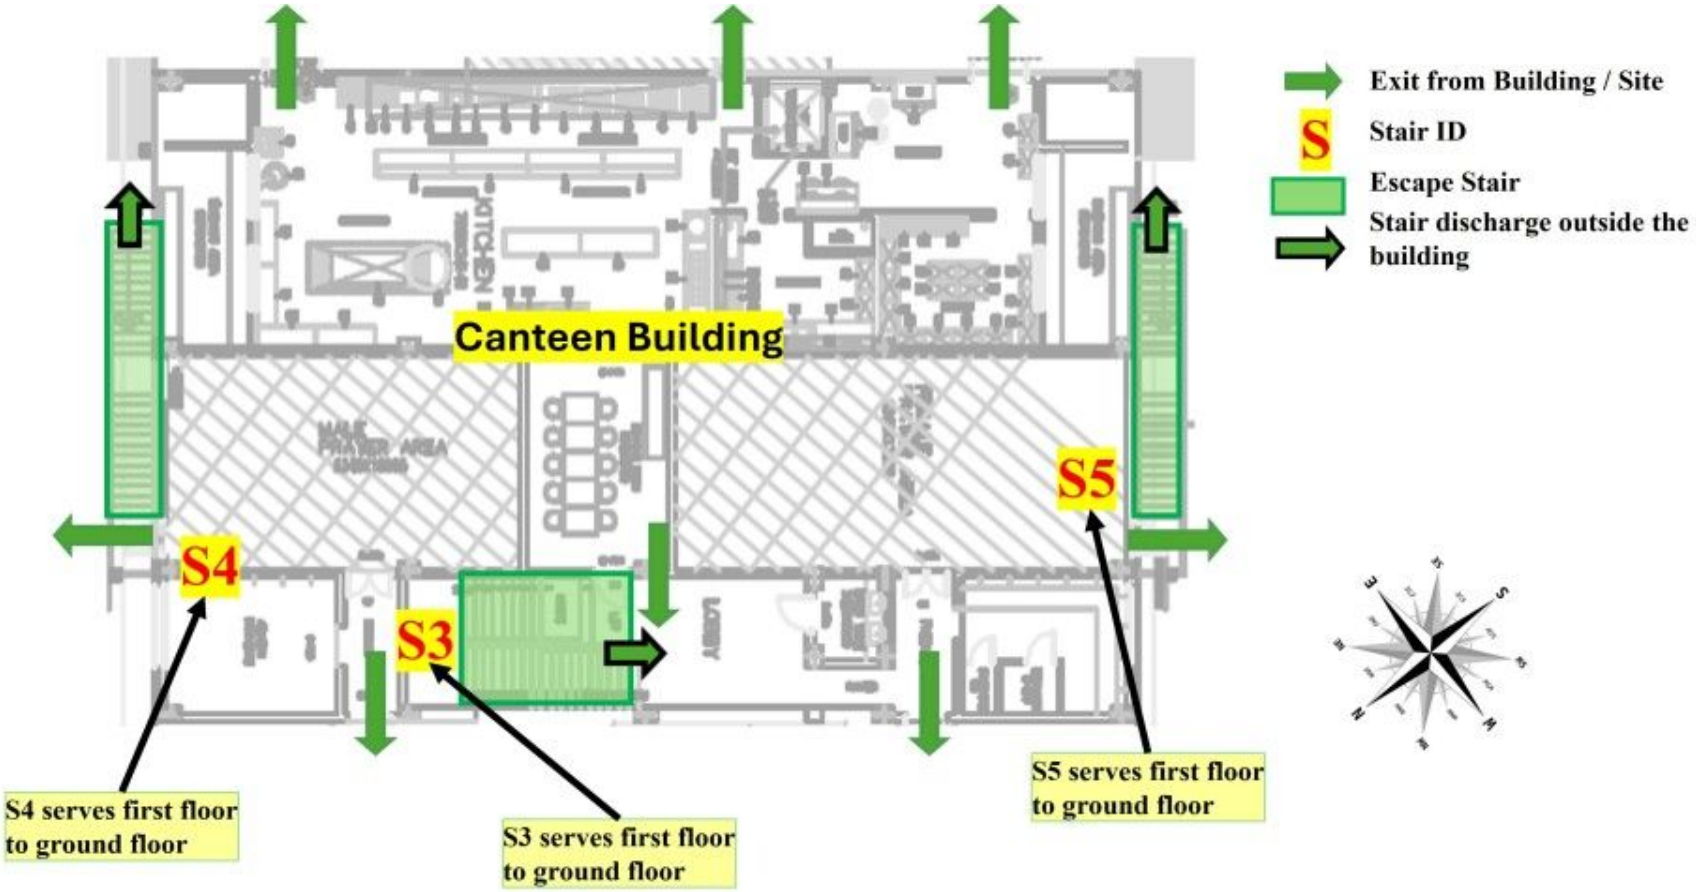


Figure 1.9. Egress layout for Canteen Building

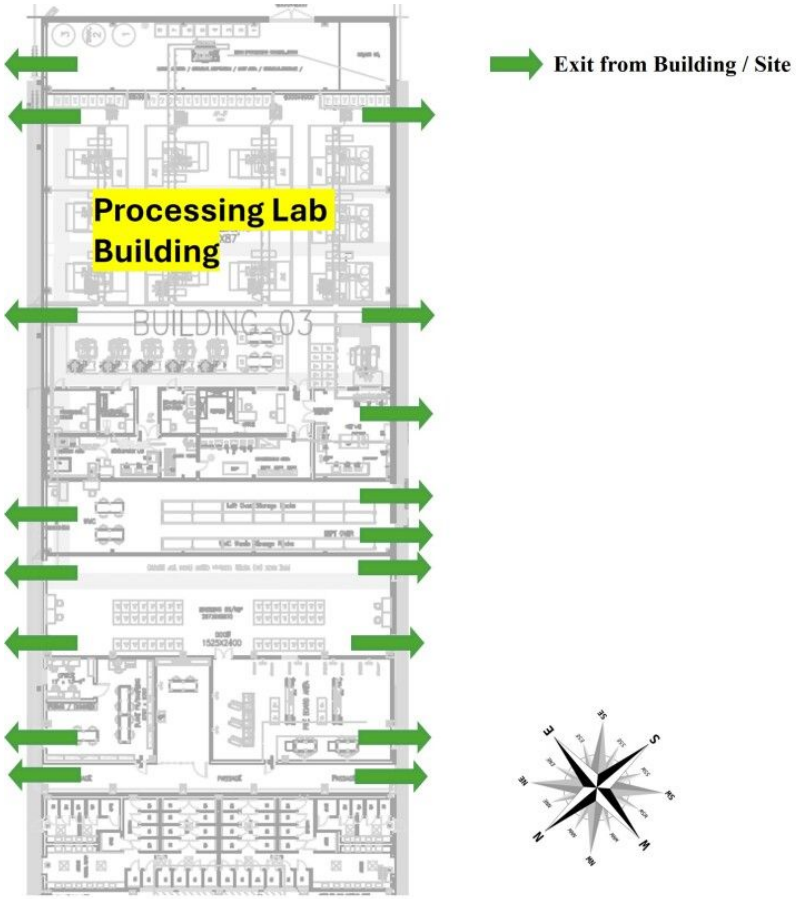


Figure 1.10. Egress layout for Processing Lab Building

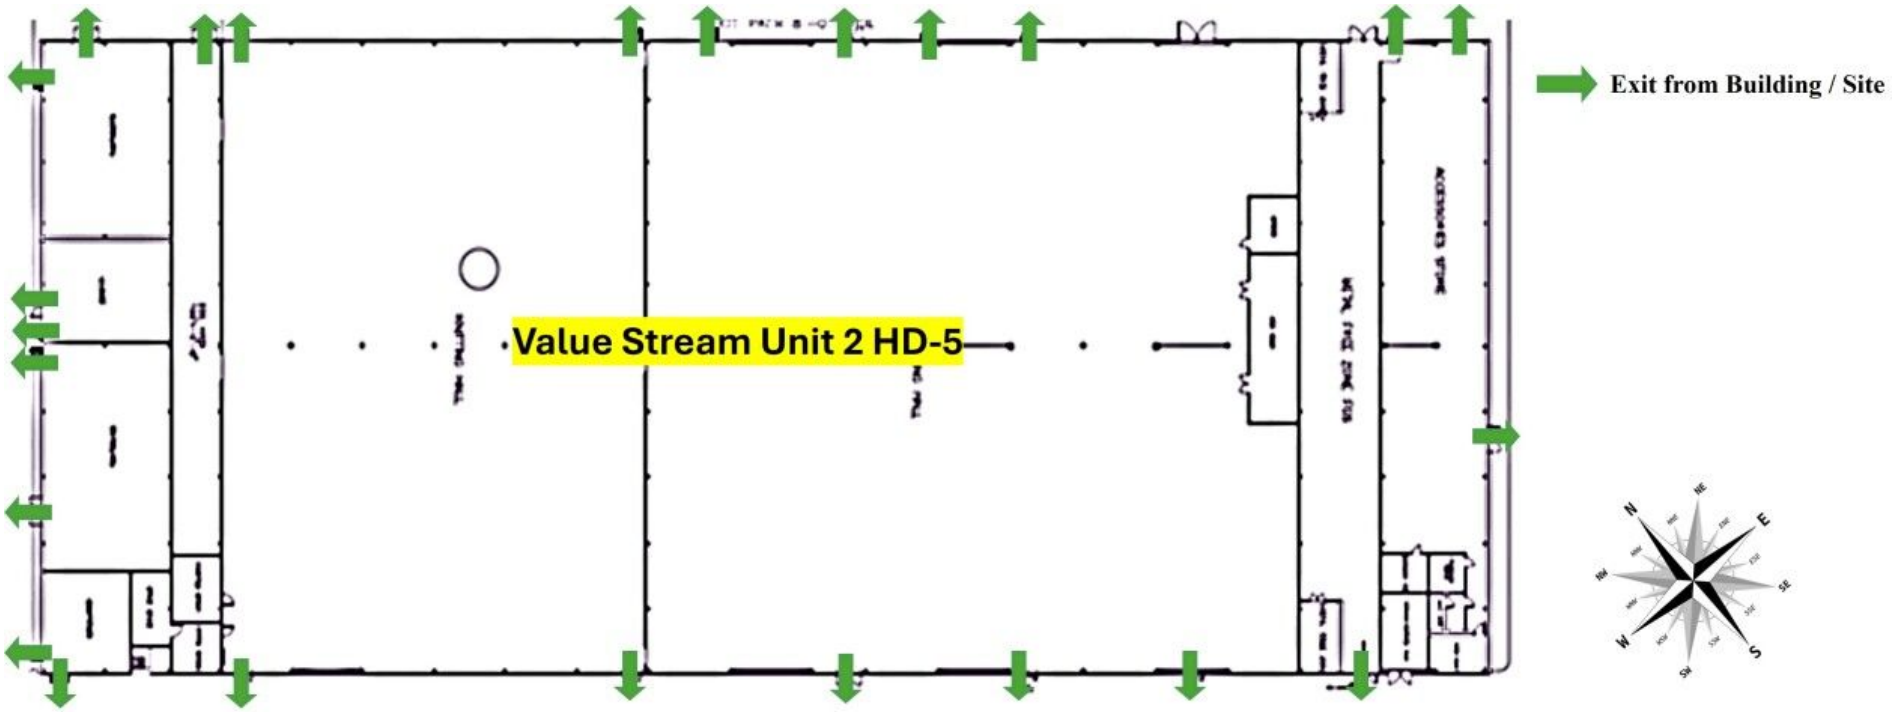


Figure 1.11. Egress layout for Value Stream Unit 2 - HD5

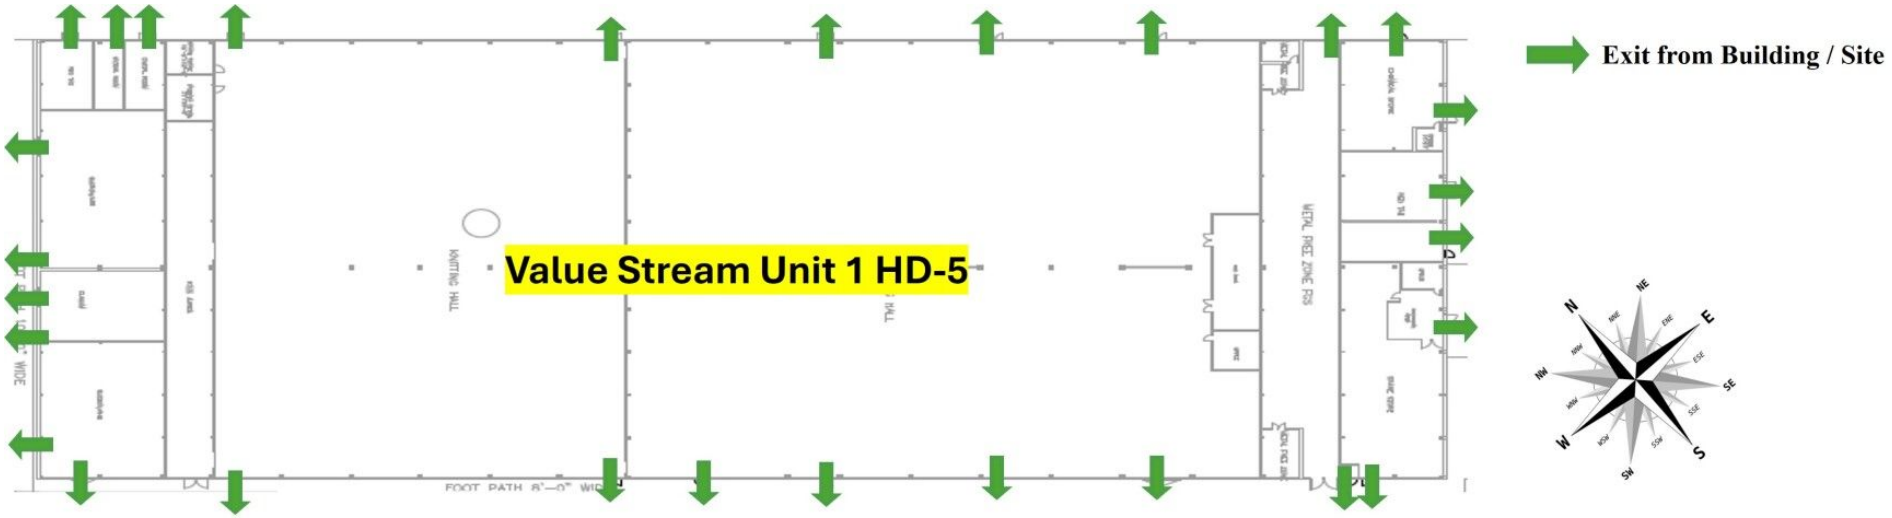


Figure 1.12. Egress layout for Value Stream Unit 1 - HD5

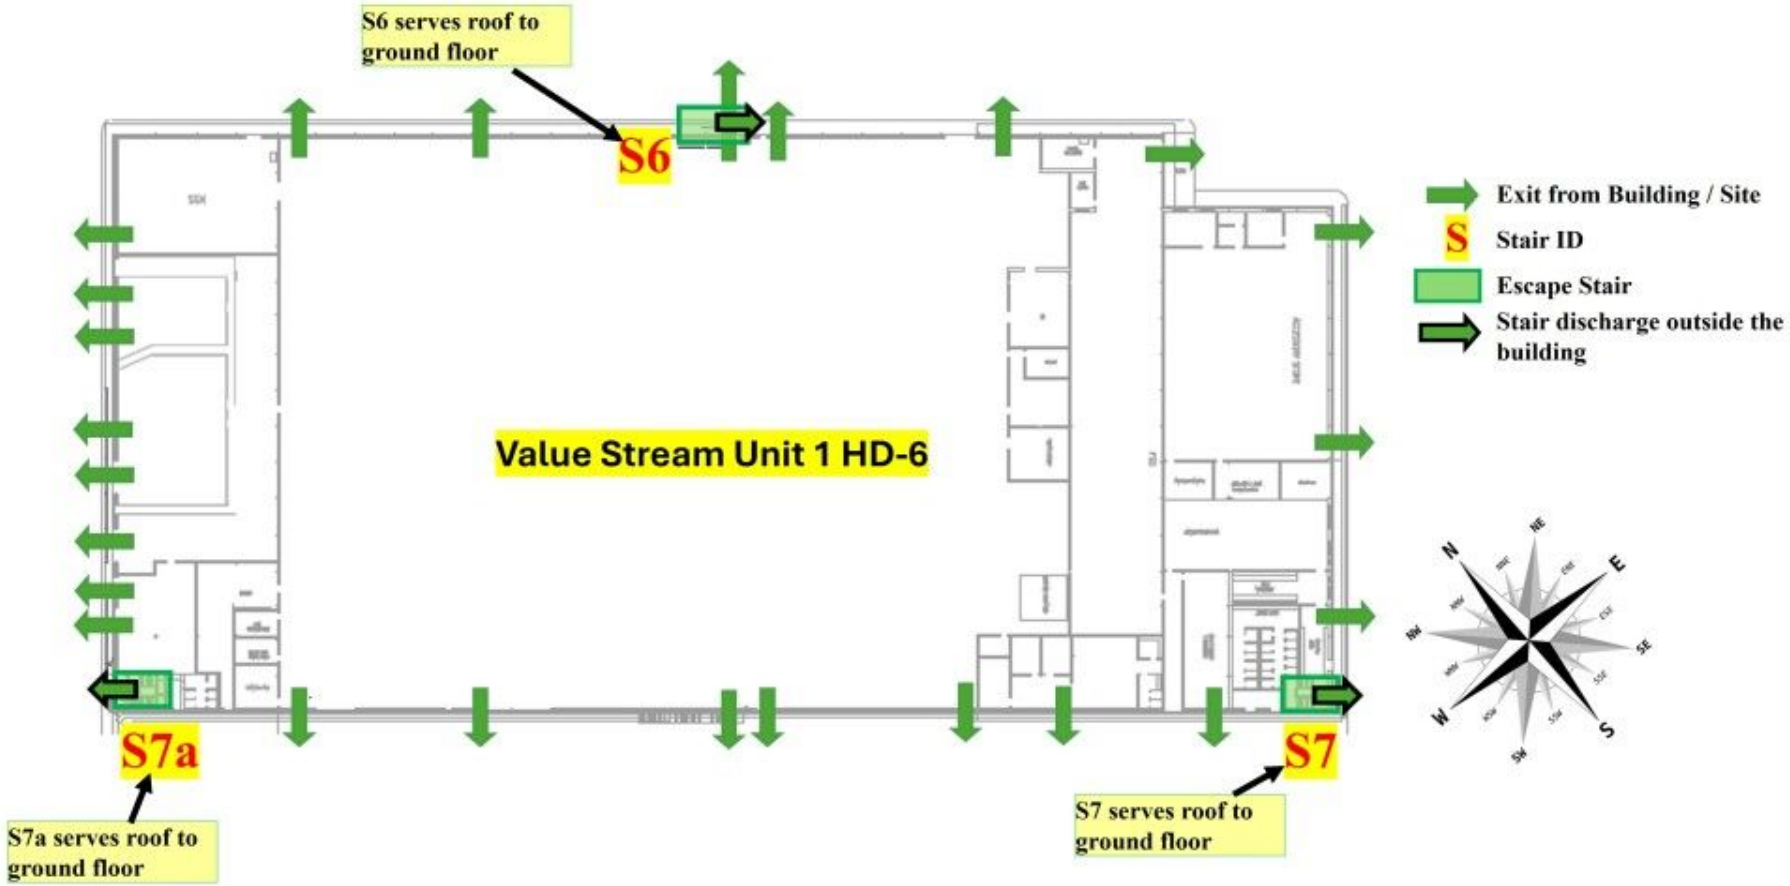


Figure 1.13. Egress layout for Value Stream Unit 1 - HD6

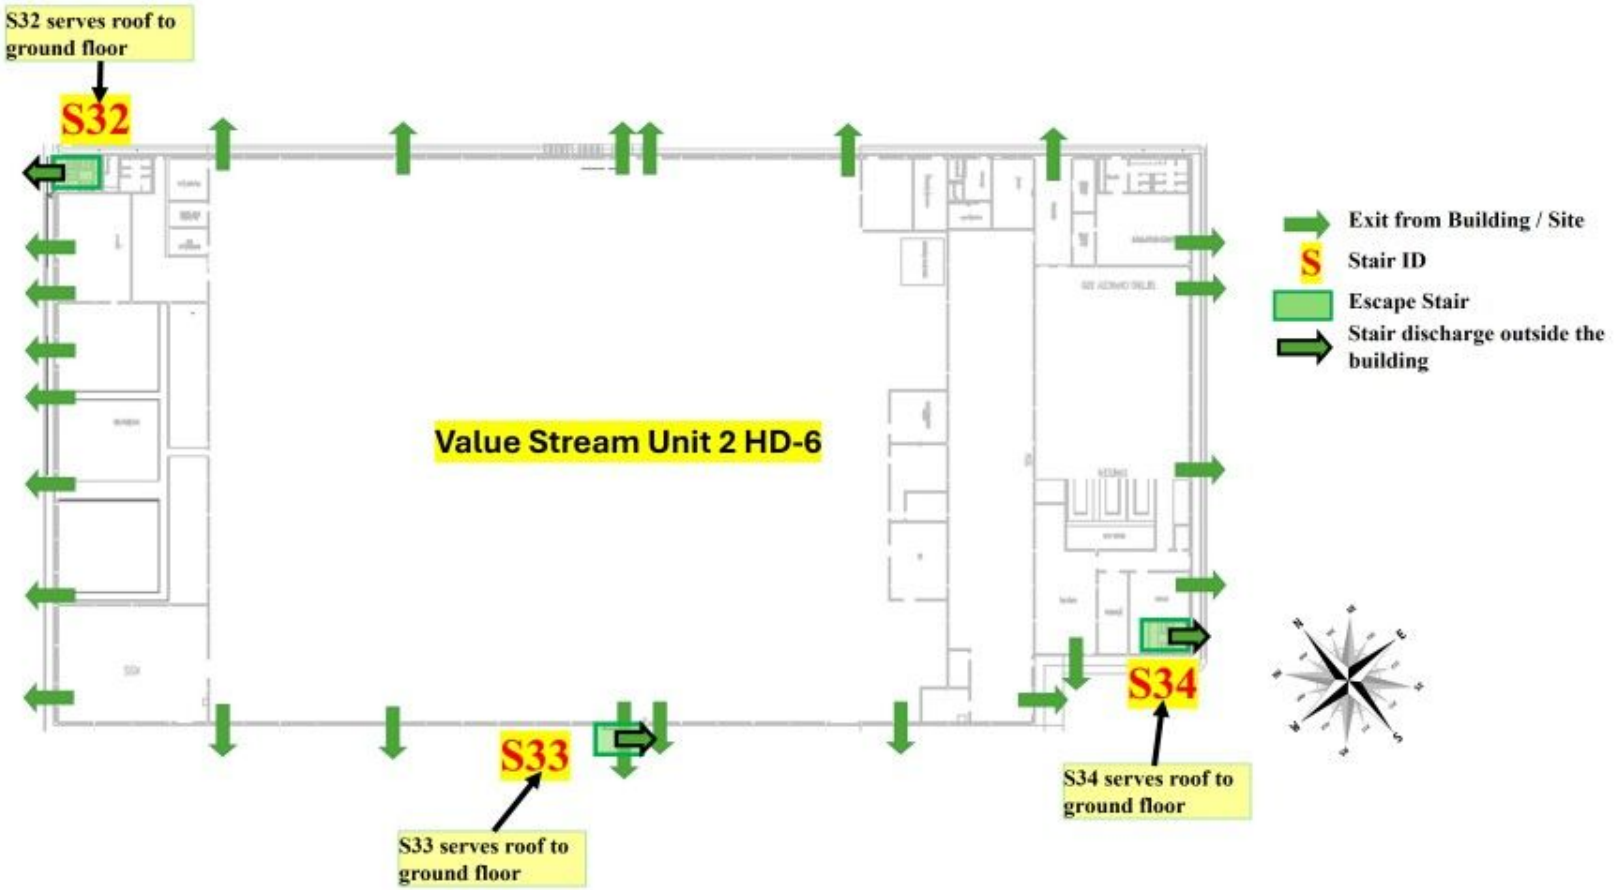


Figure 1.14. Egress layout for Value Stream Unit 2 - HD6

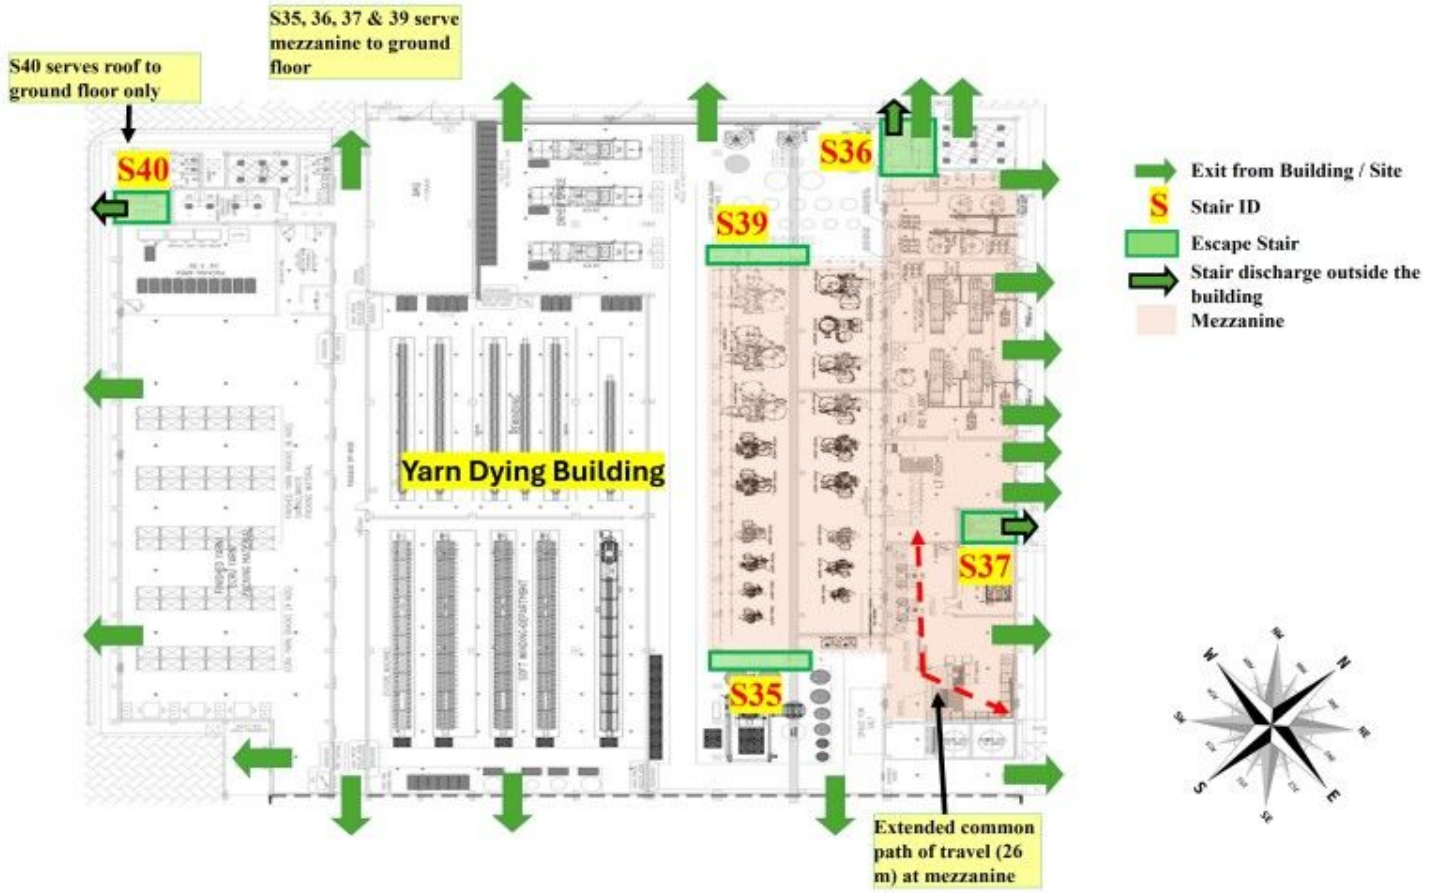


Figure 1.15. Egress layout for Yarn Dying Building

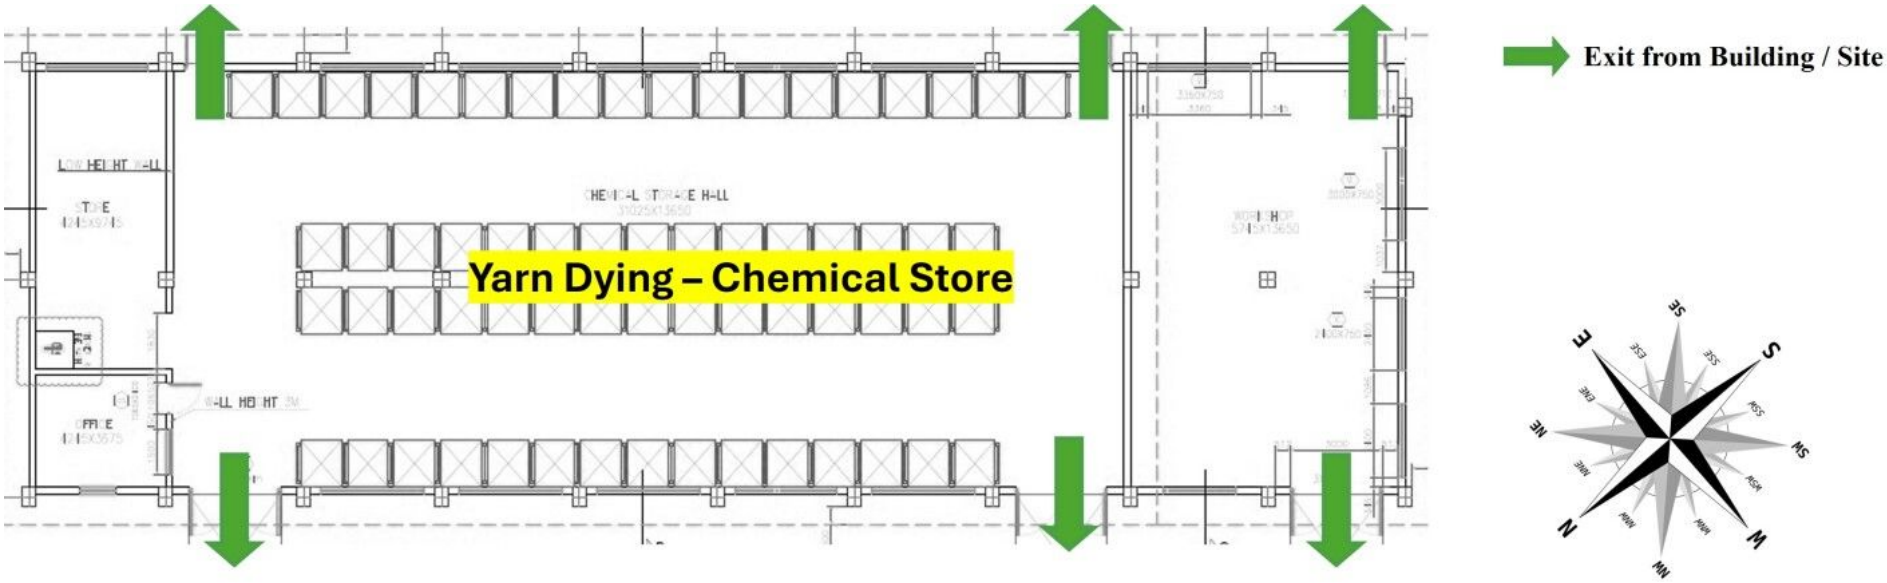


Figure 1.16. Egress layout for Yarn Dying - Chemical Store

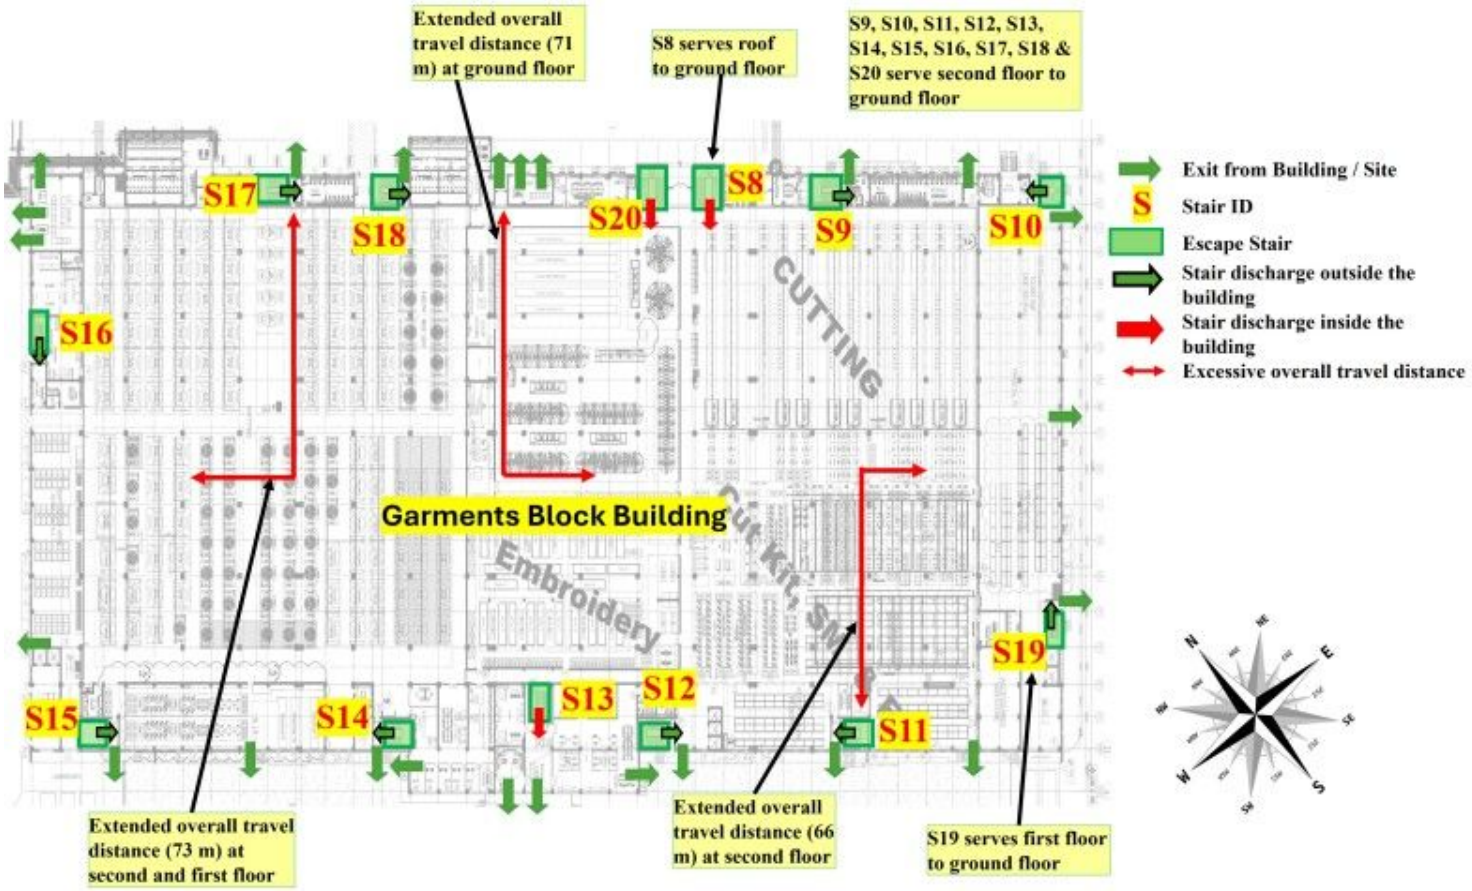


Figure 1.17. Egress layout for Garments Block Building

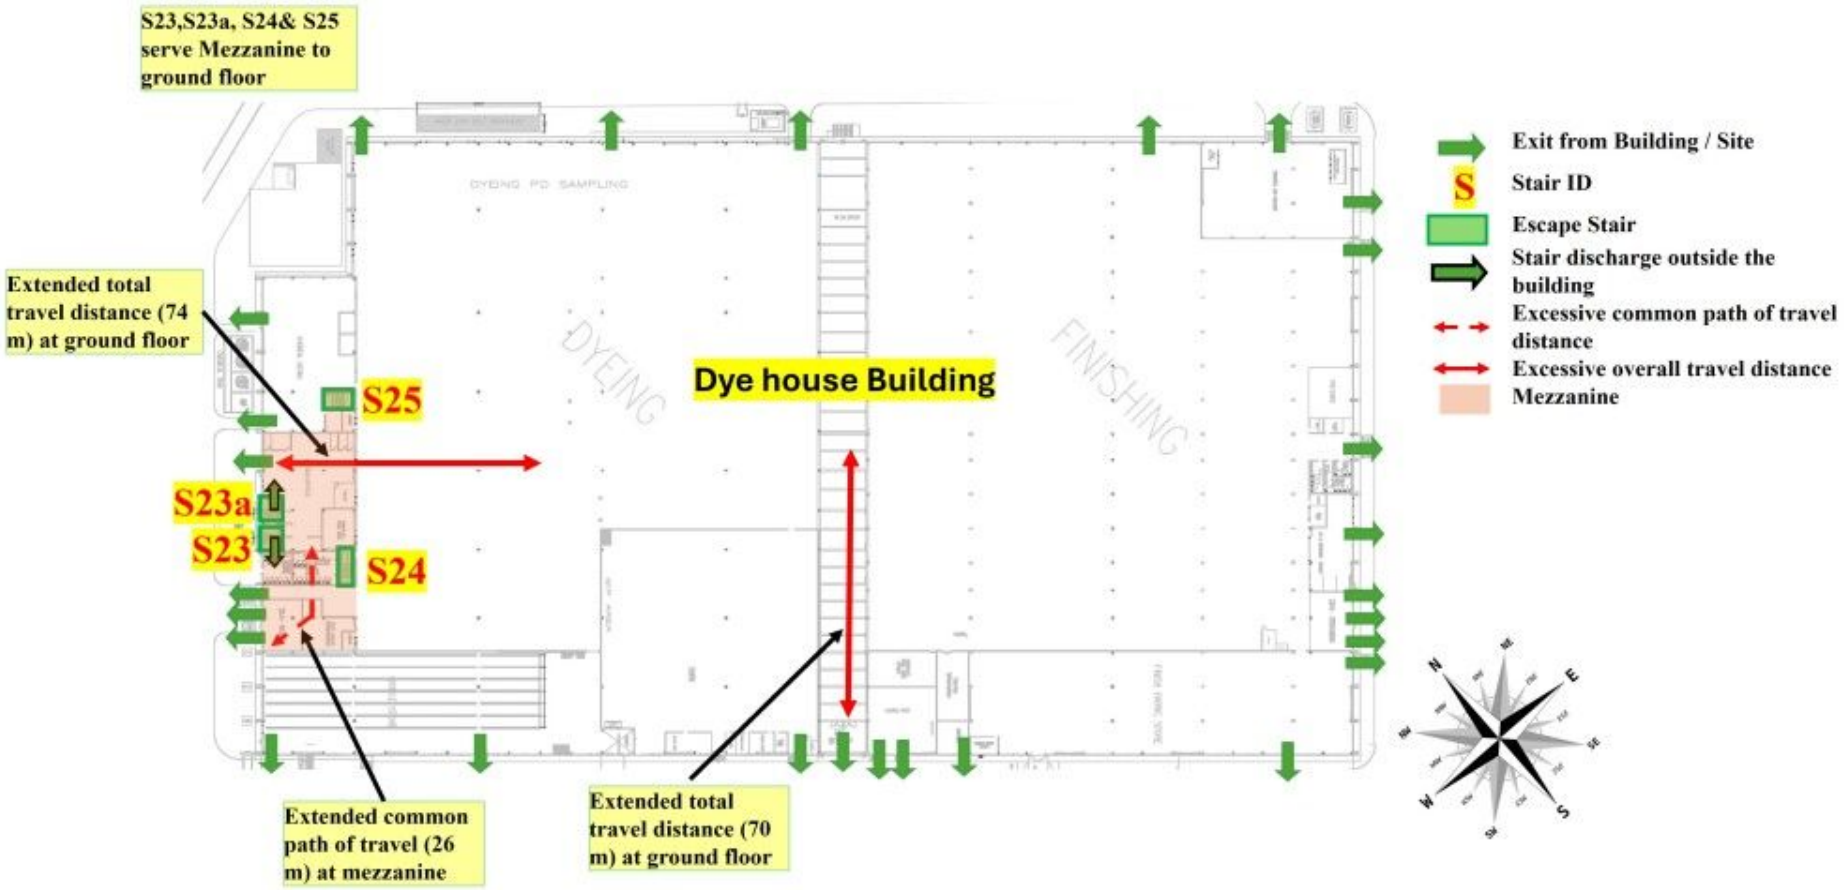


Figure 1.18. Egress layout for Dye house Building

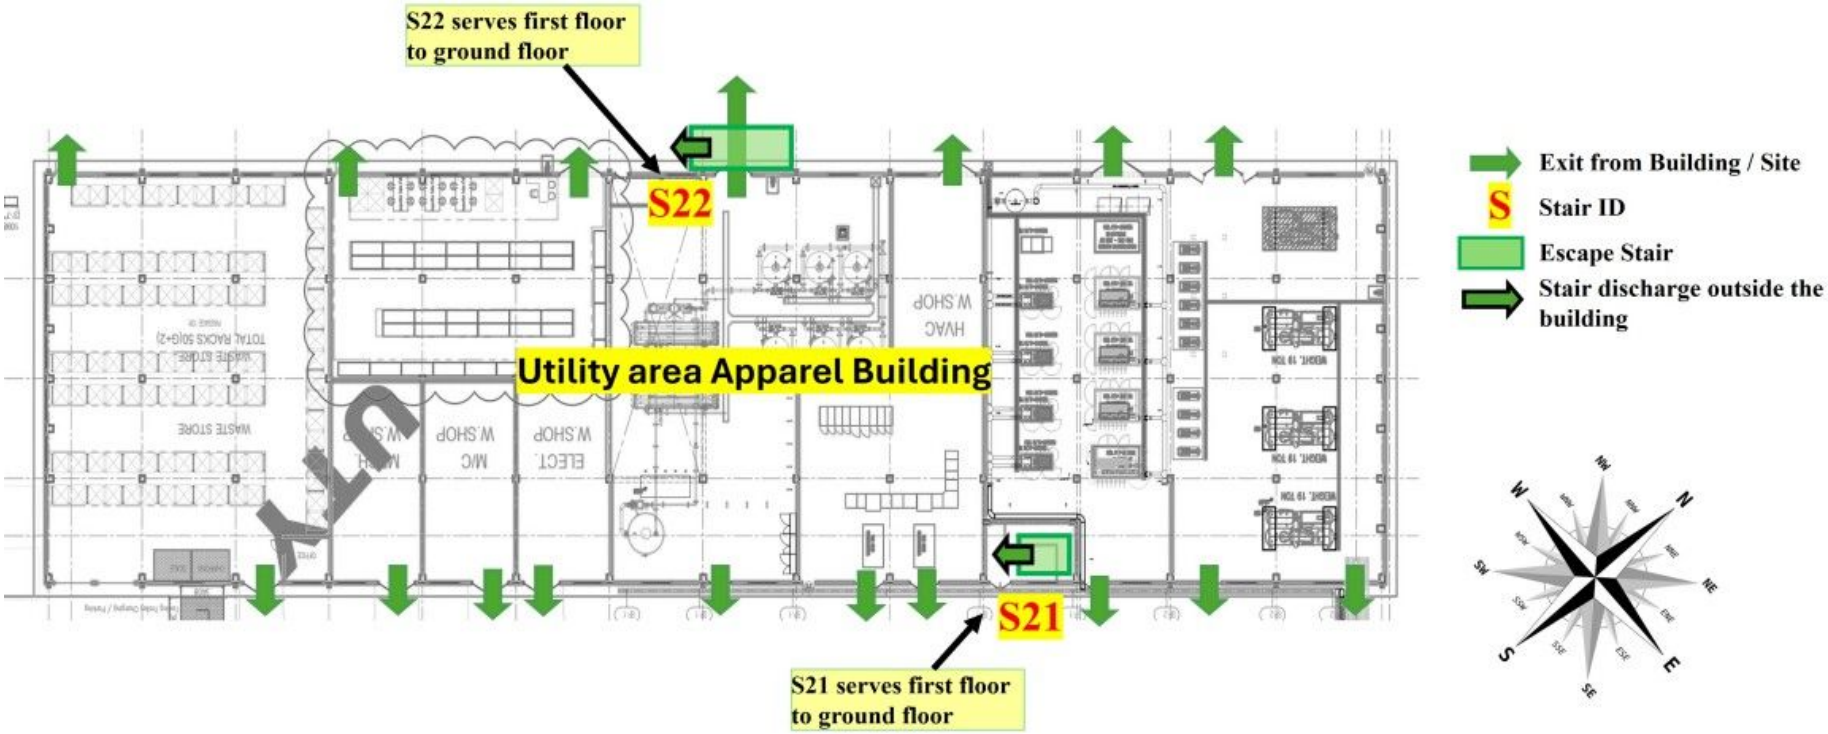


Figure 1.19. Egress layout for Utility area Apparel Building



Figure 1.20. Egress layout for Marketing Building

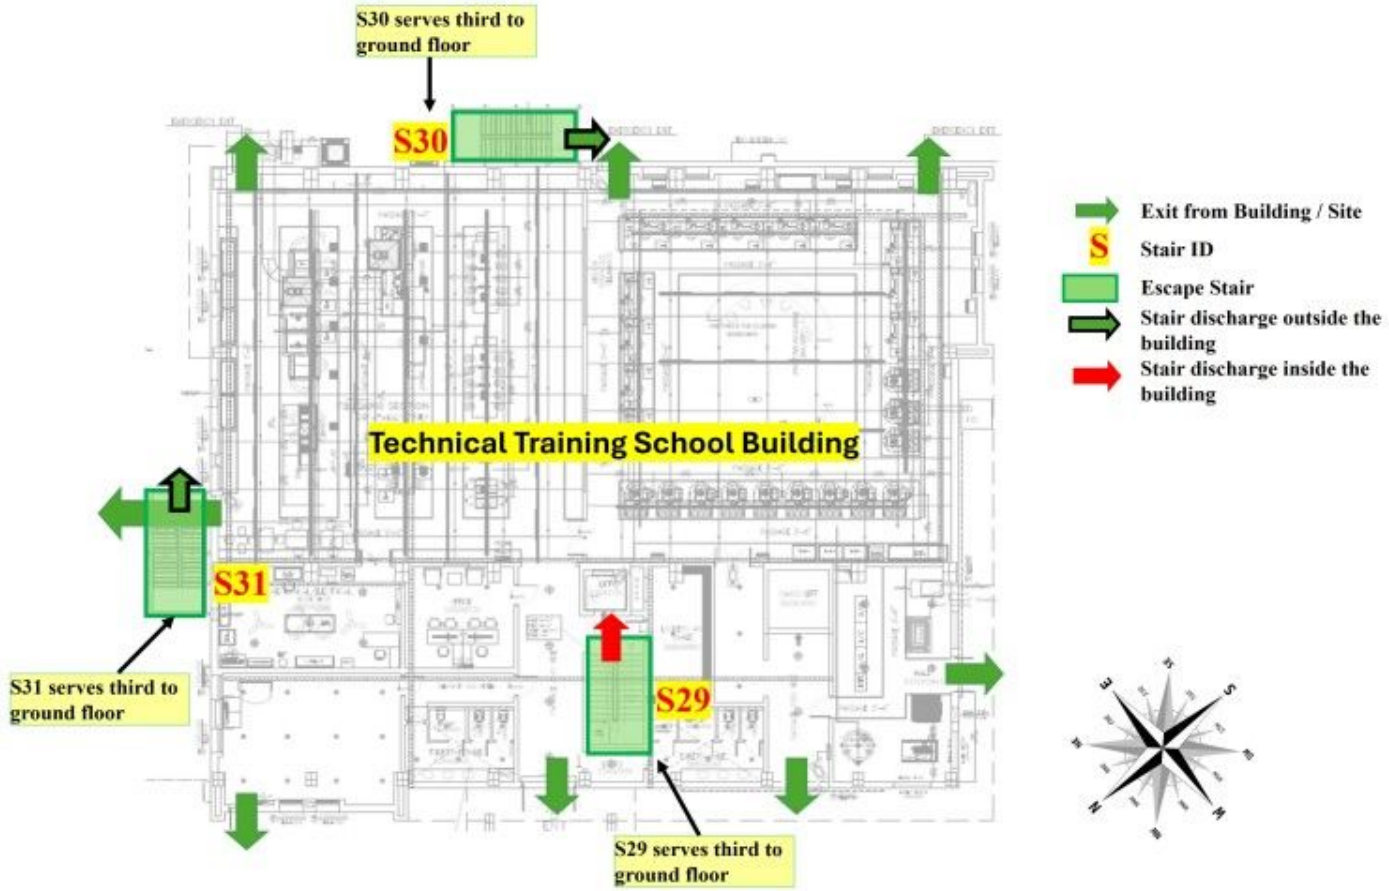


Figure 1.21. Egress layout for Technical Training School Building

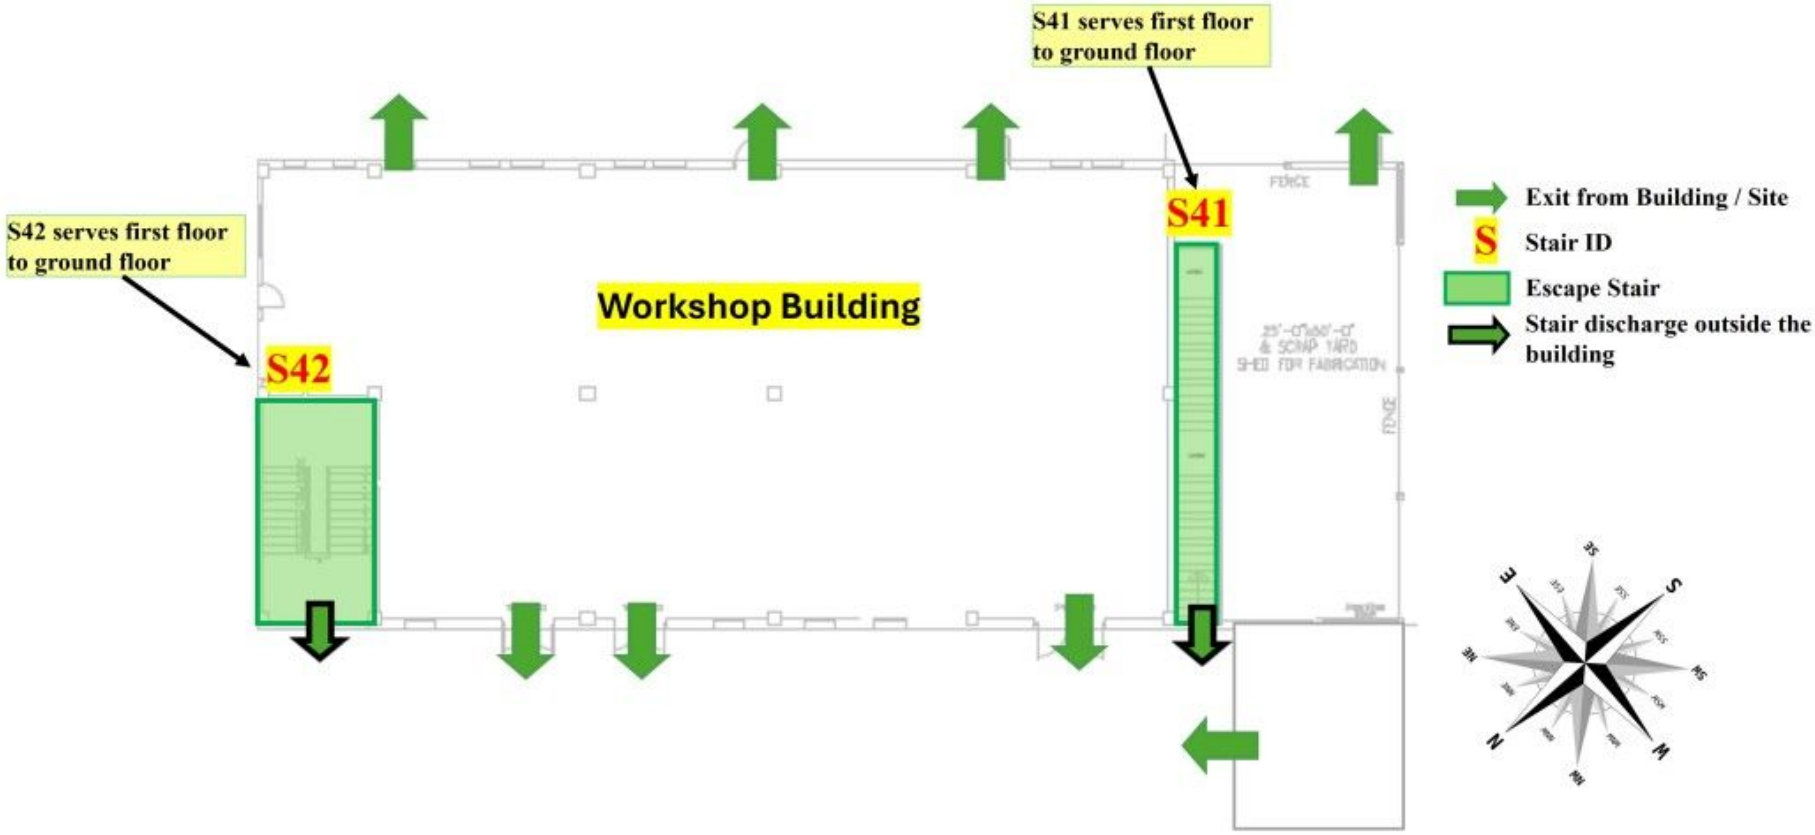


Figure 1.22. Egress layout for Workshop Building

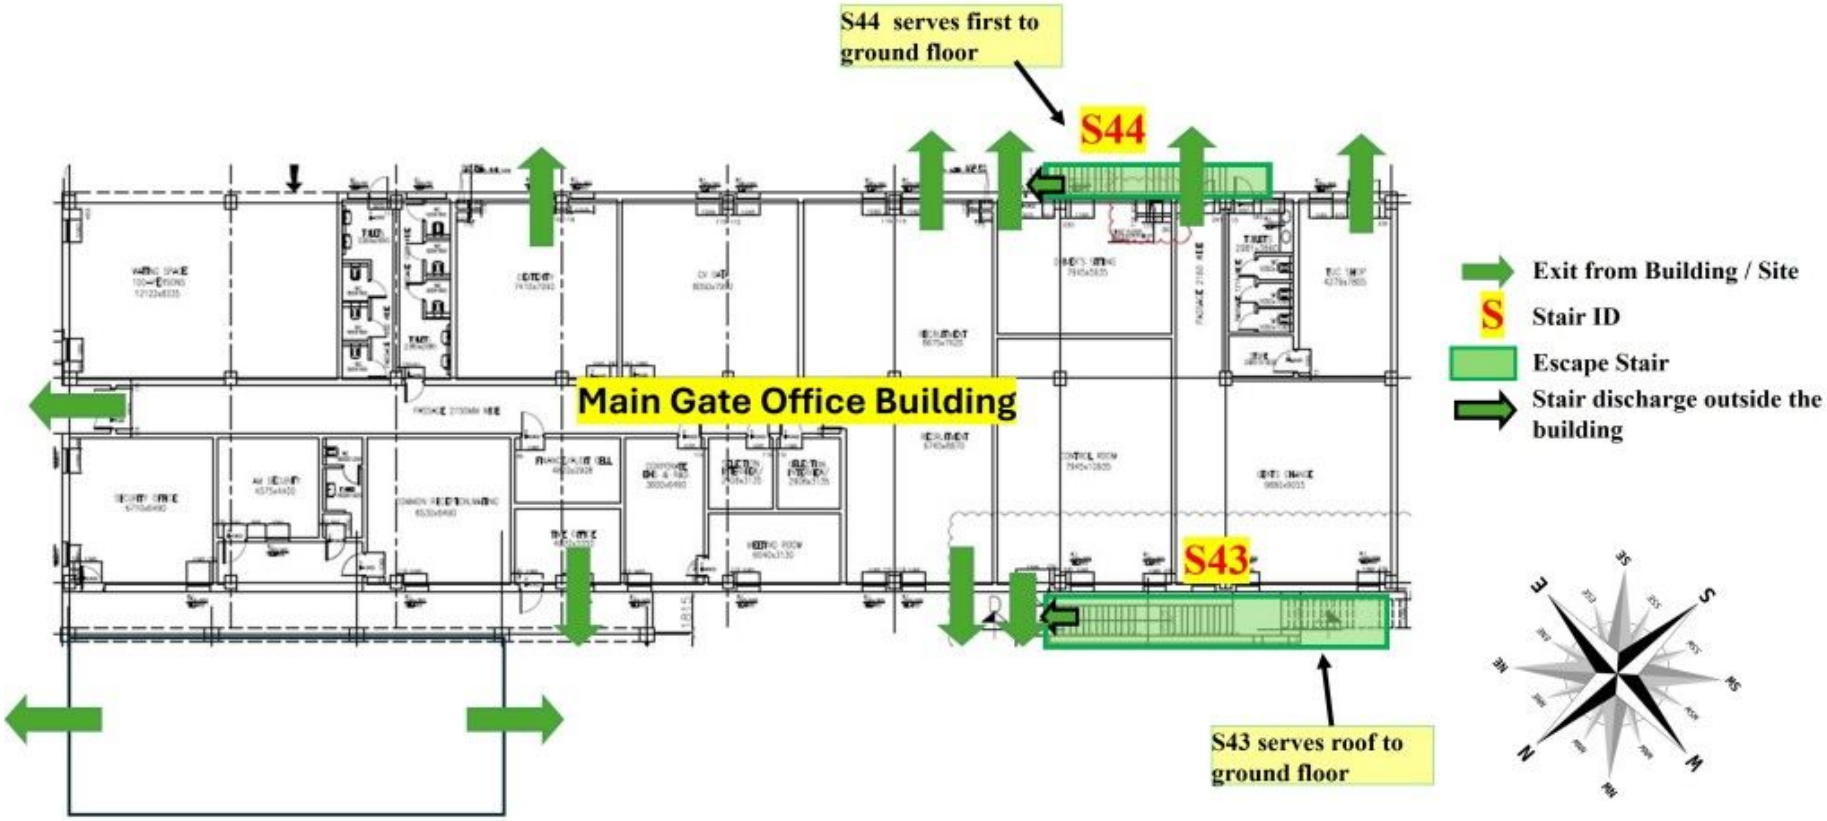


Figure 1.23. Egress layout for Main Gate Office Building

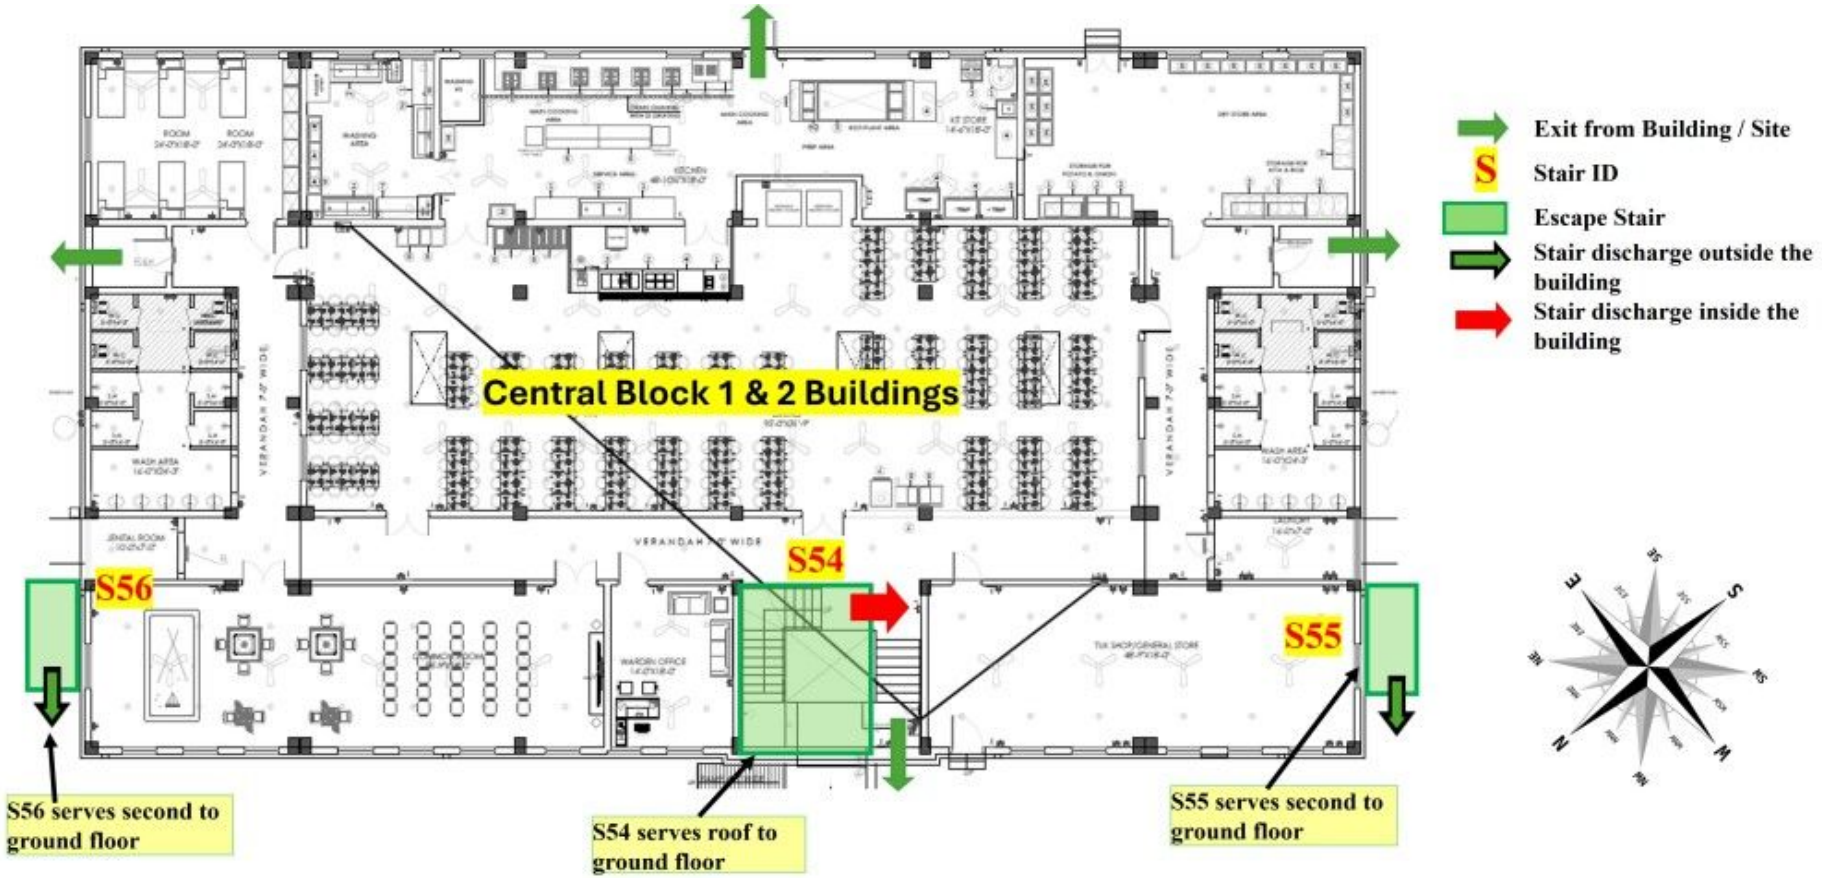


Figure 1.24. Egress layout for Central Block 1 & 2 Buildings (Typical Buildings)

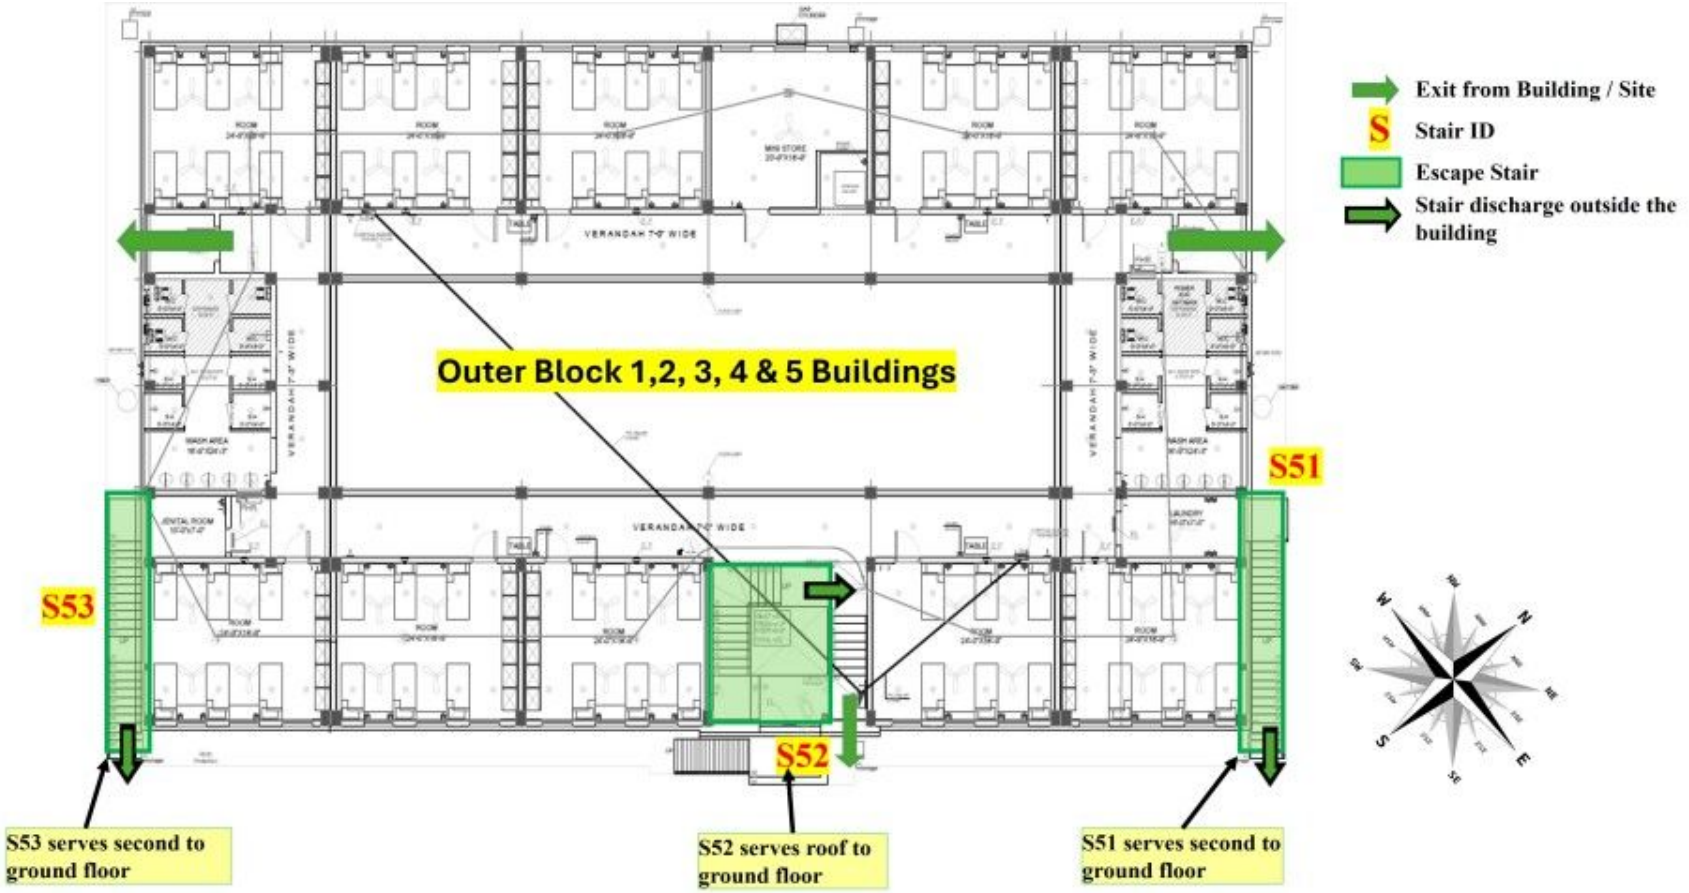


Figure 1.25. Egress layout for Outer Block 1,2,3,4 & 5 Buildings (Typical Buildings)

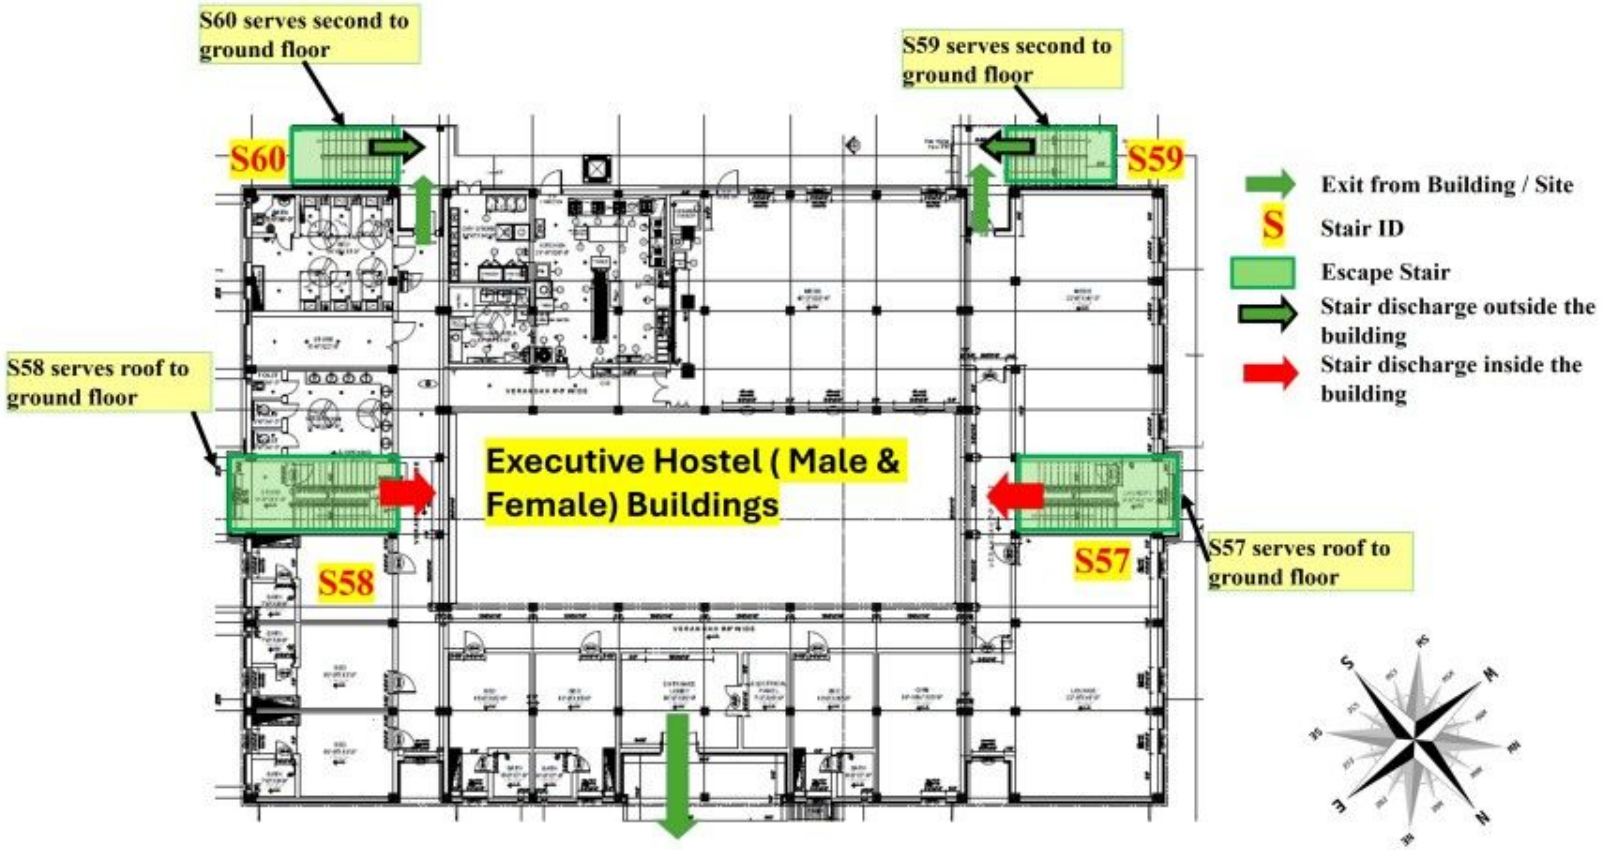


Figure 1.26. Egress layout for Executive Hostel (Male & Female) Buildings (Typical Buildings)

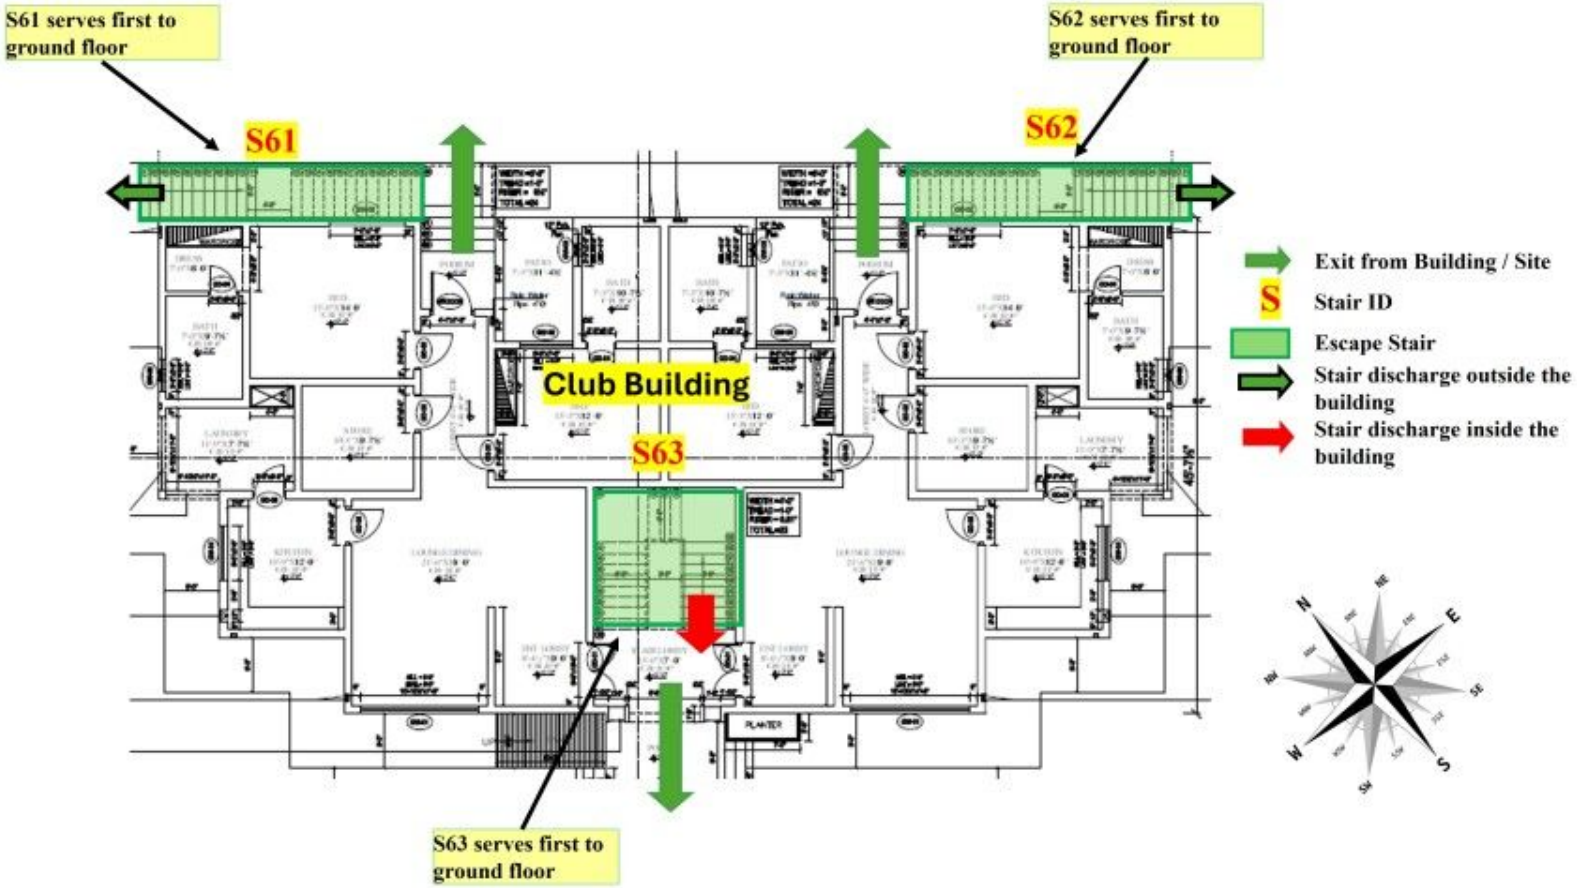


Figure 1.27. Egress layout for Club Building

3.2 Building Use

Floor Level	Occupancy	Occupant Load	No. of Exits	Excessive Travel Distance		
				Total Travel Distance	Common Path	Dead End
Office Block Building						
Roof	Unoccupied	-	-	-	-	-
First floor	Offices and meeting room	35	1	-	26m	-
Ground Floor	Offices, meeting room and kitchen	60	7	-	-	-
Canteen Building						
Roof	Unoccupied	-	-	-	-	-
First floor	Dining area	80	3	-	-	-
Ground Floor	Prayer area (Male)	40	2	-	-	-
	Prayer area (Female)	40	2	-	-	-
	Dining (Differently abled)	10	1	-	-	-
	Kitchen	10	3	-	-	-
Processing Lab Building						
Roof	Unoccupied	-	-	-	-	-
Ground Floor	Accessory stores	30	4	-	-	-
	Sampling area	30	4	-	-	-
	Waste management area	25	3	-	-	-
	Processing area, labs, offices and chemical storage	70	6	-	-	-
Value Stream Unit 2 Building – HD 5						
Roof	Unoccupied	-	-	-	-	-
Ground Floor	Electronic lab	8	2	-	-	-
	AHU and LT room	15	6	-	-	-
	Store, offices, knitting and finishing	400	12	-	-	-
	Metal free zone finish good store	40	2	-	-	-
	Accessory store	30	2	-	-	-
Value Stream Unit 1 Building – HD 5						
Roof	Unoccupied	-	-	-	-	-
Ground Floor	Electronic lab	8	1	-	-	-
	Red tag 1 area	4	1	-	-	-
	Control room	4	1	-	-	-
	AHU and LT room	15	6	-	-	-
	Store, offices, knitting and finishing	400	11	-	-	-

	Metal free zone finish good store	40	2	-	-	-
	Spare store	30	2	-	-	-
	Red tag 2 area	5	1	-	-	-
	Charging point	5	1	-	-	-
	Chemical store	8	2	-	-	-
Value Stream Unit 1 Building – HD 6						
Roof	Unoccupied	-	3	-	-	-
Ground Floor	AHU and LT room	12	7	-	-	-
	Store, finishing, offices, electronic lab	300	11	-	-	-
	Finish good store, office, prayer area, sampling	150	4	-	-	-
	Accessory store	40	2	-	-	-
Value Stream Unit 2 Building – HD 6						
Roof	Unoccupied	-	3	-	-	-
Ground Floor	AHU and LT room	12	6	-	-	-
	Store, finishing, offices and electronic lab	300	11	-	-	-
	Finish good store, office, prayer area, sampling	150	3	-	-	-
	Dining, kitchen and store	140	4	-	-	-
Yarn Dying Building						
Roof	Unoccupied	-	1	-	-	-
Mezzanine	Lab, office, under construction area and dying machines	35	4	-	26m	-
Ground Floor	Yarn dying, store and AHU	200	12	-	-	-
	Prayer area	20	2	-	-	-
	LT room	6	2	-	-	-
	RO Plant	8	3	-	-	-
Yarn Dying Chemical Store Building						
Roof	Unoccupied	-	-	-	-	-
Ground Floor	Chemical store	10	4	-	-	-
	Workshop	5	2	-	-	-
Garments Block Building						
Roof	Unoccupied	-	1	-	-	-
Second floor	Stitching, dining, kitchen, mosques, storage and offices	1600	12	73m & 66m	-	-
First floor	Stitching, dining, kitchen, mosques, storage and offices	1800	13	73m	-	-
Ground Floor	Cutting, store, embroidery and offices	1700	18	71m	-	-
	LT room (1)	5	3	-	-	-
	LT room (2)	5	3	-	-	-

Dye House Building						
Roof	Unoccupied	-	-	-	-	-
Mezzanine	Lab and offices	35	4	-	26m	-
Ground Floor	Dying, finishing, washing, chemical dispensing and storage	800	20	74m & 70m	-	-
	LT room (1)	4	2	-	-	-
	LT room (2)	5	3	-	-	-
	Thermal oil heaters	10	2	-	-	-
Utility Area Apparel Building						
Roof	Unoccupied	-	-	-	-	-
First floor	Offices	30	2	-	-	-
Ground Floor	Chiller and compressor area	10	5	-	-	-
	Electric panels	5	2	-	-	-
	RO Plant	5	2	-	-	-
	Electrical workshop	5	1	-	-	-
	Mechanical workshop 1	5	1	-	-	-
	Mechanical workshop 2	5	1	-	-	-
	Waste store	10	2	-	-	-
	Leftover store	10	2	-	-	-
	HVAC workshop	8	1	-	-	-
Marketing Building						
Roof	Unoccupied	-	-	-	-	-
First floor	Sampling, embroidery and offices	150	3	-	27m	-
Ground Floor	Under construction	-	8	-	-	-
Technical Training School Building						
Roof	Unoccupied	-	-	-	-	-
Third floor	Under construction	-	3	-	-	-
Second floor	Training halls, dining area, rest area, offices and storage	120	3	-	-	-
First floor	Training halls, dining area, rest area, offices and storage	120	3	-	-	-
Ground Floor	Training halls, lockers, rest area, offices, LT room and storage	100	8	-	-	-
Workshops Building						
Roof	Unoccupied	-	-	-	-	-
First floor	Offices	30	2	-	-	-
Ground Floor	Workshop 1	5	2	-	-	-
	Workshop 2	5	2	-	-	-
	Store	8	2	-	-	-

	Workshop 3	5	2	-	-	-
Main Gate Office Building						
Roof	Unoccupied	-	1	-	-	-
First floor	Office and under construction	25	2	-	-	-
Ground Floor	Control room	10	1	-	-	-
	HR and recruitment offices	30	4	-	-	-
	Time office	4	1	-	-	-
	Security offices	10	2	-	-	-
	Driver sitting	5	1	-	-	-
	Rest area	10	1	-	-	-
	TUC shop	8	1	-	-	-
Central Block 1 and Central Block 2 Building (Typical Buildings)						
Roof	Solar	-	1	-	-	-
Second floor	Dormitories	60	3	-	-	-
First floor	Dormitories	60	3	-	-	-
Ground Floor	Dormitories, kitchen and dining	150	4	-	-	-
Outer Block 1, 2, 3, 4 and 5						
Roof	Solar	-	1	-	-	-
Second floor	Dormitories	60	3	-	-	-
First floor	Dormitories	60	3	-	-	-
Ground Floor	Dormitories	60	3	-	-	-
Executive Hostel (Male) and Executive Hostel (Female) – Typical Buildings						
Roof	Unoccupied	-	2	-	-	-
Second floor	Dormitories	30	4	-	-	-
First floor	Dormitories	30	4	-	-	-
Ground Floor	Dormitories	30	3	-	-	-
Club Building						
Roof	Unoccupied	-	-	-	-	-
First floor	Gym and rest room	30	3	-	-	-
Ground Floor	Dining and sitting	60	3	-	-	-

There is sufficient exit capacity in all Buildings. Number of exits issue is observed at first floor of the Office due to exits are not meeting the remoteness criteria. Excessive travel distances are observed at following locations:

a. First floor of the Office Block Building.
b. Mezzanine of Yarn Dying Building.

c. Ground floor and Mezzanine of Dye House Building.
d. Ground, first & second floor of the Garments Block Building.
e. First floor of the Marketing Building.

4. Documentation

This table shows the details about the documentation provided by the factory.

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		Yes	18-08-2025	-
2.	Architecture Layout		Yes	-	-
3.	Sectional Layout		No	-	-
4.	Evacuation Maps		Yes	-	Missing at some places
5.	Emergency Action Plan		Yes	30-11-2021	Not as per Pakistan Accord Building Standards
6.	Inspection	Fire extinguishers	Yes	Jan, Feb, March 2026 5-3-2026	Not as per Pakistan Accord Building Standards
		Standpipe	Yes	5-3-2026	Not as per Pakistan Accord Building Standards
		Exit signage	Yes	5-3-2026	Not as per Pakistan Accord Building Standards
		Fire door	No	-	-
		Fire Pump	No	-	-
7.	Testing	Fire extinguishers	No	-	-
		Standpipe	No	-	-
		Exit signage	No	-	-
		Fire door	No	-	-
		Fire Pump	No	-	-
8.	Maintenance	Fire extinguishers	No	-	-
		Standpipe	No	-	-
		Exit signage	No	-	-

		Fire door	No	-	-
		Fire Pump	No	-	-
9.	Evidence of Fire Drills		Yes	30-03-2026 27-12-2025	Required details are missing
10.	Staff Training		Yes	26-02-2026 28-03-2026	Monthly available

5. Fire Safety Measures

During our fire site inspection of Interloop Ltd. (HD05) co-located w/Interloop Ltd. Apparel Park, a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Interloop Ltd. (HD05) co-located w/Interloop Ltd. Apparel Park. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-065945

Timeline	Remediation Plan
Immediate CAP-0078407	Factories should begin remediation of CAP items—such as installing extinguishers, signage, and clearing escape routes—using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape
- Sliding doors shall not serve for escape from areas with more than 10 occupants

This is not always achieved, examples include (list not exhaustive):
- Multiple escape doors are lockable in the factory i.e. lockable escape door at the ground floor of the Office Block Building, roller doors installed at ground floor of the Yarn Dying Building (with out fail to open mechanism & not integrated with the Fire alarm control panel).
- Doors serving areas with over 50 occupants swing against the direction of escape i.e. escape door at the ground floor of the Office Block Building swing against the direction of escape.
- Sliding doors serve for escape from areas with more than 10 occupants i.e. Shutter door installed at the ground floor of the Yarn Dying Building.

Recommended remedial actions are provided below.F-202604-065418

Timeline	Remediation Plan
Immediate CAP-0078038	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0078039	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5. Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, that are side swinging and open in the direction of travel to an exit.

Longer Term CAP-0078040	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Escape door at the ground floor of the Office Block Building swing against the direction of escape.



Figure 2.2 - Shutter door installed at the ground floor of the Yarn Dying Building



Figure 2.3 - Roller doors installed at ground floor of the Yarn Dying Building



Figure 2.4 - Lockable escape door at the ground floor of the Office Block Building

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.

This is not always achieved, examples include (list not exhaustive):
-Stair discharges inside the building at a distance from building exit i.e. S1, S8, S13, S20, S29, S54 (Typical for Central Block 1 &2 Buildings), S57,S58 (Typical for Executive Hostel Male & Female Buildings) & S63

Recommended remedial actions are provided below.F-202604-065419

Timeline	Remediation Plan
Medium Term CAP-0077983	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks)
Longer Term CAP-0077984	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted.



Figure 2.5 - Stair S29 discharges inside a Building.



Figure 2.6 - Stair S1 discharges inside a Building.

7.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Standard. The standard provides limitations on:
- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.
- Travel distance, i.e. the overall travel distance the occupants have to travel to enter a protected stair enclosure or exit outside the building.

This is not always achieved, examples include (list not exhaustive):
- Common path of travel distances exceed permitted limits at following locations:
 a. First floor of the Office Block Building (26m).
 b. Mezzanine of the Yarn Dying Building (26m).
 c. First floor of the Marketing Building (27m).
 d. Mezzanine of the Dye House Building (26m).

- The travel distance to the nearest alternative exits exceeds the permissible limits throughout the Garments Block Building and Dye House Building; however, a few representative locations are listed below for reference only:
 a. Second floor of the Garments Block Building (73m & 66m).
 b. First floor of the Garments Block Building (73m).
 c. Ground floor of the Garments Block Building (71m).
 d. Ground floor of the Garments Block Building (74m & 70m).

Recommended remedial actions are provided below.F-202604-065415

Timeline	Remediation Plan
Medium Term CAP-0078096	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Standard.
Longer Term CAP-0078097	Implement the plan previous reviewed by Pakistan Accord and ensure all travel distances to emergency exits meet the requirements of the Pakistan Accord Standard.

7.4 Number of exits

Per Pakistan Accord Standard, the exit provisions should meet the following:
- Exits to be sufficiently spaced apart to be classed as alternative exits.

This is not always achieved, examples include (list not exhaustive):
- Exits do not meet the remoteness criteria i.e. Two exits at the first floor of the Office Block Building are not meeting the remoteness criteria and considered as a single exit.F-202604-065417

Timeline	Remediation Plan
Medium Term CAP-0078044	Review each floor and area to ensure that the number of exits complies with Pakistan Accord Standard. Develop plans and drawings to provide additional exits where necessary. Submit the plan and drawings to Pakistan Accord for review and approval prior to commencing rectification works.
Longer Term CAP-0078045	Implement the above plan as agreed with Pakistan Accord. Number of exits from all floors and parts of the building should comply with Pakistan Accord Standard.



Figure 2.7 - Exits at the first floor of the Office Block Building are not meeting the remoteness criteria

7.5 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings into multiple stairs i.e. S2,S22, S27& S28 (hose cabinet from stair enclosure to production), S51, S52 and S53
- Missing fire rated enclosure and fire doors in stair i.e. S1 (all floors), S8 (all floors), S13 (all floors)
- Fire door specification, details and listing documentation are missing.
- Fire load in stairs i.e. S4 (first floor), S20 (ground floor), S37 (first floor) & S60 (ground floor).

Recommended remedial actions are provided below.F-202604-065414

Timeline	Remediation Plan
Immediate CAP-0078098	Remove fire load and any other obstructions due to stored items from stairs. Provide fire doors specifications, details and listing documentation for the verification purpose.
Medium Term CAP-0078099	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.
Longer Term CAP-0078100	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.8 - Unprotected openings (windows) into stair S22



Figure 2.9 - Missing fire rated enclosure and fire doors in stair S1 (all floors)



Figure 2.10 - Fire load in stair S20 (ground floor)



Figure 2.11 - Unprotected opening in S28 (hose cabinet from stair enclosure to production)

7.6 Exit discharge

Exit discharge routes outside the building should be sufficiently protected so that people can escape safely in the event of a fire anywhere in the building. This includes:
- External escape routes should not lead via high-risk areas.

This is not always achieved, examples include (list not exhaustive):

- External escape routes are through high-risk areas i.e. North-west side exit of Dye House Building is passing through steam condensate tank.

Recommended remedial actions are provided below.F-202604-065420

Timeline	Remediation Plan
Medium Term CAP-0077981	Prepare drawings showing proposed fire separating construction to exit discharge routes. These shall be submitted to Accord for review and approval prior to commencing rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge routes - Details of proposed fire resisting walls and fire door assemblies required to protect discharge routes Provide additional exits from site.
Longer Term CAP-0077982	- Ensure external exit discharge routes are adequately fire separated from the rest of the building. - Ensure external escape routes do not pass close to unprotected high-risk areas



Figure 2.12 - North-west side exit of Dye House Building is passing through steam condensate tank

7.7 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs in corridors and circulation areas i.e. missing exit sign in corridor of the Processing Lab Building (ground floor).
- Missing exit signs in production areas i.e. missing exit signs in knitting hall of the Value stream unit 2 Building – HD 5, missing exit signs in knitting hall (ground floor) of the Garments Block Building.
- Exit signs are not clear / misleading i.e misleading exit signs in stair S37 (exit signage leading from enclosure to building)
- Electrically powered exit signs are not a tested and listed system.

Recommended remedial actions are provided below.F-202604-065416

Timeline	Remediation Plan
Immediate CAP-0078092	Remove misleading directional escape signs.
Medium Term CAP-0078093	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0078094	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.13 - Missing exit sign in corridor of the Processing Lab Building (ground floor)



Figure 2.15 - Missing exit signs in knitting hall (ground floor) of the Garments Block Building



Figure 2.14 - Misleading exit signs in stair S37 (exit signage leading from enclosure to building)

8. Fire Rated Construction

8.1 Structural fire rating

Structural fire rating of buildings must meet the requirements of Pakistan Accord Standard, which requires that non-sprinklered buildings are provided with structural fire protection if the floor is occupied. Where a building does not meet these conditions, fire protection of the structural steelwork and/or sprinkler protection are required.
Mezzanine levels generally do not need to be structurally fire rated if they are less than 1/3 of the adjacent floor area. Mezzanines that are more than 1/3 of the adjacent floor area they serve should be treated as any other floor. Mezzanine levels containing heavy machinery should be have a fire rated structure irrespectively of the mezzanine size.

The following deficiencies have been observed on site, including (list not exhaustive):
- Heavily loaded mezzanine with no fire protection to supporting structure i.e. heavy loaded steel floored mezzanine in Dye House Building.
- Ground-only Pre-Engineered Buildings (PEB) or steel sheds with a floor area ≥ 2,350 sq. m shall have supporting structural elements with a minimum 2-hour fire resistance rating, while those with a floor area ≥ 1,440 sq. m but < 2,350 sq. m shall have a minimum 1-hour fire resistance rating.; a few examples are listed below for reference:

a. Value stream unit 2 Building- HD 5
b. Value stream unit 1 Building- HD 5
c. Value stream unit 2 Building- HD 6
d. Value stream unit 1 Building- HD 6
e. Dye House Building

Recommended remedial actions are provided below.F-202604-065400

Timeline	Remediation Plan
Medium Term CAP-0078317	Factory consultant to identify level of fire protection needed for the structure based on the building height, area, provision of sprinklers and frontage space around the building, in accordance with Pakistan Accord Standard and reference to NFPA 5000 Section 7.6.2. Submit proposal for level of fire protection required and methods for achieving it to Pakistan Accord for review.

Longer Term CAP-0078318	Implement the proposal for addressing the fire protection of the structure based on proposal reviewed previously, and in accordance with Pakistan Accord Standard.



Figure 2.16 - Heavy loaded steel floored mezzanine in Dye House Building steel.



Figure 2.17 - Pre Engineered Building (PEB) shed of Dye House Building

8.2 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):

-LT rooms are not fire separated from production hall in multiple Buildings; a few examples are listed below for reference:
  a. LT room is not fire separated from office area (ground floor) of the Office Block Building
  b. LT room is not fire separated from production hall (second floor) of the Garments Block Building
-Air Handling Units (AHUs) are not fire separated from production halls and storage in multiple Buildings; a few examples are listed below for reference:
  a. AHUs is not fire separated from production hall and storage of Value stream unit 1 Building – HD 5,
  b. AHUs is not fire separated from production hall and storage of Value stream unit 2 Building – HD 5
  c. AHUs is not fire separated from production hall and storage of Value stream unit 1 Building – HD 6
  d. AHUs is not fire separated from production hall and storage of Value stream unit 2 Building – HD 6
- Electric panel rooms are not fire separated from rest of the building in multiple Buildings and locations; a few examples are listed below for reference:
  a. Electric panel room is not fire separated from chiller area in Value stream unit 1 Building – HD 6
  b. Electric panel room is not fire separated from production hall of Dye House Building
  c. Electric panel room is not fire separated from compressor & chiller area (ground floor) of the Utility Area Apparel Building.
  d. Electric panel room is not fire separated from Gas boiler area (ground floor) of Gas Boiler Ancillary Structure.
- Kitchens are not fire separated from Dining area at multiple locations; a few examples are listed below for reference:
  a. Kitchen is not fire separated from the dining hall (second & first floor) of the Garments Block Building.
  b. Kitchen is not fire separated from dinning hall of Value stream unit 2 Building – HD 6
  c. Kitchen is not fire separated (ground & first floor) from rest of the building in Apartment Ancillary.
  d. Kitchen is not fire separated from mess hall of the Executive Hostel (Male & Female) Buildings (ground floor).
- Transformers are not fire separated from rest of the building i.e. Transformers are not fire separated from chillers in Utility 1 Ancillary, Transformers are not fire separated from compressor area in Utility 1 Ancillary
- Workshops are not fire separated from the production hall at multiple locations i.e. workshops are not fire separated from the production hall (ground, first & second floor) of the Garments Block Building
- Electronic lab is not fire separated from knitting hall of of Value stream unit 1 Building – HD 6
- Thermal Oil Heaters are not fire separated from the production hall (ground floor) of the Dye House Building.

Recommended remedial actions are provided below.F-202604-065402

Timeline	Remediation Plan
Medium Term CAP-0078204	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0078205	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.18 - Transformers are not fire separated from chillers in Utility 1 Ancillary,



Figure 2.19 - LT room is not fire separated from production hall (second floor) of the Garments Block Building



Figure 2.20 - Thermal Oil Heaters are not fire separated from the production hall (ground floor) of the Dye House Building



Figure 2.22 - Workshops is not fire separated from the production hall of the Garments Block Building



Figure 2.21 - AHUs is not fire separated from production hall and storage of Value stream unit 1 Building – HD 5,



Figure 2.23 - Kitchen is not fire separated (ground floor) from rest of the building in Apartment Ancillary.



Figure 2.24 - Electronic lab is not fire separated from knitting hall of of Value stream unit 1 Building – HD 6

8.3 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):

- Lift shafts are not separated with fire rated construction i.e. cargo lift shaft is not fire separated with fire rated construction in Canteen Building, lift shafts are not fire separated with fire rated construction in Garments Block Building,

Recommended remedial actions are provided below.F-202604-065404

Timeline	Remediation Plan
Medium Term CAP-0078198	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0078199	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.25 - Lift shaft is not fire separated with fire rated construction in Garments Block Building



Figure 2.26 - Cargo lift shaft is not fire separated with fire rated construction in Canteen Building

8.4 Floor openings

Per Pakistan Accord Standard, each floor should be fire separated using 2 hours fire resisting construction with 90 minutes fire rated door/shutter assemblies.

The following deficiencies have been observed on site, including (list not exhaustive):
- Floor openings connecting different levels of the Building. i.e. floor opening connecting first and ground floor of the Marketing Building, floor opening connecting first and ground floor of the Club Building.

Recommended remedial actions are provided below.F-202604-065403

Timeline	Remediation Plan
Medium Term CAP-0078202	Prepare a plan and drawings showing the proposed fire separation details. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of floor openings - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0078203	Provide fire rated separation between floors by implementing the plan reviewed previously by Pakistan Accord.



Figure 2.27 - Floor opening connecting first and ground floor of the Club Building

8.5 Atrium

An atrium is a large-volume space created by floor openings connecting two or more stories and covered at the top. Escape via an atrium is not permitted unless the building is fully sprinklered, among other conditions.
Per Pakistan Accord Standard, an atrium must be separated from the adjacent spaces by 1 hour fire resisting construction with opening protectives and a smoke control system may needed.

The following deficiencies have been observed on site, including (list not exhaustive):
- Large opening between two or more floors / portions of floors i.e. Large opening connecting ground, first and second floor of the Garments Block Building, Large opening connecting first and second floor of the Garments Block Building.

Recommended remedial actions are provided below.F-202604-065772

Timeline	Remediation Plan
Medium Term CAP-0078330	Prepare drawings showing the proposed fire separation and means of escape from all areas bordering on the atrium and submit to Pakistan Accord for review.
Longer Term CAP-0078331	Provide fire rated construction including opening protection assemblies i.e. fire doors and alternative means of escape as needed and according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.28 - Large opening connecting first and second floor of the Garments Block Building

8.6 Separation of occupancies

Residential sleeping areas should comply with special measures required for sleeping occupancies. Such measures include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key.
- Providing an automatic fire detection and alarm system

The following deficiencies have been observed on site, including (list not exhaustive):
- Locking devices on doors do not allow for free escape under all circumstances from all dormitories.
- No fire alarm system inside the sleeping rooms of all dormitories i.e. Outer Blocks, Central blocks .

Recommended remedial actions are provided below.F-202604-065399

Timeline	Remediation Plan
Medium Term CAP-0078322	Document proposals for design of remedial measures to ensure compliance with all fire safety requirements for sleeping occupancies to comply with Pakistan Accord Standard. Submit proposals to Pakistan Accord for review.
Longer Term CAP-0078323	Implement remediation measures to ensure full compliance with dormitory requirements of Pakistan Accord Standard and Pakistan Building Code in accordance with previously reviewed design.



Figure 2.29 - No fire alarm system inside the outer block (ground floor)

8.7 Separation of occupancies

Pakistan Accord Standard requires different occupancy types to be fire separated from each other. The aim is to limit the fire to only one occupancy type.

The following deficiencies have been observed on site, including (list not exhaustive):

- Large office areas not fire separated from the production areas i.e. Office area is not fire separated from the production hall (second, first and ground floor of the Garments Block Building.
- Areas with above 50 occupants is not fire separated from the rest of the building (canteen, prayer area etc.):

a. Dining hall is not fire separated from the production hall (second and first floor) of the Garments Block Building.
b. Dining hall is not fire separated from the production hall and storage (ground floor) of the Value Stream Unit 2- HD-06.
c. Mosque is not fire separated from the production hall (second and first floor) of the Garments Block Building.

Recommended remedial actions are provided below.F-202604-065405

Timeline	Remediation Plan
Medium Term CAP-0078101	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Different occupancy types in the building - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0078102	Provide fire rated separation between occupancies as per proposal reviewed by Pakistan Accord



Figure 2.30 - Dining hall is not fire separated from the production hall (second floor) of the Garments Block Building



Figure 2.31 - Office area is not fire separated from the production hall (first floor) of the Garments Block Building



Figure 2.32 - Mosque is not fire separated from the production hall (second floor) of the Garments Block Building

8.8 Separation of occupancies

Pakistan Accord Standard requires different buildings with the fire proximity risk to be fire separated from each other. The aim is to limit the fire to single building.

The following deficiencies have been observed on site, including (list not exhaustive):
- Outer Block Building 1 and Outer Block Building 2 are not fire separated.
- Canteen Building is not fire separated from the Processing Lab Building.

Recommended remedial actions are provided below.F-202604-065773

Timeline	Remediation Plan
Medium Term CAP-0078332	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0078333	Provide fire rated separation between buildings as per proposal reviewed by Pakistan Accord



Figure 2.33 - Canteen Building is not fire separated from the Processing Lab Building.

8.9 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building; a few examples are listed below for reference:
  a. Storage hall is not fire separated from knitting hall of Value Stream Unit 2 - HD 5.
  b. Finish good store is not fire separated from the finishing hall of the Value Stream Unit 1 - HD 6.
  c. Super market storage is not fire separated from the cutting (ground floor) of the Garments Block Building.
  d. Grey fabric store is not fire separated from dying hall (ground floor) of the Dye House Building.
  e. Main store is not fire separated from escape route (second floor) of the Technical Training School Building.

Recommended remedial actions are provided below.F-202604-065398

Timeline	Remediation Plan
Immediate CAP-0078327	Provide details of the installed fire curtains (e.g. listing, fire rating period, operating mechanism, egress capability)

Medium Term CAP-0078328	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0078329	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard



Figure 2.34 - Grey fabric store is not fire separated from dying hall (ground floor) of the Dye House Building.



Figure 2.36 - Storage hall is not fire separated from knitting hall of Value Stream Unit 2 - HD 5



Figure 2.35 - Super market storage is not fire separated from the cutting (ground floor) of the Garments Block Building

9. Fire Suppression

9.1 Standpipe system

Per Pakistan Accord Standard a Class-I standpipe systems is required in the building. The system should be designed and installed in accordance with NFPA 14.
Technical Training School Building requires standpipe system due to height of the topmost occupied floor exceeding 15m. Garments Block Building requires standpipe system due to the number of stories exceeding 2 with a fire floor area exceeding 2325 sq m.

The following deficiencies have been observed on site, including (list not exhaustive):
- Standpipe system comprise of non-listed products in both Technical Training School Building and Garments Block Building.
- Missing standpipe outlets in stairs in Technical Training School Building.

Recommended remedial actions are provided below.F-202604-065412

Timeline	Remediation Plan
Medium Term CAP-0078335	(1) Submit design documentation for the required standpipe system and supporting infrastructure to Pakistan Accord for review before purchasing any new equipment. Design documentation to include drawings, technical data sheets and product certifications of all listed equipment to show full compliance of the system with NFPA 14, 20, 22, and 24.
Medium Term CAP-0078336	(2) Submit documentation to Pakistan Accord showing that an L/C has been opened for import of any components required for the system design submitted earlier
Longer Term CAP-0078337	(3) Submit documentation to Pakistan Accord demonstrating that all materials, both imported and locally procured, have been purchased and are available on site for installation of the system.
Longer Term CAP-0078338	(4) Once installation of the system is complete, factory to submit full "as-built" documentation of the system to Pakistan Accord for review.
Longer Term CAP-0078339	(5) Factory to advise Pakistan Accord when system installation is fully completed and the system is fully functional. Pakistan Accord will then arrange a verification inspection to ensure that the installation fully complies with the previously reviewed design documentation

Longer Term CAP-0078340	(6) Provide full testing and commissioning (T&C) certification from the system installer and make provision for attendance of the system installer, factory technical personnel and Pakistan Accord technical team to witness a final T&C demonstration verification on site. On successful completion of this T&C verification inspection, remediation of the system will be complete



Figure 2.37 - Standpipe system comprise of non-listed products

9.2 Fire pumps

Per Pakistan Accord Standard, a complete fire pump set is required. The pump set should be designed and installed in accordance with NFPA 20. The system should comprise of a) Electric pump (Main), b) Diesel Pump (Back-Up), and c) Jockey Pump. Each pump should be provided with individual drivers and controllers. Pumps shall be installed with positive suction. These measures are intended to provide a level of resilience whereby a failure of a pump or lack of power in the building will not compromise fire water supply in the building.

The following deficiencies have been observed on site, including (list not exhaustive):

- No design document, hydraulic calculation and listing documentations were provided for the installed Fire Pumps.
- The pressure setting of the fire pump requires adjustment.
- No alarm check valve is installed in the pump room.

Recommended remedial actions are provided below.F-202604-065411

Timeline	Remediation Plan
Immediate CAP-0078341	Provide design and listing document for electric duty pump, diesel backup fire pumps and jockey pump, together with individual drivers and controllers and hydraulic calculations in accordance with NFPA 20 as part of the supporting infrastructure to the SUPS system and submit to Accord for review. Adjust the fire pump pressure settings.



Figure 2.38 - Fire Pump

9.3 Water supply

Fire water storage provisions on site should comply with NFPA 22.

The following deficiencies have been observed on site, including (list not exhaustive):
- No design document was provided for fire water supply to confirm the fire water reservoir capacity and to confirm compliance with the applicable standard.

Recommended remedial actions are provided below.F-202604-065413

Timeline	Remediation Plan
Immediate CAP-0078334	Provide design document for the fire water supply reservoir in accordance with NFPA 22 and submit to Accord for review. .

10. Hazardous Materials

10.1 Chemicals storage

This relates to storage, handling, and use of flammable chemicals and combustible liquids and solids.
Chemical storage areas should be fire separated from the rest of the building. Adequate ventilation should be provided.

The following deficiencies have been observed on site, including (list not exhaustive):
- Chemical storage is not fire separated from rest of the building; a few examples are listed below for reference:
  a. Chemical storage is not fire separated from the general storage of the Processing Lab Building.
  b. Chemical store is not fire separated from the dying hall (ground floor) of the Dye House Building.
  c. Chemical store is not fire separated from production hall (ground floor) and escape route of Yarn Dying Building.

Recommended remedial actions are provided below.F-202604-065410

Timeline	Remediation Plan
Medium Term CAP-0078342	Factory to collect MSDS sheets for all chemicals stored, classify materials, and propose storage arrangements to meet NFPA 30 requirements. Prepare drawings showing the proposed chemical storage areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all chemical storage areas - Locations of fire rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0078343	Implement the above plan on site. All chemical storage areas to be compliant with Pakistan Accord Standard.



Figure 2.39 - Chemical store is not fire separated from the dying hall (ground floor) of the Dye House Building.

11. Fire Safety Management

11.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Fire drill documentation requires improvement i.e. details of fire system used, communication logs and emergency coordinator details are missing .

Recommended remedial actions are provided below.F-202604-065409

Timeline	Remediation Plan
Medium Term CAP-0078344	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0078345	Ensure fire drills are performed a minimum of 2 times per year.

11.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire Pumps
- No records of testing of Standpipes
- No records of testing of Fire Extinguishers
- No records of testing of Fire Doors
- Norecords of testing of Emergency Exit Signage

Recommended remedial actions are provided below.F-202604-065408

Timeline	Remediation Plan
Medium Term CAP-0078346	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0078347	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

11.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of maintenance of Fire Pumps
- No records of maintenance of Standpipes
- No records of maintenance of Fire Extinguishers
- No records of maintenance of Fire Doors
- No records of maintenance of Emergency Exit Signage

Recommended remedial actions are provided below.F-202604-065406

Timeline	Remediation Plan
Medium Term CAP-0078349	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0078350	- Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

11.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid firefighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):

- Escape diagrams are missing in some of the office areas.
- An Emergency Action Plan (EAP) document was available; however, it lacks detailed procedures, roles, and responsibilities in the event of a fire.

Recommended remedial actions are provided below.F-202604-065401

Timeline	Remediation Plan
Medium Term CAP-0078351	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0078352	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.