Issue	**1**
Factory ID	**25337**
Date of Issue	**09-Jul-2026**


K.M Ashraf & Sons

Pull Aik, Aminabad Road
51310 Sialkot
Punjab Pakistan

Latitude: [32.478145], longitude: [74.538269]
Date of inspection: 05-May-2026

Fire Safety Inspection Report

Observations & Actions

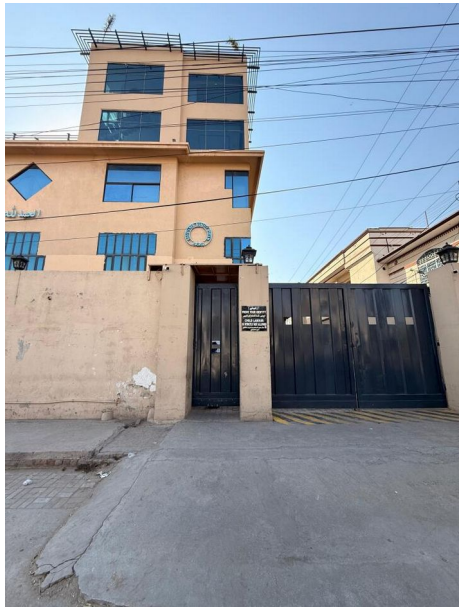

Authors	**Naveed Anjum**
Reviewed by	**Muhammad Naseer**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 05-05-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 13
   - 3.1 Building Means of Egress Details 15
   - 3.2 Building Use 16
4. Documentation 21
5. Fire Safety Measures 23
6. Remediation Support 24
   - 6.1 Engineering Support 24
7. Means of Escape 25
   - 7.1 Escape doors 25
   - 7.2 Exit access 27
   - 7.3 Travel distance 30
   - 7.4 Number of exits 31
   - 7.5 Protection of stairs 32
   - 7.6 Escape stair condition 35
   - 7.7 Exit discharge 38
   - 7.8 Exit signage 40
8. Fire Rated Construction 43
   - 8.1 Structural fire rating 43
   - 8.2 Separation of high-risk areas 45
   - 8.3 Separation of shafts 47

8.4 Separation of occupancies..... 49
8.5 Separation of occupancies..... 51
8.6 Storage..... 53
9. Fire Suppression..... 56
9.1 Sprinkler system..... 56
9.2 Standpipe system..... 58
9.3 Fire pumps..... 60
9.4 Water supply..... 62
9.5 Fire extinguishers..... 63
10. Hazardous Materials..... 65
10.1 Chemicals storage..... 65
11. Fire Safety Management..... 67
11.1 Fire drills..... 67
11.2 Records of system testing..... 68
11.3 Records of systems maintenance..... 69
11.4 Emergency Action Plan..... 70
12. Assessment Limitations and Assumptions..... 71

1. Executive Summary

On 05-May-2026, Shehroz Javed and Naveed Anjum on behalf of the Pakistan Accord carried out an initial fire inspection for K.M Ashraf & Sons, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Sam Khawaja (Director), Suleman Khan (Manager HR), Mr. Hafiz Qasim (AM HR & Compliance) & Mr. Khalid Mehmood (Electrical Engineer) along with other staff members of the factory. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Accord were also present and the team was led by Bilal Butt of Pakistan Accord.
The factory comprises of **6 Main Building & 4 Ancillary** details of which are provided below:

Building 1 is a Five-story (G+4) above grade-plane RC moment-resisting frame structure & partial steel shed at 3rd floor only. It has a covered area (footprint) of 1537 sq. m. with the height of 17.97m measured from the fire department vehicle access to the topmost occupied floor. The building is provided with three staircases, out of which one discharge internally. The building is used for Fabric Store, Offices & FID (Ground Floor); Embroidery, Induction, Pad Pasting, Residence (1st Floor); Marketing Office, Panels Inspection, Sampling (2nd Floor); Cutting & Stitching Department, Penthouse residence (3rd Floor) & Penthouse residence, Solar plates (4th Floor), and Un-Occupied (Roof). Building was constructed in 1996.
Building 2 is a Ground only steel structure. It has a covered area (footprint) of 4126 sq. m. The building is used for Dying unit, Acro store, Chemical store, Washing & Boiler Shed (Ground Floor) and no access to Roof. Building was constructed in 2010.
Building 3 is a Six-story (B+G+5) above grade-plane RC moment-resisting frame structure & 4th floor roof of steel shed. It has a covered area (footprint) of 592 sq. m. with the height of 19m measured from the fire department vehicle access to the topmost occupied floor. The building is provided with three staircases, out of which two discharge internally. The building is used for Warehouse (Basement), Main Accessory store (Ground Floor); Audit room & Storage (1st Floor); Packing (2nd Floor); Packing (3rd Floor), Machinery Store (4th Floor) & Left over store (5th Floor) and no access to roof. Building was constructed in 2001.
Building 4 is a Seven-story (B+G+6) above grade-plane RC moment-resisting frame structure. It has a covered area (footprint) of 1050 sq. m. with the height of 22.7m measured from the fire department vehicle access to the topmost occupied floor. The building is provided with two staircases, which discharge internally. The building is used for Machine & Pad storage (Basement), Office, Stitching & Finishing (Ground to 6th Floor) & no access to roof. Building was initially constructed up to the 2nd floor in 2010, and the upper remaining floors were later completed in 2015.
Building 5 is a Six-story (G+5) above grade-plane RC moment-resisting frame structure. It has a covered area (footprint) of 252 sq. m. with the height of 17.85m measured from the fire department vehicle access to the topmost occupied floor. The building is provided with two staircases, which discharge externally. The building is used for Offices & LT Room (Ground Floor); Masjid (1st Floor); Canteen (2nd Floor); Residence (3rd to 5th Floor), and Un-Occupied (Roof). The building was originally constructed up to the 2nd floor in 2007, while the remaining upper floors were completed in 2014.
Building 6 is a Ground only Building. It has a covered area (footprint) of 1102 sq. m. The building is used for storage and no access to Roof. Building

construction year was unknown.

Ancillary Structures:

- **ETP Operation Room:** A ground floor only Bricks Masonry (RC) moment-resisting frame structure used for ETP Operation.
- **Security Office:** A Ground floor only Bricks Masonry (RC) moment-resisting frame structure used for Security guard sitting.
- **Waste Storage Shed:** A ground floor steel truss shed is being used for waste storage.
- **ETP Shed:** A ground floor steel truss shed is being used for ETP.

The factory complex is entirely occupied by K.M Ashraf & Sons as Owner.
The factory operates in three shifts for all activities. Approximately 800 workers are employed at the factory, with no female representation

We were presented with Civil defence certificate, Fire Extinguisher & Standpipe system inspection record, Fire Drills record and Staff Training documents.

A summary of the main concerns identified during the inspection includes (non-exhaustive):

- Lockable mechanisms observed in escape route across the whole facility.
- There is no fire separation between stairs and the rest of the Buildings.
- Multiple exit stairs discharge inside Buildings.
- Storage areas are not fire separated from rest of the Building 1 & Building 2.
- There is no standpipe system installed in Building 5, and the standpipe coverage in Building 1, Building 3, and Building 4 is insufficient.
- There is no sprinkler system in Building 3 & Building 4
- Lift shafts are not fire separated from rest of the Buildings 1,3 & 4.
- Fire Pump is non-listed

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes).

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

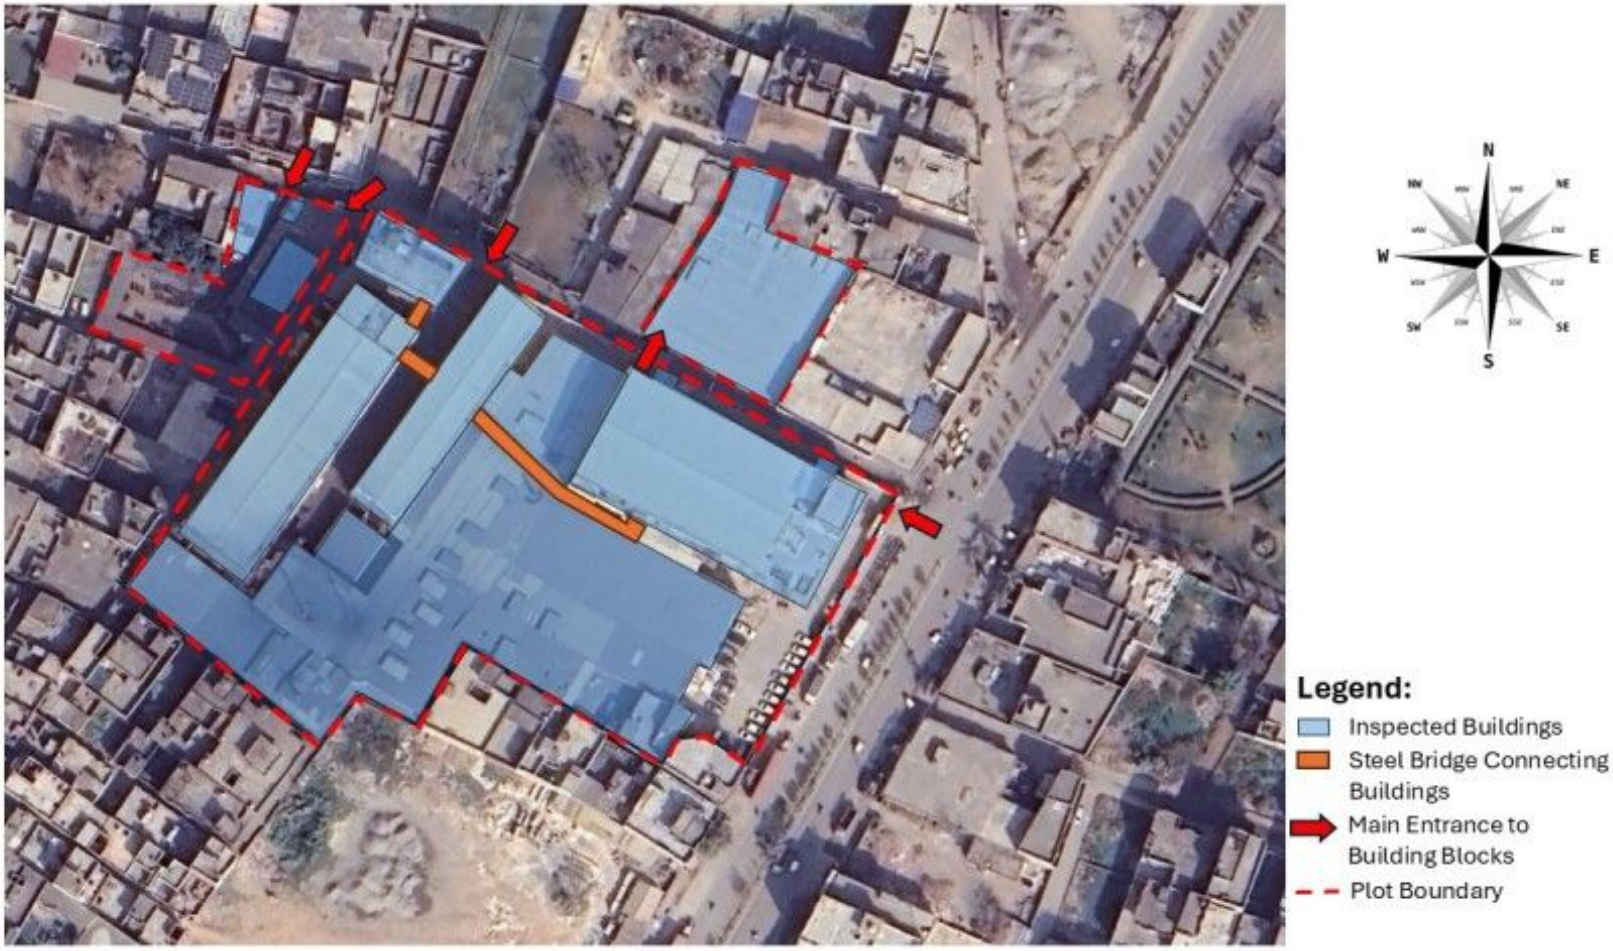


Figure 1.1. Satellite view (Red dashed line indicates site boundary)

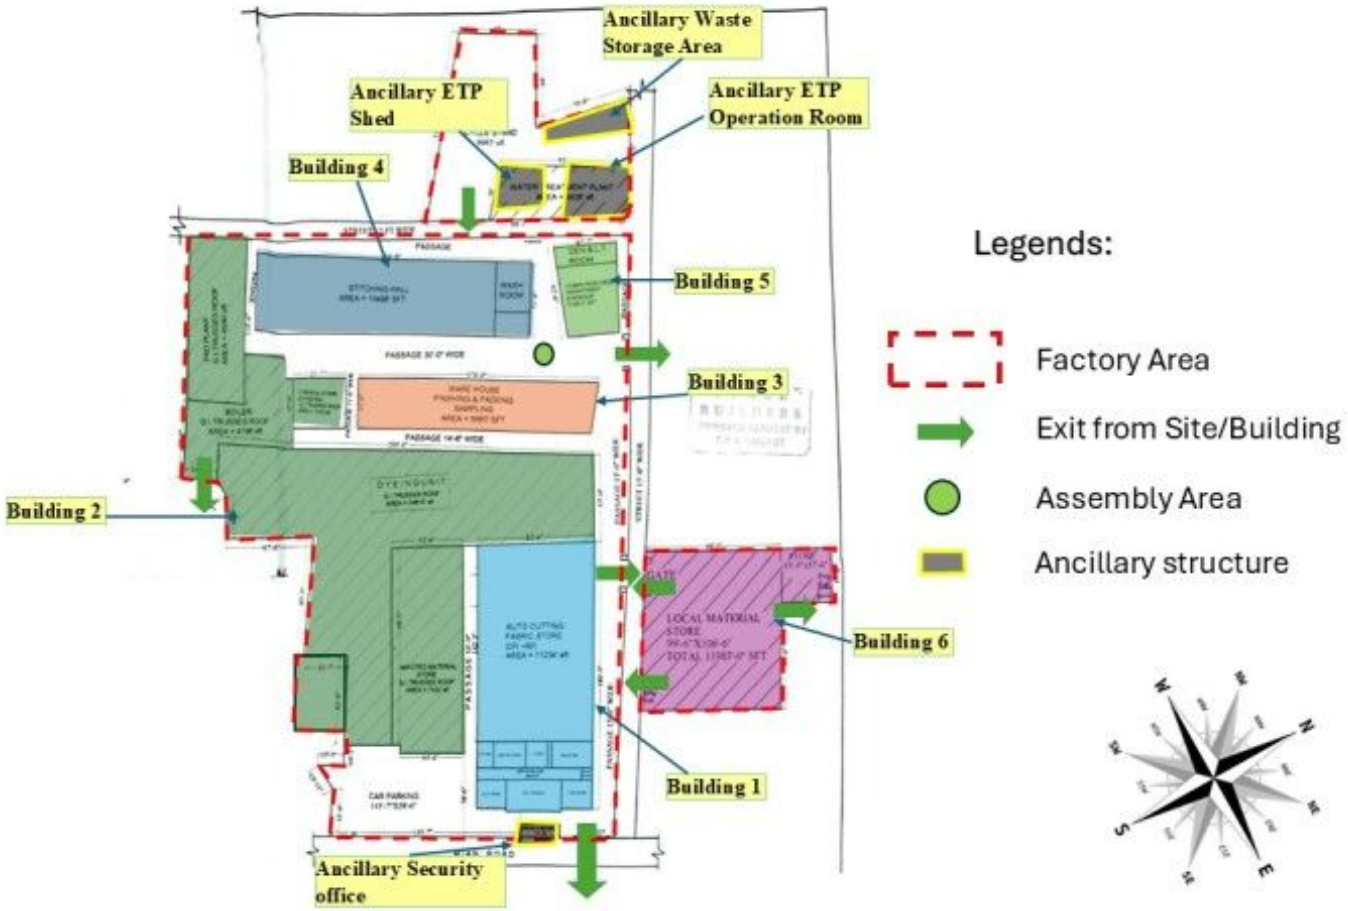


Figure 1.2. Site layout. Red dashed line indicates site boundary

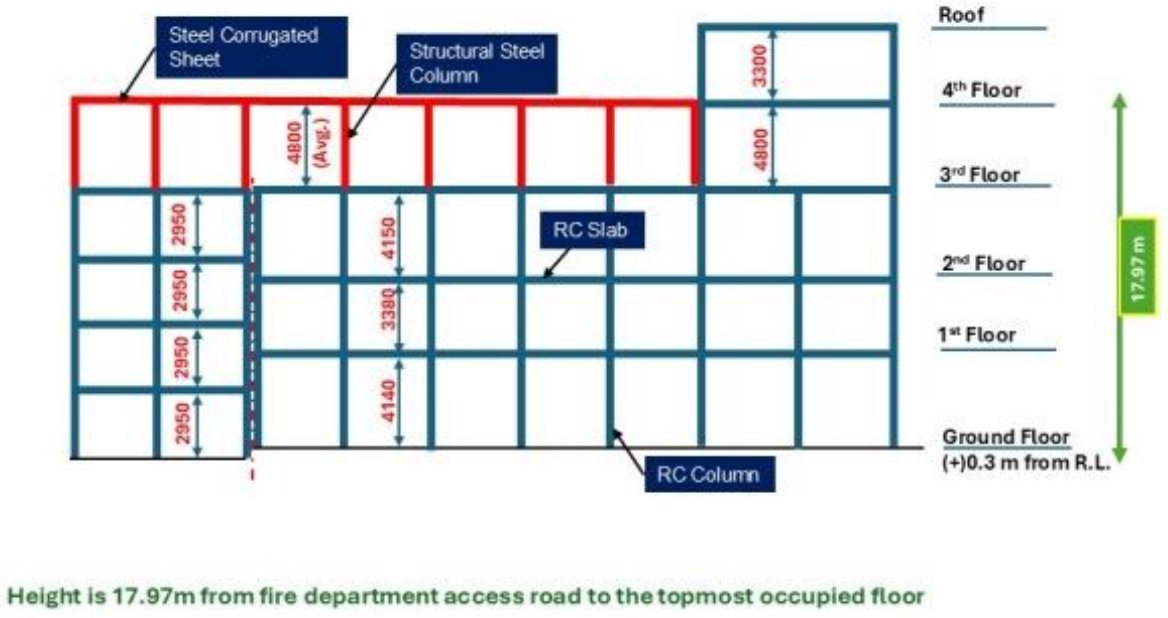


Figure 1.3. Section layout of Building 1

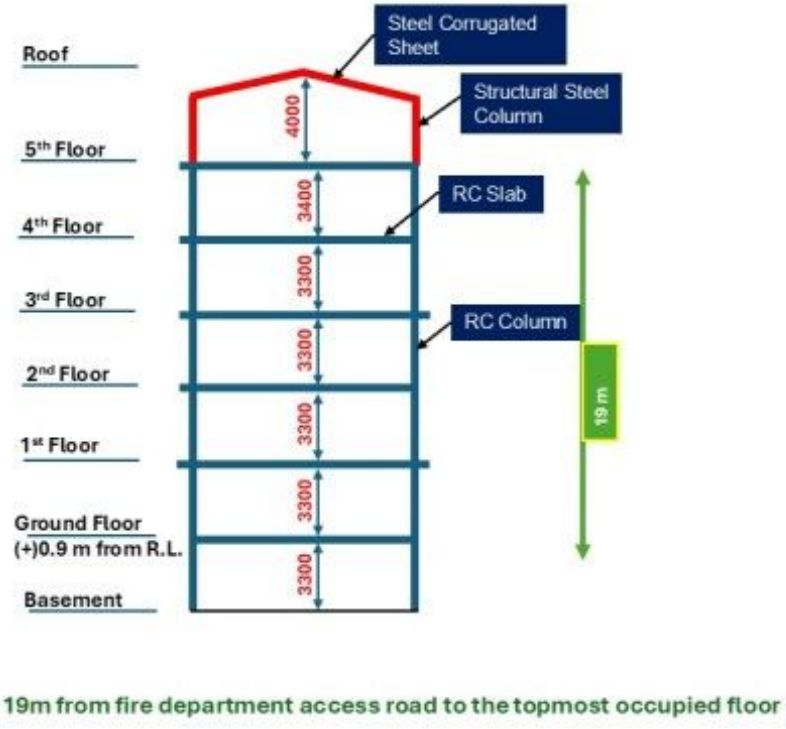


Figure 1.4. Section layout of Building 3

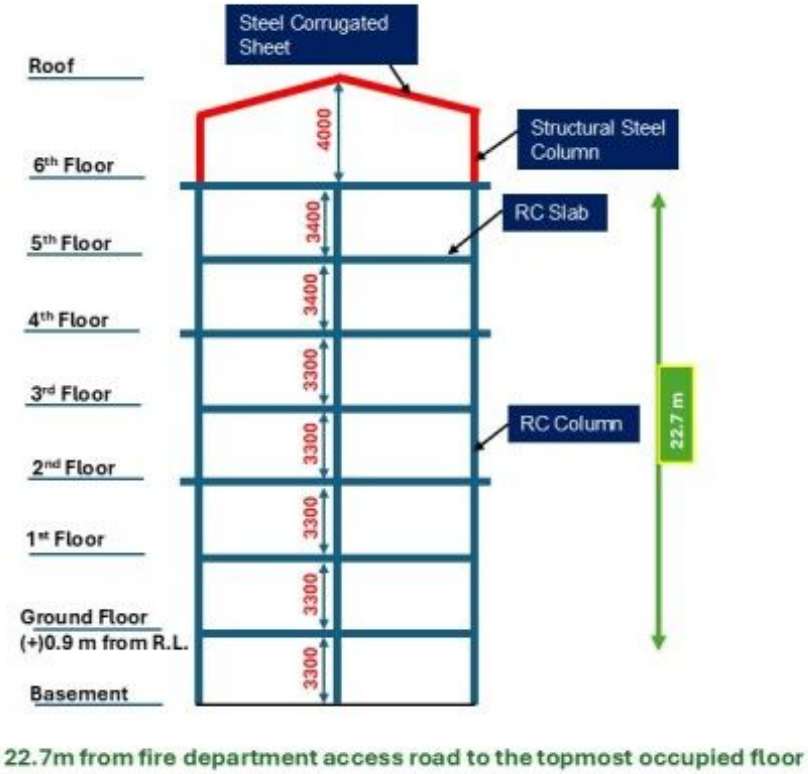


Figure 1.5. Section layout of Building 4

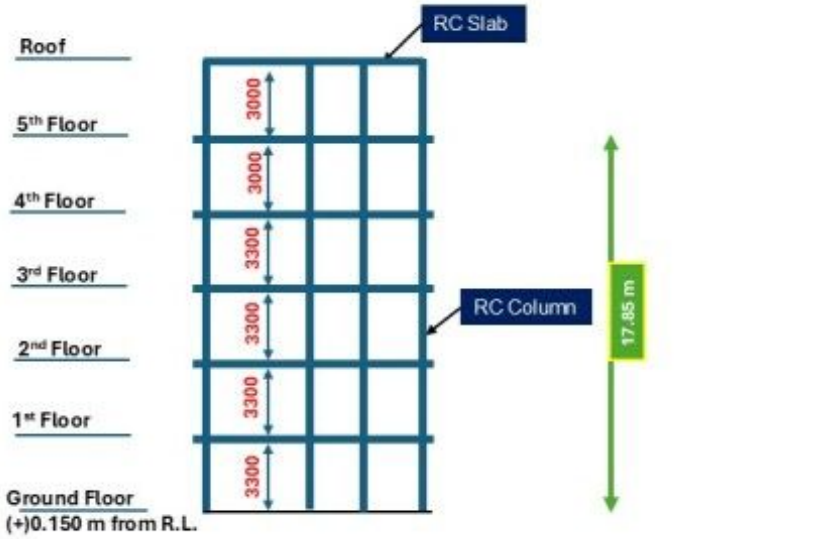


Figure 1.6. Section layout of Building 5

3. Building Description

The factory comprises of **6 Main Building & 4 Ancillary** details of which are provided below:

Building 1 is a Five-story (G+4) above grade-plane RC moment-resisting frame structure & partial steel shed at 3rd floor only. It has a covered area (footprint) of 1537 sq. m. with the height of 17.97m measured from the fire department vehicle access to the topmost occupied floor. The building is provided with three staircases, out of which one discharge internally. The building is used for Fabric Store, Offices & FID (Ground Floor); Embroidery, Induction, Pad Pasting, Residence (1st Floor); Marketing Office, Panels Inspection, Sampling (2nd Floor); Cutting & Stitching Department, Penthouse residence (3rd Floor) & Penthouse residence, Solar plates (4th Floor), and Un-Occupied (Roof). Building was constructed in 1996.
Building 2 is a Ground only steel structure. It has a covered area (footprint) of 4126 sq. m. The building is used for Dying unit, Acro store, Chemical store, Washing & Boiler Shed (Ground Floor) and no access to Roof. Building was constructed in 2010.
Building 3 is a Six-story (B+G+5) above grade-plane RC moment-resisting frame structure & 4th floor roof of steel shed. It has a covered area (footprint) of 592 sq. m. with the height of 19m measured from the fire department vehicle access to the topmost occupied floor. The building is provided with three staircases, out of which two discharge internally. The building is used for Warehouse (Basement), Main Accessory store (Ground Floor); Audit room & Storage (1st Floor); Packing (2nd Floor); Packing (3rd Floor), Machinery Store (4th Floor) & Left over store (5th Floor) and no access to roof. Building was constructed in 2001.
Building 4 is a Seven-story (B+G+6) above grade-plane RC moment-resisting frame structure. It has a covered area (footprint) of 1050 sq. m. with the height of 22.7m measured from the fire department vehicle access to the topmost occupied floor. The building is provided with two staircases, which discharge internally. The building is used for Machine & Pad storage (Basement), Office, Stitching & Finishing (Ground to 6th Floor) & no access to roof. Building was initially constructed up to the 2nd floor in 2010, and the upper remaining floors were later completed in 2015.
Building 5 is a Six-story (G+5) above grade-plane RC moment-resisting frame structure. It has a covered area (footprint) of 252 sq. m. with the height of 17.85m measured from the fire department vehicle access to the topmost occupied floor. The building is provided with two staircases, which discharge externally. The building is used for Offices & LT Room (Ground Floor); Masjid (1st Floor); Canteen (2nd Floor); Residence (3rd to 5th Floor), and Un-Occupied (Roof). The building was originally constructed up to the 2nd floor in 2007, while the remaining upper floors were completed in 2014.
Building 6 is a Ground only Building. It has a covered area (footprint) of 1102 sq. m. The building is used for storage and no access to Roof. Building construction year was unknown.
Ancillary Structures:

- **ETP Operation Room:** A ground floor only Bricks Masonry (RC) moment-resisting frame structure used for ETP Operation.
- **Security Office:** A Ground floor only Bricks Masonry (RC) moment-resisting frame structure used for Security guard sitting.

- **Waste Storage Shed:** A ground floor steel truss shed is being used for waste storage.
- **ETP Shed:** A ground floor steel truss shed is being used for ETP.

3.1 Building Means of Egress Details

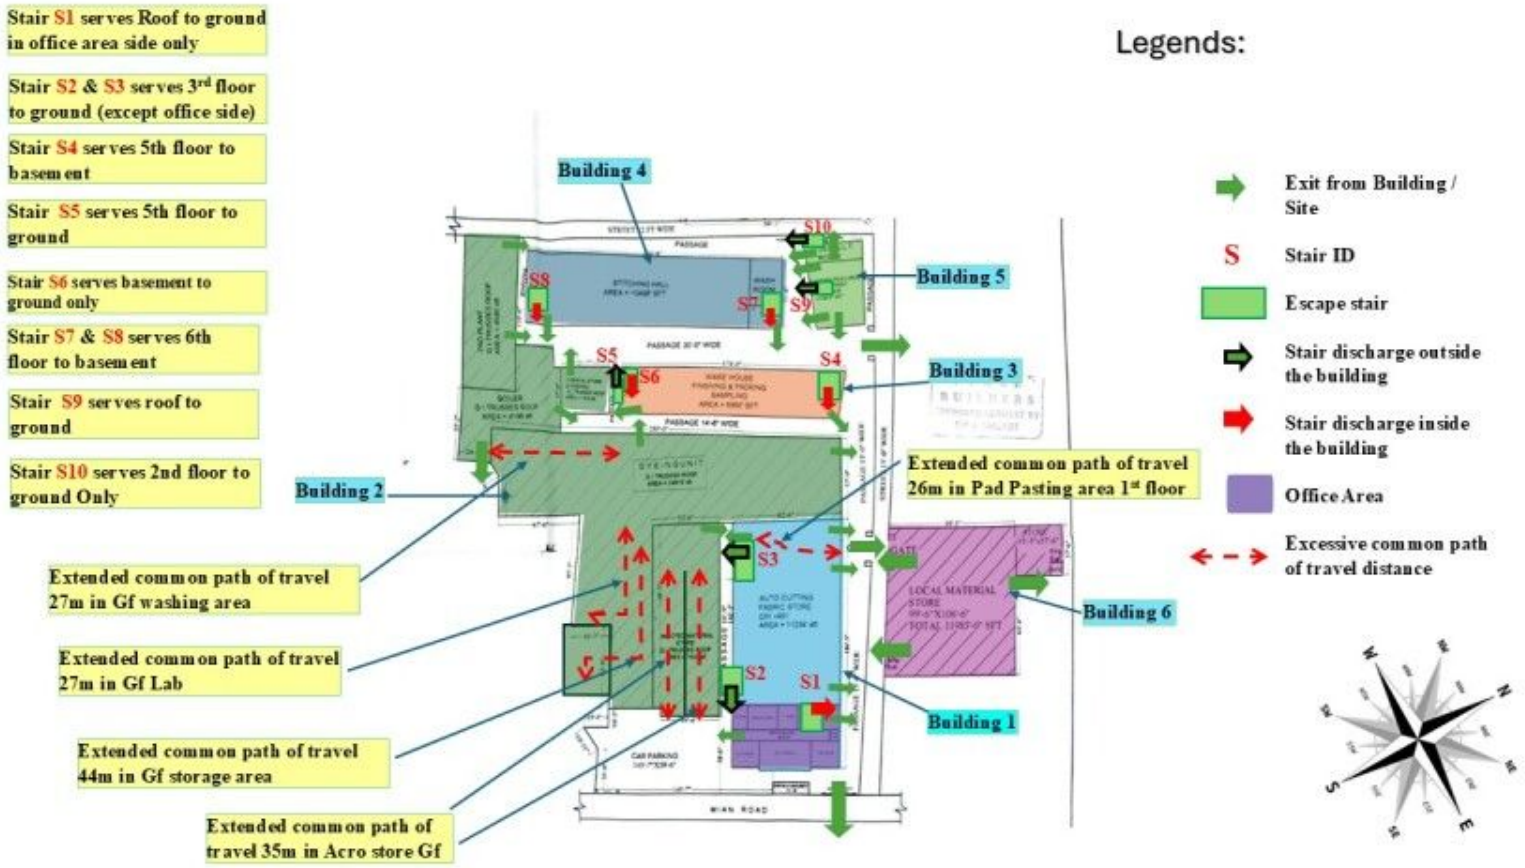


Figure 1.7. Egress Layout plan of all Main Buildings

3.2 Building Use

Building 1:

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternative Paths	Common Path	Dead End
Ground floor	Fabric Store & FID	70	4	-	-	-
	Offices	30	2	-	-	-
1st Floor	Embroidery, Induction, Pad Pasting	120	2	-	23m	-
	Residence	25	1	-	-	-
2nd Floor	Panels Inspection, Sampling	70	2	-	-	-
	Marketing Offices	35	1	-	-	-
3rd Floor	Cutting & Stitching Department	120	2	-	-	-
	Penthouse Residence	6	1	-	-	-
4th Floor	Penthouse residence, Solar plates	3	1	-	-	-
Roof	Un-Occupied	-	1	-	-	-

Building 2:

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternative Paths	Common Path	Dead End
Ground floor	Dying unit, Acro store, Chemical Store, Washing & Boiler Shed	147	8	-	35m,35m, 44m,27m,27m	-
Roof	Un-Occupied	-	-	-	-	-

Building 3:

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternative Paths	Common Path	Dead End
Basement	Warehouse	21	2	-	-	-
Ground floor	Main accessory Store	21	2	-	-	-
1st Floor	Audit Room & Storage	25	2	-	-	-

2nd Floor	Packing	25	2	-	-	-
3rd Floor	Packing	25	2	-	-	-
4th Floor	Machinery Store	30	2	-	-	-
5th Floor	Left over store	25	2			
Roof	Un-Occupied	-	-	-	-	-

Building 4:

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternative Paths	Common Path	Dead End
Basement	Machine & Pad Storage	37	2	-	-	-
Ground floor	Office, Stitching & Finishing	112	2	-	-	-
1st Floor	Office, Stitching & Finishing	112	2	-	-	-
2nd Floor	Office, Stitching & Finishing	112	2	-	-	-
3rd Floor	Office, Stitching & Finishing	112	2	-	-	-
4th Floor	Office, Stitching & Finishing	112	2	-	-	-

5th Floor	Office, Stitching & Finishing	112	2	-	-	-
6th Floor	Office, Stitching & Finishing	112	2	-	-	-
Roof	Un-Occupied	-	-	-	-	-

Building 5:

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternative Paths	Common Path	Dead End
Ground floor	Offices & LT Room	27	5	-	-	-
1st Floor	Masjid	120	1	-	-	-
2nd Floor	Canteen	160	2	-	-	-
3rd Floor	Residence	27	1	-	-	-
4th Floor	Residence	27	1	-	-	-
5th Floor	Residence	27	1	-	-	-
Roof	Un-Occupied	-	1	-	-	-

Building 6:

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternative Paths	Common Path	Dead End
Ground floor	Storage	30	3	-	-	-

There is sufficient exit capacity in all buildings. However a deficiency in the required number of exits was identified on all floors of the office area in Building 1, as one of the 2nd floor office exits passes through a low-to-high hazard area and is therefore considered as a single exit. Similar issues were also observed on the 1st , 3rd , 4th , and 5th floors of Building 5.
Furthermore, excessive common path/travel distances of 35 m, 35 m, 44 m, 27 m, and 27 m were observed on the ground floor of Building 2, while a travel distance of 23 m was observed in the pad pasting area on the 1st floor of Building 1.

4. Documentation

This table shows the details about the documentation provided by the factory.

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		Yes	16-03-2026	-
2.	Architecture Layout		Yes	-	-
3.	Sectional Layout		No	-	-
4.	Evacuation Maps		Yes	-	Inappropriate and also missing at some places
5.	Emergency Action Plan		No	-	-
6.	Inspection	Fire Pump	No		
		Standpipe	Yes	03-03-2026	Not as per Pakistan Accord Building Standard
		Fire extinguishers	Yes	02-03-2026	Not as per Pakistan Accord Building Standard
		Exit signage	No	-	-
7.	Testing	Fire Pump	No	-	-
		Standpipe	No	-	-
		Fire extinguishers	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Fire Pump	No	-	-
		Standpipe	No	-	-
		Fire extinguishers	No	-	-
		Exit signage	No	-	-

9.	Evidence of Fire Drills	Yes	19-01-2026	Only single drill record was presented with no attendance sheet.
10.	Staff Training	Yes	19-01-2026	First Aid & Firefighting

Table 1: Documentation

5. Fire Safety Measures

During our fire site inspection of K.M Ashraf & Sons, a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within K.M Ashraf & Sons. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202605-067067

Timeline	Remediation Plan
Immediate CAP-0080170	Factories should begin remediation of CAP items—such as installing extinguishers, signage, and clearing escape routes—using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Sliding doors shall not serve for escape from areas with more than 10 occupants

This is not always achieved, examples include (list not exhaustive):
- Escape doors are lockable through out the facility .
- Sliding doors serve for escape from areas with more than 10 occupants. e.g. Sliding door in Building 2,Building 3 & Building 4 ground floor .

Recommended remedial actions are provided below.F-202605-066743

Timeline	Remediation Plan
Immediate CAP-0080156	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0080157	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5. Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, which are side swinging and open in the direction of travel to an exit.
Longer Term CAP-0080158	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Sliding door Building 2 ground floor



Figure 2.2 - Lockable door of Building 2 3rd floor toward S2



Figure 2.3 - Sliding door Building 3 Ground floor



Figure 2.4 - Lockable door of Building 2 2nd floor toward S2

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.
- Headroom along escape route should be more than 2.05m.

This is not always achieved, examples include (list not exhaustive):
- Obstructions on escape route e.g. Storage was observed within the exit access route at the Building 1 ground floor fabric insulation area. The exit access route was also blocked in the padding area at the Building 2 ground floor and at the 6th floor of Building 4.
- Protected stair discharges inside the building at a distance from building exit e.g. S1,S4,S6,S7 & S8 discharge inside .
- Insufficient headroom along escape route (i.e. headroom height is less than 2.05m) e.g. 1.8m head clearance in stair route of S6 from basement to ground.

Recommended remedial actions are provided below.F-202605-066724

Timeline	Remediation Plan
Immediate CAP-0080083	Remove obstructions on escape routes and keep them clear for escape. Install Soft Padding at locations with headroom clearance below 2.05 m. Provide warning signs where headroom height is less than 2.05 m on escape routes.
Medium Term CAP-0080084	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks) Propose modifications to ensure 2.05m headroom height is achieved along the escape routes or propose alternative egress routes that comply. Submit the proposal to Pakistan Accord for review.

Longer Term CAP-0080085	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted. Implement measures to ensure adequate clear head height is achieved along all escape routes.



Figure 2.5 - Head room height is below 2.05m on exit route from basement Building 3



Figure 2.7 - Blocked exit access route in the padding area at the Building 2 ground floor



Figure 2.6 - Blocked exit access at the 6th floor of Building 4



Figure 2.8 - Storage was observed within the exit access route at the Building 1 ground floor

7.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Standard. The standard provides limitations on:
- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.

This is not always achieved, examples include (list not exhaustive):
- Common path of travel distances exceed permitted limits. e.g. excessive travel distances common path of 35 m, 35 m, 44 m, 27 m, and 27 m were observed on the ground floor of Building 2 & 23m on 1st floor of Building 1 pad pasting area.

Recommended remedial actions are provided below.F-202605-066733

Timeline	Remediation Plan
Medium Term CAP-0080118	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Standard.
Longer Term CAP-0080119	Implement the plan previous reviewed by Pakistan Accord and ensure all travel distances to emergency exits meet the requirements of the Pakistan Accord Standard.

7.4 Number of exits

Per Pakistan Accord Standard, the exit provisions should meet the following:
- Minimum 2 exits from every occupied floor.
- Minimum 2 exits from every occupied area with more than 50 occupants.

This is not always achieved, examples include (list not exhaustive):
- Single exit from some of the occupied floors. e.g. Single exit from all floors of the office area in Building 1, (as the 2nd floor one office exit passes through a low-to-high hazard area and is therefore considered as a single exit) & Building 5 3rd ,4th & 5th Floor
- There are areas with over 50 occupants that are served by only 1 exit. e.g. Building 5 1st Floor Prayer Area .

Recommended remedial actions are provided below.F-202605-066734

Timeline	Remediation Plan
Medium Term CAP-0080120	Review each floor and area to ensure that the number of exits complies with Pakistan Accord Standard. Develop plans and drawings to provide additional exits where necessary. Submit the plan and drawings to Pakistan Accord for review and approval prior to commencing rectification works.
Longer Term CAP-0080121	Implement the above plan as agreed with Pakistan Accord. Number of exits from all floors and parts of the building should comply with Pakistan Accord Standard.

7.5 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- Stair discharge routes should be protected to the same level of safety as the stair.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings into stairs e.g. Glass windows openings in S2 all floors,S10 ground floor
- Missing fire rated enclosure and fire doors in stair S1,S4,S6,S7, S8 all floors.
- Doors are not fire doors in S2,S3 , S5 & S9 all floors
- Fire load in stairs. e.g. Fire load under S3 ground floor, S3 3rd floor & S4 5th floor.
- Services passing through stairs S3 2nd floor & S9 third floor.

Recommended remedial actions are provided below.F-202605-066719

Timeline	Remediation Plan
Immediate CAP-0080042	Remove fire load and any other obstructions due to stored items from stairs
Medium Term CAP-0080043	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.

Longer Term CAP-0080044	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.9 - Doors are not fire doors in S5 4th floor



Figure 2.10 - Fire load in stairs S3 3rd floor



Figure 2.11 - Fire load in stairs S4 5th floor



Figure 2.12 - Unprotected Openings in stairs S2 2nd floor



Figure 2.13 - Fire load under stairs S3 ground floor



Figure 2.14 - Services passing through stairs S3 2nd floor

7.6 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):
- Stair landings are not in compliance with the standard. For example, Stair S10 continues from the 2nd floor to the ground floor without any landing platform.
- There are no handrail on one side of stairs S1 & S9 at all floors.
- Obstacles in stairs. e.g. A door is installed along the travel path of Stair S5 between the 5th and 4th floors.
- Stairs S5 in Building 3 width is not in compliance with the required standard, as it was measured at only 0.64 m between the 5th and 4th floors.

Recommended remedial actions are provided below.F-202605-066730

Timeline	Remediation Plan
Immediate CAP-0080076	Remove all obstructions from stairs.
Medium Term CAP-0080077	Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height. Provide compliant landing platforms in the stairway in accordance with applicable code requirements. Ensure the stair configuration supports safe movement and emergency evacuation & width to ensure safe and efficient occupant evacuation during an emergency.



Figure 2.15 - Door creating obstruction on route of S5



Figure 2.16 - Insufficient Stairs width 0.64m of S5



Figure 2.17 - Stair S10 continues from the 2nd floor to the ground floor without any landing platform



Figure 2.18 - Handrail is missing on one side of Staircase S1



Figure 2.19 - Handrail is missing on one side of Staircase S9

7.7 Exit discharge

Exit discharge routes outside the building should be sufficiently protected so that people can escape safely in the event of a fire anywhere in the building. This includes:
- Escape discharge route should be free of obstruction and trip hazards.
- External escape routes should not lead via high-risk areas.

This is not always achieved, examples include (list not exhaustive):
-Trip hazards on escape route. e.g. pipe lines on exit discharge route from Building 2 pad plant area creating trip hazard.
- External escape routes are through high-risk areas. e.g. Boiler placed at exit route of Building 2 pad plant area.
- Unprotected openings from building 4 in the external discharge route of Building 2 pad plant area.

Recommended remedial actions are provided below.F-202605-066735

Timeline	Remediation Plan
Immediate CAP-0080126	Cover any uneven areas in external escape routes.
Medium Term CAP-0080127	Prepare drawings showing proposed fire separating construction to exit discharge routes. These shall be submitted to Accord for review and approval prior to commencing rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge routes - Details of proposed fire resisting walls and fire door assemblies required to protect discharge routes
Longer Term CAP-0080128	- Ensure external exit discharge routes are adequately fire separated from the rest of the building. - Ensure external escape routes do not pass close to unprotected high-risk areas



Figure 2.20 - Exit discharge toward boiler from building 2 Pad making



Figure 2.21 - Openings & Trip Hazard from Building 4 toward exit discharge of Building 2 Pad making area

7.8 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at entry into stairs e.g. S4 3rd floor & S7 6th floor
- Missing exit signs in production areas e.g. Building 1 2nd floor , 2nd floor Building 4
- Missing exit signs at exits from site in Boiler area exit.
- Exit signs are misleading. e.g. Misleading floor exit signage was observed at the 2nd floor stitching area of Building 1. An exit sign was also installed in the basement of Building 4 facing away from the designated escape stair route.
- Exit signs are not uniform throughout the facility. e.g. exit signs in Building 1 ground floor.
- Electrically powered exit signs are not a tested and listed system

Recommended remedial actions are provided below.F-202605-066732

Timeline	Remediation Plan
Immediate CAP-0080101	Remove misleading directional escape signs.
Medium Term CAP-0080102	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0080103	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.22 - Misleading floor exit signage observed at the 2nd floor of Building 1



Figure 2.23 - Exit sign facing away from the designated escape stair route Basement Building 4



Figure 2.24 - S4 entry into stairs missing exit sign 3rd floor



Figure 2.25 - Non-uniform Exit signs ground floor Building 1



Figure 2.26 - Missing exit sign in Boiler area Building 2



Figure 2.27 - Building 1 2nd floor Missing exit signs

8. Fire Rated Construction

8.1 Structural fire rating

Structural fire rating of buildings must meet the requirements of Pakistan Accord Standard, which requires that non-sprinklered buildings are provided with structural fire protection if the floor is occupied. Where a building does not meet these conditions, fire protection of the structural steelwork and/or sprinkler protection are required.
The following deficiencies have been observed on site, including (list not exhaustive):
- The steel structure of the building, or portions of it, is not fire-resistance rated. Examples include Building 2 (area exceeding 2,325 m²).

Recommended remedial actions are provided below.F-202605-066721

Timeline	Remediation Plan
Medium Term CAP-0080053	Factory consultant to identify level of fire protection needed for the structure based on the building height, area, provision of sprinklers and frontage space around the building, in accordance with Pakistan Accord Standard and reference to NFPA 5000 Section 7.6.2. Submit proposal for level of fire protection required and methods for achieving it to Pakistan Accord for review.
Longer Term CAP-0080054	Implement the proposal for addressing the fire protection of the structure based on proposal reviewed previously, and in accordance with Pakistan Accord Standard.



Figure 2.28 - Unprotected steel structure of Building 2

8.2 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Fire pump room is not fire separated from the rest of the building
- Electrical rooms are not fire separated e.g. Electrical panel room at the Building 2 ground floor is not fire-separated from the boiler area. Electrical panels in Building 4 are not fire-separated from the exit route. Additionally, the electrical panel room at the Building 5 ground floor is not fire-separated from the workshop area and Stair S10.
- Generator is not fire separated from Building 4 ground floor.
- Boiler area is not fire separated from Chemical Storage area & Dying area in Building 2 ground floor.

Recommended remedial actions are provided below.F-202605-066725

Timeline	Remediation Plan
Medium Term CAP-0080086	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g. storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0080087	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.29 - Electrical Panel room is not fire separated from workshop area and S10



Figure 2.31 - Boiler area is not fire separated from Chemical Storage area



Figure 2.30 - Generator is not fire separated from Building 4 ground floor

8.3 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):

- Lift shafts are not separated with fire rated construction e.g. Cargo lift shaft of Building 1, Building , 3 & Building 4 all floors.

Recommended remedial actions are provided below.F-202605-066726

Timeline	Remediation Plan
Medium Term CAP-0080088	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0080089	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.32 - Lift shaft is not fire separated in Building 1



Figure 2.33 - Lift shaft is not fire separated in Building 3

8.4 Separation of occupancies

Residential sleeping areas should comply with special measures required for sleeping occupancies. Such measures include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key.
- Fire separation of dormitories from other occupancies
- Providing a minimum of 2 escape routes from the above ground levels
- Providing an automatic fire detection and alarm system
- Fire separation of cooking facilities/kitchens from the remainder of the dormitory

The following deficiencies have been observed on site in Building 1 1st , 3rd & 4th Floor & Building 5 3rd ,4th & 5th Floor , including (list not exhaustive):
- Locking devices on doors do not allow for free escape under all circumstances
- No adequate automatic fire detection and alarm system
- Above ground levels lack an alternative escape route
- Cooking facilities and/or kitchens not adequately fire separated
- Lack of fire rated separation between the dormitory and other occupancy types

Recommended remedial actions are provided below.F-202605-066720

Timeline	Remediation Plan
Immediate CAP-0080049	The dormitory is not to be used until minimum requirements for sleeping occupancies have been provided. Alternative arrangements must be sought immediately for the dormitory as continuing the use of the building for this purpose is not appropriate. Dormitory not to be re-occupied until the minimum requirements have been implemented.
Medium Term CAP-0080050	Document proposals for design of remedial measures to ensure compliance with all fire safety requirements for sleeping occupancies to comply with Pakistan Accord Standard. Submit proposals to Pakistan Accord for review.
Longer Term CAP-0080051	Implement remediation measures to ensure full compliance with dormitory requirements of Pakistan Accord Standard and Pakistan Building Code in accordance with previously reviewed design.



Figure 2.34 - Dormitory area 4th floor of Building 5



Figure 2.35 - Dormitory area 1st floor of Building 1

8.5 Separation of occupancies

Pakistan Accord Standard requires different Buildings to be fire separated from each other. The aim is to limit the fire to only one occupancy type.

The following deficiencies have been observed on site, including (list not exhaustive):
- Basement is not fire separated from the rest of the building e.g. Building 3 & Building 4 Basements are not fire separated from ground floor.
- Building 2 is not fire separated from Building 3, Building 1 is not fire separated from Building 2.
- Large office areas not fire separated from the production areas e.g. Building 1 office side area is not fire separated from production area .

Recommended remedial actions are provided below.F-202605-066744

Timeline	Remediation Plan
Medium Term CAP-0080159	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Different occupancy types in the building - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0080160	Provide fire rated separation between buildings as per proposal reviewed by Pakistan Accord



Figure 2.36 - Basement of Building 3 is not fire separated from rest of the Building



Figure 2.37 - Building 2 is not fire separated from Building 3



Figure 2.38 - Building 1 is not fire separated from Building 2

8.6 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building. e.g. Storage area on the 3rd floor of Building 1 is not fire-separated from the office area, RFI storage area on the 1st floor of Building 1 is not fire-separated from the embroidery area, Ground floor storage area of Building 1 is not fire-separated from the inspection area & Acro store is not fire-separated from the finishing area Building 2, and the waste storage area near Exit Stair S2 is not fire-separated from Building 1.
- Presence of areas where storage does not meet miscellaneous in-process storage requirements (listed above) e.g. Building 2 ground floor in process storage in finishing area .

Recommended remedial actions are provided below.F-202605-066742

Timeline	Remediation Plan
Medium Term CAP-0080154	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0080155	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard



Figure 2.39 - Waste storage area is not fire separated from Building 1



Figure 2.40 - RFI storage area on the 1st floor of Building 1 is not fire-separated from the embroidery area



Figure 2.41 - Acro store is not fire-separated from the finishing area Building 2



Figure 2.42 - Building 2 ground floor in-process storage in finishing area



Figure 2.43 - Storage area on the 3rd floor of Building 1 is not fire-separated from the office area



Figure 2.44 - Ground floor storage area of Building 1 is not fire-separated from the inspection area

9. Fire Suppression

9.1 Sprinkler system

Per Pakistan Accord Standard, a fire sprinkler system is required in buildings exceeding 18.3 m in height when measured from the fire department vehicle access level to the highest occupied floor. The system should be designed and installed in accordance with NFPA 13.

The following deficiencies have been observed on site, including (list not exhaustive):

- Sprinkler system is not provided in Building 3 & Building 4 .

Recommended remedial actions are provided below.F-202605-066746

Timeline	Remediation Plan
Medium Term CAP-0080161	(1) Submit design documentation for a sprinkler system (along with required standpipe system) and supporting infrastructure to Pakistan Accord for review before purchasing any new equipment. Design documentation to include drawings, technical data sheets, and product certification of all listed equipment to show full compliance of the Suppression System (SUPS) with NFPA 13, NFPA 14, 20, 22, and 24.
Medium Term CAP-0080162	(2) Submit documentation to Pakistan Accord showing that an L/C has been opened for import of any components required for the SUPS design submitted earlier.
Longer Term CAP-0080163	(3) Submit documentation to Pakistan Accord demonstrating that all materials, both imported and locally procured, have been purchased and are available on site for installation of the SUPS.
Longer Term CAP-0080164	(4) Once installation of the SUPS system is complete, factory to submit full "as-built" documentation of the system to Pakistan Accord for review.
Longer Term CAP-0080165	(5) Factory to advise Pakistan Accord when SUPS installation is fully completed and fully functional. Pakistan Accord will then arrange a verification inspection to ensure that the installation fully complies with the previously reviewed design documentation.

Longer Term CAP-0080166	(6) Provide full testing and commissioning (T&C) certification from the SUPS system installer and make provision for attendance of the system installer, factory technical personnel, and Pakistan Accord technical team to witness a final T&C demonstration verification on site. On successful completion of this T&C verification inspection, remediation of the SUPS system will be complete.

9.2 Standpipe system

Per Pakistan Accord Standard a Class-I standpipe systems is required in the building. The system should be designed and installed in accordance with NFPA 14.
Building 1, Building 3, Building 4 & Building 5 requires standpipe system due to height of the topmost occupied floor exceeding 15m.

The following deficiencies have been observed on site, including (list not exhaustive):
- There are no standpipes in the building 5.Building 1, Building 3, and Building 4 do not have properly designed Class I standpipe systems.
- Standpipe system comprise of non-listed products in Building 1, Building 3 & Building 4 .
- Connection points are not compliant in Building 1, Building 3 & Building 4 .
- Missing standpipe outlets in some of the stairs of Building 1, Building 3 & Building 4 .

Recommended remedial actions are provided below.F-202605-066741

Timeline	Remediation Plan
Longer Term CAP-0080137	Provide a Class 1 standpipe system with adequate risers and connections, in accordance with NFPA 14 as part of the supporting infrastructure to the SUPS system by following the steps (1) to (6) above.



Figure 2.45 - Non-listed standpipe connections are installed with undersized piping.

9.3 Fire pumps

Per Pakistan Accord Standard, a complete fire pump set is required. The pump set should be designed and installed in accordance with NFPA 20. The system should comprise of a) Electric pump (Main), b) Diesel Pump (Back-Up), and c) Jockey Pump. Each pump should be provided with individual drivers and controllers. Pumps shall be installed with positive suction. These measures are intended to provide a level of resilience whereby a failure of a pump or lack of power in the building will not compromise fire water supply in the building.

The following deficiencies have been observed on site, including (list not exhaustive):

- Fire pump set is not listed
- There is no diesel pump
- There is no jockey pump
- Fire pumps are not in a fire separated room
- Fire pumps are exposed to the weather conditions

Recommended remedial actions are provided below.F-202605-066737

Timeline	Remediation Plan
Longer Term CAP-0080132	Provide electric duty pump, diesel backup fire pumps, and jockey pumps, together with individual drivers and controllers, in accordance with NFPA 20 as part of the supporting infrastructure to the SUPS system by following the steps (1) to (6) above.



Figure 2.46 - Non-UL listed Fire Pump

9.4 Water supply

Fire water storage provisions on site should comply with NFPA 22.

The following deficiencies have been observed on site, including (list not exhaustive):

- No design document was provided for fire water supply to confirm the fire water reservoir capacity and to confirm compliance with the applicable standard.

Recommended remedial actions are provided below.F-202605-066740

Timeline	Remediation Plan
Immediate CAP-0080133	Provide design document for the fire water supply reservoir in accordance with NFPA 22 and submit to Accord for review.
Longer Term CAP-0080134	Provide fire water supply and storage that complies with Building Code of Pakistan and NFPA 22 & NFPA 24 as part of the supporting infrastructure to the SUPS system by following the steps (1) to (6) above.

9.5 Fire extinguishers

Extinguisher coverage and type of extinguishers used should comply with NFPA 10.

The following deficiencies have been observed on site, including (list not exhaustive):

- Poor condition of fire extinguishers. e.g. Fire extinguishers with broken seals were observed in various areas, including the fabric inspection area at the Building 1 ground floor, the office-side area at the Building 1 ground floor, and the 5th floor of Building 3.

Recommended remedial actions are provided below.F-202605-066728

Timeline	Remediation Plan
Medium Term CAP-0080093	Ensure that all building areas are protected using fire extinguishers. The coverage and type of extinguishers used should follow NFPA 10.
Longer Term CAP-0080094	Monitor fire extinguishers for coverage and extinguisher type to comply with NFPA 10.



Figure 2.47 - Broken seal of fire extinguishers in Building 1 ground floor



Figure 2.48 - Broken seal of fire extinguisher found at ground floor of Building 1

10. Hazardous Materials

10.1 Chemicals storage

This relates to storage, handling, and use of flammable chemicals and combustible liquids and solids.
Chemical storage areas should be fire separated from the rest of the building. Adequate ventilation should be provided.

The following deficiencies have been observed on site, including (list not exhaustive):

- Combustible liquid furnace oil was stored in the boiler area without secondary containment (dike protection).

Recommended remedial actions are provided below.F-202605-066731

Timeline	Remediation Plan
Medium Term CAP-0080098	Provide appropriate secondary containment (dike protection) for combustible liquid storage in accordance with applicable fire safety standards. Ensure the containment system is capable of controlling spills and preventing the spread of fire hazards.



Figure 2.49 - Furnace oil stored in the boiler area without secondary containment

11. Fire Safety Management

11.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- No regular fire drills. Only Single drill record was presented
- Fire drill documentation is of poor standard. e.g. No attendance record with Fire drill report.

Recommended remedial actions are provided below.F-202605-066723

Timeline	Remediation Plan
Medium Term CAP-0080081	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0080082	Ensure fire drills are performed a minimum of 2 times per year.

11.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):

- No records of testing of Fire Pumps
- No records of testing of Standpipes
- No records of testing of Fire Extinguishers
- No records of testing of Emergency Exit Signage

Recommended remedial actions are provided below.F-202605-066718

Timeline	Remediation Plan
Medium Term CAP-0080038	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0080039	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

11.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of maintenance of Fire Pumps
- No records of maintenance of Standpipes
- No records of maintenance of Fire Extinguishers
- No records of maintenance of Emergency Exit Signage

Recommended remedial actions are provided below.F-202605-066727

Timeline	Remediation Plan
Medium Term CAP-0080091	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0080092	- Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

11.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid firefighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):

- Escape diagrams are inappropriate, as they do not reflect the actual layout.
- There is no EAP document which details procedures, roles and responsibilities in the event of fire.

Recommended remedial actions are provided below.F-202605-066722

Timeline	Remediation Plan
Medium Term CAP-0080061	Ensure that accurate evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0080062	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.