Issue	**1**
Factory ID	**25337**
Date of Issue	**10-Jul-2026**


K.M Ashraf & Sons

Pull Aik, Aminabad Road
51310 Sialkot
Punjab Pakistan

Latitude: [32.478145], longitude: [74.538269]
Date of inspection: 05-May-2026

Structural Safety Inspection Report

Observations & Actions

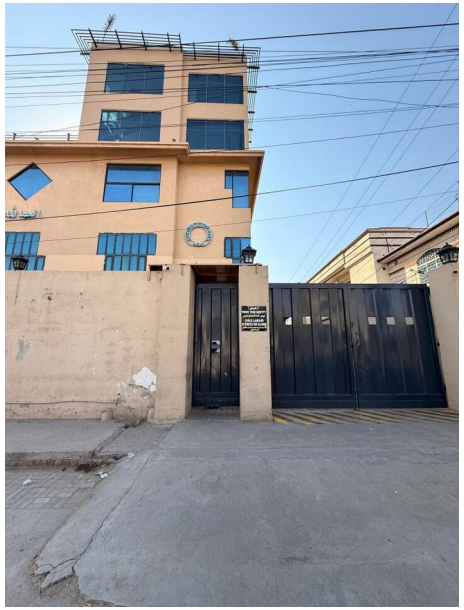

Authors	**Haris Mahmood**
Reviewed by	**Qaseem Uz Zaman Khan**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 05-05-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
   2.1 Structural System 27
3. Documentation 36
4. Structural Safety Measures 37
5. Remediation Support 40
   5.1 Engineering Support 40
6. Potential Overstress 41
   6.1 Highly stressed columns 41
   6.2 Highly stressed columns 43
7. Other Damage/Defects 45
   7.1 Health and Safety 45
   7.2 Health and Safety 46
   7.3 Health and Safety 47
   7.4 Health and Safety 48
   7.5 Health and Safety 49
8. Structural Documentation 50
   8.1 Documentation unavailable 50
   8.2 Lack of safe load plans 51
9. Assessment Limitations and Assumptions 52

1. Executive Summary

On 05-May-2026, Haris Mahmood and Saira Sandal on behalf of the Pakistan Accord carried out an initial structural inspection for K.M Ashraf & Sons, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with Mr. Saim Khwaja (Director), Mr. Suleman Khan (Manager HR), Mr. Shujaat Hashmi (Manager Admin), Mr. Hafiz Qasim (Assistant Manager HR + Compliance) and other staff members of K. M. Ashraf & Sons. The assessment was conducted as a part of an overall Structural, Fire, and Electrical initial inspection.

The factory operates in three shifts for dyeing and security and single shift for remaining activities. Factory employs approximately 800 workers with no female representation.

The factory comprises of six main buildings and four ancillary structures owned by K. M. Ashraf & Sons. During the inspection, the buildings highlighted in blue in Figure 1.1 were surveyed with the site boundary indicated in red.

- **Building 1** consists of the following three areas:
  - **Area 1** is a five-storey (Ground + 4) building. The structural system of the building is RC moment resisting frame system. The building is used for Penthouse (Fourth and Third Floor), marketing offices (Second Floor), residence, offices (First Floor) and offices (Ground Floor). The construction year of the building is 1996.
  - **Area 2** is a four-storey (Ground + 3) building. The structural system of the building is RC moment resisting frame system. The roof structural system of the building is steel portal frame shed. The building is used for solar panels (Roof), cutting department (Third floor), panel inspection (Second Floor), induction, ready for induction (RFI) fabric storage (First Floor) and fabric store, offices (Ground Floor). The construction year of the building is 1996.
  - **Area 3** is a five-storey (Ground + 4) building area. The structural system of the building is a combination of RC moment resisting frame system and load bearing brick masonry walls and columns. The roof structural system of the building is steel portal frame shed. The building is used for solar panels (Roof), cutting (Fourth Floor) sampling (Third floor), panel inspection, embroidery (Second Floor), pad pasting (First Floor) and Fabric Inspection Department (FID); (Ground Floor). The construction year of the building is 1996.
- **Building 2** is a single-storey (Ground only) steel truss shed structure. The building is used for solar panels (Roof), and stenter machines, laboratory, processing offices, jet machines, washing, chemical storage, compressor, boiler operation (Ground Floor). The construction year of the building is 2010.
- **Building 3** is a seven storey (Basement + Ground + 5) building. The structural system of the building is RC moment resisting frame system. The roof structural system of the building is steel portal frame shed. The building is used for solar panels (Roof), leftover store (Fifth Floor), machinery store (Fourth Floor), packing (Third & Second Floor), Audit Room (First Floor), accessory store (Ground Floor) and warehouse (Basement). The roof of the building is inaccessible. The construction year of the building is 2001.
- **Building 4** is an eight storey (Basement + Ground + 6) building. The structural system of the building is RC moment resisting frame system.

The roof structural system of the building is steel portal frame shed. The building is used for solar panels (Roof) and stitching and finishing on all floors. The roof of the building is inaccessible. Basement, Ground and two stories were constructed in 2010, the rest of the storey's were constructed in 2015.

- **Building 5** is a six storey (Ground + 5) building. The structural system of the building is RC moment resisting frame system. The building is used for bird cages (Roof), residence (Fifth, Fourth and Third Floor), canteen (Second Floor), mosque (First Floor) and offices (Ground Floor). Ground and two stories were constructed in 2007, the rest of the storey's were constructed in 2014.
- **Building 6** is a single-storey (Ground Only) steel truss shed structure supported on load bearing brick masonry walls and columns. The building is used for solar panels (Roof), and storage (Ground Floor). The construction year of the structure is unknown.
- **Ancillary Structures** consist of the following:
    - **Security Office** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting RC slab. The structure is used for office (Ground Floor). The construction year of the structure is unknown.
    - **ETP Operation Room** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting RC slab. The structure is used for ETP operations monitoring. The construction year of the structure is unknown.
    - **ETP Shed** is a single storey (Ground Only) steel truss shed structure. The structure is used to cover the ETP tanks. The construction year of the structure is unknown.
    - **Waste Storage Shed** is a single storey (Ground Only) steel truss shed structure. The structure is used for waste storage. The construction year of the structure is unknown.

There were multiple steel interconnected bridges between the buildings i.e.,

- Between Building 3 (Second Floor) to Building 1 (First Floor).
- Between Building 3 and 4 at Second, Third, Fourth and Fifth floor.
- Between Building 4 and 5 at First and Third Floors.

We were presented with the site layout plan only. For further details, refer to Table 2 of the documentation of this report.
There is a health and safety concern including the lack of edge protection at roof level of Building 1, Building 2, Building 3, Building 4 and Building 6, which should be addressed immediately. For further details, refer Section 7 of this report.
A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Highly overstressed columns were observed in Building 1 and Building 4.
- Architectural and structural As-Built drawings were not available.

We see no reason to suspend the operations in the facility due to these concerns.
Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1: Building Summary

Building		Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / modifications	Engineer access issues
Building 1	Area 1	Penthouse (Fourth and Third Floor) Marketing offices (Second Floor) Residence, offices (First Floor) Offices (Ground Floor)	Five (Ground+4)	1996	RC moment resisting frame system	-	-	-

	Area 2	Solar panels (Roof) Cutting department (Third floor) Panel inspection (Second Floor) Induction, ready for induction (RFI), fabric storage (First Floor) Fabric store, offices (Ground Floor)	Four (Ground+3)	1996	RC moment resisting frame system	Steel portal frame shed	-	-

	Area 3	Solar panels (Roof) Cutting (Fourth Floor) Sampling (Third floor) Panel inspection, embroidery (Second Floor) Pad pasting (First Floor) Fabric Inspection Department (FID) (Ground Floor)	Five (Ground+4)	1996	Combination of RC moment resisting frame system and load bearing brick masonry walls and columns	Steel portal frame shed	-	-
Building 2		solar panels (Roof) Stenter machines, laboratory, processing offices, jet machines, washing, chemical storage, compressor, boiler operation (Ground	One (Ground only)	2010	Steel Truss Shed	-	-	-

	Floor)						
Building 3	Solar panels (Roof) Leftover store (Fifth Floor) Machinery store (Fourth Floor) Packing (Third & Second Floor) Audit Room (First Floor) Accessory store (Ground Floor) Warehouse (Basement)	Seven (B+G+5)	2001	RC moment resisting frame system	Steel portal frame shed	-	Roof was inaccessible
Building 4	Solar panels (Roof) Stitching and finishing (All floors)	Eight (B+G+6)	2010	RC moment resisting frame system	Steel portal frame shed	3rd to 6th Floors were constructed in 2015	Roof was inaccessible

Building 5		Bird cages (Roof) Residence (Fifth, Fourth and Third Floor) Canteen (Second Floor) Mosque (First Floor) Offices (Ground Floor)	Six (G+5)	2007	RC moment resisting frame system	-	3rd to 5th Floors were constructed in 2014	-
Building 6		Solar panels (Roof) Storage (Ground Floor)	One (Ground Only)	Unknown	Steel truss shed supported on load bearing brick masonry walls and columns	-	-	-
Ancillary Structures	Security Office	Offices (Ground Floor)	One (Ground Only)	Unknown	Load bearing brick masonry walls supporting RC Slab	-	-	-
	ETP Operation Room	ETP operations monitoring (Ground Floor)	One (Ground Only)	Unknown	Load bearing brick masonry walls supporting RC Slab	-	-	-
	ETP Shed	ETP tanks	One	Unknown	Steel truss	-	-	-

		cover (Ground Floor)	(Ground Only)		shed			
	Waste Storage Shed	Waste Storage (Ground Floor)	One (Ground Only)	Unknown	Steel truss shed	-	-	-

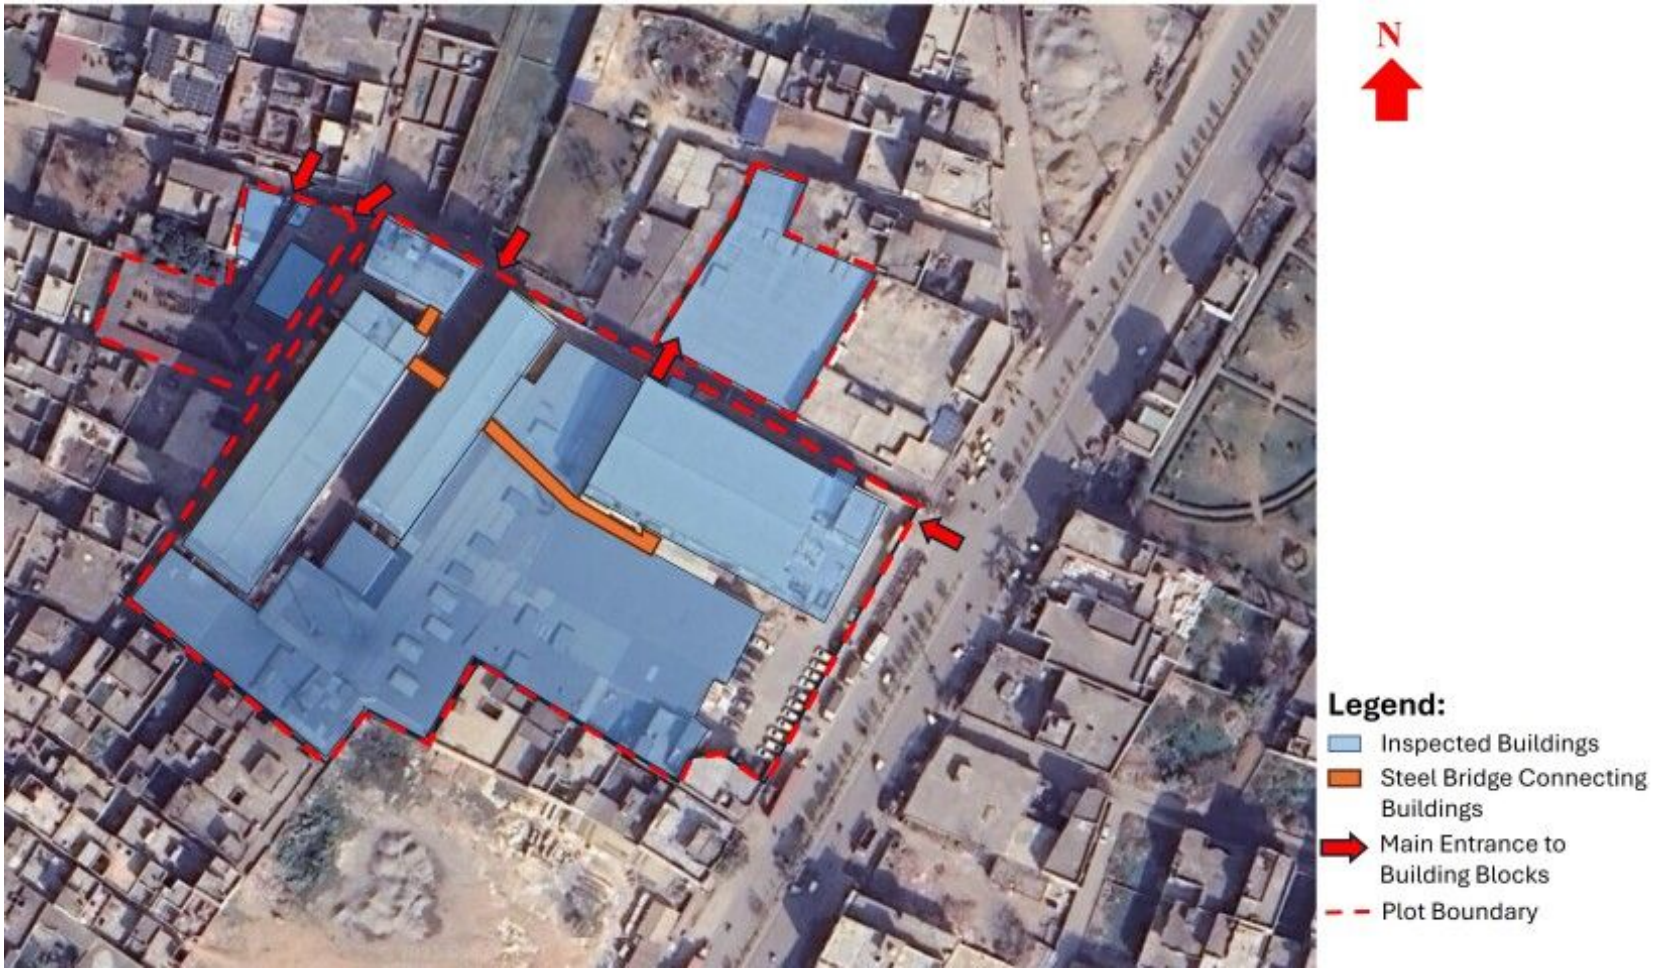


Figure 1.1. Satellite View of the factory premises

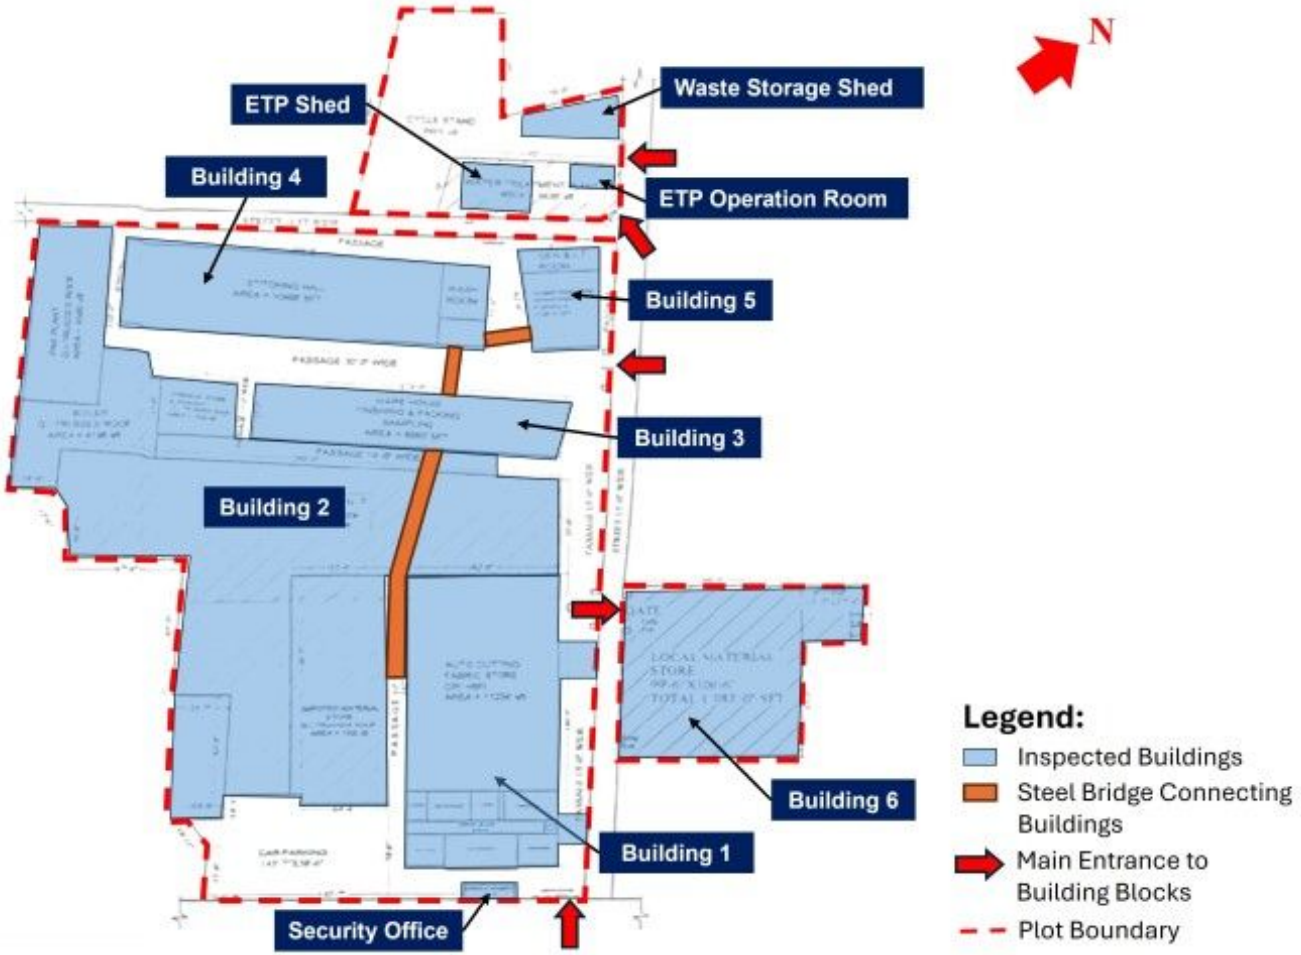


Figure 1.2. Site Layout of the factory premises



Figure 1.3. East Side Elevation of Building 1



Figure 1.4. East Elevation of Building 2



Figure 1.5. North-East Elevation of Building 3



Figure 1.6. South-East Elevation of Building 4



Figure 1.7. Front Elevation of Building 5



Figure 1.8. Front Elevation of Building 6



Figure 1.9. Penthouse at Fourth Floor of Building 1 (Area 1)



Figure 1.10. Penthouse at Third Floor of Building 1 (Area 1)



Figure 1.11. Offices at Second Floor of Building 1 (Area 1)



Figure 1.12. Offices at First Floor of Building 1 (Area 1)



Figure 1.13. Offices at Ground Floor of Building 1 (Area 1)



Figure 1.14. Solar Panels at Roof of Building 1 (Area 2 & 3)



Figure 1.15. Typical Floor activity at Third Floor of Building 1 (Area 2) & Fourth Floor of Building 1 (Area 3)



Figure 1.16. Typical Floor Activity at Second Floor of Building 1 (Area 2)



Figure 1.17. Typical Floor Activity at First Floor of Building 1 (Area 2)



Figure 1.18. Typical activity at Ground Floor of Building 1 (Area 2)



Figure 1.19. Typical Floor activity at Third Floor of Building 1 (Area 3)



Figure 1.20. Typical Floor activity at Second Floor of Building 1 (Area 3)



Figure 1.21. Typical activity at First Floor of Building 1 (Area 3)



Figure 1.22. Typical activity at Ground Floor of Building 1 (Area 3)



Figure 1.23. Typical activity at Ground Floor of Building 2



Figure 1.24. Boiler Operations at Ground Floor of Building 2



Figure 1.25. Chemical Storage at Ground Floor of Building 2



Figure 1.26. Typical activity at 5th Floor of Building 3



Figure 1.27. Typical activity at 4th Floor of Building 3



Figure 1.28. Typical activity at 3rd Floor of Building 3



Figure 1.29. Typical activity at 2nd Floor of Building 3



Figure 1.30. Typical activity at First Floor of Building 3



Figure 1.31. Typical activity at Ground Floor of Building 3



Figure 1.32. Currently Empty Basement of Building 3



Figure 1.33. Typical activity at 6th Floor of Building 4



Figure 1.34. Typical activity at 5th Floor of Building 4



Figure 1.35. Typical activity at 4th Floor of Building 4



Figure 1.36. Typical activity at 3rd Floor of Building 4



Figure 1.37. Typical activity at 2nd Floor of Building 4



Figure 1.38. Typical activity at First Floor of Building 4



Figure 1.39. Typical activity at Ground Floor of Building 4



Figure 1.40. Storage at Basement of Building 4



Figure 1.41. Bird Cages at Roof of Building 5



Figure 1.42. Typical Residences at Fifth, Fourth and Third Floors of Building 5



Figure 1.43. Canteen at 2nd Floor of Building 5



Figure 1.44. Mosque at First Floor of Building 5



Figure 1.45. Typical activity at Ground Floor of Building 5



Figure 1.46. Solar Panels at Roof of Building 6



Figure 1.47. Storage at Ground Floor of Building 6



Figure 1.48. ETP Operation Room



Figure 1.49. Steel Truss shed on ETP water tanks



Figure 1.50. Waste Storage Shed

2.1 Structural System

Building	Building 1
Stability system	Area 1: RC MRF Area 2, 3: RC MRF with steel portal frame shed at roof Area 3: RC MRF and load bearing walls/columns with steel portal frame shed at roof
Column size (m)	0.340 x 0.450 (Area 1, 2) 0.350 x 0.350 (Area 3)
Grid (m)	8.19 x 6.23 (Typical) – (Area 1,2) 2.97 x 6.13 (Area 3)
Primary beam size (m)	Area 1, 2: 0.400 x 0.450, 0.300 x 0.450 Area 3: 0.300 x 0.300
Secondary beam size (m)	Area 1, 2: 0.300 x 0.450 Area 3: 0.300 x 0.300
Slab depth (m)	0.150 (Assumed)
Finishes depth (m)	0.075 (Assumed)
Ceiling height (m)	Area 1, 2 4th to Roof = 3.3 3rd to Roof = 4.8 (max.) 2nd to 3rd Floor= 4.15 1st to 2nd Floor =3.38 G to 1st Floor = 4.14 Area 3: 4th to Roof = 4.8 (max.) 3rd to 4th Floor = 2.95 2nd to 3rd Floor = 2.95 1st to 2nd Floor = 2.95 G to 1st Floor = 2.95

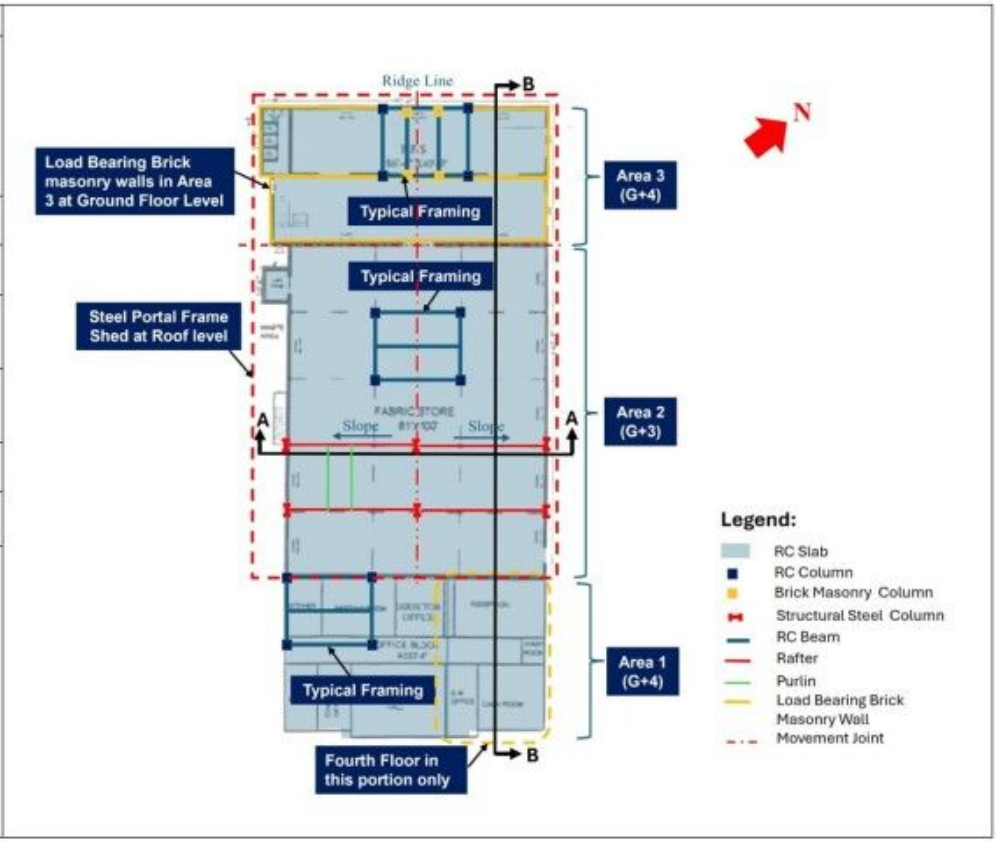


Figure 1.51. Typical Floor Framing Plan of Building 1


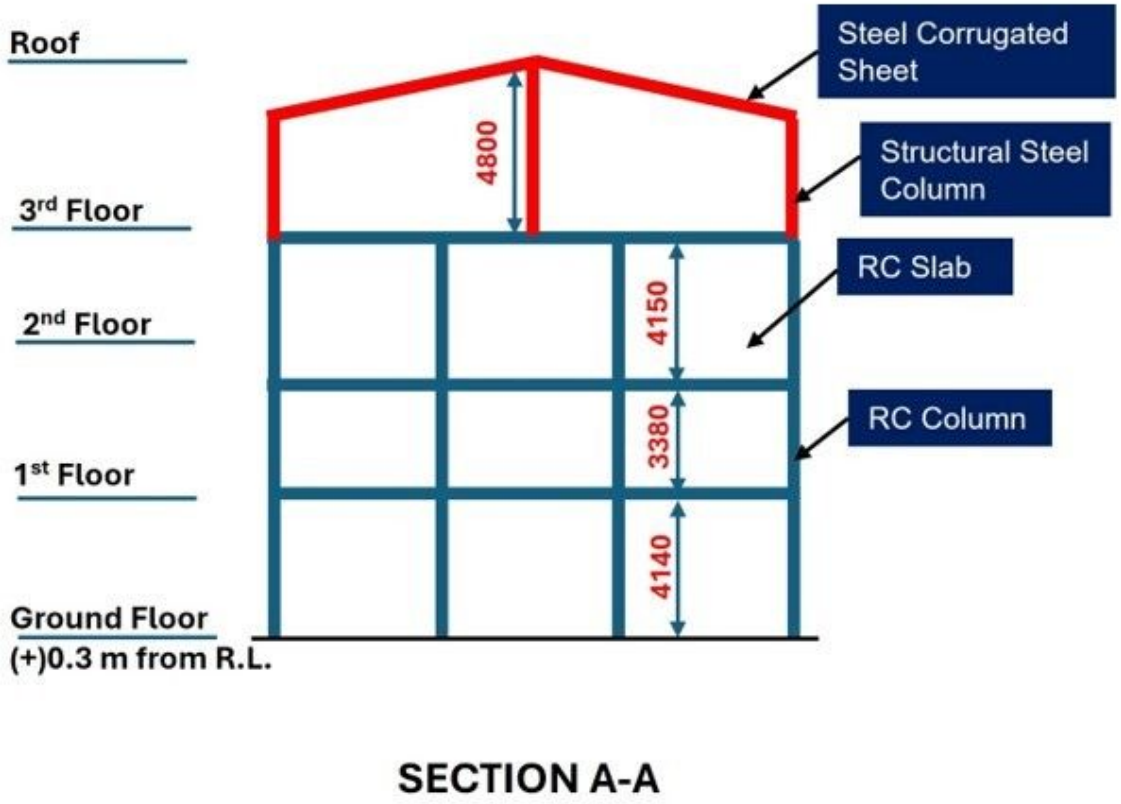


Figure 1.52. Section A-A of Building 1

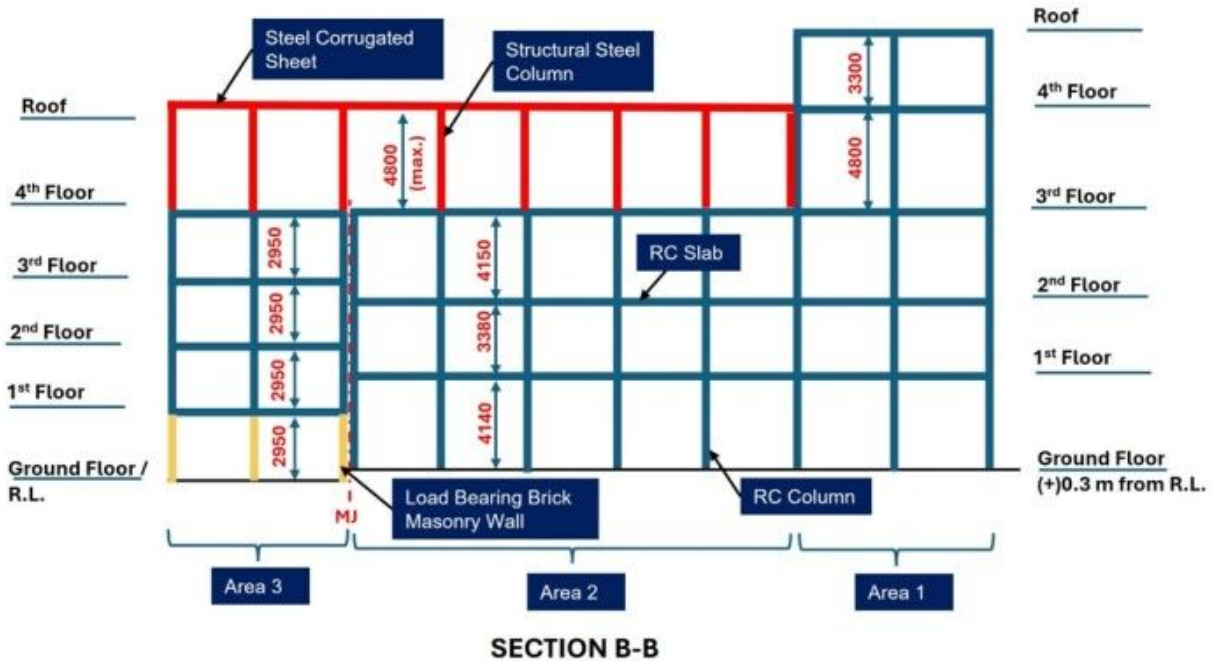

Structural System Notes

Column size is the structural dimension and excludes render thickness
Grid measurements are from centre of column to centre of column
Beam sizes do not include slab depth

Figure 1.53. Section B-B of Building 1

Building	Building 3
Stability system	RC moment resisting frame system and steel portal frame shed at roof
Column size (m)	0.350 x 0.450
Grid (m)	9.88 x 3.01
Primary beam size (m)	0.300 x 0.430
Secondary beam size (m)	-
Slab depth (m)	0.150
Finishes depth (m)	0.075
Ceiling height (m)	5th to Roof = 4.0 4th to 5th Floor = 3.4 3rd to 4th Floor = 3.3 2nd to 3rd Floor = 3.3 1st to 2nd Floor = 3.3 G to 1st Floor = 3.3 Basement to G Floor = 3.3


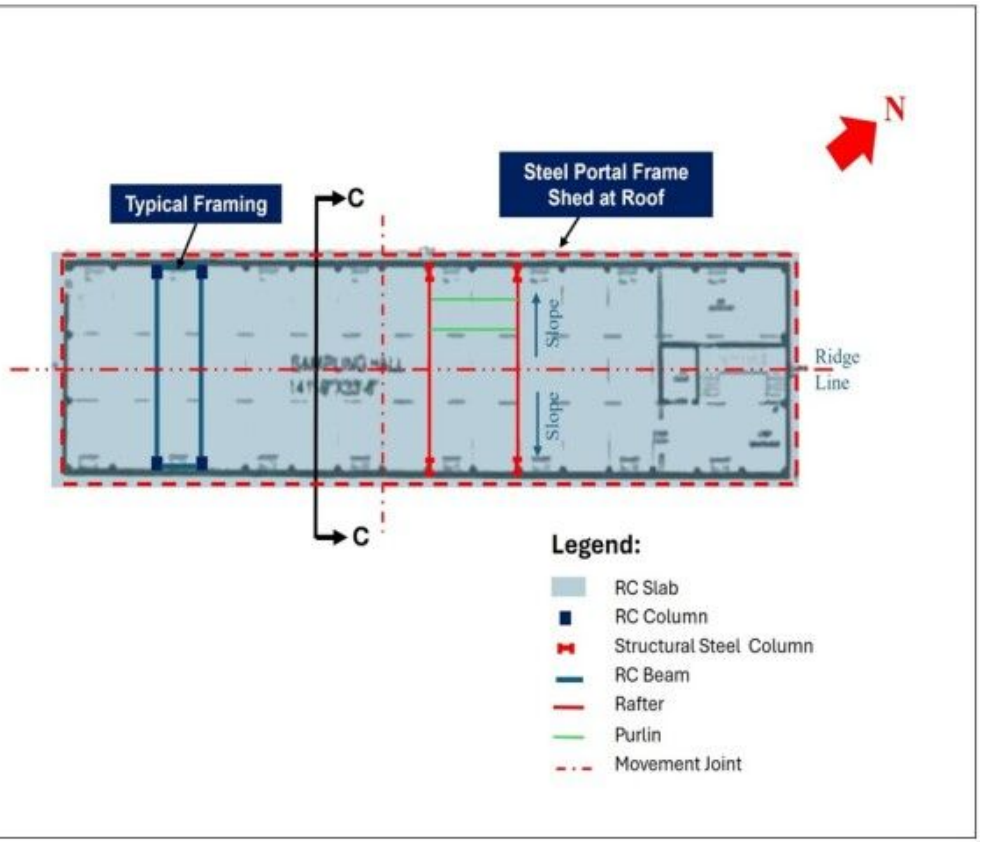


Figure 1.54. Typical Floor Framing Plan of Building 3

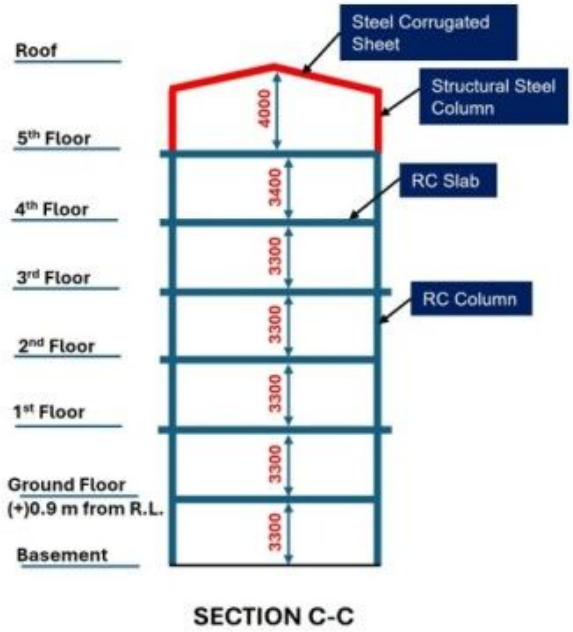

Structural System Notes

Column size is the structural dimension and excludes render thickness
Grid measurements are from centre of column to centre of column
Beam sizes do not include slab depth

Figure 1.55. Section C-C of Building 3

Building	Building 4
Stability system	RC moment resisting frame system and steel portal frame shed at roof
Column size (m)	0.550 x 0.550
Grid (m)	7.65 x 7.65
Primary beam size (m)	0.550 x 0.475 0.300 x 0.400
Secondary beam size (m)	0.300 x 0.400
Slab depth (m)	0.150 (Assumed)
Finishes depth (m)	0.075 (Assumed)
Ceiling height (m)	6th to Roof = 4.0 5th to 6th Floor = 3.4 4th to 5th Floor = 3.4 3rd to 4th Floor = 3.3 2nd to 3rd Floor = 3.3 1st to 2nd Floor = 3.3 G to 1st Floor = 3.3 Basement to G Floor = 3.3


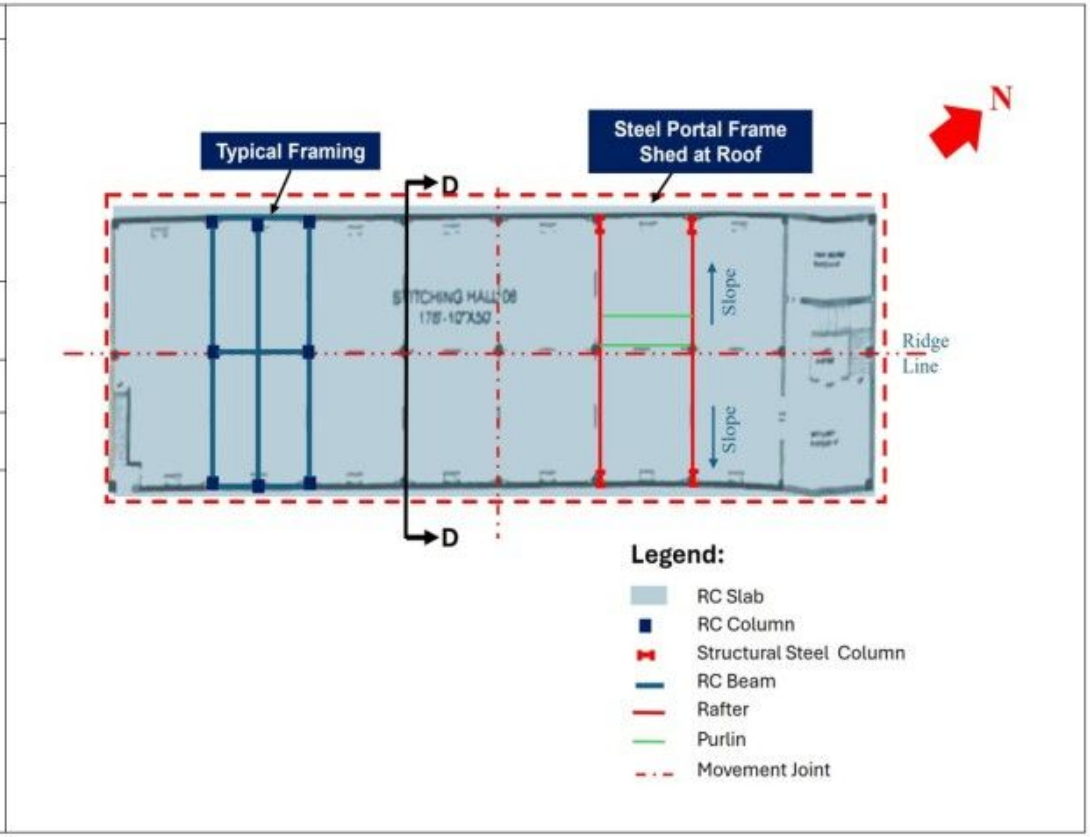


Figure 1.56. Typical Floor Framing Plan of Building 4

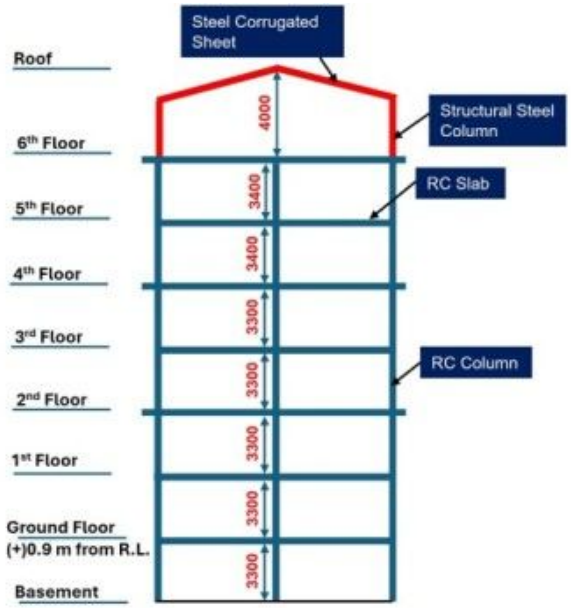

Structural System Notes

Column size is the structural dimension and excludes render thickness
Grid measurements are from centre of column to centre of column
Beam sizes do not include slab depth

Figure 1.57. Section D-D of Building 4

Building	Building 5
Stability system	RC moment resisting frame system
Column size (m)	0.400 x 0.400
Grid (m)	3.06 x 3.06
Primary beam size (m)	0.350 x 0.350
Secondary beam size (m)	-
Slab depth (m)	0.150 (Assumed)
Finishes depth (m)	0.100 (Assumed)
Ceiling height (m)	5th to Roof = 3.0 4th to 5th Floor = 3.0 3rd to 4th Floor = 3.3 2nd to 3rd Floor = 3.3 1st to 2nd Floor = 3.3 G to 1st Floor = 3.3


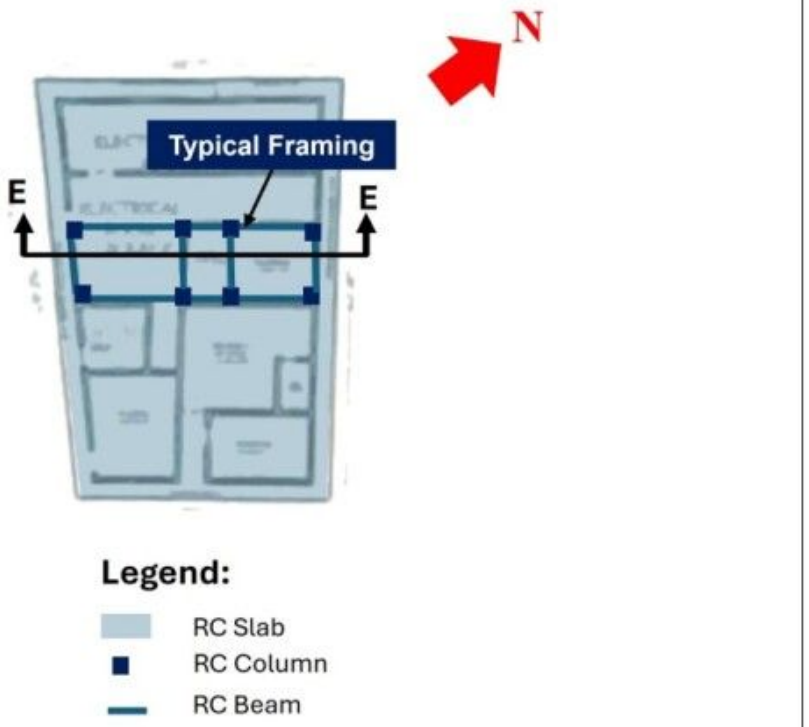


Figure 1.58. Typical Floor Framing Plan of Building 5

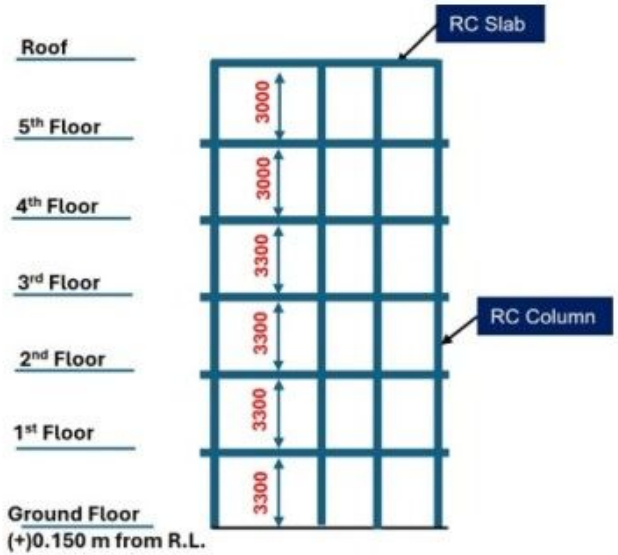

SECTION E-E

Structural System Notes

Column size is the structural dimension and excludes render thickness
Grid measurements are from centre of column to centre of column
Beam sizes do not include slab depth

Figure 1.59. Section E-E of Building 5

3. Documentation

This table outlines the documentation details provided by the factory.

Table 2 – Documentation

Building		Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plans	Stability certificate	Inspection reports	Materials testing
Building 1		Yes	Yes	No	No	No	No	No	No	No
Building 2		Yes	Yes	No	No	No	No	No	No	No
Building 3		Yes	Yes	No	No	No	No	No	No	No
Building 4		Yes	Yes	No	No	No	No	No	No	No
Building 5		Yes	Yes	No	No	No	No	No	No	No
Building 6		Yes	Yes	No	No	No	No	No	No	No
Ancillary Structure	Security Office	Yes	Yes	No	No	No	No	Yes	No	No
	ETP Operation Room									
	ETP Shed									
	Waste Storage Shed									

4. Structural Safety Measures

During our structural site inspection of K.M Ashraf & Sons, a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within K.M Ashraf & Sons. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3 Summary of issues by building:

Building		Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Building 1	Area 1	Highly Stressed Columns	-	-	-	-	Documentation Unavailable Lack of safe Load Plans
	Area 2	Highly Stressed Columns	-	-	-	Health and Safety – Inadequate Edge Protection	

	Area 3	-	-	-	-	Health and Safety – Inadequate Edge Protection	
Building 2		-	-	-	-	Health and Safety – Inadequate Edge Protection	Documentation Unavailable
Building 3		-	-	-	-	Health and Safety – Inadequate Edge Protection	Documentation Unavailable Lack of safe Load Plans
Building 4		Highly Stressed Columns	-	-	-	Health and Safety – Inadequate Edge Protection	Documentation Unavailable Lack of safe Load Plans
Building 5		-	-	-	-	-	Documentation Unavailable
Building 6		-	-	-	-	Health and Safety – Inadequate Edge Protection	Documentation Unavailable
Ancillary Structure	Security Office	-	-	-	-	-	Documentation Unavailable
	ETP Operation Room	-	-	-	-	-	Documentation Unavailable
	ETP Shed	-	-	-	-	-	Documentation Unavailable

	Waste Storage Shed	-	-	-	-	-	Documentation Unavailable

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified Engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202605-067509

Timeline	Remediation Plan
Medium Term CAP-0081284	Factories should begin remediation of CAP items such as surface cracks or non-structural repairs using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Potential Overstress

6.1 Highly stressed columns

The internal columns of the Building 1 (Area 1, 2 & 3) at Ground Floor level were observed to be highly stressed, which may be attributed to the relatively larger structural grid size (8.19 m x 6.23 m) and unavailability of in-situ design data i.e., concrete compressive strength and steel tensile strength. F-202605-067510

Timeline	Remediation Plan
Immediate CAP-0081305	Verify in-situ reinforcement by removing cover and confirming no. and diameter of bars and submit results to Pakistan Accord.
Immediate CAP-0086741	Verify the strength of reinforcement through laboratory tensile strength testing.
Immediate CAP-0081306	Verify in-situ concrete strength for the identified columns either by 100mm dia. cores from at least 4 columns or existing cylinder strength data and submit results to Pakistan Accord.
Immediate CAP-0081307	(1) Appoint qualified and competent Structural Engineer to carry out the DEA on the full building, in accordance with the DEA scope and minimum requirements set out in the initial inspection report.
Medium Term CAP-0081309	Factory Engineer to review design, loads and columns stresses in area identified.
Medium Term CAP-0081308	(2) Submit accurate As-built Drawings showing structure, loading, elements, dimensions, levels, foundations and framing on Plan, Section and Elevation drawings and a report on Engineering tests carried out to justify material strengths and reinforcement content in all key elements studied, to Pakistan Accord for review.
Medium Term CAP-0081310	(3) Submit structural engineering assessment with supporting calculations based on the as-built drawing and material strengths reviewed previously using a model-based design that justifies the safety and serviceability of the building against loading as set out in Building Code of Pakistan.

Longer Term CAP-0081311	(4) Submit proposals for any retrofitting works that may be needed to demonstrate the adequacy of the structure to Pakistan Accord for review.
Longer Term CAP-0081312	(5) Carry out all retrofitting works if needed as proposed and previously reviewed by Pakistan Accord.
Longer Term CAP-0081313	(6) Factory to advise Pakistan Accord when all retrofitting works are complete and make provision for a verification inspection attended by the factory Structural Engineer. Once Pakistan Accord has verified retrofitting works in accordance with previously reviewed proposals, then this item will be complete.
Longer Term CAP-0081314	Continue to implement load plan.



Figure 2.1 - Highly Stressed Internal Columns at Ground Floor of Building 1 (Area 1, 2 & 3)

6.2 Highly stressed columns

The internal columns of the Building 4 at basement level were observed to be highly stressed, which may be attributed to the relatively larger structural grid size (7.65 m x 7.65 m), more number of stories exceeding the load carrying capacity of the column and unavailability of in-situ design data i.e., concrete compressive strength and steel tensile strength. F-202605-067511

Timeline	Remediation Plan
Immediate CAP-0081295	Verify in-situ reinforcement by removing cover and confirming no. and diameter of bars and submit results to Pakistan Accord.
Immediate CAP-0081296	Verify in-situ concrete strength for the identified columns either by 100mm dia. cores from at least 4 columns or existing cylinder strength data and submit results to Pakistan Accord.
Immediate CAP-0081297	(1) Appoint qualified and competent Structural Engineer to carry out the DEA on the full building, in accordance with the DEA scope and minimum requirements set out in the initial inspection report.
Medium Term CAP-0081299	Factory Engineer to review design, loads and columns stresses in area identified.
Medium Term CAP-0081298	(2) Submit accurate As-built Drawings showing structure, loading, elements, dimensions, levels, foundations and framing on Plan, Section and Elevation drawings and a report on Engineering tests carried out to justify material strengths and reinforcement content in all key elements studied, to Pakistan Accord for review.
Medium Term CAP-0081300	(3) Submit structural engineering assessment with supporting calculations based on the as-built drawing and material strengths reviewed previously using a model-based design that justifies the safety and serviceability of the building against loading as set out in Building Code of Pakistan.
Longer Term CAP-0081301	(4) Submit proposals for any retrofitting works that may be needed to demonstrate the adequacy of the structure to Pakistan Accord for review.
Longer Term CAP-0081303	(5) Carry out all retrofitting works if needed as proposed and previously reviewed by Pakistan Accord.

Longer Term CAP-0081304	(6) Factory to advise Pakistan Accord when all retrofitting works are complete and make provision for a verification inspection attended by the factory Structural Engineer. Once Pakistan Accord has verified retrofitting works in accordance with previously reviewed proposals, then this item will be complete.
Longer Term CAP-0081302	Continue to implement load plan.

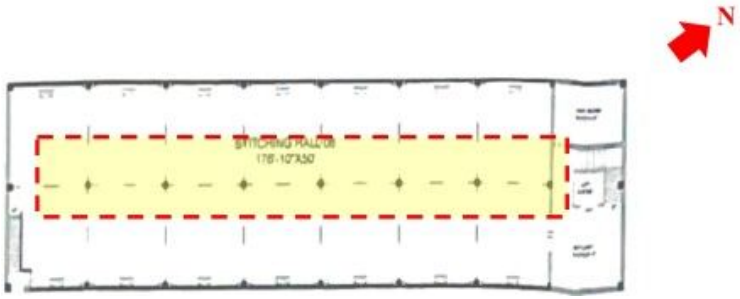


Figure 2.2 - Highly stressed Internal columns at Basement level of Building 4

7. Other Damage/Defects

7.1 Health and Safety

This refers to the Building 1 (Area 2 and Area 3), where edge protection is not provided on the roof level. Missing edge protection presents a risk of potential injury resulting from slip, trip or fall from the roof, while accessing and maintaining services on the roof. This is a Health and Safety Concern. F-202605-067512

Timeline	Remediation Plan
Immediate CAP-0081289	Provide safe access and adequate edge protection on the roof, and on any other part of the factory with the same issue.



Figure 2.3 - Missing Edge Protection Location at Roof of Building 1 (Area 2, 3)



Figure 2.4 - Missing Edge Protection at Roof of Building 1 (Area 2, 3)

7.2 Health and Safety

This refers to the Building 2, where edge protection is not provided on the roof level. Missing edge protection presents a risk of potential injury resulting from slip, trip or fall from the roof, while accessing and maintaining services on the roof. This is a Health and Safety Concern. F-202605-067513

Timeline	Remediation Plan
Immediate CAP-0081290	Provide safe access and adequate edge protection on the roof, and on any other part of the factory with the same issue.



Figure 2.5 - Missing Edge Protection Location at roof of Building 2



Figure 2.6 - Missing Edge Protection at roof of Building 2

7.3 Health and Safety

This refers to the Building 3, where edge protection is not provided on the roof level. Missing edge protection presents a risk of potential injury resulting from slip, trip or fall from the roof, while accessing and maintaining services on the roof. This is a Health and Safety Concern. F-202605-067514

Timeline	Remediation Plan
Immediate CAP-0081291	Provide safe access and adequate edge protection on the roof, and on any other part of the factory with the same issue.

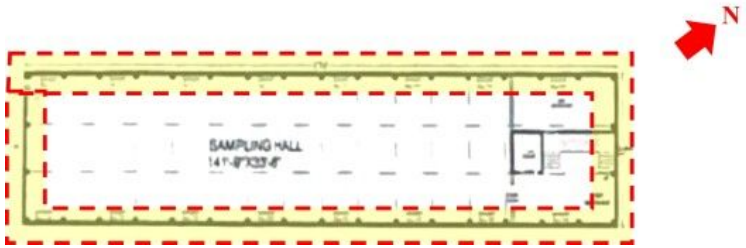


Figure 2.7 - Missing Edge Protection Location at Roof of Building 3



Figure 2.8 - Missing Edge Protection at Roof of Building 3 (Red Highlighted)

7.4 Health and Safety

This refers to the Building 4, where edge protection is not provided on the roof level. Missing edge protection presents a risk of potential injury resulting from slip, trip or fall from the roof, while accessing and maintaining services on the roof. This is a Health and Safety Concern. F-202605-067515

Timeline	Remediation Plan
Immediate CAP-0081292	Provide safe access and adequate edge protection on the roof, and on any other part of the factory with the same issue.

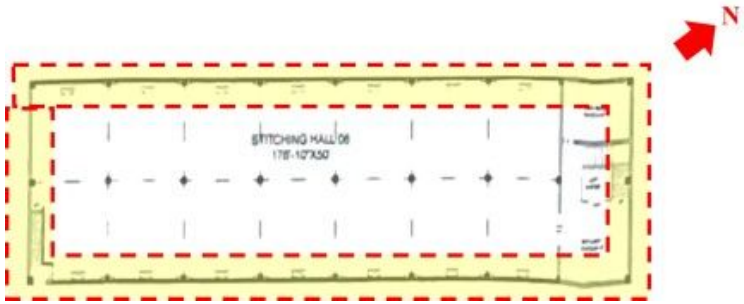


Figure 2.9 - Missing Edge Protection Location at Roof of Building 4

7.5 Health and Safety

This refers to the Building 6, where edge protection is not provided on the roof level. Missing edge protection presents a risk of potential injury resulting from slip, trip or fall from the roof, while accessing and maintaining services on the roof. This is a Health and Safety Concern. F-202605-067518

Timeline	Remediation Plan
Immediate CAP-0081293	Provide safe access and adequate edge protection on the roof, and on any other part of the factory with the same issue.



Figure 2.10 - Missing Edge Protection location at Roof of Building 6



Figure 2.11 - Missing Edge Protection at Roof of Building 6

8. Structural Documentation

8.1 Documentation unavailable

Following documents were unavailable:

- As-Built Architectural drawings of all the buildings (Main buildings and ancillary structures).
- As-Built Structural Drawings of all the buildings (Main buildings and ancillary structures).F-202605-067516

Timeline	Remediation Plan
Longer Term CAP-0081285	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete As-Built documentation.

8.2 Lack of safe load plans

No safe load plans were posted on any of the floor of all multi-storey buildings. F-202605-067517

Timeline	Remediation Plan
Longer Term CAP-0081286	Building Structural Engineer to review design documentation to confirm the load capacity of the structure.
Longer Term CAP-0081287	Develop safe load plans and submit to Pakistan Accord for review.
Longer Term CAP-0081288	Factory to post safe load plans on each floor.

9. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.