Issue	**1**
Factory ID	**920037**
Date of Issue	**10-Jun-2026**

M/S Stylers International Ltd. - Unit 2 (Raiwind)

Village Buchoke Majha Raiwind Bypass 3 Km Off Raiwind Manga Road, Tehsil Raiwind
55150 Lahore
Punjab Pakistan

Latitude: [31.228723], longitude: [74.176596]
Date of inspection: 30-Mar-2026

Electrical Safety Inspection Report

Observations & Actions



Authors	**Azka Riaz**
Reviewed by	**Majid Khan**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 30-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
   - 2.1 Building Use 9
   - 2.2 Utility Source 10
   - 2.3 Backup source 11
3. Documentation 12
4. Electrical Safety Measures 13
5. Remediation Support 14
   - 5.1 Engineering Support 14
6. Diagrams & Drawings 15
   - 6.1 Sub-station room layout drg 15
   - 6.2 Single Line Diagram (SLD) 16
   - 6.3 Electrical layout drawing 17
7. DBs & Elec Protection Systems 18
   - 7.1 Circuit breakers 18
   - 7.2 Hot Spots 20
   - 7.3 Earthing system 24
   - 7.4 Panel/cabling/busbar 27
   - 7.5 Loop Connection 29
   - 7.6 Multiple Connections 32
   - 7.7 Openings 34
   - 7.8 Adequate accessibility 36

7.9 Lint & dust inside panel board 38
7.10 Lightning Protection System (LPS) 40
8. Fire Alarm & Detection System (FADS) 42
8.1 Non-functional or incomplete 42
8.2 Maintenance records 45
9. Emergency Lighting 46
9.1 Provided but non-functional 46
9.2 Provided but insufficient 48
9.3 Independent power source 51
10. Generator, Transformer & Sub-Station Room 52
10.1 Battery 52
11. Cabling & Wiring 54
11.1 Cable support and protection 54
11.2 Splicing of cables 56
11.3 Colour coding 60
11.4 Fixtures 62
12. Assessment Limitations and Assumptions 64

1. Executive Summary

On 30-Mar-2026, Azka Riaz and Muhammad Bilal Butt on behalf of the Pakistan Accord carried out an initial electrical inspection for M/S Stylers International Ltd. - Unit 2 (Raiwind), a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Najam-us-Saqlain (Project Head), Mr. Imran Shahid (Manager Compliance), Mr. Abdul Wahab (Manager Engineering), Mr. Muhammad Bilal Khan (Manager Electrical), Zubair Umar (Civil Engineer) and other staff members of M/S Stylers International Ltd.

The factory operates in a total of four shifts. Approximately 2000 workers operate in the factory, with 7% of the workers being females.

The factory comprises four buildings and four ancillary structures owned by M/S Stylers International Ltd. During the inspection, the areas highlighted in Figure 1.1 were inspected.

- **Mill Building** is a four storeys (Ground+Mezzanine+2) building. The building is used for solar panels (roof), cutting, canteen, storage and masjid (second floor), sewing and stitching (first floor), offices and server rooms (mezzanine floor), and washing, finishing and offices (ground floor).
- **Utility Building 01** is mainly a single storey structure with a partial mezzanine floor (Ground+Mezzanine) building. The building is used for offices (mezzanine floor), and biomass fuel storage and boiler operation (ground floor).
- **Utility Building 02** is a three storeys (Ground+Mezzanine+1) building. The building is used for chiller room (first floor), offices (mezzanine floor), and workshops and chemical storage (ground floor).
- **Admin Building** is a two storeys (Ground+1) building. The building is used for offices on all floors (first and ground).

Ancillary Structures – It comprises four structures, the details of which are given below:

- **Gate Office 01** is a single storey (ground only) structure. The structure is used for offices (ground floor).
- **Gate Office 02** is a single storey (ground only) structure. The building is used for offices (ground floor).
- **ETP** is a two storeys (Ground+1) structure. The building is used for offices (first floor), and operation building (ground floor).
- **Scrap Yard:** It is a single storey (ground only) structure. It is used for storage purpose (ground floor).

A summary of the main concerns in relation to life safety systems identified during the inspection (non-exhaustive) that should be actioned is as follows:

- **Abnormal Temperature:** Within electrical panels, abnormal temperatures were recorded at various locations (refer to section 7.2 for further details). Hotspots within panels can cause short circuits and fire due to insulation damage and overheating of cables or electrical components.
- **Fire Alarm Detection System:** Five addressable fire alarm systems are installed across the facility. However, several deficiencies were observed, including the absence of built-in batteries in the Admin Building fire alarm control panel (configured as the master panel) and reliance on UPS backup

via non-fire-rated cables. Additionally, the Mill Building panel (first floor) indicated a power supply fault. These conditions may affect the system's reliability during a fire emergency.

• **Emergency lighting System:** The emergency lighting system, supported by a UPS backup supply, was installed using non-fire-rated cabling. In addition, several self-contained emergency lights were found to be non-functional, obstructed, or insufficient in external areas. These conditions may affect safe evacuation during power outages and increase the likelihood of accidents.

We see no reason to suspend operations in the facility due to these concerns, subject to the actions identified being addressed within the specified timeframes.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

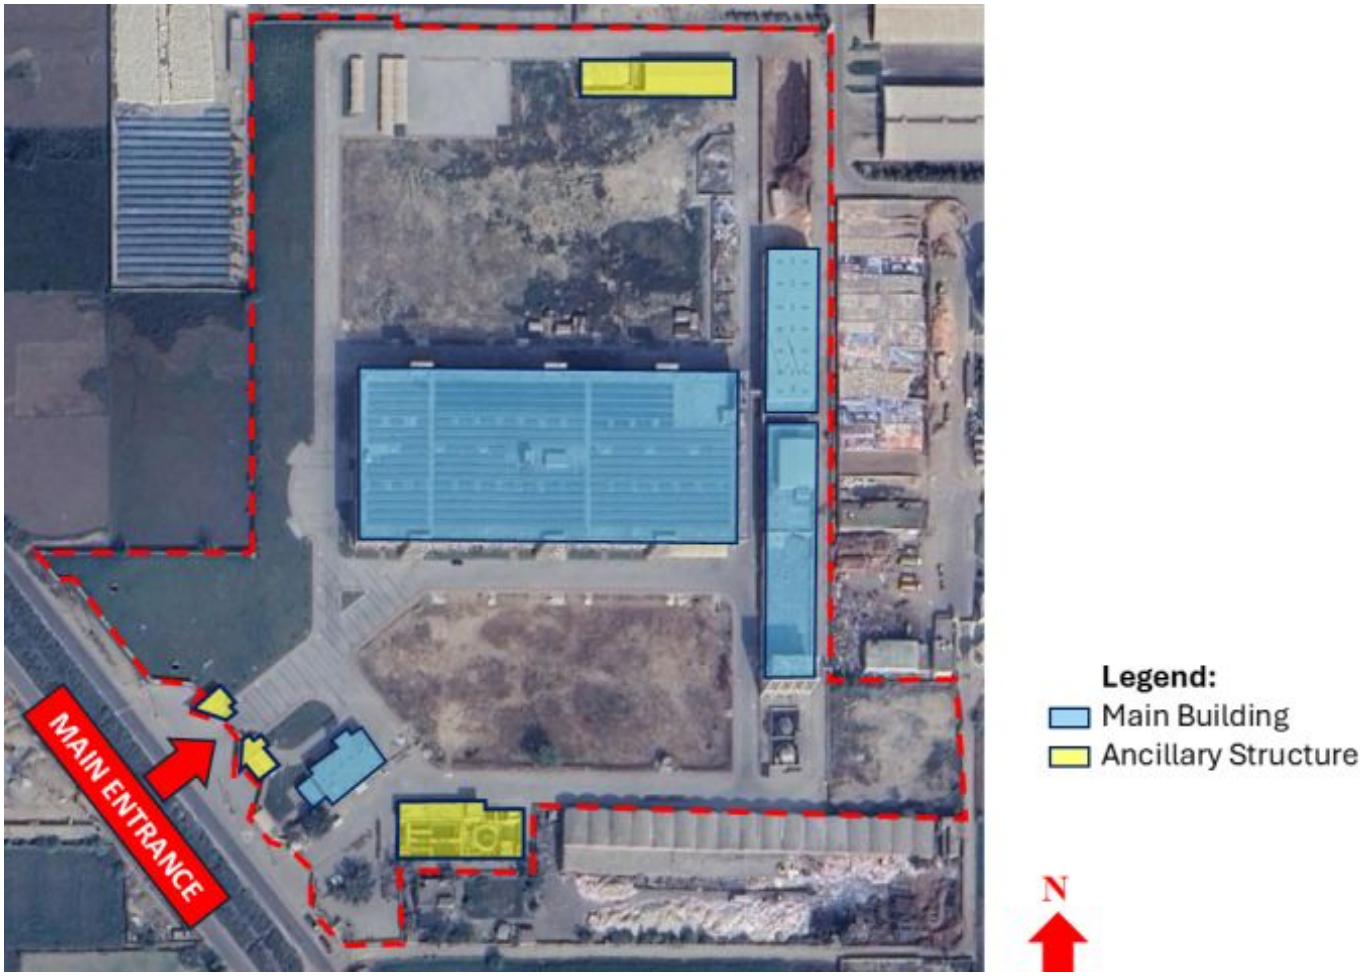


Figure 1.1. Site plan (Satellite view) - Red dashed line indicates site boundary and highlighted areas indicates buildings inspected

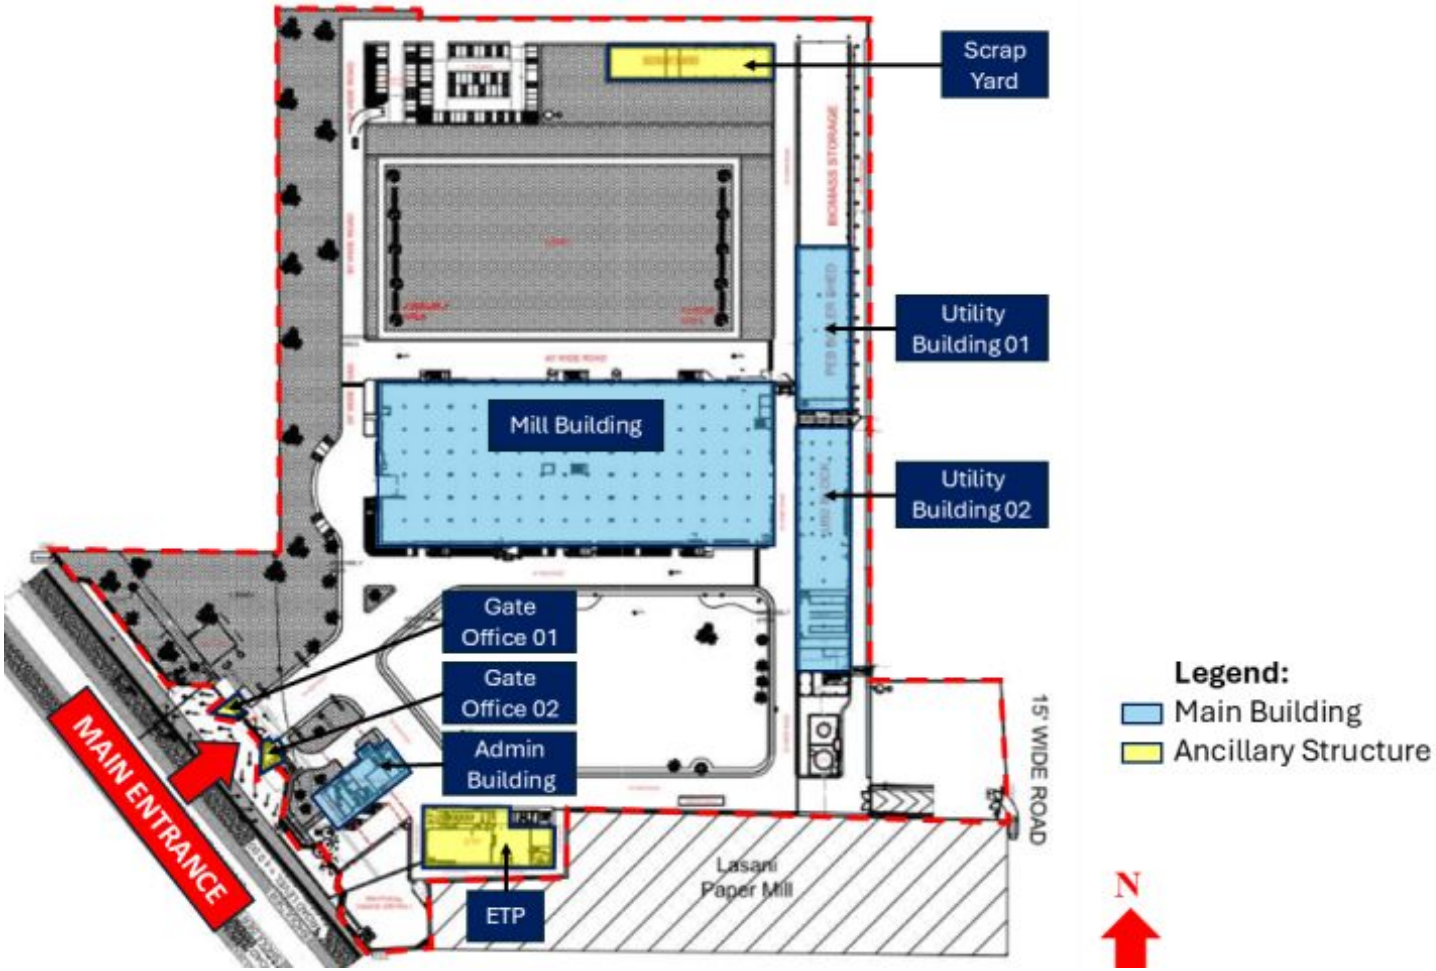


Figure 1.2. Site Layout Plan - Red dashed line indicates site boundary and blue & yellow highlighted areas indicates buildings inspected.

2.1 Building Use

The factory comprises four main buildings and four ancillary structures. The floor-wise activity details are as follows:

Mill Building:
L00 – Ground Floor: Washing, finishing, and offices.
M01 – Mezzanine Floor: Offices and server rooms.
L01 – First Floor: Sewing and stitching.
L02 – Second Floor: Cutting, canteen, storage, and masjid.
L99 – Roof: Solar panels.

Utility Building 01:
L00 – Ground Floor: Biomass fuel storage and boiler operation.
M01 – Mezzanine Floor: Offices.

Utility Building 02:
L00 – Ground Floor: Workshops and chemical storage.
M01 – Mezzanine Floor: Offices.
L01 – First Floor: Chiller room.

Admin Building:
L00 – Ground Floor: Offices.
L01 – First Floor: Offices.

Ancillary Structures:

Gate Office 01:
L00 – Ground Floor: Offices.

Gate Office 02:
L00 – Ground Floor: Offices.

ETP Building:
L00 – Ground Floor: Operations.
L01 – First Floor: Offices.

Scrap Yard:
L00 – Ground Floor: Storage.

2.2 Utility Source

The facility receives a single 11 kV utility supply connection from the Lahore Electric Supply Company (LESCO) as its primary power source, at Utility Building 2. This building houses HT panels, two dry-type step-down transformers (rated 3000 kVA and 1000 kVA), and main LT panels. The low-voltage supply is distributed to the Mill Building via busways (busbar trunking system) and to the rest of the facility through underground cabling. Additionally, a 1 MW solar power system is synchronized with the primary utility supply.

2.3 Backup source

The facility has one 1MW low-voltage diesel generator serving as the primary backup power source and an additional 100 kVA low-voltage diesel generator provided as a standby, both located in the utility building 2. Both UPS and built-in battery backups support the emergency lighting and the fire alarm system.

3. Documentation

This table shows the details of the documentation provided by the factory.

S.NO	Description	Available (Y/N)	Created Date	Status / Remarks
1	Electrical Layout Drawing	No	-	-
2	Single Line Diagrams	Yes	Nov-2022	Document doesn't match site conditions and is not up-to-date as per the required standards.
3	Fire Alarm Drawing	Yes	06-05-2025	Doesn't comply with approval.
4	Earth Test Report	No	-	-
5	Thermographic Test Report	No	-	-
6	Insulation Resistance Test Report	No	-	-
7	LPS Risk Assessments	No	-	-
8	Periodic Maintenance Record	No	-	-
9	Transformer Oil Testing Report	No	-	-

4. Electrical Safety Measures

During our electrical site inspection of M/S Stylers International Ltd. - Unit 2 (Raiwind), a number of electrical issues were identified.

It is essential to address these electrical safety issues promptly to enhance safety and compliance within M/S Stylers International Ltd. - Unit 2 (Raiwind). Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

All survey, testing, and design activities specified in this report shall be performed by a qualified electrical engineer. The recommended installation and modification tasks should be executed by a licensed professional electrician.

Before commencing any installation and/or modification works, the proposed design must be submitted to the Pakistan Accord for approval.

Upon completion of the works, the necessary evidence required to verify that the tasks have been completed to the agreed standards will be determined during the development of the Corrective Action Plan (CAP).

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-064567

Timeline	Remediation Plan
Medium Term CAP-0076216	Factories should begin remediation of CAP items such as cleaning, cable organization, and basic corrections using internal resources. For systems or design-related remediation, engagement of a qualified Electrical Engineer is required.

6. Diagrams & Drawings

6.1 Sub-station room layout drg

This section refers to the electrical rooms within the facility.

During the inspection conducted, it was observed that there were no substation room layout drawings available for the factory.

There are no visible indications of substation equipment locations or pathways for maintenance and emergency access.

The absence of substation room layout drawings poses significant risks to life and fire safety within the factory premises. Without these critical documents, emergency responders and maintenance personnel may face difficulties in locating and isolating electrical faults during emergencies. This delay can result in prolonged exposure to electrical hazards, increasing the risk of electrical fires and endangering lives. Furthermore, the lack of layout drawings complicates routine maintenance, potentially leading to undetected faults and increased likelihood of equipment failure. F-202603-064512

Timeline	Remediation Plan
Medium Term CAP-0076221	Develop detailed substation room layout drawings in accordance with the requirements outlined in Sections 132.12 and 132.13 of BS7671 18th Edition + A2 (2022). Ensure that all critical equipment and pathways are accurately documented. Retain the drawings along with all O&M information for the facility.
Longer Term CAP-0076222	Regularly update and review the substation room layout drawings to reflect any changes in equipment or configuration. Provide training sessions for maintenance personnel and emergency responders on how to interpret and utilize the layout drawings.

6.2 Single Line Diagram (SLD)

This section refers to the entire facility.

It was found that the submitted electrical single-line diagram (SLD) lacked individual SLDs for each distribution board and was missing several essential details, such as cable sizes. Furthermore, it did not match the current site installations.

The factory lacks documented diagrams that illustrate the electrical distribution system, including the connection and configuration of all electrical components.

Single line diagrams are crucial for understanding the electrical distribution network and for troubleshooting issues effectively. Without these diagrams, maintenance personnel and emergency responders lack critical information necessary for isolating faults and managing power during emergencies. This can lead to delays in addressing electrical issues, increasing the risk of electrical fires and potential harm to personnel. Moreover, the lack of SLDs complicates routine maintenance and inspection processes, potentially resulting in undetected electrical faults and system inefficiencies.F-202603-064511

Timeline	Remediation Plan
Medium Term CAP-0076223	Update and develop detailed substation room layout drawings in accordance with the requirements outlined in Sections 132.12 and 132.13 of BS7671 18th Edition + A2 (2022). Ensure that all critical equipment and pathways are accurately documented. Retain the drawings along with all O&M information for the facility.
Longer Term CAP-0076224	Regularly update and review the substation room layout drawings to reflect any changes in equipment or configuration. Provide training sessions for maintenance personnel and emergency responders on how to interpret and utilize the layout drawings.

6.3 Electrical layout drawing

This section refers to the entire facility.

During the survey, it was noted that the factory lacked electrical layout drawings - including small power layouts, lighting layouts, and containment layouts.

This absence was consistent across all areas where such documentation should be available.

These drawings are vital for understanding the placement and connections of electrical systems, which is crucial for identifying and mitigating potential hazards. In emergencies, the lack of detailed layouts can delay the identification and isolation of electrical faults, increasing the risk of fire and electrical accidents. Additionally, without proper layout drawings, routine inspections and maintenance may overlook critical issues, potentially leading to system failures and safety breaches.F-202603-064510

Timeline	Remediation Plan
Medium Term CAP-0076219	Develop comprehensive electrical layout drawings in accordance with the requirements outlined in Sections 132.12 and 132.13 of BS7671 18th Edition + A2 (2022). To avoid drawings becoming overcrowded, separate drawings shall be prepared for each electrical system. Retain the drawings along with all O&M information for the facility.
Longer Term CAP-0076220	Implement a regular review and update process for the electrical layout drawings to reflect any changes in the system. Conduct training sessions for maintenance personnel and emergency responders on interpreting and using the layouts.

7. DBs & Elec Protection Systems

7.1 Circuit breakers

This section refers to the entire facility.

During the survey, the circuit breakers installed throughout the facility, inside the electrical panels and distribution boards, were inspected.

It was observed in utility building 2 that multiple circuit breakers had ratings that were not appropriate for the connected cable sizes.
a. In the compressor electrical panel, a 250 A circuit breaker, adjusted at 175 A, was connected to 35 mm² PVC cables.
b. In the RO electrical panel, a 160 A circuit breaker, adjusted at 112 A, was connected to 16 mm² PVC cables.

Specifically, some circuit breakers had higher ratings than the cables could safely handle, which poses a significant risk of overheating and potential fire hazards. Conversely, other circuit breakers had lower ratings than necessary, resulting in frequent and unnecessary tripping. To ensure both safety and operational efficiency, corrective action is required to align the circuit breaker ratings with the cable capacities. This adjustment will mitigate the risks associated with overheating and improve the reliability of the electrical system. F-202603-064497

Timeline	Remediation Plan
Medium Term CAP-0076461	Evaluate the breaker ratings and cable sizes for all circuits in the facility according to Section 433.1.1 and Appendix 4 of BS 7671 18th Edition + A2 (2022). Ensure that the breaker rating does not exceed the cable's current-carrying capacity. If the breaker has adjustable settings, they must be configured to allow current within the cable's ampacity after applying derating factors.



Figure 2.1 - 160 A circuit breaker connected to 16 mm² PVC cables, RO panel



Figure 2.2 - 175 A circuit breaker connected to 35 mm² PVC cables, compressor panel

7.2 Hot Spots

This relates to the entire facility.

During the inspection, Thermographic surveys were conducted on the electrical boards.

The survey identified numerous hot spots within panels and distribution boards. Hot spots in electrical distribution systems can be caused by several factors, including:

> Loose connections
> Overloaded circuits
> Faulty components
> Improper sized cable
> Insulation degradation

It was also found that the thermographic report was not available at the site. Without thermography testing, faults such as overheating components or loose connections may go unnoticed, which increases the risk of fire. Early detection through thermography can prevent fire incidents.

The categories of identified hot spots have been evaluated as per the ANSI NETA MTS 2019 standard, Table 100.18. Hot spots were observed, particularly at the following locations:
i. 85.8°C and 82.1°C at the busbar connection points, and 71.9°C on the base plate in the solar distribution board located on the rooftop of the main building.
ii. 73.7°C at the cable connector in the ETP distribution board.
iii. 61.1°C at the terminal block cable connection in the boiler distribution board.

Circuit breakers are typically designed to operate safely within an ambient temperature range of -20°C to 40°C. Commonly used PVC-insulated cables typically have a maximum operating temperature of 70°C. Prolonged exposure to temperatures above these can degrade the insulation of the breaker as well as the cable and result in reduced performance.

Hot spots in electrical systems pose significant life safety risks due to several factors. Overheated components can ignite surrounding materials, leading to electrical fires. This is particularly dangerous in densely packed panels and distribution boards where flammable materials may be present. Hot spots can degrade insulation on wires and components, increasing the risk of electrical shock to personnel who might come into contact with exposed conductive parts. Overheating can contribute to conditions that might trigger an arc flash, a dangerous high-temperature

event that can cause severe injuries or fatalities to personnel working near the affected equipment.F-202603-064499

Timeline	Remediation Plan
Immediate CAP-0076462	Any circuits identified on site with temperatures exceeding 40°C above the ambient temperature, operating above 90°C or exhibiting visual signs of burning must be immediately isolated and taken out of service. These circuits should remain de-energized until a thorough review has been conducted and appropriate remedial actions have been implemented to resolve the underlying issues.
Medium Term CAP-0076463	During the inspection, several circuits were identified where the temperature was exceeding 20°C above ambient temperature, as illustrated in the example images below. It is recommended that the factory conducts comprehensive thermographic surveys of all electrical panels to detect similar issues. Identified hot spots should be thoroughly reviewed to determine their underlying causes. Corrective actions must be taken to address and resolve these issues, ensuring safe and reliable operation of the electrical systems.
Longer Term CAP-0076464	Regular thermographic inspections should be incorporated into the maintenance schedule to proactively manage and mitigate the risks associated with overheating. Submit the thermographic test report to the Pakistan Accord for review.



Figure 2.3 - Hot spot found on the busbar connection point in the solar distribution board, mill building



Figure 2.4 - Hot spot found on the busbar connection point in the solar distribution board, mill building



Figure 2.5 - Hot spot found on the busbar connection point in the solar distribution board, mill building



Figure 2.6 - Hot spot found on the busbar connection point in the solar distribution board, mill building



Figure 2.7 - Hot spot found on the base plate in the solar distribution board, mill building



Figure 2.8 - Hot spot found on the base plate in the solar distribution board, mill building

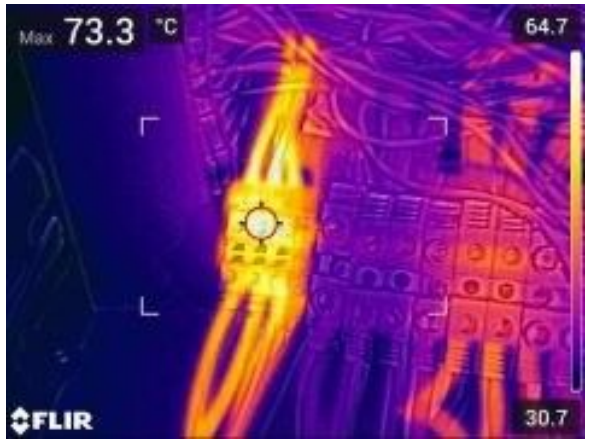


Figure 2.9 - Hot spot found on the cable connector in the ETP distribution board

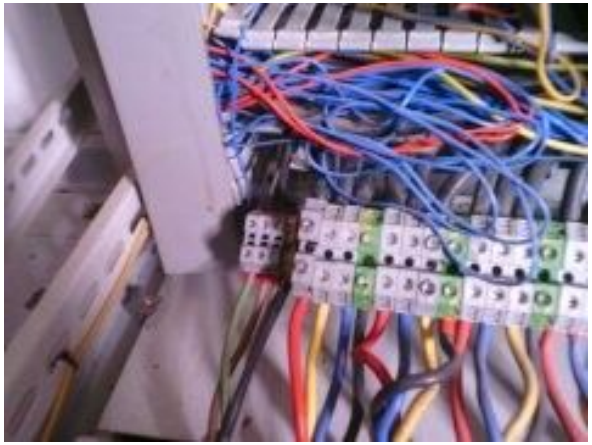


Figure 2.10 - Hot spot found on the cable connector in the ETP distribution board

7.3 Earthing system

This relates to the entire facility.

During the inspection of the facility's electrical panels, distribution boards, and machinery, several observations with the earthing system were identified.

i. A tender document with earthing layouts was submitted; however, essential details were missing, indicating inadequate verification of the earthing system’s compliance and ongoing performance in accordance with relevant standards.

ii. The earthing cable was found disconnected from the earth testing bar outside the mill building.

iii. It was noted that the earth bar was incorrectly connected to the neutral bar in the boiler distribution board, indicating improper grounding practices.

iv. Equipotential bonding for the cable trays, metallic panel covers, and the standby generator body and frame was missing. This issue was observed throughout the facility.

v. The earth pit testing and maintenance records were not provided.

The lack of a proper earthing system throughout the facility poses substantial safety risks, such as electric shocks, fires, and equipment damage. Implementing appropriate earthing measures is crucial to prevent hazardous voltage levels and ensure operational safety. F-202603-064504

Timeline	Remediation Plan
Medium Term CAP-0076984	i. Design and evaluate the facility's earthing system, and develop layout drawings in accordance with BS 7671 18th Edition + A2 (2022). Submit the as-built earthing layout drawings to the Pakistan Accord for review.
Medium Term CAP-0076475	ii. Reconnect and securely terminate the earthing cable to the earth testing bar and verify continuity.
Medium Term CAP-0076476	iii. Disconnect the earth bars from the neutral bars with the distribution boards and ensure proper separation and connection.

Medium Term CAP-0076477	iv. Implement equipotential bonding for all cable trays to comply with BS 7671 Regulation 411.3.1.2. Ensure all exposed conductive parts are bonded to the main earthing terminal.
Medium Term CAP-0076478	v. Implement periodic earth testing per BS 7671 Regulation 643.7.1 to verify grounding effectiveness and submit testing record to Pakistan Accord for review.
Longer Term CAP-0076479	Establish a schedule for regular maintenance and inspection of the earthing system and protective devices as per BS 7671 Regulation 651.2. Document all inspections and maintenance activities to ensure ongoing compliance. Provide training to facility maintenance personnel on proper earthing practices and the importance of maintaining electrical safety standards in line with BS 7671 requirements.



Figure 2.11 - Equipotential bonding missing for the cable tray in the generator room, utility building 2



Figure 2.12 - Neutral and earth cables combined in the boiler distribution board, utility building 1



Figure 2.13 - Equipotential bonding missing for panel doors in the engineering workshop distribution board, utility building 2



Figure 2.15 - Equipotential bonding missing for panel doors in the stitching distribution board, mill building



Figure 2.14 - Earthing cable found disconnected from the earth testing bar outside mill building



Figure 2.16 - Equipotential bonding missing for the standby generator body and frames

7.4 Panel/cabling/busbar

This relates to the entire facility.

The visual site inspection included an examination of the electrical panels, cables, and busbars throughout the facility.

i. Phase separators were missing in some panels, posing the risk of accidental contact between phases. This issue was observed specifically in the solar distribution board located on the rooftop of the mill building.

ii. Inadequate cable dressing was observed in most of the distribution boards, with conductors not properly arranged, secured, or terminated neatly. This resulted in untidy wiring, poor segregation between circuits, and unnecessary strain on terminations, which can lead to loose connections, overheating, and difficulty during inspection or fault-finding. This issue was observed specifically in the main lighting distribution board of utility building 2, as well as the lighting distribution board on the rooftop, and the finishing distribution board on the first floor of the mill building.

The utilization of electrical equipment that is either unsuitable for its operating environment or physically damaged poses significant safety risks. These risks include potential electrical failures, increased likelihood of short circuits, and the heightened risk of fire and electrical shock. F-202603-064500

Timeline	Remediation Plan
Medium Term CAP-0076465	i. Phase separators should be installed between adjacent live conductors of different phases within distribution boards to ensure safe segregation and protection against direct contact, in accordance with BS 7671 Regulation 416.2.
Medium Term CAP-0076466	ii. Ensure proper cable management by organizing and securing cables within the panels using cable ties, clips, or ducting. Verify that all components and connections are securely mounted, neatly arranged, and labelled to improve safety, ease of maintenance, and compliance with electrical standards such as BS 7671.
Longer Term CAP-0076467	Establish a schedule for regular maintenance and inspection of the panel, cabling and busbars. Document all inspections and maintenance activities to ensure ongoing compliance. Provide training to facility maintenance personnel on the importance of maintaining electrical safety standards in line with BS 7671 requirements.



Figure 2.17 - Inadequate cable dressing observed in the main lighting distribution board, utility building 2



Figure 2.18 - Phase separators missing in the solar distribution board on the rooftop, mill building



Figure 2.19 - Inadequate cable dressing observed in the lighting distribution board on the rooftop, mill building



Figure 2.20 - Inadequate cable dressing observed in the finishing distribution board on the first floor, mill building

7.5 Loop Connection

This relates to the entire facility.

During the inspection, loop connections were identified within the electrical panels. This issue was observed specifically in the boiler distribution board of utility building 1, the lighting distribution board on the first floor of utility building 2, and the lighting distribution boards of ETP building, admin building, and on the rooftop of mill building.

In these loop connections, one circuit breaker is energized by the live part of another circuit breaker, creating loops within the panel instead of using a busbar system.

Avoiding loop connections is crucial due to several significant risks. Loop connections can complicate maintenance activities, making it difficult to trace and isolate circuits. These connections can lead to increased resistance and overheating, potentially damaging components. Loop connections raise the risk of accidental phase mixing, which can result in short circuits. The above issues compromise personal safety and significantly increase the risk of fire.F-202603-064502

Timeline	Remediation Plan
Medium Term CAP-0076469	All electrical panels shall be modified to eliminate loop connections. A busbar system within the electrical panels shall be utilized to provide each circuit with the required live, neutral, and earth connections.



Figure 2.21 - Loop connections found in the lighting distribution board of ETP building



Figure 2.22 - Loop connections found in the lighting distribution board of admin building



Figure 2.23 - Loop connections found in the lighting distribution board of mill building



Figure 2.24 - Loop connections found in the boiler distribution board of utility building 1



Figure 2.25 - Loop connections found in the lighting distribution board on the first floor of utility building 2

7.6 Multiple Connections

This relates to the whole facility.

During our inspection, multilooping was observed in a number of electrical panels across the facility. This issue was observed specifically in the boiler distribution board of utility building 1 and the lighting distribution board on the rooftop of mill building.

In these cases, multiple circuits were being protected by a single circuit breaker.

Multilooping can result in improper distribution of electrical current, leading to voltage drops and potential electrical hazards. To mitigate these risks and ensure the safety and reliability of the electrical system, it is essential to adhere to proper installation practices. This includes using appropriate dedicated circuit breakers for each circuit.F-202603-064501

Timeline	Remediation Plan
Medium Term CAP-0076468	The electrical installation throughout the facility shall be modified to ensure each circuit is protected by a dedicated circuit breaker of a suitable type and rating for each individual circuit in accordance with Section 430 of BS 7671 18th Edition + A2 (2022).



Figure 2.26 - Multiple connections found in the boiler distribution board of utility building 1



Figure 2.27 - Multiple connections found in the boiler distribution board of utility building 1



Figure 2.28 - Multiple connections found in the lighting distribution board on the rooftop of mill building

7.7 Openings

This relates to the entire facility of the factory.

During the visual inspection, the electrical panels and distribution boards were examined for unsealed openings to ensure compliance with the IP rating requirements.

Unsealed openings and missing baseplates were observed in the panels and distribution boards. This issue was observed specifically in the fire hydrant panel, water turbine distribution board, and the lighting distribution board in the generator room of utility building 2, and the lighting distribution board of the admin building.

These deficiencies pose multiple hazards. Unsealed openings and missing panels expose live electrical components, significantly increasing the risk of accidental contact and electric shock to personnel working nearby. The unsealed openings allow dust, debris, and moisture to enter, which can lead to short circuits and increase the risk of fire. The absence of proper sealing compromises the IP rating of the panels, which is crucial for ensuring safety and protection against environmental factors.F-202603-064503

Timeline	Remediation Plan
Medium Term CAP-0076470	Corrective actions are required to seal all openings and replace missing panels to restore the integrity and safety of the electrical systems. The electrical system shall ensure compliance with Sections 614.2.1, 412.2.2, and 512.2 of BS 7671 18th Edition + A2 (2022).
Longer Term CAP-0076471	Conduct regular maintenance and maintain comprehensive records for all electrical panels to ensure there are no openings and that the IP ratings of the panels remain uncompromised.



Figure 2.29 - Base plate missing in the water turbine distribution board, utility building 2



Figure 2.30 - Unsealed openings observed in the lighting distribution board of admin building



Figure 2.31 - Unsealed openings observed in the fire hydrant panel of utility building 2



Figure 2.32 - Unsealed openings observed in the lighting distribution board in the generator room, utility building 2

7.8 Adequate accessibility

This relates to the entire facility.

During the visit, the electrical panels and distribution boards were examined for adequate accessibility.

At numerous locations, it was found that the electrical panels do not possess the required space for inspection or easy access to the panels and their components. This issue was observed specifically in the engineering workshop distribution board of the utility building 2, the parking shed distribution board, the cargo lift electrical panel, and the washing distribution board in the mill building.

Limited accessibility to distribution panels and machine panels hampers effective maintenance and inspection procedures. This can potentially cause delays in addressing emergencies and troubleshooting electrical problems. These accessibility challenges could compromise the operational reliability and safety of the premises, as prompt maintenance and emergency responses are hindered. F-202603-064506

Timeline	Remediation Plan
Medium Term CAP-0076474	Electrical equipment shall be arranged to provide sufficient space for the initial installation and later replacement of individual items of electrical equipment. Sufficient allowance shall also be made for sufficient space for the initial installation and later replacement of individual items of electrical equipment in accordance with Section 132.12 of BS7671 18th Edition + A2 (2022).



Figure 2.33 - Inadequate accessibility for the cargo lift electrical panel, mill building



Figure 2.34 - Inadequate accessibility for the washing distribution board, mill building



Figure 2.35 - The parking shed distribution board door obstructed in the parking area



Figure 2.36 - Inadequate accessibility for the engineering workshop distribution board, utility building 2

7.9 Lint & dust inside panel board

This relates to the entire facility.

During the inspection, the cleanliness of electrical panels, distribution boards and electrical containment was assessed.

The inspection revealed a significant accumulation of lint and dust in the parking shed distribution board in the parking area.

The presence of lint and dust inside distribution boards poses several hazards. Accumulated lint and dust can act as fuel for fires if exposed to electrical currents or sparks, significantly increasing the risk of electrical fires. The cooling capacity of electrical components can also be impaired by the presence of dust and lint, leading to overheating.

Additionally, the accumulation of dust and lint can obstruct proper operation and maintenance, thereby impairing the functionality of the electrical components.F-202603-064505

Timeline	Remediation Plan
Medium Term CAP-0076472	All electrical panels and trunking runs shall be inspected and cleaned of any dust or lint in accordance with Section 522.4.2 of BS7671 18th Edition + A2 (2022).
Longer Term CAP-0076473	A regular maintenance procedure shall be established to ensure routine inspection and cleaning of all electrical panels and trunking runs. This will prevent the accumulation of lint and dust, thereby maintaining the safety and efficiency of the electrical systems.



Figure 2.37 - Lint and dust observed in the parking shed distribution board, parking area

7.10 Lightning Protection System (LPS)

During the inspection, the lightning protection strategy of the factory was assessed.

A lightning protection system was provided; however, no risk assessment report was provided in accordance with BS EN 62305. The submitted lightning protection design was based on NF C 17-102, which utilizes the Early Streamer Emission (ESE) method. As per BS EN 62305, ESE-based designs are not recognized and therefore do not demonstrate compliance with the standard.

Lightning strikes can cause significant damage to buildings, primarily through the ignition of fires. When lightning strikes a structure, it can cause an electrical surge that ignites flammable materials. Without a proper lightning protection system (LPS), the energy from a lightning strike can travel through the building's electrical and plumbing systems, creating sparks and starting fires. F-202603-064509

Timeline	Remediation Plan
Medium Term CAP-0076227	Engage a qualified lightning protection specialist to perform a comprehensive risk assessment according to BS EN 62305 (Protection against Lightning). This assessment will determine the necessity of a lightning protection system (LPS) based on factors such as building height, location, occupancy, and the presence of sensitive electronic equipment.
Longer Term CAP-0076228	If the risk assessment concludes that an LPS is necessary, then hire a qualified engineer to perform an adequacy study of the existing LPS. This study should evaluate whether the current system meets the necessary design and performance standards according to BS EN 62305. If the study finds that the current LPS is inadequate, make the necessary upgrades to bring the system up to standard.



Figure 2.38 - Lightning protection system installed at the rooftop of mill building



Figure 2.39 - Lightning arrestor installed at the top of telecom tower, near utility building 2

8. Fire Alarm & Detection System (FADS)

8.1 Non-functional or incomplete

This section refers to the entire facility.

During the inspection, the Fire Alarm and Detection System (FADS) for the facility was evaluated.

Five addressable fire alarm systems were installed across the facility. The Admin Building fire alarm control panel lacked built-in batteries and was used as a master panel, with UPS backup via non-fire-rated cables, and the fire alarm control panel installed on the first floor of the Mill Building panel also indicated a power supply fault. Additionally, inadequate manual call points and fire detection coverage were observed at several locations, with some detectors found covered. Addressable fire alarm panels also lacked documentation and certification to verify their authenticity as listed products. These issues pose a significant life safety risk in the event of a fire emergency.

A non-functional/incomplete FADS significantly increases the risk of worker injury or fatality, substantial property damage, operational disruptions, legal liabilities, reputational damage, and environmental harm. A delayed response during a fire event can significantly increase the impact on personnel, goods, and property.F-202603-064513

Timeline	Remediation Plan
Immediate CAP-0076441	Ensure the functionality and performance of the existing alarm and detection system within the building and remove the faults indicated on the fire alarm control panels.
Medium Term CAP-0076442	i. Submit design documentation for the new replacement of FADS system to Pakistan Accord for review before purchasing any new equipment. Design documentation to include drawings, technical data sheets, and product certifications of all listed equipment to show full compliance with the Fire Alarm and Detection System (FADS) with NFPA 72.
Longer Term CAP-0076443	ii. Submit documentation to the Pakistan Accord showing that an L/C has been opened for import of any components required for the FADS design submitted earlier.
Longer Term CAP-0076444	iii. Submit documentation to the Pakistan Accord demonstrating that all materials, both imported and locally procured, have been purchased and are available on-site for installation.

Longer Term CAP-0076445	iv. Once installation of the FADS system is complete, the factory is to submit full "as-built" documentation of the system to the Pakistan Accord for review.
Longer Term CAP-0076446	v. Factory to advise Pakistan Accord when FADS installation is fully completed and ready for review. Pakistan Accord will then arrange a verification inspection to ensure that the installation fully complies with the previously reviewed design documentation.
Longer Term CAP-0076447	vi. Provide full testing and commissioning (T&C) certification from the FADS system installer and make provision for attendance of the system installer, factory technical personnel, and Pakistan Accord technical team to witness a final T&C demonstration verification on site. On successful completion of this T&C verification inspection, remediation of the FADS system will be complete.



Figure 2.40 - Fire alarm and detection missing in the cargo lift room, mill building



Figure 2.41 - Fire alarm and detection missing in the chiller room, utility building 2



Figure 2.42 - Smoke detector found covered in the generator room, utility building 2



Figure 2.43 - Fire alarm control panel showing fault indication installed in the admin building



Figure 2.44 - Manual call point missing in the child care room, admin building



Figure 2.45 - Smoke detector found covered in the finishing area, mill building

8.2 Maintenance records

This section refers to the entire facility.

It was observed that the testing and maintenance of the Fire Alarm and Detection System (FADS) have not been conducted in accordance with the requirements specified in Chapter 14 of NFPA 72.

Routine testing and maintenance of the Fire Alarm and Detection System (FADS) in a factory are essential to ensure the system's reliability and functionality, enabling early fire detection and preventing unexpected failures. It also ensures compliance with NFPA 72 and other regulatory standards, enhances occupant safety through effective evacuation, and minimizes operational downtime and costs. F-202604-065152

Timeline	Remediation Plan
Longer Term CAP-0077122	Conduct regular testing of the Fire Alarm and Detection System (FADS) to verify proper operation under both mains and backup power supply conditions. Ensure any faults indicated on the FADS control panel are promptly diagnosed and rectified. Maintain accurate records of all routine test results to ensure ongoing compliance and system reliability in accordance with Chapter 14 of NFPA 72.

9. Emergency Lighting

9.1 Provided but non-functional

The section refers to the entire facility.

During the inspection, it was observed that emergency lighting was provided but not functional in a number of locations. This issue was specifically observed in the engineering workshop of utility building 2, the washing area of mill building, the child care room, and on the first floor of the admin building.

Functional emergency lighting is critical for providing illumination in the event of a power failure or other emergencies, ensuring that workers can safely evacuate the facility.F-202603-064508

Timeline	Remediation Plan
Medium Term CAP-0076448	Conduct a thorough inspection of all emergency lighting units throughout the facility to identify specific locations and units that are non-functional. This involves checking both the lights and the power sources, including batteries and wiring connections. Repair any faulty emergency lighting units immediately. If repair is not feasible, replace the defective units with new, compliant emergency lighting fixtures to ensure they provide adequate illumination during an emergency.
Longer Term CAP-0076449	Establish a regular maintenance and testing schedule to routinely check the functionality of emergency lighting systems. This should include periodic tests, inspections, and prompt maintenance actions to address any issues. Maintain detailed records of all inspections, tests, repairs, and maintenance activities. Train facility maintenance staff on the procedures for inspecting and maintaining emergency lighting systems to ensure ongoing reliability and compliance with safety standards.



Figure 2.46 - Non-functional emergency light found on the first floor of admin building



Figure 2.47 - Non-functional emergency light found in the washing area of mill building



Figure 2.48 - Non-functional emergency light found in the child care room of admin building



Figure 2.49 - Non-functional emergency light found in the engineering workshop of utility building 2

9.2 Provided but insufficient

The section refers to the entire facility.

During the inspection, the emergency lighting arrangement throughout the facility was assessed.

The following observations were made:

i. Several areas lack sufficient emergency lighting and exit directional signs coverage. This issue was specifically observed in the corridors and internal stairs of the mill building. Additionally, the layouts for emergency lighting were missing. The absence of emergency lighting layouts throughout the facility raises concerns regarding the adequacy of illumination provided during power failures or emergencies.

ii. Emergency lights were found blocked or obstructed in multiple areas, including the washing area and first floor of the mill building, and the chemical store of utility building 2.

iii. A central UPS was utilized to provide backup power to the normal lighting in the substation building; however, non-fire-rated cables were used for the emergency lighting circuits.

iv. External emergency lighting was not provided, preventing people from reaching a place of safety outside the facility during nighttime evacuations. This issue was observed in the external emergency stairs of the mill building, the admin building, and utility building 2.

Adequate and functional emergency lighting throughout the facility is crucial for providing necessary illumination during power failures or other emergencies, ensuring the safe evacuation of workers.F-202603-064507

Timeline	Remediation Plan
Medium Term CAP-0076456	i. Conduct a comprehensive survey to identify areas lacking adequate emergency lighting. Prepare and submit the emergency light design and layouts to the Pakistan Accord for review. Install additional emergency luminaires and exit directional signs in these areas to meet the coverage requirements specified in the Building Code of Pakistan Fire Safety Provisions 2016, ensuring sufficient illumination for safe evacuation.
Medium Term CAP-0076457	ii. Ensure all emergency lights remain unobstructed and clearly visible at all times.

Medium Term CAP-0076458	iii. Replace non-fire-rated cables with compliant fire-rated cabling for emergency lighting circuits and ensure that the UPS is placed in accordance with applicable fire and electrical safety standards.
Medium Term CAP-0076459	iv. Install external emergency luminaires to enable safe evacuation during hours of darkness, all the way to a safe place outside the building(s).
Longer Term CAP-0076460	Establish a regular maintenance and testing schedule to routinely check the functionality of emergency lighting systems. This should include periodic tests, inspections, and prompt maintenance actions to address any issues. Maintain detailed records of all inspections, tests, repairs, and maintenance activities. Train facility maintenance staff on the procedures for inspecting and maintaining emergency lighting systems to ensure ongoing reliability and compliance with safety standards.



Figure 2.50 - External emergency lights missing in emergency stairs of utility building 2



Figure 2.51 - Insufficient emergency light in the corridor of mill building



Figure 2.52 - Emergency light obstructed in the chemical store, utility building 2



Figure 2.53 - External emergency lights not provided in the emergency stairs of mill building



Figure 2.54 - Emergency light missing in the stairway of the mill building



Figure 2.55 - Emergency light obstructed in the washing area, mill building

9.3 Independent power source

The section refers to the entire facility.

During the inspection, it was observed that the emergency lighting within the facility was not connected in a manner that would ensure automatic activation upon the loss of power to the general lighting in various spaces.

Proper circuitry is crucial to ensure that emergency lighting is automatically activated when general lighting fails. This automatic activation is essential for maintaining sufficient illumination, allowing for the safe evacuation of occupants and preventing panic during power outages. Further the emergency lights and exit signs should be reconfigured to be connected on a dedicated single circuit, which must not include any other load except for the emergency lighting system. According to the Building Code of Pakistan Fire Safety Provisions 2016, emergency lighting systems must be designed to provide immediate illumination in the event of power loss to ensure a clear and safe path for evacuation.

Ensuring that the emergency lighting is integrated with the facility's power system to activate automatically during power failures is critical for life safety. This integration helps prevent hazardous conditions that can arise in the dark, such as trips, falls, and confusion, thereby facilitating orderly and efficient evacuation during emergencies.F-202603-064514

Timeline	Remediation Plan
Medium Term CAP-0076450	Reconfigure the emergency lighting circuitry to ensure that emergency lights activate immediately upon failure of general lighting power as required by the Building Code of Pakistan Fire Safety Provisions 2016. Emergency lighting shall be powered from a source independent of that supplying the normal lighting.
Longer Term CAP-0076451	Establish a regular maintenance and testing schedule to routinely check the functionality of emergency lighting systems. This should include periodic tests, inspections, and prompt maintenance actions to address any issues. Maintain detailed records of all inspections, tests, repairs, and maintenance activities. Train facility maintenance staff on the procedures for inspecting and maintaining emergency lighting systems to ensure ongoing reliability and compliance with safety standards.

10. Generator, Transformer & Sub-Station Room

10.1 Battery

During the inspection of the battery system, the battery cells, connections, and enclosures were thoroughly examined.

Stand-by generator battery terminals were exposed and not properly insulated, increasing the risk of electrical shock or short circuits.

Proper monthly and annual maintenance of the battery system is crucial for fire safety. Spilled fluid can cause corrosion and fires, while bare terminals increase the risk of electrical shocks and short circuits, potentially igniting fires or explosions. Non-compliant battery placement can obstruct ventilation, leading to hazardous gas buildup and fire risks. Addressing these issues is essential to prevent fires and ensure battery system safety.F-202603-064517

Timeline	Remediation Plan
Medium Term CAP-0076225	Insulate exposed battery terminals using appropriate insulating materials to prevent electrical shock and short circuits. Conduct a thorough inspection of all connections to ensure that there are no immediate risks of exposure.
Longer Term CAP-0076226	Establish a routine inspection and maintenance protocol to check and maintain proper insulation of all battery terminals regularly.



Figure 2.56 - Exposed terminals observed on the standby generator battery

11. Cabling & Wiring

11.1 Cable support and protection

This section refers to the entire facility.

During the inspection of the entire facility, a visual survey of the cable containment system was conducted.

Proper supports were not provided for cables; they were laid directly on the ground and hung along the walls. Additionally, several locations had open and exposed electrical connections. Inadequate cable support results in sagging or stress on cables, which can lead to damage or failure. This issue was specifically observed outside the mill building, the admin building, and near the unloading gate inside the mill building. F-202603-064498

Timeline	Remediation Plan
Medium Term CAP-0076419	Secure cables with appropriate supports and insulate any exposed connections to prevent sagging, stress, and potential hazards. (Reference: BS 7671 18th Edition + A2 (2022) Regulation 522.8.5 for mechanical support and 526.5 for proper terminations).
Longer Term CAP-0076420	Implement a comprehensive cable management system with regular inspections to ensure cables remain properly supported and insulated over time.



Figure 2.57 - Inadequate cable support observed near unloading gate in the mill building



Figure 2.59 - Cable hanging with inadequate support outside the mill building



Figure 2.58 - Cable laying on the ground with inadequate support outside the admin building

11.2 Splicing of cables

This relates to the whole facility.

During the inspection, the cable installation was visually surveyed throughout the facility.

The following observations were noted:

i. Cables terminations within panels and switchgears were made without cable lugs, resulting in broken strands and loose connections. This presents a significant fire risk due to the potential for electrical arcing and overheating, which can ignite nearby materials and cause a fire. Furthermore, loose connections can cause voltage drops and equipment malfunctions, posing a life safety hazard. This issue was specifically observed in the boiler distribution boards and the stitching distribution board on the first floor of the mill building.

ii. PVC tape joints were found in several locations - including within distribution boards - where cables were either damaged or two cables were being joined together. This method of jointing is unreliable and can deteriorate over time, increasing the risk of electrical shorts and fires. The adhesive on PVC tape can degrade, leading to exposed conductors that can spark and ignite surrounding materials, presenting both fire and life safety risks. This issue was specifically observed in the ETP panel, compressor distribution board, and the boundary light connections near the ETP building.

iii. Non-compliant PVC connectors used in the cable cellar of utility building 2, which could pose a hazard of a potential short circuit due to their poor insulation.

iv. Open, exposed, and idle cable connections were found inside distribution boards and outside the admin building, posing a risk of electric shock, short circuit, and fire. This issue was specifically observed in the ETP panel, compressor distribution board and the boiler distribution board.

For any future electrical work, the termination of stranded cables must be done with cable lugs, and PVC tape joints shall not be utilized. Proper termination ensures secure and reliable connections, reducing the risk of electrical failures and enhancing overall safety.F-202603-064495

Timeline	Remediation Plan

Medium Term CAP-0076431	i. Install cable lugs on all improperly terminated cables within panels and switchgears to secure connections and prevent breaking strands and loose connections in accordance with Regulation 526.1 of BS7671 18th Edition + A2 (2022).
Medium Term CAP-0076432	ii. Replace all PVC tape joints with proper terminal blocks or connectors to ensure secure and stable connections in accordance with Regulation 526.1 of BS7671 18th Edition + A2 (2022). Replace all damaged cabling with new wiring.
Medium Term CAP-0076433	iii. Replace the low-quality PVC connectors with standard quality terminal blocks in accordance with BS7671 18th Edition + A2 (2022).
Medium Term CAP-0076434	iv. Remove unused cables or properly terminate and insulate open and exposed connections to eliminate the risk of sparks and potential fires. (Reference: BS 7671 18th Edition + A2 (2022) Regulation 416.1 for basic insulation of live parts).
Longer Term CAP-0076435	i. Implement a standard operating procedure (SOP) requiring the use of cable lugs for all future cable terminations. Regularly train and audit personnel to ensure compliance with this procedure, thus maintaining safe and reliable electrical connections.
Longer Term CAP-0076436	ii. Establish a policy prohibiting the use of PVC tape for electrical jointing. Regularly inspect and maintain electrical installations to ensure compliance, and provide continuous training for staff on proper jointing techniques.
Longer Term CAP-0076437	iii. Establish a plan to replace all low-quality PVC connectors with compliant electrical terminal blocks and integrate this into regular maintenance to ensure ongoing safety and compliance.
Longer Term CAP-0076438	iv. Establish routine inspections to ensure all electrical terminations remain properly insulated and protected from exposure, especially in high-risk operational areas.



Figure 2.60 - Open and exposed connections observed outside admin building



Figure 2.61 - Cable terminations without lugs and open earthing cables in the boiler distribution board

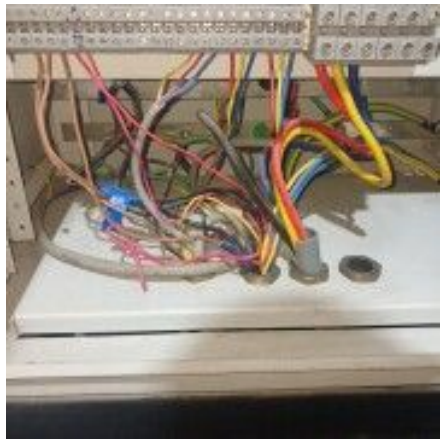


Figure 2.62 - Exposed connections and PVC tape joints in the compressor distribution board



Figure 2.63 - Low quality PVC connector found in the cable cellar in utility building 2



Figure 2.64 - Open and exposed wiring connections found in the ETP panel



Figure 2.65 - Spliced cables covered with PVC tape found in the boundary wall light connections

11.3 Colour coding

This relates to the whole facility.

During the inspection of several distribution boards, deviations from standard cable colour coding practices were identified. Such deviations pose significant risks, as they can lead to the misinterpretation and misidentification of cables. This misidentification can result in incorrect connections, potentially causing unsafe working conditions and increasing the likelihood of electrical accidents, such as shocks or fires. This issue was specifically observed in the RO plant panel and the lighting distribution board on the first floor of utility building 2.

To mitigate these risks, it is imperative that all future electrical work strictly adheres to standardized colour coding as prescribed by BS 7671. This will ensure accurate identification of conductors, thereby enhancing overall safety and operational efficiency. F-202603-064494

Timeline	Remediation Plan
Medium Term CAP-0076423	Conduct a comprehensive audit of all distribution boards to identify and correct any deviations from the standard cable colour coding. This involves re-labelling or re-insulating the cables with the appropriate colour codes as specified in BS 7671. Specifically, adhere to BS 7671 Regulation 514.3.1, which mandates the correct identification of conductors.
Longer Term CAP-0076424	Develop and enforce a strict protocol for cable colour coding to be followed for all future installations and maintenance activities. This protocol should include regular training sessions for electricians and maintenance personnel to keep them updated on the latest standards and practices. Additionally, periodic audits should be conducted to ensure ongoing compliance with the standardized colour coding system, thereby preventing future deviations and ensuring sustained safety and operational efficiency.



Figure 2.66 - Incorrect color coding observed on the earthing bar in the RO plant panel, utility building 2



Figure 2.67 - Incorrect color coding observed in the lighting distribution board on the first floor, utility building 2

11.4 Fixtures

This relates to the whole facility.

During the inspection, the electrical fixtures throughout the facility were visually surveyed.

Power receptacle installed on the rooftop of utility building 2: Receptacles placed in unsuitable locations, such as non-IP rated sockets installed outdoors or exposed to the elements, are at higher risk of moisture ingress and corrosion. This can lead to electrical short circuits or fires, posing a severe safety hazard.F-202603-064496

Timeline	Remediation Plan
Medium Term CAP-0076440	Develop installation guidelines and training for personnel to ensure future power receptacles are installed in compliant and safe locations.
Medium Term CAP-0076439	Relocate power receptacles from inappropriate locations to more suitable, protected areas to prevent exposure to environmental elements. For external receptacles utilize suitably rated IP fixtures.



Figure 2.68 - Non-weather proof power receptacle installed on the rooftop of utility building 2

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.