Issue	**1**
Factory ID	**920037**
Date of Issue	**04-Jun-2026**

M/S Stylers International Ltd. - Unit 2 (Raiwind)

Village Buchoke Majha Raiwind Bypass 3 Km Off Raiwind Manga Road, Tehsil Raiwind
55150 Lahore
Punjab Pakistan

Latitude: [31.228723], longitude: [74.176596]
Date of inspection: 30-Mar-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Abdul Hayee**
Reviewed by	**Muhammad Naseer**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 30-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 11
   - 3.1 Building Means of Egress Details 13
   - 3.2 Building Use 17
4. Documentation 20
5. Fire Safety Measures 21
6. Remediation Support 22
   - 6.1 Engineering Support 22
7. Means of Escape 23
   - 7.1 Escape doors 23
   - 7.2 Exit access 25
   - 7.3 Travel distance 27
   - 7.4 Protection of stairs 28
   - 7.5 Exit signage 31
8. Fire Rated Construction 33
   - 8.1 Separation of high-risk areas 33
   - 8.2 Separation of shafts 36
   - 8.3 Floor openings 38
   - 8.4 Separation of occupancies 40
   - 8.5 Storage 42
9. Fire Suppression 44

9.1 Standpipe system 44
9.2 Fire pumps 46
9.3 Water supply 48
9.4 Fire extinguishers 49
10. Hazardous Materials 51
10.1 Chemicals storage 51
10.2 Diesel storage 53
11. Fire Safety Management 55
11.1 Fire drills 55
11.2 Records of system testing 56
11.3 Records of systems maintenance 57
11.4 Emergency Action Plan 58
12. Assessment Limitations and Assumptions 59

1. Executive Summary

On 30-Mar-2026, Shehroz Javed and Abdul Hayee on behalf of the Pakistan Accord carried out an initial fire inspection for M/S Stylers International Ltd. - Unit 2 (Raiwind), a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Najam-Us-Saqlain (Project Head), Mr. Muhammad Imran Shahid (Manager Compliance), Mr. Abdul Wahab (Manager Engineering), Mr. Bilal Khan(Manager Electrical) along with other staff members of the factory. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Accord were also present and the team was led by Mr. Abdul Hayee from Pakistan Accord.
The factory comprises of 4 buildings and 5 ancillary structures.
Details of buildings are provided below:

1. **Mill Building** is a 3 storey (G+M+2) RC moment resisting frame building, with a covered area (footprint) of 11,364 sq. m. The mezzanine does not comply with Fire Safety provisions under the Pakistan Accord Building Standard and is therefore classified as a full floor, making the building a 4 storey structure (G+3). The height of the building is 13.2 m measured from the fire department vehicle access to the topmost occupied floor. Building has 8 staircases out of which 2 discharge internally. The building is used for solar panels (roof), cutting, canteen, storeroom, electric room and mosque (second floor); stitching and sewing (first floor); major portion of the mezzanine is under construction, only IT room is operational at mezzanine (mezzanine); washing, finishing, offices, QA lab, electric room and warehouse (ground floor). The building was constructed in 2024.

2. **Utility Building 1** is a single storey (G+M) steel portal frame building, with a covered area (footprint) of 1190 sq. m. A staircase serves mezzanine only. The building is used for unoccupied (roof); control room (mezzanine); boilers, workshop and biomass storage (ground floor). Building was constructed in 2024.

3. **Utility Building 2** is a 2 storey (G+M+1) is combination of RC moment resisting frame and steel portal frame, with a covered area (footprint) of 2,180 sq. m. A total of 4 staircases serves the building out of which 2 staircases discharge externally, one serve mezzanine only and one serves first floor to open space of mezzanine. The building is used for unoccupied (roof), chiller and control room (first floor); offices and electric panel room (mezzanine); compressors, generators, electric room, transformer room, engineering workshop, chemical store, RO plant room, stores, fire pump room (ground floor). Building was constructed in 2024.

4. **Admin Building** is a 2 storey (G+1) load bearing brick masonry building, with a covered area (footprint) of 440 sq. m. A total of 2 staircase serves the building both staircases discharges externally. The building is used for unoccupied (roof); meeting room, kitchen, control room and offices (first floor); and dispensary, daycare, store and offices (ground floor). The building was constructed in 2024.

Details of ancillaries are provided below:

1. **Scrap yard** is a single storey (Ground only) steel portal frame structure. The structure is used for scrap storage. The structure was constructed in 2024.
2. **ETP** is a 2 storey (G+1) load bearing brick masonry structure. The structure is used for storage. The structure was constructed in 2024.
3. **Offices** is a single storey (Ground only) load bearing brick masonry structure. The structure is used for offices. The structure was constructed in 2024.
4. **Gate office 1** is a single storey (Ground only) load bearing brick masonry structure. The structure is used for offices. The structure was constructed in 2024.
5. **Gate office 2** is a single storey (Ground only) load bearing brick masonry structure. The structure is used for offices. The structure was constructed in 2024.

The factory complex is entirely occupied by M/S Stylers International Ltd. (Unit-2) as owner.
The factory operates in four shifts with approximately 2000 workers out of which approximately 7% employees are female.
We were presented with Architectural Layouts, Section layout, Evacuation Maps, Emergency Action Plan, Civil Defence Certificate, Inspection record, Fire Drills and Staff Training documents.

A summary of the main concerns identified during the inspection includes (non-exhaustive):

- Lockable mechanisms observed in escape route across the whole facility.
- Travel Distances exceeding permitted limits.
- There is no fire separation between stairs, lift shafts and the rest of the building.
- Multiple stairs discharge inside the building.
- Storage areas are not fire separated from rest of the building.
- Standpipe system is missing in the staircases of the Mill Building.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes.)

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Building	Mill Building
Stability System	RC moment resisting frame
Column Size (m)	0.76 x 0.76 0.923 Diameter
Grid (m)	8.4 x 8.4
Primary Beam Size (m)	0.45 x 0.63
Secondary Beam Size (m)	0.15 x 0.63
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	4.8 (Second to Roof) 3.8 (Mezz. to First) 3.8 (Ground to Mezz.)

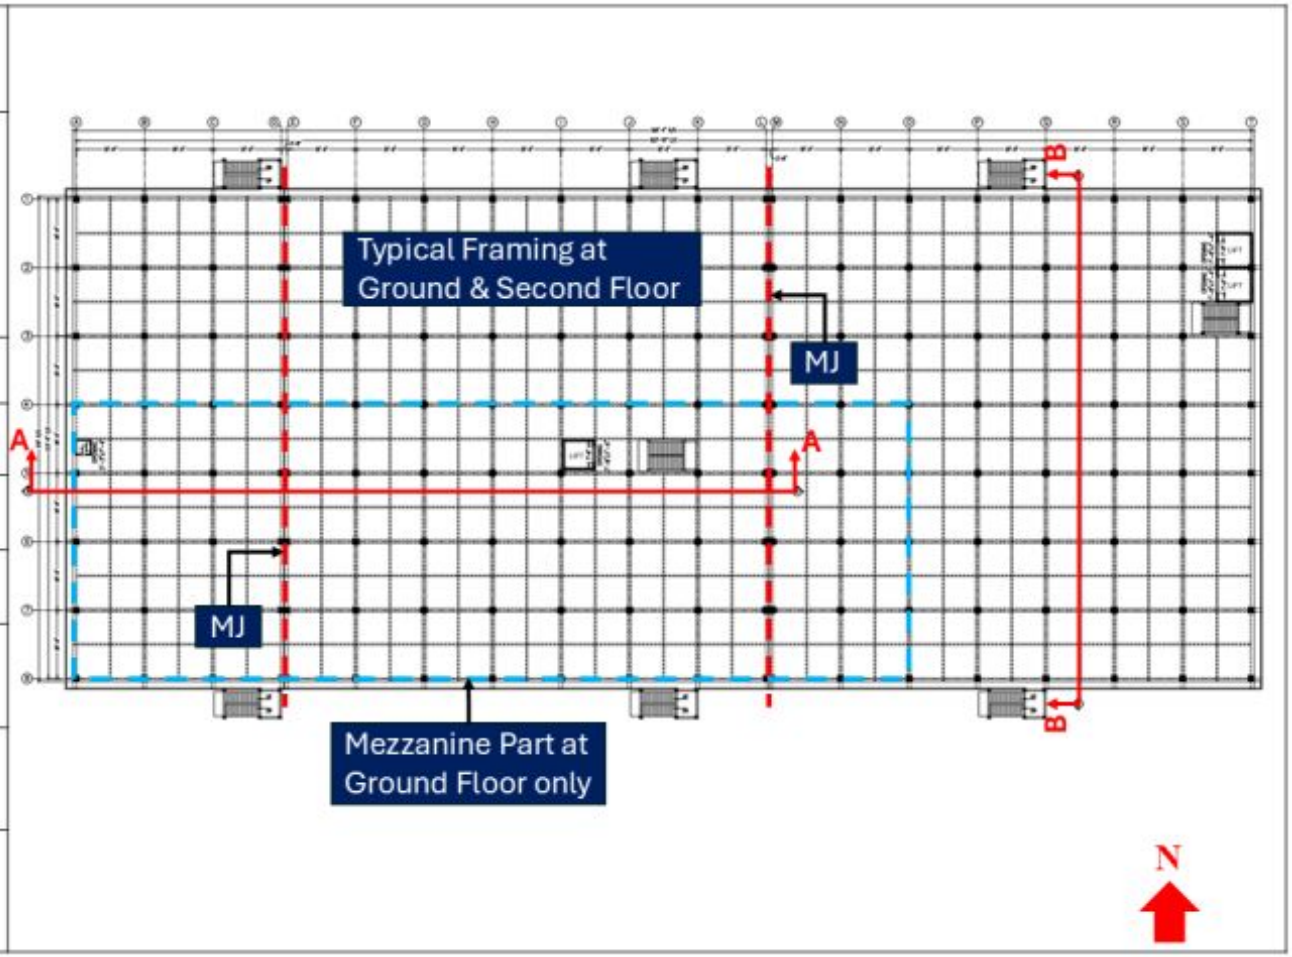


Figure 1.1. Satellite View of the Factory Premises

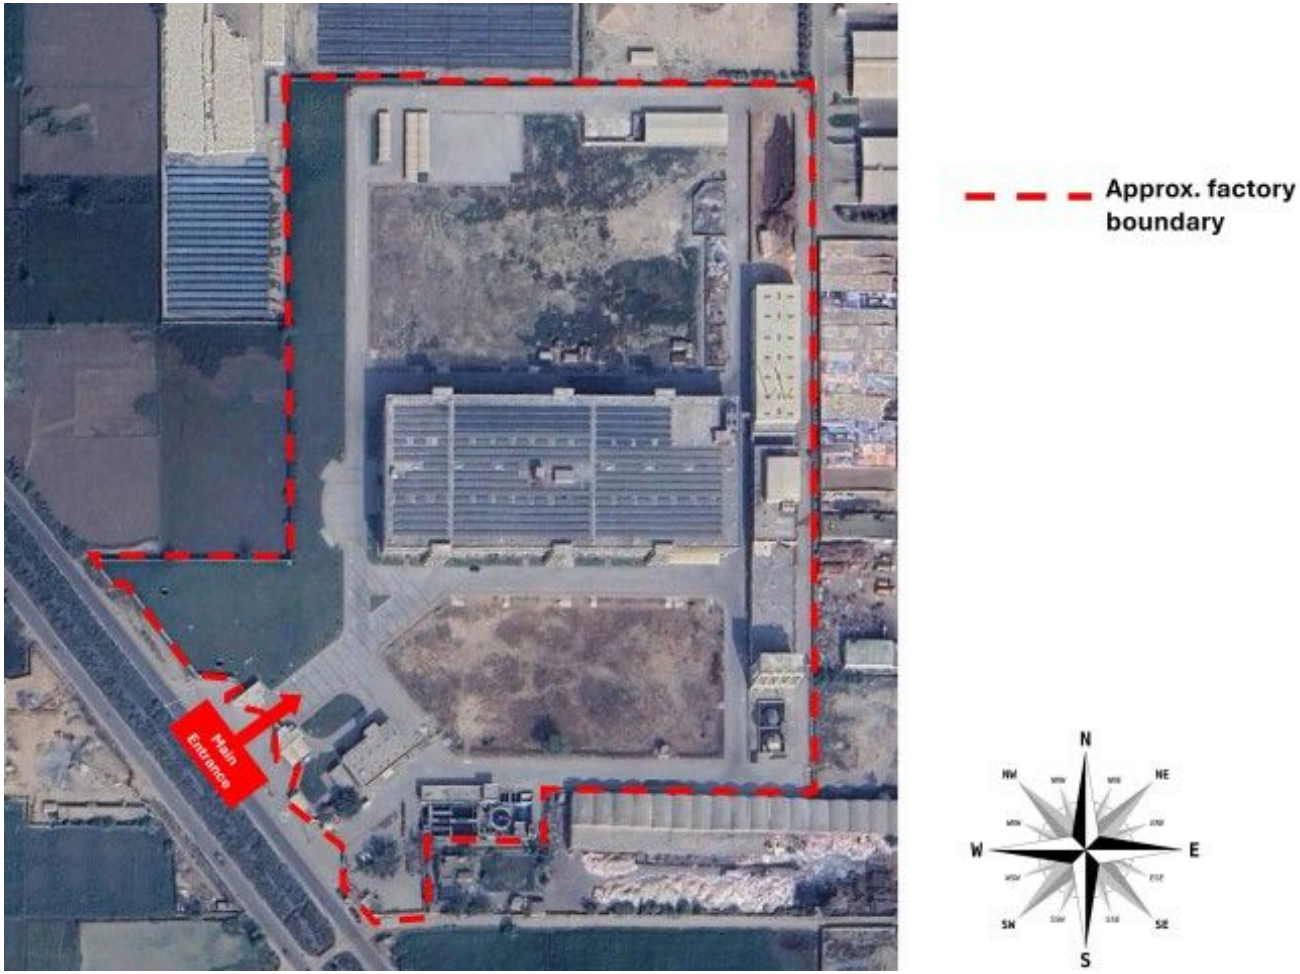


Figure 1.2. Satellite View of the Factory Premises

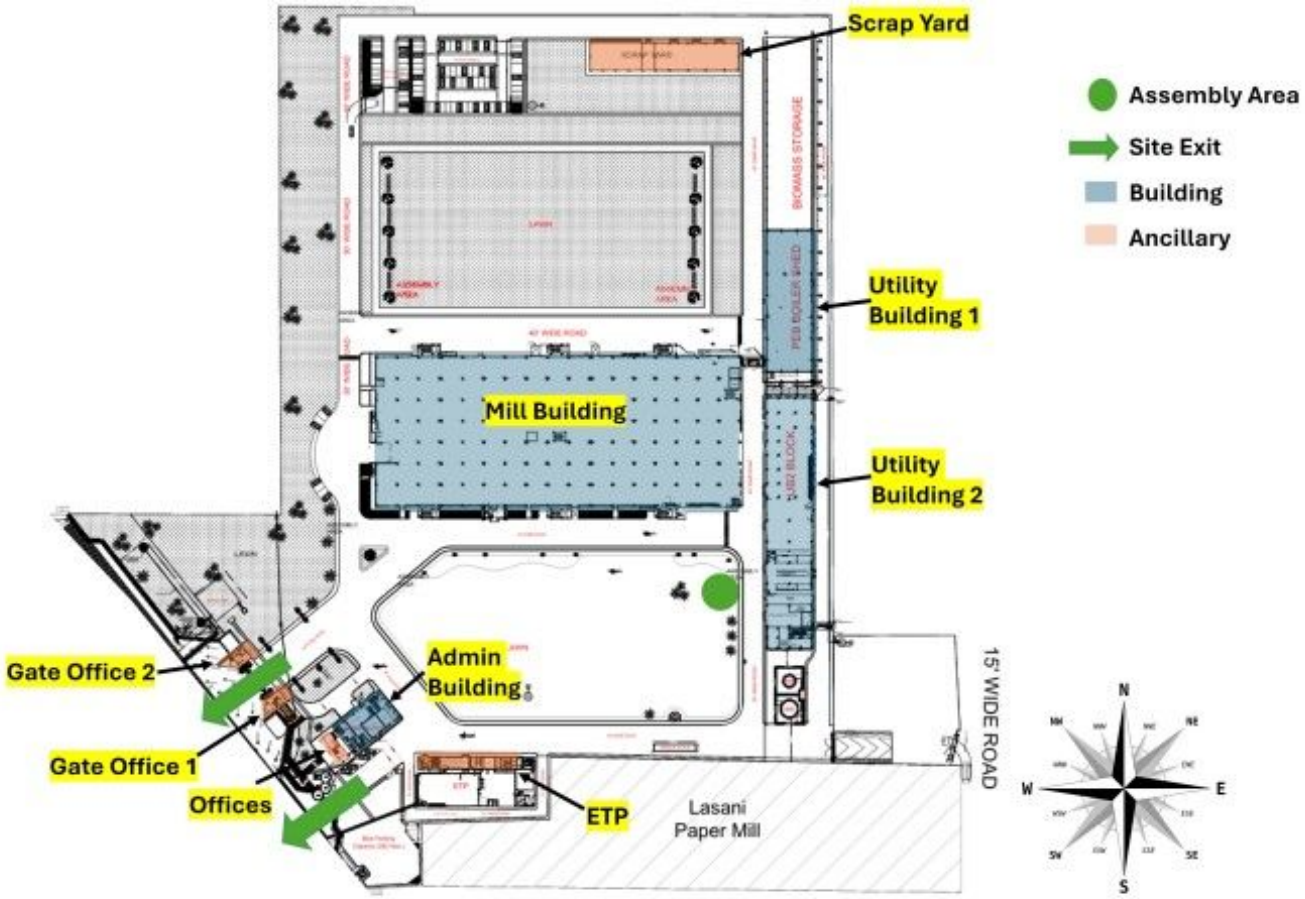


Figure 1.3. Site layout



Figure 1.4. Sectional layout of Mill Building

3. Building Description

The factory comprises of 4 buildings and 5 ancillary structures.
Details of buildings are provided below:

1. Mill Building is a 3 storey (G+M+2) RC moment resisting frame building, with a covered area (footprint) of 11,364 sq. m. The mezzanine does not comply with Fire Safety provisions under the Pakistan Accord Building Standard and is therefore classified as a full floor, making the building a 4 storey structure (G+3). The height of the building is 13.2 m measured from the fire department vehicle access to the topmost occupied floor. Building has 8 staircases out of which 2 discharge internally. The building is used for solar panels (roof), cutting, canteen, storeroom, electric room and mosque (second floor); stitching and sewing (first floor); major portion of the mezzanine is under construction, only IT room is operational at mezzanine (mezzanine); washing, finishing, offices, QA lab, electric room and warehouse (ground floor). The building was constructed in 2024.

2. Utility Building 1 is a single storey (G+M) steel portal frame building, with a covered area (footprint) of 1190 sq. m. A staircase serves mezzanine only. The building is used for unoccupied (roof); control room (mezzanine); boilers, workshop and biomass storage (ground floor). Building was constructed in 2024.

3. Utility Building 2 is a 2 storey (G+M+1) is combination of RC moment resisting frame and steel portal frame, with a covered area (footprint) of 2,180 sq. m. A total of 4 staircases serves the building out of which 2 staircases discharge externally, one serve mezzanine only and one serves first floor to open space of mezzanine. The building is used for unoccupied (roof), chiller and control room (first floor); offices and electric panel room (mezzanine); compressors, generators, electric room, transformer room, engineering workshop, chemical store, RO plant room, stores, fire pump room (ground floor). Building was constructed in 2024.

4. Admin Building is a 2 storey (G+1) load bearing brick masonry building, with a covered area (footprint) of 440 sq. m. A total of 2 staircase serves the building both staircases discharges externally. The building is used for unoccupied (roof); meeting room, kitchen, control room and offices (first floor); and dispensary, daycare, store and offices (ground floor). The building was constructed in 2024.

Details of ancillaries are provided below:

1. Scrap yard is a single storey (Ground only) steel portal frame structure. The structure is used for scrap storage. The structure was constructed in 2024.

2. ETP is a 2 storey (G+1) load bearing brick masonry structure. The structure is used for storage. The structure was constructed in 2024.

3. **Offices** is a single storey (Ground only) load bearing brick masonry structure. The structure is used for offices. The structure was constructed in 2024.

4. **Gate office 1** is a single storey (Ground only) load bearing brick masonry structure. The structure is used for offices. The structure was constructed in 2024.

5. **Gate office 2** is a single storey (Ground only) load bearing brick masonry structure. The structure is used for offices. The structure was constructed in 2024.

3.1 Building Means of Egress Details

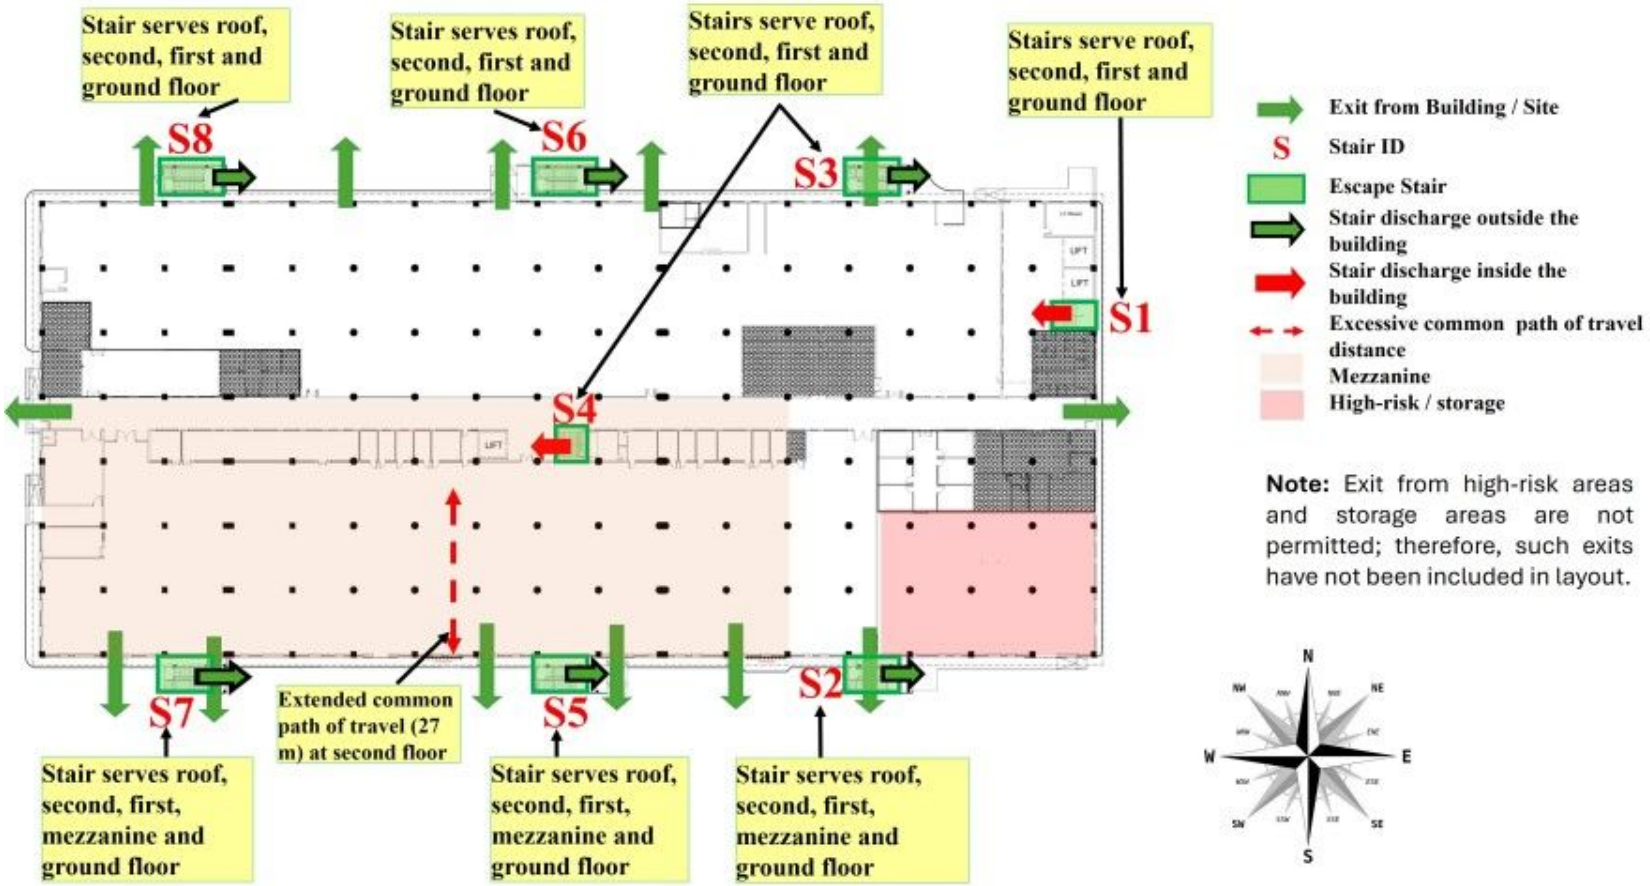


Figure 1.5. Egress layout for Mill Building

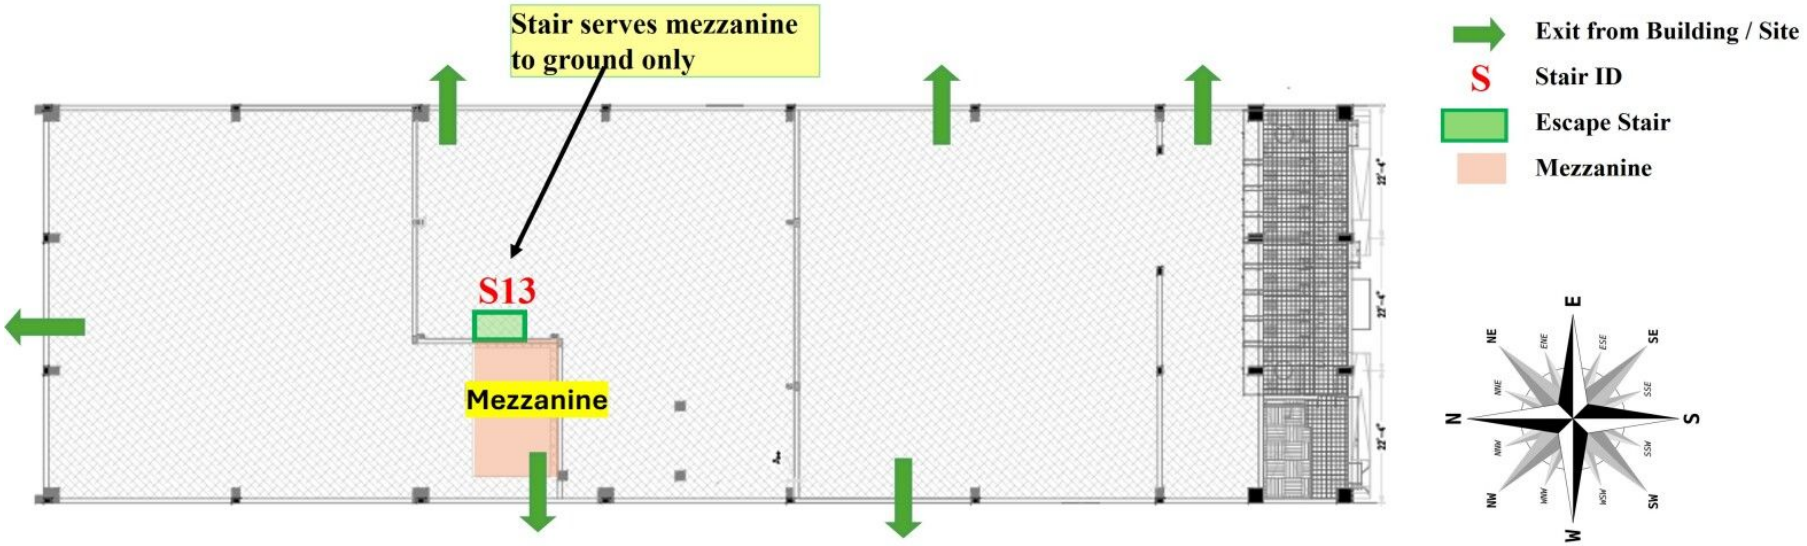


Figure 1.6. Egress layout for Utility Building 1

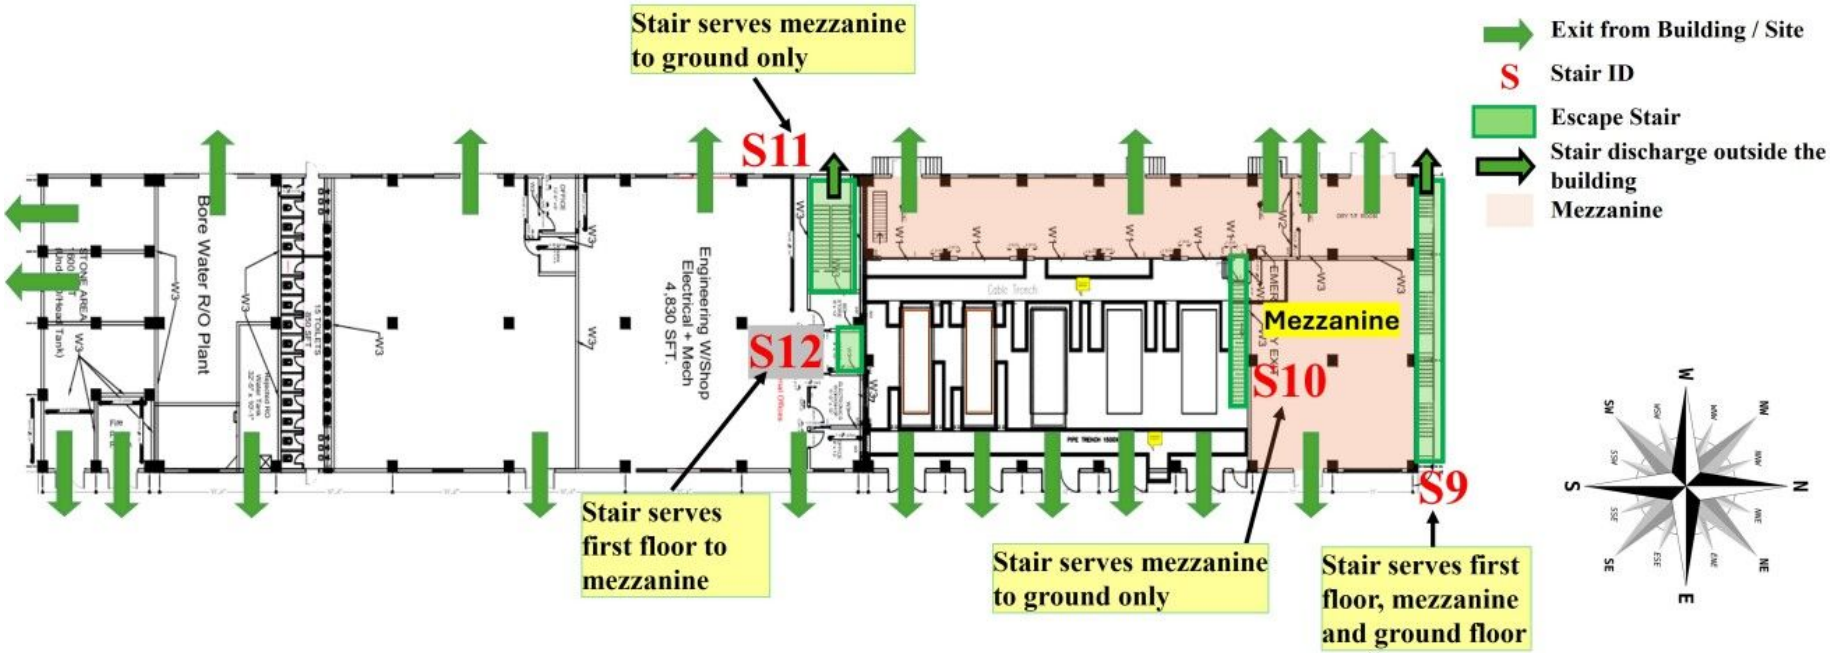


Figure 1.7. Egress layout for Utility Building 2

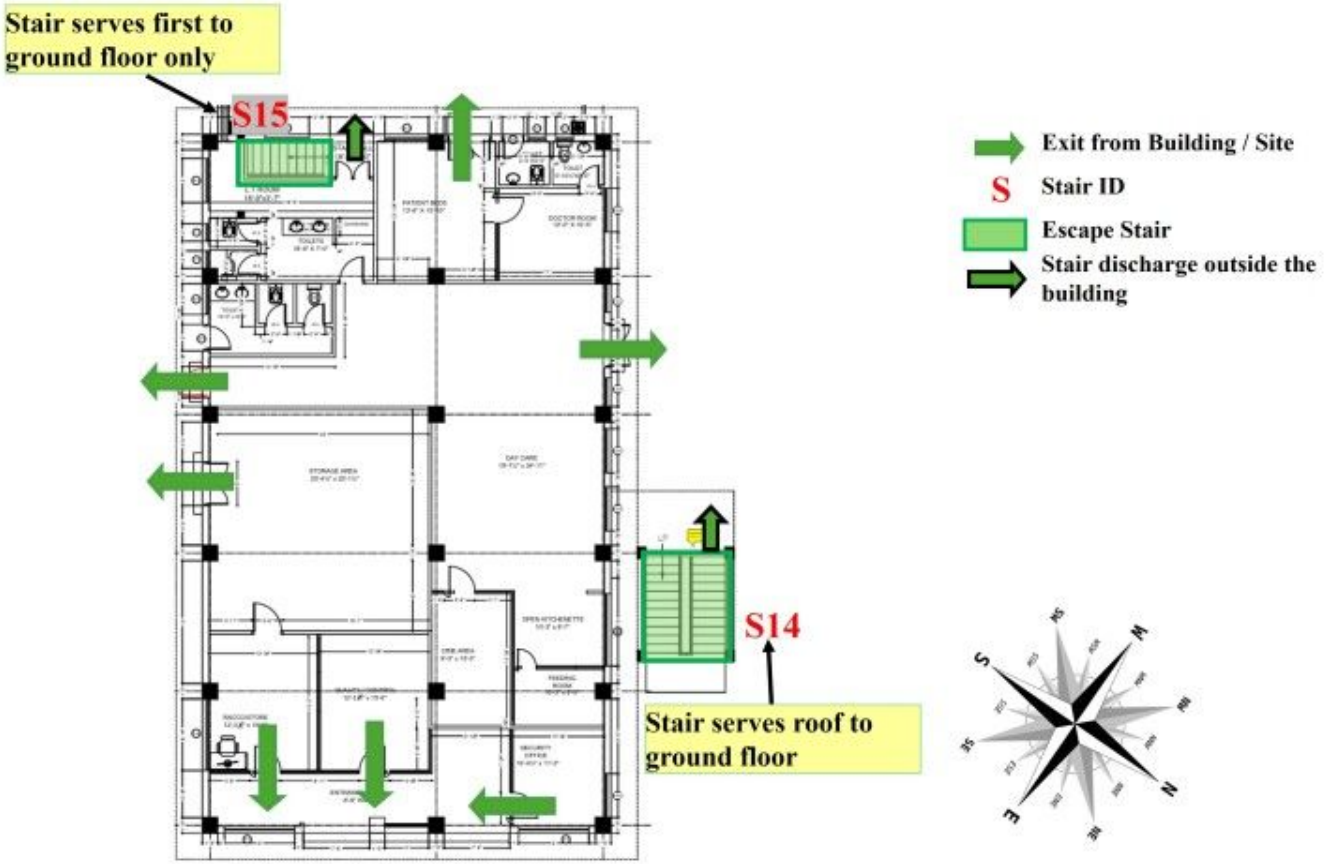


Figure 1.8. Egress layout for Admin Building

3.2 Building Use

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
Mill Building				Total Travel Distance	Common Path	Dead End
Roof	Solar panels	-	8	-	-	-
Second floor	Cutting, canteen, storeroom, mosque, electric room	500	8	-	27m	-
First floor	Stitching and sewing	500	8	-	-	-
Mezzanine	IT room, Under construction	50	3	-	-	-
Ground Floor	Washing, finishing, offices, QA lab, electric room and warehouse	400	13	-	-	-
Utility Building 1						
Roof	Unoccupied	-	-	-	-	-
Mezzanine	Control room	5	1	-	-	-
Ground Floor	Boilers, workshop and biomass storage	15	6	-	-	-

Utility Building 2						
Roof	Unoccupied	-	-	-	-	-
First Floor	Chiller shed and control room	4	2	-	-	-
Mezzanine	Office and electric panel room	20	3	-	-	-
Ground Floor	Compressors, generators, electric room	10	9	-	-	-
	Transformer room	2	2	-	-	-
	Engineering workshop	10	2	-	-	-
	Chemical store	5	2	-	-	-
	RO plant room	5	2	-	-	-
	Store 1	4	1	-	-	-
	Store 2	4	1	-	-	-
	Store 3	4	1	-	-	-
	Fire Pump room	5	1	-	-	-
Admin Building						
Roof	Unoccupied	-	1	-	-	-

First Floor	Meeting room, kitchen, control room and offices	20	2	-	-	-
Ground Floor	Dispensary	8	1	-	-	-
	Daycare	15	2	-	-	-
	Store	5	1	-	-	-
	Office 1	4	1	-	-	-
	Office 2	4	1	-	-	-
	Office 3	4	1	-	-	-

The travel distance issue was observed at second floor of the Mill Building. The number of exits is sufficient in all Buildings.

4. Documentation

This table shows the details about the documentation provided by the factory.

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		Yes	08-01-2026	-
2.	Architecture Layout		Yes	-	-
3.	Sectional Layout		Yes	-	-
4.	Evacuation Maps		Yes	-	On floors
5.	Emergency Action Plan		Yes	16-05-2024	Not as per Pakistan Accord standard
6.	Inspection	Standpipes	No	-	-
		Fire extinguishers	Yes	02-03-2026	Not as per Pakistan Accord standard
		Fire pumps	Yes	March 2026	Not as per Pakistan Accord standard
		Exit signage	No	-	-
7.	Testing	Standpipes	No	-	-
		Fire extinguishers	No	-	-
		Fire pumps	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Standpipes	No	-	-
		Fire extinguishers	No	-	-
		Fire pumps	No	-	-
		Exit signage	No	-	-
9.	Evidence of Fire Drills		Yes	08-01-2026 01-10-2025	Need improvement and Date & time stamp are missing.
10.	Staff Training		Yes	08-01-2026	Firefighting training

5. Fire Safety Measures

During our fire site inspection of M/S Stylers International Ltd. - Unit 2 (Raiwind), a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within M/S Stylers International Ltd. - Unit 2 (Raiwind). Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-064647

Timeline	Remediation Plan
Immediate CAP-0076426	Factories should begin remediation of CAP items such as installing extinguishers, signage, and clearing escape routes using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape
- Sliding doors shall not serve for escape from areas with more than 10 occupants

This is not always achieved, examples include (list not exhaustive):
- Escape doors are lockable throughout the facility.
- Doors serving areas with over 50 occupants swing against the direction of escape i.e. East side exit door of Mill Building
- Sliding doors serve for escape from areas with more than 10 occupants i.e. escape door (second floor) leads towards stair S2

Recommended remedial actions are provided below.F-202604-064608

Timeline	Remediation Plan
Immediate CAP-0076280	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0076281	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5. Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, that are side swinging and open in the direction of travel to an exit.
Longer Term CAP-0076282	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Sliding escape door (second floor) leads towards stair S2



Figure 2.2 - Lockable escape door at cutting hall (second floor) of the Mill Building



Figure 2.3 - East side exit door of Mill Building swing against the direction of escape

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.

This is not always achieved, examples include (list not exhaustive):
- Stair discharges inside the building at a distance from building exit i.e. Stair S1 & S4

Recommended remedial actions are provided below.F-202604-064609

Timeline	Remediation Plan
Medium Term CAP-0076283	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks)
Longer Term CAP-0076284	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted.



Figure 2.4 - Stair S1 discharge inside the building

7.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Standard. The standard provides limitations on:
- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.

This is not always achieved, examples include (list not exhaustive):
- Common path of travel distances exceed permitted limits i.e. 27m common path of travel was observed at second floor of the Mill Building

Recommended remedial actions are provided below.F-202604-064610

Timeline	Remediation Plan
Medium Term CAP-0076289	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Standard.
Longer Term CAP-0076290	Implement the plan previous reviewed by Pakistan Accord and ensure all travel distances to emergency exits meet the requirements of the Pakistan Accord Standard.

7.4 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- Stair discharge routes should be protected to the same level of safety as the stair.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings into multiple stairs i.e. S2 (all floors), S4 (intermediate landing from second to first floor)
- Missing fire rated enclosure and fire doors in stair i.e. S1 (all floors), S4 (all floors)
- Listing details of fire doors and hardware are missing on all fire doors.
- Door self-closers are missing on multiple fire doors
- Fire load under stair S1 (ground floor)
- Services passing through stair S9 (first floor)

Recommended remedial actions are provided below.F-202604-064598

Timeline	Remediation Plan
Immediate CAP-0076252	Remove fire load and any other obstructions due to stored items from stairs
Medium Term CAP-0076253	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.

Longer Term CAP-0076254	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.5 - Listing details of fire doors and hardware are missing on fire door



Figure 2.6 - Services passing through stair S9 (first floor)



Figure 2.7 - Missing fire rated enclosure and fire doors in stair S1 (all floors)



Figure 2.9 - Door self-closer is missing on fire door into Stair S2 (second floor)



Figure 2.8 - Unprotected openings into stair S4



Figure 2.10 - Fire load under stair S1 (ground floor)

7.5 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at entry into stairs i.e. S1 (all floors), S4 (all floors)
- Missing exit signs in corridor (all floors) of the Mill Building
- Missing exit signs at exits from Mill Building
- Electrically powered exit signs are not a tested and listed system

Recommended remedial actions are provided below.F-202604-064607

Timeline	Remediation Plan
Medium Term CAP-0076262	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0076263	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.11 - Missing exit signs at entry into stair S4 (second floor)



Figure 2.12 - Missing exit signs at west side exit of Mill Building



Figure 2.13 - Missing exit signs in corridor (second floor) of the Mill Building

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Electrical rooms are not fire separated from escape route (second floor) of the Mill Building.
- Generator room is not fire separated from electric panel room (ground floor) of the Utility Building 2.
-Compressor room is not fire separated from generator room (ground floor) of the Utility Building 2.
- Transformer room is not fire separated from electric panel room (ground floor) of the Utility Building 2.
- Fire pump is not fire separated from adjacent store (ground floor) of the Utility Building 2.
- LT room is not fire separated from ETP Lab (ground floor) of ETP ancillary.
- Engineering workshop is not fire separated from chemical store (ground floor) of the Utility Building 2.
- Kitchen is not fire separated from the building i.e. kitchen is not fire separated from office area (mezzanine) of the Utility Building 2, kitchen is not fire separated from dining hall and escape route (second floor) of the Mill Building.

Recommended remedial actions are provided below.F-202604-064591

Timeline	Remediation Plan
Medium Term CAP-0076298	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0076299	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.14 - Kitchen is not fire separated from dining hall and escape route (second floor) of the Mill Building.



Figure 2.15 - Electrical rooms are not fire separated from escape route (second floor) of the Mill Building



Figure 2.16 - Transformer room is not fire separated from electric panel room (ground floor) of the Utility Building 2



Figure 2.17 - Compressor room is not fire separated from generator room (ground floor) of the Utility Building 2



Figure 2.18 - Engineering workshop is not fire separated from chemical store (ground floor) of the Utility Building 2



Figure 2.19 - Generator room is not fire separated from electric panel room (ground floor) of the Utility Building 2

8.2 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):

- Multiple lift shafts are not separated with fire rated construction i.e. lift shaft connecting all floors of the Mill Building

Recommended remedial actions are provided below.F-202604-064594

Timeline	Remediation Plan
Medium Term CAP-0076388	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0076389	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.20 - Lift shaft connecting all floors of the Mill Building is not separated with fire rated construction

8.3 Floor openings

Per Pakistan Accord Standard, each floor should be fire separated using 2 hours fire resisting construction with 90 minutes fire rated door/shutter assemblies.

The following deficiencies have been observed on site, including (list not exhaustive):
- Floor openings from mezzanine (classified as a full floor) to ground floor of the Mill Building.
- Plumbing and opening connecting second floor to ground floor of the Mill Building.

Recommended remedial actions are provided below.F-202604-064595

Timeline	Remediation Plan
Medium Term CAP-0076390	Prepare a plan and drawings showing the proposed fire separation details. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of floor openings - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0076391	Provide fire rated separation between floors by implementing the plan reviewed previously by Pakistan Accord.



Figure 2.21 - Plumbing and opening connecting second floor to ground floor of the Mill Building



Figure 2.22 - Floor openings from mezzanine (classified as a full floor) to ground floor of the Mill Building

8.4 Separation of occupancies

Pakistan Accord Standard requires different occupancy types to be fire separated from each other. The aim is to limit the fire to only one occupancy type.

The following deficiencies have been observed on site, including (list not exhaustive):

- Dinning area is not separated from training hall and escape route at second floor of the Mill Building .
- Large office area is not fire separated from the production area at ground floor of the Mill Building .
-Mosque is not fire separated from the escape route at second floor of the Mill Building .
- Day care is not fire separated from the rest of the building at ground floor of the Admin Building.

Recommended remedial actions are provided below.F-202604-064596

Timeline	Remediation Plan
Medium Term CAP-0076392	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Different occupancy types in the building - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0076393	Provide fire rated separation between occupancies as per proposal reviewed by Pakistan Accord



Figure 2.23 - Day care is not fire separated from the rest of the building at ground floor of the Admin Building



Figure 2.24 - Dinning area is not separated from training hall and escape route at second floor of the Mill Building



Figure 2.25 - Mosque is not fire separated from the escape route at second floor of the Mill Building



Figure 2.26 - Large office area is not fire separated from the production area at ground floor of the Mill Building

8.5 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building i.e. storage is not fire separated from cutting hall and escape route of Mill Building (second floor), Warehouse is not fire separated from finishing hall and QA lab of Mill Building (ground floor).

Recommended remedial actions are provided below.F-202604-064592

Timeline	Remediation Plan
Medium Term CAP-0076384	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0076385	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard



Figure 2.27 - Warehouse is not fire separated from finishing hall and QA lab of Mill Building (ground floor)



Figure 2.28 - storage is not fire separated from cutting hall and escape route of Mill Building (second floor)

9. Fire Suppression

9.1 Standpipe system

Per Pakistan Accord Standard a Class-I standpipe systems is required in the building. The system should be designed and installed in accordance with NFPA 14.
Mill Building requires standpipe system due to the number of stories exceeding 3 with a fire floor area exceeding 1440 sq m.

The following deficiencies have been observed on site, including (list not exhaustive):
- Standpipe system comprise of non-listed products i.e. Landing valves
- Missing standpipe outlets in stairs of Mill Building.

Recommended remedial actions are provided below.F-202604-064605

Timeline	Remediation Plan
Medium Term CAP-0076402	(1) Submit design documentation for the required standpipe system and supporting infrastructure to Pakistan Accord for review before purchasing any new equipment. Design documentation to include drawings, technical data sheets and product certifications of all listed equipment to show full compliance of the system with NFPA 14, 20, 22, and 24.
Medium Term CAP-0076403	(2) Submit documentation to Pakistan Accord showing that an L/C has been opened for import of any components required for the system design submitted earlier.
Longer Term CAP-0076404	(3) Submit documentation to Pakistan Accord demonstrating that all materials, both imported and locally procured, have been purchased and are available on site for installation of the system.
Longer Term CAP-0076405	(4) Once installation of the system is complete, factory to submit full "as-built" documentation of the system to Pakistan Accord for review.
Longer Term CAP-0076406	(5) Factory to advise Pakistan Accord when system installation is fully completed and the system is fully functional. Pakistan Accord will then arrange a verification inspection to ensure that the installation fully complies with the previously reviewed design documentation

Longer Term CAP-0076407	(6) Provide full testing and commissioning (T&C) certification from the system installer and make provision for attendance of the system installer, factory technical personnel and Pakistan Accord technical team to witness a final T&C demonstration verification on site. On successful completion of this T&C verification inspection, remediation of the system will be complete



Figure 2.29 - Landing valve for the available standpipe system



Figure 2.30 - Missing standpipe outlets in stair S1 (all floors)

9.2 Fire pumps

Per Pakistan Accord Standard, a complete fire pump set is required. The pump set should be designed and installed in accordance with NFPA 20. The system should comprise of a) Electric pump (Main), b) Diesel Pump (Back-Up), and c) Jockey Pump. Each pump should be provided with individual drivers and controllers. Pumps shall be installed with positive suction. These measures are intended to provide a level of resilience whereby a failure of a pump or lack of power in the building will not compromise fire water supply in the building.

The following deficiencies have been observed on site, including (list not exhaustive):

- No design and listing documentations were provided for the installed Fire Pumps.

Recommended remedial actions are provided below.F-202604-064600

Timeline	Remediation Plan
Immediate CAP-0076398	Provide design and listing document for electric duty pump, diesel backup fire pumps and jockey pump, together with individual drivers and controllers and hydraulic calculations in accordance with NFPA 20 as part of the supporting infrastructure to the SUPS system and submit to Accord for review.



Figure 2.31 - Diesel engine fire pump controller



Figure 2.32 - Jockey pump controller



Figure 2.33 - Electric fire pump controller

9.3 Water supply

Fire water storage provisions on site should comply with NFPA 22.

The following deficiencies have been observed on site, including (list not exhaustive):

- No design document was provided for fire water supply to confirm the fire water reservoir capacity and fire separation.

Recommended remedial actions are provided below.F-202604-064603

Timeline	Remediation Plan
Immediate CAP-0076400	Provide design document for the fire water supply reservoir in accordance with NFPA 22 and submit to Accord for review. .

9.4 Fire extinguishers

Extinguisher coverage and type of extinguishers used should comply with NFPA 10.

The following deficiencies have been observed on site, including (list not exhaustive):
- Poor condition of fire extinguishers i.e. empty fire extinguisher at ground floor washing area of Mill Building.

Recommended remedial actions are provided below.F-202604-064599

Timeline	Remediation Plan
Medium Term CAP-0076394	Ensure that all building areas are protected using fire extinguishers. The coverage and type of extinguishers used should follow NFPA 10.
Longer Term CAP-0076395	Monitor fire extinguishers for coverage and extinguisher type to comply with NFPA 10.



Figure 2.34 - Empty fire extinguisher at ground floor washing area of Mill Building

10. Hazardous Materials

10.1 Chemicals storage

This relates to storage, handling, and use of flammable chemicals and combustible liquids and solids.
Chemical storage areas should be fire separated from the rest of the building. Adequate ventilation should be provided.

The following deficiencies have been observed on site, including (list not exhaustive):
-Chemical store is not fire separated from engineering workshop and RO plant room at the ground floor of the Utility Building 2.
-Chemical store is not fire separated from washing hall at the ground floor of the Mill Building.

Recommended remedial actions are provided below.F-202604-064602

Timeline	Remediation Plan
Medium Term CAP-0076408	Factory to collect MSDS sheets for all chemicals stored, classify materials, and propose storage arrangements to meet NFPA 30 requirements. Prepare drawings showing the proposed chemical storage areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all chemical storage areas - Locations of fire rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0076409	Implement the above plan on site. All chemical storage areas to be compliant with Pakistan Accord Standard.



Figure 2.35 - Chemical store is not fire separated at ground floor of the Utility Building 2.

10.2 Diesel storage

Diesel storage areas should be fire separated from the rest of the building. Adequate ventilation and bunding should be provided.

The following deficiencies have been observed on site, including (list not exhaustive):
-Missing bunding under diesel storage (ground floor) of the Utility Building 2.

Recommended remedial actions are provided below.F-202604-064604

Timeline	Remediation Plan
Medium Term CAP-0076411	Prepare drawings showing the proposed diesel storage arrangements to comply with NFPA 30. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Bunding details
Longer Term CAP-0076412	Implement the above plan on site. All diesel storage areas to be compliant with Pakistan Accord Standard.



Figure 2.36 - Missing bunding under diesel storage (ground floor) of the Utility Building 2

11. Fire Safety Management

11.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):

- Fire drill documentation is of poor standard. Document is without improvement plan.

Recommended remedial actions are provided below.F-202604-064597

Timeline	Remediation Plan
Medium Term CAP-0076415	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0076416	Ensure fire drills are performed a minimum of 2 times per year.

11.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire Pumps
- No records of testing of Standpipes
- No records of testing of Fire Extinguishers
- No records of testing of Emergency Exit Signage

Recommended remedial actions are provided below.F-202604-064593

Timeline	Remediation Plan
Medium Term CAP-0076413	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and
Longer Term CAP-0076414	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

11.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of maintenance of Fire Pumps
- No records of maintenance of Standpipes
-No records of maintenance of Fire Extinguishers
-No records of maintenance of Emergency Exit Signage

Recommended remedial actions are provided below.F-202604-064606

Timeline	Remediation Plan
Medium Term CAP-0076421	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0076422	- Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

11.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid fire fighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):

-An Emergency Action Plan (EAP) document was available; however, detailed procedures, roles, and responsibilities for fire were missing.

Recommended remedial actions are provided below.F-202604-064601

Timeline	Remediation Plan
Medium Term CAP-0076417	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0076418	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.