Issue	**1**
Factory ID	**25797**
Date of Issue	**13-Apr-2026**


Magna Manufacturing (New Site)

13 Km Daska Road
Sialkot
Punjab Pakistan

Latitude: [32.39948], longitude: [74.44158]
Date of inspection: 17-Mar-2026

Fire Safety Inspection Report

Observations & Actions

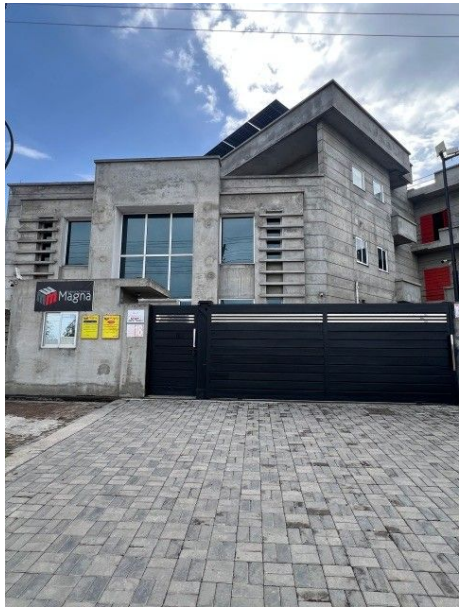

Authors	**Muhammad Naseer**
Reviewed by	**Waqar Sami**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 17-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 10
   - 3.1 Building Means of Egress Details 11
   - 3.2 Building Use 12
4. Documentation 13
5. Fire Safety Measures 14
6. Remediation Support 15
   - 6.1 Engineering Support 15
7. Means of Escape 16
   - 7.1 Escape doors 16
   - 7.2 Exit access 18
   - 7.3 Travel distance 20
   - 7.4 Protection of stairs 21
   - 7.5 Escape stair condition 23
   - 7.6 Exit discharge 24
   - 7.7 Exit signage 26
8. Fire Rated Construction 28
   - 8.1 Separation of high-risk areas 28
   - 8.2 Separation of shafts 30
   - 8.3 Floor openings 32
   - 8.4 Separation of occupancies 34

8.5 Storage..... 36
9. Fire Safety Management..... 38
9.1 Fire drills..... 38
9.2 Records of system testing..... 39
9.3 Records of systems maintenance..... 40
9.4 Emergency Action Plan..... 41
10. Assessment Limitations and Assumptions..... 42

1. Executive Summary

On 17-Mar-2026, Shehroz Javed, Muhammad Naseer and Tariq Mehmood on behalf of the Pakistan Accord carried out an initial fire inspection for Magna Manufacturing (New Site), a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with Humza Mahmood (Director), Umar Mahmood (Director) and other staff members of Magna Manufacturing (New Site). The assessment was conducted as part of an overall Structural, Fire, and Electrical initial inspection.
The factory operates in single shift. Approximately 47 workers operate in the factory with 1 worker being female.
The factory consists of one main building and two ancillary structures owned by Magna Manufacturing (New Site). During the inspection, the areas highlighted in Figure 1.1 were surveyed, with the site boundary indicated in red dashed line.
Main Building – is a 4 storey (G+3), RC MRF building with a covered area (footprint) of 990 sq. m and height of 11.9m from fire vehicle access to topmost occupied floor. 4 staircase serves the building, out of which 3 stairs discharge internally. The building is used for cutting, storage, shipment, raw material inspection, sampling, offices (Ground floor), sewing, packing, checking, offices (1st Floor), dining, prayer area and sleeping area (2nd Floor), currently vacant (ready for production hall) & solar panels (3rd Floor) and un-occupied (roof). The building was constructed in 2022.
Ancillary Buildings:
Generator Room is a single storey (Ground only) structure having a load bearing brick masonry wall system supporting RC slab. The building is used for generator operations (Ground Floor). The structure was constructed in 2022.
Gate Office is a single storey (Ground only) structure having a load bearing brick masonry wall system supporting RC slab. The building is used for office (Ground Floor). The structure was constructed in 2022.
We were presented with site layout, fire drill records , staff training record and civil defence certificate.
A summary of the main concerns identified during the inspection includes (non-exhaustive):
-There is no fire separation between stairs and the rest of the building.
-Storage areas are not fire separated from rest of the building.
-Most of the stairs discharge inside the building.
-Lockable exit doors found at most of the facility.
We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes.)

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

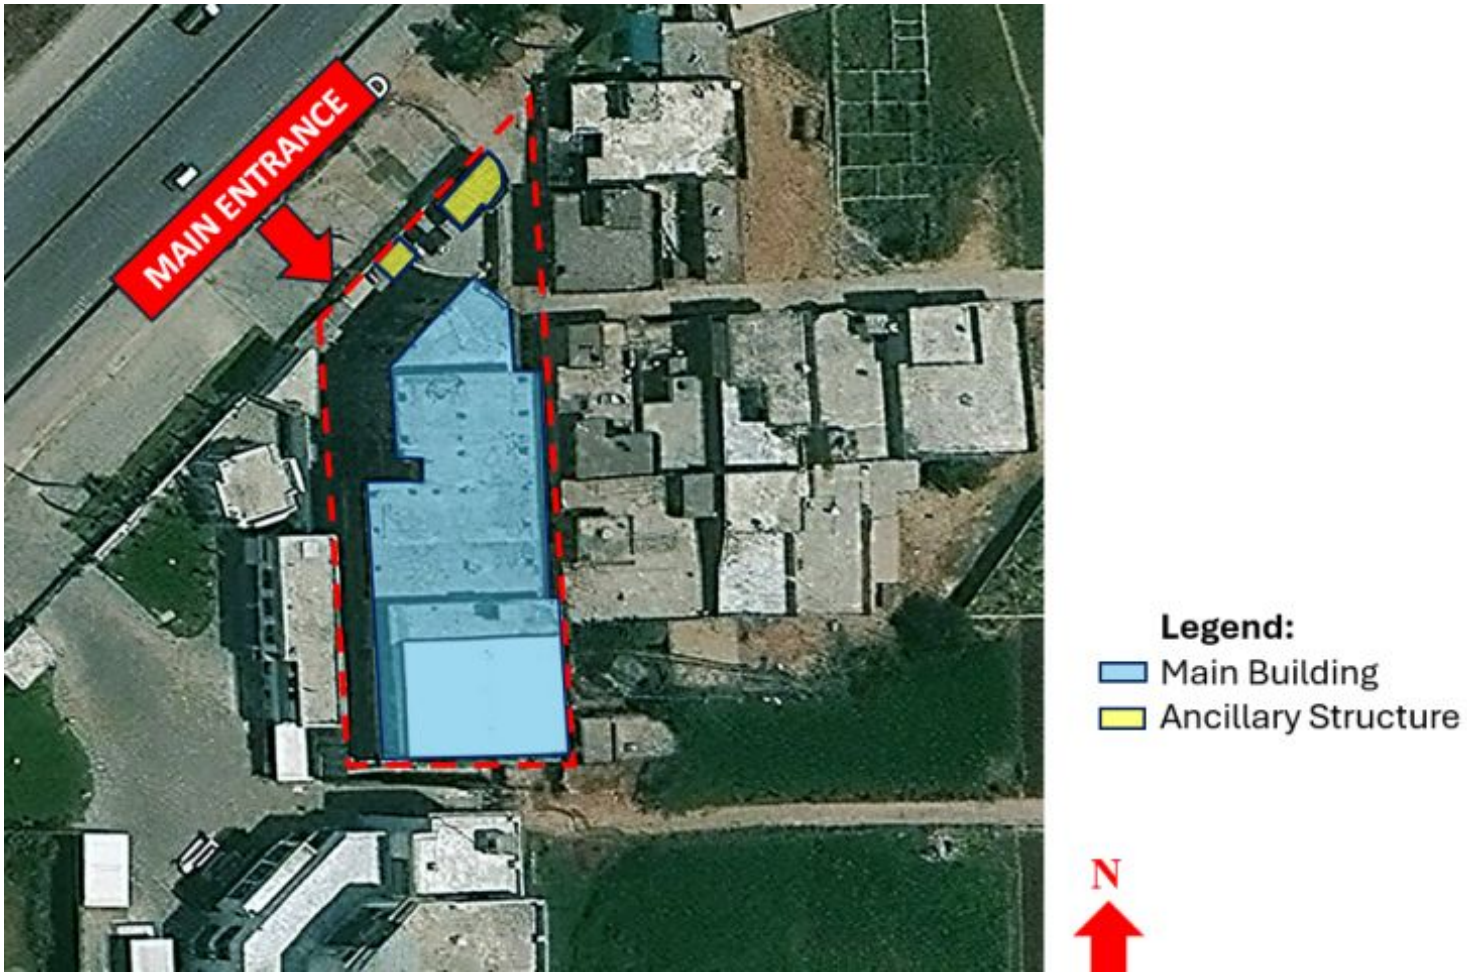


Figure 1.1. Satellite view of the factory– Red dashed line indicates site boundary

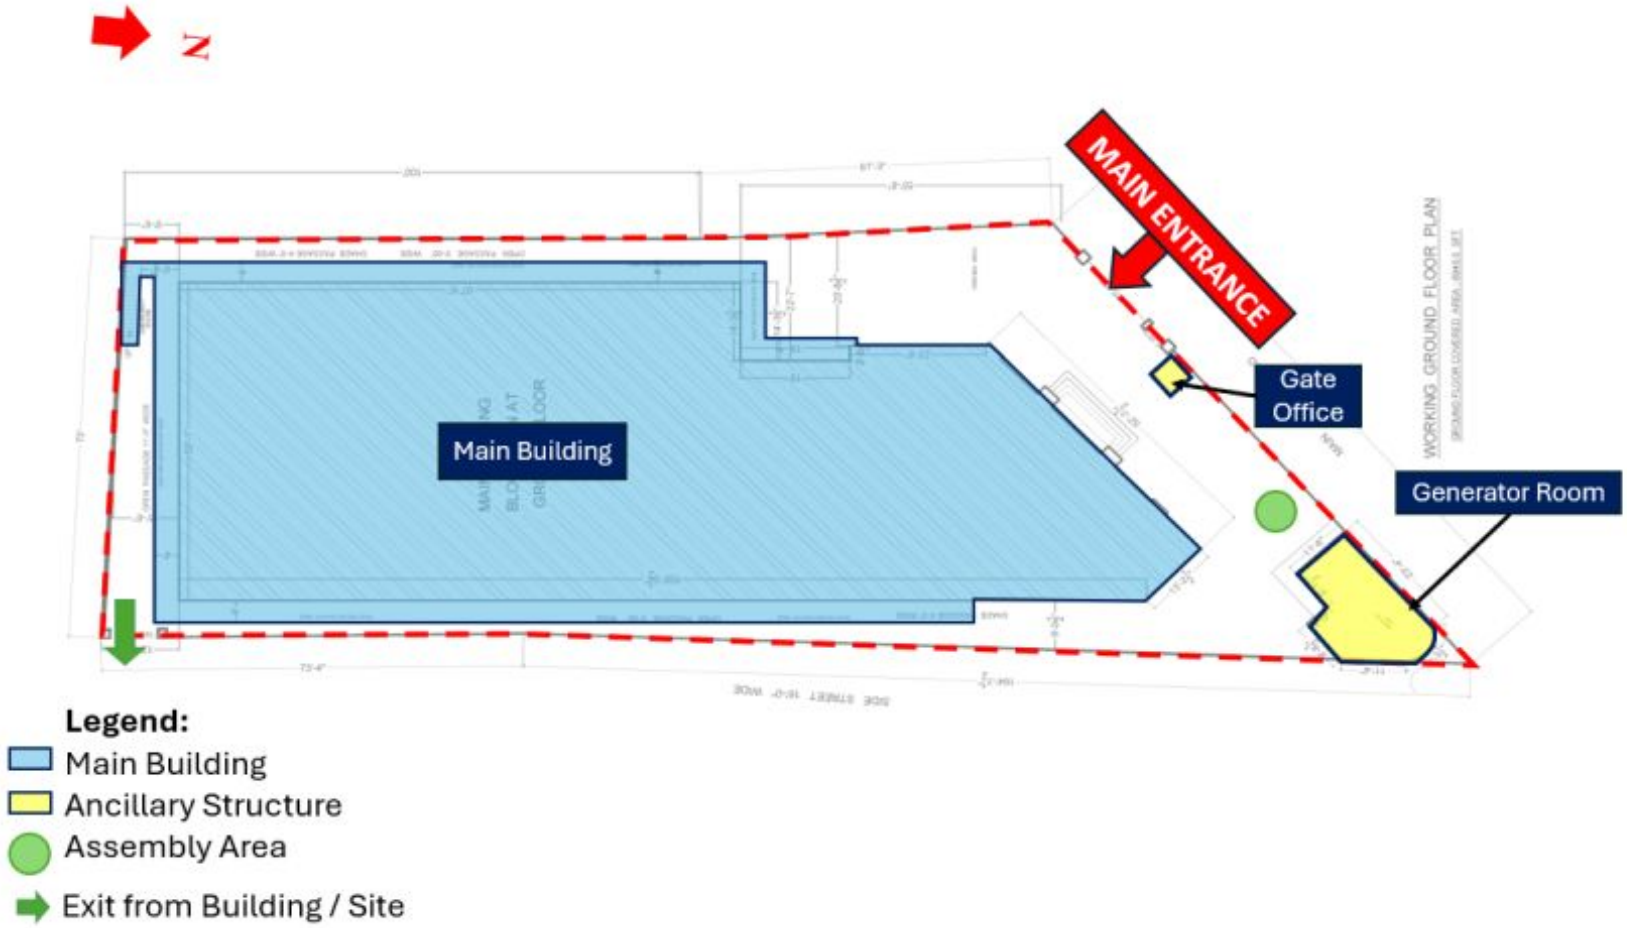


Figure 1.2. Site layout. Red dashed line indicates site boundary

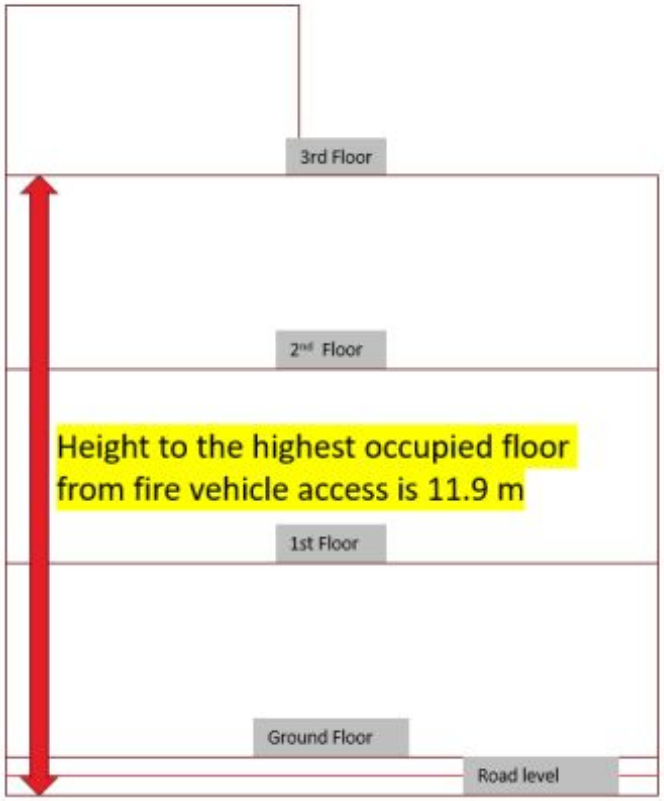


Figure 1.3. Section Layout Main Building

3. Building Description

The factory consists of one main building and two ancillary structures owned by Magna Manufacturing (New Site). During the inspection, the areas highlighted in Figure 1.1 were surveyed, with the site boundary indicated in red dashed line.

Main Building – is a 4 storey (G+3), RC MRF building with a covered area (footprint) of 990 sq. m and height of 11.9m from fire vehicle access to topmost occupied floor. 4 staircase serves the building, out of which 3 stairs discharge internally. The building is used for cutting, storage, shipment, raw material inspection, sampling, offices (Ground floor), sewing, packing, checking, offices (1st Floor), dining, prayer area and sleeping area (2nd Floor), currently vacant (ready for production hall) & solar panels (3rd Floor) and un-occupied (roof). The building was constructed in 2022.

Ancillary Buildings:

Generator Room is a single storey (Ground only) structure having a load bearing brick masonry wall system supporting RC slab. The building is used for generator operations (Ground Floor). The structure was constructed in 2022.

Gate Office is a single storey (Ground only) structure having a load bearing brick masonry wall system supporting RC slab. The building is used for office (Ground Floor. The structure was constructed in 2022.

3.1 Building Means of Egress Details

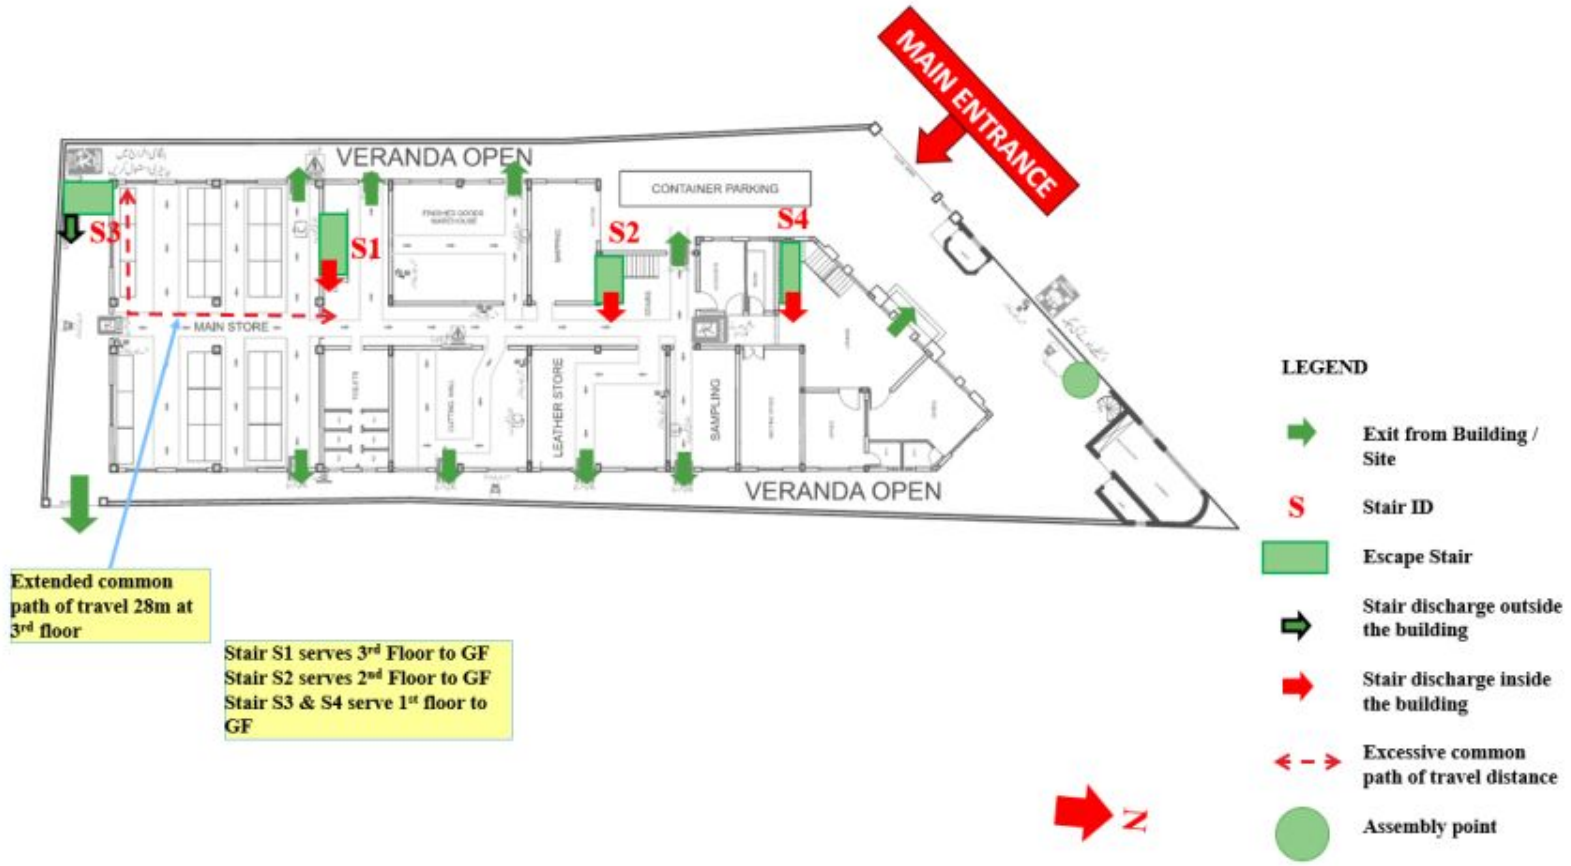


Figure 1.4. Egress layout of Main Building (Ground floor)

3.2 Building Use

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Main Building						
Roof	Un-occupied	-	_	-	-	-
3rd floor	Solar panels, currently vacant (ready for production)	30	1	-	28m	-
2nd floor	Dining, Prayer area, sleeping area	100	2	-	-	-
1st floor	Sewing, packing, checking, offices	70	4	-	-	-
Ground floor	Cutting, storage, shipment, raw material inspection, sampling, offices	70	9	-	-	-

The number of exits are sufficient but common path of travel distance issue observed at 3rd floor.

4. Documentation

This table shows the details about the documentation provided by the factory.

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		Yes	23-07-2025	-
2.	Architecture Layout		Yes	-	-
3.	Sectional Layout		No	-	-
4.	Evacuation Maps		Yes	-	Missing in some areas
5.	Emergency Action Plan		Yes	01-01-2022	Not as per Pakistan Accord Building Standards
6.	Inspection	Fire extinguishers	No	-	-
		Exit signage	No	-	-
7.	Testing	Fire extinguishers	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Fire extinguishers	No	-	-
		Exit signage	No	-	-
9.	Evidence of Fire Drills		Yes	23-07-2025	No attendance & no visuals (annual only)
10.	Staff Training		Yes	23-07-2025	Fire fighting and first aid

5. Fire Safety Measures

During our fire site inspection of Magna Manufacturing (New Site), a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Magna Manufacturing (New Site). Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-064590

Timeline	Remediation Plan
Immediate CAP-0076232	Factories should begin remediation of CAP items such as installing extinguishers, signage, and clearing escape routes using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.

This is not always achieved, examples include (list not exhaustive):
- Most of the escape doors are lockable throughout the facility.

Recommended remedial actions are provided below.F-202604-064581

Timeline	Remediation Plan
Immediate CAP-0076245	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0076246	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5.
Longer Term CAP-0076247	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Lockable escape door from canteen area at 2nd floor

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building..

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings (windows & exhaust fan) into exit access route at 1st, 2nd & 3rd floor.
- Obstructed doors installed in exit routes at 1st, 2nd & 3rd floor (reducing the clear width of escape route).
- Stairs discharges inside the building at a distance from building exit i-e S1, S2 and S4.

Recommended remedial actions are provided below.F-202604-064576

Timeline	Remediation Plan
Immediate CAP-0076257	Remove obstructions on escape routes and keep them clear for escape.
Medium Term CAP-0076258	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks)
Longer Term CAP-0076259	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted.



Figure 2.2 - Stair S4 discharge inside the building



Figure 2.4 - Obstructed doors installed in exit routes at 2nd floor (reducing the clear width of escape route)



Figure 2.3 - Unprotected openings (windows & exhaust fan) into exit access route at 1st floor

7.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Standard. The standard provides limitations on:
- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.

This is not always achieved, examples include (list not exhaustive):
- Common path of travel distances exceed permitted limits and found 28m at 3rd floor.

Recommended remedial actions are provided below.F-202604-064579

Timeline	Remediation Plan
Medium Term CAP-0076269	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Standard.
Longer Term CAP-0076270	Implement the plan previous reviewed by Pakistan Accord and ensure all travel distances to emergency exits meet the requirements of the Pakistan Accord Standard.

7.4 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Missing fire rated enclosure and fire doors in stair S1 , S2 and S4 (all floors).
- Fire load under stair S4 (Ground floor).

Recommended remedial actions are provided below.F-202604-064572

Timeline	Remediation Plan
Immediate CAP-0076229	Remove fire load and any other obstructions due to stored items from stairs
Medium Term CAP-0076230	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.
Longer Term CAP-0076231	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.5 - Fire load under stair S4(Ground floor)



Figure 2.6 - Missing fire rated enclosure & fire door in S1 (2nd floor)

7.5 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):
- Missing 1 side handrail in S4.

Recommended remedial actions are provided below.F-202604-064578

Timeline	Remediation Plan
Medium Term CAP-0076273	Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height.



Figure 2.7 - Missing 1 side handrail in S4

7.6 Exit discharge

Exit discharge routes outside the building should be sufficiently protected so that people can escape safely in the event of a fire anywhere in the building. This includes:
- External escape routes should not lead via unprotected openings.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings into external discharge route at south, east & west exit discharge route.

Recommended remedial actions are provided below.F-202604-064582

Timeline	Remediation Plan
Medium Term CAP-0076243	Prepare drawings showing proposed fire separating construction to exit discharge routes. These shall be submitted to Accord for review and approval prior to commencing rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge routes - Details of proposed fire resisting walls and fire door assemblies required to protect discharge routes
Longer Term CAP-0076244	- Ensure external exit discharge routes are adequately fire separated from the rest of the building. - Ensure external escape routes do not pass close to unprotected high-risk areas



Figure 2.8 - Unprotected openings into external discharge route at east exit discharge route

7.7 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at entry into stairs S1, S2 and S4 (all floors).
- Missing exit signs at Main Building office area exit door (Ground floor).
- Electrically powered exit signs are not a tested and listed system

Recommended remedial actions are provided below.F-202604-064587

Timeline	Remediation Plan
Medium Term CAP-0076233	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0076234	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.9 - Missing exit signs at Main Building office area exit door (Ground floor)



Figure 2.10 - Missing exit signs at entry into stairs S1(2nd floor)

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Kitchen is not fire separated from the rest of the building at Ground & 1st floor e.g. kitchen not separated from office area at Ground floor.

Recommended remedial actions are provided below.F-202604-064573

Timeline	Remediation Plan
Medium Term CAP-0076248	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0076249	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.11 - Kitchen is not fire separated from the rest of the building at 1st floor

8.2 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):
- Proposed lift shaft is not fire separated from rest of the building (all floors).

Recommended remedial actions are provided below.F-202604-064575

Timeline	Remediation Plan
Medium Term CAP-0076255	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0076256	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.12 - Proposed lift shaft is not fire separated from rest of the building (2nd floor)

8.3 Floor openings

Per Pakistan Accord Standard, each floor should be fire separated using 2 hours fire resisting construction with 90 minutes fire rated door/shutter assemblies.

The following deficiencies have been observed on site, including (list not exhaustive):
- Open voids connecting ground & 1st floor at office area.

Recommended remedial actions are provided below.F-202604-064583

Timeline	Remediation Plan
Medium Term CAP-0076241	Prepare a plan and drawings showing the proposed fire separation details. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of floor openings - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0076242	Provide fire rated separation between floors by implementing the plan reviewed previously by Pakistan Accord.



Figure 2.13 - Open voids connecting ground & 1st floor at office area

8.4 Separation of occupancies

Residential sleeping areas should comply with special measures required for sleeping occupancies. Such measures include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key.
- Fire separation of dormitories from other occupancies
- Providing a minimum of 2 escape routes from the above ground levels
- Providing an automatic fire detection and alarm system
- Fire separation of cooking facilities/kitchens from the remainder of the dormitory

The following deficiencies have been observed on site at 2nd floor, including (list not exhaustive):
- No adequate automatic fire detection and alarm system.
- Cooking facilities and/or kitchens not adequately fire separated.
- Lack of fire rated separation between the dormitory and other occupancy type.

Recommended remedial actions are provided below.F-202604-064611

Timeline	Remediation Plan
Medium Term CAP-0076264	Document proposals for design of remedial measures to ensure compliance with all fire safety requirements for sleeping occupancies to comply with Pakistan Accord Standard. Submit proposals to Pakistan Accord for review.
Longer Term CAP-0076265	Implement remediation measures to ensure full compliance with dormitory requirements of Pakistan Accord Standard and Pakistan Building Code in accordance with previously reviewed design.



Figure 2.14 - Missing automatic alarm in sleeping area at 2nd floor



Figure 2.15 - Cooking facilities and/or kitchens not adequately fire separated at 2nd floor

8.5 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building e.g. finished goods storage and raw material storage not fire separated from production area at Ground floor and storage at 2nd floor not separated from dinning area.

Recommended remedial actions are provided below.F-202604-064580

Timeline	Remediation Plan
Medium Term CAP-0076260	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction).
Longer Term CAP-0076261	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard.



Figure 2.16 - Raw material storage not fire separated from production area at Ground floor

9. Fire Safety Management

9.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Fire drill documentation is of poor standard (No attendance sheet/visuals attached).
-No regular fire drills.
Recommended remedial actions are provided below.F-202604-064585

Timeline	Remediation Plan
Medium Term CAP-0076237	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0076238	Ensure fire drills are performed a minimum of 2 times per year.

9.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire Extinguishers
- No records of testing of Emergency Exit Signage

Recommended remedial actions are provided below.F-202604-064586

Timeline	Remediation Plan
Medium Term CAP-0076235	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0076236	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

9.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
-No records of maintenance of Fire Extinguishers.
-No records of maintenance of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202604-064577

Timeline	Remediation Plan
Medium Term CAP-0076271	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0076272	- Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

9.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid firefighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):

- Escape diagrams are missing on some levels e.g. at 3rd floor.
- An EAP document is available; however, It was poor & not as per Pakistan Accord Standard .

Recommended remedial actions are provided below.F-202604-064584

Timeline	Remediation Plan
Medium Term CAP-0076239	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0076240	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

10. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.