Issue	**1**
Factory ID	**26347**
Date of Issue	**22-Apr-2026**

Select Enterprise

P-204, Arshad Town, Darbar Street Rajbah Road
Faisalabad
Punjab Pakistan

Latitude: [31.424016], longitude: [73.025898]
Date of inspection: 10-Mar-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Shehroz Javed**
Reviewed by	**Muhammad Imran**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 10-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 10
   - 3.1 Building Means of Egress Details 11
   - 3.2 Building Use 12
4. Documentation 13
5. Fire Safety Measures 14
6. Remediation Support 15
   - 6.1 Engineering Support 15
7. Means of Escape 16
   - 7.1 Escape doors 16
   - 7.2 Exit access 18
   - 7.3 Protection of stairs 20
   - 7.4 Exit signage 22
8. Fire Rated Construction 24
   - 8.1 Separation of high-risk areas 24
   - 8.2 Separation of shafts 26
   - 8.3 Floor openings 28
   - 8.4 Storage 30
9. Fire Safety Management 32
   - 9.1 Fire drills 32
   - 9.2 Records of system testing 33

9.3 Records of systems maintenance..... 34
9.4 Emergency Action Plan..... 35
10. Assessment Limitations and Assumptions..... 36

1. Executive Summary

On 10-Mar-2026, Shehroz Javed and Muhammad Naseer on behalf of the Pakistan Accord carried out an initial fire inspection for Select Enterprise, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Muhammad Shabbir (Owner), Mr. Mohsin Siddique (HR manager), and other staff members of Select Enterprise. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Accord were also present and the team was led by Mr. Muhammad Naseer of Pakistan Accord.
The factory operates in a general single shift. Approximately 45 workers operate in the factory with 2 workers being females.
The factory comprises of one main building, detail of which is provided below:

- **Main Building** is mainly a three-storey (Ground+M+2) RC moment-resisting frame system with load bearing brick masonry walls at periphery. The building has covered area of 687 sq.m. and with the height of 7.9 m measured from the fire department vehicle access to the topmost occupiable floor. Building has 2 staircases and both discharges internally. The mezzanine floor does not comply with Fire Safety provisions under the Pakistan Accord Building Standard and is therefore classified as a full floor, making the building a four-storey structure (G+M+2). The building is used for solar panels, storage (2nd floor), stitching, pressing, packing, meeting room (1st floor), prayer area, storage (mezzanine), warehouse, store, offices and cutting (ground floor). The construction year of the building is 2017.

The factory complex is entirely occupied by Select Enterprise as owner.
The factory operates in a general single shift for all the activities. Approximately 45 workers operate in the factory with 2 workers being females.
We were presented with civil defence certificate, evacuation Maps, emergency action plan, inspection record of fire extinguisher and fire drill record.

A summary of the main concerns identified during the inspection includes (non-exhaustive):

- Lockable mechanism observed in escape route of whole facility.
- There is no fire separation between stairs, cargo lift and the rest of the building.
- Both stairs discharge inside the building.
- Escape routes are not adequately fire separated from adjoining high-risk areas.
- Storage areas are not fire separated from rest of the building.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes.)

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents



Legends:

Factory Boundary

Inspected Area

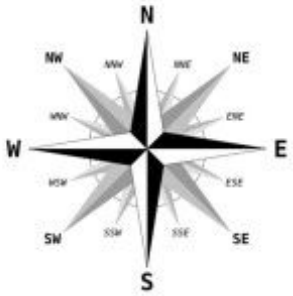


Figure 1.1. Satellite View


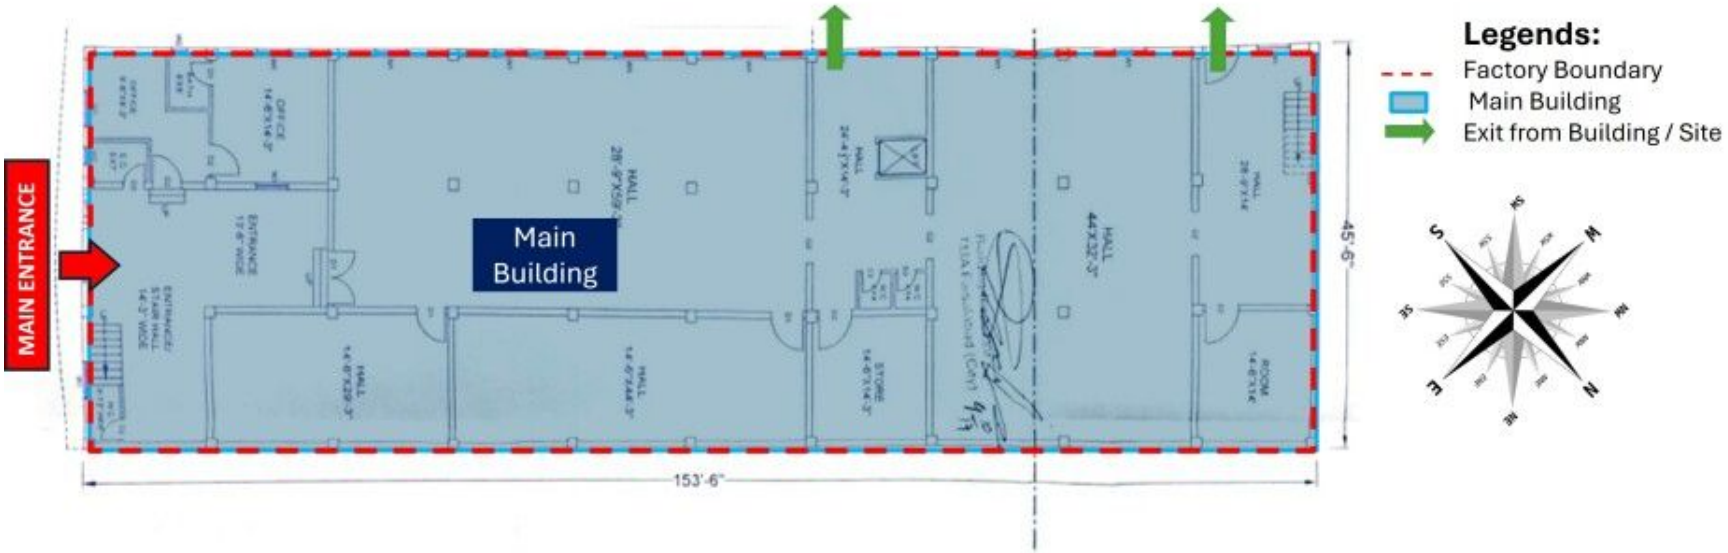


Figure 1.2. Site layout

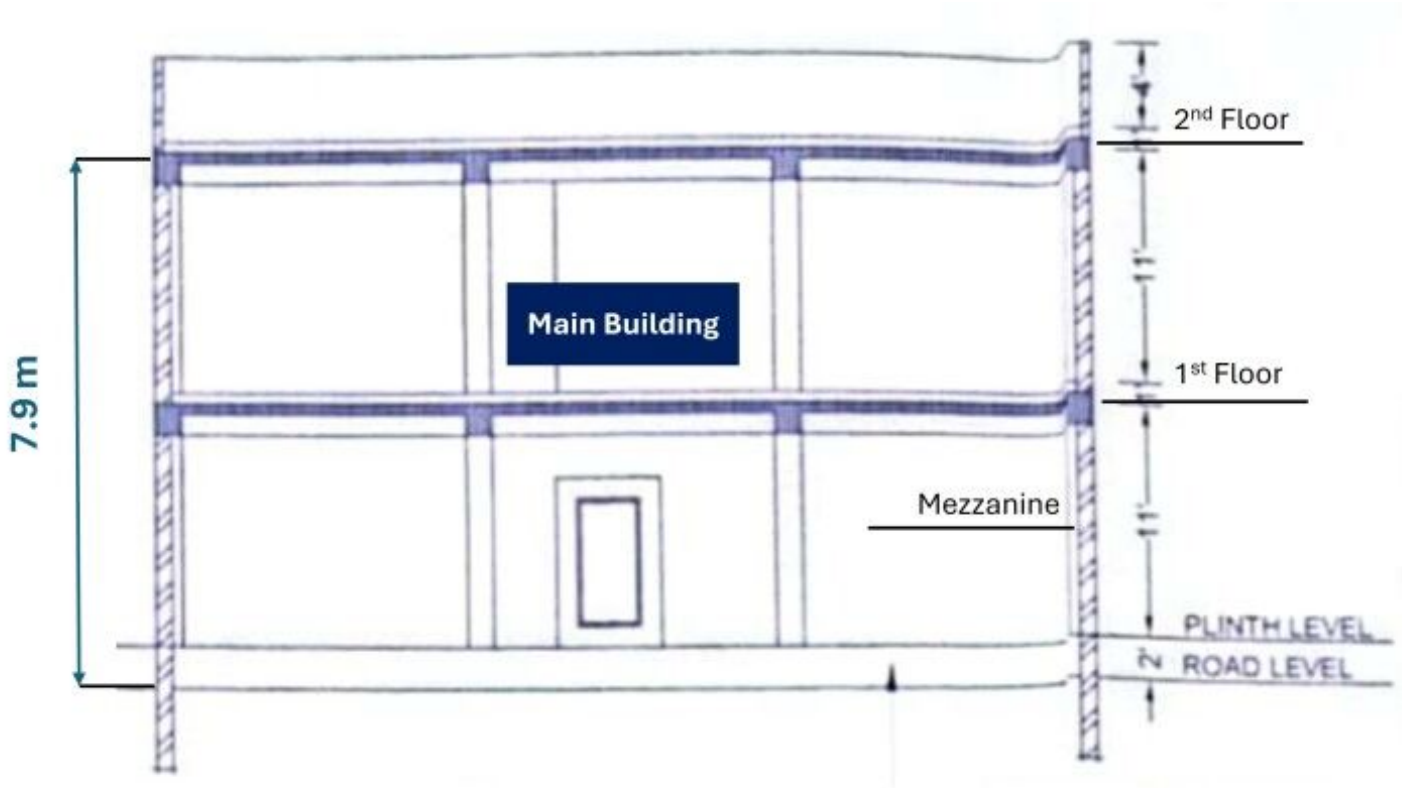

Height is 7.9 m from fire department access road to the topmost occupied floor of above building

Figure 1.3. Section Layout of Main Building.

3. Building Description

The factory comprises of one main building, detail of which is provided below:

· **Main Building** is mainly a three-storey (Ground+M+2) RC moment-resisting frame system with load bearing brick masonry walls at periphery. The building has covered area of 687 sq.m. and with the height of 7.9 m measured from the fire department vehicle access to the topmost occupiable floor. Building has 2 staircases and both discharges internally. The mezzanine floor does not comply with Fire Safety provisions under the Pakistan Accord Building Standard and is therefore classified as a full floor, making the building a four-storey structure (G+M+2). The building is used for solar panels, storage (2nd floor), stitching, pressing, packing, meeting room (1st floor), prayer area, storage (mezzanine), warehouse, store, offices and cutting (ground floor). The construction year of the building is 2017.

3.1 Building Means of Egress Details

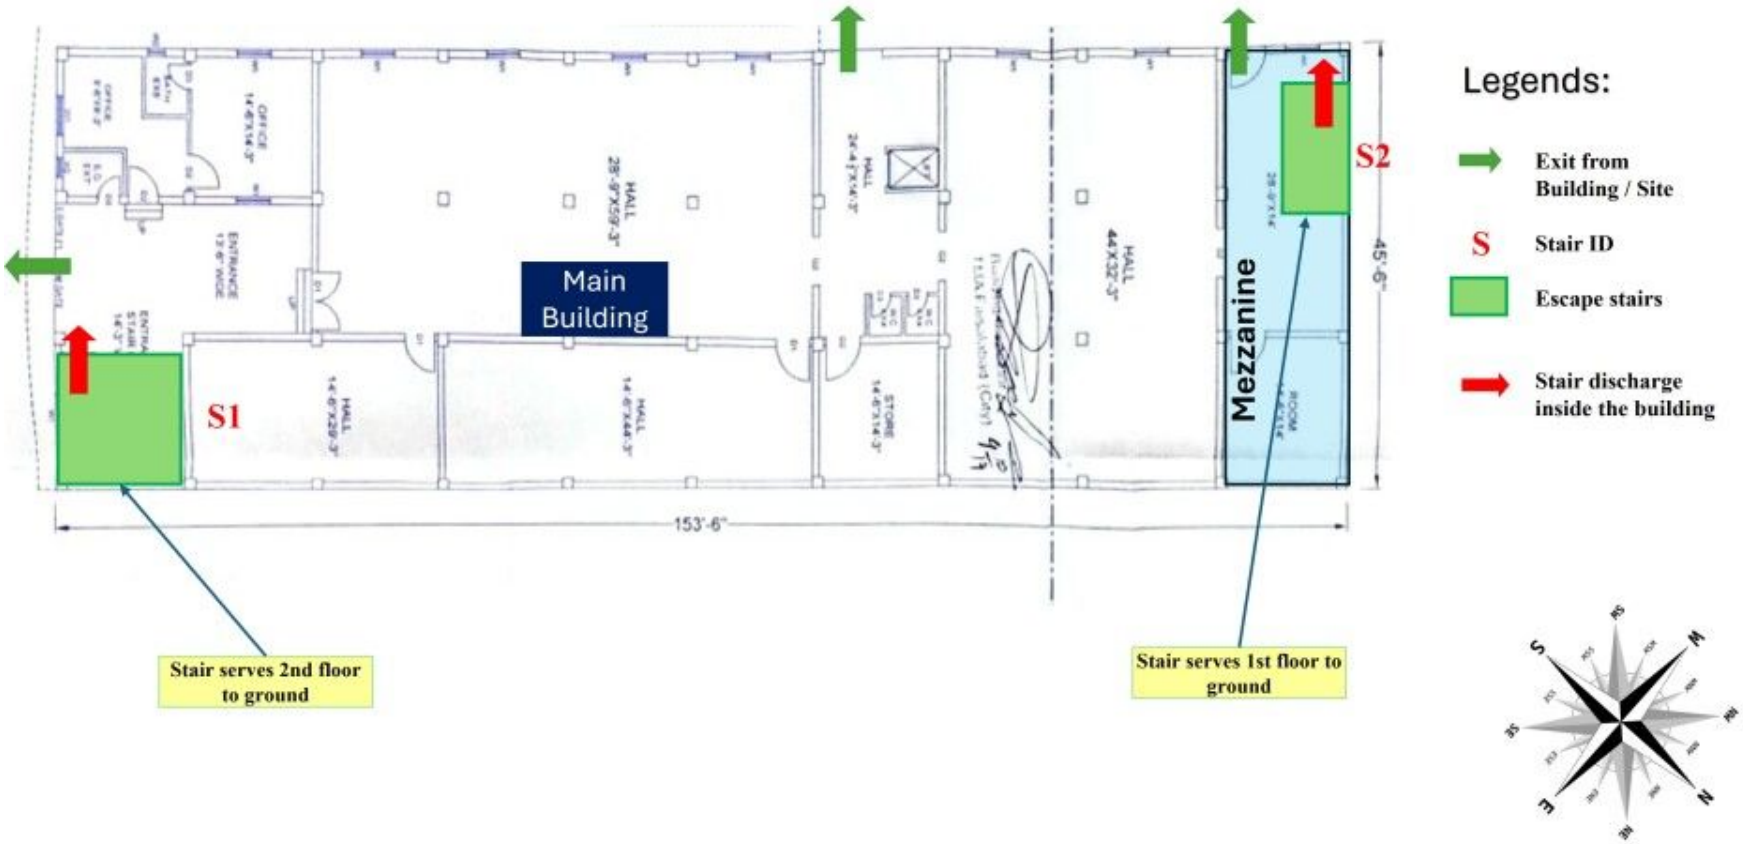


Figure 1.4. Egress Layout of Main Building

3.2 Building Use

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Total Travel Distance	Common Path	Dead End
Main Building						
Roof	Unoccupied	-	-	-	-	-
2nd Floor	Solar panels & storage	10	1	-	-	-
1st Floor	Stitching, pressing, packing & meeting room	60	2	-	-	-
Mezzanine	Prayer area & storage	30	1	-	-	-
Ground Floor	Warehouse, store, offices and cutting	80	3	-	-	-

The number of exits is sufficient at Main Building. No excessive common path was observed in the Main Building.

4. Documentation

This table shows the details about the documentation provided by the factory.

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		Yes	03 March 2026	-
2.	Architecture Layout		No	-	Approved building layout was provided
3.	Sectional Layout		Yes	02 Oct 2019	-
4.	Evacuation Maps		Yes	-	Missing at entrance into multiple staircases
5.	Emergency Action Plan		Yes	Not mentioned	Not as per Pakistan Accord Building Standard.
6.	Inspection	Fire extinguishers	Yes	Jan 2026	-
		Exit signage	No	-	-
7.	Testing	Fire extinguishers	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Fire extinguishers	No	-	-
		Exit signage	No	-	-
9.	Evidence of Fire Drills		Yes	03 Feb 2026	Not as per Pakistan Accord Building Standard as only single drill was performed with Poor documentation as no date and time stamp missing on evidence pictures.
10.	Staff Training		Yes`	31 Jan 2026	First aid & Firefighting

5. Fire Safety Measures

During our fire site inspection of Select Enterprise, a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Select Enterprise. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202603-064221

Timeline	Remediation Plan
Immediate CAP-0075535	Factories should begin remediation of CAP items—such as installing extinguishers, signage, and clearing escape routes—using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape

This is not always achieved, examples include (list not exhaustive):
- Escape doors are lockable in multiple escape routes such as entrance into Stairs S1 from 2nd & 1st floor and exits from main building are lockable.
- Doors serving areas with over 50 occupants swing against the direction of escape such as escape door from production area at ground floor towards main entrance.
- Doors into stairs swing against the direction of escape such as escape door of meeting room and stitching at 1st floor & 2nd floor escape door towards S1.

Recommended remedial actions are provided below.F-202603-064226

Timeline	Remediation Plan
Immediate CAP-0075570	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0075571	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5.
Longer Term CAP-0075572	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Escape door swing against the direction of escape from meeting room to S1.



Figure 2.2 - Escape door near generator area at ground floor is lockable from inside.



Figure 2.3 - Escape door swing against the direction of escape from production area towards main entrance at ground floor.

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.
- Headroom along escape route should be more than 2.05m.

This is not always achieved, examples include (list not exhaustive):
- Protected stair discharges inside the building at a distance from building exit such as S1 & S2.
- Insufficient headroom along escape route (i.e. headroom height is less than 2.05m) such as 1.97m headroom clearance at S2 (mezzanine).

Recommended remedial actions are provided below.F-202603-064233

Timeline	Remediation Plan
Medium Term CAP-0075555	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks) Propose modifications to ensure 2.05m headroom height is achieved along the escape routes or propose alternative egress routes that comply. Submit the proposal to Pakistan Accord for review.

Longer Term CAP-0075556	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted. Implement measures to ensure adequate clear head height is achieved along all escape routes.



Figure 2.4 - 1.97m headroom clearance measured at S2 (Mezzanine).

7.3 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Missing fire rated enclosure and fire doors in stairs S1 & S2.
- Fire load in stairs S1 (batteries & electrical DB and also under stair S2 at ground floor.

Recommended remedial actions are provided below.F-202603-064222

Timeline	Remediation Plan
Immediate CAP-0075583	Remove fire load and any other obstructions due to stored items from stairs.
Medium Term CAP-0075584	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.
Longer Term CAP-0075585	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.5 - Fire load under stair S1 at ground floor.

7.4 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at entry into stair S1 from 2nd floor.
- Missing exit signs in production areas at ground & 1st floor.
- Electrically powered exit signs are not a tested and listed system

Recommended remedial actions are provided below.F-202603-064230

Timeline	Remediation Plan
Medium Term CAP-0075577	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0075578	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.6 - Missing exit signage at stitching area at 1st floor.

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Generator room is not fire separated from production area/exit access route at ground floor.

Recommended remedial actions are provided below.F-202603-064231

Timeline	Remediation Plan
Medium Term CAP-0075601	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0075602	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.7 - Generator room is not fire separated from production area/exit access route (ground floor).

8.2 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):

- Lift shaft is not separated with fire rated construction at Main Building.

Recommended remedial actions are provided below.F-202603-064223

Timeline	Remediation Plan
Medium Term CAP-0075603	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0075604	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.8 - Lift shaft is not fire separated with fire rated construction (on all floors).

8.3 Floor openings

Per Pakistan Accord Standard, each floor should be fire separated using 2 hours fire resisting construction with 90 minutes fire rated door/shutter assemblies.

The following deficiencies have been observed on site, including (list not exhaustive):
- Ventilation openings linking different levels (2nd floor to ground floor) are not fire separated.

Recommended remedial actions are provided below.F-202603-064225

Timeline	Remediation Plan
Medium Term CAP-0075588	Prepare a plan and drawings showing the proposed fire separation details. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of floor openings - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0075589	Provide fire rated separation between floors by implementing the plan reviewed previously by Pakistan Accord.



Figure 2.9 - Ventilation opening links (connecting ground to 2nd floor) are not fire separated.

8.4 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building such as storage area at ground floor and 1st floor is not fire separated from cutting and finishing area respectively. Furthermore, storage area at mezzanine is also not fire separated from prayer area.

Recommended remedial actions are provided below.F-202603-064229

Timeline	Remediation Plan
Medium Term CAP-0075590	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0075591	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard.



Figure 2.10 - Storage area is not fire separated from cutting at ground floor.

9. Fire Safety Management

9.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- No regular fire drills as only single drill was performed.
- Fire drill documentation is of poor standard as date & time stamp missing on provided evidence pictures.

Recommended remedial actions are provided below.F-202603-064232

Timeline	Remediation Plan
Medium Term CAP-0075628	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0075629	Ensure fire drills are performed a minimum of 2 times per year.

9.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire Extinguishers.
- No records of testing of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202603-064224

Timeline	Remediation Plan
Medium Term CAP-0075609	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0075610	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

9.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of maintenance of Fire Extinguishers
-No records of maintenance of Emergency Exit Signage

Recommended remedial actions are provided below.F-202603-064227

Timeline	Remediation Plan
Medium Term CAP-0075617	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0075618	- Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

9.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid firefighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):

- Escape diagrams are missing on some levels such as at entrance into S2 from 1st floor.
- An EAP document is available; however, it was not as per Pakistan Accord Standard .

Recommended remedial actions are provided below.F-202603-064228

Timeline	Remediation Plan
Medium Term CAP-0075622	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0075623	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

10. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.