Issue	**1**
Factory ID	**25298**
Date of Issue	**11-Jun-2026**

Smart Apparel (Pvt.) Ltd.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Chak No.196 / R.B. Islamabad, P-1, Garments City, Dry Port Road
Faisalabad
Punjab Pakistan

Latitude: [31.50359], longitude: [73.119422]
Date of inspection: 14-Apr-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Usama Zia**
Reviewed by	**Waqar Sami**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 14-04-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 9
   - 3.1 Building Means of Egress Details 10
   - 3.2 Building Use 11
4. Documentation 12
5. Fire Safety Measures 13
6. Remediation Support 14
   - 6.1 Engineering Support 14
7. Means of Escape 15
   - 7.1 Escape doors 15
   - 7.2 Exit access 17
   - 7.3 Protection of stairs 19
   - 7.4 Escape stair condition 21
   - 7.5 Exit signage 22
8. Fire Rated Construction 24
   - 8.1 Separation of high-risk areas 24
   - 8.2 Storage 26
9. Fire Suppression 28
   - 9.1 Fire extinguishers 28
10. Fire Safety Management 30

10.1 Fire drills..... 30
10.2 Records of system testing..... 31
10.3 Records of systems maintenance..... 32
10.4 Emergency Action Plan..... 33
11. Assessment Limitations and Assumptions..... 34

1. Executive Summary

On 14-Apr-2026, Usama Ahmed Zia and Tariq Mehmood on behalf of the Pakistan Accord carried out an initial fire inspection for Smart Apparel (Pvt.) Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Muhammad Shoaib Ijaz Compliance consultant, Mr. Bilal Yaqoob Health and Safety, Mr. Nazar Ali Electrical, Mr. Muhammad Muaz Compliance Officer along with other staff members of the factory. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Pakistan Accord were also present and the team was led by Tariq Mehmood Pakistan Accord.

The factory comprises of three main buildings and four ancillary building, details of which are provided below:

1. **Building 1** is a two storey G+1 RC MRF building. The building is used for Sampling, Offices, Warehouse, Metal free zone on ground level, Stitching, Printing on level 1, and the roof is inaccessible. The building was constructed in 2021.

2. **Building 2** is a two-storey G+1 RC MRF building with steel portal frame shed on level 1. The building is used for Stitching, sampling, offices on level ground, cutting and checking on level 1, and the roof is inaccessible. The building was constructed in 2021.

3. **Building 3** is a G only, T-Iron and concrete PCC/brick slab supported on load bearing brick masonry walls building. The building is used for pressing, checking, packing, warehouse, carton storage and offices, and the roof is unoccupied. Construction year of the building is 2021.

From Fire and Life Safety perspective all three buildings are considered as a single building and name as **Main Building** which is a two story G+1 building with a covered area (footprint) of approximately 1661 sq. m and the height of the topmost occupied floor from fire department vehicle access is 4.26 m. Building has four staircase out of which one discharge internally.

4. Ancillaries

a. Office, ground only load bearing brick masonry walls supporting RC slab structure used as office.
b. Washroom, ground only load bearing brick masonry walls supporting RC slab structure used as washroom and water tank.
c. Utilities, ground only steel shed with fibreglass sheeting supported on adjacent load bearing brick masonry walls with two sides open used for

boiler, compressor and RO plant.

d. Mechanical Plant, ground only load bearing brick masonry walls supporting RC slab and pre-cast slab panels used as washrooms and mechanical room.

The factory complex is entirely occupied by Smart Apparels Pvt. Ltd. Enterprises as a tenant.

The factory operates with single shift of 8 hours for all the activities. Approximately 90 workers operate in the factory out of which approximately 18 employees are female.

We were presented with Architectural Layouts, Section layout, Evacuation Maps, Civil Defence Certificate.

A summary of the main concerns identified during the inspection includes (non-exhaustive):

- Lockable mechanisms observed in escape route across the whole facility.
- There is no fire separation between stairs and the rest of the building.
- Storage areas are not fire separated from rest of the building.

We see no reason to suspend operations in the facility due to these concerns (subject to the required actions noted in this report being addressed within agreed timeframes.)

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

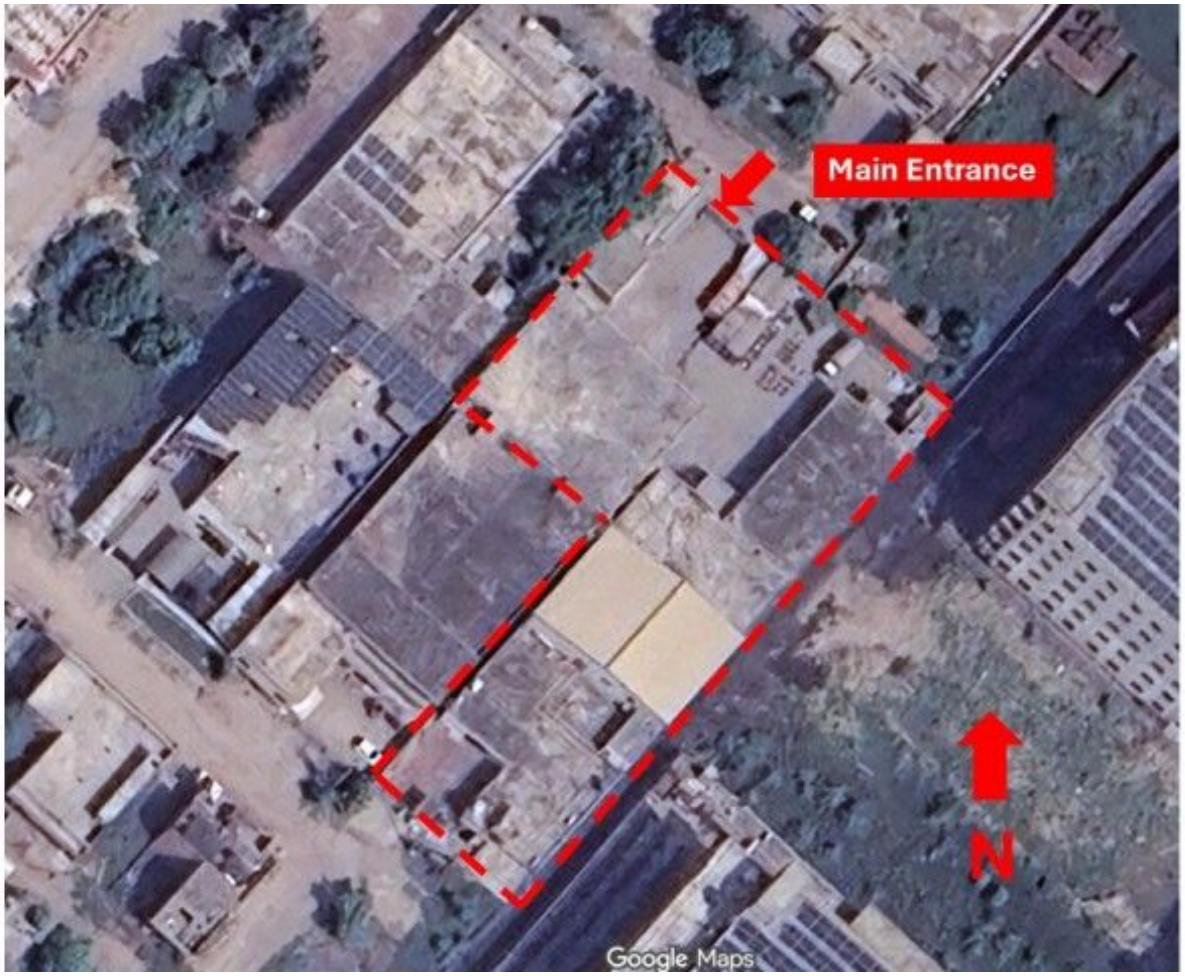


Figure 1.1. Site layout (satellite view) with red dashed lies indicates approximate site boundary

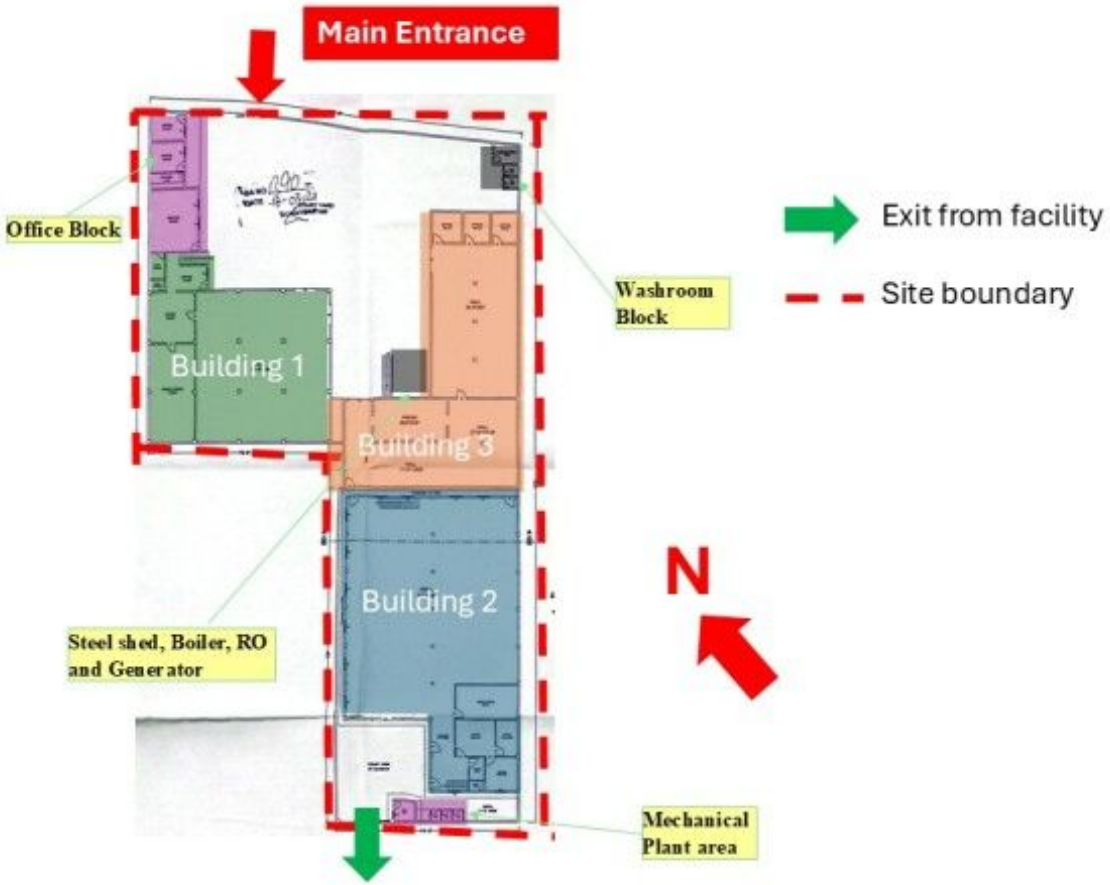


Figure 1.2. Site Layout

3. Building Description

The factory comprises of three main buildings and four ancillary building, details of which are provided below:

1. **Building 1** is a two storey G+1 RC MRF building. The building is used for Sampling, Offices, Warehouse, Metal free zone on ground level, Stitching, Printing on level 1, and the roof is inaccessible. The building was constructed in 2021.

2. **Building 2** is a two-storey G+1 RC MRF building with steel portal frame shed on level 1. The building is used for Stitching, sampling, offices on level ground, cutting and checking on level 1, and the roof is inaccessible. The building was constructed in 2021.

3. **Building 3** is a G only, T-Iron and concrete PCC/brick slab supported on load bearing brick masonry walls building. The building is used for pressing, checking, packing, warehouse, carton storage and offices, and the roof is unoccupied. Construction year of the building is 2021.

From Fire and Life Safety perspective all three buildings are considered as a single building and name as **Main Building** which is a two story G+1 building with a covered area (footprint) of approximately 1661 sq. m and the height of the topmost occupied floor from fire department vehicle access is 4.26 m. Building has four staircase out of which one discharge internally.

4. Ancillaries

a. Office, ground only load bearing brick masonry walls supporting RC slab structure used as office.
b. Washroom, ground only load bearing brick masonry walls supporting RC slab structure used as washroom and water tank.
c. Utilities, ground only steel shed with fibreglass sheeting supported on adjacent load bearing brick masonry walls with two sides open used for boiler, compressor and RO plant.
d. Mechanical Plant, ground only load bearing brick masonry walls supporting RC slab and pre-cast slab panels used as washrooms and mechanical room.

The factory complex is entirely occupied by Smart Apparels Pvt. Ltd. Enterprises as a tenant.

3.1 Building Means of Egress Details

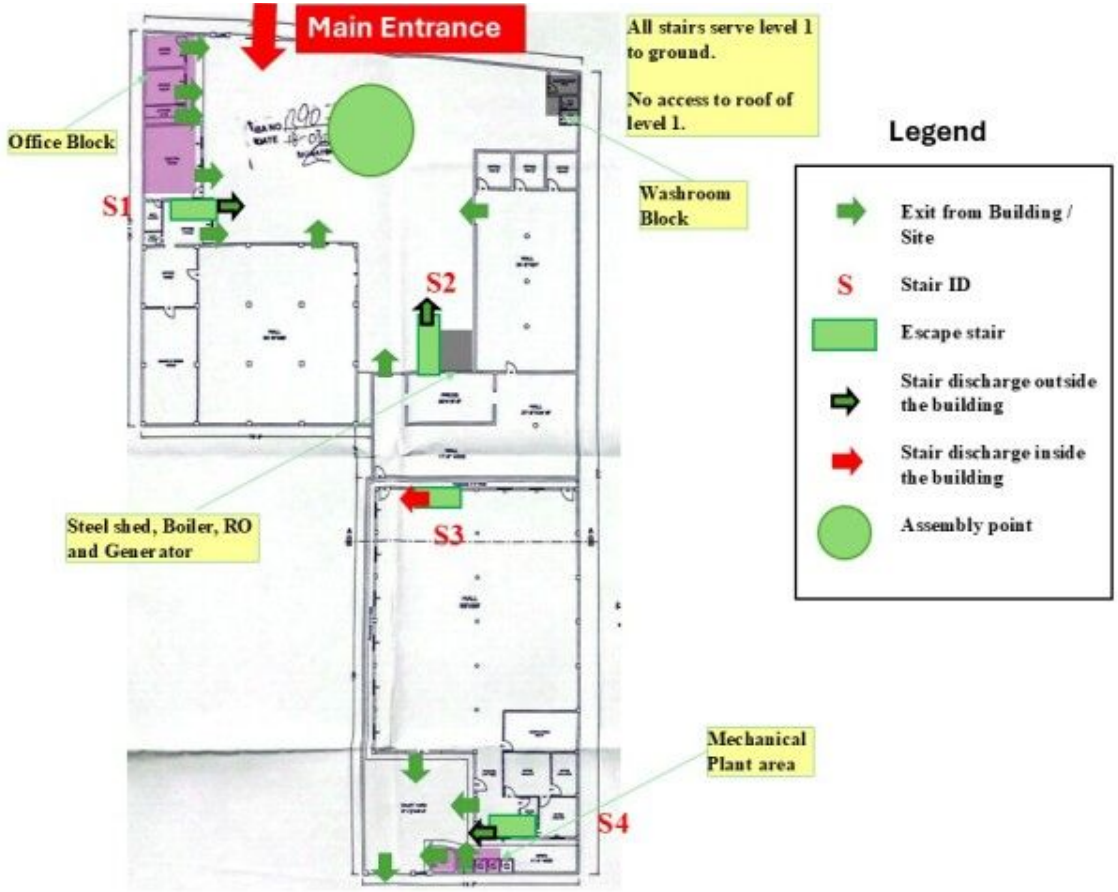


Figure 1.3. Egress layout of site

3.2 Building Use

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Total Travel Distance	Common Path	Dead End
Main Building						
Roof	Inaccessible	-	-	-	-	-
Level 1	Stitching, Printing, Cutting & Checking	45	4	-	-	-
Ground	Stitching, Sampling, Warehouse/Storage and Offices	45	6	-	-	-
Ancillary blocks						
Office	Office, Conference room	25	3	-	-	-
Washroom	Washroom	-	-	-	-	-
Utilities	Shed with two sides open	-	-	-	-	-
Mechanical Plant	Mechanical room and washroom	2	2	-	-	-

There is sufficient exit capacity in the buildings and no Travel Distance issue found.

4. Documentation

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defence Certificate (NOC)		Yes	03-01-2026	-
2.	Architecture Layout		Yes	-	Not as per built structure
3.	Sectional Layout		Yes	-	Not as per built structure
4.	Evacuation Maps		Yes	-	-
5.	Emergency Action Plan		No	-	-
6.	Inspection	Fire extinguishers	No	-	-
		Exit signage	No	-	-
7.	Testing	Fire extinguishers	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Fire extinguishers	No	-	-
		Exit signage	No	-	-
9.	Evidence of Fire Drills		Yes	14-10-2025	Not as per Pakistan Accord Building Standard.
10.	Staff Training		Yes	09-10-2025	No attendance sheet record

5. Fire Safety Measures

During our fire site inspection of Smart Apparel (Pvt.) Ltd., a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Smart Apparel (Pvt.) Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-065314

Timeline	Remediation Plan
Immediate CAP-0077280	Factories should begin remediation of CAP items—such as installing extinguishers, signage, and clearing escape routes—using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape.
- Sliding doors shall not serve for escape from areas with more than 10 occupants.

This is not always achieved, examples include (list not exhaustive):
- Escape doors are lockable across the facility including the facility exit doors and gates.
- Doors into stairs swing against the direction of escape at staircase S1 and S4.
- Sliding doors serve for escape from areas with more than 10 occupants at multiple locations across the facility at both levels.

Recommended remedial actions are provided below.F-202604-065263

Timeline	Remediation Plan
Immediate CAP-0077228	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0077229	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5. Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, that are side swinging and open in the direction of travel to an exit.
Longer Term CAP-0077230	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Sliding and lockable escape door at level ground



Figure 2.2 - Lockable and swing against the direction of escape at entry into stair S4 at level 1

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.
- Headroom along escape route should be more than 2.05m.

This is not always achieved, examples include (list not exhaustive):
- Obstructions on escape route at storage area level ground in form of door opening in the escape and reducing the width to below minimum required.
- Protected stair S3 discharges inside the building at a distance from building exit.
- Insufficient headroom along escape route (i.e. headroom height is less than 2.05m) at staircase S4 (1.8m).

Recommended remedial actions are provided below.F-202604-065272

Timeline	Remediation Plan
Immediate CAP-0077261	Remove obstructions on escape routes and keep them clear for escape. Provide warning signs where headroom height is less than 2.05 m on escape routes.
Medium Term CAP-0077262	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks) Propose modifications to ensure 2.05m headroom height is achieved along the escape routes or propose alternative egress routes that comply. Submit the proposal to Pakistan Accord for review.

Longer Term CAP-0077263	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted. Implement measures to ensure adequate clear head height is achieved along all escape routes.



Figure 2.3 - Obstruction in terms of door opening in exit access route at level ground



Figure 2.4 - Low head room clearance (1.8m) observed in staircase S4

7.3 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Missing fire rated enclosure and fire doors in stair S3 and S4.
- Fire load in stairs S2, S3 and S4.

Recommended remedial actions are provided below.F-202604-065269

Timeline	Remediation Plan
Immediate CAP-0077253	Remove fire load and any other obstructions due to stored items from stairs.
Medium Term CAP-0077254	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.
Longer Term CAP-0077255	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.5 - Unprotected opening and fire load under staircase S4



Figure 2.6 - Missing fire rated enclosure and fire door at staircase S3

7.4 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):
- Missing handrail on one side of staircase S1 and S4.

Recommended remedial actions are provided below.F-202604-065273

Timeline	Remediation Plan
Medium Term CAP-0077264	Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height.



Figure 2.7 - Missing one side handrail in staircase S4

7.5 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs in production areas at both levels.
- Missing exit signs in offices at level ground.
- Missing exit signs at roof area level 1.
- Exit signs are not clear / misleading at level ground storage, where signage is leading back into production.
- Electrically powered exit signs are not a tested and listed system.
- Exit signage is inconsistent in colour and style across the facility.

Recommended remedial actions are provided below.F-202604-065271

Timeline	Remediation Plan
Immediate CAP-0077258	Remove misleading directional escape signs.
Medium Term CAP-0077259	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0077260	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.8 - Misleading exit signage on level ground taking the occupants back to production



Figure 2.9 - Missing signage on roof area

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Electrical rooms are not fire separated from Storage area at level ground.
- Generator room is not fire separated from boiler and production at level ground.
- Boiler area is not fire separated from generator and production at level ground.

Recommended remedial actions are provided below.F-202604-065267

Timeline	Remediation Plan
Medium Term CAP-0077237	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0077238	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard.



Figure 2.10 - LT room not fire separated from storage area at level ground



Figure 2.11 - Boiler, Generator and RO plant area not fire separated from production and storage

8.2 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45m
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from office and production at level ground of the building (door not fire door and unprotected openings), and not fire separated from packing and sizing at level ground.
- Presence of areas where storage does not meet miscellaneous in-process storage requirements (listed above) at finishing and packing area level ground.

Recommended remedial actions are provided below.F-202604-065264

Timeline	Remediation Plan
Medium Term CAP-0077231	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0077232	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard.



Figure 2.12 - Storage is not fire separated from packing and sizing at level ground

9. Fire Suppression

9.1 Fire extinguishers

Extinguisher coverage and type of extinguishers used should comply with NFPA 10.

The following deficiencies have been observed on site, including (list not exhaustive):
- Poor condition of fire extinguishers. Fire extinguishers found with damaged body (cylinder), rusted, and hose damaged (inoperable).

Recommended remedial actions are provided below.F-202604-065265

Timeline	Remediation Plan
Medium Term CAP-0077233	Ensure that all building areas are protected using fire extinguishers. The coverage and type of extinguishers used should follow NFPA 10.
Longer Term CAP-0077234	Monitor fire extinguishers for coverage and extinguisher type to comply with NFPA 10.



Figure 2.13 - Improper hanging, damaged hose and damaged cylinder at level 1

10. Fire Safety Management

10.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- No regular fire drills.
- Fire drill documentation is not as per standard.

Recommended remedial actions are provided below.F-202604-065270

Timeline	Remediation Plan
Medium Term CAP-0077256	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0077257	Ensure fire drills are performed a minimum of 2 times per year.

10.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- Inadequate records of testing of Fire Extinguishers.
- Inadequate records of testing of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202604-065266

Timeline	Remediation Plan
Medium Term CAP-0077235	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0077236	#NAME?

10.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire alarm and detection system to NFPA 72, fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- Inadequate records of maintenance of Fire Extinguishers.
-Inadequate records of maintenance of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202604-065281

Timeline	Remediation Plan
Medium Term CAP-0077267	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0077268	#NAME?

10.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation
plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid firefighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):
- There is no EAP document which details the procedures, roles and responsibilities in the event of fire.

Recommended remedial actions are provided below.F-202604-065268

Timeline	Remediation Plan
Medium Term CAP-0077248	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0077249	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

11. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.