Issue	**1**
Factory ID	**25298**
Date of Issue	**11-Jun-2026**

Smart Apparel (Pvt.) Ltd.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Chak No.196 / R.B. Islamabad, P-1, Garments City, Dry Port Road
Faisalabad
Punjab Pakistan

Latitude: [31.50359], longitude: [73.119422]
Date of inspection: 14-Apr-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Haris Mahmood**
Reviewed by	**Talha Akram Khan**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 14-04-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 4
2. Building Extents 6
   2.1 Structural System 16
3. Documentation 20
4. Structural Safety Measures 21
5. Remediation Support 23
   5.1 Engineering Support 23
6. Cracking 24
   6.1 Walls 24
7. Other Damage/Defects 26
   7.1 Corrosion of reinforcement 26
   7.2 Corrosion of reinforcement 27
   7.3 Health and Safety 28
8. Structural Documentation 29
   8.1 Documentation unavailable 29
   8.2 Lack of safe load plans 30
9. Assessment Limitations and Assumptions 31

1. Executive Summary

On 14-Apr-2026, Haris Mahmood and Kashif Riaz on behalf of the Pakistan Accord carried out an initial structural inspection for Smart Apparel (Pvt.) Ltd., a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with Mr. Muhammad Shoaib Ijaz (Factory Compliance Consultant), Mr. Bilal Yaqoob (HR and Admin Manager), Mr. Muhammad Muaz (Compliance Officer) and other staff members of Smart Apparel (Pvt.) Ltd. The assessment was conducted as a part of an overall Structural, Fire, and Electrical initial inspection.

The factory operates in single general shift. Factory employs approximately 90 workers with approximately 25% female representation.

The factory comprises of three main buildings and four ancillary structures rented to Smart Apparel (Pvt.) Ltd on a tenancy basis. During the inspection, the building highlighted in blue in Figure 1.1 was surveyed with the site boundary indicated in red.

- **Building 1** is a two-storey (Ground + 1) building. The structural system of the building is RC moment resisting frame system. The building is used for stitching , printing (First Floor) and sampling, offices, warehouse, metal free zone (Ground Floor). The construction year of the building is 2021.
- **Building 2** is a two-storey (Ground + 1) building. The structural system of the building is mainly RC moment resisting frame system and locally load bearing brick masonry walls supporting T-iron and brick slab. The roof structural system of the building is steel portal frame shed. The building is used for cutting, checking (First Floor) and stitching, sampling, offices (Ground Floor). The construction year of the building is 2021.
- **Building 3** is a single storey (Ground Only) building. The structural system of the building is load bearing brick masonry walls supporting steel girders and T-iron with brick/PCC tile slab. The building is used for pressing, checking, packing, warehouse, carton storage (Ground Floor). The construction year of the building is 2021.
- **Ancillary Structures** consist of the following:
  - **Office Block** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting RC Slab. The structure is used for offices, kitchen (Ground Floor). The construction year of the structure is 2021.
  - **Toilet Block** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting RC Slab. The structure is used for Water Tank (Roof) and toilets (Ground Floor). The construction year of the structure is 2021.
  - **Utilities** is a single storey (Ground Only) steel shed with fiberglass sheeting supported on adjacent load bearing walls. The structure is used for boiler, RO plant, compressor (Ground Floor). The construction year of the structure is 2021.
  - **Mechanical Room** is a single storey (Ground Only) structure with load bearing brick masonry walls supporting RC Slab and precast slab panels. The structure is used as mechanical room and toilets (Ground Floor). The construction year of the structure is 2021.

We were presented with the site layout plan and stability certificate of the factory. For further details, refer to Table 2 of the documentation of this report.

There is a health and safety concern including the inadequate edge protection at first floor level of Building 2, which should be addressed immediately. For further details, refer to Section 7 of this report.

A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Cracking was observed in the load bearing brick masonry walls of Building 2.
- The column dowel reinforcement is exposed to atmospheric corrosion at the first-floor level of Building 2.

We see no reason to suspend operations in the facility due to these concerns.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1: Building Summary

Building	Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / modifications	Engineer access issues
Building 1	Stitching, printing (First Floor) Sampling, offices, warehouse, metal free zone (Ground Floor)	Two (Ground+1)	2021	RC moment resisting frame system	-	-	-
Building 2	Cutting, checking (First Floor) Stitching, Sampling, offices (Ground Floor)	Two (Ground+1)	2021	RC moment resisting frame system and load bearing brick masonry walls supporting T-iron and brick slab	Steel Portal Frame Shed	-	-

Building 3		Pressing, checking, packing, warehouse, carton storage (Ground Floor)	One (Ground Only)	2021	Load bearing brick masonry walls supporting steel girders and T-iron with brick/PCC tile slab	-	-	-
Ancillary Structures	Office Block	Offices, kitchen (Ground Floor)	One (Ground Only)	2021	Load bearing brick masonry walls supporting RC Slab	-	-	-
	Toilet Block	Water Tank (Roof) Toilets (Ground Floor)	One (Ground Only)	2021	Load bearing brick masonry walls supporting RC Slab	-	-	-

	Utilities	Boiler, RO plant, compressor (Ground Floor)	One (Ground Only)	2021	Steel shed with fiberglass sheeting supported on adjacent load bearing walls	-	-	-
	Mechanical Room	Mechanical room and toilets (Ground Floor)	One (Ground Only)	2021	Load bearing brick masonry walls supporting RC Slab and precast slab panels	-	-	-

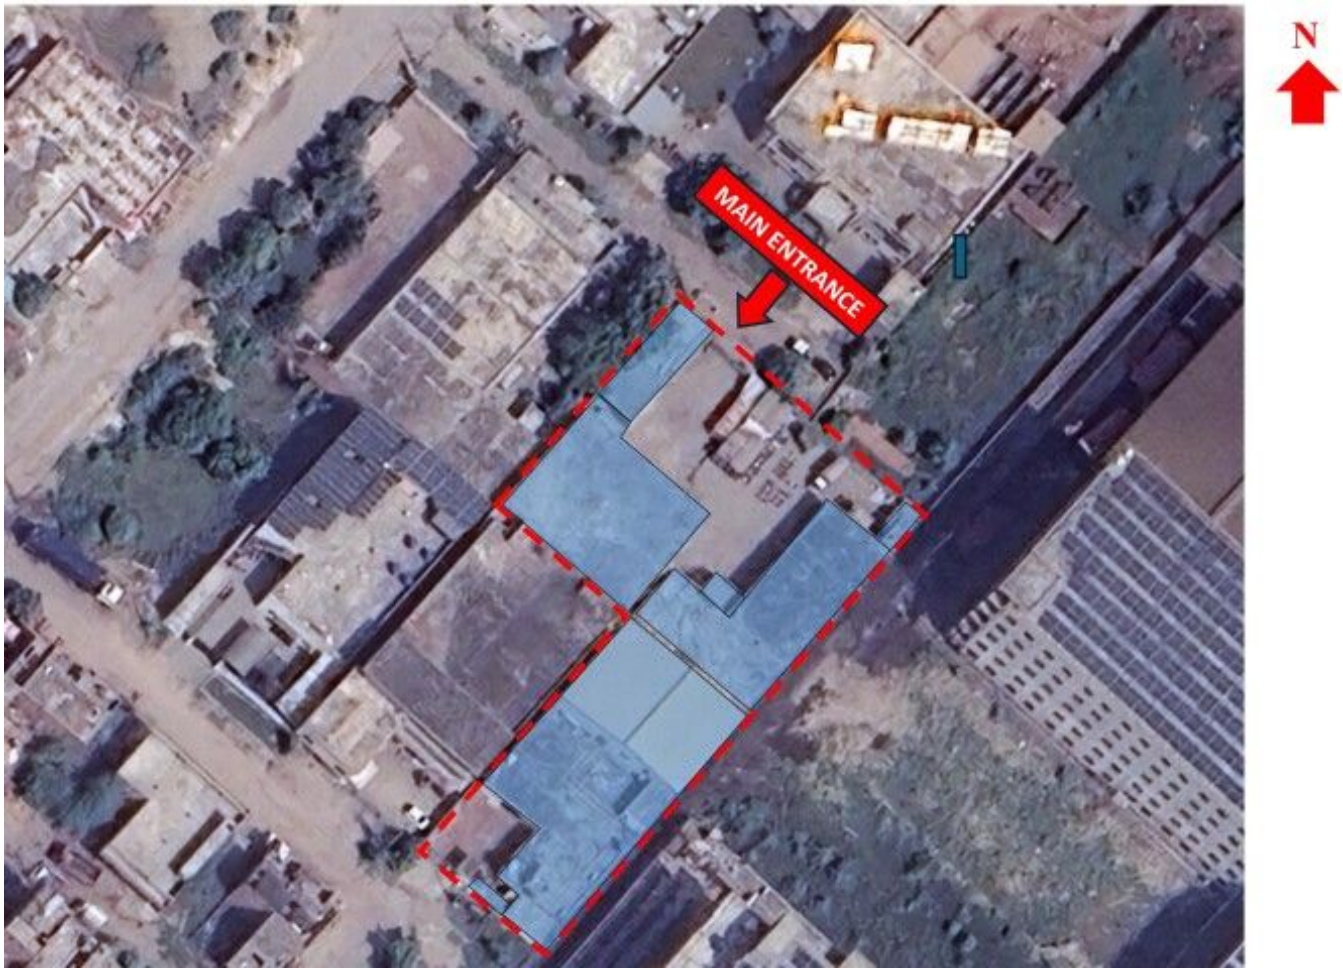


Figure 1.1. Satellite view of the factory premises; Red dashed line indicates site boundary, and highlighted blue area indicates inspected building area

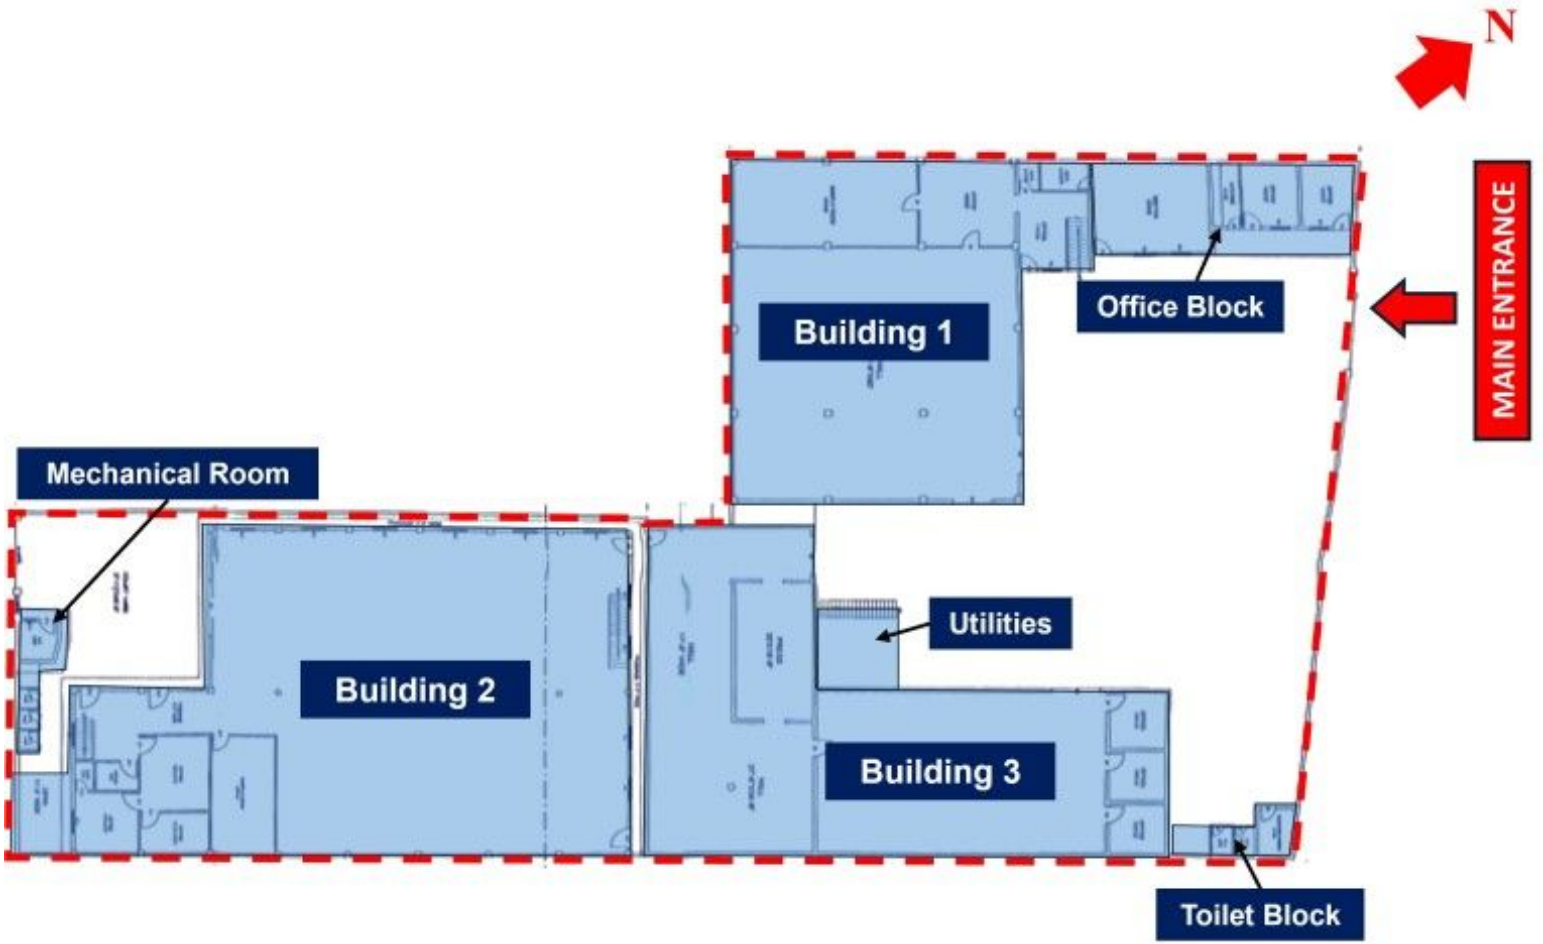


Figure 1.2. Site Layout Plan of the Factory Premises; Red Dashed Line indicates site boundary, and Highlighted Area indicates Buildings inspected



Figure 1.3. Front Elevation of Building 1



Figure 1.4. North Side Elevation of Building 2



Figure 1.5. South Side Elevation of Building 2



Figure 1.6. Front Elevation of Building 3



Figure 1.7. Front Elevation of Office Block



Figure 1.8. Front Elevation of Toilet Block



Figure 1.9. Front Elevation of Utilities



Figure 1.10. Front Elevation of Mechanical Room



Figure 1.11. Stitching at First Floor of Building 1



Figure 1.12. Metal free Zone at Ground Floor of Building 1



Figure 1.13. Offices at Ground Floor of Building 1



Figure 1.14. Sampling Room at Ground Floor of Building 1



Figure 1.15. Sampling at First Floor of Building 2



Figure 1.16. Cutting at First Floor of Building 2



Figure 1.17. Office at Ground Floor of Building 2



Figure 1.18. Sample Stitching at Ground Floor of Building 2



Figure 1.19. Stitching at Ground Floor of Building 2



Figure 1.20. Pressing at Ground Floor of Building 3



Figure 1.21. Checking and Packing at Ground Floor of Building 3



Figure 1.22. Carton Storage at Ground Floor of Building 3

2.1 Structural System

Building	Building 1
Stability system	RC moment resisting frame system
Column size (m)	0.500 x 0.500
Grid (m)	5.7 x 6.2
Primary beam size (m)	0.400 x 0.300
Secondary beam size (m)	-
Slab depth (m)	0.150 (Assumed)
Finishes depth (m)	0.100 (Assumed)
Ceiling height (m)	G to 1st Floor = 3.7 1st Floor to Roof = 3.5


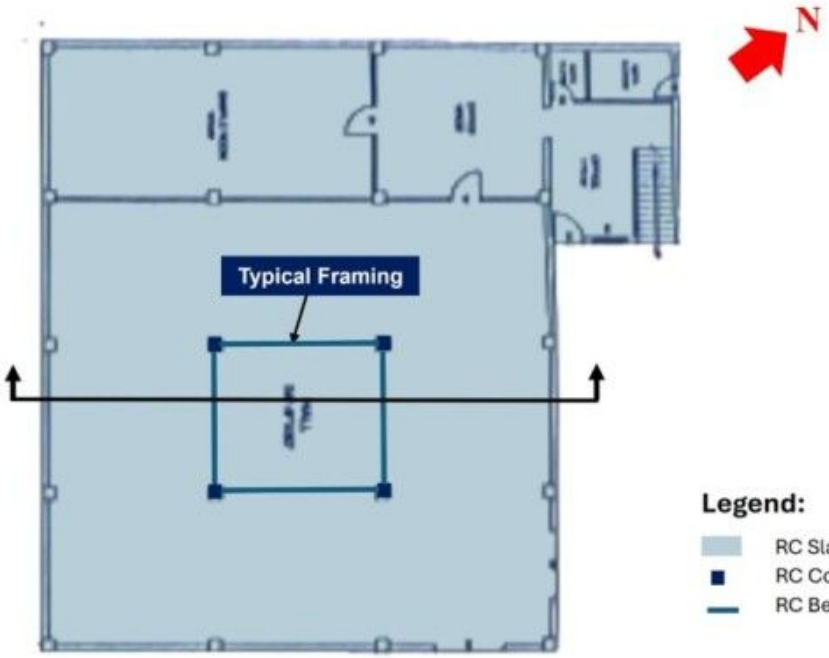


Figure 1.23. Typical Floor Framing Plan of Building 1

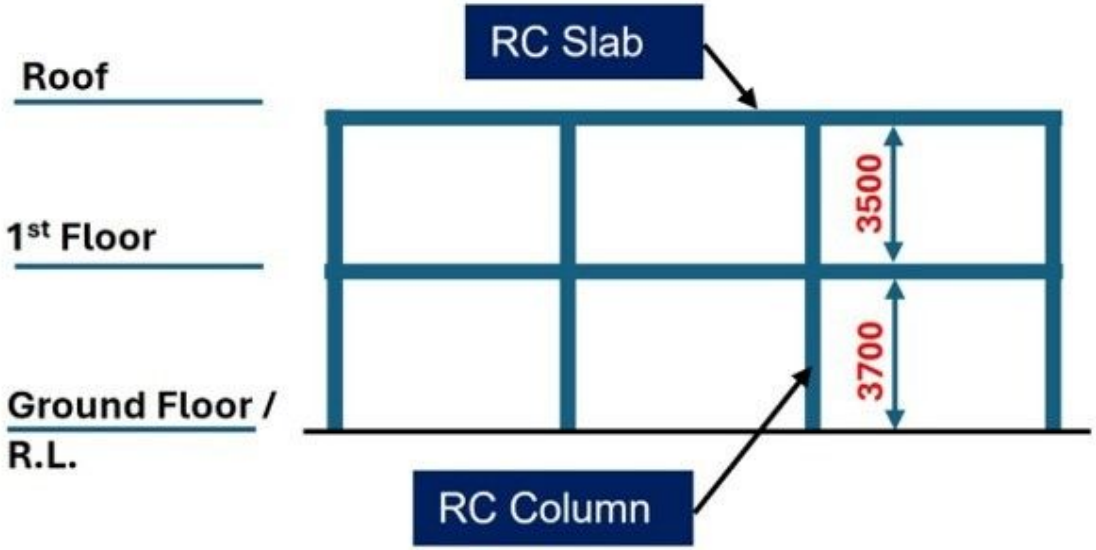

Structural System Notes

Column size is the structural dimension and excludes render thickness
Grid measurements are from centre of column to centre of column
Beam sizes do not include slab depth

Figure 1.24. Typical Section of Building 1

Building	Building 2
Stability system	RC moment resisting frame system, load bearing brick masonry walls supporting T-iron and brick slab
Column size (m)	0.450 x 0.450 (External/Edge) 0.450 Dia (Internal)
Grid (m)	10.55 x 4.55
Primary beam size (m)	0.400 x 0.450
Secondary beam size (m)	-
Slab depth (m)	0.150 (Assumed)
Finishes depth (m)	0.100 (Assumed)
Ceiling height (m)	G to 1st Floor = 3.6 1st Floor to Roof = 4.3 max.


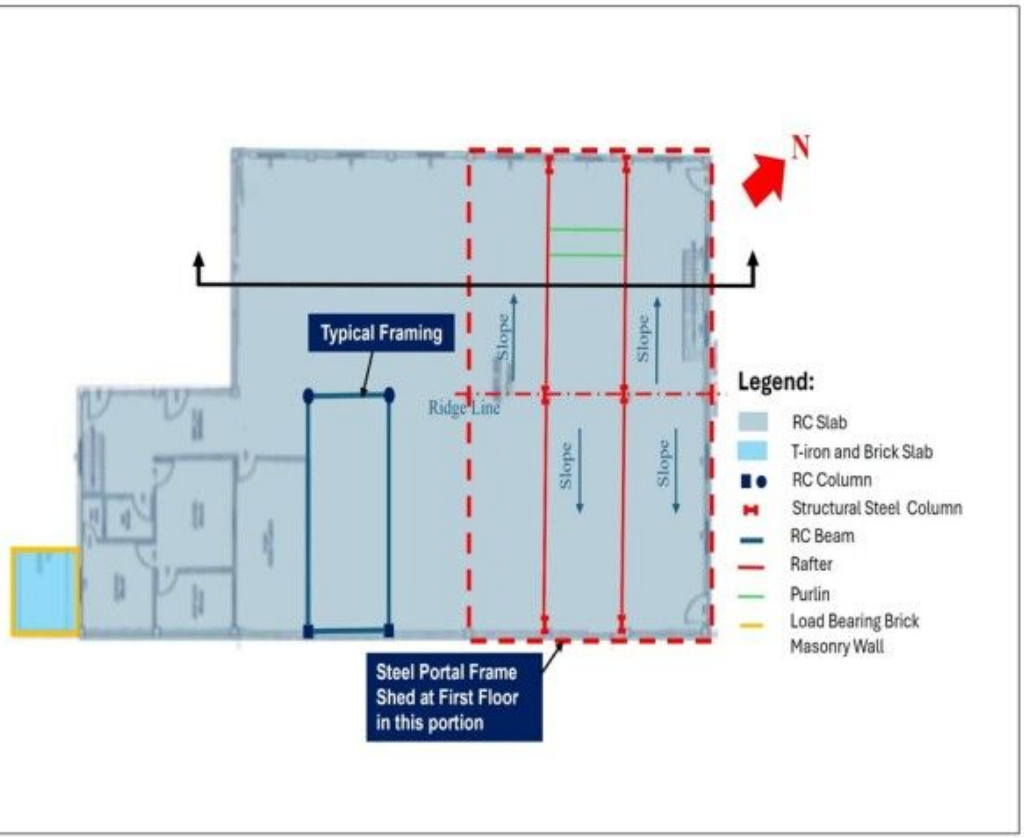


Figure 1.25. Typical Floor Framing Plan of Building 2

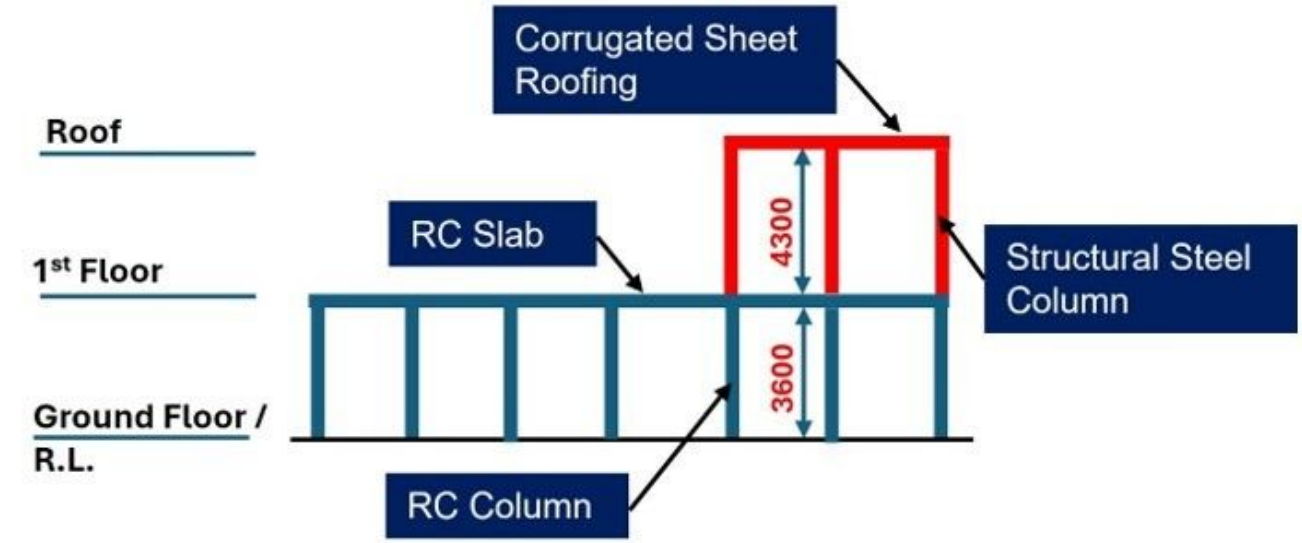

Structural System Notes

Column size is the structural dimension and excludes render thickness
Grid measurements are from centre of column to centre of column
Beam sizes do not include slab depth

Figure 1.26. Typical Section of Building 2

3. Documentation

This table outlines the documentation details provided by the factory.

Table 2 – Documentation

Building		Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plans	Stability certificate	Inspection reports	Materials testing
Building 1		Yes	No	No	No	No	No	Yes	No	No
Building 2		Yes	No	No	No	No	No	Yes	No	No
Building 3		Yes	No	No	No	No	No	Yes	No	No
Ancillary Structure	Office Block	Yes	No	No	No	No	No	Yes	No	No
	Toilet Block	Yes	No	No	No	No	No	Yes	No	No
	Utilities	Yes	No	No	No	No	No	Yes	No	No
	Mechanical Room	Yes	No	No	No	No	No	Yes	No	No

4. Structural Safety Measures

During our structural site inspection of Smart Apparel (Pvt.) Ltd., a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within Smart Apparel (Pvt.) Ltd.. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3 Summary of issues by building:

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Building 1	-	-	-	-	Corrosion of Reinforcement	Documentation Unavailable Lack of safe Load Plans
Building 2	-	-	Wall	-	Corrosion of Reinforcement Health and Safety – Inadequate Edge Protection	Documentation Unavailable Lack of safe Load Plans

Building 3		-	-	-	-	-	Documentation Unavailable
Ancillary Structure	Office Block	-	-	-	-	-	Documentation Unavailable
	Toilet Block	-	-	-	-	-	Documentation Unavailable
	Utilities	-	-	-	-	-	Documentation Unavailable
	Mechanical Room	-	-	-	-	-	Documentation Unavailable

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-065692

Timeline	Remediation Plan
Medium Term CAP-0078024	Factories should begin remediation of CAP items such as surface cracks or non-structural repairs using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Cracking

6.1 Walls

This refers to the Building 2.
Cracks were observed in the load bearing brick masonry wall on the ground floor level. This may be due to the differential settlement of underneath soil, absence of lintel beam over wall opening and insufficient wall thickness to withstand the slab load. F-202604-065695

Timeline	Remediation Plan
Medium Term CAP-0078046	Building Engineer to inspect the wall and investigate the cause of cracking.
Medium Term CAP-0078047	Propose measures to prevent further damage and to repair the existing damage as required and submit to Pakistan Accord for approval.
Longer Term CAP-0078048	Implement the required remedial work.
Longer Term CAP-0078049	Continue to Monitor further damage.



Figure 2.1 - Location of Wall cracking at Ground floor of Building 2



Figure 2.2 - Wall cracking in Load Bearing Brick masonry wall at Ground floor of Building 2

7. Other Damage/Defects

7.1 Corrosion of reinforcement

The dowel reinforcement of the columns at the first floor level of Building 2 has been significantly affected by atmospheric corrosion. This condition may compromise the structural integrity over time.F-202604-065693

Timeline	Remediation Plan
Medium Term CAP-0078071	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0078072	Implement the required remedial work.

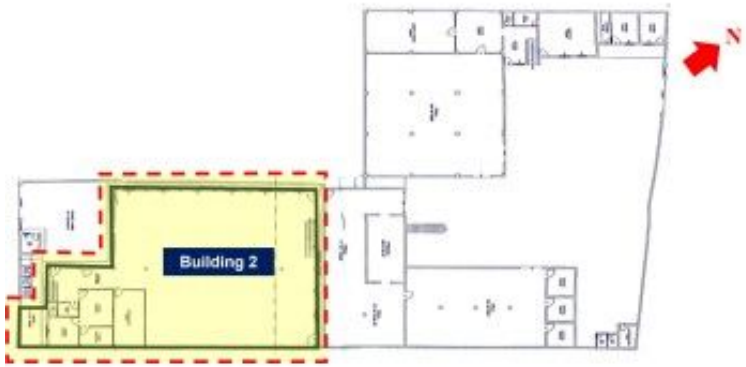


Figure 2.3 - Corrosion of Column Dowel Reinforcement at First Floor Level of Building 2



Figure 2.4 - Corrosion of Column Dowel Reinforcement at First Floor Level of Building 2

7.2 Corrosion of reinforcement

The dowel reinforcement of the column at the roof of Building 1 has been significantly affected by atmospheric corrosion. This condition may compromise the structural integrity over time. F-202604-065694

Timeline	Remediation Plan
Medium Term CAP-0078066	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0078067	Implement the required remedial work.



Figure 2.5 - Corrosion of dowel reinforcement at roof of Building 1



Figure 2.6 - Corrosion of dowel reinforcement at roof of Building 1

7.3 Health and Safety

This refers to the Building 2.
Inadequate edge protection is provided at the first-floor level of Building 2 which presents a risk of potential injury resulting from slip, trip or fall from the roof while accessing and maintaining services on the first-floor level. This is a Health and Safety Concern. F-202604-065703

Timeline	Remediation Plan
Immediate CAP-0078085	Provide adequate edge protection on the roof, and on any other part of the factory with the same issue.



Figure 2.7 - Inadequate Edge protection location at first floor level of Building 2



Figure 2.8 - Inadequate Edge protection at first floor level of Building 2

8. Structural Documentation

8.1 Documentation unavailable

Following documents were unavailable:

- As-Built Architectural drawings of all the buildings (Main buildings and ancillary structures).
- Structural Drawings of all the buildings (Main buildings and ancillary structures). F-202604-065696

Timeline	Remediation Plan
Longer Term CAP-0078034	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete As-built documentation.

8.2 Lack of safe load plans

No safe load plans were posted in Building 1 and Building 2 of the factory. F-202604-065697

Timeline	Remediation Plan
Longer Term CAP-0078030	Building Structural Engineer to review design documentation to confirm the load capacity of the structure.
Longer Term CAP-0078031	Develop safe load plans and submit to Pakistan Accord for review.
Longer Term CAP-0078032	Factory to post safe load plans on each floor.

9. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.