Issue	**1**
Factory ID	**25514**
Date of Issue	**18-Jun-2026**

TAJ Industries

B/12-C, S.I.T.E.
75700 Karachi
Sindh Pakistan

Latitude: [24.910152], longitude: [67.012005]
Date of inspection: 14-Apr-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Fraz Hayder**
Reviewed by	**Shehroz Javed**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 14-04-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 10
   - 3.1 Building Means of Egress Details 11
   - 3.2 Building Use 12
4. Documentation 13
5. Fire Safety Measures 14
6. Remediation Support 15
   - 6.1 Engineering Support 15
7. Means of Escape 16
   - 7.1 Escape doors 16
   - 7.2 Exit access 18
   - 7.3 Number of exits 21
   - 7.4 Protection of stairs 22
   - 7.5 Escape stair condition 25
   - 7.6 Exit discharge 27
   - 7.7 Exit signage 29
8. Fire Rated Construction 31
   - 8.1 Structural fire rating 31
   - 8.2 Separation of high-risk areas 33
   - 8.3 Separation of shafts 35
   - 8.4 Floor openings 37

8.5 Separation of occupancies 39
8.6 Separation of occupancies 41
8.7 Storage 43
9. Fire Suppression 45
9.1 Sprinkler system 45
9.2 Standpipe system 47
9.3 Fire pumps 49
9.4 Fire extinguishers 51
10. Hazardous Materials 53
10.1 Chemicals storage 53
11. Fire Safety Management 55
11.1 Fire drills 55
11.2 Records of system testing 56
11.3 Records of systems maintenance 57
11.4 Emergency Action Plan 58
12. Assessment Limitations and Assumptions 59

1. Executive Summary

On 14-Apr-2026, Fraz Hayder, Waqar Sami and Muzammil Aslam on behalf of the Pakistan Accord carried out an initial fire inspection for TAJ Industries, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Zeeshan (HR and Compliance Lead from factory side) along with other staff members of Taj Industries. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Accord were present.
The factory operates in one shift for all departments. Approximately 250 workers operate in the factory with 05 workers being females.
The factory comprises one building owned by TAJ Industries, During the inspection, the buildings highlighted in Figure 1.1 were inspected, with the site boundary indicated in red.
Main Building: A 7-storey building (Ground+ Mezzanine + 5) with a covered area (footprint) of 6,457 sq. m and a height of 22.45 m, measured from the fire department vehicle access level to the topmost occupied floor. The mezzanine floor does not comply with Fire Safety provisions under the Pakistan Accord Building Standard and is therefore classified as a full floor. The building has 5 staircases, 3 of which discharge internally. The building is used for multiple functions, including compressor and livestock storage (Roof), warehouse (5th floor), cut to pack (4th floor), stitching, packing and checking (3rd floor), stitching, packing and checking (2nd floor), offices, cutting, bundling, sampling and prayer areas (1st floor), offices, accessories store, parking, canteen and record room (Mezzanine floor),fabric inspection, warehouse, generator room, canteen and parking areas, Allied Bank (Ground floor).

A portion at mezzanine and ground floor level is rented by Allied bank Limited, Access to these areas was restricted; detailed data recording was not permitted, and only a brief walkthrough by a single person was allowed.

We have been provided with site layout plan of each plot, civil defense certificate, Fire Drill, Inspection checklist of Fire pump and hydrant system. Further details on documentation are provided in Table 1.
A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Lockable mechanisms observed in escape route at multiple floors.
- Storage and production areas not separated with fire-rated construction.
- Stairs are not protected to contain fire and smoke spread.
- Lift shaft is not fire separated from rest of the building.
- There is no fire separation between stairs and the rest of the building.
- Non-compliant standpipe system installed in the building.
- Existing Fire pump set comprise of non-listed product.

- Sleeping arrangement was found on the mezzanine floor in canteen area.
- Building is not protected by Automatic Sprinkler System.

We see no reason to suspend operations in the facility due to these concerns. Actions with associated priorities and timeframes are given in the detailed section of this report. within the timeframe noted.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents



Figure 1.1. Site plan (Satellite view) - Red dashed line indicates site boundary, highlighted (blue) area indicated area inspected

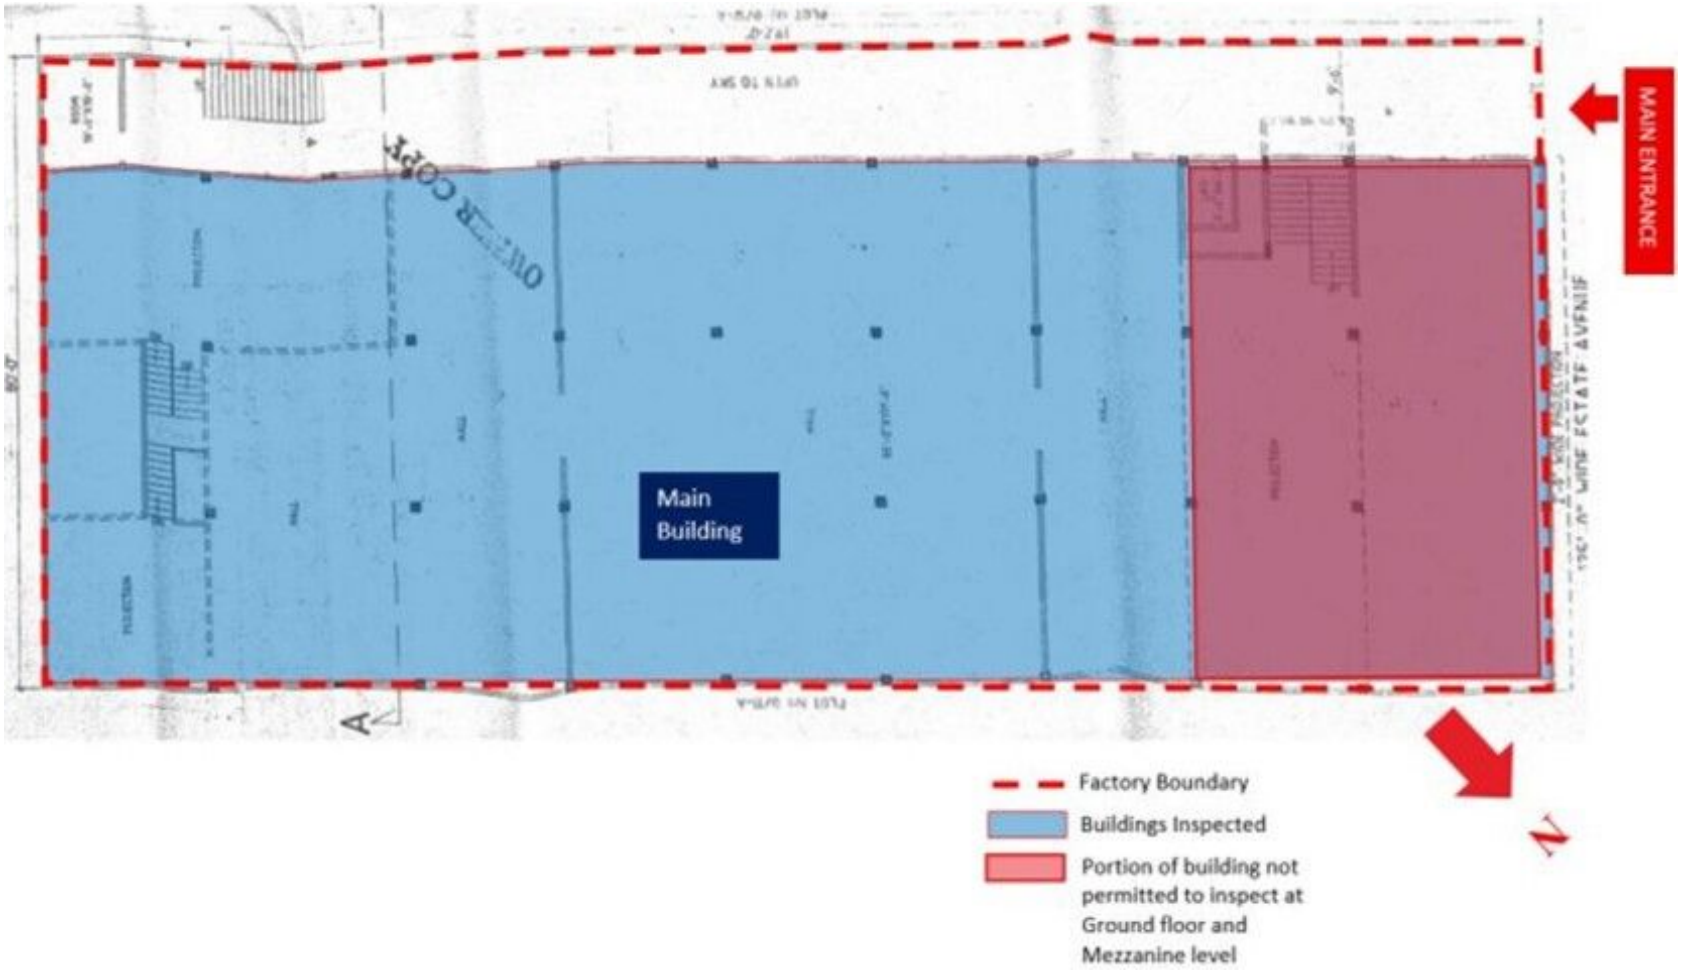


Figure 1.2. Site layout. Red dashed line indicates site boundary, highlighted area (blue) indicates buildings inspected.

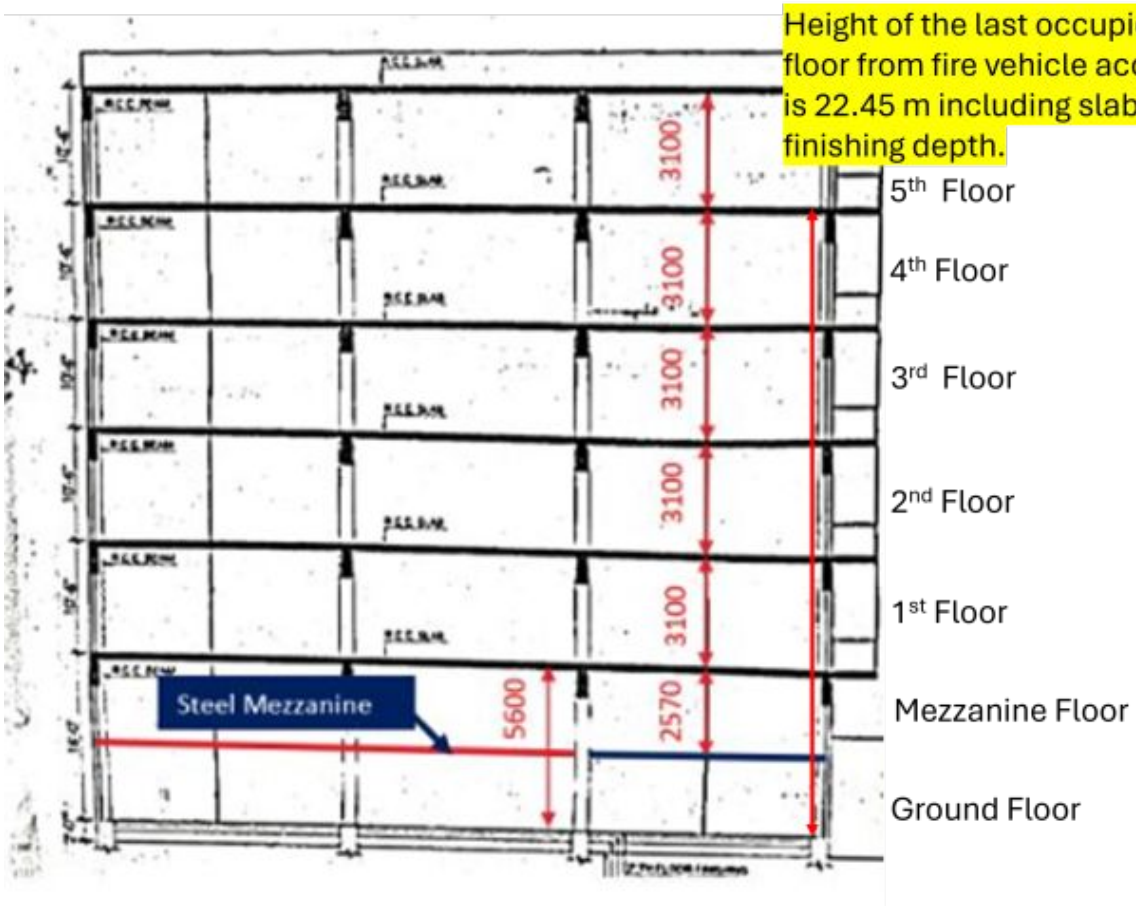


Figure 1.3. Typical cross-section

3. Building Description

Main Building: A 7-storey building (Ground+ Mezzanine + 5) with a covered area (footprint) of 6,457 sq. m and a height of 22.45 m, measured from the fire department vehicle access level to the topmost occupied floor. The mezzanine floor does not comply with Fire Safety provisions under the Pakistan Accord Building Standard and is therefore classified as a full floor. The building has 5 staircases, 3 of which discharge internally. The building is used for multiple functions, including compressor and livestock storage (Roof), warehouse (5th floor), cut to pack (4th floor), stitching, packing and checking (3rd floor), stitching, packing and checking (2nd floor), offices, cutting, bundling, sampling and prayer areas (1st floor), offices, accessories store, parking, canteen and record room (Mezzanine floor),fabric inspection, warehouse, generator room, canteen and parking areas, Allied Bank (Ground floor).

3.1 Building Means of Egress Details

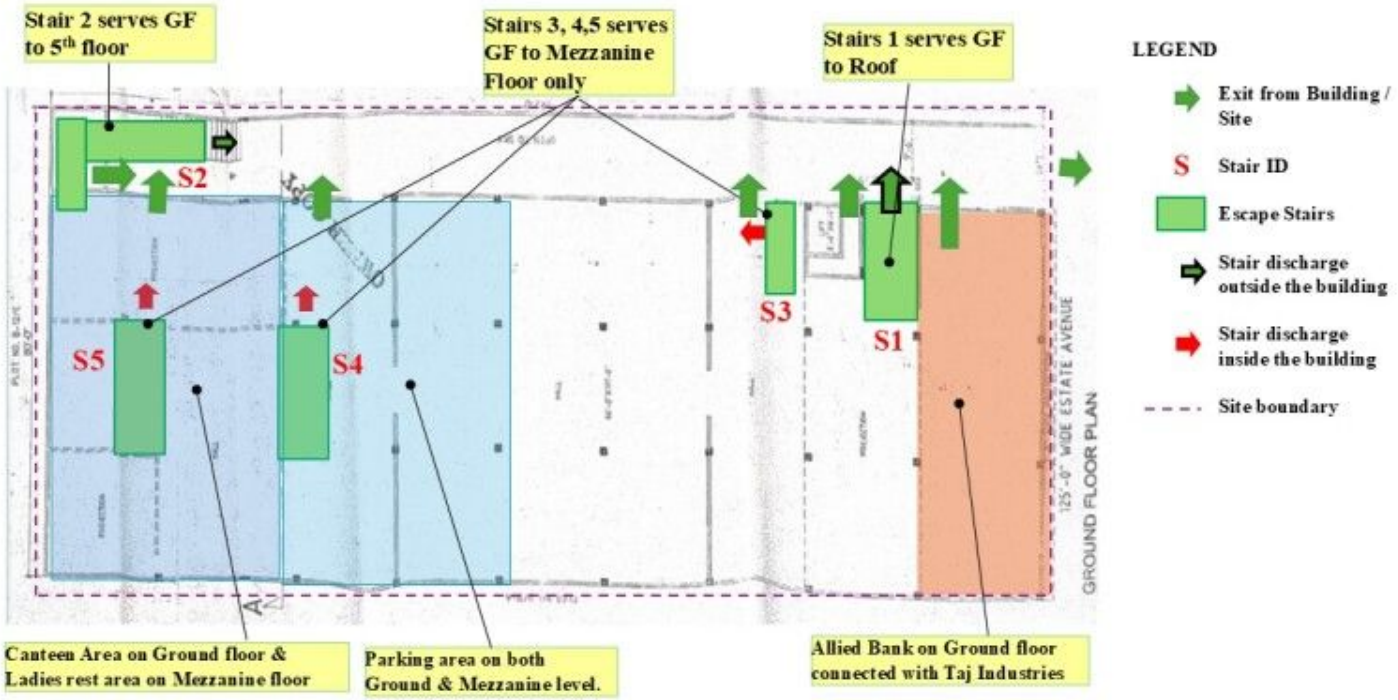


Figure 1.4. Means of egress layout

3.2 Building Use

2.1 Table 1.1 Building Descriptions

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Ground Floor	Fabric inspection, warehouse, generator room, canteen and parking areas	60	6	-	-	-
Mezzanine Floor	Offices, accessories store	10	2	-	-	-
	Parking	10	2			
	Canteen and record room	40	1	-	-	-
1st Floor	Offices, cutting, bundling, sampling and prayer areas	60	2	-	-	-
2nd Floor	Stitching, packing and checking	90	2	-	-	-
3rd Floor	Stitching, packing and checking	90	2	-	-	-
4th Floor	Cut to pack	50	2	-	-	-
5th Floor	Warehouse	30	2	-	-	-
Roof Floor	compressor and livestock storage	5	1	-	-	-

There is insufficient number of exits found in buildings at Roof floor and Mezzanine floor canteen area. No excessive travel distance issue was observed in Main Building.

4. Documentation

Table 1.2 Documentation

No.	Description	Availability Yes/No	Created/Updated Date	Status/Remarks
1	Layouts	Yes	-	-
2	Section Layouts	No		-
3	Civil Defence Certificate	Yes	10-02-2026	-
4	Emergency Action Plan	No		-
5	Fire Drill	Yes	09-02-2026	Not as per Pakistan Accord Building Standard
	Inspection of Fire pump and hydrant system	Yes	-	Not as per Pakistan Accord Building Standard
6	Inspection of Fire Extinguishers	No	-	
8	Maintenance	No	-	-
9	Evacuation Maps	Yes	-	-
10	Staff Training	Yes	01-01-2026 09-02-2026	Firefighting / First Aid training Firefighting & First Aid training As per Pakistan Accord Building Standard

5. Fire Safety Measures

During our fire site inspection of TAJ Industries, a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within TAJ Industries. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support F-202604-065769

Timeline	Remediation Plan
Immediate CAP-0078197	Factories should begin remediation of CAP items such as installing extinguishers, signage, and clearing escape routes using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Final exit doors from site serving areas with more than 50 occupants shall swing in the direction of escape.

This is not always achieved, examples include (list not exhaustive):
- Escape doors are lockable e.g. Parking and kitchen area and main gate at ground floor, 5th and 4th floor and top floor near S1.
-Site exit door swing against the direction of escape at ground floor.

Recommended remedial actions are provided below.F-202604-065456

Timeline	Remediation Plan
Immediate CAP-0077827	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0077828	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5.
Longer Term CAP-0077829	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Site exit door swing against the direction of escape at ground floor.



Figure 2.3 - Escape doors are lockable at 5th floor



Figure 2.2 - Escape doors are lockable at ground floor



Figure 2.4 - Escape doors are lockable at ground floor

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Headroom along escape route should be more than 2.05m.

This is not always achieved, examples include (list not exhaustive):
- Trip hazards on escape route e.g. 5th and 4th floor near steam generator area.
- Insufficient headroom along escape route e.g. 1.6 m at mezzanine floor record room.
- Stair discharges inside the building at a distance from building exit e.g. S3, S4 and S5.

Recommended remedial actions are provided below.F-202604-065484

Timeline	Remediation Plan
Immediate CAP-0077835	Remove trip hazards on escape routes and keep them clear for escape. Provide warning signs where headroom height is less than 2.05 m on escape routes. Install Smart Padding at locations with headroom clearance below 2.05 m.
Medium Term CAP-0077836	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks) Propose modifications to ensure 2.05m headroom height is achieved along the escape routes or propose alternative egress routes that comply. Submit the proposal to Pakistan Accord for review.

Longer Term CAP-0077837	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted. Implement measures to ensure adequate clear head height is achieved along all escape routes.



Figure 2.5 - Trip hazard on escape route at 4th floor



Figure 2.6 - Insufficient headroom along escape route mezzanine floor record room.

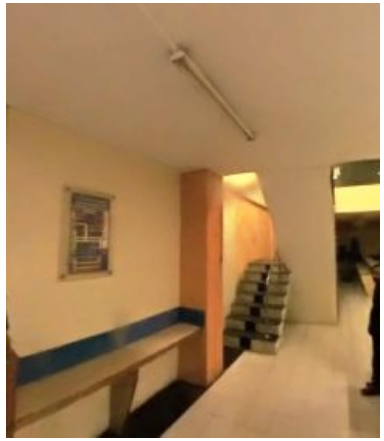


Figure 2.7 - Stair S5 discharges inside the building

7.3 Number of exits

Per Pakistan Accord Standard, the exit provisions should meet the following:
- Minimum 2 exits from every occupied floor.

This is not always achieved, examples include (list not exhaustive):
- Single exit from some of the occupied floors e.g. mezzanine floor record room, top floor.
- There is only a single exit from site and there is a risk it may not be available in the event of fire in the building at ground floor.

Recommended remedial actions are provided below.F-202604-065455

Timeline	Remediation Plan
Medium Term CAP-0077825	Review each floor and area to ensure that the number of exits complies with Pakistan Accord Standard. Develop plan and drawings to provide additional exits where necessary. Submit the plan and drawings to Pakistan Accord for review and approval prior to commencing rectification works.
Longer Term CAP-0077826	Implement the above plan as agreed with Pakistan Accord. Number of exits from all floors and parts of the building should comply with Pakistan Accord Standard.

7.4 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- Stair discharge routes should be protected to the same level of safety as the stair.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings into stairs e.g. S2 at all levels
- Unprotected penetrations into stairs e.g. S1 and S2 at 4th floor.
- Missing fire rated enclosure and fire doors in all stairs.
- Doors are not fire doors at all stairs.
- Fire load in stairs e.g. S1 top floor and ground floor.
- Services passing through or within stairs e.g. S1

Recommended remedial actions are provided below.F-202604-065485

Timeline	Remediation Plan
Immediate CAP-0078027	Remove fire load and any other obstructions due to stored items from stairs
Medium Term CAP-0078028	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.
Longer Term CAP-0078029	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.8 - Fire load Storage room found in Stairs S1 top floor



Figure 2.10 - Services passing through or within stairs S1.



Figure 2.9 - Unprotected openings into stairs e.g. S2



Figure 2.11 - Services passing through or within stairs S1



Figure 2.12 - Fire load at S1 ground floor

7.5 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.
This is not always achieved, examples include (list not exhaustive):
- There are no handrails on one side of stair e.g. S1 and S4 at ground floor.
- Trip hazards in stairs due to large height of step of mezzanine floor step in S1.

Recommended remedial actions are provided below.F-202604-065486

Timeline	Remediation Plan
Immediate CAP-0078069	Remove all trip hazards from stairs.
Medium Term CAP-0078068	Ensure the following are provided: - Stair structure to be properly fixed so that stairs are safe for escape. - Ensure all stairs have balustrades. - Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height.



Figure 2.13 - No handrails on one side of stair S1 at ground floor.



Figure 2.14 - No handrail on one side of S4



Figure 2.15 - Trip hazards in stairs due to large height of step of mezzanine floor step in S1

7.6 Exit discharge

Exit discharge routes outside the building should be sufficiently protected so that people can escape safely in the event of fire anywhere in the building. This includes:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.
- Where there is no safe assembly point on site, the final egress routes from site should be sufficiently wide and open in the direction of escape to enable escape to public way. Exits from site should be arranged so that a single fire event will not compromise all site exits.

This is not always achieved, examples include (list not exhaustive):
- Stair discharge routes are not fire separated from the rest of the building e.g. S5 .

Recommended remedial actions are provided below.F-202604-065488

Timeline	Remediation Plan
Medium Term CAP-0078114	Prepare drawings showing proposed fire separating construction to exit discharge routes. These shall be submitted to Accord for review and approval prior to commencing rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge routes - Details of proposed fire resisting walls and fire door assemblies required to protect discharge routes.
Longer Term CAP-0078115	- Ensure external exit discharge routes are adequately fire separated from the rest of the building. - Ensure external escape routes do not pass close to unprotected high risk areas.



Figure 2.16 - Stair discharge routes are not fire separated from the rest of the building S1

7.7 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at stair discharge routes e.g. S3 to S5.
- Missing exit signs in production areas at all floors.
- Missing exit signs in offices e.g. first floor and mezzanine floor.
- Electrically powered exit signs are not a tested and listed system.
- Exit sign found faulty at ground floor kitchen area.

Recommended remedial actions are provided below.F-202604-065489

Timeline	Remediation Plan
Medium Term CAP-0078124	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0078125	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.17 - Exit sign found faulty at ground floor kitchen area



Figure 2.19 - Missing exit sign at mezzanine floor.



Figure 2.18 - Missing exit signs in production areas 2nd floor



Figure 2.20 - Missing exit sign at exit discharge route S4

8. Fire Rated Construction

8.1 Structural fire rating

Structural fire rating of buildings must meet the requirements of Pakistan Accord Standard, which requires that non-sprinklered buildings are provided with structural fire protection if the floor is occupied. Where a building does not meet these conditions, fire protection of the structural steelwork and/or sprinkler protection are required.
Mezzanine levels generally do not need to be structurally fire rated if they are less than 1/3 of the adjacent floor area. Mezzanines that are more than 1/3 of the adjacent floor area they serve should be treated as any other floor. Mezzanine levels containing heavy machinery should be have a fire rated structure irrespectively of the mezzanine size.
The following deficiencies have been observed on site, including (list not exhaustive):
- Mezzanine floor occupies more than 1/3 floor area with no fire protection to the supporting structure e.g. mezzanine floor above car parking ground floor.
- Heavily loaded mezzanine with no fire protection to supporting structure at car parking area ground floor
Recommended remedial actions are provided below.F-202604-065426

Timeline	Remediation Plan
Medium Term CAP-0077540	Factory consultant to identify level of fire protection needed for the structure based on the building height, area, provision of sprinklers and frontage space around the building, in accordance with Pakistan Accord Standard and reference to NFPA 5000 Section 7.6.2. Submit proposal for level of fire protection required and methods for achieving it to Pakistan Accord for review.
Longer Term CAP-0077541	Implement the proposal for addressing the fire protection of the structure based on proposal reviewed previously, and in accordance with Pakistan Accord Standard.



Figure 2.21 - Mezzanine floor occupies more than 1/3 floor area with no fire protection to the supporting structure



Figure 2.22 - Heavily loaded mezzanine with no fire protection to supporting structure

8.2 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2 hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Fire pump room is not fire separated from the rest of the building at ground floor
- Electrical rooms are not fire separated from Storage Block and lift shaft at ground floor
- Generator room is not fire separated with kitchen and S2 at ground floor
- Gas steam generator is not fire separated with production area at 4th and 5th floor.

Recommended remedial actions are provided below.F-202604-065423

Timeline	Remediation Plan
Medium Term CAP-0077531	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0077532	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.23 - Gas steam generator is not fire separated with production area at 4th floor



Figure 2.24 - Fire pump room is not fire separated from the rest of the building at ground floor



Figure 2.25 - Generator room is not fire separated with kitchen area and S2



Figure 2.26 - Electrical rooms are not fire separated from lift

8.3 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.
The following deficiencies have been observed on site, including (list not exhaustive):
- Lift shafts are not separated with fire rated construction at all floors
Recommended remedial actions are provided below.F-202604-065422

Timeline	Remediation Plan
Medium Term CAP-0077524	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction).
Longer Term CAP-0077525	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.27 - Lift shafts are not separated with fire rated construction

8.4 Floor openings

Per Pakistan Accord Standard, each floor should be fire separated using 2 hours fire resisting construction with 90 minutes fire rated door/shutter assemblies.
The following deficiencies have been observed on site, including (list not exhaustive):
- Open voids connecting different levels e.g. Stairs S1, S4 and ramp of car parking.
Recommended remedial actions are provided below.F-202604-065424

Timeline	Remediation Plan
Medium Term CAP-0077535	Prepare a plan and drawings showing the proposed fire separation details. These shall be submitted to Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of floor openings. - Proposed fire separation details (including fire rating of walls and doors).
Longer Term CAP-0077536	Provide fire rated separation between floors by implementing the plan reviewed previously by Pakistan Accord.



Figure 2.28 - Opening connecting different levels at S1



Figure 2.29 - Openings connecting mezzanine to ground from ramp of car parking

8.5 Separation of occupancies

Pakistan Accord Standard requires different occupancy types to be fire separated from each other. The aim is to limit the fire to only one occupancy type.
The following deficiencies have been observed on site, including (list not exhaustive):
- Canteen is not fire separated from car parking area and generator area at ground floor and mezzanine floor
- Large office areas not fire separated from the production areas at first floor.
- Prayer areas with above 50 occupants is not fire separated from the office area at first floor.
- Mezzanine is not fire separated with other floors.
- Factory is not fire separated with bank at ground floor.

Recommended remedial actions are provided below.F-202604-065425

Timeline	Remediation Plan
Medium Term CAP-0077537	Prepare a plan and drawings showing showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Different occupancy types in the building - Proposed fire separation details (including fire rating of walls and doors).
Longer Term CAP-0077538	Provide fire rated separation between occupancies as per proposal reviewed by Pakistan Accord.



Figure 2.30 - office area is not fire separated with production at first floor



Figure 2.31 - Canteen is not fire separated from car parking area and generator area



Figure 2.32 - Prayer areas with above 50 occupants is not fire separated from office area at first floor

8.6 Separation of occupancies

Sleeping area in mezzanine floor above kitchen should comply with special measures required for sleeping occupancies. Such measures include:
- Fire separation of dormitories from other occupancies
- Providing a minimum of 2 escape routes from the above ground levels
- Providing an automatic fire detection and alarm system
- Fire separation of cooking facilities/kitchens from the remainder of the dormitory

The following deficiencies have been observed on site, including canteen area mezzanine floor:
- No adequate automatic fire detection and alarm system.
- Above ground levels lack an alternative escape route.
- Car parking area not adequately fire separated.
- Lack of fire rated separation between the dormitory and other occupancy types.

Recommended remedial actions are provided below.F-202604-065428

Timeline	Remediation Plan
Immediate CAP-0077739	The dormitory is not to be used until minimum requirements for sleeping occupancies have been provided. Alternative arrangements must be sought immediately for the dormitory as continuing the use of the building for this purpose is not appropriate. Dormitory not to be re-occupied until the minimum requirements have been implemented.
Medium Term CAP-0077740	Document proposals for design of remedial measures to ensure compliance with all fire safety requirements for sleeping occupancies to comply with Pakistan Accord Standard. Submit proposals to Pakistan Accord for review.
Longer Term CAP-0077741	Implement remediation measures to ensure full compliance with dormitory requirements of Pakistan Accord Standard and Pakistan Building Code in accordance with previously reviewed design.



Figure 2.33 - Sleeping area in mezzanine floor above kitchen

8.7 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.
Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area.
- Storage height is less than 2.45m.
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building at 4th and 5th floor.
- Presence of areas where storage does not meet miscellaneous in-process storage requirements e.g. at 1st floor and 2nd floor.

Recommended remedial actions are provided below.F-202604-065427

Timeline	Remediation Plan
Medium Term CAP-0077542	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction).
Longer Term CAP-0077543	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard



Figure 2.34 - Storage does not meet miscellaneous in-process storage requirements at 1st floor



Figure 2.35 - Storage areas are not fire separated from the rest of the building at 4th floor



Figure 2.36 - Storage areas are not fire separated from the rest of the building at 5th floor

9. Fire Suppression

9.1 Sprinkler system

Per Pakistan Accord Standard, a fire sprinkler system is required in buildings exceeding 18 m in height when measured from the fire department vehicle access level to the highest occupied floor. The system should be designed and installed in accordance with NFPA 13.
The following deficiencies have been observed on site, including (list not exhaustive):
- Sprinkler system is not provided in the main building.
Recommended remedial actions are provided below.F-202604-065434

Timeline	Remediation Plan
Medium Term CAP-0077753	(1) Submit design documentation for the required standpipe system and supporting infrastructure to Pakistan Accord for review before purchasing any new equipment. Design documentation to include drawings, technical data sheets and product certifications of all listed equipment to show full compliance of the system with NFPA 14, 20, 22, and 24.
Medium Term CAP-0077754	(2) Submit documentation to Pakistan Accord showing that an L/C has been opened for import of any components required for the system design submitted earlier.
Longer Term CAP-0077755	(3) Submit documentation to Pakistan Accord demonstrating that all materials, both imported and locally procured, have been purchased and are available on site for installation of the system.
Longer Term CAP-0077756	(4) Once installation of the system is complete, factory to submit full "as-built" documentation of the system to Pakistan Accord for review.
Longer Term CAP-0077757	(5) Factory to advise Pakistan Accord when system installation is fully completed and the system is fully functional. Pakistan Accord will then arrange a verification inspection to ensure that the installation fully complies with the previously reviewed design documentation
Longer Term CAP-0077758	(6) Provide full testing and commissioning (T&C) certification from the system installer and make provision for attendance of the system installer, factory technical personnel and Pakistan Accord technical team to witness a final T&C demonstration verification on site. On successful completion of this T&C verification inspection, remediation of the system will be complete

9.2 Standpipe system

Per Pakistan Accord Standard a Class-I standpipe systems is required in the building. The system should be designed and installed in accordance with NFPA 14. Building requires standpipe system due to height of the topmost occupied floor exceeding 15m, the number of stories exceeding 3 with a fire floor area exceeding 1440 sq m.
The following deficiencies have been observed on site, including (list not exhaustive):
- Standpipe system comprise of non-listed products
- Connection points are not compliant
- Missing standpipe outlets in stairs
- Pressure / flow is not adequate

Recommended remedial actions are provided below.F-202604-065770

Timeline	Remediation Plan
Longer Term CAP-0078200	Provide a Class 1 standpipe system with adequate risers and connections, in accordance with NFPA 14 as part of the supporting infrastructure to the SUPS system by following the steps (1) to (6) above.



Figure 2.37 - Standpipe system comprise of non-listed products

9.3 Fire pumps

Per Pakistan Accord Standard, a complete fire pump set is required. The pump set should be designed and installed in accordance with NFPA 20. The system should comprise of a) Electric pump (Main), b) Diesel Pump (Back-Up), and c) Jockey Pump. Each pump should be provided with individual drivers and controllers. Pumps shall be installed with positive suction. These measures are intended to provide a level of resilience whereby a failure of a pump or lack of power in the building will not compromise fire water supply in the building.
The following deficiencies have been observed on site, including (list not exhaustive):
- Fire pump set is not listed
- There is no diesel pump
- Fire pumps are not in a fire separated room
- Fire pumps are exposed to the weather conditions
- Fire pumps installed with negative suction arrangement

Recommended remedial actions are provided below.F-202604-065437

Timeline	Remediation Plan
Longer Term CAP-0077816	Provide electric duty pump, diesel backup fire pumps and jockey pumps, together with individual drivers and controllers, in accordance with NFPA 20 as part of the supporting infrastructure to the SUPS system by following the steps (1) to (6) above.



Figure 2.38 - Non listed fire pump without diesel pump installed in open environment at ground floor

9.4 Fire extinguishers

Extinguisher coverage and type of extinguishers used should comply with NFPA 10.
The following deficiencies have been observed on site, including (list not exhaustive):
- Insufficient coverage of fire extinguishers.
- No extinguisher in record room area e.g. mezzanine floor
- Poor condition of fire extinguishers found e.g. seals missing and empty fire extinguisher at 4th and 3rd floor.

Recommended remedial actions are provided below.F-202604-065446

Timeline	Remediation Plan
Medium Term CAP-0077823	Ensure that all building areas are protected using fire extinguishers. The coverage and type of extinguishers used should follow NFPA 10.
Longer Term CAP-0077824	Monitor fire extinguishers for coverage and extinguisher type to comply with NFPA 10.



Figure 2.39 - Seal of fire extinguisher found missing at 4th floor



Figure 2.40 - No fire extinguisher in record room mezzanine floor



Figure 2.41 - Empty fire extinguisher found at ground floor

10. Hazardous Materials

10.1 Chemicals storage

Chemical handling procedures should follow the best international practice.

The following deficiencies have been observed on site, including (list not exhaustive):
- Chemicals found in production areas e.g. 3rd floor
- Inadequate ventilation of areas with chemical handling e.g. 3rd floor

Recommended remedial actions are provided below.F-202604-065448

Timeline	Remediation Plan
Medium Term CAP-0077519	Factory to collect MSDS sheets for all chemicals stored, classify materials, and propose storage arrangements to meet NFPA 30 requirements. Prepare drawings showing the proposed chemical storage areas. These shall be submitted to Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all chemical storage areas - Locations of fire rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction) - Ventilation provisions to each of these rooms"
Longer Term CAP-0077520	Implement the above plan on site. All chemical storage areas to be compliant with Pakistan Accord Standard.



Figure 2.42 - Chemicals in production areas at 3rd floor

11. Fire Safety Management

11.1 Fire drills

Per Pakistan Accord Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained and suitable provisions are in place to enable timely evacuation in the event of an emergency.
The following deficiencies have been observed on site, including (list not exhaustive):
- Fire drill documentation is of poor standard
Recommended remedial actions are provided below.F-202604-065432

Timeline	Remediation Plan
Medium Term CAP-0077516	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term CAP-0077517	Ensure fire drills are performed a minimum 2 times per year.

11.2 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire extinguishers to NFPA 10 etc.
The following deficiencies have been observed on site, including (list not exhaustive):
- Inadequate records of testing of Fire Pumps.
- Inadequate records of testing of Standpipes.
- No records of testing of Fire Extinguishers.
- No records of testing of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202604-065431

Timeline	Remediation Plan
Medium Term CAP-0077508	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule to be submitted to Accord for review and approval.
Longer Term CAP-0077509	- Ensure all systems are being tested as per the schedule agreed with Accord . - Keep testing records."

11.3 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire suppression systems to NFPA 25, fire extinguishers to NFPA 10 etc.
- No records of maintenance of Fire Pumps
- No records of maintenance of Standpipes
- No records of maintenance of Fire Extinguishers.
- No records of maintenance of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202604-065430

Timeline	Remediation Plan
Medium Term CAP-0077500	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule to be submitted to Accord for review and approval.
Longer Term CAP-0077501	- Ensure all systems are being maintained as per the schedule agreed with Accord . - Keep maintenance records.

11.4 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023. Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid fire fighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.
The following deficiencies have been observed on site, including (list not exhaustive):
- No EAP document found which details procedures, roles and responsibilities in the event of fire.
Recommended remedial actions are provided below.F-202604-065429

Timeline	Remediation Plan
Medium Term CAP-0077819	Ensure that evacuation plans are provided on each level. Prepare an Emergency Action Plan report.
Longer Term CAP-0077820	Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

12. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.