Issue	**1**
Factory ID	**25514**
Date of Issue	**18-Jun-2026**

TAJ Industries

B/12-C, S.I.T.E.
75700 Karachi
Sindh Pakistan

Latitude: [24.910152], longitude: [67.012005]
Date of inspection: 14-Apr-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Muhammad Hasaan Tabassum**
Reviewed by	**Owais Raza**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 14-04-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 4
2. Building Extents 6
   2.1 Structural System 12
3. Documentation 15
4. Structural Safety Measures 16
5. Remediation Support 17
   5.1 Engineering Support 17
6. Potential Overstress 18
   6.1 Highly stressed columns 18
7. Structural System 20
   7.1 Connection details 20
8. Other Damage/Defects 22
   8.1 Corrosion of reinforcement 22
   8.2 Spalling concrete 24
9. Structural Documentation 26
   9.1 Documentation unavailable 26
   9.2 Lack of safe load plans 27
10. Assessment Limitations and Assumptions 28

1. Executive Summary

On 14-Apr-2026, Qaseem Uz Zaman Khan and Muhammad Hasaan Tabassum on behalf of the Pakistan Accord carried out an initial structural inspection for TAJ Industries, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Zeeshan (HR and Compliance Manager) and other staff members of TAJ Industries. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Pakistan Accord were present.

The factory operates in one shift for all departments. Approximately 250 workers operate in the factory with 05 workers being females.

The factory comprises of 01 main building owned by TAJ Industries. During the inspection, the building highlighted in Figure 1.1 was surveyed, with the site boundary indicated in red:

- **Main Building:** Seven storey (Ground + 6) building with RC moment resisting frame (RC MRF) with infill masonry panels. The mezzanine floor will be considered as a seperate story (1st floor) in this building and consists of a combination of steel and RC MRF as it covers most of the area of the building. The building is used for compressor and livestock storage (Roof), warehouse (6th floor), cut to pack (5th floor), stitching, packing and checking (4th floor), stitching, packing and checking (3rd floor), offices, prayer area, cutting, bundling and sampling (2nd floor), offices, accessories store, parking, canteen and record room (1st floor) and fabric inspection, warehouse, parking, genset room and canteen (Ground floor). The building was constructed in 1999 and purchased by Taj Industries in 2012.

A portion at 1st and ground floor is occupied by Allied bank Limited as a tenant. Access to these areas was restricted; detailed data recording was not permitted, and only a brief walkthrough by a single person was allowed. During this walkthrough it was observed that the 1st floor area was lightly loaded and ground floor area contains bank operation's offices.

We were only presented with a site approved layout, stability certificate and soil test report (refer to Table 2).

A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows, for details refer to structural issues:

- Columns are highly stressed for the observed loading at ground floor.
- Corrosion of reinforcement is observed at roof.
- Spalling in slab and beam is observed at 5th floor.

- Connection details issue is observed at emergency staircase.

We see no reason to suspend operations in the facility due to these concerns.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1 - Building Summary

Building	Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / Modification	Engineer access issues
Main Building	Compressor and livestock storage (Roof) Warehouse (6th floor) Cut to pack (5th floor) Stitching, packing and checking (4th floor) Stitching, packing and checking (3rd floor) Offices, prayer area, cutting, bundling and sampling (2nd floor) Offices, accessories store, parking, canteen and record room (1st floor) Fabric inspection, warehouse, parking, genset room and canteen (Ground floor)	Seven storeys (Ground + 6)	1999 and purchased by Taj Industries in 2012	RC MRF with infill masonry panels and a comination of RC MRF and Steel MRF at 1st floor	-	-	A portion at 1st and ground floor level is occupied by Allied bank Limited as a tenant, Access to these areas was restricted to record any data.



Figure 1.1. Site plan (Satellite view) – Red dashed line indicates site boundary, highlighted area (blue) indicates building inspected

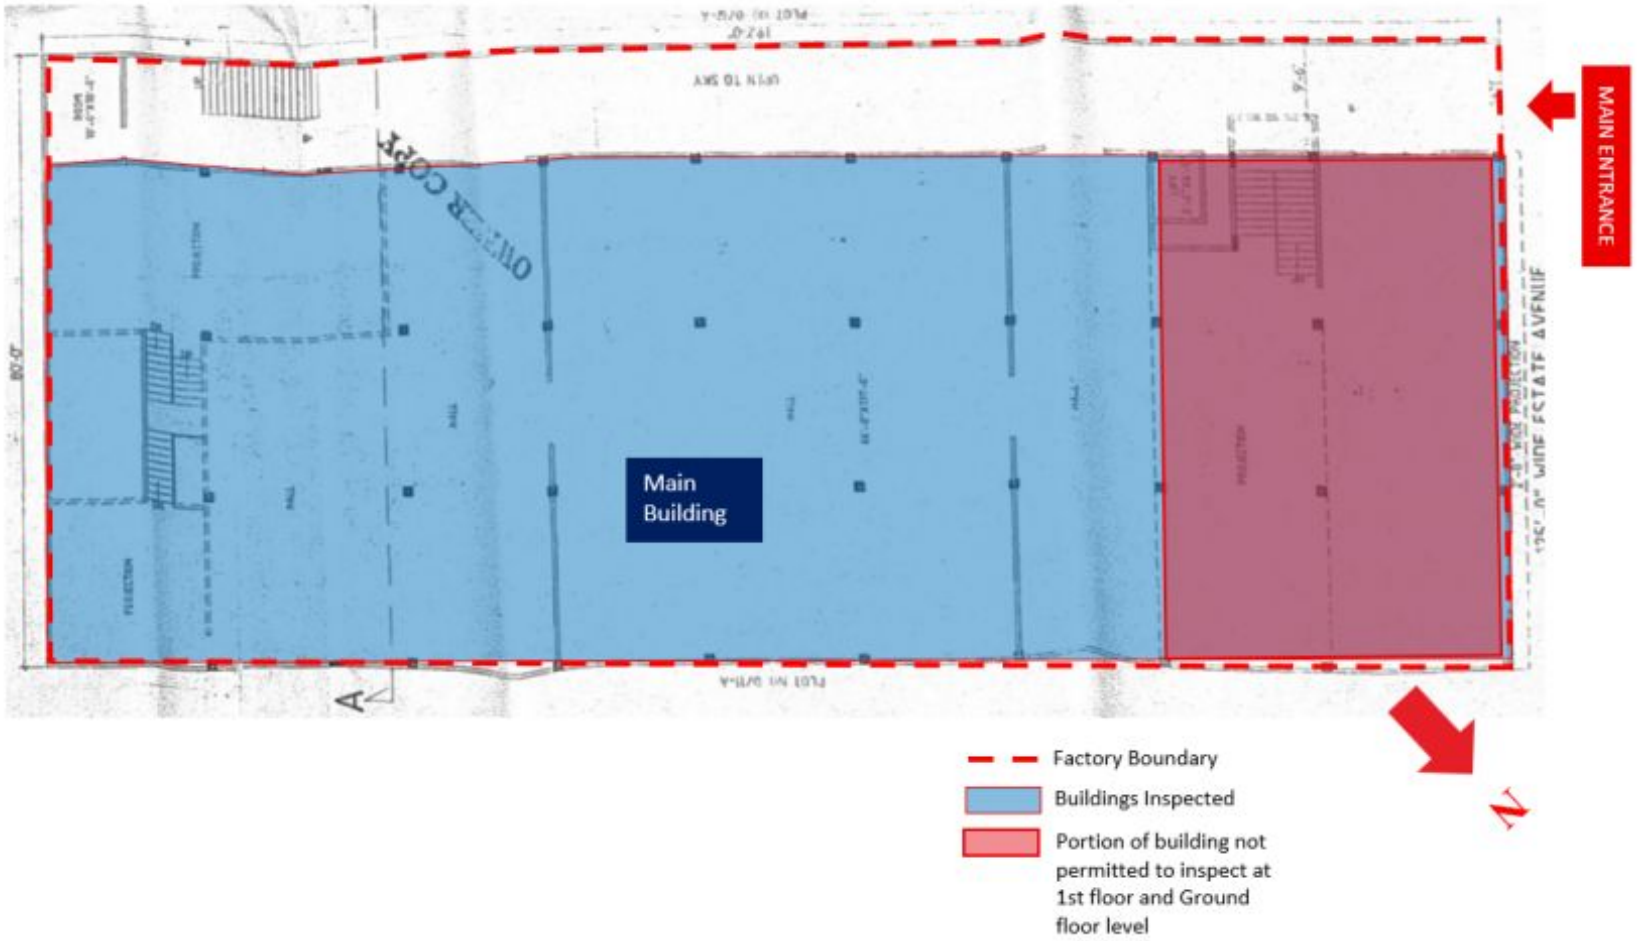


Figure 1.2. Site layout plan - Red dashed line indicates site boundary, highlighted area (blue) indicates building inspected and (red) indicates portion not allowed to inspect.



Figure 1.3. Front elevation of main building



Figure 1.4. Typical roof activity



Figure 1.5. Typical 6th floor activity



Figure 1.6. Typical 5th floor activity



Figure 1.7. Typical 4th floor activity



Figure 1.8. Typical 3rd floor activity



Figure 1.9. Typical 2nd floor activity



Figure 1.10. Typical 1st floor activity



Figure 1.11. Typical ground floor activity

2.1 Structural System

Building	Main Building
Stability system	RC MRF with infill masonry
Column size (m)	0.53 x 0.53 (Max)
Grid (m)	7.64 x 6.6 (Max)
Primary beam size (m)	0.25 x 0.6
Secondary beam size (m)	-
Slab depth (m)	0.175
Finishes depth (m)	0.1
Ceiling height (m)	3.1 - 6th floor 3.1 - 5th floor 3.1 – 4th floor 3.1 – 3rd floor 3.1 – 2nd floor

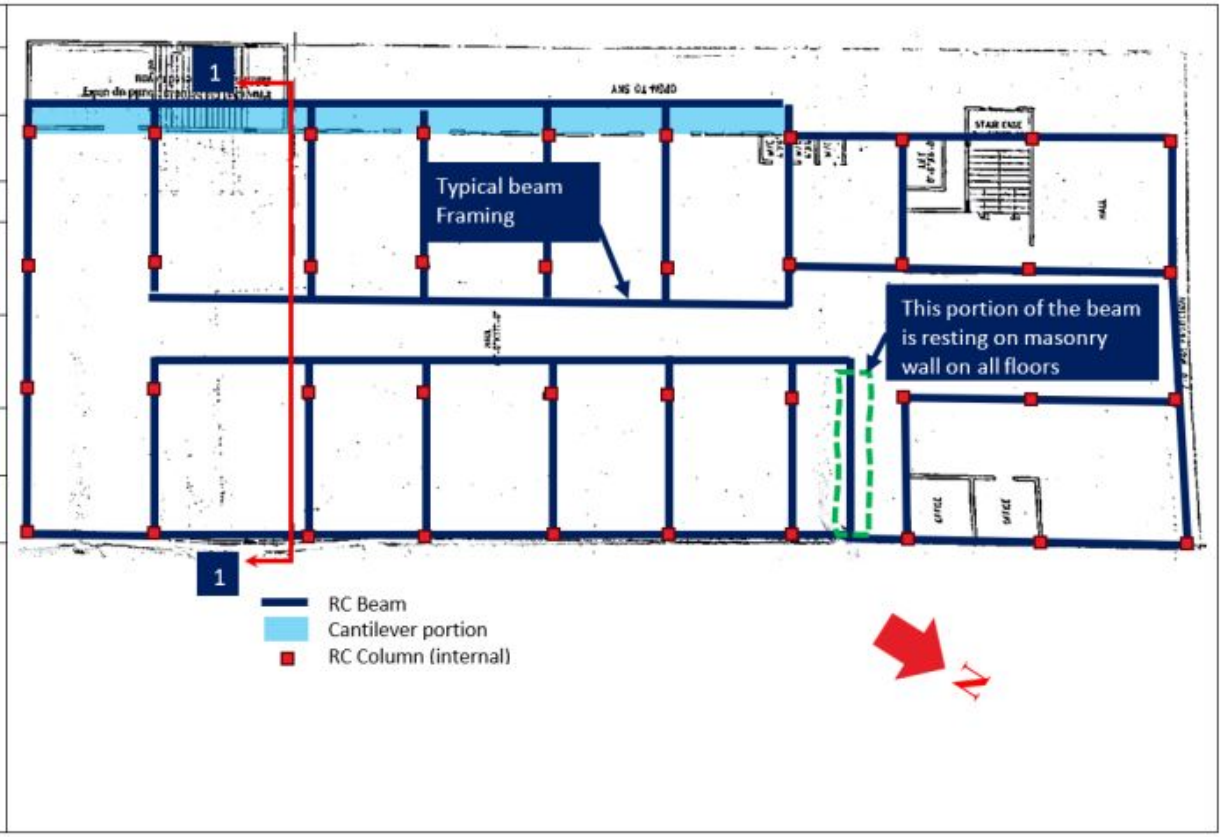


Figure 1.12. Main Building - Typical framing plan for 2nd to roof

Building	Main Building
Stability system	RC MRF with infill masonry
Column size (m)	0.53 x 0.53
Grid (m)	7.64 x 6.6 (max)
Primary beam size (m)	0.25 x 0.6
Secondary beam size (m)	-
Slab depth (m)	0.175
Finishes depth (m)	0.1
Ceiling height (m)	2.57 - (1st floor) 5.6 - (G. floor)


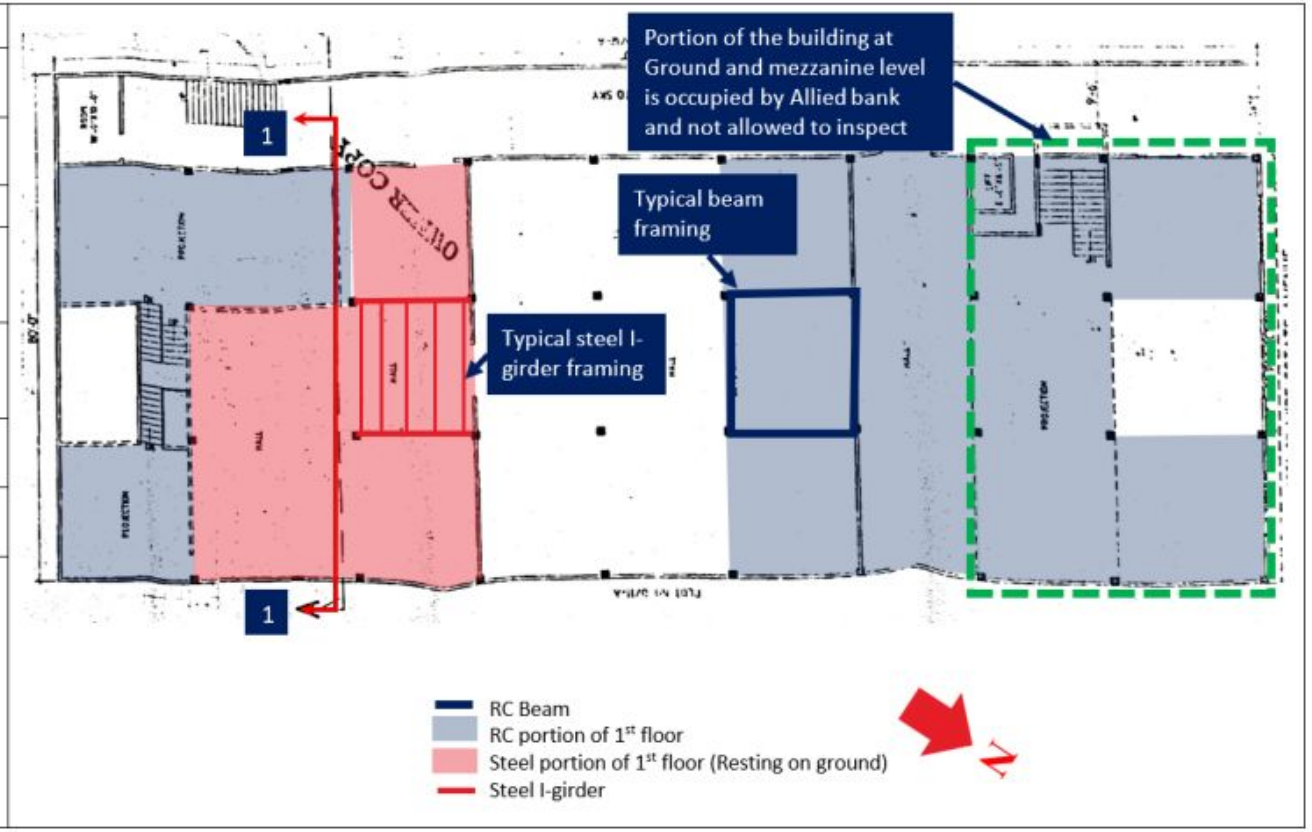


Figure 1.13. Typical framing plan for 1st floor

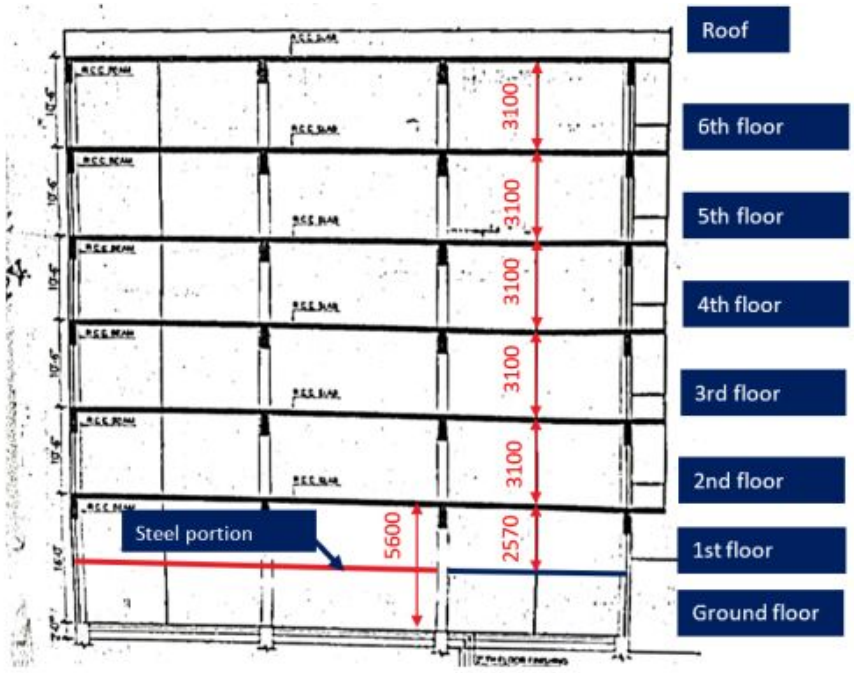

Structural System Notes

Column size is the structural dimension and excludes render thickness
Grid measurements are from centre of column to centre of column
Beam sizes do not include slab depth

Figure 1.14. Typical Section 1-1 of Main Building

3. Documentation

This table shows the details about the documentation provided by the factory.

Table 2: Documentation

Building	Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plan	Stability certificate	Inspection reports	Materials testing
Main Building	Yes	Yes	Yes	No	No	No	Yes	No	No

4. Structural Safety Measures

During our structural site inspection of TAJ Industries, a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within TAJ Industries. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3: Summary of issues

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Main Building	Highly stressed Columns	Connection details	-	-	Spalling concrete Corrosion of reinforcement	Documentation unavailable Lack of safe load plans

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-065635

Timeline	Remediation Plan
Medium Term CAP-0077903	Factories should begin remediation of CAP items—such as surface cracks or non-structural repairs—using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Potential Overstress

6.1 Highly stressed columns

Based on the initial assessment and considering the observed loading conditions, the internal RC columns at ground floor level of the main building appear to be highly stressed, likely attributed to the relatively large structural grid (7.64 m × 5.9 m) and unavailibility of concrete strength data. F-202604-065622

Timeline	Remediation Plan
Immediate CAP-0077868	Verify insitu reinforcement by removing cover and confirming no. and diameter of bars and submit results to Pakistan Accord.
Immediate CAP-0077869	Verify in-situ concrete strength for the identified columns either by 100mm dia. cores from at least 4 columns or existing cylinder strength data and submit results to Pakistan Accord.
Immediate CAP-0077870	Verify strength of reinforcement through laboratory tensile strength testing.
Immediate CAP-0077871	(1) Appoint qualified and competent Structural Engineer to carry out DEA on the full building , in accordance with the DEA scope and minimum requirements set out in the Initial Inspection report.
Medium Term CAP-0077872	Factory Engineer to review design, loads and columns stresses in area identified and submit to Pakistan Accord for review.
Medium Term CAP-0077873	(2) Submit accurate As-built Drawings showing structure, loading, elements, dimensions, levels, foundations and framing on Plan, Section and Elevation drawings and a report on Engineering tests carried out to justify material strengths and reinforcement content in all key elements studied, to Pakistan Accord for review
Medium Term CAP-0077874	(3) Submit structural engineering assessment with supporting calculations based on the as-built drawing and material strengths along with safe load plans reviewed previously using a model-based design that justifies the safety and serviceability of the building against loading as set out in Building Code of Pakistan

Medium Term CAP-0077875	(4) Submit proposals for any retrofitting works that may be needed to demonstrate the adequacy of the structure to Pakistan Accord for review
Longer Term CAP-0077876	(5) Carry out all retrofitting works if needed as proposed and previously reviewed by Pakistan Accord
Longer Term CAP-0077877	(6) Factory to advise Pakistan Accord when all retrofitting works are complete and make provision for a verification inspection attended by the factory Structural Engineer. Once Pakistan Accord has verified retrofitting works in accordance with previously reviewed proposals, then this item will be complete.
Longer Term CAP-0077878	Continue to implement load plan

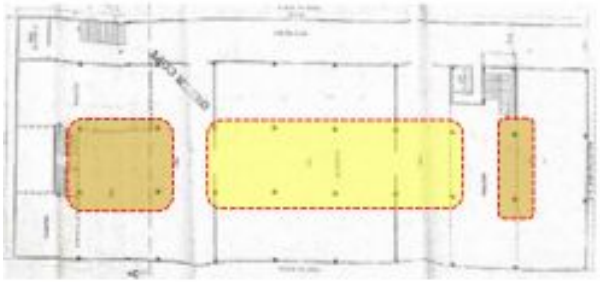


Figure 2.1 - Location of stressed columns (yellow) and highly stressed columns (amber)

7. Structural System

7.1 Connection details

This observation relates to the steel emergency staircase of the main building. At each level, the stair flight members are found to be bearing on undersized landing members. Additionally, a portion of these members remains unwelded/unconnected, resulting in inadequate load transfer and increased structural vulnerability. F-202604-065627

Timeline	Remediation Plan
Medium Term CAP-0077861	Building structural engineer to review the as-built design for code compliance and confirm if the connection details is adequate and submit the report with remedial measures to Pakistan Accord for review.
Longer Term CAP-0080629	Implement the required remedial works

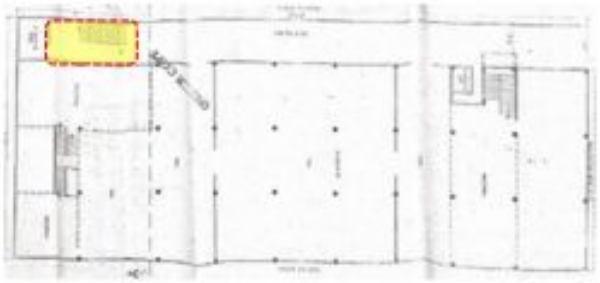


Figure 2.2 - Location of steel emergency staircase



Figure 2.3 - Inadequate conncetion in stair members at 4th floor level



Figure 2.4 - Inadequate conncetion in stair members at 3rd floor level



Figure 2.5 - Inadequate conncetion in stair members at 3rd floor level

8. Other Damage/Defects

8.1 Corrosion of reinforcement

This observation relates to the roof level of the main building, where column reinforcement bars are exposed, posing a high risk of corrosion due to direct exposure to environmental conditions. F-202604-065631

Timeline	Remediation Plan
Medium Term CAP-0077895	Building Engineer to inspect areas with protect the exposed rebars from the weather and to propose the remedial solution to further stop reduce the effect of corrosion.
Longer Term CAP-0077896	Implement the remedial works.

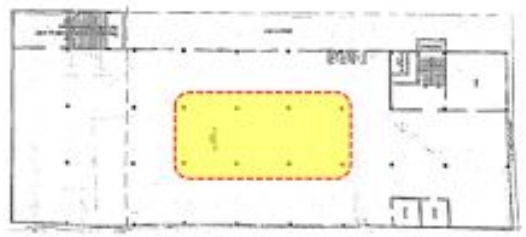


Figure 2.6 - Location of exposed column rebars at roof



Figure 2.7 - Exposed column rebars at roof



Figure 2.8 - Exposed column rebars at roof

8.2 Spalling concrete

This observation relates to the main building at the 5th floor, where signs of concrete spalling have been observed at the ceiling, along with similar distress signs in the peripheral beam on the exterior side. This is likely due to corrosion of reinforcement induced by long-term water ingress from the roof level. F-202604-065628

Timeline	Remediation Plan
Medium Term CAP-0077891	Identify the cause of the damage and propose measures to prevent further water damage.
Medium Term CAP-0077892	Inspect damage to the beam and propose plan for remediation to the structure. Submit report capturing the above to Pakistan Accord for approval.
Longer Term CAP-0077893	Implement remedial works.
Longer Term CAP-0077894	Continue to monitor for future signs of water ingress/damage.



Figure 2.9 - Signs of spalling at the peripheral beam at 5th floor



Figure 2.10 - Spalling signs at 5th floor near washroom area



Figure 2.11 - Location of spalling affected areas at 5th floor

9. Structural Documentation

9.1 Documentation unavailable

This observation relates to the factory, where the only available documentation is an approved site layout, which does not match the as-built condition. No architectural or structural drawings were available. F-202604-065632

Timeline	Remediation Plan
Longer Term CAP-0077897	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete asbuilt documentation

9.2 Lack of safe load plans

Safe load plans were not available and posted on any of the part of the main building. F-202604-065634

Timeline	Remediation Plan
Longer Term CAP-0077898	Building structural engineer to review design documentation to confirm load capacity of the structure.
Longer Term CAP-0077899	Develop safe load plans and submit to Pakistan Accord for review
Longer Term CAP-0077900	Factory to post safe load plans on each floor

10. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.