Issue	**1**
Factory ID	**25969**
Date of Issue	**01-Jul-2026**

Usman & Sons

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Plot No. A-95, S.I.T.E. Super Highway, Phase 1
75700 Karachi
Sindh Pakistan

Latitude: [25.004252], longitude: [67.09787]
Date of inspection: 05-May-2026

Fire Safety Inspection Report

Observations & Actions



Authors	**Tahaam Shaikh**
Reviewed by	**Usama Zia**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 05-05-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 10
   - 3.1 Building Means of Egress Details 11
   - 3.2 Building Use 12
4. Documentation 14
5. Fire Safety Measures 15
6. Remediation Support 16
   - 6.1 Engineering Support 16
7. Means of Escape 17
   - 7.1 Escape doors 17
   - 7.2 Exit access 20
   - 7.3 Number of exits 22
   - 7.4 Protection of stairs 24
   - 7.5 Escape stair condition 28
   - 7.6 Exit discharge 30
   - 7.7 Exit signage 32
8. Fire Rated Construction 35
   - 8.1 Separation of high-risk areas 35
   - 8.2 Separation of shafts 37
   - 8.3 Separation of occupancies 39
   - 8.4 Storage 41

9. Fire Safety Management 44
9.1 Records of system testing 44
9.2 Records of systems maintenance 45
9.3 Emergency Action Plan 46
10. Assessment Limitations and Assumptions 47

1. Executive Summary

On 05-May-2026, Tahaam Shaikh, Waqar Sami and Muzammil Aslam on behalf of the Pakistan Accord carried out an initial fire inspection for Usman & Sons, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Imran Usman (CEO), Mr. Amin Usman (GM Technical), Mr. Ahsan Sheikh (Health and safety manager), Mr. Zohaib Ali (Compliance representative) and other staff members of Usman & sons. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Accord were also present and the team was led by Dr Muhammad Imran Pakistan Accord.

The factory operates in one general shift, with approximately 120 workers operate in the factory, with 4% workers being females.

The factory comprises one main building and 4 ancillary buildings owned by Usman & sons. During the inspection, the buildings highlighted in Figure 1.1 were inspected, with the site boundary indicated in red.

- **Main building** is a 4 storey (Ground + mezzanine + 3), RC Moment resisting frame with infill masonry panels with roof consist of steel portal frame shed with a covered area (footprint) of 1237 sq. m and with the height of 13.05m measured from the fire department vehicle access to the topmost occupied floor. There are two mezzanine floors at ground floor and both of them does not comply with Fire Safety provisions under the Pakistan Accord Building Standard and is therefore classified as a full floor, making the building a five-storey structure (G+M+3). Building has 4 staircases out of which 3 discharge internally. The building is used for stitching and storage (3*rd*, 2*nd* and 1*st* floor), offices and storage (mezzanine floor) and stitching and storage (ground floor). The construction date of building is 2001.
- **Ancillaries:**

Masjid is a single storey (Ground only), RC Moment resisting frame. The building is used for prayers (ground floor). The construction date of building is 2001.

Gate office is a single storey (Ground only), RC Moment resisting frame with infill masonry panels. The building is used for security office, fire pump room and generator room (ground floor). The construction date of building is 2001.

B1 is a 2 storey (Ground + 1), RC Moment resisting frame. The building is currently non-operational, and factory has decided to demolish the structure.

B2 is a single storey (Ground only), combination of precast shed and steel truss shed supported by load bearing block masonry. The building is currently non-operational, and factory has decided to demolish the structure.

We were presented with master layout plan, as-built architectural layout, inspection checklist and staff training documents.

A summary of the main concerns identified during the inspection includes (non-exhaustive):

- Lockable mechanisms observed in escape route across the whole facility.
- There is no fire separation between stairs, lift shafts and the rest of the building.
- Escape routes are not adequately fire separated from adjoining high-risk areas.
- Storage areas are not fire separated from rest of the building.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

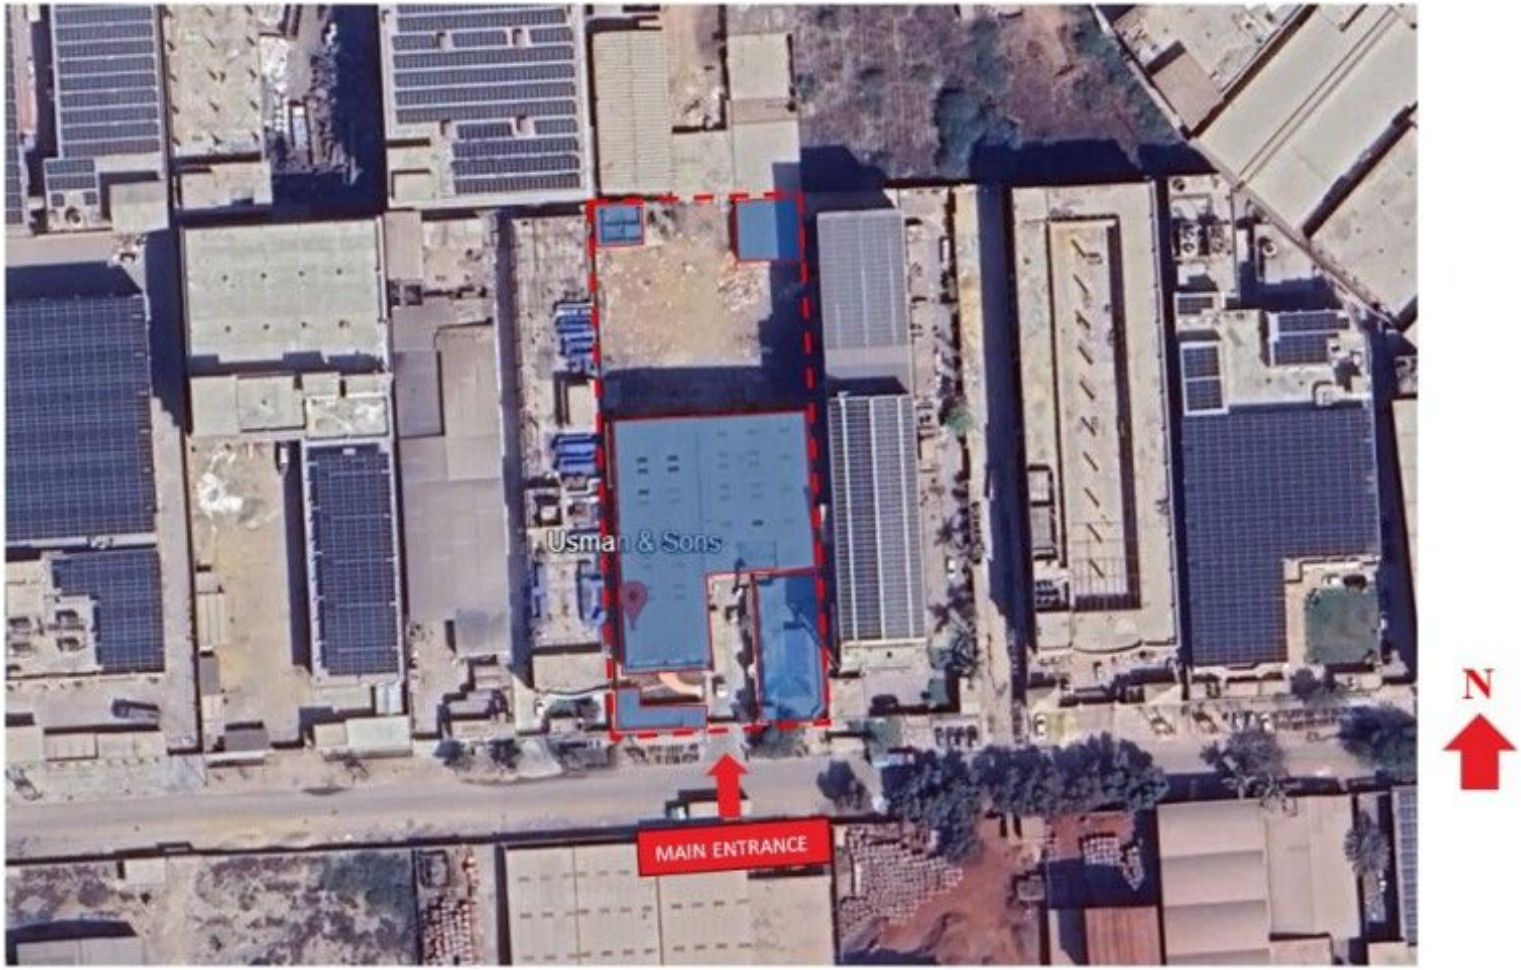


Figure 1.1. Site plan (Satellite view). Red dashed line indicates site boundary, highlighted (blue) area indicates buildings inspected

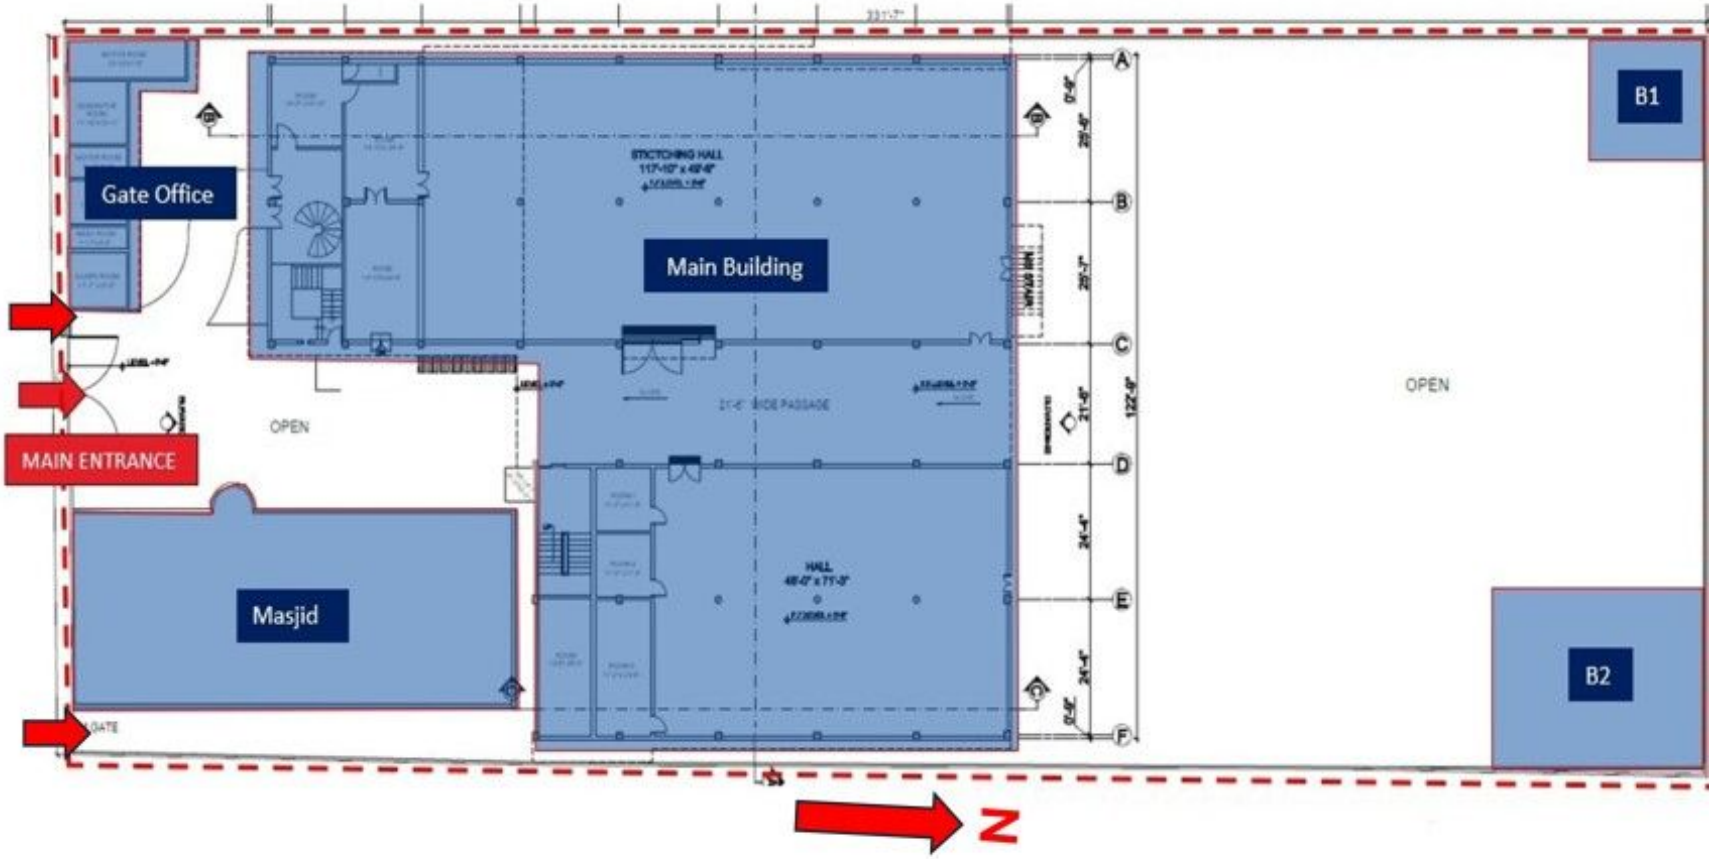


Figure 1.2. Site plan (Site layout). Red dashed line indicates site boundary, highlighted (blue) area indicates buildings inspected

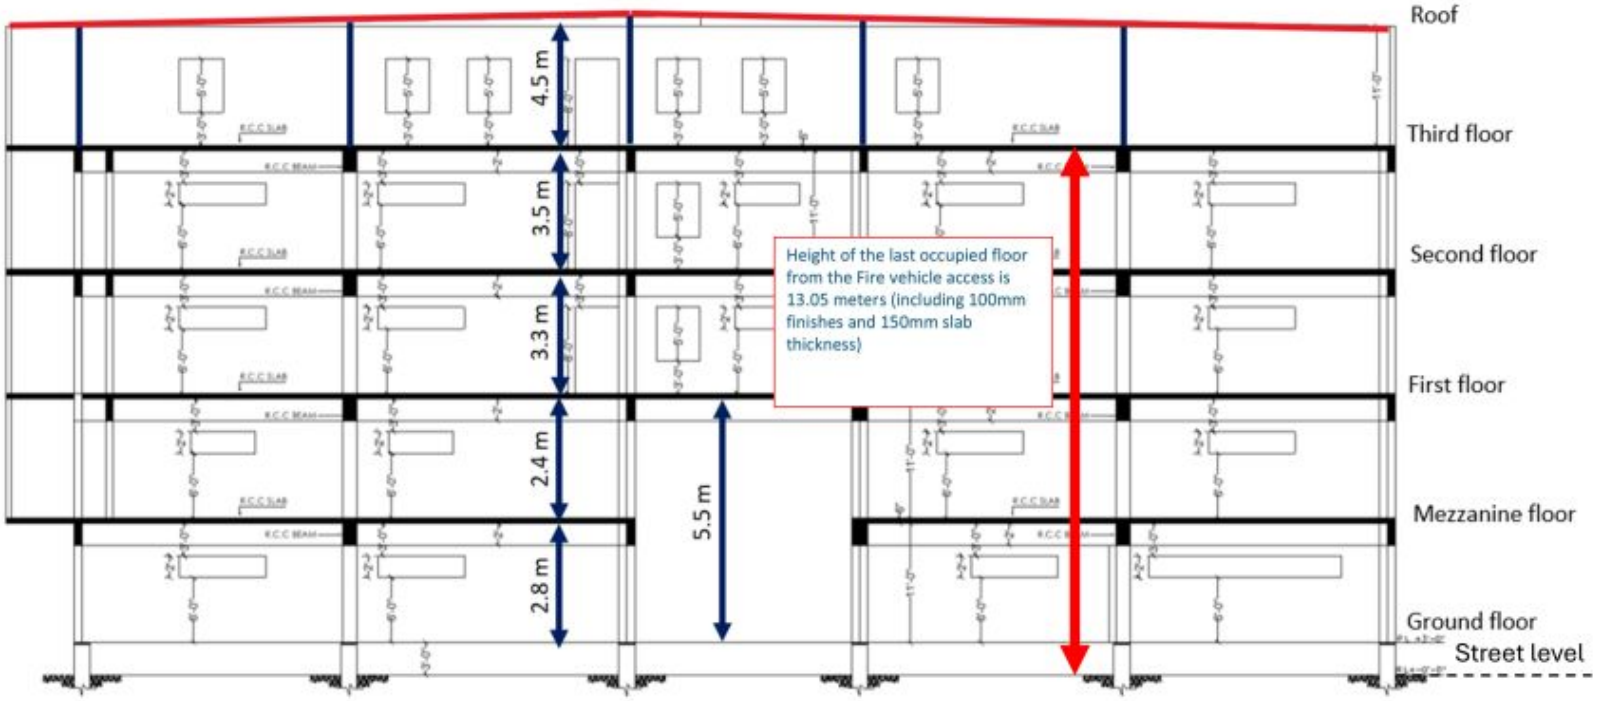


Figure 1.3. Typical section of Main building

3. Building Description

The factory comprises one main building and 4 ancillary buildings owned by Usman & sons. During the inspection, the buildings highlighted in Figure 1.1 were inspected, with the site boundary indicated in red.

- **Main building** is a 4 storey (Ground + mezzanine + 3), RC Moment resisting frame with infill masonry panels with roof consist of steel portal frame shed with a covered area (footprint) of 1237 sq. m and with the height of 13.05m measured from the fire department vehicle access to the topmost occupied floor. The mezzanine floor does not comply with Fire Safety provisions under the Pakistan Accord Building Standard and is therefore classified as a full floor, making the building a five-storey structure (G+M+3). Building has 4 staircases out of which 3 discharge internally. The building is used for stitching and storage (3*rd*, 2*nd* and 1*st* floor), offices and storage (mezzanine floor) and stitching and storage (ground floor). The construction date of building is 2001.
- **Ancillaries:**

Masjid is a single storey (Ground only), RC Moment resisting frame. The building is used for prayers (ground floor). The construction date of building is 2001.

Gate office is a single storey (Ground only), RC Moment resisting frame with infill masonry panels. The building is used for security office, fire pump room and generator room (ground floor). The construction date of building is 2001.

B1 is a 2 storey (Ground + 1), RC Moment resisting frame. The building is currently non-operational, and factory has decided to demolish the structure.

B2 is a single storey (Ground only), combination of precast shed and steel truss shed supported by load bearing block masonry. The building is currently non-operational, and factory has decided to demolish the structure.

3.1 Building Means of Egress Details

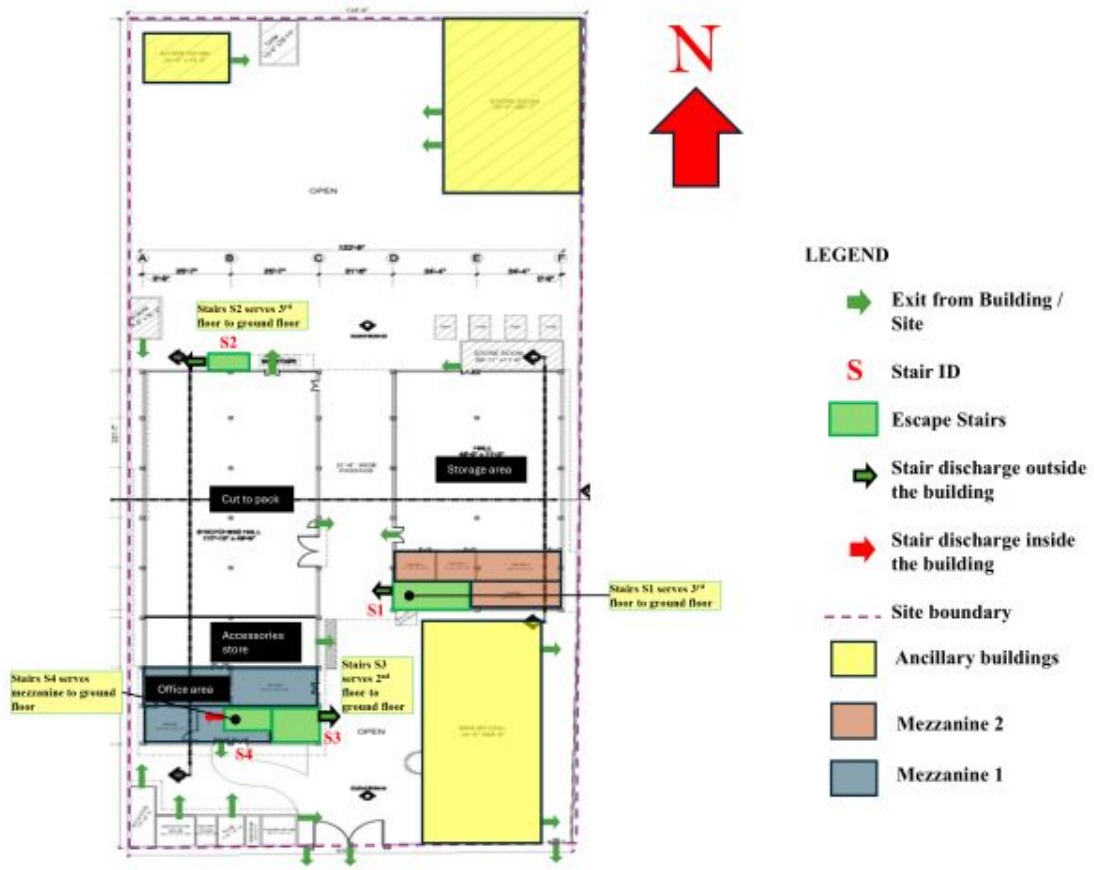


Figure 1.4. Means of egress of Usman and Sons

3.2 Building Use

Main Building

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Ground Floor	Office	5	1	-	-	-
	Cut to pack	50	2	-	-	-
	Accessories store	5	1	-	-	-
	Storage	10	2	-	-	-
Mezzanine floor 1	Offices	20	1	-	-	-
Mezzanine floor 2	Storage	5	1	-	-	-
1st floor	Stitching, Office, Storage	50	3	-	-	-
2nd floor	Stitching, Storage	50	3	-	-	-
3rd Floor	Stitching, Storage	50	3	-	-	-

Masjid

Floor level	Occupancy	Occupant Load	No. of Exits	Excessive travel distance		
				Alternatives	Common path	Dead End
Ground Floor	Prayer area	150	2	-	-	-

There is sufficient exit capacity found in main building. Also, common path and travel distance issues are not observed.

4. Documentation

This table shows the details about the documentation provided by the factory.

No.	Description		Availability Yes/No	Created/ Updated	Status/Remarks
1.	Civil Defense Certificate (NOC)		Yes	Jan-2026	-
2.	Architecture Layout		Yes	-	Not as per built structure
3.	Sectional Layout		Yes	-	Not as per built structure
4.	Evacuation Maps		Yes	-	-
5.	Emergency Action Plan		Yes	2-Jan-2025	Not as per Pakistan Accord Building Standard
6.	Inspection	Fire extinguishers	Yes	2-May-2026	Not as per Pakistan Accord Building Standard
		Exit signage	Yes	2-May-2026	Not as per Pakistan Accord Building Standard
7.	Testing	Fire extinguishers	No	-	-
		Exit signage	No	-	-
8.	Maintenance	Fire extinguishers	No	-	-
		Exit signage	No	-	-
9.	Evidence of Fire Drills		Yes	Jan-2026 9- July-2025	-
10.	Staff Training		Yes	22-july-2025	-

5. Fire Safety Measures

During our fire site inspection of Usman & Sons, a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Usman & Sons. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Remediation Support

6.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202606-068679

Timeline	Remediation Plan
Immediate CAP-0083398	Factories should begin remediation of CAP items such as installing extinguishers, signage, and clearing escape routes using internal resources. For fire protection systems, design-related or construction-related remediation, engagement of a qualified Fire Safety Engineer is required.

7. Means of Escape

7.1 Escape doors

Per Pakistan Accord Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:
- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have an opening mechanism that allows for easy opening without key or prior knowledge.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape

This is not always achieved, examples include (list not exhaustive):
- Escape doors are found lockable at multiple locations across the entire facility such as exit door at S1 3rd floor, S2 2nd floor, main exit door, lockable grill door at S1 ground floor.
- Sliding doors serve for escape from areas with more than 10 occupants e.g. Grilled sliding door was found at S1 on ground floor.
- Doors into stairs swing against the direction of escape. e.g. At S3 1st floor.
- Discharge doors from stairs swing against the direction of escape e.g. At S4 ground floor.

Recommended remedial actions are provided below.F-202605-066527

Timeline	Remediation Plan
Immediate CAP-0079519	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term CAP-0079520	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5. Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, which are side swinging and open in the direction of travel to an exit.

Longer Term CAP-0079521	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Lockable door at s1 3rd floor



Figure 2.2 - Lockable door at 2nd floor



Figure 2.3 - Discharge door At S4 ground floor swing against the direction of escape



Figure 2.4 - Lockable door at S1 2nd floor.



Figure 2.5 - lockable door at entry into compressor room



Figure 2.6 - lockable grill at S1 ground floor



Figure 2.7 - Door opening against the direction of escape at S3 1st floor

7.2 Exit access

Per Pakistan Accord Standard, escape routes within the building should be sufficiently wide and safe for use in an event of an emergency, the key requirements include:
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.
- Headroom along escape route should be more than 2.05m.

This is not always achieved, examples include (list not exhaustive):
- Obstructions on escape route. e.g. Obstructions in Mezzanine at S1 ground floor.
- Protected stair discharges inside the building at a distance from building exit. e.g. S4 discharges internally at ground floor.
- 1.5m Headroom was found at S3 on 3rd floor which is insufficient (i.e. headroom height is less than 2.05m).

Recommended remedial actions are provided below.F-202605-066533

Timeline	Remediation Plan
Immediate CAP-0079558	Remove obstructions on escape routes and keep them clear for escape. Provide warning signs where headroom height is less than 2.05 m on escape routes. Install Soft Padding at locations with headroom clearance below 2.05 m.
Medium Term CAP-0079559	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge corridor leading outside the building. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge corridors - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks) Propose modifications to ensure 2.05m headroom height is achieved along the escape routes or propose alternative egress routes that comply. Submit the proposal to Pakistan Accord for review.

Longer Term CAP-0079560	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90-minute fire doors. The design shall follow the reviewed proposal and comply with Pakistan Accord Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetration through the doors is not permitted. All fire doors require self-closers. Doors into stair discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge corridors need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted. Implement measures to ensure adequate clear head height is achieved along all escape routes.



Figure 2.8 - S4 discharges internally at ground floor



Figure 2.9 - obstructions in storage area at mezzanine near S1 ground floor

7.3 Number of exits

Per Pakistan Accord Standard, the exit provisions should meet the following:
- Minimum 2 exits from every occupied floor.

This is not always achieved, examples include (list not exhaustive):
- Missing exit from some of the occupied floors e.g. Mezzanine floor is served only by S4 which cannot be considered a safe stair for escape as it is a spiral staircase. Therefore, mezzanine has to be provided with minimum 2 compliant stairs.
- There is only a single exit from site in Masjid and there is a risk it may not be available in the event of fire in the building.

Recommended remedial actions are provided below.F-202606-068759

Timeline	Remediation Plan
Medium Term CAP-0083682	Review each floor and area to ensure that the number of exits complies with Pakistan Accord Standard. Develop plans and drawings to provide additional exits where necessary. Submit the plan and drawings to Pakistan Accord for review and approval prior to commencing rectification works.
Longer Term CAP-0083683	Implement the above plan as agreed with Pakistan Accord. Number of exits from all floors and parts of the building should comply with Pakistan Accord Standard.



Figure 2.10 - Stairs S4 is not compliant for escape as it is spiral

7.4 Protection of stairs

Per Pakistan Accord Standard, exit stairs should be adequately protected, including:
- Stairs to be fire separated from the rest of the building using 2-hour fire resisting construction with 90-minute fire rated doors.
- Stair discharge routes should be protected to the same level of safety as the stair.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):
- Unprotected openings into stairs. e.g. unprotected openings in S2 from 3rd floor, openings from compressor room at 3rd floor S1.
- Missing fire rated enclosure and fire doors in stair. e.g. No fire rated enclosure at S1 2nd floor, missing enclosure in S4 at mezzanine floor.
- Doors are not fire doors. e.g. No fire doors in S1, S2, S3 at all floors.
- Fire load in stairs. e.g. Fire load in S1 at 2nd floor and 1st floor, storage fire load causing obstruction at entrance in S3 from 3rd floor.
- Services passing through or within stairs e.g. services passing through S2 at 3rd floor.

Recommended remedial actions are provided below.F-202605-066530

Timeline	Remediation Plan
Immediate CAP-0079541	Remove fire load and any other obstructions due to stored items from stairs
Medium Term CAP-0079542	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Pakistan Accord for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls /doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.

Longer Term CAP-0079543	Ensure all emergency escape stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors with self-closing mechanisms. - Penetrations through doors are not permitted. - Doors into stairs should be kept closed (but not locked) at all times.



Figure 2.11 - Cartons stored in S1 1st floor



Figure 2.12 - Openings in S2 3rd floor



Figure 2.13 - Fire load in S3 causes obstruction for entrance from 3rd floor



Figure 2.15 - Missing enclosure in S1 2nd floor



Figure 2.14 - Missing fire rated enclosure in S4 at mezzanine floor



Figure 2.16 - Fire load due to electric panel at S1 3rd floor



Figure 2.17 - Fire door is missing in S1

7.5 Escape stair condition

Per Pakistan Accord Standard, escape stairs should be designed to be safe for use, including day to day use.

This is not always achieved, examples include (list not exhaustive):

- There is only one handrail e.g. Single side handrail is missing at S3 on all floors, S1 at ground floor.

Recommended remedial actions are provided below.F-202605-066532

Timeline	Remediation Plan
Medium Term CAP-0079551	Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height.



Figure 2.18 - Single side handrail is missing at S3 (on all floors)



Figure 2.19 - Single sided handrail at S1 ground floor

7.6 Exit discharge

Exit discharge routes outside the building should be sufficiently protected so that people can escape safely in the event of a fire anywhere in the building. This includes:
- External escape routes should not lead via high-risk areas.
- Where there is no safe assembly point on site, the final egress routes from site should be sufficiently wide and open in the direction of escape to enable escape to public way. Exits from site should be arranged so that a single fire event will not compromise all site exits.

This is not always achieved, examples include (list not exhaustive):
- External escape routes are through high-risk areas. e.g. The discharge route in-between cut to pack and storage area in main building at level ground has unprotected openings which are not fire separated.
- Unprotected openings from building in the external discharge route. e.g. Openings in exit discharge of S2 at ground floor.

Recommended remedial actions are provided below.F-202605-066531

Timeline	Remediation Plan
Medium Term CAP-0079547	Prepare drawings showing proposed fire separating construction to exit discharge routes. These shall be submitted to Accord for review and approval prior to commencing rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge routes - Details of proposed fire resisting walls and fire door assemblies required to protect discharge routes
Longer Term CAP-0079548	- Ensure external exit discharge routes are adequately fire separated from the rest of the building. - Ensure external escape routes do not pass close to unprotected high-risk areas



Figure 2.20 - Exit discharge passes through storage



Figure 2.21 - Openings from production and store into exit discharge at ground floor

7.7 Exit signage

Per Pakistan Accord Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in an event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):
- Missing exit signs at entry into stairs. e.g. At S3 2nd,1st floor.
- Missing exit signs at stair discharge routes. e.g. At S4 and S3.
- Missing exit signs in production areas e.g. At 1st, 2nd,3rd floor stitching area.
- Exit signs are not uniform throughout the facility e.g. The facility is using red and green exit signs, also the wording of exit signages is non-uniform too.
- Missing exit signs in offices and back of house areas. e.g. At 1st floor.
- Electrically powered exit signs are not a tested and listed system

Recommended remedial actions are provided below.F-202605-066534

Timeline	Remediation Plan
Medium Term CAP-0079602	Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Standard and BCP 10.15.1, 10.15.2 and 10.15.3
Longer Term CAP-0079603	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.22 - Missing exit signs at ground floor production area



Figure 2.24 - Missing exit signs in office 1st floor



Figure 2.23 - Missing exit signs at 3rd floor



Figure 2.25 - Missing exit signs in production at ground floor



Figure 2.26 - Missing exit signs in 2nd floor production



Figure 2.27 - Non uniform exit signs are found throughout the facility



Figure 2.28 - Missing exit sign at exit discharge of S3

8. Fire Rated Construction

8.1 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
- Electrical rooms, Generator rooms, Mechanical plant areas: 2-hour fire resisting construction with 90 minutes fire doors

The following deficiencies have been observed on site, including (list not exhaustive):
- Mechanical plant areas are not fire separated e.g. Compressor room at 3rd floor is not fire separated from stairs S1.
- Electrical rooms are not fire separated e.g. Electrical room at ground floor is not fire separated from exit discharge of S2.
- Generator rooms are not fire separated e.g. Generator room is not fire separated at ground floor from exit discharge of S4

Recommended remedial actions are provided below.F-202605-066519

Timeline	Remediation Plan
Medium Term CAP-0079413	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g. storage, electrical rooms, mechanical rooms, fire pump room etc.) - Locations of fire- rated walls and doors to protect these rooms - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction)
Longer Term CAP-0079422	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.29 - Generator room is not fire separated at ground floor from exit discharge of S4



Figure 2.30 - Compressor room at 3rd floor



Figure 2.31 - Electrical room is not fire separated from exit discharge of S2

8.2 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction to maintain compartmentation between floors.

The following deficiencies have been observed on site, including (list not exhaustive):

- Lift shafts are not separated with fire rated construction. e.g. Lift shaft near S1 is not fire separated from the rest of the building.

Recommended remedial actions are provided below.F-202605-066520

Timeline	Remediation Plan
Medium Term CAP-0079423	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to the Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0079447	Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.32 - Lift shaft at stairs S1

8.3 Separation of occupancies

Pakistan Accord Standard requires different occupancy types to be fire separated from each other. The aim is to limit the fire to only one occupancy type.

The following deficiencies have been observed on site, including (list not exhaustive):
- Large office areas not fire separated from the production areas. e.g. office area not separated from stitching area at 1st floor.

Recommended remedial actions are provided below.F-202605-066521

Timeline	Remediation Plan
Medium Term CAP-0079438	Prepare a plan and drawings showing the proposed separation details. These shall be submitted to Pakistan Accord for review and approval prior to the rectification works. The drawings should cover: - Different occupancy types in the building - Proposed fire separation details (including fire rating of walls and doors)
Longer Term CAP-0079439	Provide fire rated separation between occupancies as per proposal reviewed by Pakistan Accord



Figure 2.33 - Office area not separated from stitching at 1st floor

8.4 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2-hour fire resisting walls with 90 minutes fire rated doors.

Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:
- Combined storage areas do not exceed 10% of the production floor area.
- Storage height is less than 2.45m.
- Storage areas are grouped into islands not exceeding 23 sq.m.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):
- Storage areas are not fire separated from the rest of the building. e.g. Accessories store is not fire separated from cut to pack at ground floor, storage is not fire separated from production at 3rd, 2nd and 1st floor.
- Presence of areas where storage does not meet miscellaneous in-process storage requirements (listed above). e.g. miscellaneous in-process storage exceeds permitted criteria at ground floor production area.
- Storage in exit stairs and/or stair discharge routes. e.g. Storage in exit discharge at ground floor.

Recommended remedial actions are provided below.F-202605-066523

Timeline	Remediation Plan
Medium Term CAP-0079490	Identify all designated storage areas. Identify which storage areas can be re-arranged to meet the in-process storage limitations described above and which storage areas need will be fire separated from the rest of the building. For all storage areas which require fire separation, prepare a drawing presenting the proposed fire separating construction details and submit to Pakistan Accord for review prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term CAP-0079491	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard



Figure 2.34 - Storage is not fire separated from production at 2nd floor



Figure 2.35 - Improper piled up storage is not fire separated from ground floor exit discharge



Figure 2.36 - Accessories store is not separated from production at ground floor



Figure 2.37 - Storage area is not fire separated from production at 1st floor



Figure 2.38 - Islands are missing in miscellaneous storage at ground floor

9. Fire Safety Management

9.1 Records of system testing

Per Pakistan Accord Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of testing of Fire Extinguishers.
- No records of testing of Emergency Exit Signage.

Recommended remedial actions are provided below.F-202605-066529

Timeline	Remediation Plan
Medium Term CAP-0079537	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0079538	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

9.2 Records of systems maintenance

Per Pakistan Accord Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in an event of an emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g. fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):
- No records of maintenance of Fire Extinguishers
-No records of maintenance of Emergency Exit Signage

Recommended remedial actions are provided below.F-202605-066522

Timeline	Remediation Plan
Medium Term CAP-0079444	- Prepare a detailed schedule of proposed system maintenance. Identify who is responsible for filling in the details. - Identify how systems will be maintained and who is responsible. - The schedule is to be submitted to the Accord for review and approval.
Longer Term CAP-0079445	- Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

9.3 Emergency Action Plan

Per Pakistan Accord Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023. Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid fire fighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):
- There is an EAP document, but it does not detail procedures, roles and responsibilities in the event of fire.
Recommended remedial actions are provided below.F-202605-066526

Timeline	Remediation Plan
Medium Term CAP-0079503	Prepare an Emergency Action Plan report.
Longer Term CAP-0079504	Ensure EAP is being practiced as part of fire drills.

10. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.