Issue	**1**
Factory ID	**25969**
Date of Issue	**01-Jul-2026**

Usman & Sons

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Plot No. A-95, S.I.T.E. Super Highway, Phase 1
75700 Karachi
Sindh Pakistan

Latitude: [25.004252], longitude: [67.09787]
Date of inspection: 05-May-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Ausama Iqbal**
Reviewed by	**Haris Mahmood**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 05-05-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 4
2. Building Extents 6
   2.1 Structural System 11
3. Documentation 14
4. Structural Safety Measures 15
5. Remediation Support 17
   5.1 Engineering Support 17
6. Potential Overstress 18
   6.1 Highly stressed columns 18
7. Other Damage/Defects 20
   7.1 Spalling concrete 20
   7.2 Damaged structural element 22
   7.3 Health and Safety 24
8. Structural Documentation 25
   8.1 Documentation unavailable 25
   8.2 Lack of safe load plans 26
9. Assessment Limitations and Assumptions 27

1. Executive Summary

On 05-May-2026, Ausama Iqbal and Kashif Riaz on behalf of the Pakistan Accord carried out an initial structural inspection for Usman & Sons, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Imran Usman (CEO), Mr. Amin Usman (GM Technical), Mr. Ahsan Sheikh (Health and safety manager), Mr. Zohaib Ali (Compliance representative) and other staff members of Usman & sons.

The factory operates in one general shift, with approximately 120 workers operate in the factory, with 4% workers being females.

The factory comprises one main building and 4 ancillary buildings owned by Usman & sons. During the inspection, the buildings highlighted in Figure 1.1 were inspected, with the site boundary indicated in red.

- **Main building** is a 5 storey (Ground + mezzanine + 3), RC Moment resisting frame with infill masonry panels with roof consist of steel portal frame shed. The building is used for stitching, storage and water tank (3rd floor), stitching and storage (2nd and 1st floor), offices and storage (mezzanine floor) and stitching and storage (ground floor). The construction date of building is 2001.
- **Ancillaries:**
  - **Masjid** is a single storey (Ground only), RC Moment resisting frame. The building is used for prayers (ground floor). The construction date of building is 2001.
  - **Gate office** is a single storey (Ground only), RC Moment resisting frame with infill masonry panels. The building is used for security office, fire pump room and generator room (ground floor). The construction date of building is 2001.
  - **B1** is a 2 storey (Ground + 1), RC Moment resisting frame. The building is currently non-operational, and factory has decided to demolish the structure.
  - **B2** is a single storey (Ground only), combination of precast shed and steel truss shed supported by load bearing block masonry. The building is currently non-operational, and factory has decided to demolish the structure.

We were presented with master layout plan, as-built architectural and structural drawings, assessment report and other documents as listed in Table 2.

There are two immediate concerns observed in main building. The first relates to excessively damaged structural members with exposed reinforcement, which require urgent repair. The second is a health and safety issue due to the missing railing at the 3rd floor staircase, posing a risk of potential injury resulting from slip, trip, or fall hazards. For further details, refer to section 7.

A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Potentially overstressed columns at ground floor of main building.
- Spalling in slab at multiple locations in main building.

We see no reason to suspend operations in the facility due to these concerns, subject to the actions identified being addressed within the specified timeframes.
Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1 - Building Summary

Building	Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / modifications	Engineer access issues
Main Building	Stitching, storage and water tank (3rd floor) Stitching and storage (2nd and 1st floor) Offices and storage (mezzanine floor) Stitching and storage (ground floor)	5 storey (Ground + mezzanine + 3)	2001	RC moment resisting frame with infill masonry	Steel portal frame shed	-	-
Ancillaries							
Masjid	Prayers (ground floor)	1 storey (Ground only)	2001	RC moment resisting frame	-	-	-
Gate office	Security office, fire pump room and generator room (ground floor)	1 storey (Ground only)	2001	RC moment resisting frame with infill masonry	-	-	-
B1	Non-operational	2 storey (Ground + 1)	unknown	RC moment resisting frame	-	-	-
B2	Non-operational	1 storey (Ground only)	unknown	Combination of precast shed and steel truss shed supported by load bearing block masonry	-	-	-



Figure 1.1. Site plan (Satellite view) - Red dashed line indicates site boundary, highlighted (blue) area indicated area inspected.

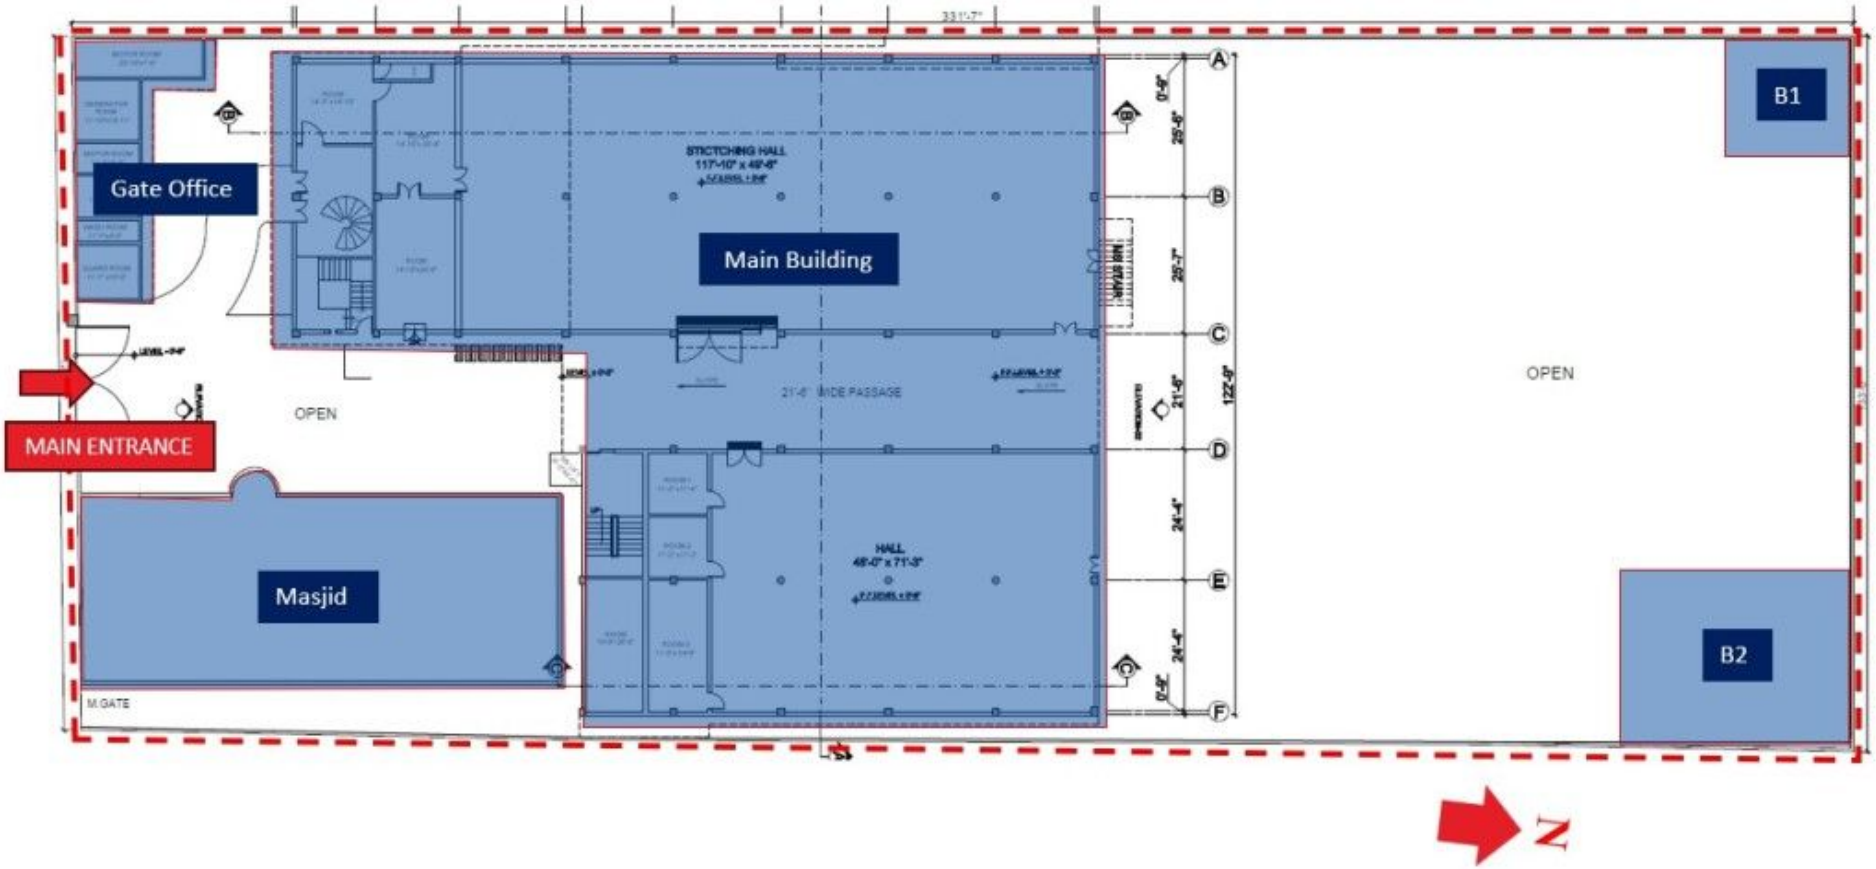


Figure 1.2. Site layout. Red dashed line indicates site boundary, highlighted area (blue) indicates buildings inspected.



Figure 1.3. Elevation of main building



Figure 1.4. Side elevation of Ancillary building (Masjid)



Figure 1.5. Floor activity at 3rd floor in main building



Figure 1.6. Floor activity at 2nd floor in main building



Figure 1.7. Floor activity at 1st floor in main building



Figure 1.8. Floor activity at mezzanine floor in main building



Figure 1.9. Floor activity at ground floor in main building

2.1 Structural System

Building	Main Building
Stability system	Steel portal frame shed
Column size (m)	-
Grid (m)	-
Primary beam size (m)	-
Secondary beam size (m)	-
Slab depth (m)	-
Finishes depth (m)	-
Ceiling height (m)	4.5 (3rd floor to roof)

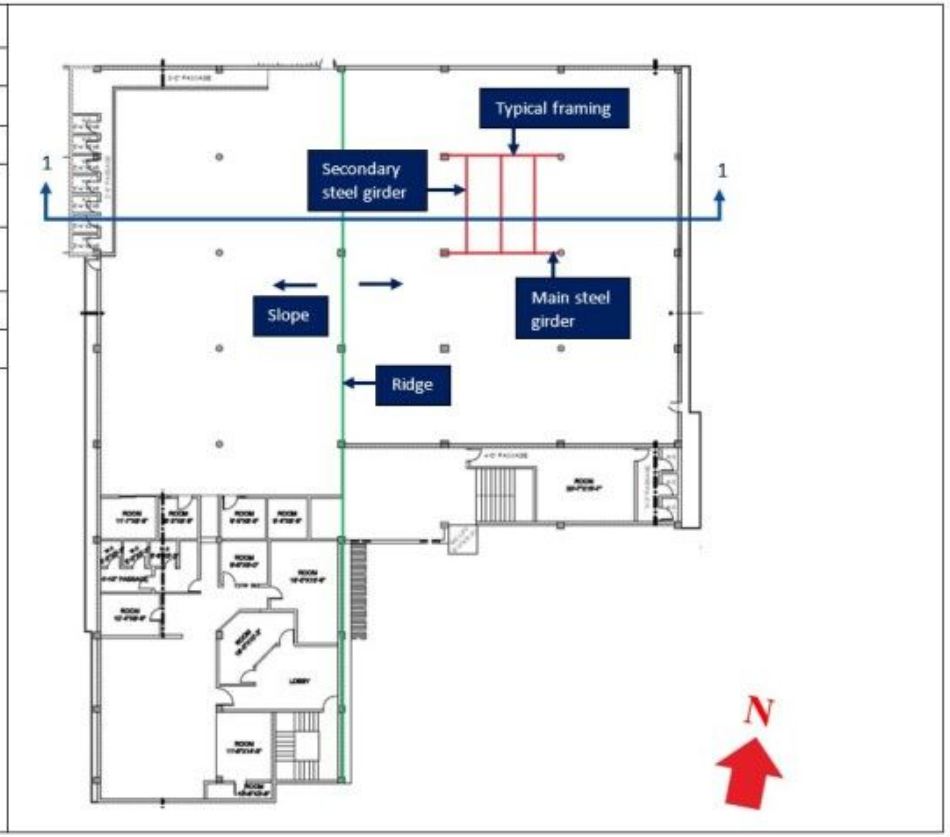


Figure 1.10. Roof framing layout of main building

Building	Main Building
Stability system	RC Moment Resisting Frame
Column size (m)	0.47 dia 0.4 x 0.4
Grid (m)	6.1 x 7.8
Primary beam size (m)	0.25 x 0.6
Secondary beam size (m)	0.2 x 0.6 (1st slab only)
Slab depth (m)	0.15
Finishes depth (m)	0.1
Ceiling height (m)	5.5 (ground to 1st floor) 2.4 (mezzanine to 1st floor) 3.3 (1st floor to 2nd floor) 3.5 (2nd floor to 3rd floor)


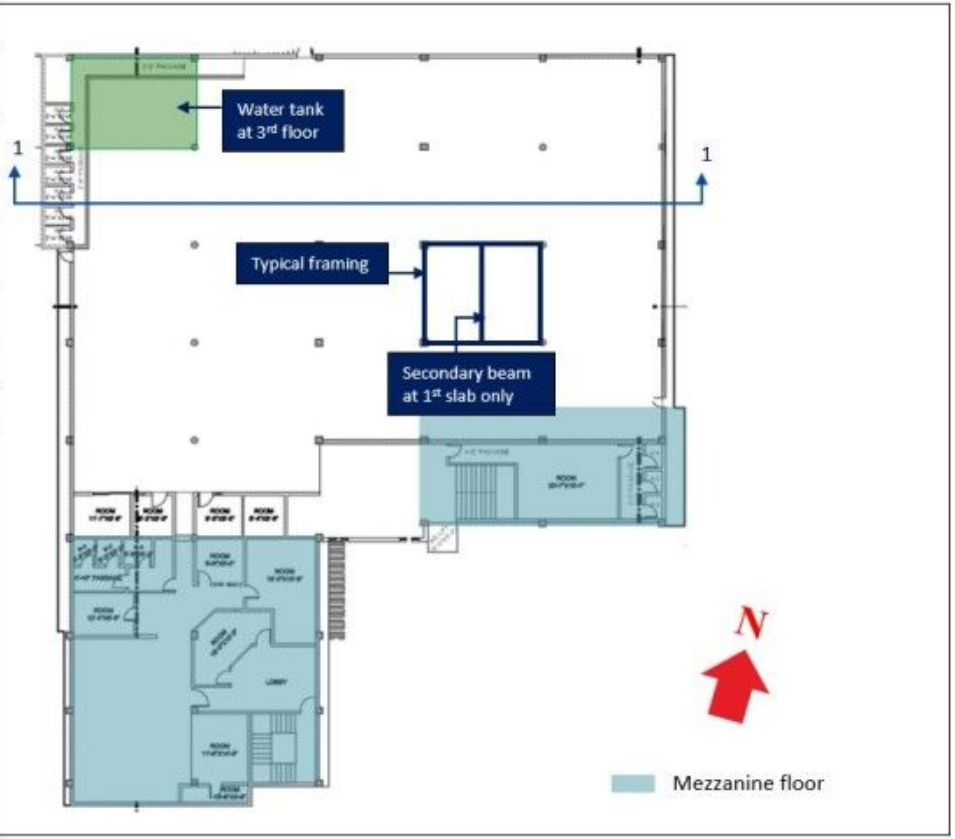


Figure 1.11. Mezzanine, 1st, 2nd & 3rd floor framing layout of main building

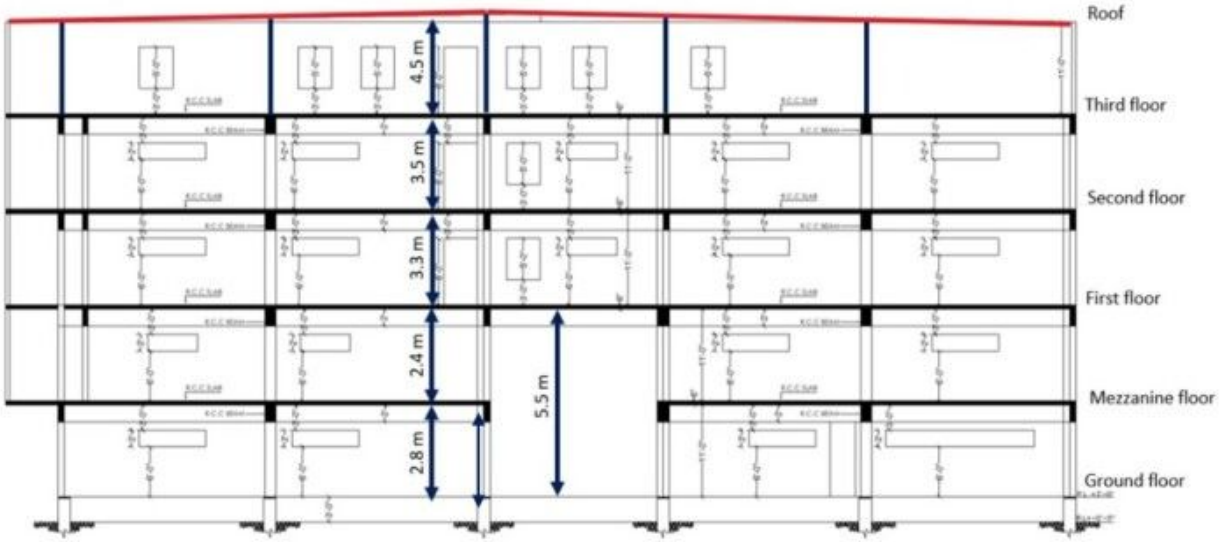

Structural System Notes

Column size is the structural dimension and excludes render thickness

Grid measurements are from centre of column to centre of column

Beam sizes do not include slab depth

Figure 1.12. Section 1-1 of main building

3. Documentation

We were presented with the following documentation.

Table 2 - Documentation

Building	Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plan	Stability certificate	Inspection reports	Materials testing
Main Building	Yes	No	Yes	No	Yes (But incomplete)	No	Yes	Yes	Yes (Core strength approx. 18 MPa)
Ancillaries									
Masjid	Yes	No	Yes	No	Yes (Architectural only)	No	Yes	No	No
Gate office	Yes	No	Yes	No	Yes (Architectural only)	No	Yes	No	No
B1	Yes	No	Yes	No	Yes (Architectural only)	No	Yes	No	No
B2	Yes	No	Yes	No	Yes (Architectural only)	No	Yes	No	No

4. Structural Safety Measures

During our structural site inspection of Usman & Sons, a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within Usman & Sons. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3: Summary of issues by building

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Main building	Highly stressed column	-	-	-	Damaged structural element Spalling concrete Health & Safety -Edge protection	Lack of safe load plan Documentation unavailable
Ancillaries						
Masjid	-	-	-	-	-	-
Gate office	-	-	-	-	-	-
B1	-	-	-	-	-	-
B2	-	-	-	-	-	-

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202605-067469

Timeline	Remediation Plan
Medium Term CAP-0081165	Factories should begin remediation of CAP items—such as surface cracks or non-structural repairs—using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Potential Overstress

6.1 Highly stressed columns

A few interior columns of the main building at the ground floor level appear to be overstressed based on the observed loading conditions. The likely cause of the overstressing is the additional load imposed by the overhead water tank and the additional mezzanine floor.

Column analysis and design calculations were available for a limited number of columns; however, supporting analysis and design documentation for the overhead water tank and the mezzanine floor were not available.F-202605-067251

Timeline	Remediation Plan
Medium Term CAP-0083314	Verify strength of reinforcement through laboratory tensile strength testing.
Medium Term CAP-0083315	Factory Engineer to review design, loads and columns stresses in area identified above.
Longer Term CAP-0083316	Produce and actively manage a loading plan for all floor plates within the factory giving consideration to floor capacity and column capacity.

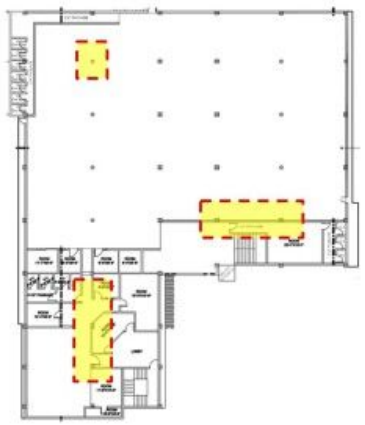


Figure 2.1 - Plan showing approximate location of overstressed columns

7. Other Damage/Defects

7.1 Spalling concrete

This concern relates to the main building, where slab spalling has been observed at the 1st and 2nd floors, particularly in the toilet areas and slab projections. The likely cause of the spalling is inadequate drainage and water leakage, which may have resulted in deterioration of the slab concrete. F-202605-067303

Timeline	Remediation Plan
Medium Term CAP-0080962	Identify the cause of the damage / source of water ingress and propose measures to prevent further water damage
Medium Term CAP-0080963	Inspect damage to the slab and propose repairs to structure Submit report capturing above to Pakistan Accord for approval
Longer Term CAP-0080966	Implement remedial works
Longer Term CAP-0080967	Continue to monitor for future signs of water ingress/damage



Figure 2.2 - Spalling in cantilever slab at 2nd floor in main building



Figure 2.4 - spalling in slab in toilet areA with corroded reinforcement at 1st floor in main building



Figure 2.3 - Spalling in slab in toilet area at 2nd floor in main building

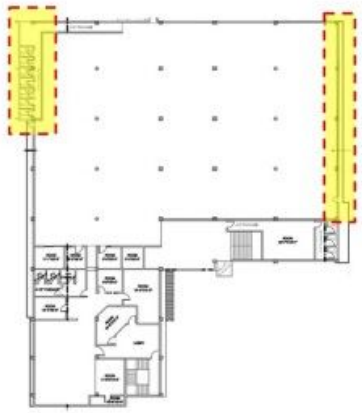


Figure 2.5 - Approximate location of damaged areas of main building

7.2 Damaged structural element

This observation relates to main building, where excessively damaged structural members (columns, beams and slab) with exposed reinforcement were observed at multiple floors. The activity has been done for rebar verification but not repaired. F-202605-067305

Timeline	Remediation Plan
Immediate CAP-0081174	Immediately repair the affected structural members using approved repair materials and methodologies



Figure 2.6 - Damaged column at 2nd floor in main building



Figure 2.7 - Damaged beam at 1st floor in main building



Figure 2.8 - Damaged slab at 3rd floor in main building

7.3 Health and Safety

It concerns with inadequate edge protection which present a risk of potential injury resulting from slip, trip or fall from 3rd floor at missing staircase railing during the access and maintenance of services – Health & Safety concern F-202605-067304

Timeline	Remediation Plan
Immediate CAP-0080968	Provide adequate edge protection at staircase on 3rd floor, and on any other part of the factory with the same issue.



Figure 2.9 - Missing protection at staircase at 3rd floor of main building

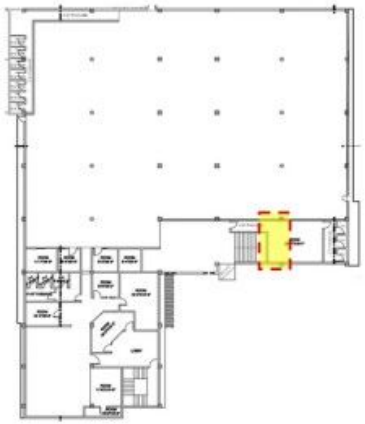


Figure 2.10 - Plan showing location of missing edge protection in main building

8. Structural Documentation

8.1 Documentation unavailable

Structural drawings of roof steel shed of main building are unavailable, also column shape and dimension at few columns are mismatching in architectural and structural drawings F-202605-067252

Timeline	Remediation Plan
Longer Term CAP-0080961	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as-built documentation

8.2 Lack of safe load plans

No safe load plans posted on any floor of the main building. F-202605-067250

Timeline	Remediation Plan
Longer Term CAP-0080959	Building structural engineer to review design documentation to confirm load capacity of the structure. Develop safe load plans and submit to Pakistan Accord for review
Longer Term CAP-0080960	Factory to post safe load plans on each floor

9. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.