Issue	**01**
Factory ID	**25401**
Date of Issue	**15-Jul-2025**

Velocity Textiles

F-235, S.I.T.E, Near Indus University, (Site Campus)
75700 Karachi
Sindh Pakistan

Latitude: [24.905947], longitude: [66.988821]
Date of inspection: 29-Jan-2025

Fire Safety Inspection Report

Observations & Actions



Authors	**Muhammad Imran**
Reviewed by	**Usama Zia**
Approved by	**Paul Rigby**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 29-01-2025 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Pakistan ACCORD for Health and Safety in the Garment and Textile Industry

Contents

1. Executive Summary 5
2. Building Extents 7
3. Building Description 11
   - 3.1 Building Means of Egress Details 12
   - 3.2 Building Use 15
4. Documentation 17
5. Fire Safety Measures 19
6. Means of Escape 20
   - 6.1 Escape doors 20
   - 6.2 Exit access 22
   - 6.3 Travel distance 25
   - 6.4 Protection of stairs 26
   - 6.5 Escape stair condition 29
   - 6.6 Exit discharge 31
   - 6.7 Exit signage 33
7. Fire Rated Construction 35
   - 7.1 Separation of high-risk areas 35
   - 7.2 Separation of shafts 37
   - 7.3 Separation of occupancies 39
   - 7.4 Storage 40
8. Fire Suppression 42

8.1 Standpipe system....42
8.2 Fire pumps....44
8.3 Water supply....45
9. Fire Safety Management....46
9.1 Fire drills....46
9.2 Records of system testing....47
9.3 Records of systems maintenance....48
9.4 Emergency Action Plan....49
10. Assessment Limitations and Assumptions....50

1. Executive Summary

On 29-Jan-2025, Fraz Hyder and Dr. Muhammad Imran on behalf of the Pakistan Accord carried out an initial fire inspection for Velocity Textiles, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representatives Mr. Rizwan Butt (Admin Manager), Mr. Syed Mudassir (Compliance officer), Mr. Hamza (Compliance officer), Mr. Uzair (Electrical engineer) and other representatives from the factory were also present. As the assessment was being carried out as part of an overall Structural, Fire and Electrical initial inspection, other representatives from Pakistan Accord were also present.

The factory operates one general shift. Approximately 520 workers are employed in the factory, including 80-90 female workers.

Building 1, a five-storey (Ground+Mezzanine+3) is a combination of reinforced concrete moment resisting frame (RC MRF) and composite slab system with masonry infill on periphery and The mezzanine floor does not comply with Fire Safety provisions under the Pakistan Accord Building Standard and is therefore classified as a full floor, making the building a Five-storey structure (G+M+3), roof is vertically extended with steel structure, is used for offices and washing (ground floor), stitching (Mezzanine floor), stitching, checking and packing (1st and 2nd floor) and storage of goods, prayer area and solar panels (roof). The building was constructed in 2000.

Building 2, a two-storey (Ground+1) is a reinforced concrete moment resisting frame (RC MRF) with masonry infill and roof is of steel portal frame, is used for cutting, storage, warehouse and chemical store (ground), stitching (1st floor) and solar panels (roof). The year of construction is 2000.

Utilities, ground only four different structures which include boiler shed, generator rooms, LT rooms and reinforced concrete ETP structure and a compressor is installed on the roof. The year of construction is unknown.

During the inspection, the area highlighted in Figure 1.1 was inspected, with the site boundary indicated in red. One building and a scrap area were not inspected, as they are shared with other tenants. While the area not inspected during the initial inspection will be covered in the follow-up inspection.
We were presented with building layout plan, Emergency response plan, Fire training and drill record and inspection record and other documents, details listed in Table 2.

A summary of the main concerns identified during the inspection includes (non-exhaustive):

- Lack of fire separation between the stair and stair discharge routes on the ground floor.
- Locking devices on doors along emergency escape routes (e.g., final exit doors from the site and various escape doors at all levels of emergency stairs).
- Inadequate compartmentation to the lift shaft throughout facility.
- No Fire pumps and controllers available in the facility.
- Building(s) XYZ is/are not protected by Standpipe system.
- The dormitory (Watchman Room) is not to be used until minimum requirements for sleeping occupancies have been provided. Alternative arrangements must be sought immediately for the dormitory as continuing the use of the building for this purpose is not appropriate.

We see no reason to suspend operations in the facility due to these concerns. Actions with associated priorities and timeframes are given in the detailed section of this report. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

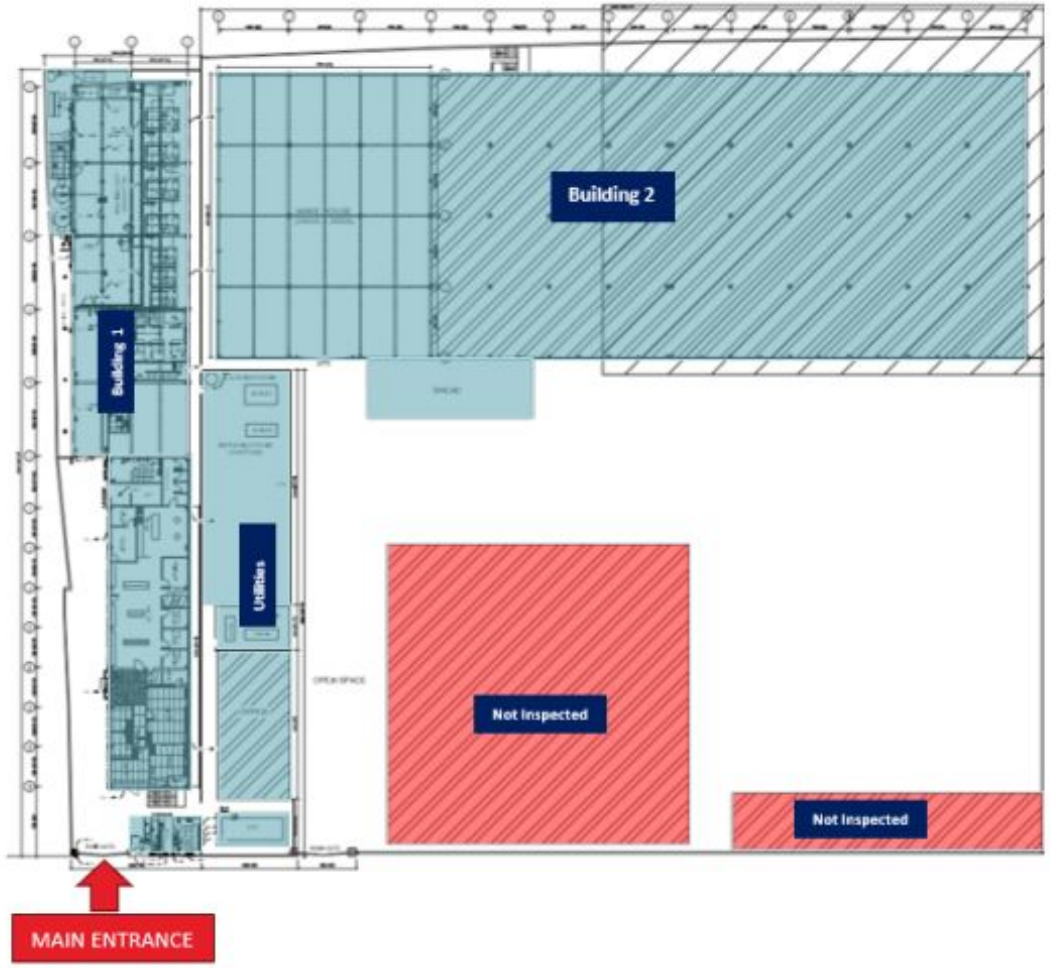


Figure 1.1. Site Layout of velocity textiles



Figure 1.2. Site plan (Satellite view) - Red dashed line indicates site boundary

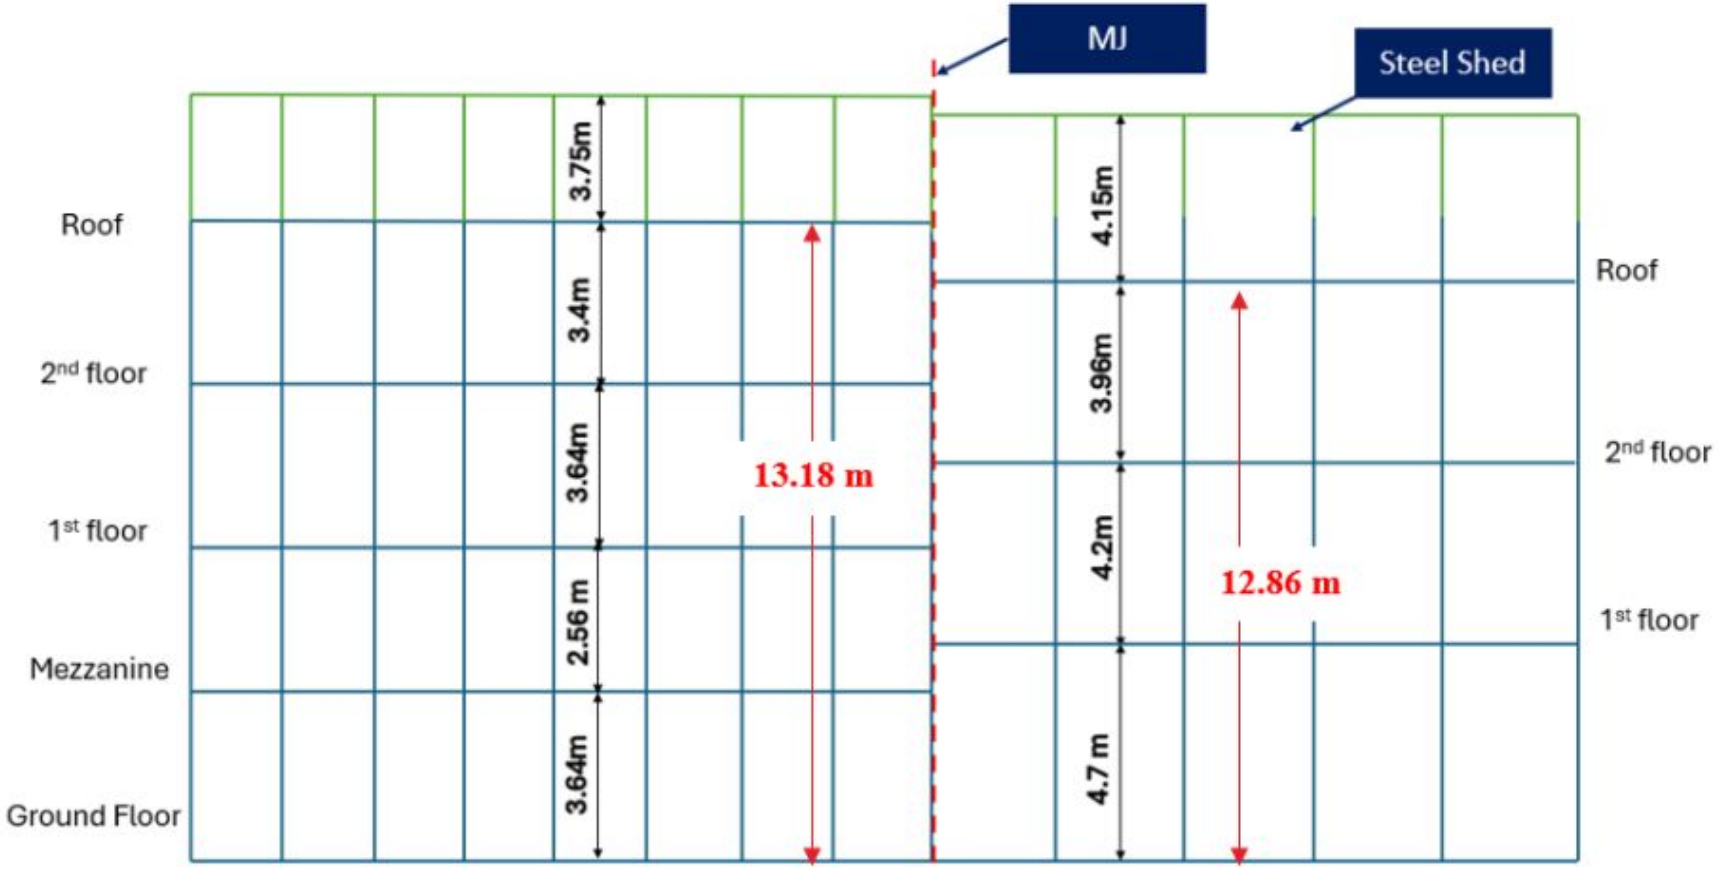


Figure 1.3. Typical Section for Building 1

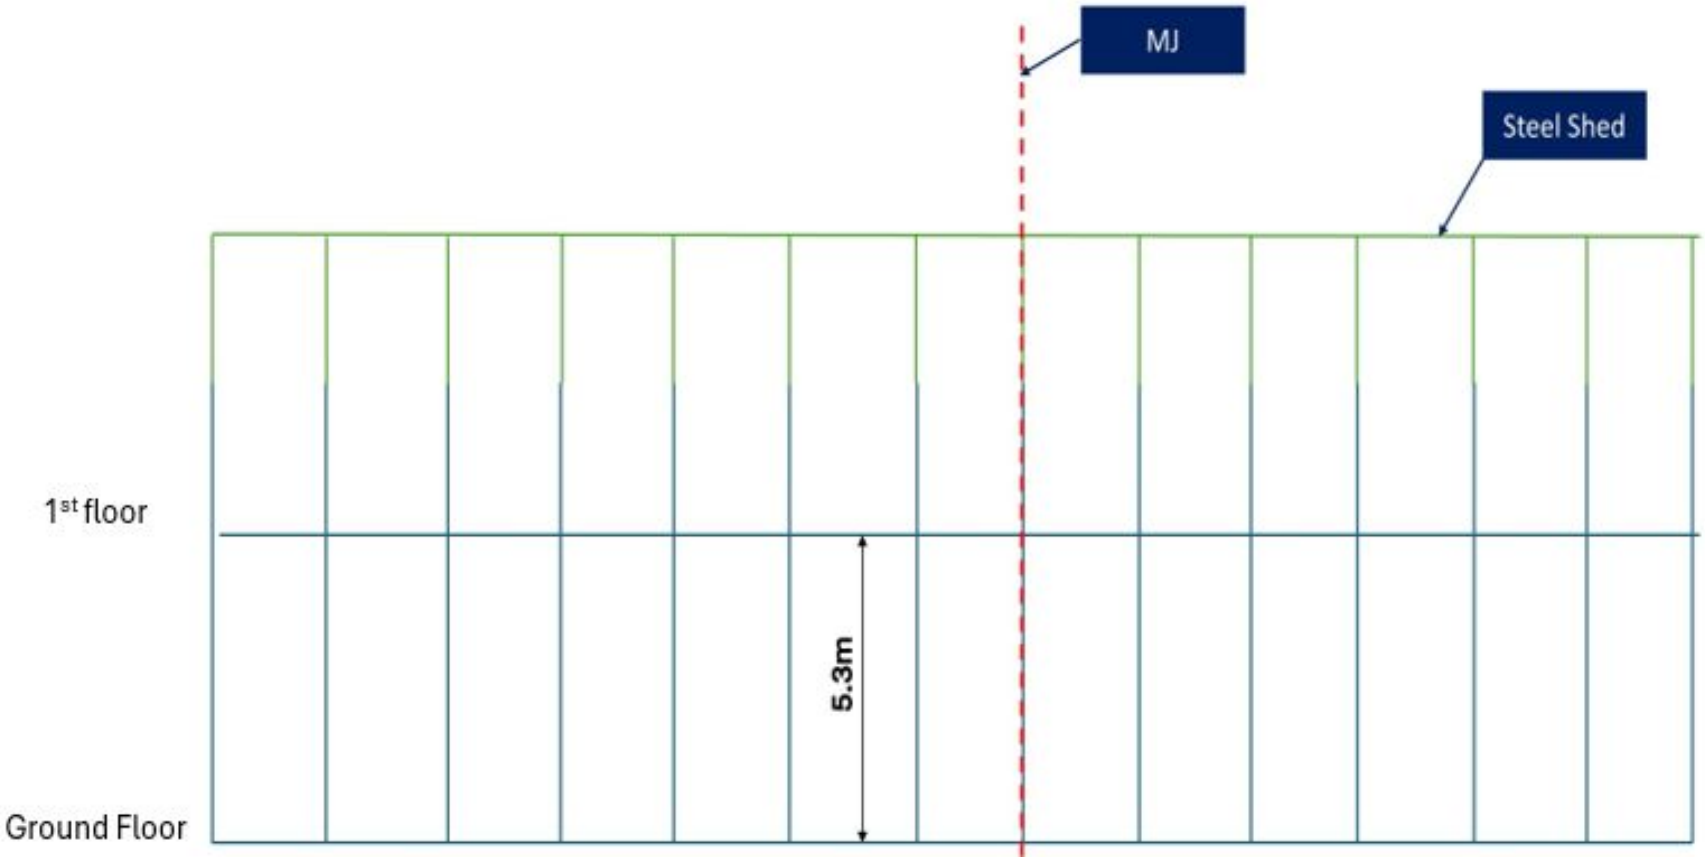


Figure 1.4. Typical Section for Building 2

3. Building Description

The factory comprises 02 buildings and a Utility Building owned by Velocity. During the inspection, the buildings highlighted in Figure 1 were surveyed, with the site boundary indicated in red:

Building 1, a five-storey (Ground+Mezzanine+3) is a combination of reinforced concrete moment resisting frame (RC MRF) and composite slab system with masonry infill on periphery and The mezzanine floor does not comply with Fire Safety provisions under the Pakistan Accord Building Standard and is therefore classified as a full floor, making the building a Five-storey structure (G+M+3), roof is vertically extended with steel structure, is used for offices and washing (ground floor), stitching (Mezzanine floor), stitching, checking and packing (1st and 2nd floor) and storage of goods, prayer area and solar panels (roof). The building was constructed in 2000.

Building 2, a two-storey (Ground+1) is a reinforced concrete moment resisting frame (RC MRF) with masonry infill and roof is of steel portal frame, is used for cutting, storage, warehouse and chemical store (ground), stitching (1st floor) and solar panels (roof). The year of construction is 2000.

Utilities, ground only four different structures which include boiler shed, generator rooms, LT rooms and reinforced concrete ETP structure and a compressor is installed on the roof. The year of construction is unknown.

During the inspection, the area highlighted in Figure 1.1 was inspected, with the site boundary indicated in red. One building and a scrap area were not inspected, as they are shared with other tenants. While the area not inspected during the initial inspection will be covered in the follow-up inspection.

3.1 Building Means of Egress Details

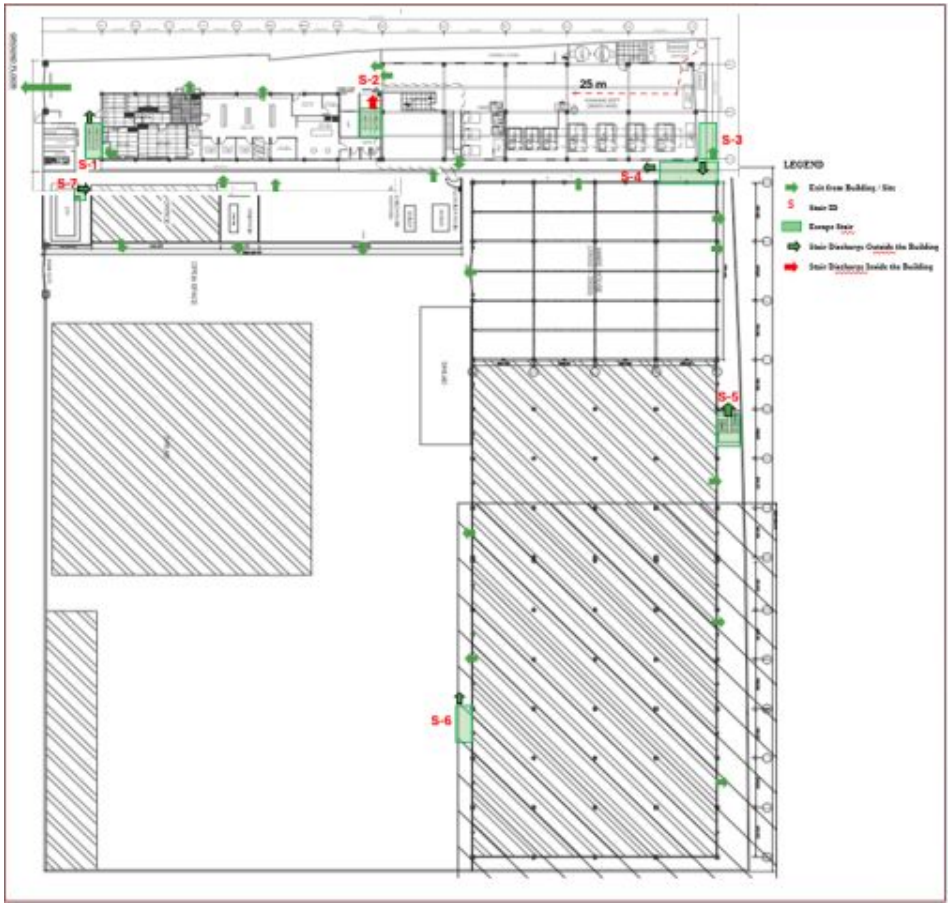


Figure 1.5. Ground Floor Egress Layout of Building 1 & 2

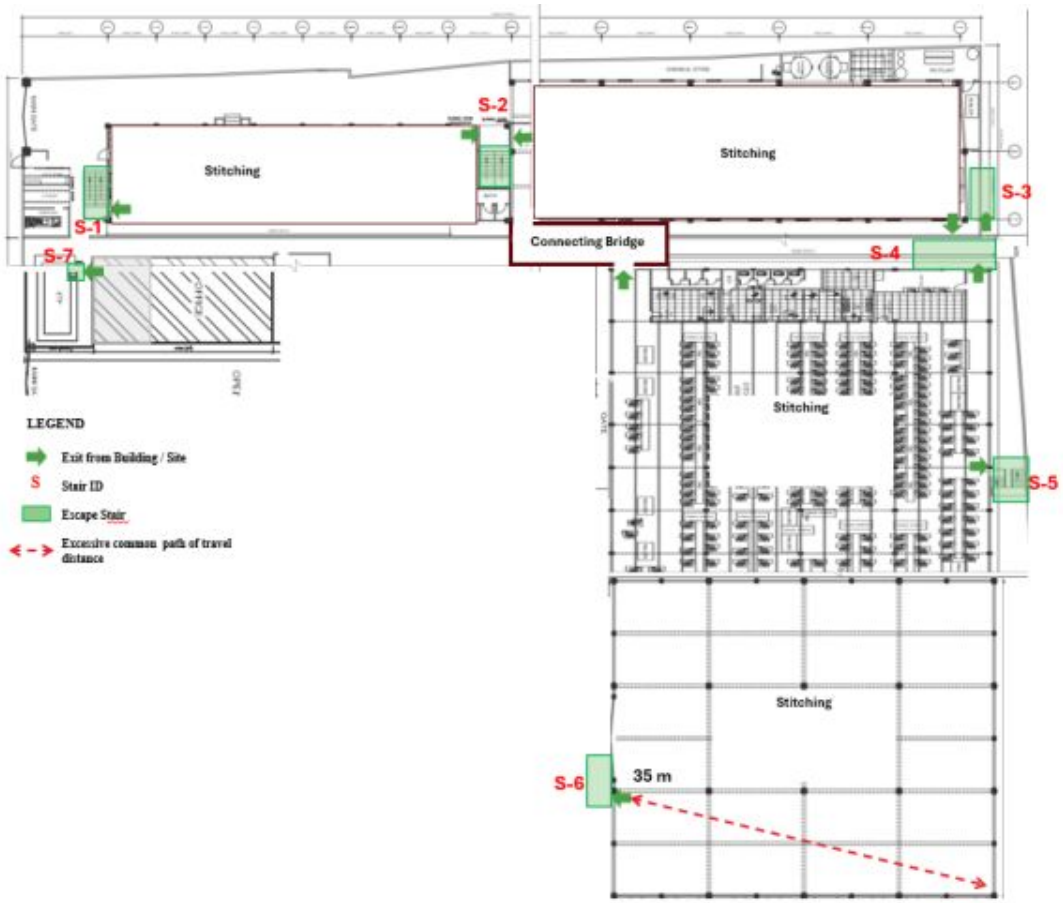


Figure 1.6. 1st Floor Egress Layout of Building 1 & 2



Figure 1.7. Mezzanine, 2nd and Roof Floor Egress Layout of Building 1

3.2 Building Use

Table A provides a floor-by-floor breakdown of building usage, maximum occupant load, and the number of floors exits, based on the facility inspection.

Floor Level Building 1	Occupancy	Occupant Load	No. of Exits	Excessive Travel Distance		
				Alternative Paths	Common Path	Dead End
Roof	Praying Area and Storage	200	03	-	-	-
2nd Floor	Stitching, checking and packing	150	03	-	-	-
1st Floor	Stitching, checking and packing	150	03	-	-	-
Mezzanine	Stitching	60	02	-	-	-
Ground Floor	Offices and Washing	120	06	-	25m	-

There is sufficient exit capacity in the Building however excessive travel distance issues found during inspection at Ground Floor.

Table B provides a floor-by-floor breakdown of building usage, maximum occupant load, and the number of floor exits, based on the facility inspection.

Floor Level Building 2	Occupancy	Occupant Load	No. of Exits	Excessive Travel Distance		
				Alternative Paths	Common Path	Dead End
Roof	Solar	-	01	-	-	-
1st Floor	Stitching	400	04	-	35m	-
Ground Floor	Cut to Pack & Waste Storage	250	09	-	-	-

There is sufficient exit capacity in the Building however excessive travel distance issues found during inspection at 1st Floor.

Table C provides a floor-by-floor breakdown of building usage, maximum occupant load, and the number of floor exits, based on the facility inspection.

Floor Level Utility Building	**Occupancy**	**Occupant Load**	**No. of Exits**	**Excessive Travel Distance**		
				Alternative Paths	Common Path	Dead End
Roof	Office, ETP	03	01	-	-	-
Ground Floor	ETP Tank, Generator, Boiler, offices	08	06	-	-	-

There is sufficient exit capacity in the Building no excessive travel distance issues found during inspection.

4. Documentation

No.No.	Description	Availability Yes/No	Created/Updated Date	Status/Remarks
1	Layouts	Yes	-	-
2	Section Layouts	No	-	Not provided
3	Fire Drill	Yes	13-11-2024 08-08-2024	Not as per Pakistan Accord Building Standard no attendance, Frequency is random
4	Emergency Action Plan	Yes	-	Not As per Accord standard: No details
5	Inspection	Yes	07-01-2025	Not as per Pakistan Accord Building Standard Doors, Extinguisher, Emergency Light (monthly) Seems all Ok no issue was highlighted
6	Testing	No	-	Not provided
7	Maintenance	No	-	Not provided
8	Evacuation Maps	-	-	On Floor but misleading

9	Staff Training	Yes	08-11-24 06-08-2024	Not as per Pakistan Accord Building Standard Fire Extinguisher, First Aid and Fire Prevention

5. Fire Safety Measures

During our fire site inspection of Velocity Textiles, a number of fire issues were identified.

It is essential to address these fire safety issues promptly to enhance safety and compliance within Velocity Textiles. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

6. Means of Escape

6.1 Escape doors

Per Pakistan Accord Building Standard, escape doors must meet several requirements so that they can be relied on for escape, the key requirements include:

- Doors must not have locking devices regardless of the door is kept locked or unlocked (if a lock is provided, e.g. to prevent unauthorized entry, then it must be overridden by panic hardware).
- Doors must have and opening mechanisms that allows for easy opening without key or prior knowledge.
- Door should be sufficiently wide for escape considering the number of people using it.
- Doors into stairs, stair discharge doors, final exit doors from site, and all doors serving areas with more than 50 occupants shall swing in the direction of escape.
- Sliding doors shall not serve for escape from areas with more than 10 occupants

This is not always achieved, examples include (list not exhaustive):

- Sliding doors observed at most of the emergency access and Exit doors at most of the buildings e.g. Building 1 2nd floor.
- Most of the exit doors found lockable e.g. All Emergency Exit Doors
- Discharge doors from swing against the direction of escape e.g. Building 2 Ground Floor.

Recommended remedial actions are provided below:F-202506-017848

Timeline	Remediation Plan
Immediate FIN-0023317	Remove all locking devices from doors on all egress routes that could prevent opening from inside.
Medium Term FIN-0023318	Escape doors to be side hung doors that open in the direction of escape and provided with easily opening door mechanisms compliant with Accord Building Standard Section 1 Clauses 1.4 and 1.5. Replace sliding doors with swing doors or provide bypass doors nearby or pocket doors built into the existing sliding door, that are side swinging and open in the direction of travel to an exit.
Longer Term FIN-0023319	Monitor escape door to ensure there are no locking devices installed that prevent easy access to emergency exits.



Figure 2.1 - Locable Door at Roof Floor



Figure 2.2 - Locable Door at Ground Floor



Figure 2.3 - Sliding Door at Exit Access at 2nd Floor Building 1



Figure 2.4 - Door Swinging and Blocking in the Direction of Exit Access Building 2

6.2 Exit access

Per Pakistan Accord Building Standard, escape routes within the building should be sufficiently wide and safe for use in and event of an emergency.
- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.
- Headroom along escape route should be more than 2.05m.

This is not always achieved, examples include (list not exhaustive):

- Obstructions on escape route e.g. 3rd Floor Building 1 & Ground Floor and 1st Floor Building 2.
- Stairs discharge inside the building. e.g. S-2.
- Insufficient headroom along escape route e.g. 1.65m at office Mezznine Floor and 1.74m 3rd Floor Building 1 .

Recommended remedial actions are provided below:F-202506-017980

Timeline	Remediation Plan
Immediate FIN-0023341	- Remove obstructions on escape routes and keep them clear for escape - Provide warning signs where headroom height is less than 2.05 m on escape routes.
Medium Term FIN-0023342	For stairs discharging within the building, prepare drawings showing the proposed fire separating construction to stair discharge routes. These shall be submitted to Accord for review and approval prior to the rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge routes - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Propose modifications to ensure 2.05m headroom height is achieved along the escape routes or propose alternative egress routes that comply. Submit the proposal to Pakistan Accord for review.

Longer Term FIN-0023343	Ensure stair discharge routes / corridors are adequately fire separated from the rest of the building or any fire hazards using 2 hours fire separating construction with 90 minute fire doors. The design shall follow Accord Building Standard. Some of the key requirements include: - All doors into stair discharge corridors need to be fire resisting doors (except stair discharge doors to external air). Penetrations through doors are not permitted. All fire doors require self-closers. Doors into exit discharge routes should be kept closed (but not locked) at all times. - All penetrations through walls into stair discharge routes need to be fire stopped. Unprotected openings (e.g. holes or window/ louver openings) are not permitted. - Ensure external escape routes are relocated so that they do not pass via high-risk areas. - Implement measures to ensure adequate clear head height is achieved along all escape routes.



Figure 2.5 - Obstructions 1st Floor Building 2



Figure 2.6 - Exit Access obstructions 3rd floor Building 1



Figure 2.7 - Headroom 1.65 office Mezznine Building 1



Figure 2.8 - Building 1 headroom 1.74m at Exit Access



Figure 2.9 - Obstructions 1st Floor Building 1

6.3 Travel distance

Travel distances should meet the limits in the Pakistan Accord Building Standard. The standard provides limitations on:

- Common path of travel, i.e. the distance the occupants have to travel before there is a choice of escape routes.

This is not always achieved, examples include (not exhaustive; a thorough facility review is required to ensure compliance):

- Common path of travel distances exceeds permitted limits e.g. Building 2 1st Floor (35 m) and Building 1 Ground Floor (25m). F-202506-017844

Timeline	Remediation Plan
Medium Term FIN-0023234	Propose a plan for addressing the excessive travel distance through alternative escape routes and/or additional exits and submit to Pakistan Accord for review prior to commencing any rectification works on site. Review travel distances from all areas in the building(s) to ensure that they meet the limits in the Pakistan Accord Building Standard.
Longer Term FIN-0023235	Implement the above plan agreed with Accord. All travel distances on site should be compliant with Accord Building Standard.

6.4 Protection of stairs

Per Pakistan Accord Building Standard, exit stairs should be adequately protected, including:

- Stairs to be fire separated from the rest of the building using 2 hour fire resisting construction with 90 minute fire rated doors. Fire resistance rating is not required to the external walls of the stair that do not face into the building and is also not required to the final exit door leading outside the building.
- Stair discharge routes should be protected to the same level of safety as the stair.
- There should be no fire load and/or services passing through a stair.

This is not always achieved, examples include (list not exhaustive):

- Unprotected openings into stairs e.g. S-1, S-2 and S-3.
- Doors not fire doors e.g. All emergency Stairs.
- Services passing through or within stairs e.g. S-2.
- No fire rated enclosure for S-2.
- Emergency Stairs are not fire separated by fire rated enclosure and fire door S-1, S-2 and S-3.
- Stair discharge route is not fire separated from the building e.g. S-2.

Recommended remedial actions are provided below:F-202506-017845

Timeline	Remediation Plan
Medium Term FIN-0023249	Prepare drawings showing proposed fire separating construction to protect stairs. These shall be submitted to Accord Pakistan for review and approval prior to rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect the stairs. - Details of proposed fire resisting walls and fire door assemblies (e.g. fire door listing, fire rating period, self-closers, door opening direction, details of the door opening mechanism and locks). - Location of stair discharge routes and details of fire resisting construction to protect that route.

Longer Term FIN-0023250	Ensure all stairs are fire separated from the rest of the building using 2 hours fire separating construction with 90-minute fire doors. The design shall follow Building code of Pakistan Section 10.3.2.1. Key requirements include: - All doors into stairs should be fire resisting doors. Penetrations through doors are not permitted. All fire doors require self-closers. Doors into stairs should be kept closed (but not locked) at all times. Note that the final exit door from a stair to outside the building does not need to be fire rated. - All penetrations through stairs need to be fire stopped. Unprotected openings (e.g. holes or window/louver openings) are not permitted. - Where stairs discharge within a building, a fire separated corridor shall be provided that leads outside building.



Figure 2.10 - Building 1, 2nd Floor Doors are not Fire Door Nor Fire Rated Enclosure



Figure 2.12 - Building 1 3rd Floor Opening into Stair S-1



Figure 2.11 - Building 1 1st Floor Opening into Stair S-3



Figure 2.13 - Building 1 2nd Floor Services Passing through S-2

6.5 Escape stair condition

Per Pakistan Accord Building Standard, escape stairs should be design to be safe for use, including day to day use.
This is not always achieved, examples include (list not exhaustive):

- Stair balustrades are not safe e.g. S-1 and S-2.
- There are no/ single sided handrails e.g. S-1, S-2, S-5
- Stair are not Structurally safe e.g. S-1.

Recommended remedial actions are provided below:F-202506-017847

Timeline	Remediation Plan
Longer Term FIN-0023290	Ensure the following are provided: - Stair structure to be fixed so that stairs are safe for escape. - Ensure all stairs have balustrades. - Handrails to be provided on both sides of each stair. Ensure the handrails are at appropriate height BCP 15.3.3..



Figure 2.14 - Building 1 Stair S-3 Balusrades are not Safe



Figure 2.15 - Single Sided Handrail at S-2 Building 1



Figure 2.16 - Single Sided Handrail at S-5 Building 2

6.6 Exit discharge

Exit discharge routes outside the building should be sufficiently protected so that people can escape safely in the event of fire anywhere in the building. This includes:

- Stairs that discharge inside the building should have routes to the exit that are fire separated from occupancies in the building.
- External escape routes should not lead via high-risk areas.
- Where there is no safe assembly point on site, the final egress routes from site should be sufficiently wide and open in the direction of escape to enable escape to public way. Exits from site should be arranged so that a single fire event will not compromise all site exits.

This is not always achieved, examples include (list not exhaustive):

- Exit discharge routes are not fire separated e.g. Ground Floor.
- External escape routes are through high risk areas e.g. Boiler at Ground Floor.
- Obstruction at exit discharge route at Ground floor building 2.

Recommended remedial actions are provided below:F-202507-019468

Timeline	Remediation Plan
Immediate FIN-0025396	Remove obstructions on external escape routes and keep them clear for escape.
Medium Term FIN-0025397	Prepare drawings showing proposed fire separating construction to exit discharge routes. These shall be submitted to Accord for review and approval prior to commencing rectification works. The drawings should cover: - Layout showing the location of fire rated walls/doors to protect stair discharge routes. - Details of proposed fire resisting walls and fire door assemblies required to protect discharge routes - Provide additional exits from site.
Longer Term FIN-0025398	- Ensure external exit discharge routes are adequately fire separated from the rest of the building. - Ensure external escape routes do not pass close to unprotected high-risk areas.



Figure 2.17 - Boiler is Not Fire Seperated From Exit Discharge Route at Ground Floor Building 1



Figure 2.18 - Obstructions at Discharge Route at Ground Floor Building 2

6.7 Exit signage

Per Pakistan Accord Building Standard, exits (e.g. escape stairs or final exits leading directly outside the building) must be clearly marked by approved exit signs. Additionally, escape routes leading to these exits need to be signed where the escape route is not readily apparent. The aim of these provisions is for the occupants to be able to easily find and escape route in and event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):

- Missing exit signs at stair discharge routes e.g. Building 1 & 2,
- Missing exit signs in corridors and circulation areas throughout facility.
- Missing exit signs in production area Building 1 and Building 2.
- Exit signs are not clear / misleading e.g. Building 1 & 2 production and storage area

Recommended remedial actions are provided below:F-202506-017846

Timeline	Remediation Plan
Immediate FIN-0023276	Remove misleading direction arrows from the means of egress.
Medium Term FIN-0023277	- Rectify and/or provide exit signage so access to exits is marked by approved, readily visible signs from all areas of the floor and clearly visible at exits, to comply with Pakistan Accord Building Standard and BCP 10.15.1, 10.15.2 and 10.15.3 - Rectify signs and provide new signage to comply with Accord Standard. - Remove any misleading exit signs.
Longer Term FIN-0023278	Ensure that all exit signage is checked periodically and in good working condition.



Figure 2.19 - Building 2 1st Floor No Exit Siganges in Production Area

7. Fire Rated Construction

7.1 Separation of high-risk areas

Per Pakistan Accord Standard, increased fire risk areas require to be fire separated from the rest of the building using the following:
Electrical rooms, Generator rooms, Fire Pumps room, and Hazardous waste room: 2-hour fire resisting construction with 90 minutes fire doors
The following deficiencies have been observed on site, including (list not exhaustive):

- Boiler is not fire separated from the rest of the building e.g. Utility builidng Ground Floor.
- Electrical rooms are not fire separated. e.g. Utility builidng Ground Floor and at S-2 Building 1.
- Generator room is not fire separated e.g. Utility builidng Ground Floor.F-202507-019404

Timeline	Remediation Plan
Medium Term FIN-0025312	Prepare drawings showing the proposed fire separation details of increased fire hazard areas. These shall be submitted to Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of all increased fire hazard areas in the building (e.g. storage, electrical rooms, mechanical rooms, fire pump room etc.). - Locations of fire rated walls and doors to protect these rooms. - Details of proposed fire rated walls and fire doors (e.g. door listing, self-closers, door opening direction).
Longer Term FIN-0025313	Provide 2-hour fire rated construction including 90-minute fire rated doors assemblies according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.20 - Boiler is Not Fire Seperated From Building 1



Figure 2.21 - Building 1 is Not Fire Seperated From Electrical Room, Boiler and Generator Area at Ground Floor

7.2 Separation of shafts

Per Pakistan Accord Standard, shafts should be enclosed in 2-hour fire resisting construction with 90 minutes fire rated doors.
The following deficiencies have been observed on site, including (list not exhaustive):

- Lift shafts are not fire separated throughout facility.

Recommended remedial actions are provided below:F-202506-017831

Timeline	Remediation Plan
Medium Term FIN-0023123	Prepare drawings showing the proposed fire separation details of vertical shafts. These shall be submitted to Accord for review and approval prior to the rectification works. The drawings should cover: - Locations of fire rated walls and doors enclosing vertical shafts. - Details of fire rated walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction).
Longer Term FIN-0023124	- Separate lift shaft by fire-rated construction with fire rated opening protective assemblies, as per reviewed proposal and in accordance with Accord Pakistan Building Standard. - Ensure that the proposed design modifications are implemented and operational on site. - Provide 2-hour fire rated protection to lift shafts according to the layouts and documents reviewed by Pakistan Accord.



Figure 2.22 - Lift Shaft is not Fire Seperated Through out Facility at Building 1

7.3 Separation of occupancies

Per PBC (2016), residential dormitories should comply with special measures required for sleeping occupancies. Such measures include:
- Fire separation of dormitories from other occupancies.
- Providing a minimum of 2 escape routes from the above ground levels.
- Providing an automatic fire detection and alarm system.
- Fire separation of cooking facilities/kitchens from the remainder of the dormitory.

The following deficiencies have been observed on site, including (list not exhaustive):
- Lack of fire rated separation between the dormitory and other occupancy types e.g. Guard Sleeping Room at Roof Building 1. F-202506-017849

Timeline	Remediation Plan
Immediate FIN-0023327	- The dormitory is not to be used until minimum requirements for sleeping occupancies have been provided. Alternative arrangements must be sought immediately for the dormitory as continuing the use of the building for this purpose is not appropriate. - Dormitory not to be re-occupied until the minimum requirements have been implemented.
Medium Term FIN-0023328	- Ensure that evacuation plans are provided on each level. - Document proposals for design of remedial measures to ensure compliance with all fire safety requirements for sleeping occupancies to comply with Pakistan Accord Building Standard. Submit proposals to Pakistan Accord for review.
Longer Term FIN-0023329	Implement remediation measures to ensure full compliance with dormitory requirements of Pakistan Accord Building Standard and Pakistan Building Code in accordance with previously reviewed design.

7.4 Storage

Per Pakistan Accord Standard, extensive storage areas need to be fire separated from the rest of the building using 2 hour fire resisting walls with 90 minutes fire rated doors (except for small ancillary offices or stores).
Limited in-process storage is permitted in production areas, subject to meeting all of the following criteria:

- Combined storage areas do not exceed 10% of the production floor area
- Storage height is less than 2.45 m
- Storage areas are grouped into islands not exceeding 23 m2.
- Islands are separated from other storage islands by at least 3m gap.

The following deficiencies have been observed on site, including (list not exhaustive):

- Storage areas are not fire separated from the rest of the building e.g. Building 1 Roof Storage from Praying Area, 2nd Floor Storage Area .
- Presence of areas where storage does not meet miscellaneous in-process storage requirements (listed above) e.g. Building 1 2nd Floor Stitching area.

Recommended remedial actions are provided below:F-202506-017832

Timeline	Remediation Plan
Medium Term FIN-0023125	Identify all designated storage areas. For all storage areas where storage cannot be managed within in-process storage limitations described above, prepare drawings showings proposed fire separation details of storage areas. These shall be submitted to Pakistan Accord for review and acceptance prior to the rectification works. The drawings should cover the following: - Locations of fire rated walls and doors. - Details of fire walls and fire doors (e.g. listing, fire rating period, self-closers, door opening direction)
Longer Term FIN-0023126	Ensure that the above plan is implemented on site following the previously reviewed documentation and in accordance with Pakistan Accord Building Standard.



Figure 2.23 - Storage is not Fire seperated from Production Area at 2nd Floor Building 1



Figure 2.24 - Excessive In Process Storage at 3rd Floor Stiching Area at Building 1



Figure 2.25 - Excessive Storage at Emergancy Exit at 3rd Floor Building 1

8. Fire Suppression

8.1 Standpipe system

Per Pakistan Accord Building Standard a Class-I standpipe systems is required in the building. The system should be designed and installed in accordance with NFPA 14.
Class I standpipe system is required when the building is more than 2 storeys, and has a floor area greater than 2,325 m2.

The following deficiencies have been observed on site, including (list not exhaustive):
- No standpipe system installed.

Recommended remedial actions are provided below:F-202507-019403

Timeline	Remediation Plan
Medium Term FIN-0025310	1. Submit design documentation for a sprinkler system [along with required standpipe system] and supporting infrastructure to Pakistan Accord for review before purchasing any new equipment. Design documentation to include drawings, technical data sheets and product certifications of all listed equipment to show full compliance of the Suppression System (SUPS) with NFPA 13, NFPA 14, 20, 22, and 24. 2. Submit documentation to Pakistan Accord showing that an L/C has been opened for import of any components required for the SUPS design submitted earlier.
Longer Term FIN-0025311	3. Submit documentation to Pakistan Accord demonstrating that all materials, both imported and locally procured, have been purchased and are available on site for installation of the SUPS. 4. Once installation of the SUPS system is complete, factory to submit full "as-built" documentation of the system to Pakistan Accord for review. 5. Factory to advise Pakistan Accord when SUPS installation fully completed and fully functional. Pakistan Accord will then arrange a verification inspection to ensure that the installation fully complies with the previously reviewed design documentation 6. Provide full testing and commissioning (T&C) certification from the SUPS system installer and make provision for attendance of the system installer, factory technical personnel and Pakistan Accord technical team to witness a final T&C demonstration verification on site. On successful completion of this T&C verification inspection, remediation of the SUPS system will be complete

8.2 Fire pumps

Per Pakistan Accord Standard, a complete fire pump set is required when a standpipe or sprinkler system is required. The pump set should be designed and installed in accordance with NFPA 20. The system should comprise of: a) Electric pump (Main), b) Diesel Pump (Back-Up), and c) Jockey Pump. Each pump should be provided with their individual drivers and controllers. Pumps shall have positive suction. These measures are intended to provide a level of resilience whereby a failure of a pump or lack of power in the building will not compromise fire water supply in the building. These measures are intended to provide a level of resilience whereby a failure of a pump or lack of power in the building will not compromise fire water supply in the building.

The following deficiency was observed on site:

- No Fire pumps and controllers available in the facility.
- There is no diesel pump
- There is no main electric pump
- There is no jockey pump

Recommended remedial actions are provided below:F-202506-017833

Timeline	Remediation Plan
Medium Term FIN-0023127	Provide design for electric duty pump, diesel backup fire pumps and jockey pump, together with individual drivers and controllers, in accordance with NFPA 20 as part of the supporting infrastructure to the SUPS system and submit to Accord for review
Longer Term FIN-0023128	Provide electric duty pump, diesel backup fire pumps and jockey pump, together with individual drivers and controllers, in accordance with NFPA 20 as part of the supporting infrastructure to the SUPS system.

8.3 Water supply

Fire water storage provisions on site should comply with NFPA 24.
The following deficiencies have been observed on site, including (list not exhaustive):

- No fire water tank on site.

Recommended remedial actions are provided below:F-202507-019405

Timeline	Remediation Plan
Medium Term FIN-0025314	Review arrangement of water supply and storage requirements to cover fire water supply as part of supporting infrastructure for the SUPS system, in accordance with NFPA 22 & 24, and submit to Accord for review.
Longer Term FIN-0025315	Provide fire water supply and storage that complies with Building Code of Pakistan and NFPA 22 & NFPA 24 as part of the supporting infrastructure to the SUPS system.

9. Fire Safety Management

9.1 Fire drills

Per Pakistan Accord Building Standard, fire drills shall be conducted as a minimum twice a year. The aim of these drills is to make sure that all staff is adequately trained, and suitable provisions are in place to enable timely evacuation in the event of an emergency.

The following deficiencies have been observed on site, including (list not exhaustive):

- Fire drill documentation is not upto standard.
- Not all staff are involved in fire drills F-202506-017975

Timeline	Remediation Plan
Medium Term FIN-0023330	Conduct a fire drill and make records, including findings and recommended future improvements.
Longer Term FIN-0023331	Ensure fire drills are performed a minimum 2 times per year.

9.2 Records of system testing

Per Pakistan Accord Building Standard, all fire safety systems should be adequately tested to ensure they will operate effectively in and event of and emergency. All fire and life safety systems should be tested in accordance with different standards applicable depending on the system type, e.g. fire extinguishers to NFPA 10 etc.

The following deficiencies have been observed on site, including (list not exhaustive):

- Inadequate records of testing of Fire Extinguishers.

Recommended remedial actions are provided below:F-202506-017977

Timeline	Remediation Plan
Immediate FIN-0023335	
Medium Term FIN-0023336	- Prepare a schedule of proposed system testing. - Identify how systems will be tested and who is responsible. - The schedule to be submitted to Accord for review and approval.
Longer Term FIN-0023337	- Ensure all systems are being tested as per the schedule agreed with Accord. - Keep testing records.

9.3 Records of systems maintenance

Per Pakistan Accord Building Standard, all fire safety systems should be adequately maintained to ensure they will operate effectively in and event of and emergency.
All fire and life safety systems should be maintained in accordance with different standards applicable depending on the system type, e.g, fire extinguishers to NFPA 10 etc.
The following deficiencies have been observed on site, including (list not exhaustive):

- Inadequate records of maintenance of Fire Extinguishers.

Recommended remedial actions are provided below:F-202506-017976

Timeline	Remediation Plan
Immediate FIN-0023332	
Medium Term FIN-0023333	- Prepare a schedule of proposed system maintenance. - Identify how systems will be maintained and who is responsible. - The schedule to be submitted to Accord for review and approval.
Longer Term FIN-0023334	- Ensure all systems are being maintained as per the schedule agreed with Accord. - Keep maintenance records.

9.4 Emergency Action Plan

Per Pakistan Accord Building Standard, and Emergency Action Plan shall be developed for each building. The plan shall follow the guidance in NFPA 2800 “Standard on Facility Emergency Action Plans” 2023.
Evacuation plans shall be posted at each exit stair and final exit to the outside. Evacuation plans should indicate the location of the plan (i.e. you are here sign), the location of nearby exits, manual call points, and first-aid firefighting provisions.
An Emergency Action Plan (EAP) report is required for the site. EAP should describe in detail what should happen in the event of a fire, this includes the roles and responsibilities, training needs, emergency equipment requirements, communication protocols etc. EAP should be practiced as part of evacuation drills.

The following deficiencies have been observed on site, including (list not exhaustive):

- Escape diagrams are missing/ misleading on some levels.
- There is no EAP document which details procedures, roles and responsibilities in the event of fire. F-202507-019406

Timeline	Remediation Plan
Medium Term FIN-0025321	- Ensure that evacuation plans are provided on each level. - Prepare an Emergency Action Plan report.
Longer Term FIN-0025322	- Ensure emergency evacuation plans are provided and up to date. Ensure EAP is being practiced as part of fire drills.

10. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.