



K3M5

K3MQ

K3Mx CABLE

STRIPPING INSTRUCTIONS

Tools Required

1. Cable cutter
2. Cable Stripping tools (a, b, c or suitable other)
3. Long nose pliers
4. Screw-driver
5. Retractable safety knife
6. Scissors
7. Tape measure
8. Electrical tape
9. Marker
10. Cut-resistant gloves
11. Safety glasses



Safety Alert



1. Use Protective Personal Equipment (**PPE**) to perform stripping of the cable.
2. Use Cut resistant / heavy leather **gloves** during the cable stripping process to prevent accidental injury.
3. Always wear PPE glasses to protect eyes from flying debris, dust or accidental injury
4. Also, follow the local relevant **safety procedures**.




Stripping Outer Sheaths

- Step 1:** Determine the stripping length required from the cable end & mark it with Electrical tape / a marker. Suggest adding 100 mm to the required stripping length to allow for stripping the sheaths (Outer Polyethylene & Nylon) to expose ripcord (aramid yarn).



- Step 2:** Use safety knife to cut through the Polyethylene & Nylon sheath longitudinally (approximately up to 100 mm or no more than the length selected in [Step 1](#)) from the free end of the cable. If ripcord is unexposed yet, another longitudinal cut can be made through the sheath layers 180° apart.


Note: The additional length allocated in [Step 1](#) is only for exposing the ripcord in this step. So, damaging the cable elements except the ripcord during this step should not be a concern.

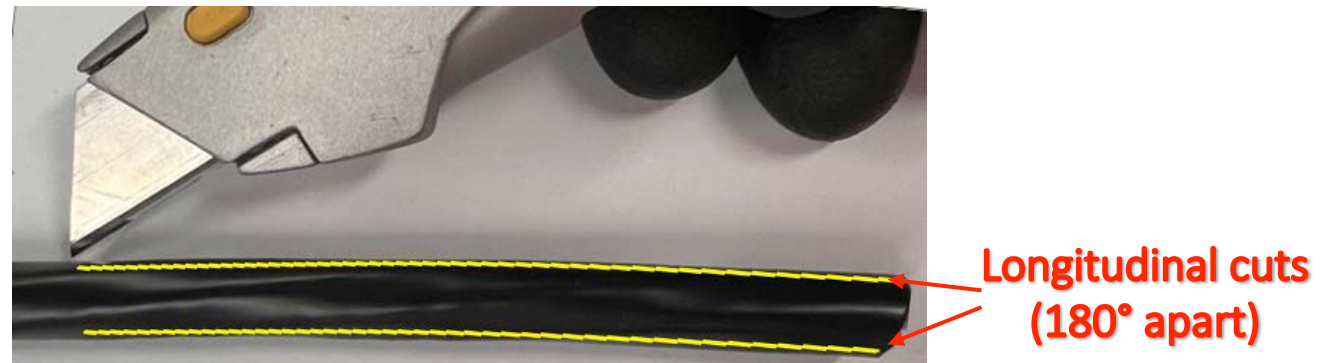

Exposing Ripcords

Step 3: Gently insert a medium sized screwdriver or nose pliers to lift and pull the cut section of the sheaths to expose the ripcord.

**Ripcord
(Aramid Yarn)**

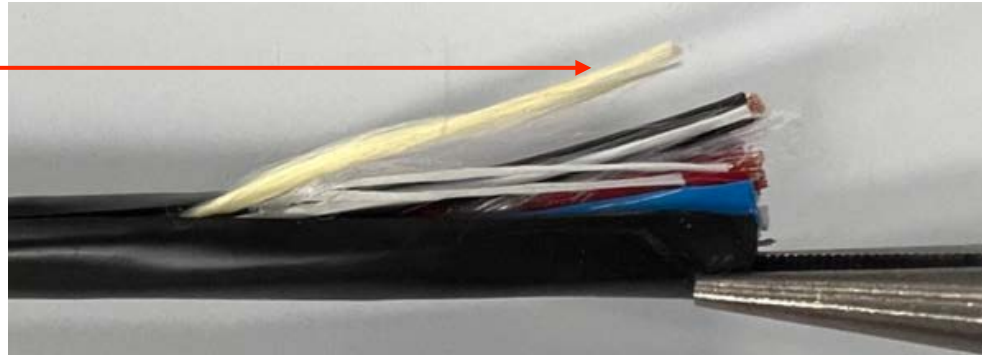


Step 4: Once the ripcord end is exposed, wrap the ripcord around a non-sharp small diameter tool like a screwdriver or pliers to assist in pulling process. Pull the pliers with the ripcord, up to the ring cut location, at a very steep angle, almost close to the cable and hold the cable with the other hand at the same time.



Exposing Cable Core



Step 5: Remove the Polyethylene and Nylon from the cable by hand by gently pulling the core out, while wearing specified protective gloves.

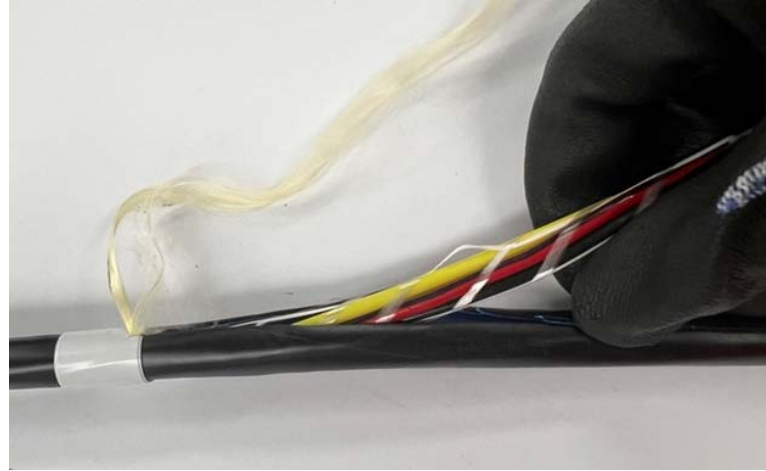


Step 6: Cut the Polyethylene and Nylon sheaths at the required length or near the original marked length using a cable cutter or safety knife. Leave the ripcord uncut to strip additional length if required.




Exposing Cable Core


Step 7: Remove binders from the cable core and cut them using scissors.

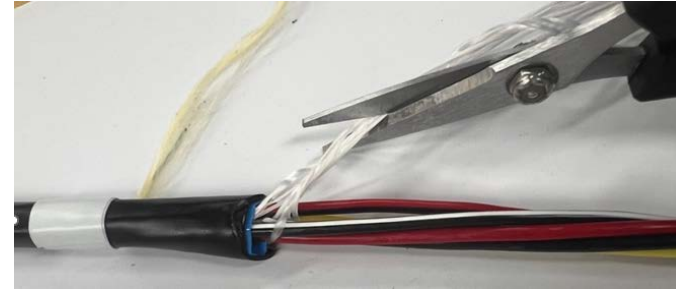


Step 8: Unwind the copper & fibre tube(s) and separate them from Central Strength Member (where present) and water blocking yarns laid over CSM. Secure the tubes and ripcord but, cut Central Strength Member (where present) and water blocking yarns to desired length.

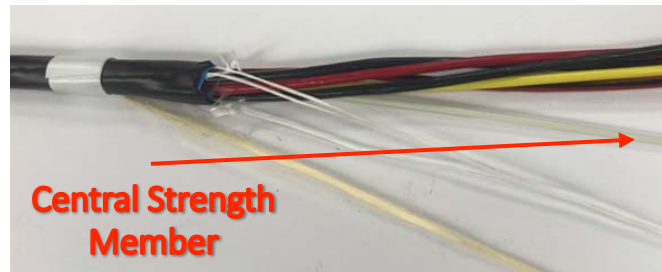

K3M5

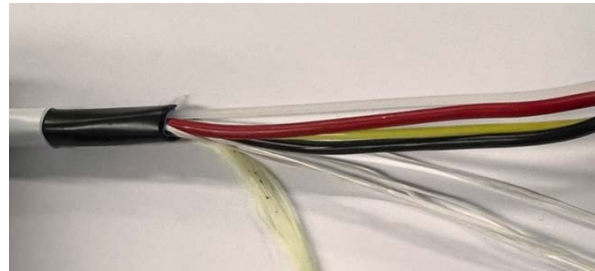


K3MQ

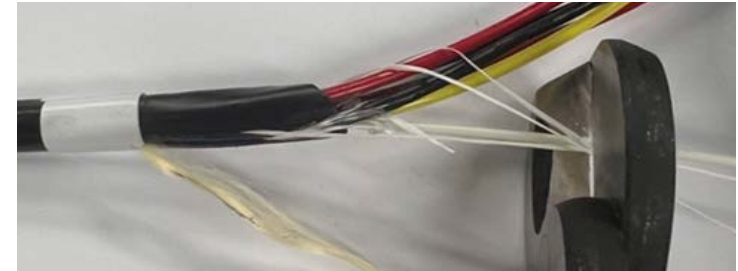


Fibre Preparation

Step 9: Using an appropriate tube cutter (a) or blade (b), break the tube using required pressure and pull it out slowly to expose the fibres. Take care not to cut through the fibres inside the tubes.

Note: This may require adjustment of the blade depth and is best to try on an offset of cable to determine required depth.

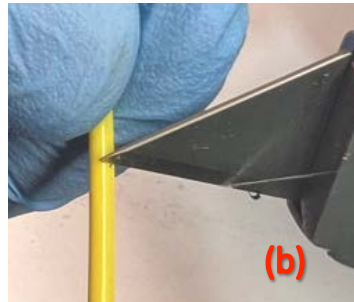


Step 10: Remove gel from the exposed fibres with a suitable solution.

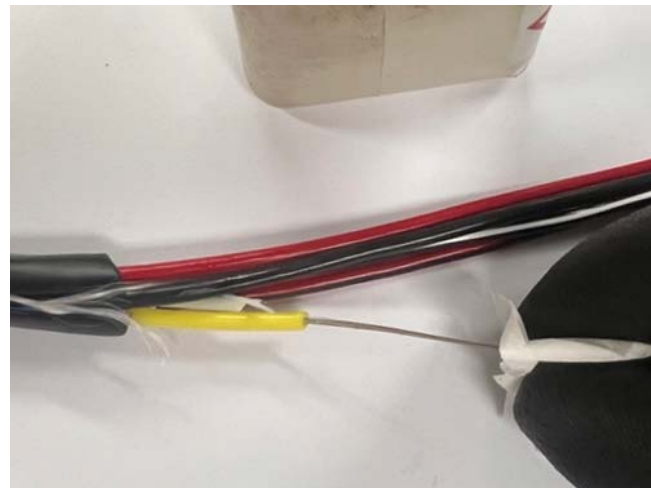

Fibre Preparation

Step 11: Cut and remove 100 mm of fibres from each of the individual tubes. This process will remove any fibre that may have been damaged during any of the cable preparation procedure.

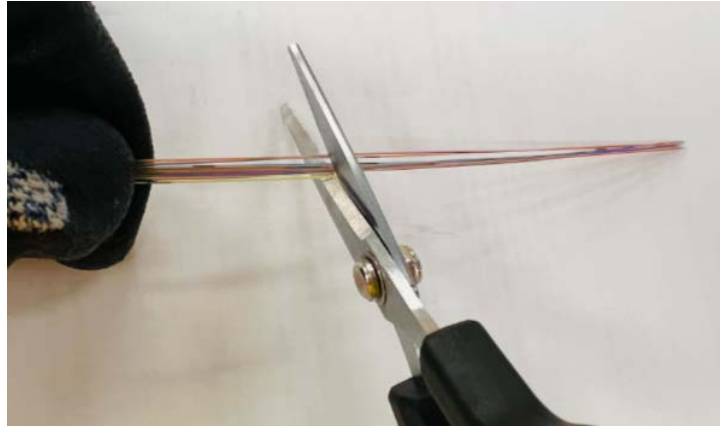



Thank You!