


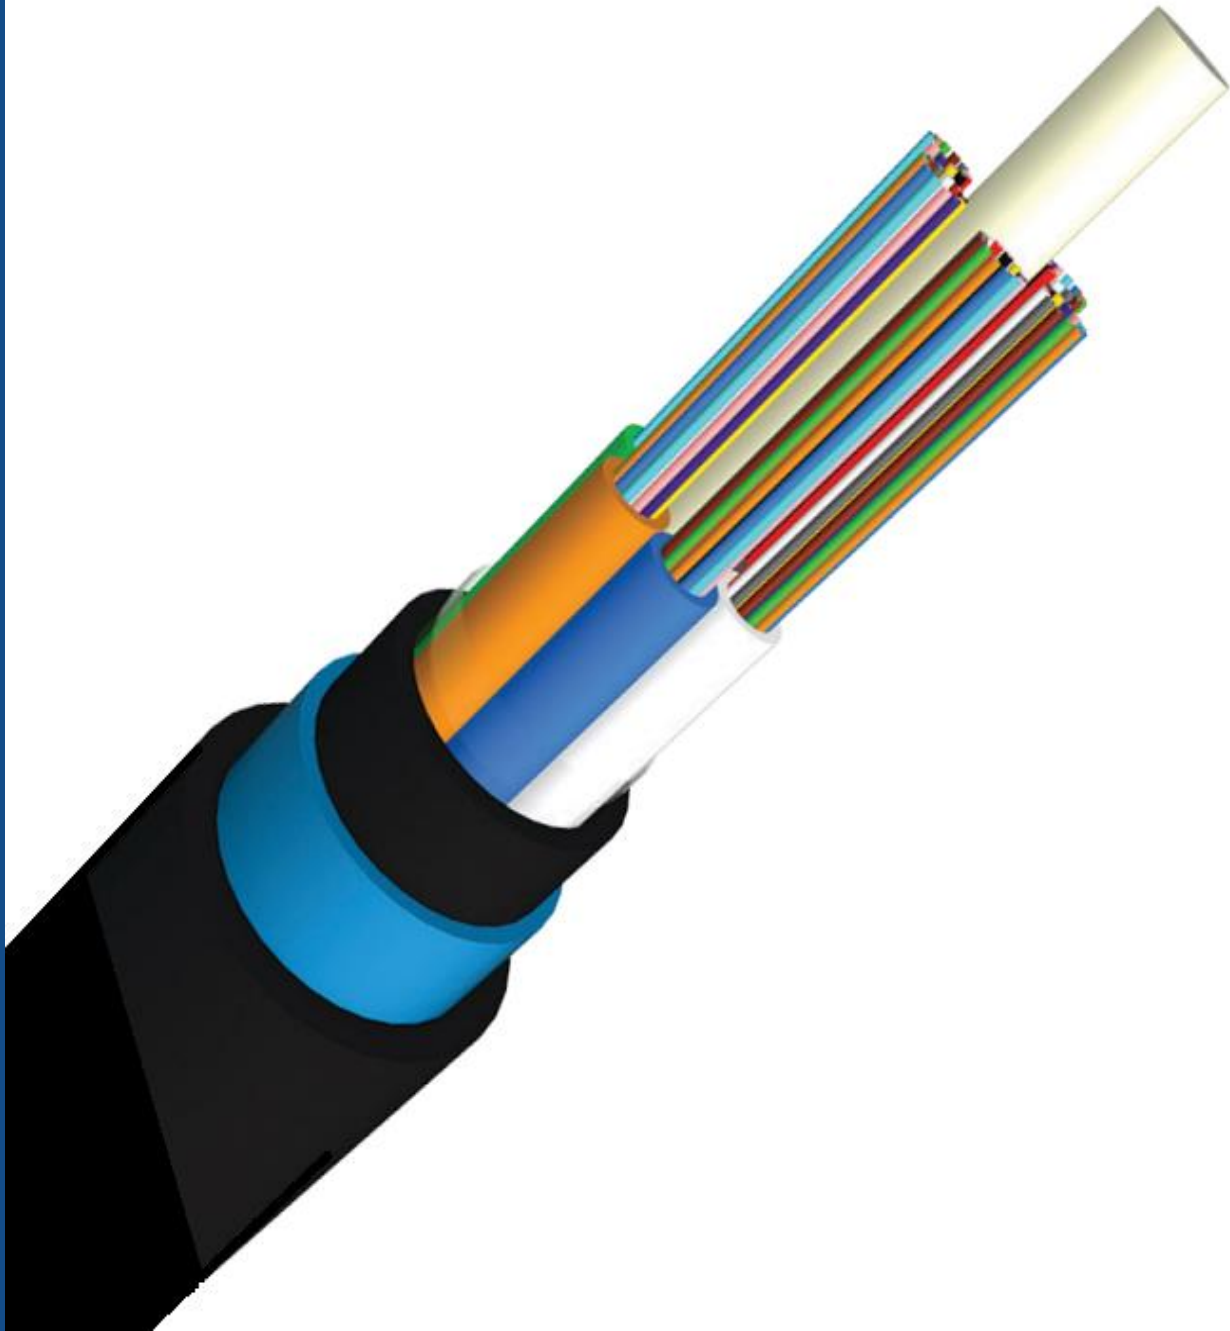

LMHx CABLE

STRIPPING INSTRUCTIONS

Tools Required

1. Cable cutter
2. Cable Stripping tools (a, b, c or suitable other)
3. Long nose pliers
4. Screw-driver
5. Retractable safety knife
6. Scissors
7. Tape measure
8. Electrical tape
9. Marker
10. Cut-resistant gloves
11. Safety glasses



Safety Alert



1. Use Protective Personal Equipment (**PPE**) to perform stripping of the cable.
2. Use Cut resistant / heavy leather **gloves** during the cable stripping process to prevent accidental injury.
3. Always wear PPE glasses to protect eyes from flying debris, dust or accidental injury
4. Also, follow the local relevant **safety procedures**.




Stripping Outer PE

- Step 1:** Determine the stripping length required from the cable end & mark it with Electrical tape / a marker. Suggest adding 100 mm to the required stripping length to allow for stripping PE (Polyethylene) to expose ripcord.



- Step 2:** Place the stripping tool around the outer PE Sheath at the marked length and using required pressure rotate around the circumference to ring cut the outer PE surface.

Note: This may require adjustment of the blade depth and is best to try on an offset of cable to determine required depth.

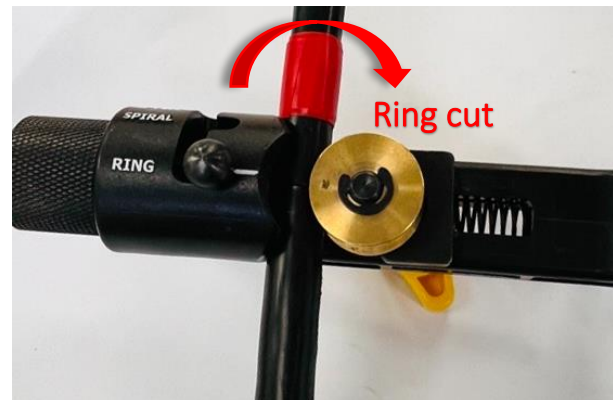

Stripping Outer PE



Step 3: Using the stripping tool, cut through the outer PE sheath longitudinally on **two opposite sides** from the ring cut location to the free end of the cable.




Step 4: Flex the cable gently near the original marked length and use flat nose pliers to separate PE. Pull the PE away from the cable by hand, like a banana peel action.




Stripping Nylon



Step 5: Place the stripping tool around the Nylon jacket next to the original marked length and using required pressure rotate around the circumference to ring cut the jacket. Take care not to cut through the inner PE layer.

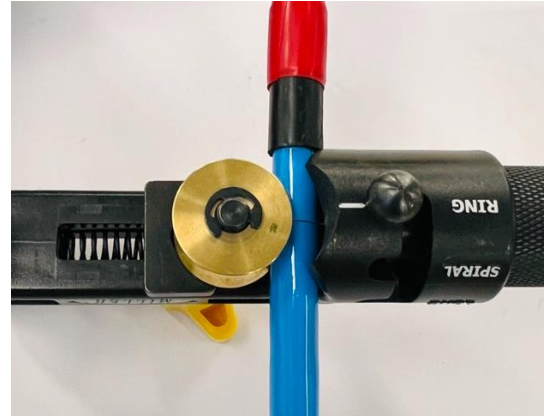


Step 6: Using the stripping tool, cut through the Nylon longitudinally once from the ring cut location to the free end of the cable. While wearing specified protective gloves, Nylon can now be easily peeled off the inner PE by hand.

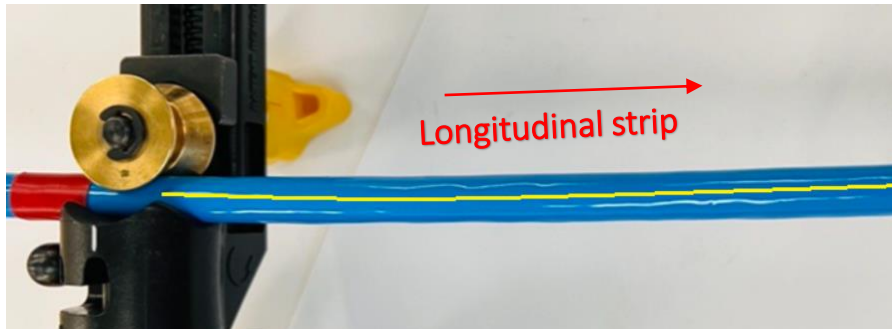

Stripping Inner PE

Step 7: Use safety knife to cut the PE sheath longitudinally on **two opposite sides** (approximately up to 100 mm or no more than the length selected in [Step 1](#)) from the free end of the cable.

Note: The length allocated in [Step 1](#) is only for exposing the ripcord in this step. So, damaging the cable elements except the ripcord during this step should not be a concern.

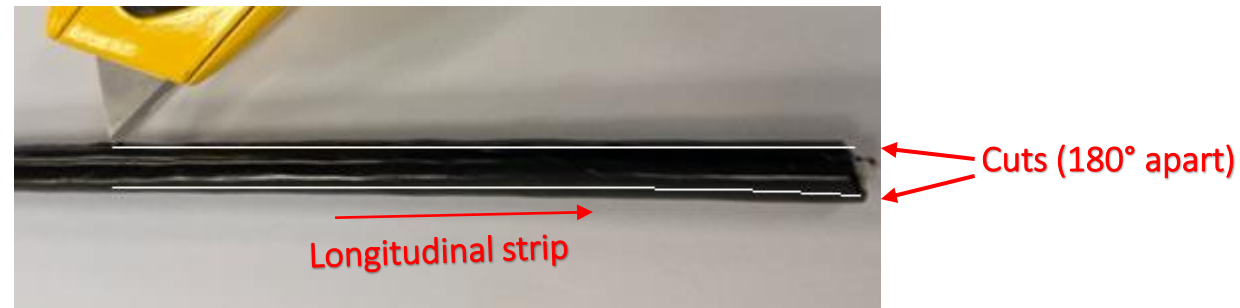


Step 8: Gently insert a medium sized screwdriver or nose pliers to lift and pull the cut section of the PE sheath to expose the ripcord.




Stripping Inner PE



- Step 9:** Once the ripcord end is exposed, wrap the ripcord around a non-sharp small diameter tool like a screwdriver or pliers to assist in the pulling process. Pull the pliers with the ripcord, up to the ring cut location, at a very steep angle, almost close to the cable and hold the cable with the other hand at the same time.

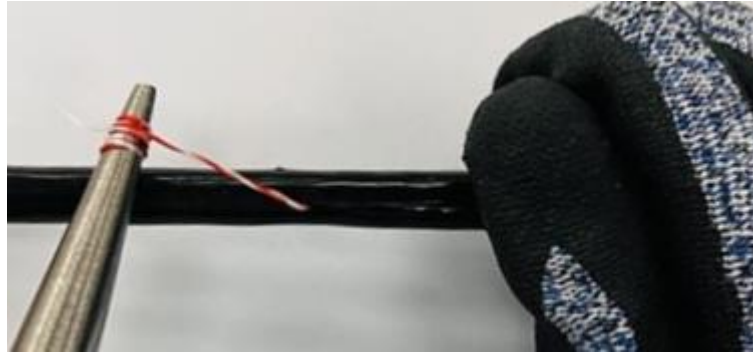


- Step 10:** Remove the PE sheath from the cable by hand, like a banana peel action, while wearing specified protective gloves. Cut the PE sheath near the original marked length using a cable cutter or safety knife. Leave the ripcord uncut to strip additional length if required.

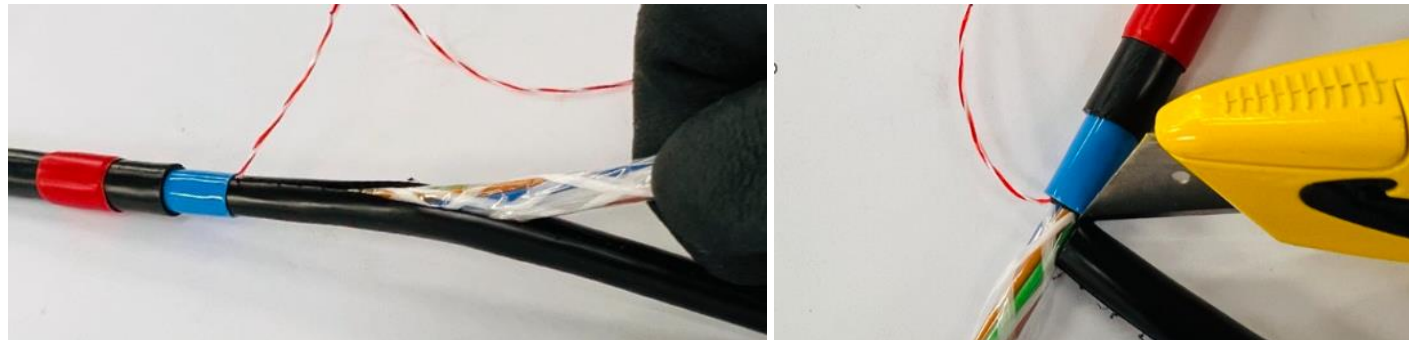


Stripping Inner PE

Step 11: Remove binders and Polyethylene Tape (PET), where present, from the cable core.

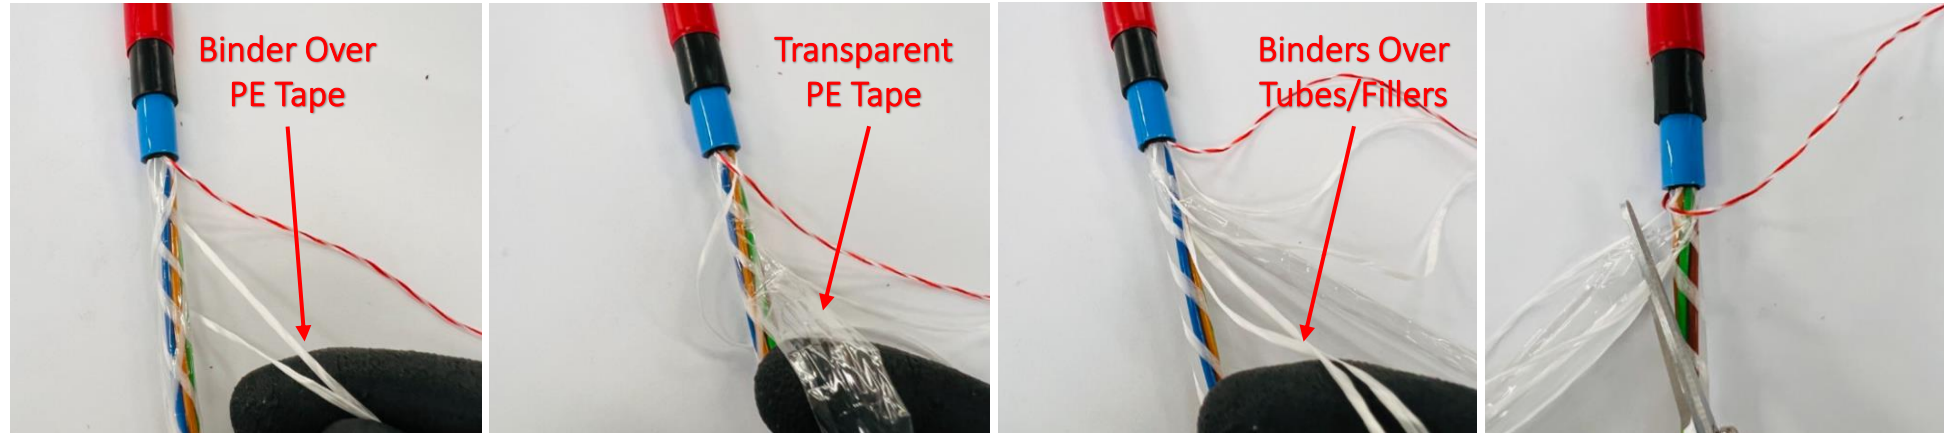


Step 12: Unwind the tube(s) and fillers, where present, from the Central Strength Member (CSM) and separate water blocking yarns laid over CSM. Secure the tube(s) and ripcord, cut CSM and water blocking yarns to desired length.

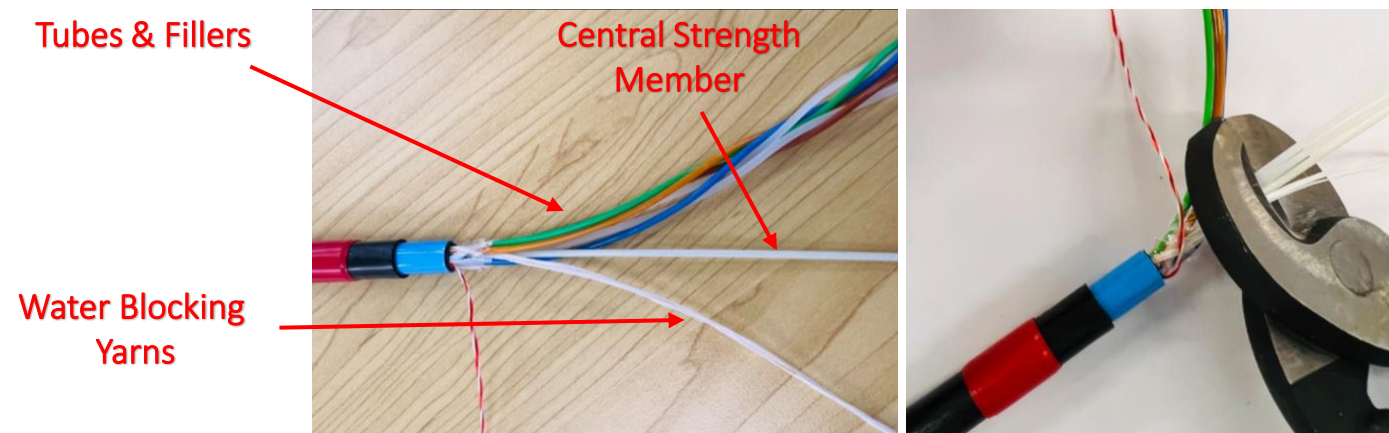


Fibre Preparation

Step 13: Using an appropriate tube cutter (a) or blade (b), break the tube using required pressure and pull it out slowly to expose the fibres. Take care not to cut through the fibres inside the tubes.

Note: This may require adjustment of the blade depth and is best to try on an offset of cable to determine required depth.

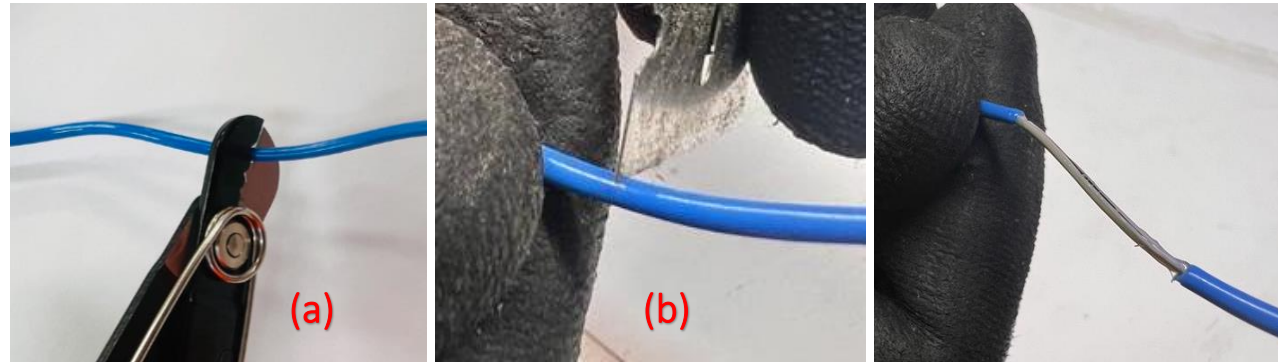


Step 14: Remove gel from the exposed fibres with a suitable solution.

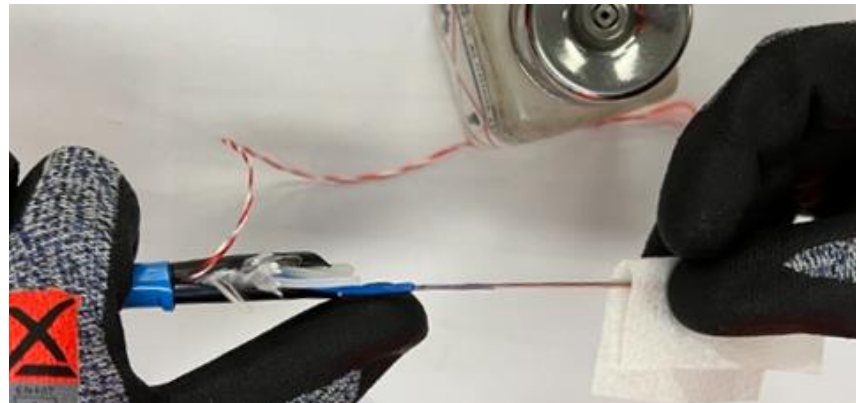

Fibre Preparation

Step 15: Cut and remove 100 mm of fibres from each of the individual tubes. This process will remove any fibre that may have been damaged during any of the cable preparation procedure.

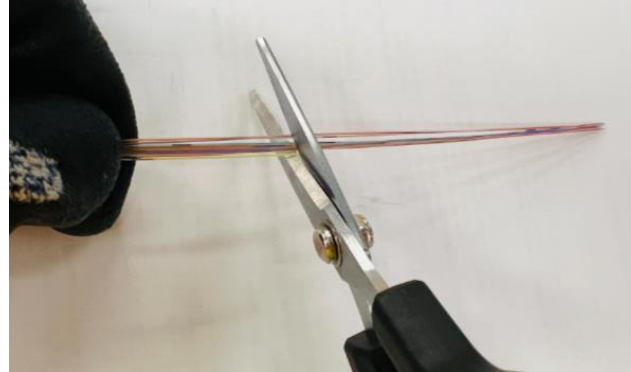



Thank You!