




SMJx CABLE ADSS STRIPPING INSTRUCTIONS

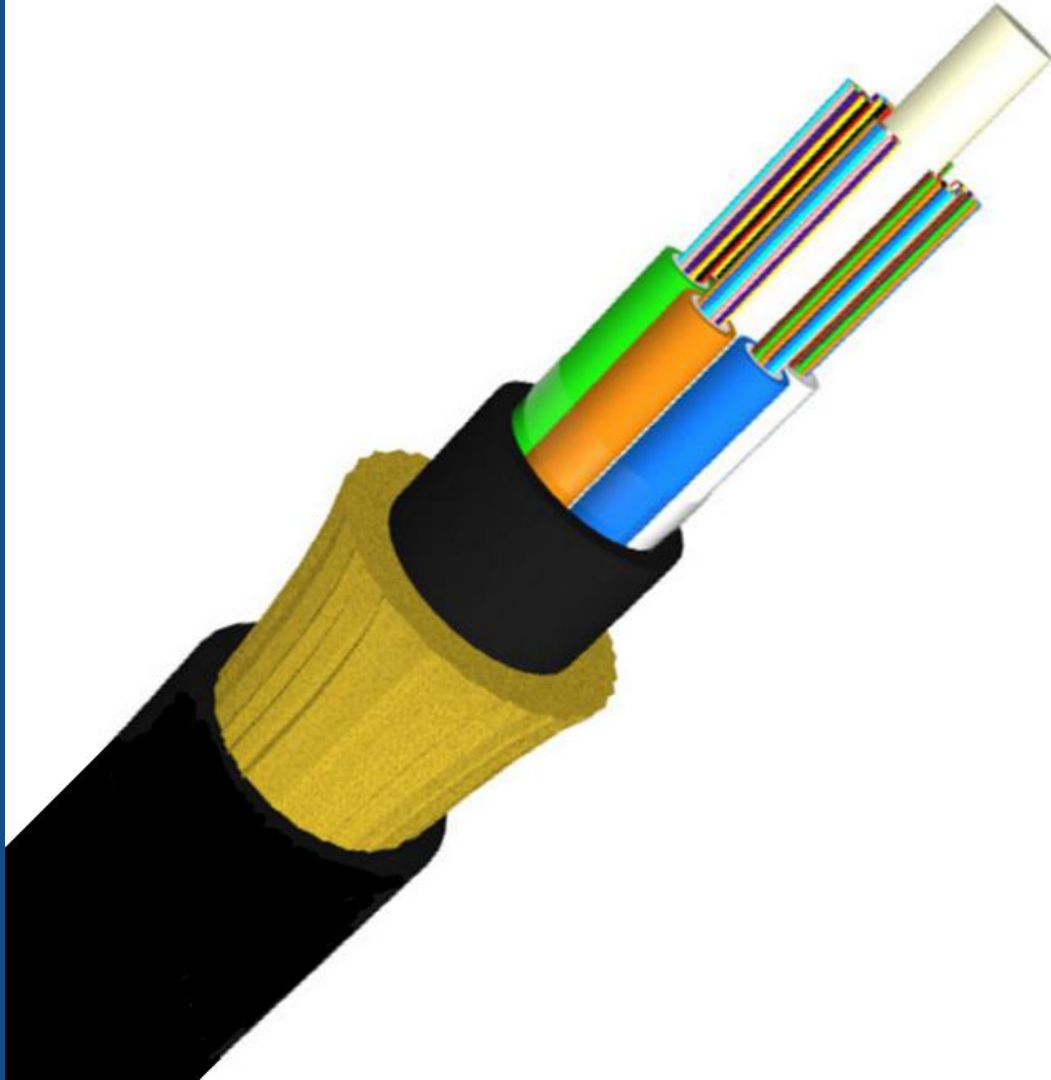

Tools Required

1. Cable cutter
2. Cable Stripping tools (a, b, c or suitable other)
3. Long nose pliers
4. Screw-driver
5. Retractable safety knife
6. Scissors
7. Tape measure
8. Electrical tape
9. Marker
10. Cut-resistant gloves
11. Safety glasses



Safety Alert



1. Use Protective Personal Equipment (**PPE**) to perform stripping of the cable.
2. Use Cut resistant / heavy leather **gloves** during the cable stripping process to prevent accidental injury.
3. Always wear PPE glasses to protect eyes from flying debris, dust or accidental injury
4. Also, follow the local relevant **safety procedures**.



Exposing Ripcord

- Step 1:** Determine the stripping length required from the cable end & mark it with electrical tape / a marker.
Suggest adding 100 – 200 mm to the required stripping length to allow for stripping Polyethylene (PE) layers to expose ripcords.



- Step 2:** Use safety knife to cut the PE sheath longitudinally **once** (approximately up to 100 mm) from the free end of the cable.
- Note:** The 100 mm length is for exposing the ripcord in this step. So, damaging the cable elements except the ripcords during this step should not be a concern.



Exposing Ripcord

Step 3: Gently insert a medium sized screwdriver or nose pliers to lift and pull the cut section of PE sheath to expose the ripcord.




Step 4: Once the ripcord end is exposed, wrap the ripcord around a non-sharp small diameter tool like a screwdriver or pliers to assist in pulling process. Pull the pliers with the ripcord, up to the ring cut location, at a very steep angle, almost close to the cable and hold the cable with the other hand at the same time.



Stripping Outer PE

Step 5: Remove the PE sheath, by pulling out the remaining cable elements from PE by hand, while wearing specified protective gloves.

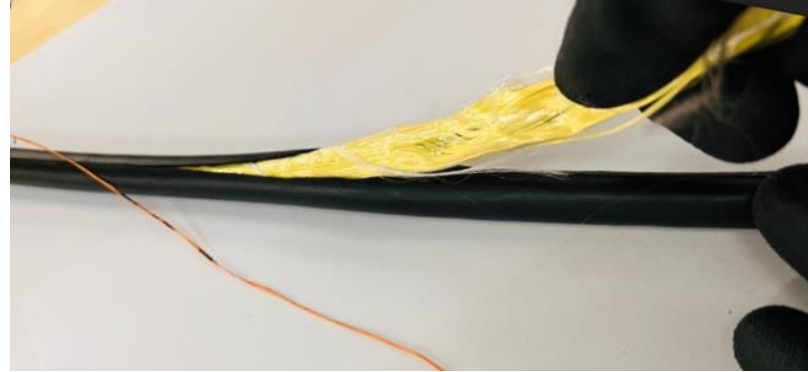



Step 6: Cut the PE sheath, transparent PE tape (where present), yellow aramid yarns and binders at required length or near the original marked length using a cable cutter or safety knife. Leave the ripcords uncut to strip additional length if required.

Transparent
PE Tape

Binders

Aramid yarns


PE sheath

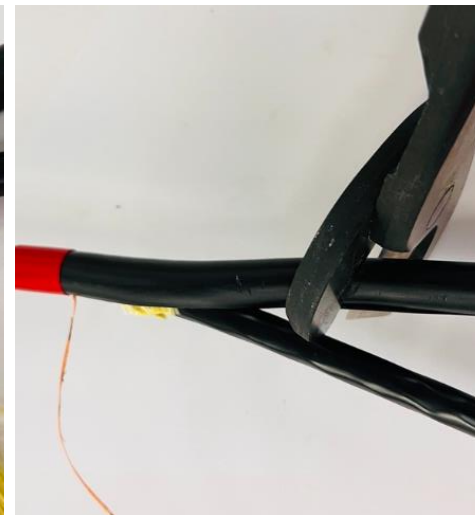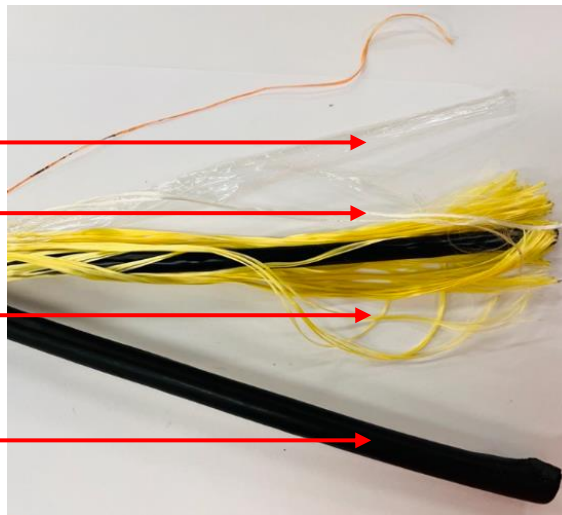


Stripping Inner PE

Step 7: Use safety knife to cut the inner PE sheath longitudinally on **two opposite sides** (approximately up to 100 mm) from the free end of the cable.

Note: The 100 mm length is also for exposing the ripcord in this step. So, damaging the cable elements except the ripcords during this step should not be a concern.

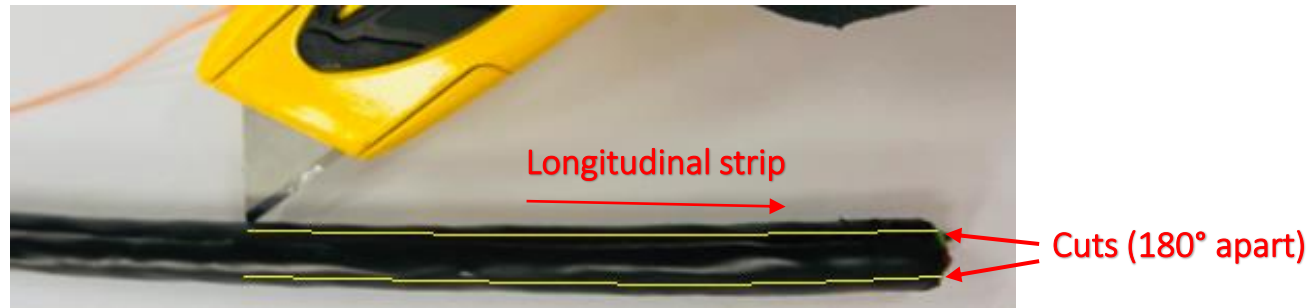


Step 8: Gently insert a medium sized screwdriver or nose pliers to lift and pull the cut section of PE sheath to expose the ripcords.

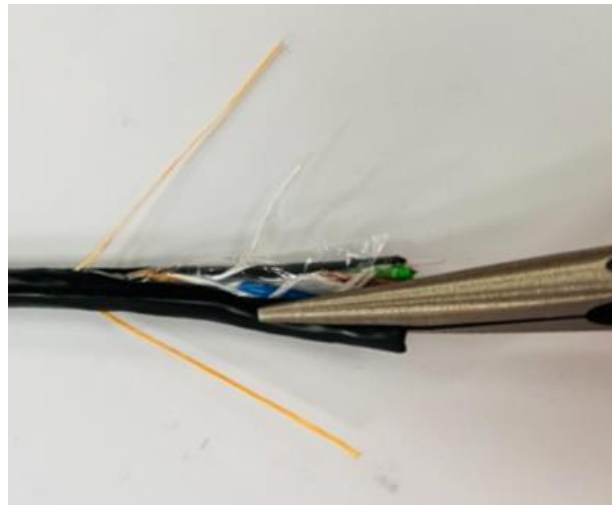

Stripping Inner PE



Step 9: Once the ripcord end is exposed, wrap the ripcord around a non-sharp small diameter tool like a screwdriver or pliers to assist in the pulling process. Pull the pliers with the ripcord, up to the ring cut location, at a very steep angle, almost close to the cable and hold the cable with the other hand at the same time. Repeat this process on the other ripcord.

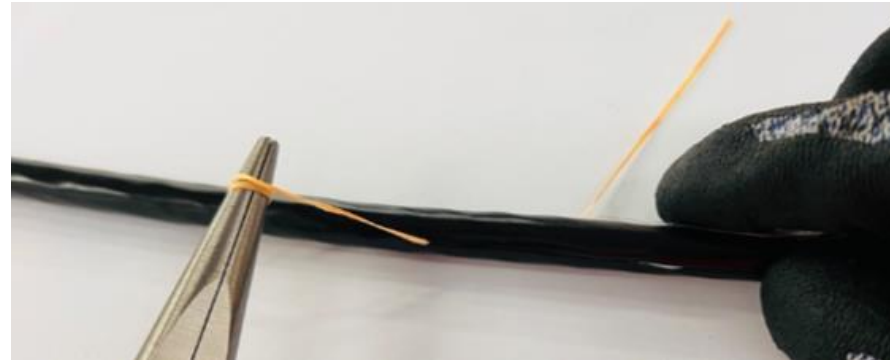


Step 10: Remove the inner PE sheath from the cable by hand, like a banana peel action, while wearing specified protective gloves. Cut the PE sheath near the original marked length using a cable cutter or safety knife. Leave the ripcords uncut to strip additional length if required.




Stripping Inner PE

Step 11: Remove binders and Polyethylene Tape (PET), where present, from the cable core.

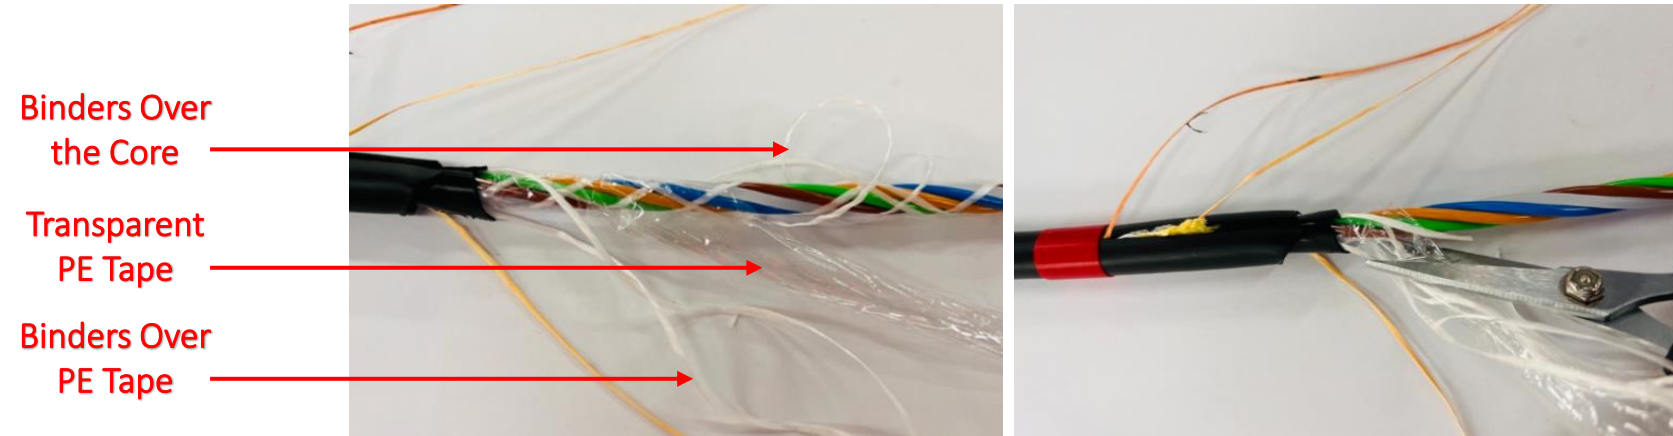


Step 12: Unwind the tube(s) and fillers, where present, from the Central Strength Member (CSM) and separate water blocking yarns laid over CSM. Secure the tube(s) and ripcord, cut CSM, water blocking yarns and fillers to desired length.

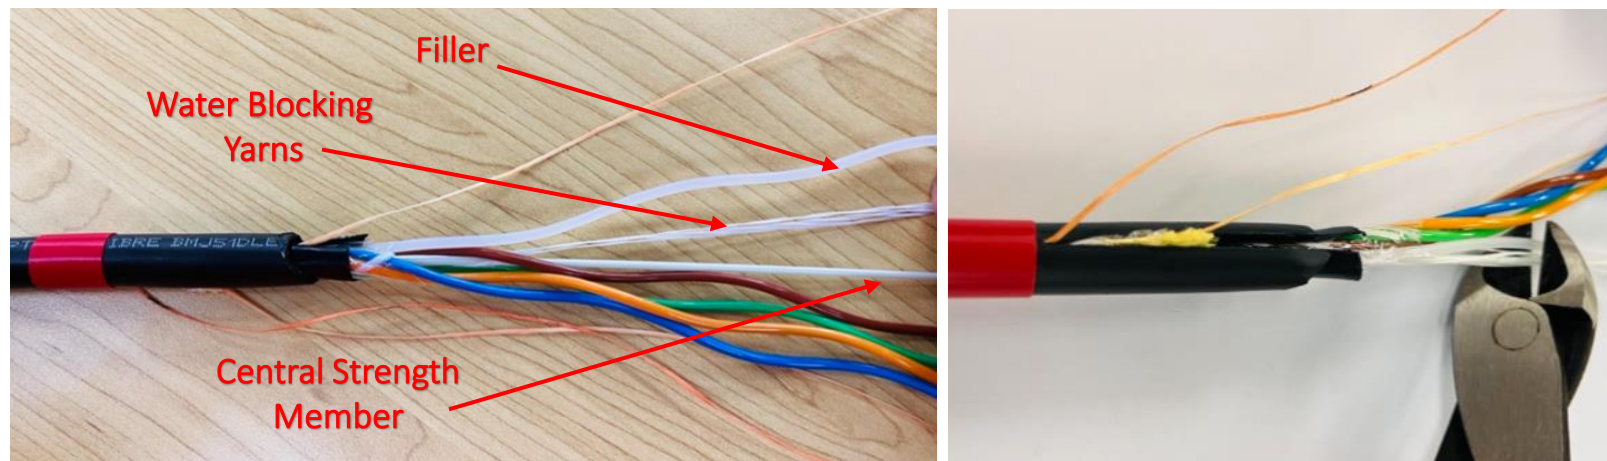


Fibre Preparation

Step 13: Using an appropriate tube cutter (a) or blade (b), break the tube using required pressure and pull it out slowly to expose the fibres. Take care not to cut through the fibres inside the tubes.

Note: This may require adjustment of the blade depth and is best to try on an offset of cable / tube to determine required depth.

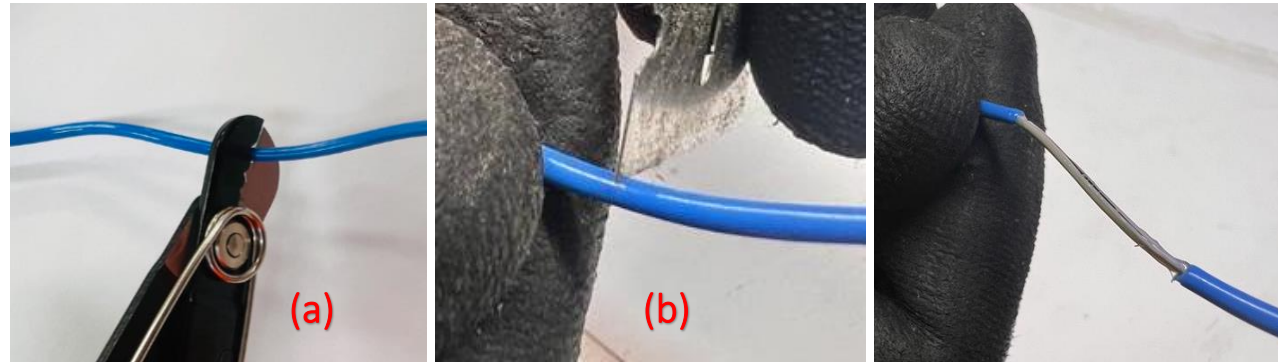


Step 14: Remove gel from the exposed fibres with a suitable solution.

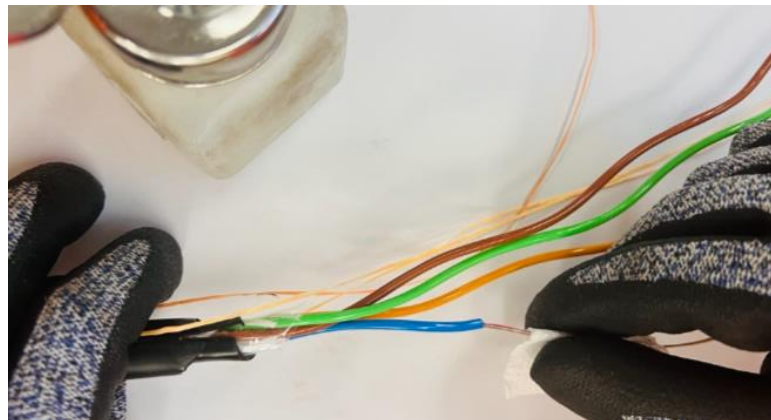

Fibre Preparation



Step 15: Cut and remove 100 mm of fibres from each of the individual tubes. This process will remove any fibre that may have been damaged during any of the cable preparation procedure.

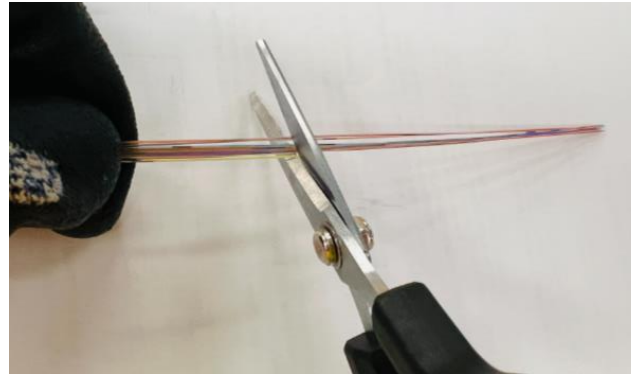



Thank You!