


Incident (16 Sep) Report for NaviX AI Microgrid

Date: 16/09/25

Issues Surfaced

On 16 Sept 2025, 1601, NaviX requested support for the following issue:





1. Missing Data on charting tool

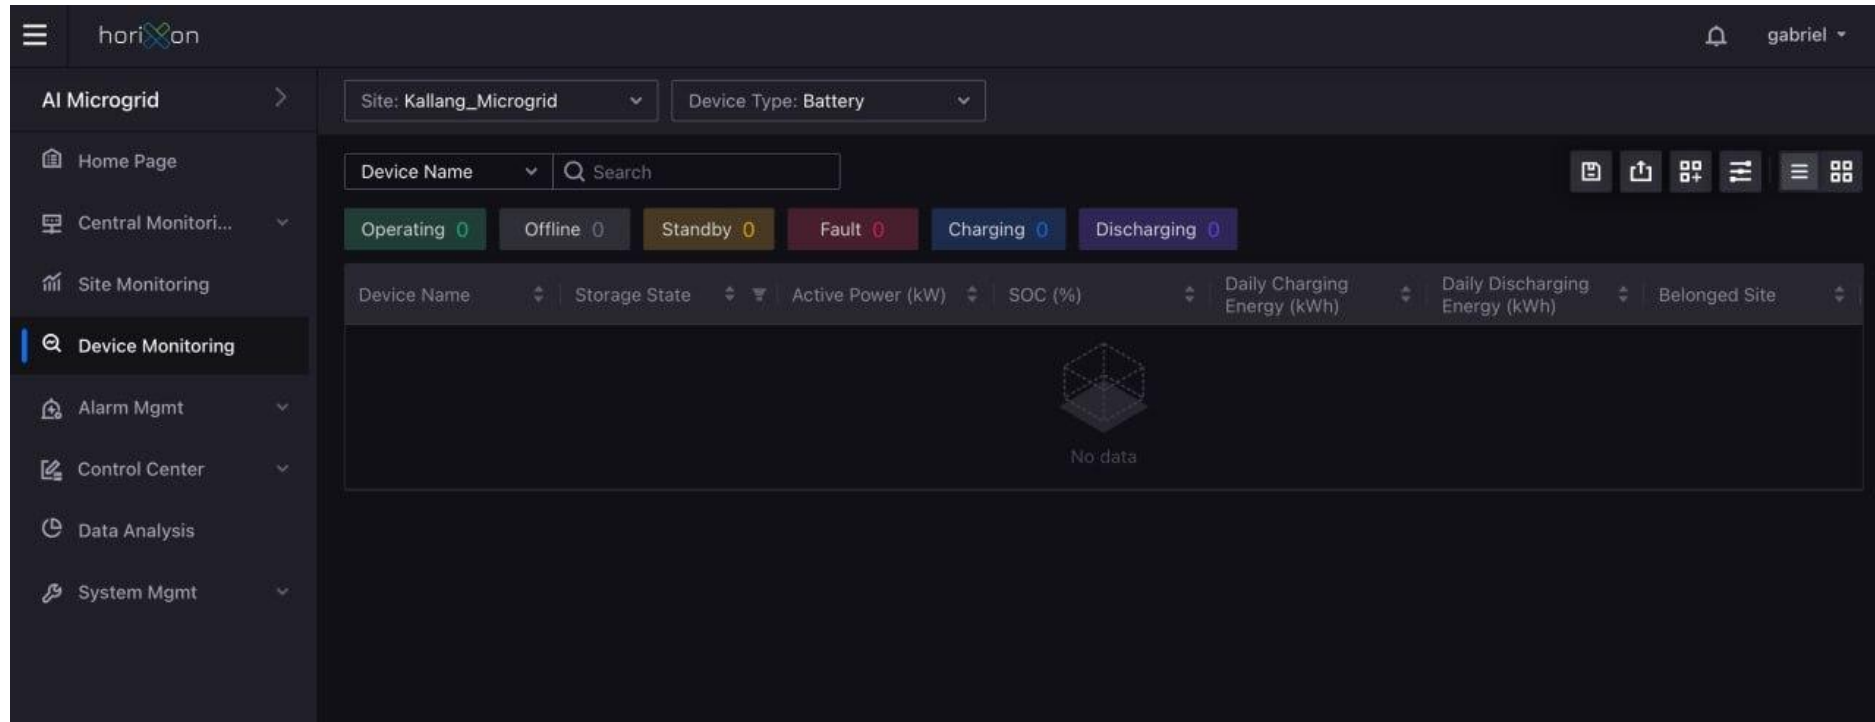

Issues Surfaced

After checking, Univers identified one other issue present:

1. Missing Assets on EnFlex platform

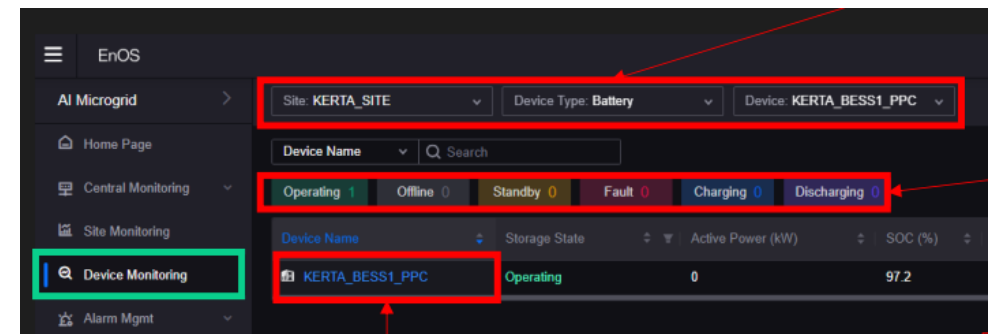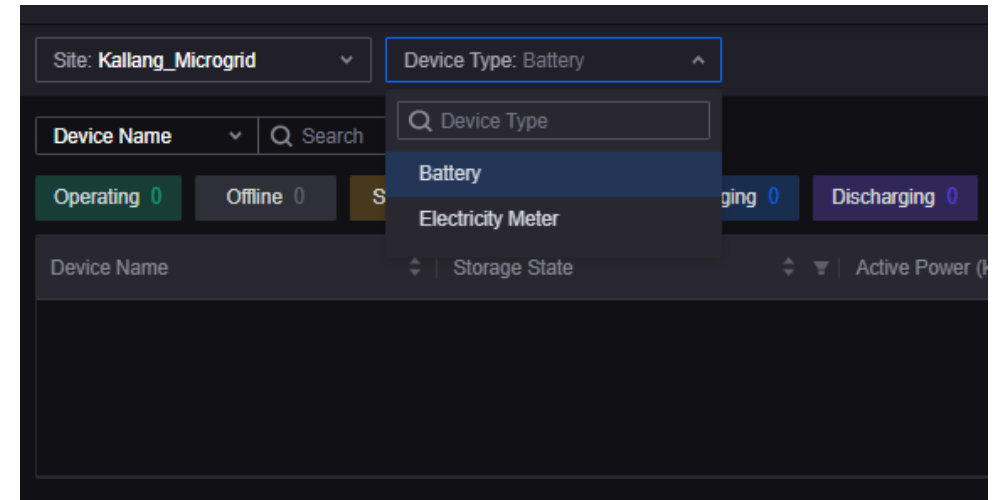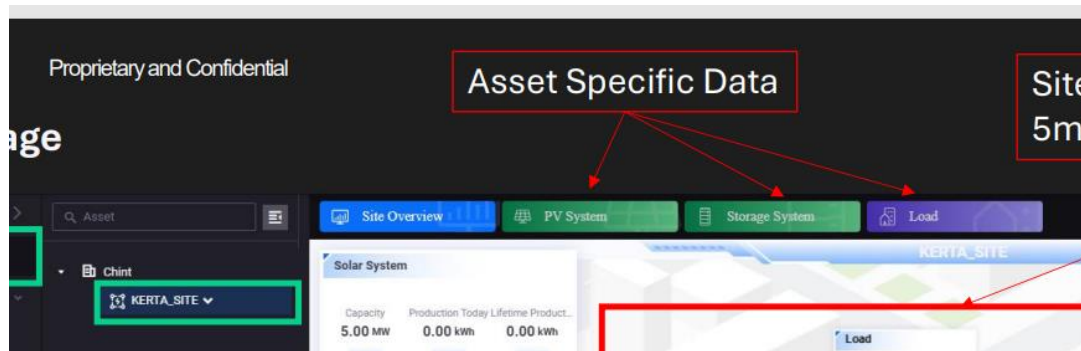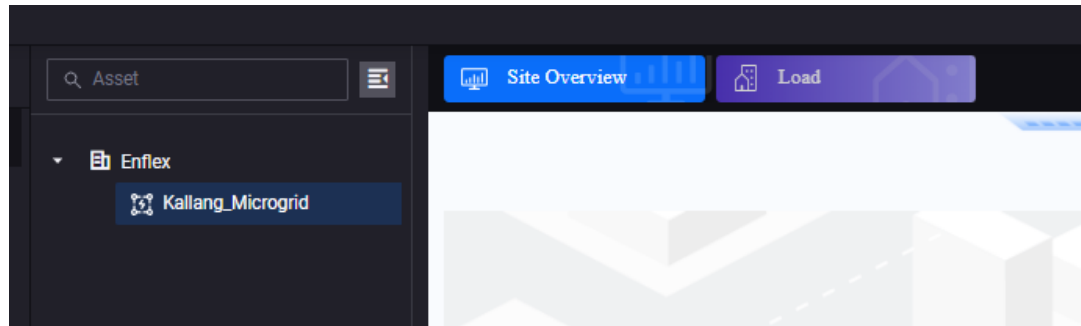

Issue 1: Missing Data

Root Cause Identified: Improper connection of Univers Logger and PLC

Quality	Timestamp
• Normal	2025-09-03 15:24:30
• Normal	2025-09-03 15:24:30
• Normal	2025-09-03 15:24:30
• Normal	2025-09-03 15:24:30
• Normal	2025-09-03 15:24:30
• Normal	2025-09-03 15:24:30
• Normal	2025-09-03 15:24:30
• Normal	2025-09-03 15:24:30
• Normal	2025-09-03 15:24:30

Last data transmitted:
03/09/25, **13 days**
prior

```
root@EnHPUY:~# ping 192.168.4.30
PING 192.168.4.30 (192.168.4.30) 56(84) bytes of data.
^LFrom 192.168.4.127 icmp_seq=1 Destination Host Unreachable
From 192.168.4.127 icmp_seq=2 Destination Host Unreachable
From 192.168.4.127 icmp_seq=3 Destination Host Unreachable
^C
--- 192.168.4.30 ping statistics ---
4 packets transmitted, 0 received, +3 errors, 100% packet loss, time 3023ms
pipe 3
```


Unable to ping devices
connected:
No Network Connection

Issue 1: Missing Data

Background Information


Network architecture:

1. All Modbus TCP connections are first connected to the blue switch
2. Logger is connected to blue switch to access data

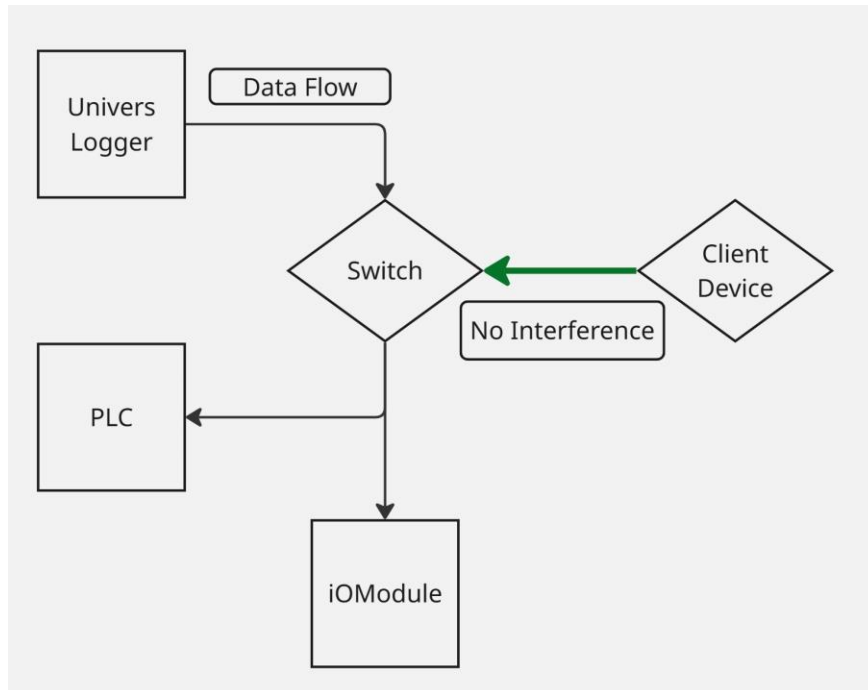


Issue 1: Missing Data

During delivery, devices were connected accordingly

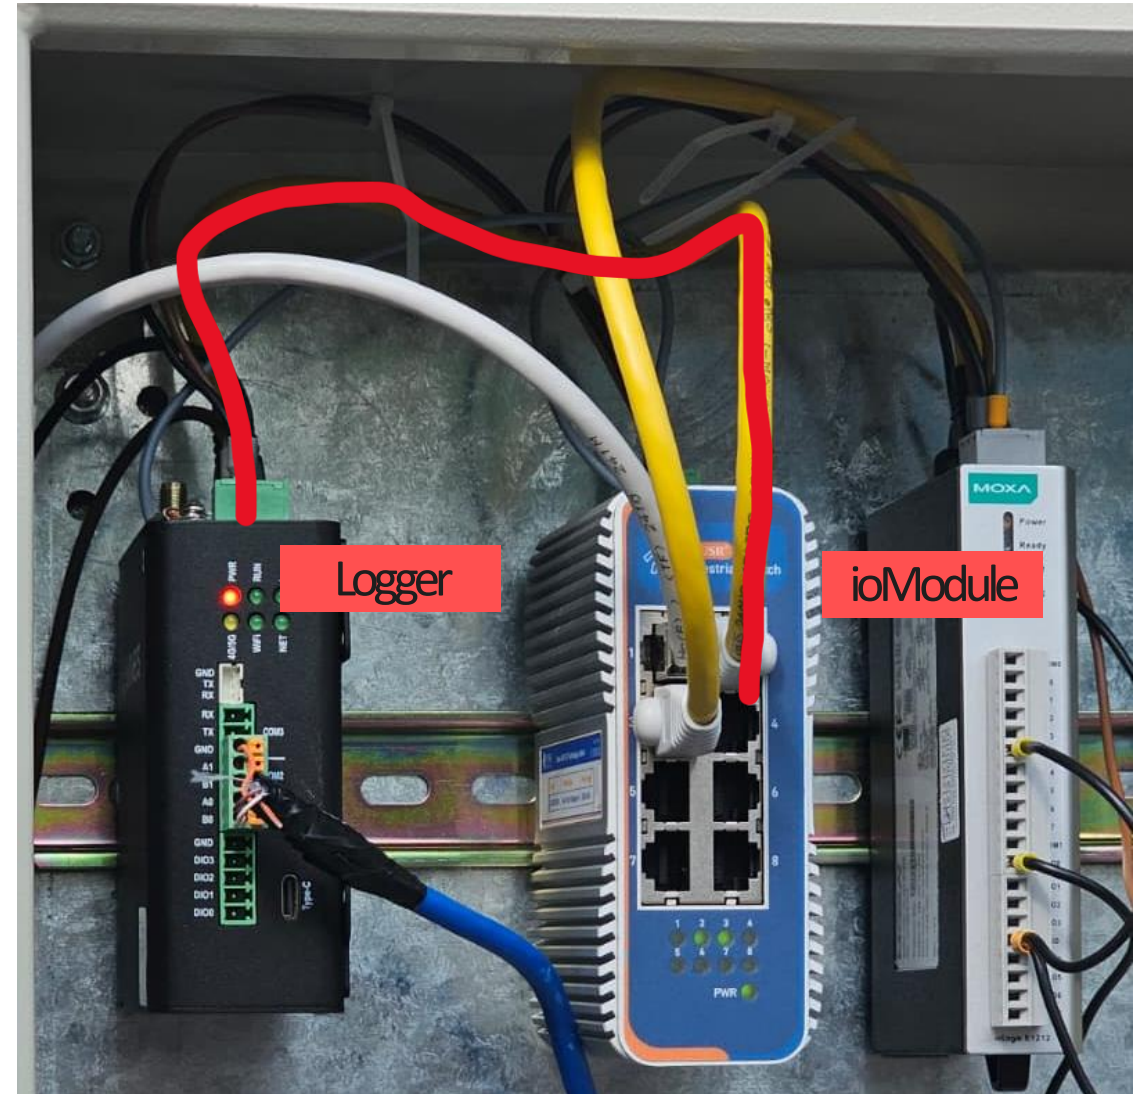

Issue 1: Missing Data (Panel photo on 16 Sep)

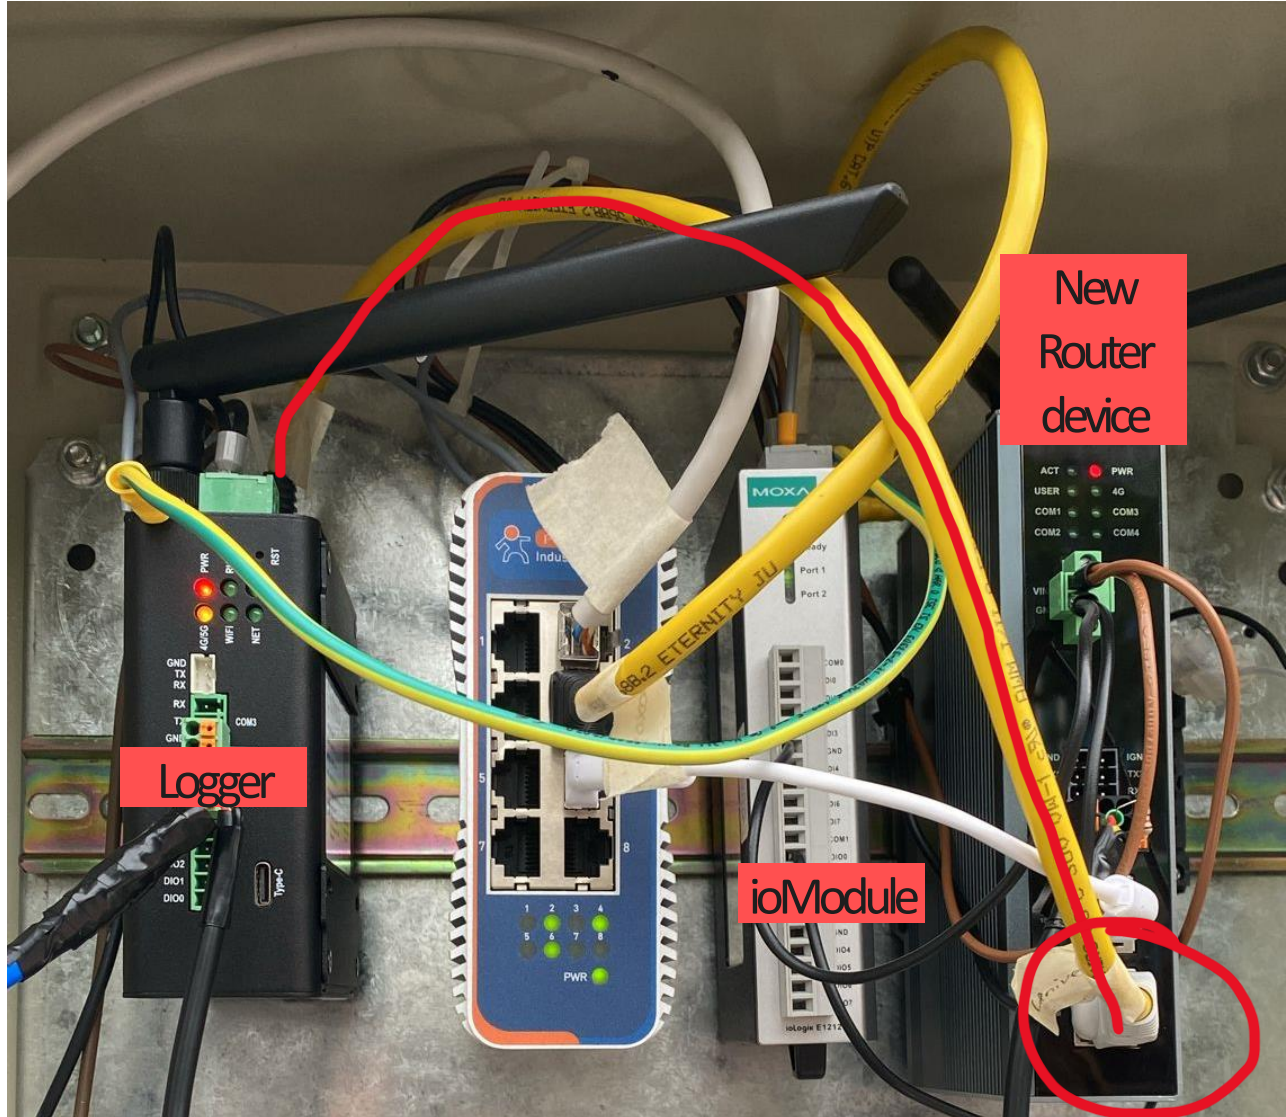

Based on photo provided by NaviX:

1. Logger is connected to external device (black box)

Issue 1: Missing Data

After correction, data returns as normal

Point	Device Name	Description	Final Value	Quality 	Timestamp
1_ao.1	Kallang_BEES1_PLC	ESS System Active Power Setting			
1_ai.2	Kallang_BEES1_PLC	Control State	1	● Normal	2025-09-16 16:51:52
1_ai.3	Kallang_BEES1_PLC	Total Charging Energy	4116	● Normal	2025-09-16 16:51:52
1_ai.4	Kallang_BEES1_PLC	Total Discharging Energy	3467	● Normal	2025-09-16 16:51:52
1_ai.5	Kallang_BEES1_PLC	Daily Charging Energy	0	● Normal	2025-09-16 16:51:52
1_ai.6	Kallang_BEES1_PLC	Daily Discharging Energy	36	● Normal	2025-09-16 16:51:52
1_ai.7	Kallang_BEES1_PLC	SOC	64	● Normal	2025-09-16 16:51:52
1_ai.8	Kallang_BEES1_PLC	SOH	100	● Normal	2025-09-16 16:51:52
1_ai.9	Kallang_BEES1_PLC	Max Charge Power	300	● Normal	2025-09-16 16:51:52
1_ai.10	Kallang_BEES1_PLC	Max Discharge Power	300	● Normal	2025-09-16 16:51:52

Issue 2: Missing Assets

In the Dev Portal, new Asset Tags were added, initially no tags were present.

Cause is still under investigation but likely linked to the addition of these tags.

Functionality has **not recovered** after removal.

Kallang_Microgrid (7)

Kallang_Edge_Logger

EGC On Kallang_Edge_Logger

Kallang_Meter_Grid_A

Kallang_Meter_Grid_B

Kallang_Meter_BESE

Kallang_E1212_001

Kallang_BESE1_PLC

Asset Details

Name	Kallang_Meter_Grid_A
Time Zone/City	UTC+08:00
Owner	jake.xu
Description	--

Asset Tag

No tag

Asset Tag 

up_uuid : Kallang_Meter_Grid_A

▼  Enflex (1)

▼  Kallang_Microgrid (7)

 Kallang_Edge_Logger

 EGC On Kallang_Edge_Logger

 Kallang_Meter_Grid_A

 Kallang_Meter_Grid_B

 Kallang_Meter_BESE

 Kallang_E1212_001

 Kallang_BESE1_PLC

Basic Information 

Attributes

Asset Details 

Name	
Time Zone/City	
Owner	
Description	

Asset Tag 

up_uuid : Kallang_BESE1_PLC

Issue 2: Missing Assets – Root cause

It's due to private objects linked to microgrid assets, causing some data conflict. After deleting the 2 private objects , Microgrid application went back to normal

☰

horizon

Common Data Service

Biz Object Types

Biz Object Elements

Biz Templates

Source Data

Administration

Tools

Object types (mdm types) define the types of the data that can be queried in Common Data Service. Public object types are globally unified across OUs while private object types are unique to the current OU, and "public" and "private" are interpreted the same in other menus.

Public Object TypesPrivate Object Types

ImportExport

Q

Search by object type

☐	Object Type Identifier	Object Type Name	Related Domain Identifier	Related Domain Name	EnOS Model Mapping	Is Site	Is Device Group	Is Business Model	Operation
☐	Navix_IQASensor	IAQ Sensor	AssetOperation	AssetOperation	SpaceLogic_Sensor_SL...	N	N	N	
☐	Navix_WaterDetectionS...	Water Detection System	AssetOperation	AssetOperation	EnOS_Water_Detection...	N	N	N	
☐	Navix_FireDetectionSyst...	Fire Detection System	AssetOperation	AssetOperation	EnOS_Fire_Detection_S...	N	N	N	
☐	EnOS_FIRE_ALARM	EnOS_FIRE_ALARM	Building	Building	EnOS_FIRE_ALARM	N	N	N	

Root causes of incident

The causes of both issues are due to changes to AI Microgrid Standard Product.

1. These changes were not communicated to AIM Team before implementation.
2. Both changes caused issues with AIM Functionality

Future Recommendations:

1. Any future changes involving AIM platform, please inform and Project Manager, Jake Xu and Product Manager, Crystal Zhou for evaluation before proceeding.
2. After implementing changes, please notify AI Microgrid team immediately to verify AIM Functionality has not been affected.

Summary of AIM team efforts to support this incident

AIM Edge L3 Engineer : 2.5 hours support

AIM Enflex L3 Engineer : 2 hours

AIM Project Manager: 1.5 hours