



AI Hazard Scan: Unsecured LPG cylinder on cart


AI-assisted photographic hazard assessment · Blast Furnace Road, Durgapur Steel Plant, Durgapur

RISK LEVEL
CRITICAL

INCIDENT DETAILS

PLANT / UNIT DSP - Durgapur Steel Plant	DEPARTMENT GENERAL	LOCATION Blast Furnace Road, Durgapur Steel Plant,	DATE & TIME 04 Oct 2026, 15:26
REPORTED BY Ravi Shankar	PERSONNEL NO. D001685	OBSERVATION TYPE N/A	STATUS OPEN
REPORT TYPE AI Image Scan	WSA CATEGORY -	REFERENCE NO. 17911077	PEOPLE INVOLVED 0

EVIDENCE PHOTOGRAPH & INCIDENT SUMMARY

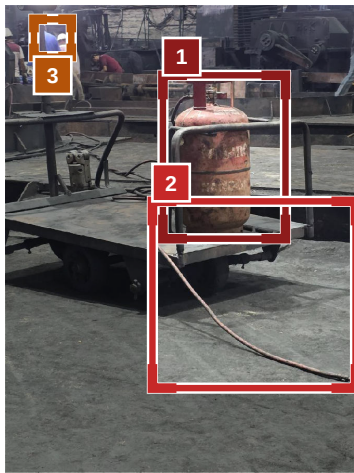

3 hazard(s) - 3 marked on photo

OVERALL RISK

CRITICAL

AI confidence 85%

15 / 25

L3 × S5 (L est.)

SUMMARY

The image shows a rusty red LPG cylinder on a wheeled flatbed cart with a hose trailing across the floor. Workers are visible in the background near heavy machinery. The primary hazard is the unsecured transport of a pressurized gas cylinder on a mobile cart, with the hose draped across a walking area.

CLOSE-UP OF MARKED AREAS

Worker missing
chin strap on**3**

HAZARDS

3

MARKED ON PHOTO

0

TO VERIFY

HAZARDS IDENTIFIED - 3 TOTAL

#	HAZARD	SEVERITY	DESCRIPTION	REGULATION	CORRECTIVE ACTION
1	Unsecured LPG cylinder on cart	CRITICAL	Visible: A large, rusty red LPG cylinder stands on a flatbed wheeled cart, held only by a thin metal hoop frame. It is not chained, strapped, or bolted to the cart. If the cart moves or tips, the cylinder can fall, roll, or drag its hose, causing a gas leak or physical impact.	SMPV Rules 2016 Rule 14	Immediately remove the cylinder from the cart, place it in an upright, chained, segregated storage rack, or use dedicated clamps/straps to secure it to the cart before any movement.
2	Hose trailing across walkway	HIGH	Visible: A long, flexible gas hose extends from the cylinder valve, drapes over the edge of the cart, and lies loose across the dark concrete floor, spanning towards the bottom right. This creates a severe trip hazard for workers moving between the foreground and background machinery.	FA 1948 S32	Coil the excess hose neatly, secure it to the cart frame, and route any remaining length along the wall or designated conduit, ensuring no part lies across the active walking path.
3	Worker missing chin strap on helmet	MEDIUM	Visible: The worker in the blue shirt (mid-left background, id 2) wears a white hard hat, but the chin strap is not fastened under the chin. The strap is loose or missing, leaving the helmet vulnerable to falling off during a slip, trip, or impact.	IS 2925:1984	Instruct the worker to fasten the chin strap securely under the jaw before entering the work area. Conduct a brief PPE compliance check for all personnel in the bay.



STEEL AUTHORITY OF INDIA LIMITED

DSP - Durgapur Steel Plant

Safety Lens · IS 14489:2018 · Factories Act 1948

AI HAZARD SCAN

REF. 17911077

AI Hazard Scan: Unsecured LPG cylinder on cart

AI-assisted photographic hazard assessment · Blast Furnace Road, Durgapur Steel Plant, Durgapur

RISK LEVEL
CRITICAL

GPS LOCATION **Blast Furnace Road, Durgapur Steel Plant, Durgapur**

+/-12m 04 Oct 2026, 15:26:10 [Google Maps](#)

REPORTED BY

Ravi Shankar

P.No. D001685

Signature & date

REVIEWED BY

Safety Officer / HOD

Name:

Signature & date

APPROVED BY

Plant Head / GM (Safety)

Name:

Signature & date

Generated by SAIL Safety Lens. AI observations are advisory and subject to verification by the Safety Department before any finding is recorded.