WIN®
HOME INSPECTION



August 28, 2026

14211 Serene Way, Lynnwood, WA, 98087

Service: **Full Home Inspection**

Prepared for: **The Beth L.Hayes Cooper Diercks, Trustee**

WIN Inspector

Steve Wentzel

License no.: WA #348

This report is provided by an independently owned and operated location of WIN Home Inspection.

Table Of Content

Inspection Information . . . 3

Explanation Of Terms . . . 4

Summary . . . 6

Full Home Inspection . . . 16

- Exterior . . . 16
- Decks, Balconies, Paved Surfaces . . . 19
- Roof . . . 20
- Garage . . . 22
- Electrical . . . 23
- HVAC . . . 26
- Plumbing . . . 26
- Water Heating Equipment . . . 28
- Interior . . . 29
- Appliances . . . 31
- Fireplace . . . 32
- Structural Components . . . 32
- Insulation And Ventilation . . . 33

© 2026 WIN Home Inspection

Inspection Information

Order Details

Site Address: **14211 Serene Way, Lynnwood, WA, 98087**

Service Date And Time: **August 28, 2026 At 12:00 PM**

Property Details

Approximate Year Built: **1966**

Approximate Square Footage: **1422**

Occupied: **No**

Main Entry Door Faces: **North**

Bedrooms: **3**

Baths: **1.5**

Floors: **1**

Inspector Detail

Name: **Steve Wentzel**

License Number: **WA #348**

Company Information

Email: **swentzel@wini.com**

Contact Number: **(425) 787-3060**

Client

Name: **The Beth L.Hayes Cooper Diercks, Trustee**

Email: **lcdiercks@comcast.net**

Contact Number: **(206) 954-1677**

Present At Inspection: **Client**

© 2026 WIN Home Inspection

Explanation Of Terms

This report was prepared and written with the age and type of structure taken into consideration. Below is an explanation of the terms used in the report

Action Required

Items marked Action Required appear to be in need of immediate repair or replacement. Delay in repair or replacement may result in a dramatic shortening of the life expectancy of the item, have immediate effect on the item, system, structure, or other related items, or present a potential health and/or safety hazard.

Repairs Recommended

Items marked Repairs Recommended are in need of repair or replacement in order to make the item functional and/or prevent further deterioration.

Attention

Items marked Attention should be monitored or evaluated further. These items may not require immediate repair, but they show signs of wear or minor deficiencies that, if left unaddressed, could develop into more significant issues over time.

Preventive Measures

Items marked Preventive Measure are in need of routine maintenance or service to ensure continued functionality and prevent potential future issues. The inspector may recommend budgeting for this maintenance or obtaining further evaluation from a third-party professional to clarify or assess the condition of the item.

Functional

Items marked Functional appear to be in serviceable condition using normal operating controls. There was no visible indication of failure at the time the services were performed.

Limitation

Items marked limitation have limited access or limited ability to test or inspect fully, We recommend gaining further information on items marked as a limitation from the owner of the property or from a third party.

Not Inspected

Items marked Not Inspected may be present at the time the services were performed and were not inspected due to obstruction, accessibility, visibility, limitation, weather conditions or the inspection of the item is not within the scope of the services performed.

Informational

Items marked informational are included in the inspection as a courtesy or to add information to the customer to help them live in and maintain their home.

© 2026 WIN Home Inspection

Summary

We have identified various items on the subject structure that either require maintenance now or require periodic maintenance in the normal course of ownership. This is only a summary report and is intended as a guide to be used in both short and long term scheduling of maintenance items. Please read the complete report carefully as additional information and details are contained therein. It is always advisable to use experienced tradespeople or a qualified handyperson when contracting for work that may not be within the scope of your capabilities.

© 2026 WIN Home Inspection

Summary

Exterior

1 Damaged Siding

Repairs Recommended

There is water damaged siding material visible on the east side of the house by the kitchen where a leak in the kitchens plumbing has occurred. Also, there is some damaged siding material at ground level next to the man door to the garage. Recommend replacement of all the damaged material.





2 Paint And Caulk Satisfactory

Repairs Recommended

The exterior paint and caulking material on both the house and on the detached garage is showing its age, painting by a licensed contractor is recommended.







3 Window Seals Failed

Repairs Recommended

© 2026 WIN Home Inspection

Nine of the double pane windows in the house have failed seals, they have lost the vacuum seal between the panes of glass, which is indicated by fogging or condensation build-up. One window in the dining room, the “fixed” section of glass in the slider door to the deck, two windows in the living room, two windows in the NW bedroom, two windows in the NE bedroom, and one window in the SW bedroom. Replacing the sealed section of glass portion is the only way to fix them. These are older style aluminum windows.... . Recommend upgrading the windows in the house.








4 Roof Structure Above Front Entry

Repairs Recommended

The roof structure above the front entry has rot visible in some of the framing material. Recommend replacement of all the damaged material.

© 2026 WIN Home Inspection



5 Sliding Glass Door Lock Not Working

Repairs Recommended

The sliding glass door lock needs to be repaired, the door does not lock when closed.

6 Crawl Space Vent

Repairs Recommended

The crawl space vent opening on the west side of the house where the gas line stubs into the crawl space needs repair. Too much of the screen material was cut out when the gas line was installed, there is an opening big enough for rodents to enter thru.




Decks, Balconies, Paved Surfaces

7 Evidence Of Rot In Both Decks

Repairs Recommended

Some of the decking material, joists, and the stair stringers in both of the decks has rot visible in the wood material which can compromise safety and structural integrity. Recommend replacement of all the damaged material.

© 2026 WIN Home Inspection

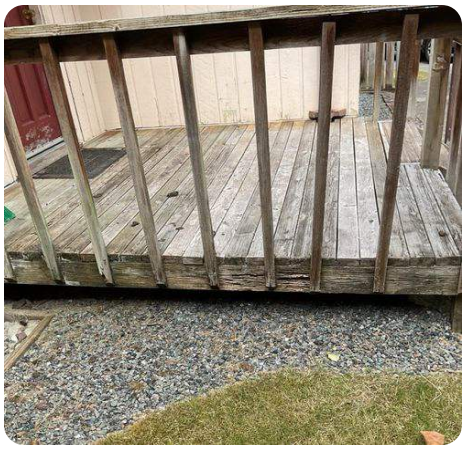
Roof

8 **Roof Replacement Recommendation** Repairs Recommended

The roofing material on the house and on the detached garage is worn out, there is granular loss and felt showing in places. Replacing the roofing material is recommended before leaks develop.





© 2026 WIN Home Inspection





9 Seams Leaking

Repairs Recommended

The gutters on the house need to be replaced when the new roofing material is installed, the seams on the gutters are rusted out and are leaking in places.



Electrical

10 Missing GFCI Protection

Repairs Recommended

The electrical outlet on the left side of the kitchen sink is not GFCI protected. This outlet was still “hot” when the GFCI outlet in the kitchen was “tripped”. GFCIs are essential in areas where water and electricity could come into contact to prevent the risk of electric shock. Recommend having a GFCI outlet installed.

© 2026 WIN Home Inspection





HVAC

11 Baseboard Heater

Repairs Recommended

The electric baseboard heater in the NE bedroom needs to be repaired or replaced, it was not working at the time of the inspection.

Plumbing

12 Plumbing Leaks

Repairs Recommended

There were 3 plumbing leaks noticed during the inspection. 1) There is a leak in the drain line under the kitchen sink. 2) There is a leak in the drain line under the sink in the 1/2 bathroom. 3) There was water dripping into the crawl space under the bathtub when the crawl space was inspected. The inspector could not determine what leaking due to all of the rodent debris and rodent damaged underfloor insulation that was hanging down. Recommend further evaluation and repairs as necessary by a licensed plumber.








© 2026 WIN Home Inspection


Interior

13 Water Damage/Mold & Mildew

Repairs Recommended

There is water damage visible in several places in the house in the drywall, wall structure, and flooring material under the kitchen sink, in the wall by the water heater in the laundry room, and in both of the bathrooms in the walls and flooring material. There is mold on the drywall in the NE corner of the dining room and mildew/mold on the ceiling/walls in the full bathroom. Recommend further evaluation by removing drywall and flooring material to determine the full extent of damage and repairs as necessary by a licensed contractor.

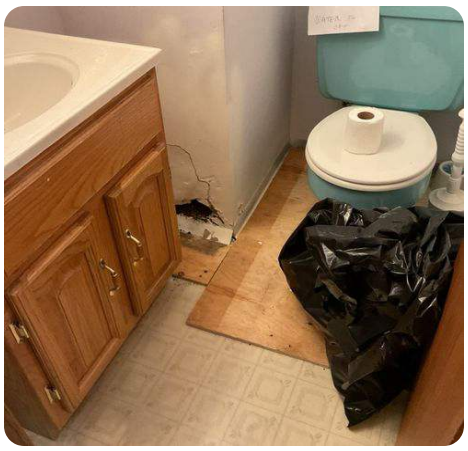

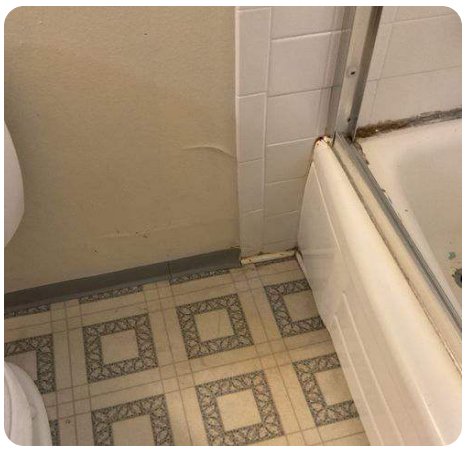









Fireplace

14 Gas Fireplace Maintenance

Informational

The glass on the front of the gas fireplace needs to be cleaned as part of regular maintenance. There is a white film starting to built up on the backside of the glass from the sulfur in the natural gas which blocks the view of the flame. Usually, this glass should be cleaned once a year depending on how often they are used.


© 2026 WIN Home Inspection



Insulation and Ventilation

15 **Rodent Activity** **Action Required**

There is extensive rodent activity in the crawl space. All of the underfloor insulation, the plastic vapor barrier, all of the rodent debris needs to be removed, all the openings that the rodents are entering from need to be filled, and new insulation/vapor barrier installed. Also, the crawl space access cover needs to be replaced, it is deteriorated, and has openings under it that rodents can enter thru. And, there appears to be a rodent tunnel under the crawl space access well that needs to be sealed off.

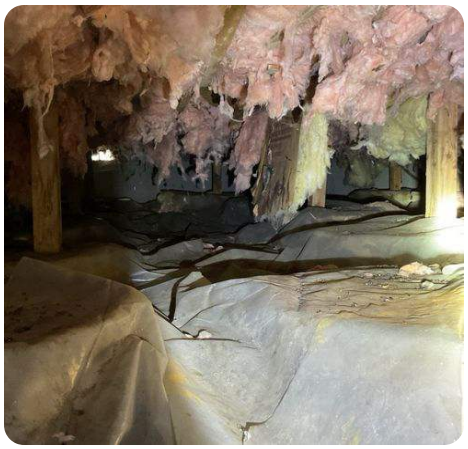



© 2026 WIN Home Inspection







© 2026 WIN Home Inspection

Full Home Inspection

© 2026 WIN Home Inspection

Full Home Inspection

1.1 Exterior > Siding and Trim

About the Siding and Trim

Siding Material: Cedar Siding

Damaged Siding *(Included in Summary)* Repairs Recommended

There is water damaged siding material visible on the east side of the house by the kitchen where a leak in the kitchens plumbing has occurred. Also, there is some damaged siding material at ground level next to the man door to the garage. Recommend replacement of all the damaged material.





1.2 Exterior > Paint/Coating and Caulking

Paint And Caulk Satisfactory *(Included in Summary)* Repairs Recommended

The exterior paint and caulking material on both the house and on the detached garage is showing its age, painting by a licensed contractor is recommended.

© 2026 WIN Home Inspection





1.3 Exterior > Exterior Windows

About the Exterior Windows

Window Type: Aluminum, Dual-Pane

Window Seals Failed *(Included in Summary)* Repairs Recommended

Nine of the double pane windows in the house have failed seals, they have lost the vacuum seal between the panes of glass, which is indicated by fogging or condensation build-up. One window in the dining room, the “fixed” section of glass in the slider door to the deck, two windows in the living room, two windows in the NW bedroom, two windows in the NE bedroom, and one window in the SW bedroom. Replacing the sealed section of glass portion is the only way to fix them. These are older style aluminum windows.... . Recommend upgrading the windows in the house.





© 2026 WIN Home Inspection





1.4 Exterior > Eaves, Soffits, and Fascia

Roof Structure Above Front Entry *(Included in Summary)* Repairs Recommended

The roof structure above the front entry has rot visible in some of the framing material. Recommend replacement of all the damaged material.



1.5 Exterior > Vegetation, Grading, Surface Drainage

Generally Serviceable Functional

The vegetation is not in contact with the home and the soil grade around the property is sloped to promote water runoff.

1.6 Exterior > Exhaust Hoods, Vents, and Other Penetrations

Generally Serviceable Functional

The exhaust hoods, vents, and other penetrations appeared to be serviceable at the time of inspection.

© 2026 WIN Home Inspection

1.7 Exterior > Exterior Doors

Sliding Glass Door Lock Not Working *(Included in Summary)* Repairs Recommended

The sliding glass door lock needs to be repaired, the door does not lock when closed.

1.8 Exterior > Additional Information

Crawl Space Vent *(Included in Summary)* Repairs Recommended

The crawl space vent opening on the west side of the house where the gas line stubs into the crawl space needs repair. Too much of the screen material was cut out when the gas line was installed, there is an opening big enough for rodents to enter thru.




2.1 Decks, Balconies, Paved Surfaces > Deck Installation, Foundation

Evidence Of Rot In Both Decks *(Included in Summary)* Repairs Recommended

Some of the decking material, joists, and the stair stringers in both of the decks has rot visible in the wood material which can compromise safety and structural integrity. Recommend replacement of all the damaged material.

© 2026 WIN Home Inspection

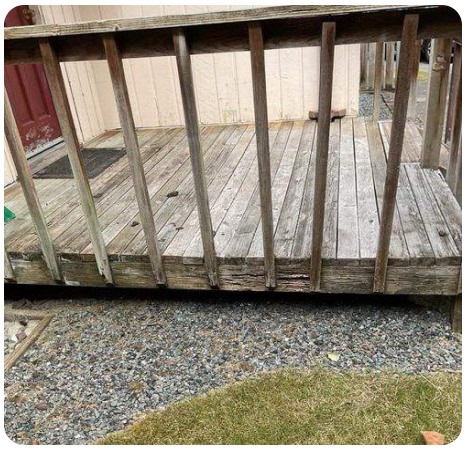
2.2 Decks, Balconies, Paved Surfaces > Walkways, Driveway

About the Walkways, Driveway

Address Identification: Visible

Visible: The property's address is visible from the street, facilitating easy location by first responders. It's advisable to verify the visibility of house numbers twice annually to ensure they remain clear.

Walkway(S) And Driveway Evaluated Functional

The walkway and driveway were in functional condition.

3.1 Roof > Roof Covering

About the Roof Covering

Pitch: Pitched

Pitched: A pitched roof is characterized by sloped surfaces that meet at an angle, designed to facilitate water runoff and add architectural appeal.

Roof Covering Material: Asphalt Shingles

Apparent Number of Layers: 1 Layer

Roof Replacement Recommendation *(Included in Summary)* Repairs Recommended

The roofing material on the house and on the detached garage is worn out, there is granular loss and felt showing in places. Replacing the roofing material is recommended before leaks develop.

© 2026 WIN Home Inspection







3.2 Roof > Exterior Chimney

Exterior Chimneys Evaluated Informational

The chimney's exterior appears to be in functional condition. There are some cracks visible in the CMU blocks on the exterior side, however, this fireplace has been converted from a wood burning fireplace to a gas burning fireplace. The flue in the wood fireplace is no longer being used, there is tube installed in the chimney flue that this gas fireplace vents thru.

© 2026 WIN Home Inspection



3.3 Roof > Gutters, Downspouts, and Drainage

Seams Leaking *(Included in Summary)* Repairs Recommended

The gutters on the house need to be replaced when the new roofing material is installed, the seams on the gutters are rusted out and are leaking in places.



3.4 Roof > Evaluation Method

About the Evaluation Method

Method of Inspection: Walked Surface

Walked Surface Informational

The roof covering was evaluated by walking the surface of the roof.

© 2026 WIN Home Inspection

4.1 Garage > Garage Vehicle Door

About the Garage Vehicle Door

Size of Garage: Detached Garage, 1 Car

Type of Garage Door: Wood

Garage Vehicle Door Evaluated Functional

The garage door was in satisfactory condition at the time of the inspection.

4.2 Garage > Garage Floor and Surfaces

Garage Floor Functional Functional

The garage floor appears to be in satisfactory condition.

5.1 Electrical > Service Entrance and Grounding

About the Service Entrance and Grounding

Main Service: Overhead

Main Service Conductor: Multi-Stranded Aluminum

Service Entrance Evaluated Functional

The visible portions of the electrical service entrance components appeared to be in functional condition at the time of the inspection.



© 2026 WIN Home Inspection

5.2 Electrical > Main Service Panels and Disconnects

About the Main Service Panels and Disconnects

Main Panel Location: Bedroom

Main Panel Capacity: 200 amps/240 Volt

Subpanel Capacity: 40 amps

Service Panels Evaluated Functional

The service panel and main disconnects have been evaluated, they were in functional condition.

5.3 Electrical > Interior Components of Main Service Panels

About the Interior Components of Main Service Panels

Panel Cover Removed: Yes

Brand of Electric Service Panel: Eaton

Interior Components Evaluated Functional

The interior components of the electrical panel were evaluated and were in satisfactory condition at the time of the inspection.



5.4 Electrical > Interior Components of Subpanels

About the Interior Components of Subpanels

Subpanel Location: Garage

Brand of Electric Subpanel: Eaton

Interior Components Evaluated Functional

The interior components of the subpanel were evaluated during the inspection, and they were found to be in working condition.

© 2026 WIN Home Inspection



5.5 Electrical > Breakers/Fuses

Over Current Devices Evaluated Functional

The circuit breakers in the electrical panels were in satisfactory condition of the time of the inspection.

5.6 Electrical > Wiring

About the Wiring

Wire Type: Non-Metallic Sheathed (Romex)

Wire Material: Copper, Multi-Strand Aluminum

Electrical Wiring Evaluated Functional

During the inspection, the visible/accessible wiring at the property was evaluated and found to be in functional condition.

5.7 Electrical > GFCIs

Missing GFCI Protection *(Included in Summary)* Repairs Recommended

The electrical outlet on the left side of the kitchen sink is not GFCI protected. This outlet was still “hot” when the GFCI outlet in the kitchen was “tripped”. GFCIs are essential in areas where water and electricity could come into contact to prevent the risk of electric shock. Recommend having a GFCI outlet installed.

© 2026 WIN Home Inspection





5.8 Electrical > Fixtures, Switches, and Receptacles

Electrical Fixtures And Switches Evaluated Functional

The inspection assessed the condition of outlets, switches, and junction boxes that were visible and accessible at the time. All outlets, switches, and junction boxes appeared functional at the time of inspection.

6.1 HVAC > Heating Equipment

About the Heating Equipment

Location of Heating System: Multiple Locations

Heating Method: Electric Baseboard

Heating System Energy Source: Electric

Baseboard Heater *(Included in Summary)* Repairs Recommended

The electric baseboard heater in the NE bedroom needs to be repaired or replaced, it was not working at the time of the inspection.

7.1 Plumbing > Water Supply and Piping

About the Water Supply and Piping

Structure Pipe Material: Copper

Incoming Water Line Pipe Material: Copper

Water Source: City Water

Static Water Pressure: Between 40-80 PSI

Plumbing Leaks *(Included in Summary)* Repairs Recommended

There were 3 plumbing leaks noticed during the inspection. 1) There is a leak in the drain line under the kitchen sink. 2) There is a leak in the drain line under the sink in the 1/2 bathroom. 3) There was water dripping into the crawl space under the bathtub when the crawl space was inspected. The inspector could not determine what leaking due to all of the rodent debris and rodent damaged underfloor insulation that was hanging down. Recommend further evaluation and repairs as necessary by a licensed plumber.

© 2026 WIN Home Inspection





7.2 Plumbing > Main Water Shutoff

About the Main Water Shutoff

Water Meter Location: Near Street


Water Shut-off Location: At Meter, Exterior on west side of house

Size of Main Water Line: 3/4"

Water Main Shut-Off

Informational

The water service main shut-off valve was located on the exterior, west side of the house, under the green cover. There is also a water shut off at the water meter at the street. It is important to know the location of the shut-off valve in case of emergencies or when repairs are needed.

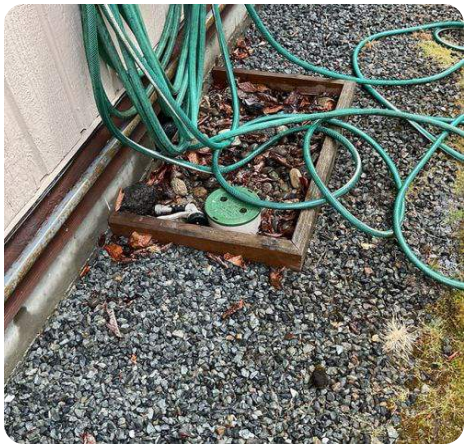

© 2026 WIN Home Inspection

7.3 Plumbing > Drain, Waste, and Vent Systems

About the Drain, Waste, and Vent Systems

Waste Pipe Material: ABS

Main Sewer Clean-Out Location: Crawl Space

Sewer Type: Public

Generally Serviceable Functional

The drain, waste, and vent systems appeared to be serviceable at the time of inspection.

7.4 Plumbing > Fuel Supply

About the Fuel Supply

Fuel Service: Natural Gas

Natural Gas: Gas line inspections are typically conducted only if problems are suspected. Corrosion on visible lines should prompt an inspection by the utility provider.

Fuel Shut Off Location: At Gas Meter and Appliances

Generally Serviceable Functional

The fuel supply, meter, and shutoff appeared to be serviceable at the time of inspection.

7.5 Plumbing > Toilets

Toilets General Statement Informational

The toilet in the full bathroom was flushed and inspected for cracks, leaks, and serviceability. The toilet in the 1/2 bathroom was not tested, the water to this toilet was shut off at the time of the inspection. The toilets should be inspected periodically for indications of cracking in the toilet bowl, tank, or base. Also, periodic replacement of flapper valves and water towers should be expected as typical homeowner maintenance.

7.6 Plumbing > Tubs, Showers, and Fixtures

Generally Serviceable Functional

The sinks, shower, and bathtub were all serviceable at the time of inspection, the leaks under the sinks were addressed in a previous section of this report.

© 2026 WIN Home Inspection

8.1 Water Heating Equipment > Water Heater

About the Water Heater

Water Heater Location: Laundry Room

Water Heater Type: Gas

Water Heater Capacity : Approximately 50 Gallons

Approximate Manufactured Date of Water Heater: Made 11/2018

Approximate Water Temperature: Over 120 Degrees

Over 120 Degrees: A child can suffer a third-degree burn in 124°F water in less than three minutes. Children and adults can be burned this badly in two seconds or sooner in 149°F water.

Seismic Strapping: Yes

Water Heater Information

Informational

The life expectancy of a water heater is typically 8-12 years from the installation date, although there are exceptions on both sides. As a preventative maintenance recommendation, the water heater should be drained periodically to remove sediment buildup in the tank. The recommended setting for a residential water heater is under 120 degrees Fahrenheit to prevent scalding if small children are present.



8.2 Water Heating Equipment > TPR Valve/Discharge Pipe

TPR Valve And Discharge Pipe

Functional

The water heater's temperature/pressure relief valve is equipped with an approved discharge pipe. The pipe serves the purpose of preventing someone from being sprayed with scalding water in the event that the valve were to discharge. These components were in satisfactory condition at the time of the inspection.

8.3 Water Heating Equipment > Exhaust Flue Piping

Exhaust Flue Piping Evaluated

Functional



The water heater exhaust flue piping was evaluated and appeared to be in functional condition at the time of the inspection.

© 2026 WIN Home Inspection

9.1 Interior > Walls, Ceilings, and Floors

Water Damage/Mold & Mildew *(Included in Summary)* Repairs Recommended

There is water damage visible in several places in the house in the drywall, wall structure, and flooring material under the kitchen sink, in the wall by the water heater in the laundry room, and in both of the bathrooms in the walls and flooring material. There is mold on the drywall in the NE corner of the dining room and mildew/mold on the ceiling/walls in the full bathroom. Recommend further evaluation by removing drywall and flooring material to determine the full extent of damage and repairs as necessary by a licensed contractor.

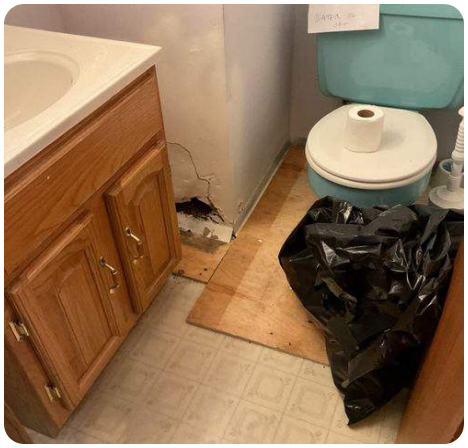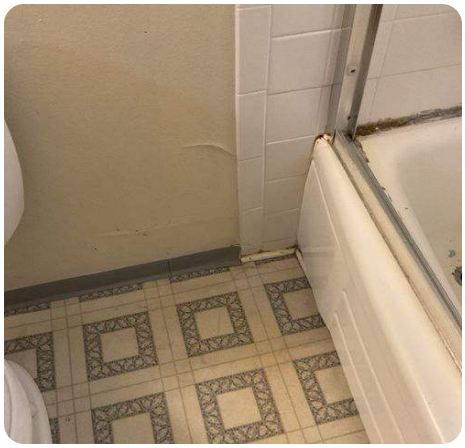



9.2 Interior > Doors

Interior Doors - Functional Functional

All accessible doors were inspected to ensure proper alignment, secure fitting, and smooth operation. No functional defects or issues were observed during the inspection, and the doors were found to be in satisfactory working condition.

© 2026 WIN Home Inspection

9.3 Interior > Smoke Alarms

Smoke Alarm Information Informational

Determining the functionality of smoke detectors is outside the scope of this inspection as the units should be checked monthly. Any unit greater than 10 years of age should be replaced as they are considered to be at the end of their service life. Functional smoke/fire detectors are recommended inside and outside each sleeping area for increased safety awareness.

9.4 Interior > Carbon Monoxide Alarms

Carbon Monoxide Alarms Evaluated Functional

Carbon monoxide (CO) alarms were located in the home. The inspector does not test these alarms; however, verifies that they are installed near sleeping areas and on each level of the home. For continued protection, regular manual testing and battery maintenance are recommended.

9.5 Interior > Countertops and Installed Cabinets

Countertops And Cabinets Functional Functional

The vanity cabinets, countertops, and associated components were in satisfactory condition at the time of inspection.

10.1 Appliances > Stove, Cooktop

About the Stove, Cooktop

Energy Source: Electric

Cooktop Tested Informational

An on/off test was performed to determine if the cooktop was functioning, it works but is in very poor condition.

10.2 Appliances > Refrigerator

Refrigerator Evaluated Functional

The refrigerator and freezer was working at the time of inspection.

10.3 Appliances > Washer, Hookups, and Drains

Washer Tested Functional

The washing machine was working at the time of the inspection.

10.4 Appliances > Dryer and Vent System

About the Dryer and Vent System

Dryer Energy Source: 240 V Electric

240 V Electric: Proper wiring or power to the 240v outlet cannot always be detected without the removal of the cover plate. The inspector will try using a voltage detector if the outlet is easily accessible.

© 2026 WIN Home Inspection

Dryer Tested Functional

The clothes dryer was working at the time of the inspection.

11.1 Fireplace > Fuel-Burning Equipment

Gas Fireplace Informational

There is a gas fireplace which was working at the time of the inspection.

Gas Fireplace Maintenance *(Included in Summary)* Informational

The glass on the front of the gas fireplace needs to be cleaned as part of regular maintenance. There is a white film starting to built up on the backside of the glass from the sulfur in the natural gas which blocks the view of the flame. Usually, this glass should be cleaned once a year depending on how often they are used.



12.1 Structural Components > Foundation and Slab

About the Foundation and Slab

Foundation Type: Poured Concrete, Raised Foundation/Crawlspace

Foundation Anchors: Not Verified

Visible Portions Of Foundation Functional

The concrete foundation was visibly assessed and found to be in functional condition.

12.2 Structural Components > Joists and Framing

About the Joists and Framing

Wall Structure: Wood 2×4

Floor Structure: Wood Beams w/2x Decking

Ceiling Structure: Wood Framing

Joists And Framing Informational

© 2026 WIN Home Inspection

Joists and framing members are typically concealed within the construction and are not fully visible during a standard home inspection. However, there is water damaged material in the kitchen, by the water heater in the laundry room, and in both of the bathrooms which was addressed in a previous section of this report. Some of the wood material will need to be replaced.

12.3 Structural Components > Roof Structure and Attic Components


About the Roof Structure and Attic Components

Roof Structure Type: Trusses

Roof Structure And Attic Components Evaluated

Functional

The roof structure and sheathing in the attic appeared to be in satisfactory condition at the time of the inspection.

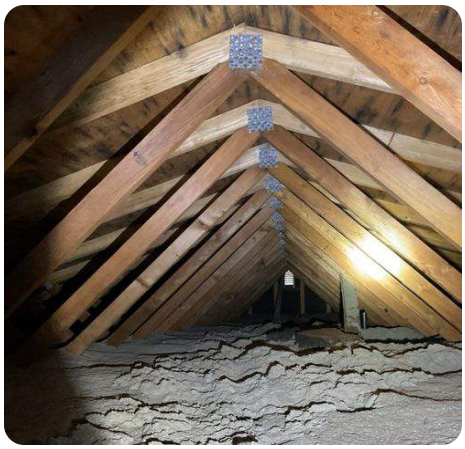



© 2026 WIN Home Inspection

13.1 Insulation and Ventilation > Insulation and Ventilation in Attic

About the Insulation and Ventilation in Attic

Attic Access Location: Bedroom Closet

Attic Evaluation Method: Head and Shoulders

Head and Shoulders: The Inspection was limited to at or near the attic entrance due to access issues.

Insulation Type: Blown-In Cellulose


Attic Insulation Approximate Depth: 5-10 Inches

Insulation And Ventilation Evaluated Functional

The insulation inside the attic has not been upgraded over the years, there appears to R 19 installed. Recommend upgrading the insulation in the future to R 49 which is the newest insulation standard to help save on the heating costs. Additionally, passive ventilation in the area appears to be functional.





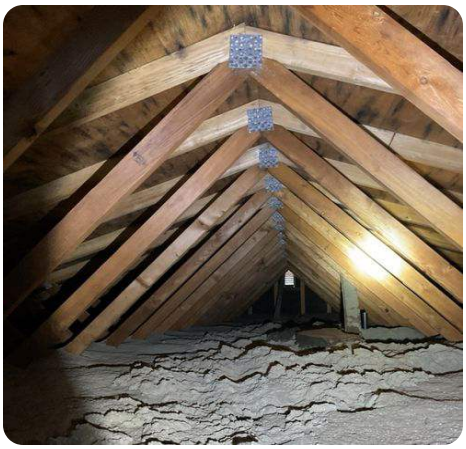

13.2 Insulation and Ventilation > Insulation and Ventilation in Crawl Space

About the Insulation and Ventilation in Crawl Space


Crawl Space Evaluation Method: Entered

Crawl Space Access Location: Exterior

Rodent Activity *(Included in Summary)* Action Required

There is extensive rodent activity in the crawl space. All of the underfloor insulation, the plastic vapor barrier, all of the rodent debris needs to be removed, all the openings that the rodents are entering from need to be filled, and new insulation/vapor barrier installed. Also, the crawl space access cover needs to be replaced, it is deteriorated, and has openings under it that rodents can enter thru. And, there appears to be a rodent tunnel under the crawl space access well that needs to be sealed off.

© 2026 WIN Home Inspection

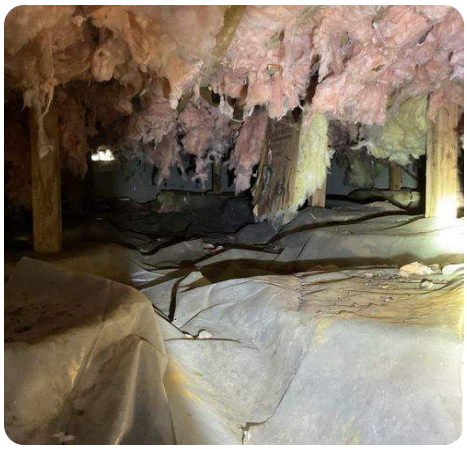






© 2026 WIN Home Inspection