


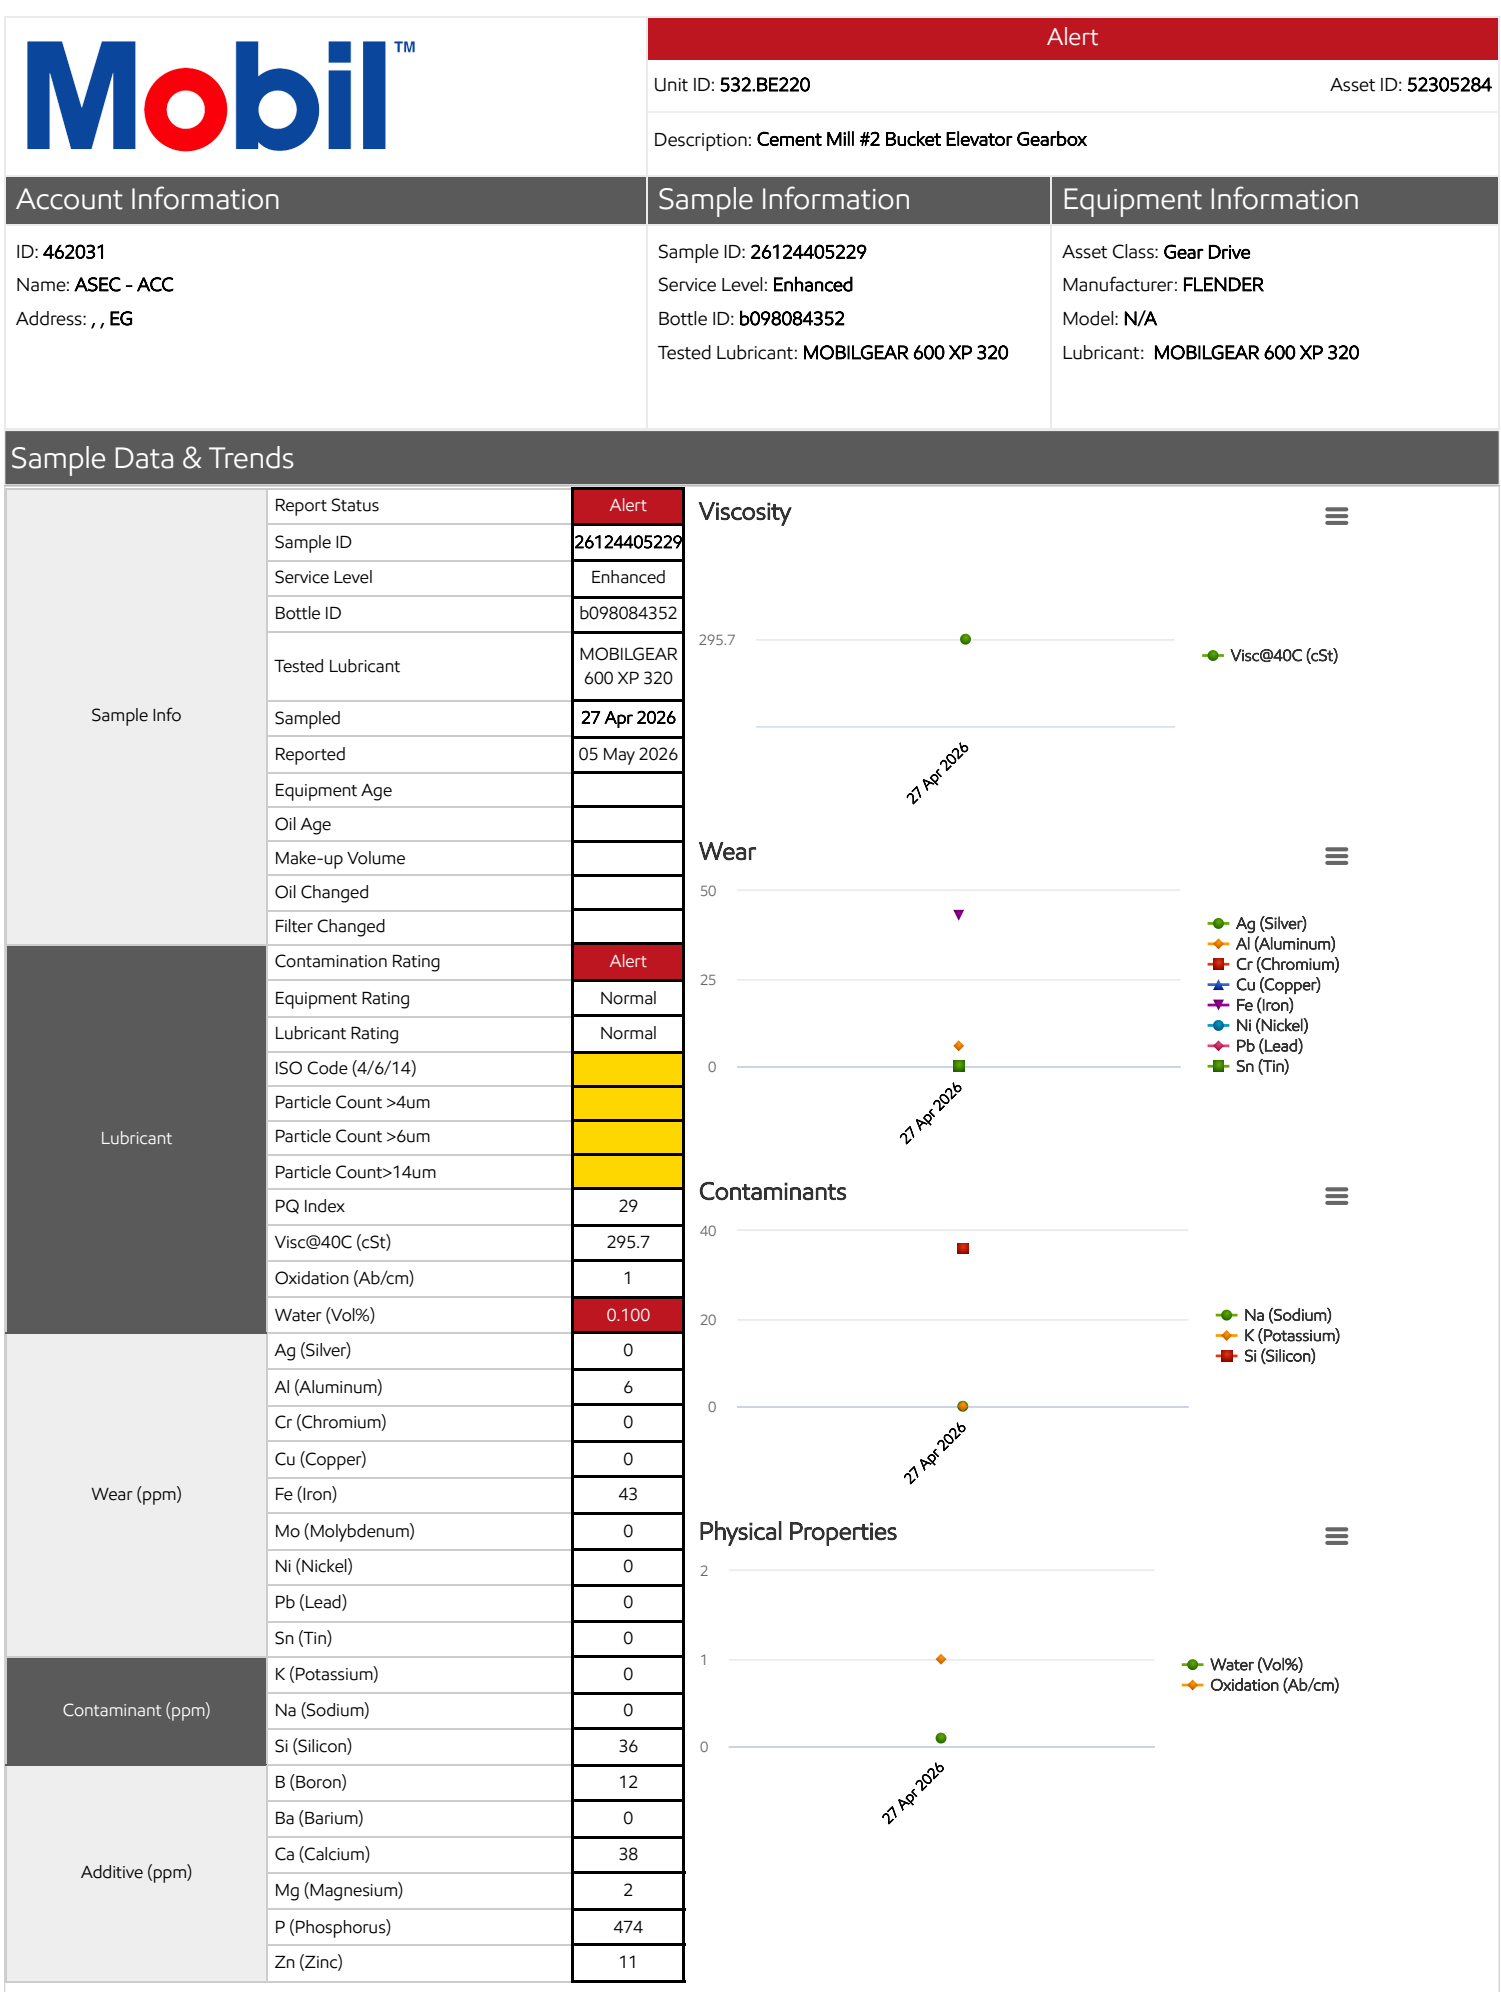

		Alert	
		Unit ID: 532.BE220	Asset ID: 52305284
		Description: Cement Mill #2 Bucket Elevator Gearbox	
Account Information		Sample Information	Equipment Information
ID: 462031 Name: ASEC - ACC Address: , , EG		Sample ID: 26124405229 Service Level: Enhanced Bottle ID: b098084352 Tested Lubricant: MOBILGEAR 600 XP 320	Asset Class: Gear Drive Manufacturer: FLENDER Model: N/A Lubricant: MOBILGEAR 600 XP 320
Recommendation/Comments			
ACTION REQUIRED - EXCESSIVE WATER CONTAMINATION. Determine source of water and take corrective action. Analyze the oil with an on-site water test if accessible. Potential sources of water include: a. Leaking seals; b. Condensation resulting from low operating temperatures or prolonged shutdowns; c. Compromised oil cooler; d. Direct exposure to atmosphere as a result of compromises to system components (i.e. improperly sealed tank fill access point. Remove water from oil using centrifuges or dehydration units, or drain the oil and recharge the system with new oil. Resample the system after corrective measures have been implemented. Contact your ExxonMobil representative for further assistance if necessary. ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary. ADMINISTRATION - PARTICLE COUNT DATA NOT REPORTED. The sample is heavily contaminated with visible sediment. Oil samples that contain significant levels of any contaminant can damage the laboratory's precision equipment. As a result, the particle count test was not completed, and analysis could not be provided. Before sending future samples to the laboratory, please ensure that no signs of visible sediment contamination are present. Consider the following: 1. The sample may not be representative of the system if it was acquired from a non-turbulent area (i.e. tank bottom); 2. Installing sample ports helps ensure that the sample is taken from the same location every time; 3. Tank fill caps and breathers might not be properly secured; 4. The filter / centrifuge may be operating incorrectly. If the sample was representative of the system, change the oil immediately to prevent equipment damage. Contact your ExxonMobil representative for further assistance if necessary.			
Sample Timeline			
27 Apr 2026 3:10 PM - Abd El Rahman Khaled - In Service Oil Sample : Comments: Photo:			