

Caution

Unit ID: 533.MD302

Asset ID: 52305310

Description: **Cement Mill #3 Separator Gearbox**

Account Information

ID: 462031
Name: ASEC - ACC
Address: , , EG

Sample Information

Sample ID: **26124405225**
Service Level: **Enhanced**
Bottle ID: **b098087663**
Tested Lubricant: **MOBIL SHC 632**

Equipment Information

Asset Class: Gear Drive
Manufacturer: FLENDER
Model: N/A
Lubricant: MOBIL SHC 632


Sample Data & Trends

Sample Info	Report Status	Caution
	Sample ID	26124405225
	Service Level	Enhanced
	Bottle ID	b098087663
	Tested Lubricant	MOBIL SHC 632
	Sampled	27 Apr 2026
	Reported	05 May 2026
	Equipment Age	
	Oil Age	
	Make-up Volume	
	Oil Changed	
	Filter Changed	
	Lubricant	Contamination Rating
Equipment Rating		Normal
Lubricant Rating		Normal
ISO Code (4/6/14)		
Particle Count >4um		
Particle Count >6um		
Particle Count>14um		
PQ Index		32
Visc@40C (cSt)		280.1
TAN (mg KOH/g)		1.40
Water (Vol%)		0.050
Wear (ppm)	Ag (Silver)	0
	Al (Aluminum)	6
	Cr (Chromium)	0
	Cu (Copper)	0
	Fe (Iron)	63
	Mo (Molybdenum)	0
	Ni (Nickel)	0
	Pb (Lead)	0
	Sn (Tin)	0
Contaminant (ppm)	K (Potassium)	0
	Na (Sodium)	0
	Si (Silicon)	32
Additive (ppm)	B (Boron)	12
	Ba (Barium)	0
	Ca (Calcium)	52
	Mg (Magnesium)	2
	P (Phosphorus)	466
	Zn (Zinc)	165


Viscosity




Wear

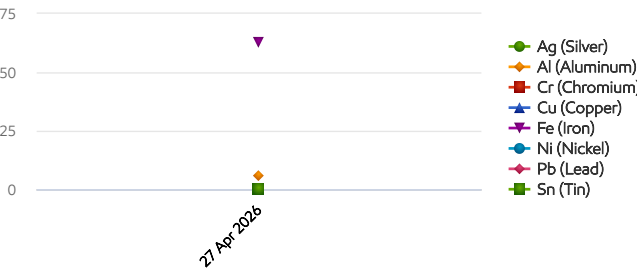

Contaminants

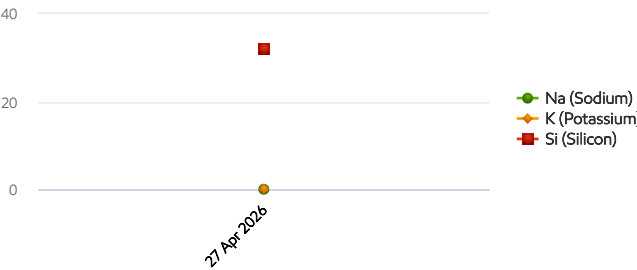

Physical Properties

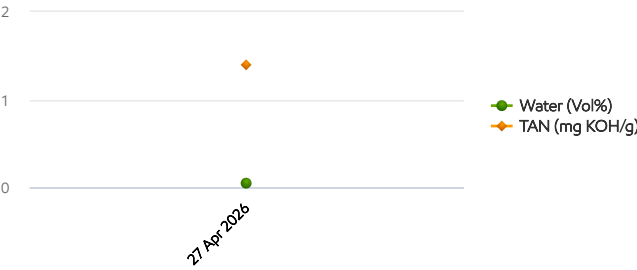

		Caution	
		Unit ID: 533.MD302	Asset ID: 52305310
		Description: Cement Mill #3 Separator Gearbox	
Account Information		Sample Information	Equipment Information
ID: 462031 Name: ASEC - ACC Address: ,, EG		Sample ID: 26124405225 Service Level: Enhanced Bottle ID: b098087663 Tested Lubricant: MOBIL SHC 632	Asset Class: Gear Drive Manufacturer: FLENDER Model: N/A Lubricant: MOBIL SHC 632
Recommendation/Comments			
ACTION REQUIRED - EXCESSIVE WATER CONTAMINATION. Determine source of water and take corrective action. Analyze the oil with an on-site water test if accessible. Potential sources of water include: a. Leaking seals; b. Condensation resulting from low operating temperatures or prolonged shutdowns; c. Compromised oil cooler; d. Direct exposure to atmosphere as a result of compromises to system components (i.e. improperly sealed tank fill access point. Remove water from oil using centrifuges or dehydration units, or drain the oil and recharge the system with new oil. Resample the system after corrective measures have been implemented. Contact your ExxonMobil representative for further assistance if necessary. ADMINISTRATION - PARTICLE COUNT DATA NOT REPORTED. The sample is heavily contaminated with visible sediment. Oil samples that contain significant levels of any contaminant can damage the laboratory's precision equipment. As a result, the particle count test was not completed, and analysis could not be provided. Before sending future samples to the laboratory, please ensure that no signs of visible sediment contamination are present. Consider the following: 1. The sample may not be representative of the system if it was acquired from a non-turbulent area (i.e. tank bottom); 2. Installing sample ports helps ensure that the sample is taken from the same location every time; 3. Tank fill caps and breathers might not be properly secured; 4. The filter / centrifuge may be operating incorrectly. If the sample was representative of the system, change the oil immediately to prevent equipment damage. Contact your ExxonMobil representative for further assistance if necessary.			
Sample Timeline			
27 Apr 2026 2:58 PM - Abd El Rahman Khaled - In Service Oil Sample : Comments: Photo:			