Global Techstream+

NEXT GENERATION DIAGNOSTICS SOFTWARE

Version 2023.04.003.02

Updated 11/29/23

KNOWN BUGS

1) Grand Highlander “Recognition Camera Axis Adjust” Static Utility Inoperable
2) Printing Issues
3) GTS+ Launch/Login issues
4) Agent Lite Update Error Message “Failed to download GTSPlus"
5) Blank Yes/No Box during Vehicle Connectivity
6) ECU Select Functionality from Health Check Results
7) Software Installation and Update Issues
8) BSM (Blind Spot Monitor) Sensor Replacement

FIXED ITEMS

1) Grand Highlander Front Millimeter Wave Radar Adjustment Failure
2) EVAP System Test Fails to Launch
3) Immobilizer Reset Issues
4) Health Check Monitors Status
5) Grand Highlander listed as “AMX”
6) Grand Highlander Front Recognition Camera Dynamic Utilities Inoperable
7) Unable to access DRS ECU on MY23 RX500h
8) "GTS + PF Error" Error Message
9) Blank ECU/Software as a part failure

TOYOTA

LEXUS

KNOWN BUGS LIST

Issue 1 – Grand Highlander “Recognition Camera Axis Adjust” Static Utility Inoperable

Affected Models

MY24 Grand Highlander

Work Around


Please use dynamic utility currently

The static utility “Recognition Camera Axis Adjust” fails to complete

Use the “Transition to Online Axis Alignment Mode” utility.

HINT: Read Service Info Carefully

- There are 3 ways to relearn this system
- If “Camera Axis Adjustment Value Write” cannot be performed, check that there are no DTC’s or RoB codes.
- Static = Stationary with targets 
- Dynamic = Driving with no targets 

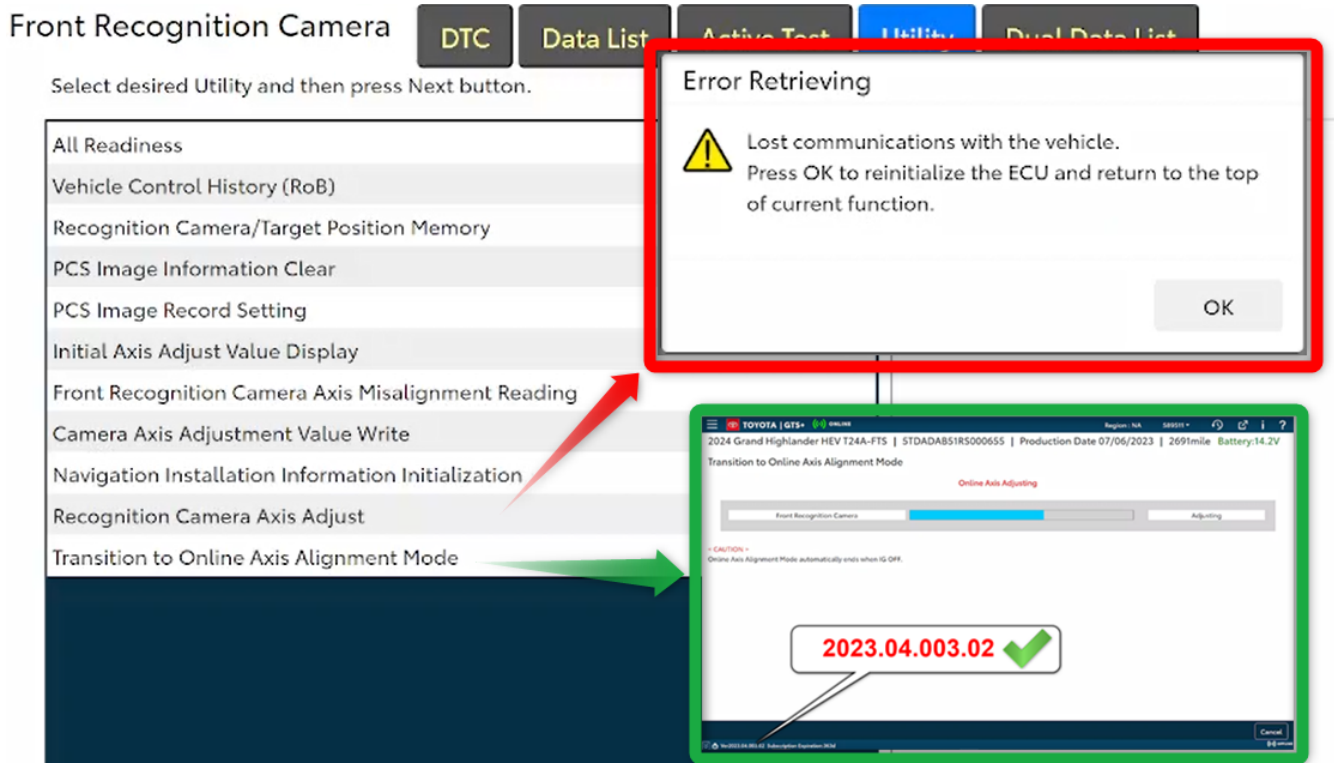

Fix ETA

To be determined

KNOWN BUGS LIST

Issue 2 - Printing Issues (1 of 2)

Affected Models **All models**

Work Around

For Health Checks and data lists, the web browser's print function (or Ctrl + P) should work correctly.

For general screenshot printing:

- **Click "Prt Scn"**
- **Then open the paint program and paste (Ctrl + V)**
- **Then can save as a file (Ctrl +S) or print (Ctrl + P)**

For DTC, FF Data, RoB, VCH, and operational history please see the new features list.

Please see the new features list

Fix ETA **Enhancements released V2023.04.003.02 and more enhancements in 2024.01 (due February 2024)**

Issue 2 - Printing Issues (2 of 2)

Browser Extensions:


“full page print” or “Go full page”

GoFullPage is available to allow all information to be printed.

Edge:
https://microsoftedge.microsoft.com/addons/detail/gofullpagefull-page-sc/hfaciehifhdcgoolaejkoncjciicbemc

Chrome:
https://chrome.google.com/webstore/detail/gofullpage-fullpage-scre/fdpohaocaechififmbbbbbknoalclacl

For CAN Bus Check printouts, select “Headers and footers” and “Background graphics before printing.

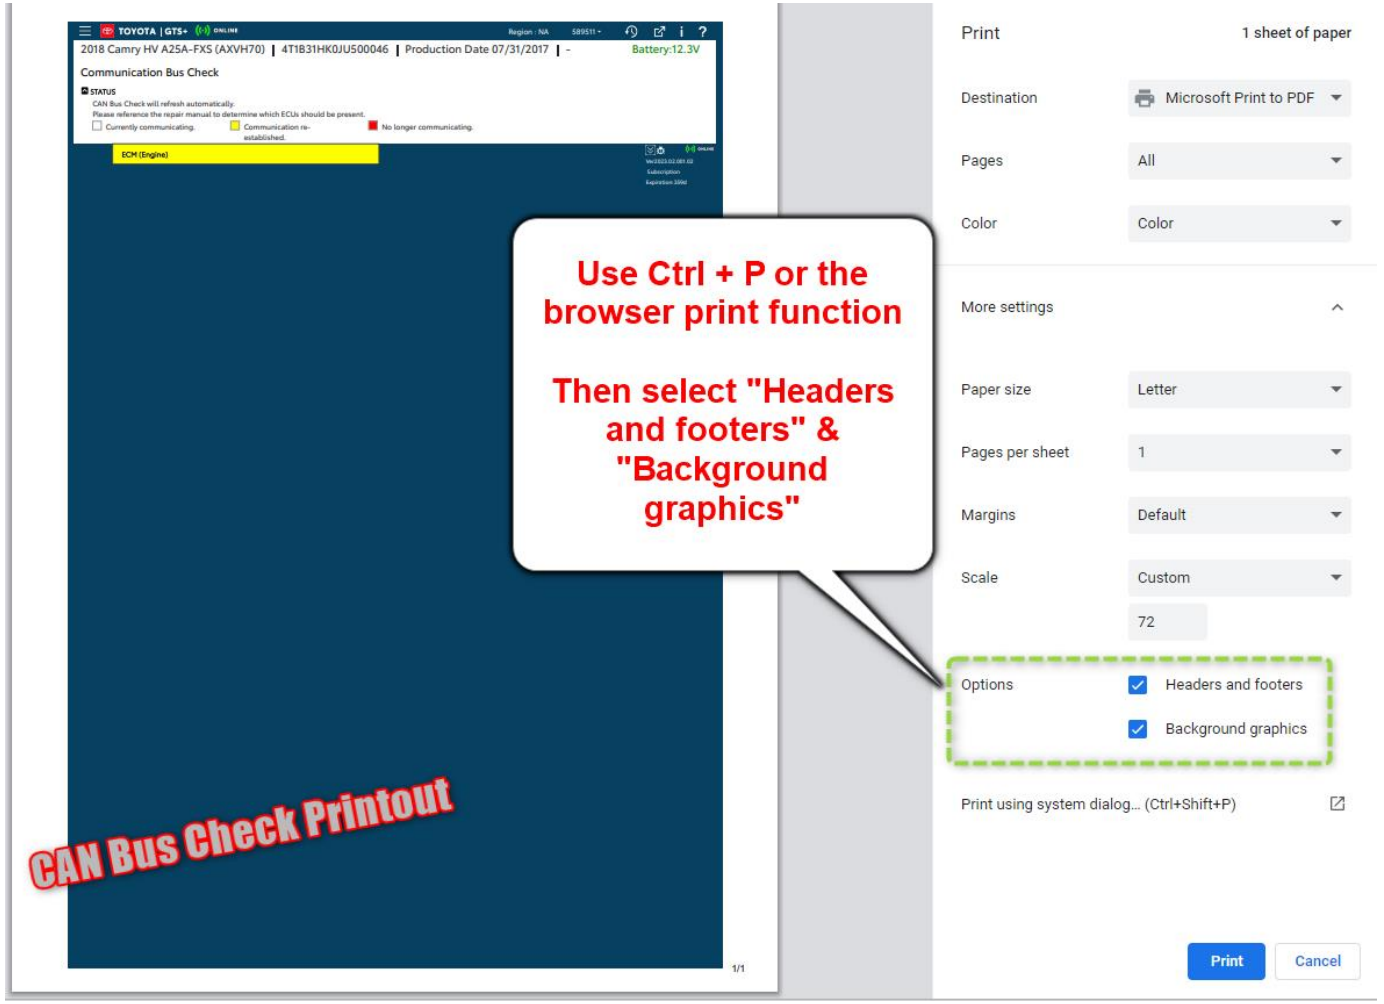

KNOWN BUGS LIST

Issue 3 – GTS+ Launch/Login issues


Affected Models

All models

GTS+ Launch or logging-in issues not pertaining to the PF error. For most errors experienced while launching GTS+ follow the workaround procedure (excludes "failure for establishing a connection with platform [PF]" error)

Work Around

Verify TIS or GTS+ is not logged into multiple PCs.
Clear browser cache, disable pop-up blocker, close browser, reopen & then GTS+ should launch without issue.

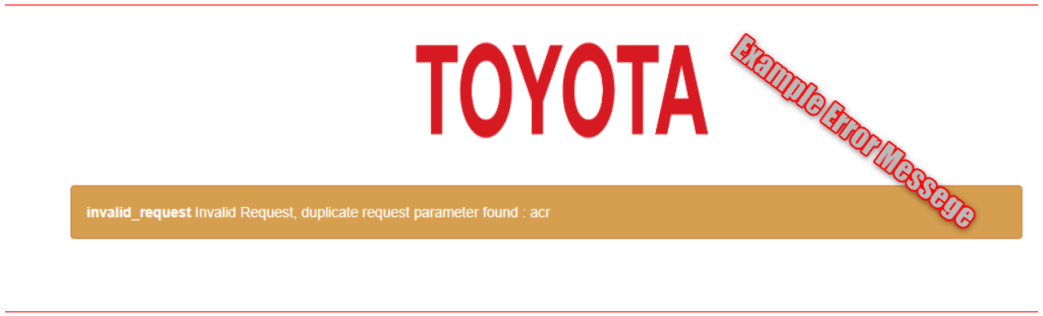



Fix ETA

N/A

KNOWN BUGS LIST

Issue 4 – Agent Lite update error message “Failed to download GTSPlus”


Affected Models

All

Agent Lite Update for Error Message "failing to download GTSPlus" may continuously display in the lower right-hand corner.

Work Around

Uninstall Agent Lite, then download and install the Agent Lite from TIS Diagnostics page.

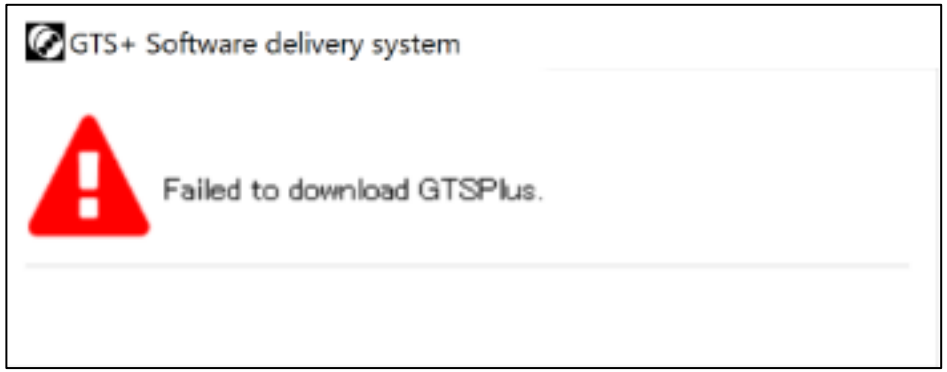


Fix ETA

N/A

KNOWN BUGS LIST

Issue 5 – Blank Yes/No Box During Vehicle Connectivity

Affected Models **All**

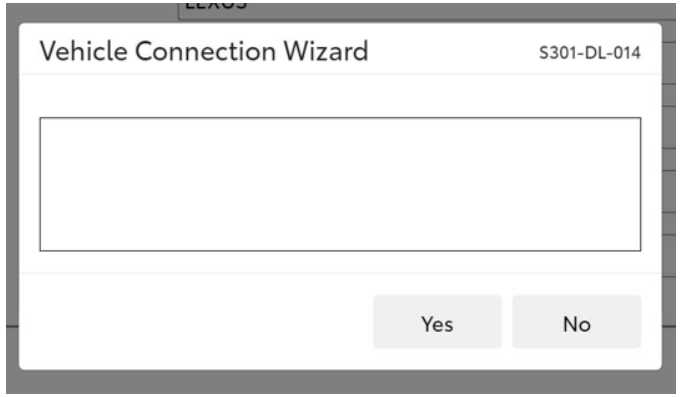

Work Around

Click "Yes" to start a Health Check, "No" to continue to the vehicle’s main menu

PLEASE use the F12 key Error Report feature so that TMNA can capture vehicle info on affected vehicles to identify the root cause.

Fix ETA **N/A**


KNOWN BUGS LIST

Issue 6 - ECU Select Functionality from Health Check Results

Affected Models

All

When attempting to enter an ECU from the Health Check results screen, saved DTC info is displayed. To get to live ECU data follow the system-select process

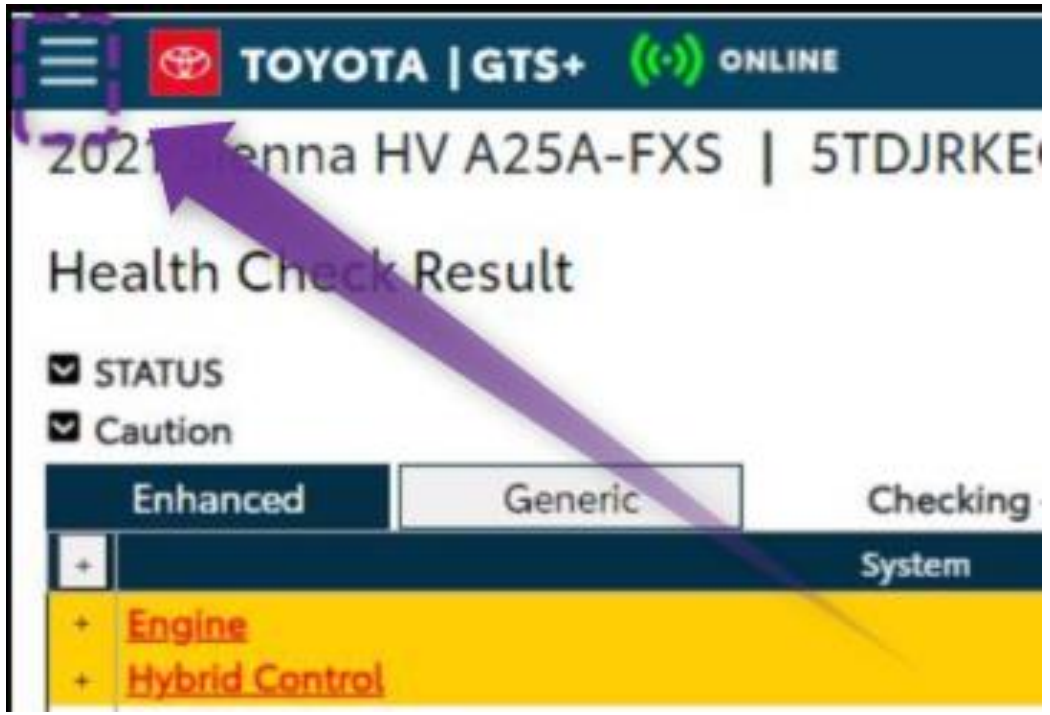

Work Around

Use the "hamburger menu" to access System Select, then select ECU from there. (Three lines icon top right of screen)

Fix ETA

N/A

KNOWN BUGS LIST

Issue 7 – Software Installation and Update Issues (1 of 2)

Affected Models	**All**

Work Around

In Windows 10, User is not able to start GTS+GUI Server

Correction

1) Windows Search -> Turn Windows feature on or off

2) Uncheck the Following:


- ❑ **Hyper-V**
- ❑ **Virtual Machine Platform**
- ❑ **Containers**
- ❑ **Windows Subsystem for Linux**
- ❑ **Microsoft Defender Application Guard**
- ❑ **Remote Differential Compression API Support**


3) Apply changes -> restart the PC

See Illustrations

KNOWN BUGS LIST

Issue 7 – Software Installation and Update Issues (2 pf 2)

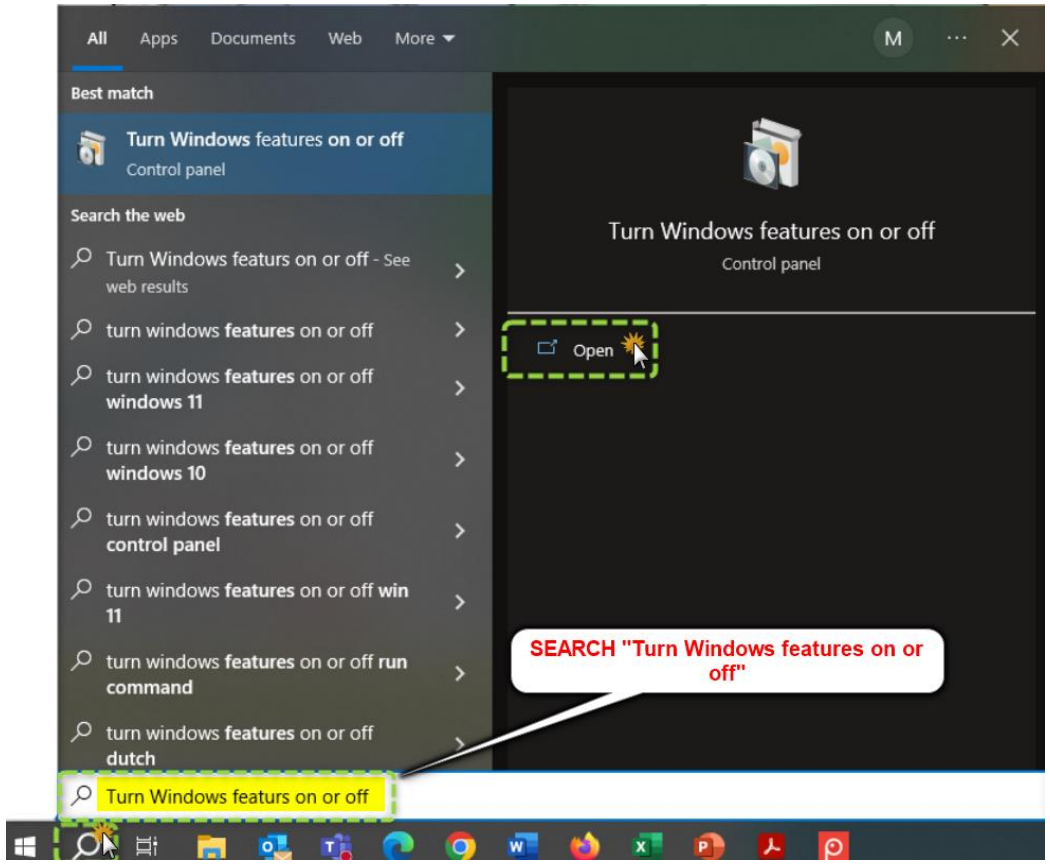

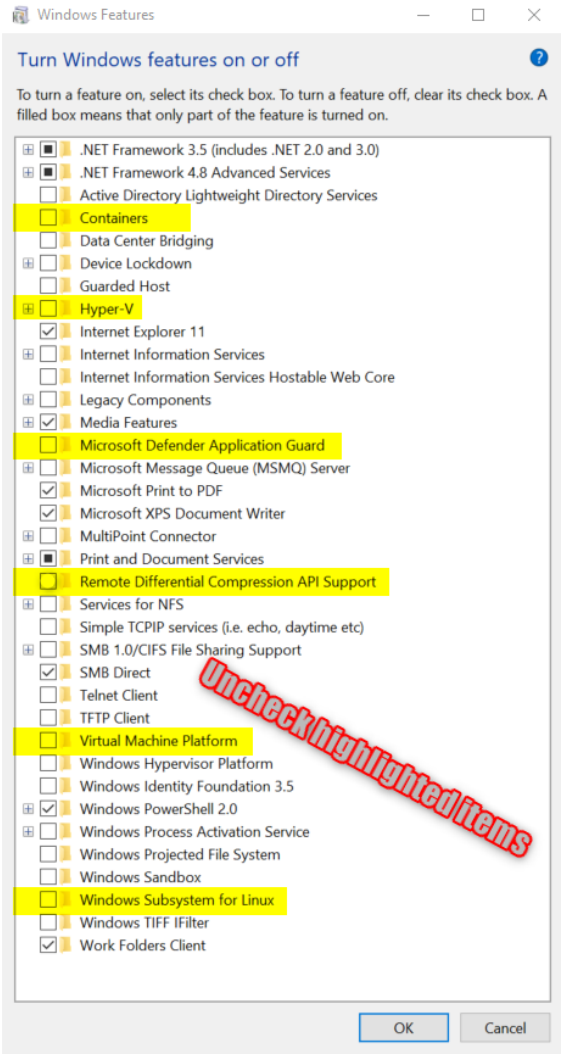

Fix ETA **N/A**

KNOWN BUGS LIST

Issue 8 - BSM (Blind Spot Monitor) Sensor Replacement

Affected Models

2023-2024 MY Prius, RX, & Grand Highlander / HV

After BSM sensor replacement, the clear RoB code function fails. Configure “Yes” may still exist after programming due to the inability to clear RoB.

Work Around

Submit an error report with a point of contact.

Fix ETA

To be announced

FIXED ITEMS

Fixed Item 1 - Grand Highlander Front Millimeter Wave Radar Adjustment Failure

Affected Models

MY24+ Toyota Grand Highlander

Performing the Front Millimeter Wave Radar Adjustment/Beam Axis Adjustment, the tool produces an error.

Now working as designed.



Remedy Software Version

2023.04.003.02


FIXED ITEMS

Fixed Item 2 - EVAP System Test Fails to Launch

Affected Models **All**

EVAP (Evaporative Emissions) system fails to launch from the engine ECU utility menu.

Now working as designed.

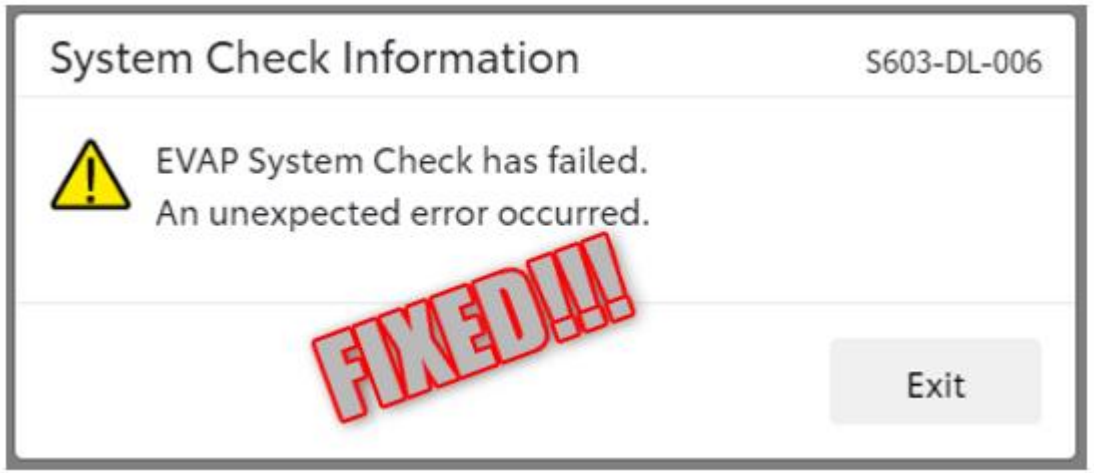

Remedy Software Version **2023.04.003.02**

FIXED ITEMS

Fixed Item 3 - Immobilizer Reseed Issues

Affected Models Model Years 2019+

GTS+ not connecting to the vehicle for Immobilizer Reseed - GTS+


On some 19+MY, GTS+ could not communicate with the vehicle when all keys were lost.

Now working as designed.

Immobilizer Passcode Generation Error

This anomaly is associated with users' PCs not generating a 96-digit seed code recognized by TIS. The issue appeared not to be login or VIN-specific.

Now working as designed.

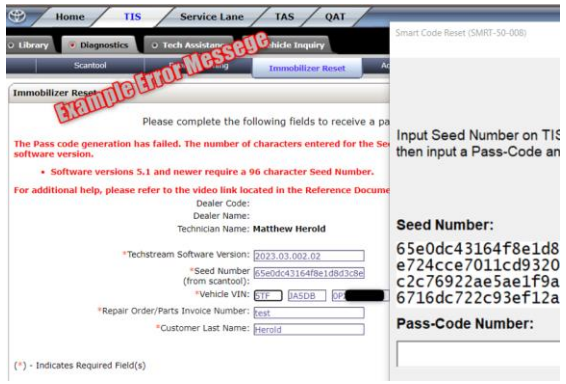

Remedy Software Versions 2023.04.003.02

FIXED ITEMS

Fixed Item 4 - Health Check Monitors Status

Affected Models

All

Health Check Monitors Status; the engine monitor status section would always show "Inc." on Health Check.

Status now working as designed.



Remedy Software Version

2023.04.003.02

FIXED ITEMS

Fixed Item 5 - Grand Highlander listed as “AMX”

Affected Models **MY24+ Toyota Grand Highlander**

The Grand Highlander populated as AMX in GTS+





Remedy Software Version **2023.04.003.02**

FIXED ITEMS


Fixed Item 6 - Grand Highlander Front Recognition Camera Dynamic Utilities Inoperable


Affected Models

2024 Grand Highlander



The “Recognition Camera Axis Adjust“ utility would error when opened in previous GTS+ versions. This has been fixed.

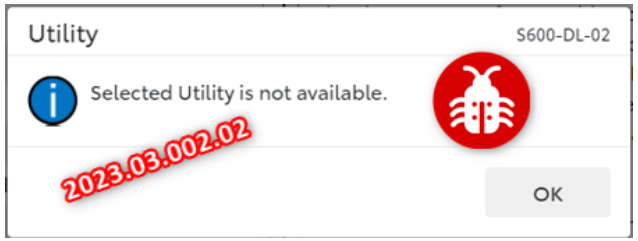

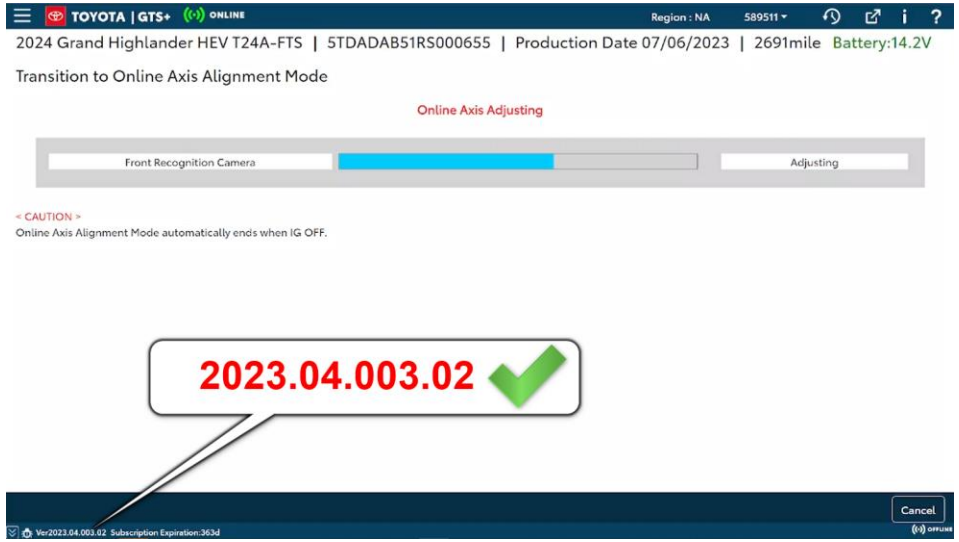

Remedy Software Version

2023.04.003.02


FIXED ITEMS

Fixed Item 7 - Unable to access DRS ECU on MY23 RX500h

Affected Models

2023 Lexus RX500h

The DRS (Dynamic Rear Steering) ECU was not showing on the Health Check or System Select. Previously, users had to manually populate 2024 RX500h> T24A-FTS> Others.

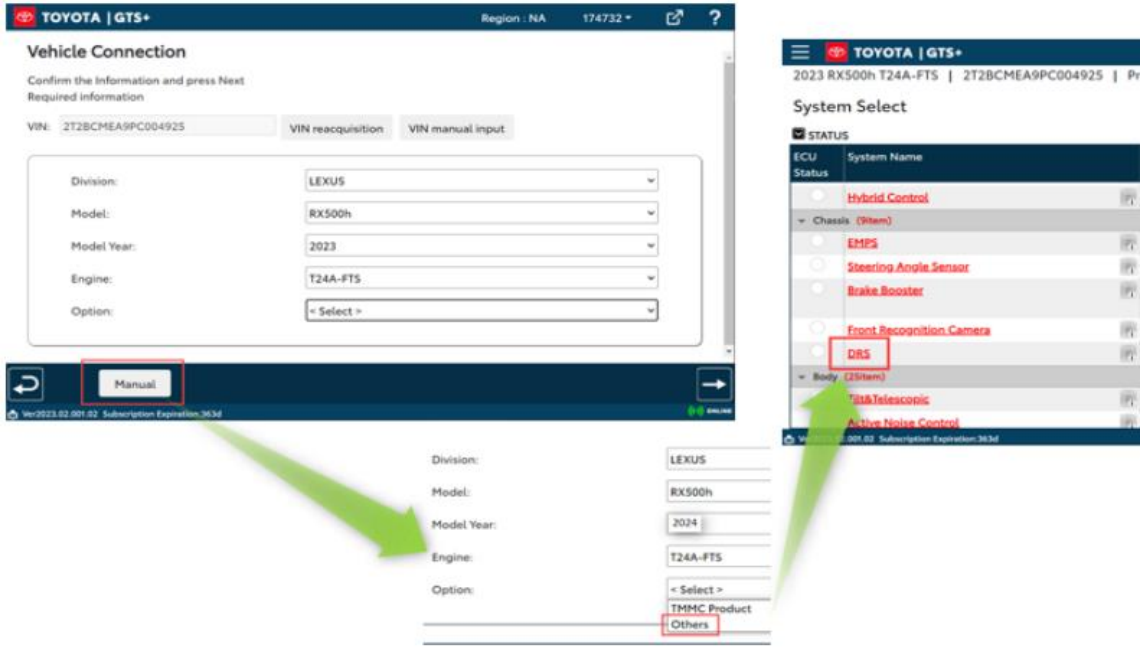

DRS ECU is now listed and supported correctly.

Remedy Software Version

2023.04.003.02


FIXED ITEMS

Fixed Item 8 - GTS+ + PF Error Message in Info Center – GTS+ Inoperable

Affected Models

All

This issue has mainly affected corporate users and dealership networks with heavy network restrictions.
The developers have prepared the remedy

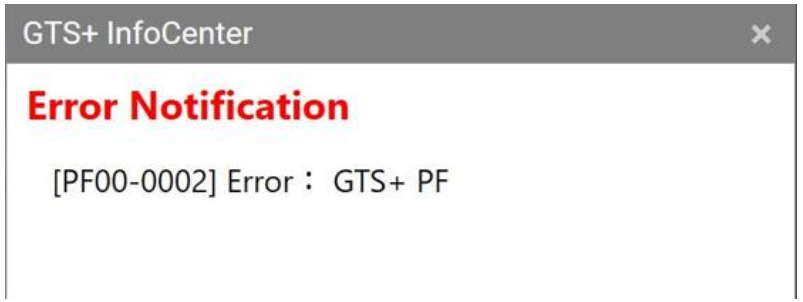

Remedy Software Version

2023.04.003.02

FIXED ITEMS

Fixed Item 9 – Blank ECU/Software as a Part Failure

Affected Models

All models

Blank ECU Calibration Download would error. While configuring ECU after replacing a blank ECU, identifying or downloading the needed calibration file mat fails.

Working as designed.

If the issue returns, please try an alternative open, unrestricted network

Remedy Software Version

2023.04.003.02