SITE INSPECTION REPORT

Customer Complaint – Surface Dents on Aluminium Composite Panel (ACP) Fascia

Site	Vapi, Gujarat
Date of site visit	22/10/2026]
Evidence reference	Site photographs and site videos
Product	AL32, SH310
Complaint	Dents on the ACP surface
Site Visit By	Mr. Vishal Saroj (CSE WEST)

1. Background of the complaint

The client raised a complaint that very small dents are present on the ACP cladding installed on the shop fascia, as seen in the video shared by the client. A customer service engineer visited the site to verify the complaint and investigate the cause.

2. Site observations

- **Complaint confirmed:** Small, isolated pinpoint dents are present on the panel face at several locations, as seen in Fig. 3 to Fig. 12.
- **Surface finish:** The panels have a high-gloss, mirror-type black finish. This type of finish reflects the surroundings and makes even minor surface imperfections and dents very prominent (see Fig. 1 and 2).
- **Handling damage:** Dents of a larger size were also noted which indicates physical impact or pressure on the surface during the fabrication or installation at site.

3. Photographic evidence

Site photographs



Fig. 1 – Corner / return of the fascia – glossy black ACP, folded edge and panel joints.

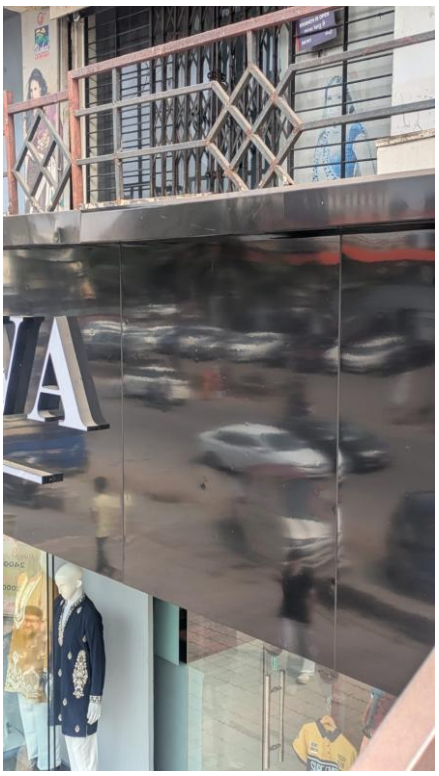


Fig. 2 – Main fascia below first-floor railing – mirror-finish surface; reflections show surface distortion.

Frames taken from site videos – overall view



Fig. 3 – Overall view of the fascia and shop front



Fig. 4 – Fascia with signage letters – overall panel layout



Fig. 5 – Panel joints and signage zone – general view of the fascia



Fig. 6 – Localised dent visible on the panel face near the signage

Frames taken from site videos – close-up of dents



Fig. 7 – Close-up: small dents reflection on the surface



Fig. 8 – Close-up: pinpoint dent on the panel face



Fig. 9 – Close-up: isolated small dent, flat panel area

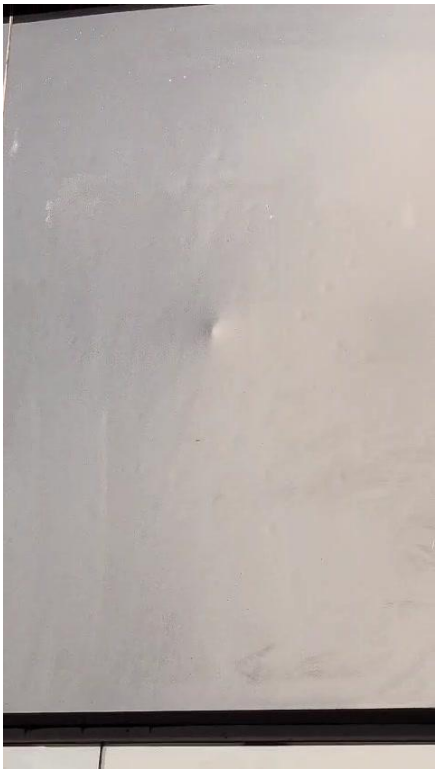


Fig. 10 – Close-up: isolated dent with light drag mark



Fig. 11 – Close-up: multiple tiny dents on the upper panel area

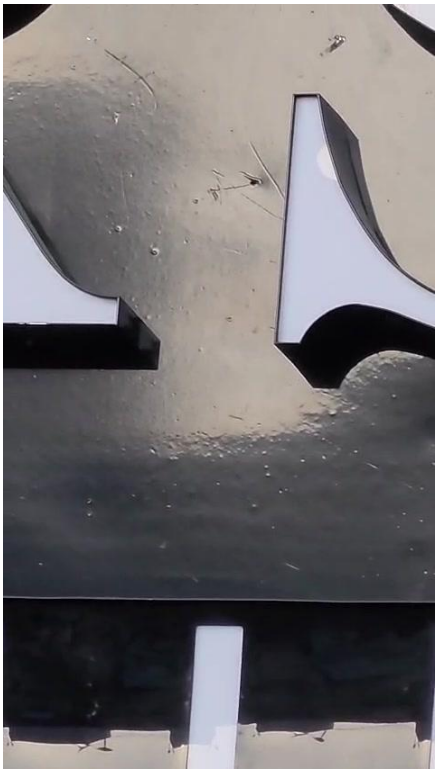


Fig. 12 – Area around the signage letters – surface marks near letter edges

4. Investigation and probable cause

Based on the inspection and discussion with the client, the damage is assessed to be caused during fabrication and installation, and not by a manufacturing defect in the sheet. The reasons are:

- **Restricted working space.** The client confirmed that the entire cutting and fabrication work was done in a narrow space. Sheets handled in limited space are easily knocked, rested against hard objects or pressed against the surface.
- **Use of a step ladder for support.** The pattern of the tiny dents resembles the contact points of a step ladder. It is probable that a step ladder was rested against the face of the ACP while the SPF (surface protection film) was being removed.
- **Nature of the dents.** The dents are localised and isolated, with larger impact dents in some places, which is consistent with mechanical contact during fabrication work, rather than a manufacturing defect.

5. Discussion with the client and status

- The findings and probable causes were explained to the client.
- The client has refused to sign the MOM.

6. Conclusion

Based on the site inspection, photographic evidence, and discussion with the client, the observed surface dents on the AL32, SH310 ACP fascia are assessed to be consistent with mechanical damage caused during fabrication, handling, or installation. The restricted working space and possible contact with a step ladder or other hard objects may have contributed to the damage. The high-gloss, mirror-finish surface makes even minor dents more prominent. Based on the available evidence, the issue is not attributed to a manufacturing defect in the ACP sheet. So, this complaint is not accepted.

Report Submitted By:
Mr. Naveen Yadav, Sr. Manager – Quality
27.10.2026