



Technical Bulletin 2025

PT. CHERY SALES INDONESIA

Model : Omoda E5	Nomor : CSTB-25-005
VIN : -	Tanggal : 8 Februari 2025
Perihal : Pemeriksaan Kondisi Selang dan Pipa Minyak Rem Omoda E5	Informasi : - Rahasia [v] - Informasi Umum [] - Edukasi Pelanggan []


Ditujukan kepada :

Branch Manager []	Service Manager [v]	Technician [v]	Parts Manager [v]
Customer Relation [v]	Service Advisor [v]	Warranty Specialist [v]	Team Leader [v]

I. PENDAHULUAN

Telah ditemukan beberapa kendaraan Omoda E5 dengan keluhan indikator sistem rem menyala dan daya pengereman berkurang. Berdasarkan pemeriksaan ditemukan pemasangan selang minyak rem yang menghubungkan tangki cadangan dan IPB yang kurang baik, mengakibatkan kekurangan suplai minyak rem ke sistem rem.

Untuk langkah pencegahan dan keselamatan, dealer wajib melakukan pemeriksaan terhadap potensi problem yang sama terjadi pada kendaraan pelanggan dan stok di dealer masing-masing.

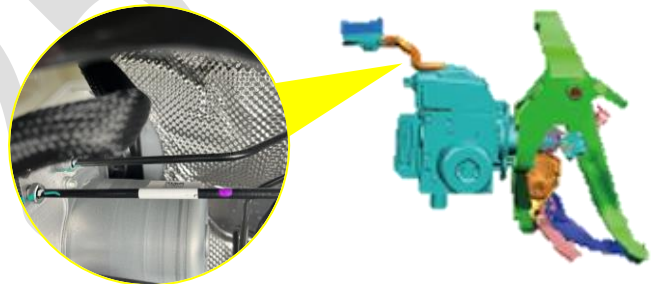


II. ALAT

1. Lampu senter
2. Hand tools standar mekanik

III. PROSEDUR Pengerjaan

Lakukan pemeriksaan secara visual dengan seksama terhadap jalur selang minyak rem dan pipa-pipa minyak rem. Pastikan semua part terpasang sempurna dan tidak ada yang tertekuk, terpuntir atau terlipat. Bila ditemukan part dengan kondisi kesalahan pemasangan seperti disebutkan di atas, lakukan penggantian part selang minyak rem atau pipa minyak rem yang terkait.

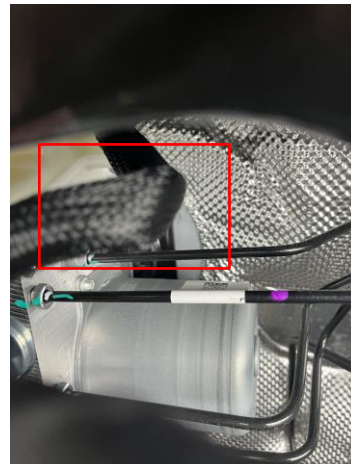

IV. PROSEDUR CLAIM WARRANTY

Lakukan pengajuan normal claim untuk jasa pemeriksaan sesuai tabel berikut. Lakukan dokumentasi hasil pemeriksaan sesuai aktual pada kendaraan.

Kode Jasa	Deskripsi	Waktu Kerja
T19CEVKKK70003282702	EHCUC Brake Fluid Hose Inspection	30

Bila diperlukan penggantian part, silahkan ajukan TAR melalui DMS terlebih dahulu dengan melengkapi data kendaraan dan hasil pemeriksaan.

V. LAIN-LAIN

Jika ada pertanyaan dan membutuhkan informasi terkait penjelasan di atas, silahkan hubungi dan kirim email ke haekal@mychery.com ikhwan.rahmadin@mychery.com bayu.suseno@mychery.com marjan@mychery.com

PENTING!! : DILARANG BERTANYA SEBELUM MEMBACA!

Demikian untuk dapat diketahui bersama. Atas perhatian dan kerjasama yang baik diucapkan terima kasih.

Hormat kami,
After Sales Service Department

Prepare	Review	Approval
		
<u>M. Ikhwan Rahmadin</u>	<u>Bayu Suseno</u>	<u>Reza Deniar</u>
<i>Technical Senior Specialist</i>	<i>Technical Supervisor</i>	<i>Head of Aftersales</i>



Technical Bulletin 2025

PT. CHERY SALES INDONESIA

Model : Omoda E5	No. : CSTB-25-005
VIN : -	Date : 8 February 2025
About : Brake Hose and Brake Pipeline Inspection on Omoda E5	Information : - Classified [v] - General Information [] - Customer Education []


Ditujukan kepada :

Branch Manager []	Service Manager [v]	Technician [v]	Parts Manager [v]
Customer Relation [v]	Service Advisor [v]	Warranty Specialist [v]	Team Leader [v]

I. BACKGROUND

Found already some on some Omoda E5 models complained braking malfunction indicator was lit and decreased braking power. Based on investigation, found the brake fluid hose connecting the reservoir tank and IPB actuator improperly installed, led to lack of brake fluid supply to the brake system.

For further preventive and safety action, the dealers instructed to perform inspection due to persists problem potency in customer's cars and dealer's stock cars.

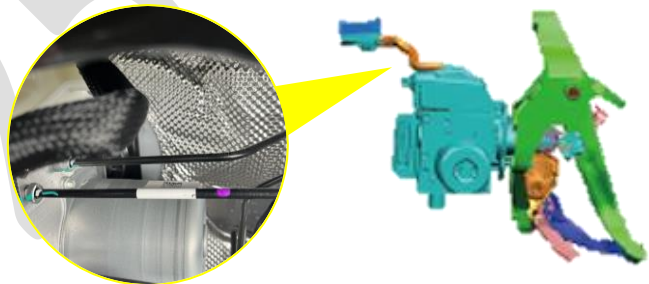


II. TOOLS

1. Working light
2. Technician hand tools equipment

III. WORKING PROCEDURE

Perform visual inspection to brake fluid hose and brake fluid pipe lines. Make sure all related parts are installed properly and there's no kinked, twisted or folded. If there is failure installation conditions as described before, please replace related brake fluid hose or brake pipeline.

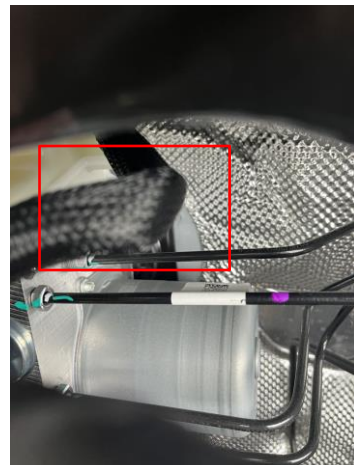

IV. CLAIM WARRANTY PROCEDURE

Submit a normal claim for services according to the following table. Take documentation of the activity result.

Labor Code	Description	Labor Hour
T19CEVKKK70003282702	EHCUC Brake Fluid Hose Inspection	30

If part replacement is required, please submit TAR in DMS with vehicle data and inspection result evidence attachment.

V. ETC

If you have any questions and need information related to the above explanation, please contact and send an email to haekal@mychery.com ikhwan.rahmadin@mychery.com bayu.suseno@mychery.com marjan@mychery.com

IMPORTANT!! : NO ASKING QUESTIONS BEFORE READING!

Thus the information to be known together. Thank you for your attention and good cooperation.

Best Regards,
After Sales Service Department

Prepare	Review	Approval
		
M. Ikhwan Rahmadin	Bayu Suseno	Reza Deniar
<i>Technical Senior Specialist</i>	<i>Technical Supervisor</i>	<i>Head of Aftersales</i>