



CODE PREPARATION PROCEDURE

Overall view of the tools

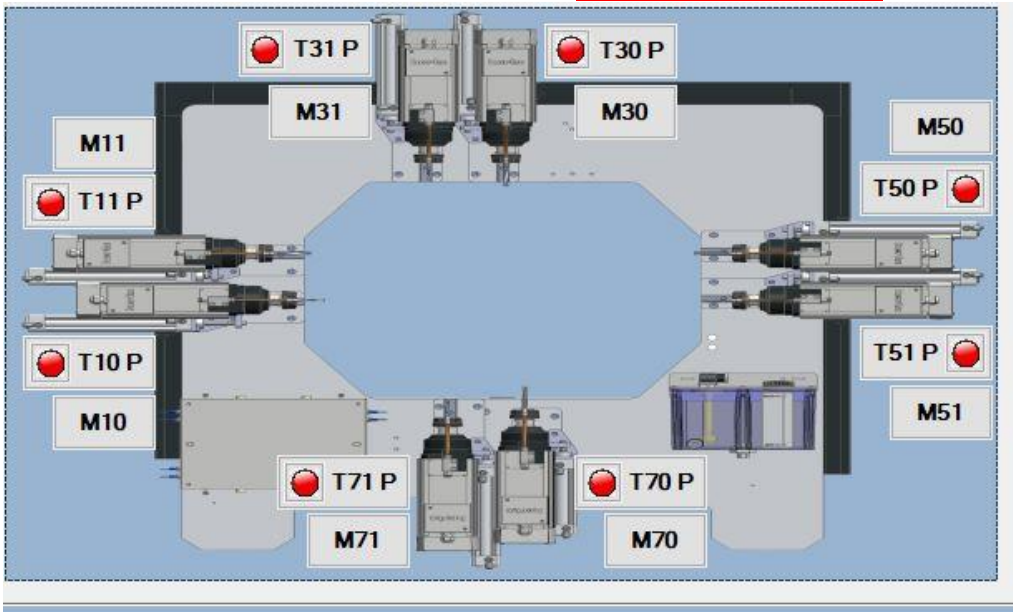

Machine is capable for doing the below operations.

- Slot for lock
- Espagnolette slot with radius
- Water drain slot
- Left barrel hole
- Right barrel hole
- Drill hole
- Marking

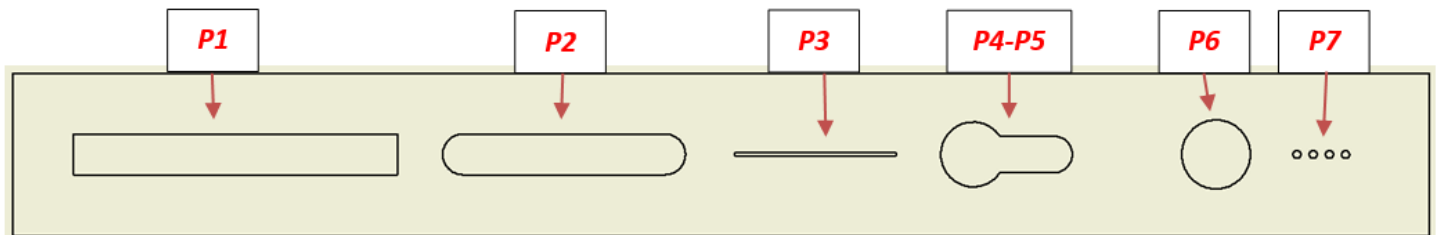


Dimensioning Conditions:

If the cutting length is 1200,5 mm it is entered as 12005. This format is valid for cutting angles too. For example if the cutting angle is 45,4°, it is entered as 454.


DETAILED REVIEW ON OPERATIONS

P1: Slot for lock

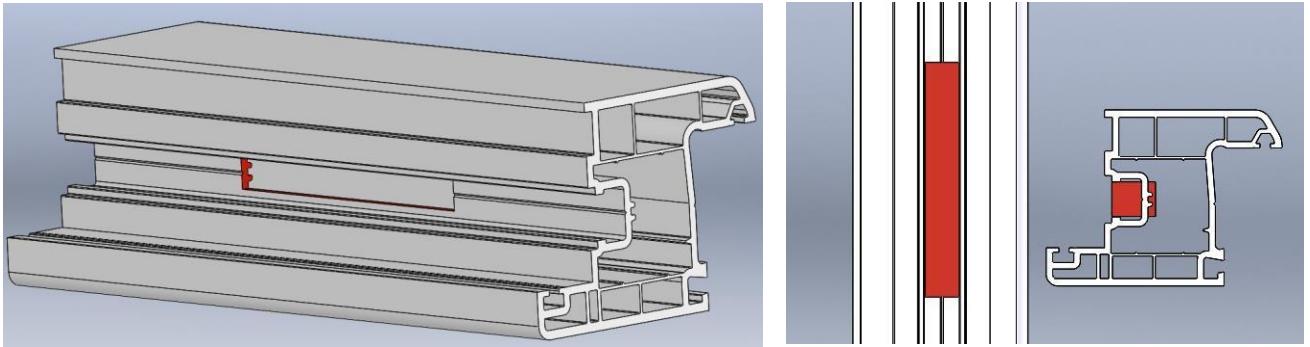


This operation is performed with T50 as per the standing position of the profile on the machine

The operation description as per TOOL 50 (T50) is as follow




The reference point of operation is the blue cloured point It is the center of X and Y axes.



- P1** : Operation code for lock slot
- T** : Tool to be used for the lock slot operation
- X** : X coodinate of operation on profile.
- Y** : Y coordinate of operation on profile
- Z** :Zcoordinate of operation on profile
- L** : Length of slot
- W** : Width of slot
- D** : : Depth of slot operation

Example Code : P1**T50**X12000**Y**300**Z**600**L**1760**W**175**D**200//

P2 : **Espagnolette Channel (Slot)**

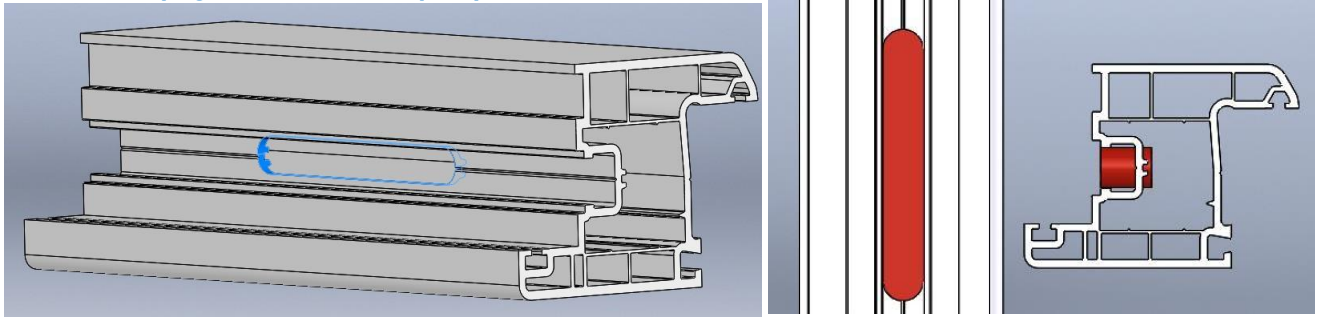



This operation is performed with T50 or T51 as per the standing position of the profile on the machine self slot width (W) = T51, operation is performed with T51. (P3 code is used here)

If slot width (W) $\neq$ T51, then with T50

The operation description as per T50 is as follow



The reference point of operation is the blue clouded point. It is the center of X and Y axes.

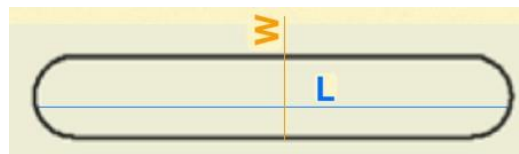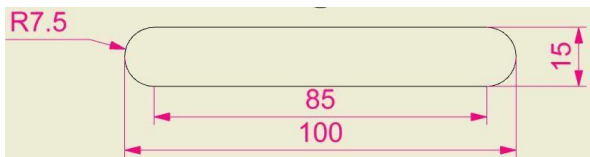

P2 : Operation code for espagnolette slot

T : Tool to be used for the espagnolette slot operation

X : X coordinate of operation on rofile.

Y : Y coordinate of operation on profile

Z : Z coordinate of operation on profile

L: Length of espagnolette slot


W : Width of espagnolette slot

R : Radius dimension of espagnolette slot.

D : Depth of espagnolette slot

Example Codeod 1: :If slot width (W) $\neq$ TOOL 51, with
T50P2T50X12000Y300Z600L1000W150R75D200//


P3 : Water Drain

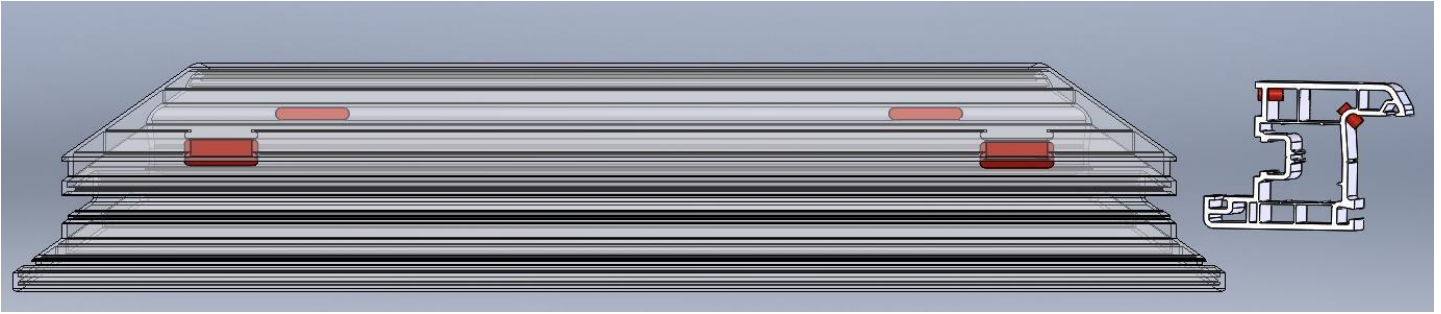

This operation is performed with T70 for inner surface of profile and with T70 for outer surface, as per the standing position of profile on the machine



This operation is performed with T60 for outer surface of profile and with T20 for inner surface of profile as per the standing position on the machine



The reference point of operation is the blue closed point.



P3 : Operation code for water drain

T : Tool to be used for the water drain operation

X: X coordinate of operation on profile.

Y : Y coordinate of operation on profile

Z: Z coordinate of operation on profile

L: Length of water drain

D : Depth of water drain operation


Sash profile example code 1 : P3**T**70**X**1200**Y**300**Z**600**L**400**D**200// (Inner water drain)

Sash profile example code 2 : P3**T**50**X**1200**Y**300**Z**600**L**400**D**200// (Outer water drain)



Frame profile example code 1: P3**T**20**X**1200**Y**300**Z**600**L**400**D**200// (Inner water drain)

Frame profile example code 2: P3**T**60**X**1200**Y**300**Z**600**L**400**D**200// (Outer water drain)



P4 : **Left Barrel**

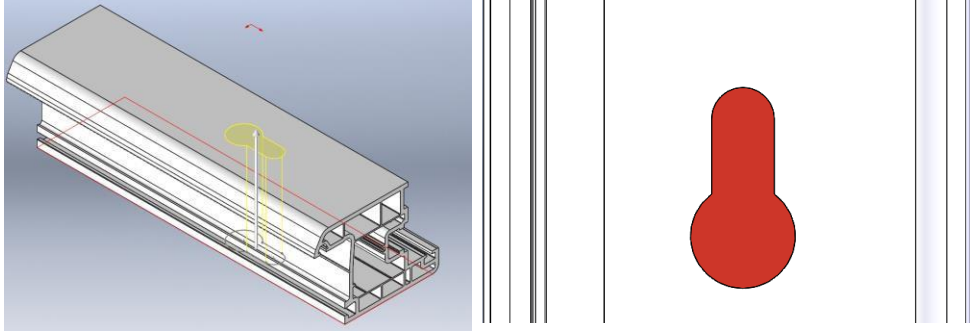

This operation is performed with T30 and T32 on top surface of profile and with T60 on bottom surface. Barrel operation can be performed in three different ways according to the height of profile.

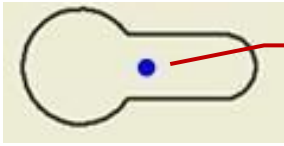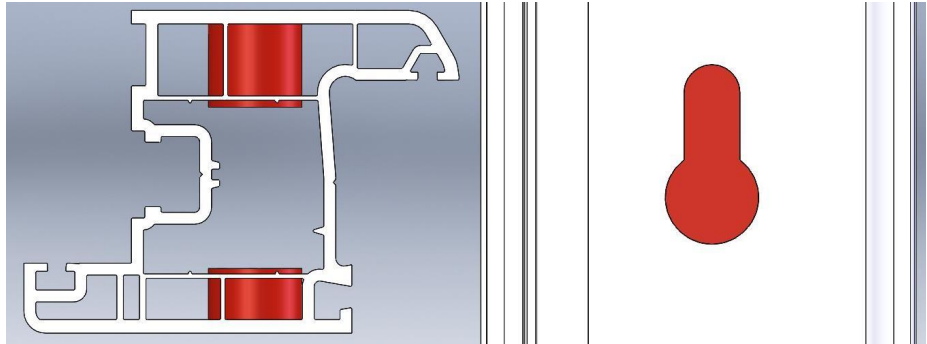

The reference point of operation is the blue closed point. It is the center of X and Y axes.

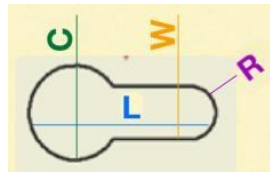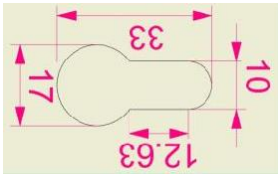


- P4** : Operation code for left barrel
T : Tool to be used for the left barrel operation
X : X coordinate of operation on profile **Y**
: Y coordinate of operation on profile
Z : Z coordinate of operation on profile
L : Length of left barrel
W : Width of left barrel
C : Diameter of left barrel
R : Radius of barrel
D : Depth of barrel.

Example code:: $D \leq 70 = T32$
P4T32X12000Y300Z600L330W100C170D650//



Örnek Kod : $D > 70 = \text{top } T32, \text{bottom } T60$
P4T32X12000Y300Z600L330W100C170D250//P4T60X12000Y300Z600L330W100C170D200//

Örnek Kod : If T32 is not existed on the machine = top T30, bottom T60
P4T30X12000Y300Z600L330W100C170D250//P4T60X12000Y300Z600L330W100C170D200//



P5 : Right Barrel

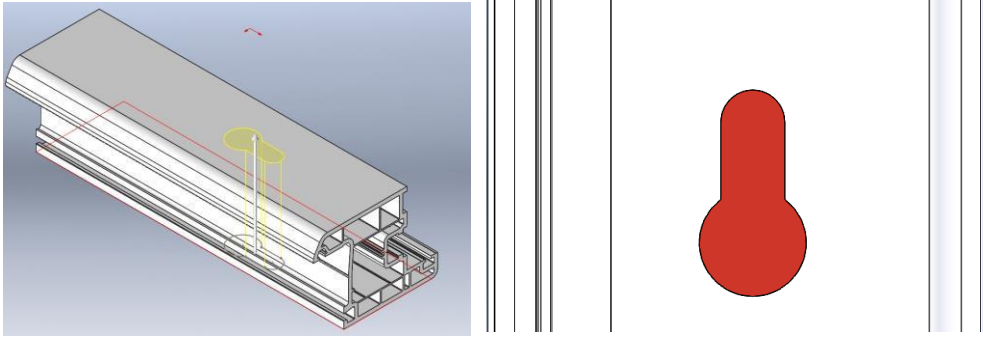

Profilin makinedeki duruş pozisyonu gereği bu işlem profilin üst yüzeyinde **T30** ve **T31**, alt yüzeyinde ise **T70** ve **T71** ile yapılır.

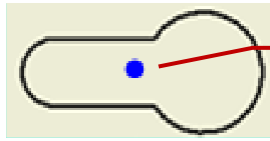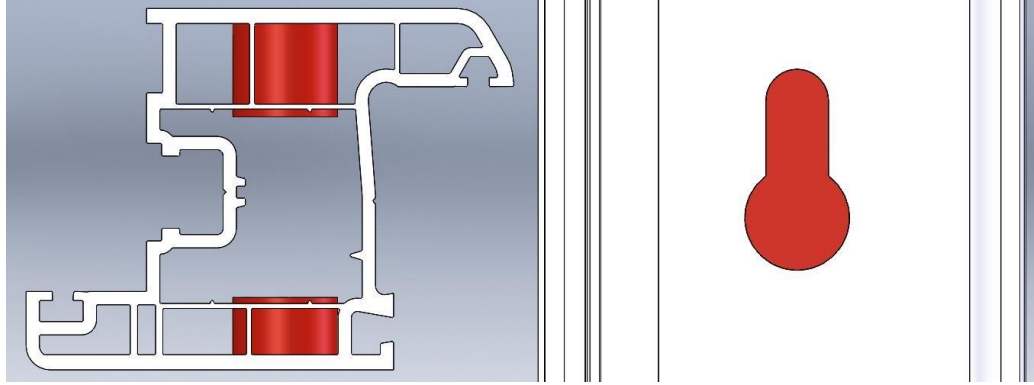

The reference point of operation is the blue cloured point It is the center of X and Y axes.

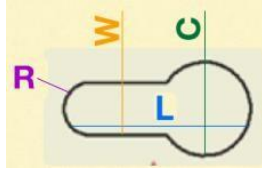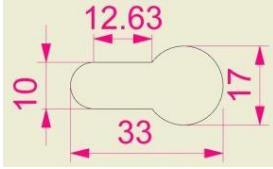

P5 : Operation code for right barrel

T : Tool to be used for the right barrel operation

X : X coordinate of operation on profile

Y : Y coordinate of operation on profile

Z : Z coordinate of operation on profile

L : Length of right barrel

W : Width of right barrel

C : Diameter of right barrel

R : Radius of right barrel

D : Depth of right barrel

Example code : $D \leq 70 = T32$

P5T32X12000Y300Z600L330W100C170D600//

Example code : $D > 70 = \text{top } T32, \text{bottom } T60$



P5T32X12000Y300Z600L330W100C170D250//P4T60X12000Y300Z600L330W100C170D200//

Example code : If T32 is not existed on the machine = top T30, bottom T60


P5T30X12000Y300Z600L330W100C170D250//P4T60X12000Y300Z600L330W100C170D200//

P6 : **Drill (hole)**

This operation is performed with T30 and T31 on top surface of profile and with T60 on bottom surface
Drill operation can be performed in different ways according to the hole diameter and profile height

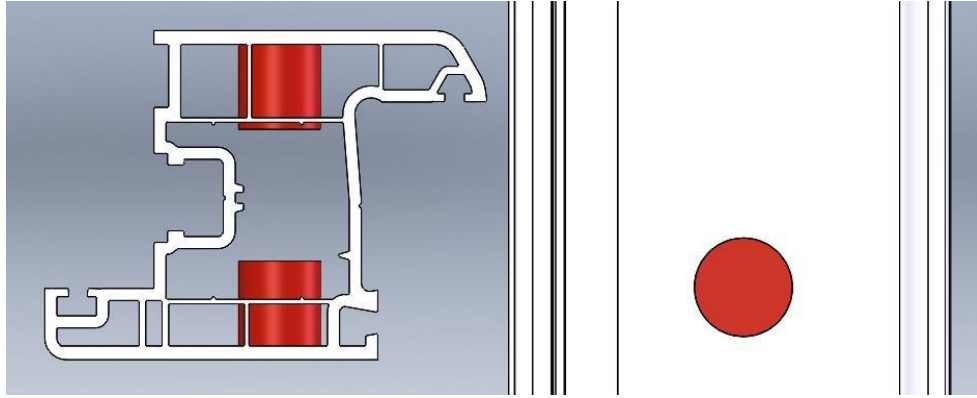

The reference point of operation is the blue cloured point
It is the center of circle



P6 : Operation code for drill

T : Tool to be used for the drill operation

X : X coordinate of operation on profile

Y : Y coordinate of operation on profile

Z : Z coordinate of operation on profile

C : Diameter of drill operation

D : Depth of drill operation

Example sode : $D \leq 70$ & $C=18$ (If the profile height is smaller than 70 mm and the hole diameter is equal to 18 mm)
P7T31X12000Y300Z600D630//

Örnek Kod : $D > 70$ & $C \neq 18$ (If the depth is bigger than 70 mm and the the hole diameter is not equal to 18 mm)
P6T30X12000Y300Z600C180D250//P6T60X12000Y300Z600C180D200//


Örnek Kod : **P6T30X12000Y300Z600C180D250//P6T70X12000Y300Z600C180D200//** (Alt Üst)

Örnek Kod : **P6T31X12000Y300Z600C180D250//P6T71X12000Y300Z600C180D200//** (Alt Üst)

P7 : *Marking and drilling hole that is equal to tool diameter*




Operations can be performed with T10, T20, T30, T40, T50 and T60 tools on each surface of the profile. The tip points of the tools are proper for marking operations.



P7 : Operation code for marking.
T : Tool to be used for the marking operation
X : X coordinate of operation on profile
Y : Y coordinate of operation on profile
Z : Z coordinate of operation on profile
D : Depth of marking operation

Example code : Sash hinge marking
P7T50X400Y0Z60D30// P7T50X600Y0Z60D30// P7T50X800Y0Z60D30//

Example code : Frame hinge marking
P7T30X400Y200Z600D30// P7T30X600Y200Z600D30// P7T30X800Y200Z600D30//

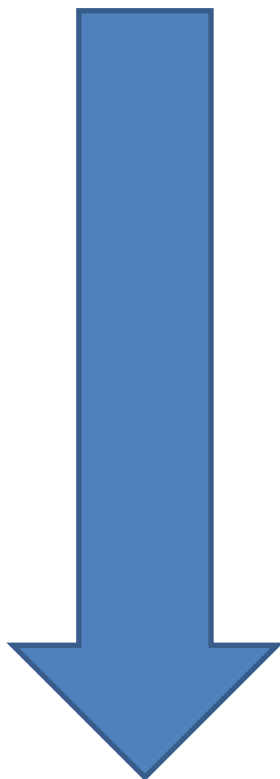


NOTES:


Put // mark at the end of whole codes. This means that the operation is ended.

How to measure the height and width of the profiles:

Frame Profiles:

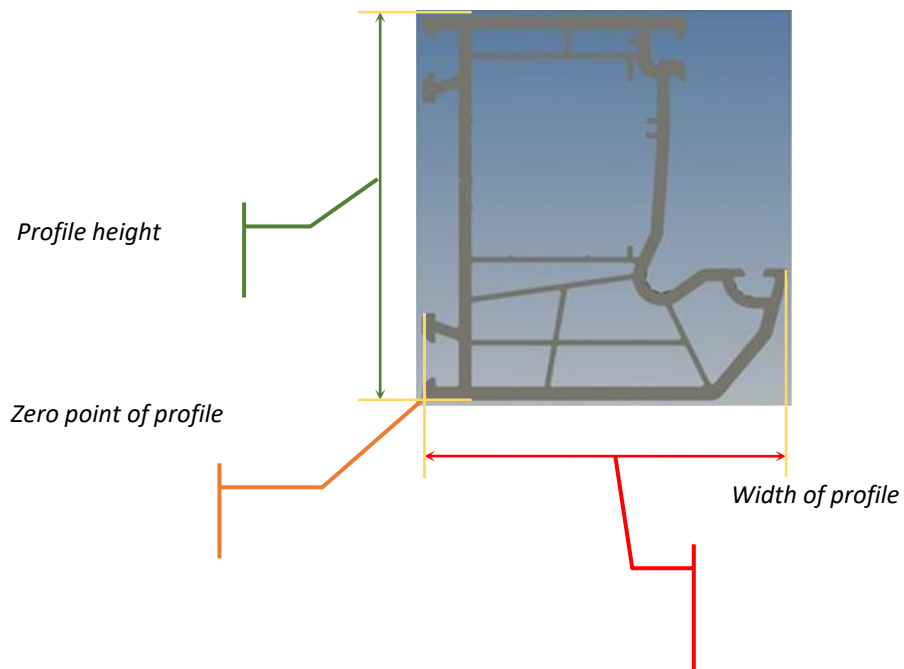


Sash Profile:

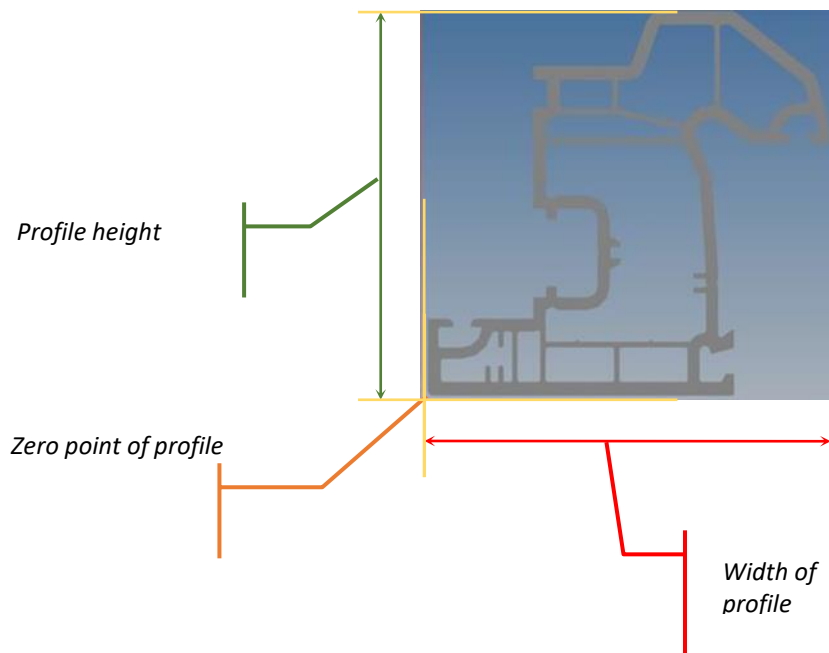


How to place the profile on the machine when looking at from operator side:


Window Frame profile :

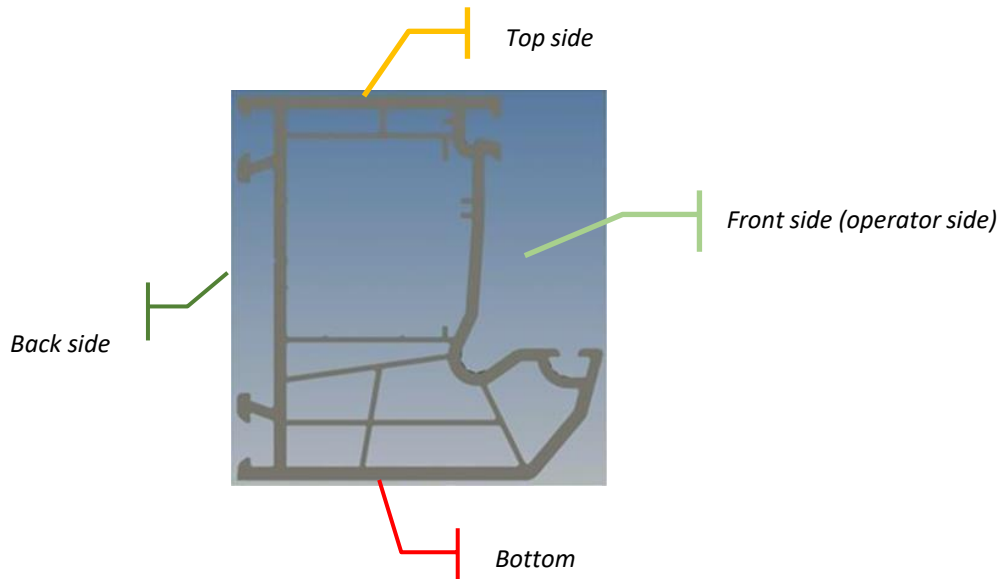


Window Frame and Door frame Profiles:

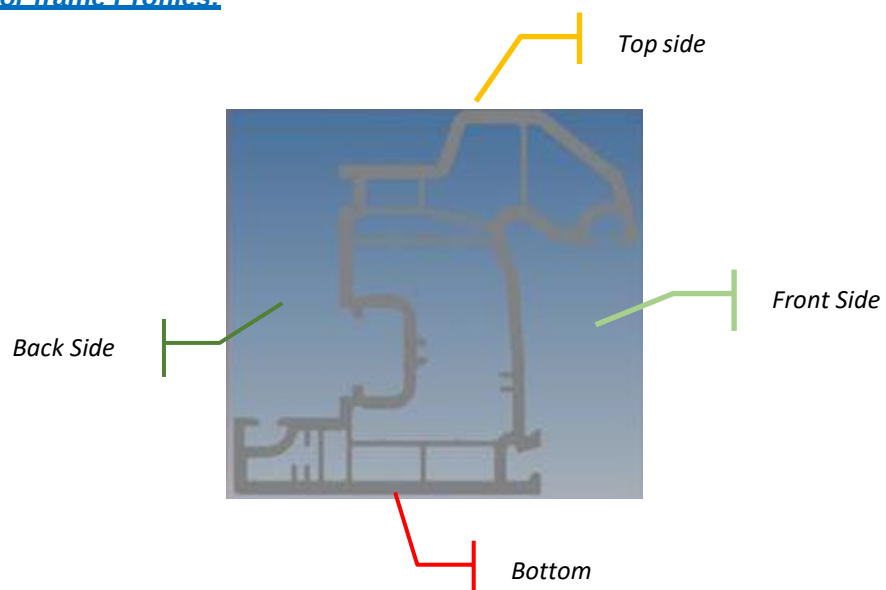


Window Sash and Door Sash Profiles Opening Outwards :

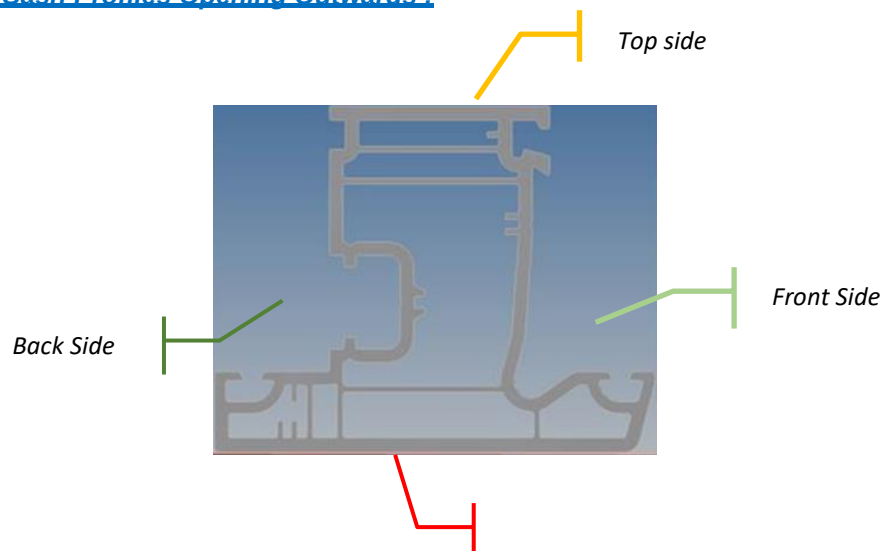

Sliding Frame Profile :

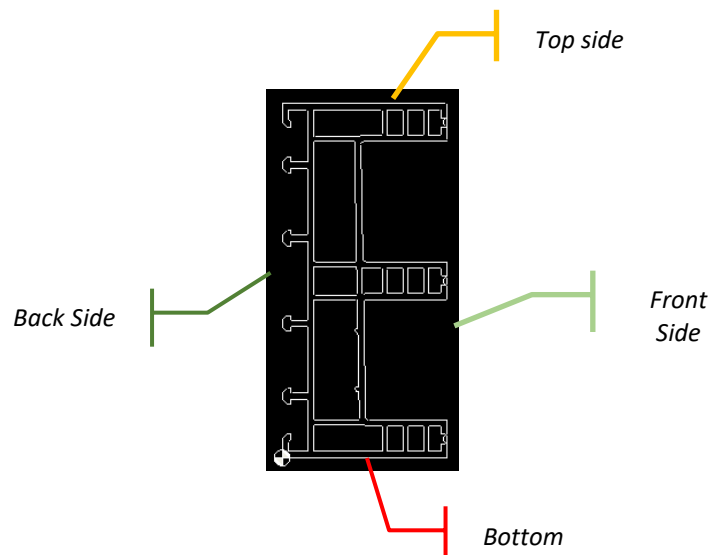

Sliding Window and Door Frame Profile :

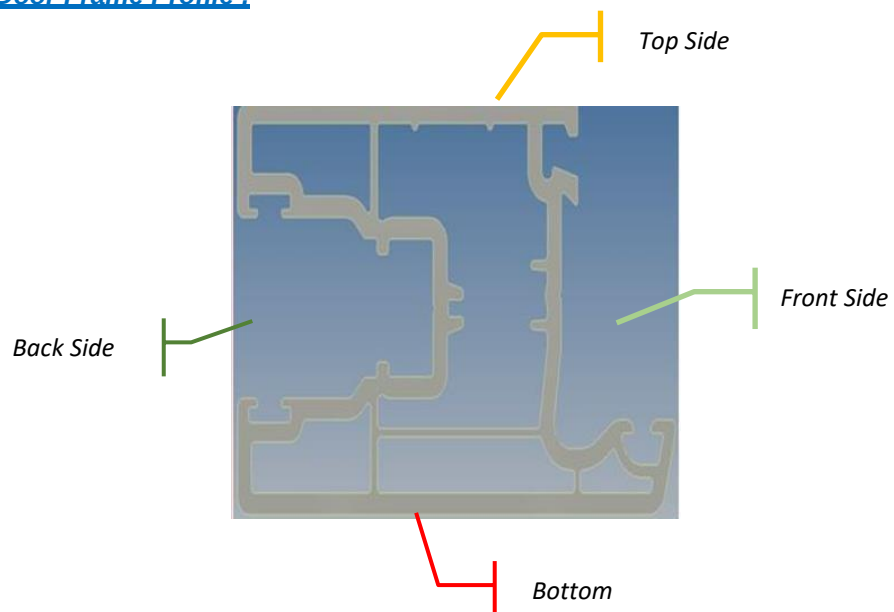

Mullion Profile :

