


# Franklin Early Childhood Center



# Franklin Early Childhood Center

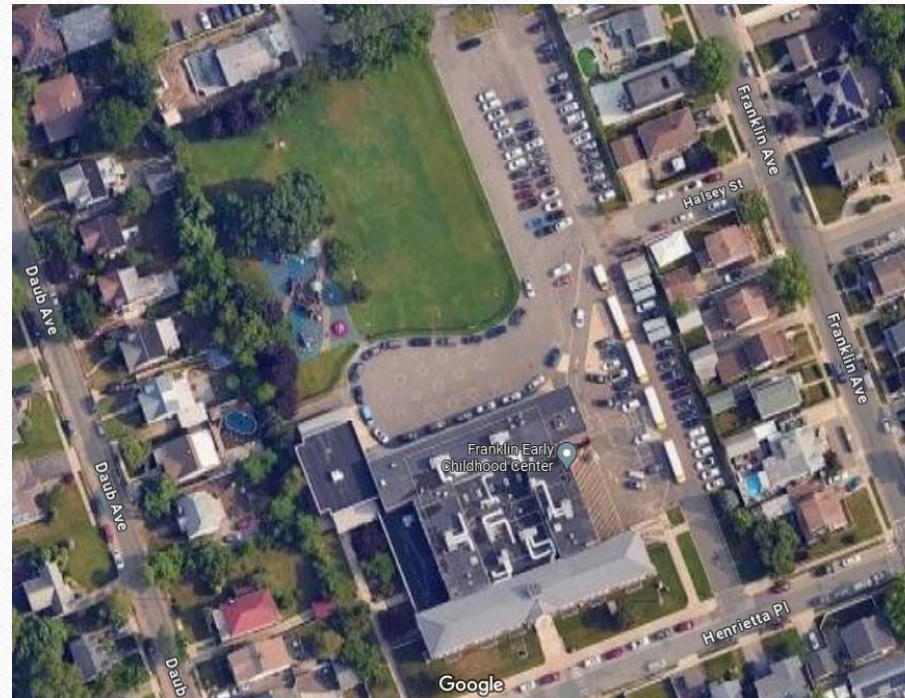

| FRANKLIN EARLY CHILDHOOD CENTER |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |                |
|---------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------|
| BCS item #                      | Description                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | Cost           |
| 46                              | Catch Basins - Recommend installation of additional storm water drainage structures to address issues that occur during significant rain events, at West side of building-Library and Gym. Install infiltrator system due to high water table.                                                                                                                                                                                                                                                                                                                                              | \$191,632.00   |
| 55                              | Pavement - Parking Lots and Roadways -Recommend parking lot and parent drop off at rear of building replaced with new asphalt. Grading and storm water improvements. Existing perimeter curbing to remain.                                                                                                                                                                                                                                                                                                                                                                                  | \$967,411.20   |
| 56                              | Sidewalks - Recommend replacement of concrete sidewalk and curbing along Henrietta Place. Sidewalk and curbing to be poured monolithically to end future settling.                                                                                                                                                                                                                                                                                                                                                                                                                          | \$124,230.40   |
| 61                              | Foundation - Constant water infiltration at cafeteria 1& 2 between areaways. Recommend excavate to expose foundation walls. Install membrane waterproofing, install drainage tile (sleeved and set in drainage stone) 18"-20" below grade discharge pipe into areaways. Restore site.                                                                                                                                                                                                                                                                                                       | \$264,320.00   |
| 66                              | Exterior Walls/Columns - Address areas not completed as part of 2023 work. This shall include lintel replacement at locations identified. Apply exterior waterproofing on all exterior walls to alleviate further moisture penetration.                                                                                                                                                                                                                                                                                                                                                     | \$376,656.00   |
| 69                              | Exterior Doors - Recommend increasing security on all exterior doors by hardening exterior door visions. Remove rotted wood frame @ boiler room door.                                                                                                                                                                                                                                                                                                                                                                                                                                       | \$52,864.00    |
| 70                              | Exterior Steps, Stairs and Ramps - Install mid railings - distance between railing exceed allowable by code                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | \$3,304.00     |
| 73                              | Roofs and Skylights - Library roof no longer under warranty. Recommend Replacement in very near future.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | \$367,404.80   |
| 74                              | Interior Bearing Walls – Repair interior plaster walls at completion of exterior masonry waterproofing.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | \$105,728.00   |
| 75                              | Other Interior Walls - Extensive cracks within ceramic tile in stair tower, adjacent to custodial office, need to be addressed. Recommend removal of all CT walls to remove sharp edges, address and inspect masonry cracks behind tile. Replace existing walls with new tile.                                                                                                                                                                                                                                                                                                              | \$257,712.00   |
| 77                              | Resilient Tile and Sheet Flooring - Recommend removal of remaining VAT flooring. Second floor corridor and room 117                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | \$93,489.99    |
| 79                              | Wood Flooring - Repairs scheduled Summer 2023. Thought should be considered for full replacement. Original wood floor both sides of gym. Assume waterproofing below wood flooring is asbestos.                                                                                                                                                                                                                                                                                                                                                                                              | \$315,201.60   |
| 80                              | Ceilings - Recommend installation of 2x2 acoustical ceilings in all remaining classrooms and gymnasiums, which still contain concealed spline ceilings.                                                                                                                                                                                                                                                                                                                                                                                                                                     | \$381,942.40   |
| 82                              | Interior Doors - Recommend replacement of all interior classroom and office doors with new doors, hardware and smaller vision lites. Recently replaced doors will receive hardened vision kits. High security classroom function hardware will be replaced at all doors. None of the cross corridor or stair tower doors have been equipped with proper latching hardware. Sidelights are glazed with wire glass. Recommend replacement of all wire glass with fire rated glass at all locations that are within reach of student and staff. Install proper latching hardware at all doors. | \$906,617.60   |
| 88                              | Ventilation Systems -Recommend improving mechanical fresh air ventilation in 4 spaces that were not upgraded as part of 2018 work. Improve ventilation in lower level crawl spaces. Apply spray on insulation to underside of concrete slab at all accessible areas within crawl spaces.                                                                                                                                                                                                                                                                                                    | \$1,552,880.00 |
| 94                              | Sanitary Systems - Long range plan to replace cast iron waste piping throughout crawl space should be implemented.                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | TBD            |
| 97                              | Plumbing Fixtures - 4 toilets under construction Summer 2023. Recommend remaining toilets be renovated as part of phase 2. Further discussion should take place regarding single stall classrooms and office bathrooms. These bathrooms are not included in 97d.                                                                                                                                                                                                                                                                                                                            | \$1,268,736.00 |
| 101                             | Electrical Power Distribution System - Recommend replacing and upgrading electrical panels throughout building.                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | \$462,560.00   |
| 102                             | Light Fixtures -Replace remaining fluorescent lighting and install lighting at parking lots and adjacent field area.                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | \$488,992.00   |
| 105                             | Fire Alarm System - Frequent failures. Recommend full replacement of FA system.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | \$561,680.00   |
|                                 | Building Total                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | \$8,743,361.99 |



# Franklin Early Childhood Center







# Franklin Early Childhood Center






# Franklin Early Childhood Center

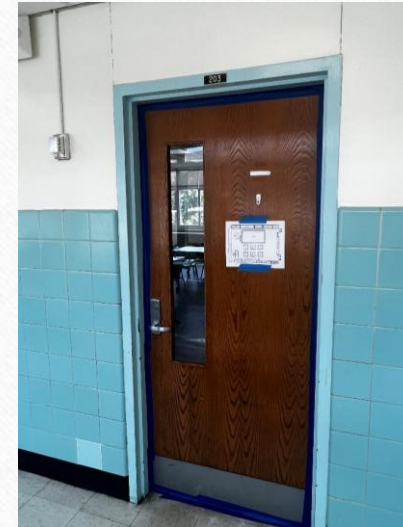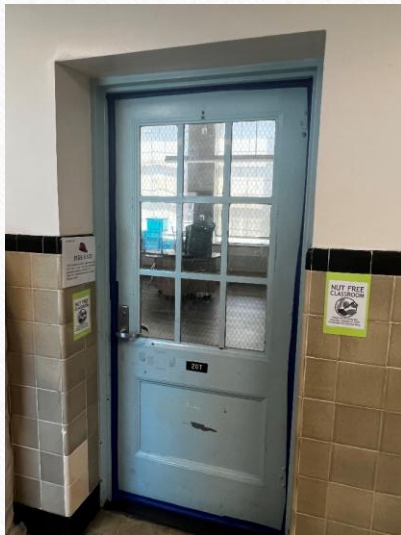

# Franklin Early Childhood Center

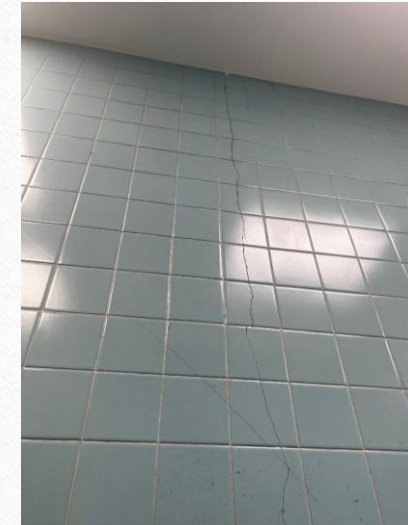




# Franklin Early Childhood Center





# Franklin Early Childhood Center

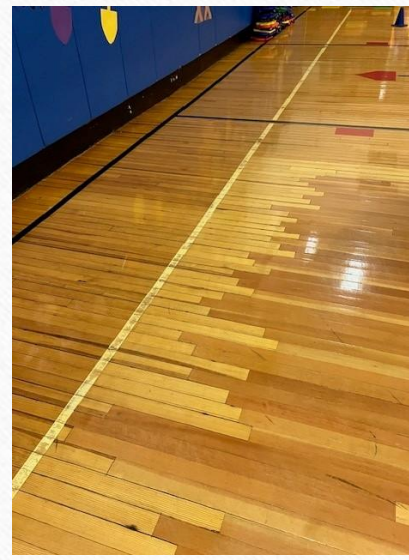



# Franklin Early Childhood Center



New Playground Installation





# Franklin Early Childhood Center



**Kitchen & Cafeteria Renovation**

