

Woodmere Education Center





Woodmere Education Center






WOODMERE EDUCATION CENTER		
BCS item #	Description	Cost
42	Site Fuel Oil - Recommend replacement of existing underground FOT.	\$429,520.00
43	Site Electrical - Parking lot lighting added in 2023. Upgrade existing incoming electrical service if building is to be upgraded to full A/C.	\$594,720.00
56	Sidewalks - Dropped curbs replaced as part of paving project. Replace concrete sidewalks around Broadway and Johnson Place as well as walks around the building.	\$244,496.00
60	Related Structures - Recommend replacement of all wrought iron and chain link fencing. Extensive rusting occurring, replace existing chain link fence with new vinyl coated fencing.	\$185,728.00
61	Foundation - Attempts to repair cracks in boiler room. Recommend properly repair cracks. Multiple locations in boiler room.	\$15,859.20
65	Structural Floors - Scrape painted floor in custodian area. Install epoxy coating. Large cracks need to be repaired on concrete slab (gray painted floor) lower level. Structural cracks in 2 locations. Extensive cracking in areaways outside lower level window.	\$72,688.00
66	Exterior Walls/Columns - Extensive repairs needed at areaways (2) along Johnson Place (NE corner of building) Complete reconstruction required. Work should be accomplished as part of sidewalk replacement. Repoint remaining masonry cracks. Power wash building and apply water based exterior seal coat.	\$376,656.00
69	Exterior Doors - Replace 1 hollow metal door, vision kit rusting and white paint peeling off. Harden all exterior visions	\$35,683.20
70	Exterior Steps, Stairs and Ramps - Recommend scrape steel steps and railing along Johnson Place down to mechanical room. Examine for structural defects. Repair and repaint (existing paint is lead based).	\$46,256.00
73	Roof and Skylights - Recoat roof at cupola. Install aluminum fascia around exposed wood. Replace missing metal coping (2 locations) which appears to have blown off roof. Roof is still under warranty. Claim should be sent to roof manufacturer to investigate statements of roof leaks.	\$37,004.80
74	Interior Bearing Walls and Fire Walls - Extensive plaster repairs needed throughout building. Address after exterior masonry waterproofing has taken place.	\$112,336.00
77	Resilient Tiles or Sheet Flooring - Remove VAT from room 404	\$13,216.00
82	Interior Doors - Recommend replacement of remaining original doors off corridor to all office space to improve on security lock downs. Replace door in lower level to boiler room. Harden all visions and install lock down hardware. Doors at AP room to remain. Further discussion required.	\$314,540.80
88	Ventilation Systems - Replace UV's in 4 story portion of the building (7). Although built to code at the time of construction, a majority of the building lacks mechanical fresh air ventilation. We further recommend converting the entire building from steam to hot water system.	\$6,146,100.80
92	HVAC Control Systems - Recommend full temperature control upgrade to DDC as part of HVAC upgrade.	\$594,720.00
96	Hot Water Heaters - Replace hot water heater, valves and insulation. Modify piping.	\$59,472.00
105	Fire Alarm Systems - Recommend full replacement. Reports of communication failure.	\$508,816.00
115	Interior Accessible Route - No elevator currently exists. Additionally no lift exists to get to lower wrestling room.	\$2,643,200.00
	Building Total	\$12,431,012.80


Woodmere Education Center

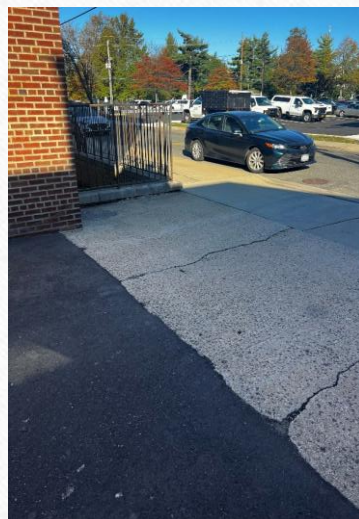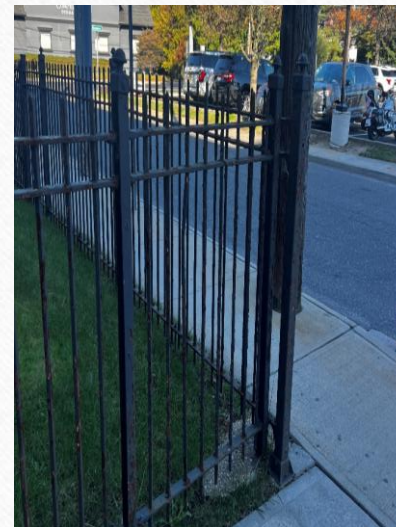


Woodmere Education Center

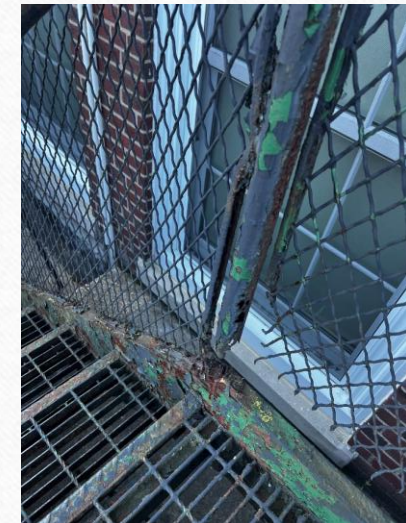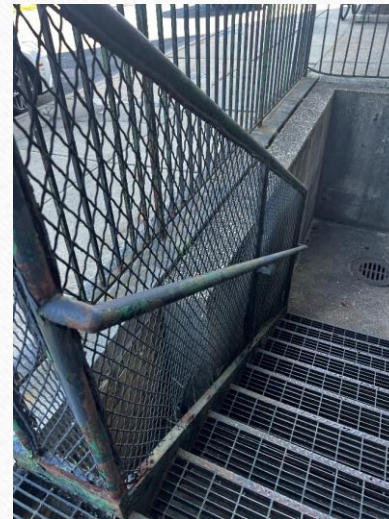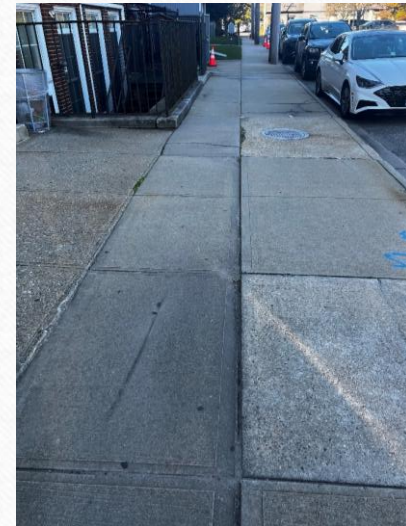


Woodmere Education Center

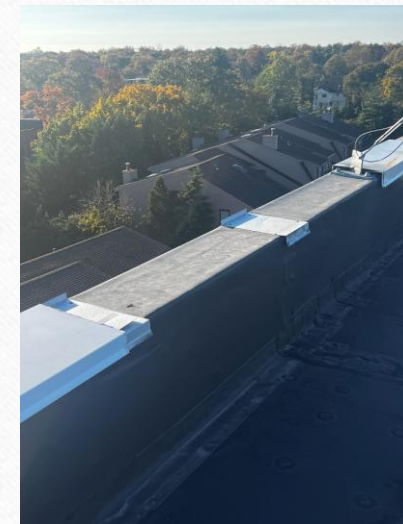



Woodmere Education Center

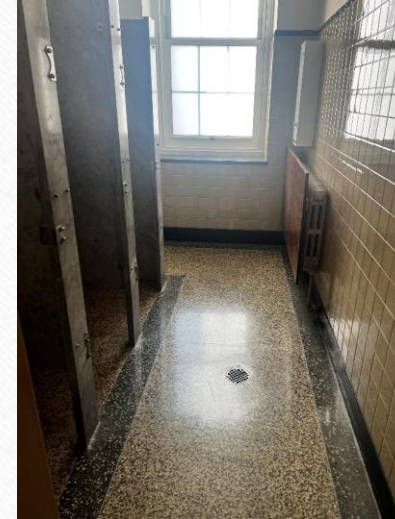

Woodmere Education Center

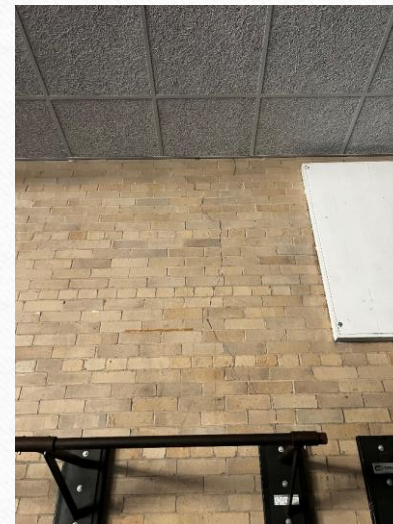

Woodmere Education Center

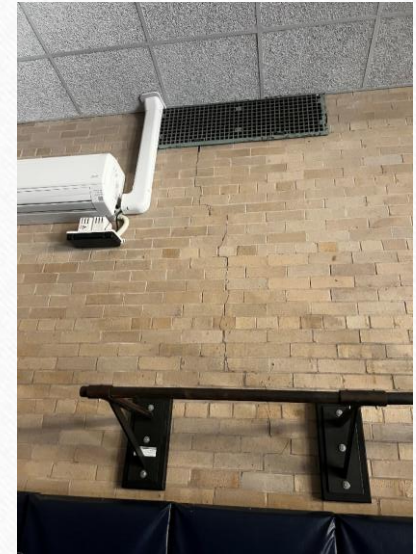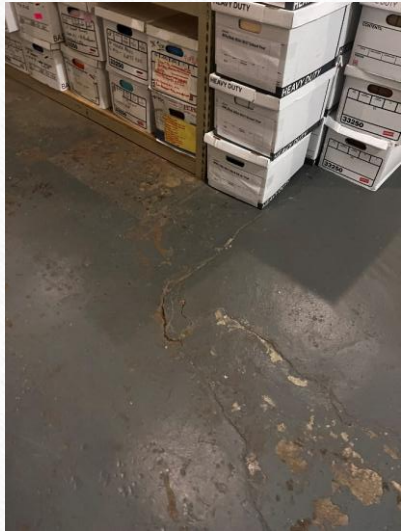

Woodmere Education Center

