


1.1 Maintenance instructions: HBZ CC units

Explanation of symbols ( 11.2.1)

Read the Servicing section in the Instruction Manuals prior to commissioning the machine.

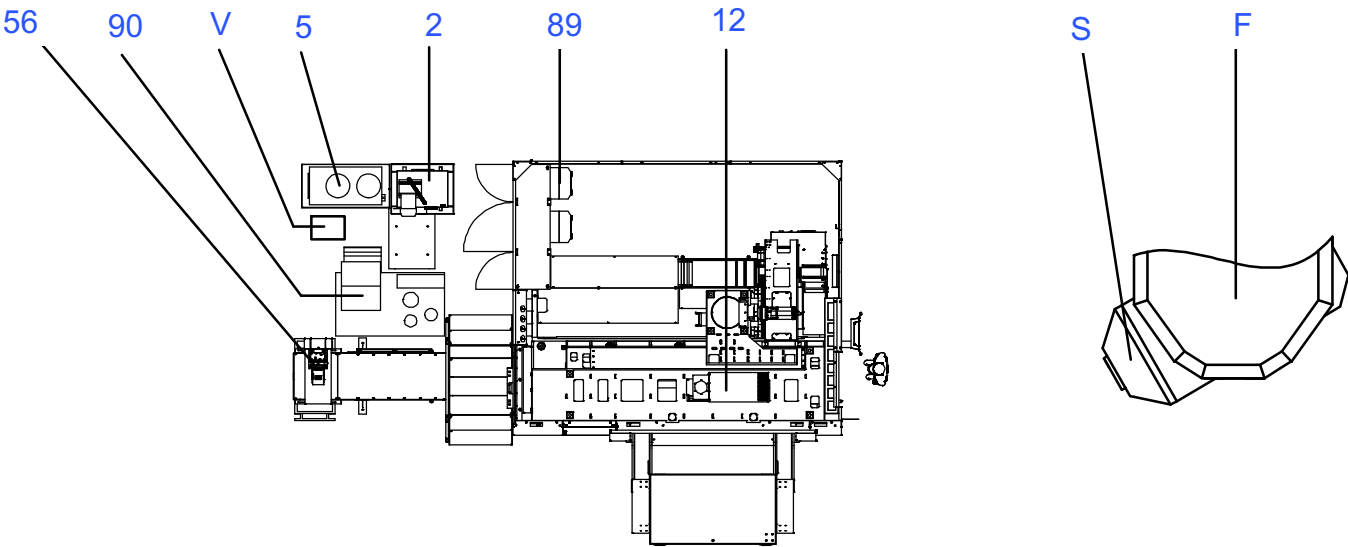


Machine parts	Hydraulic unit	Cooling system	Suction unit	Chip conveyor	Cooling device	Cooling lubricant system	Milling head	Spindle	Vacuum								
Intervention point no.	2	5	12	56	89	90	F	S	V								
Intervention symbol																	

1.2 Maintenance instructions: HBZ CC level and filter checks

Explanation of symbols (➡ 11.2.1)

Operating hours

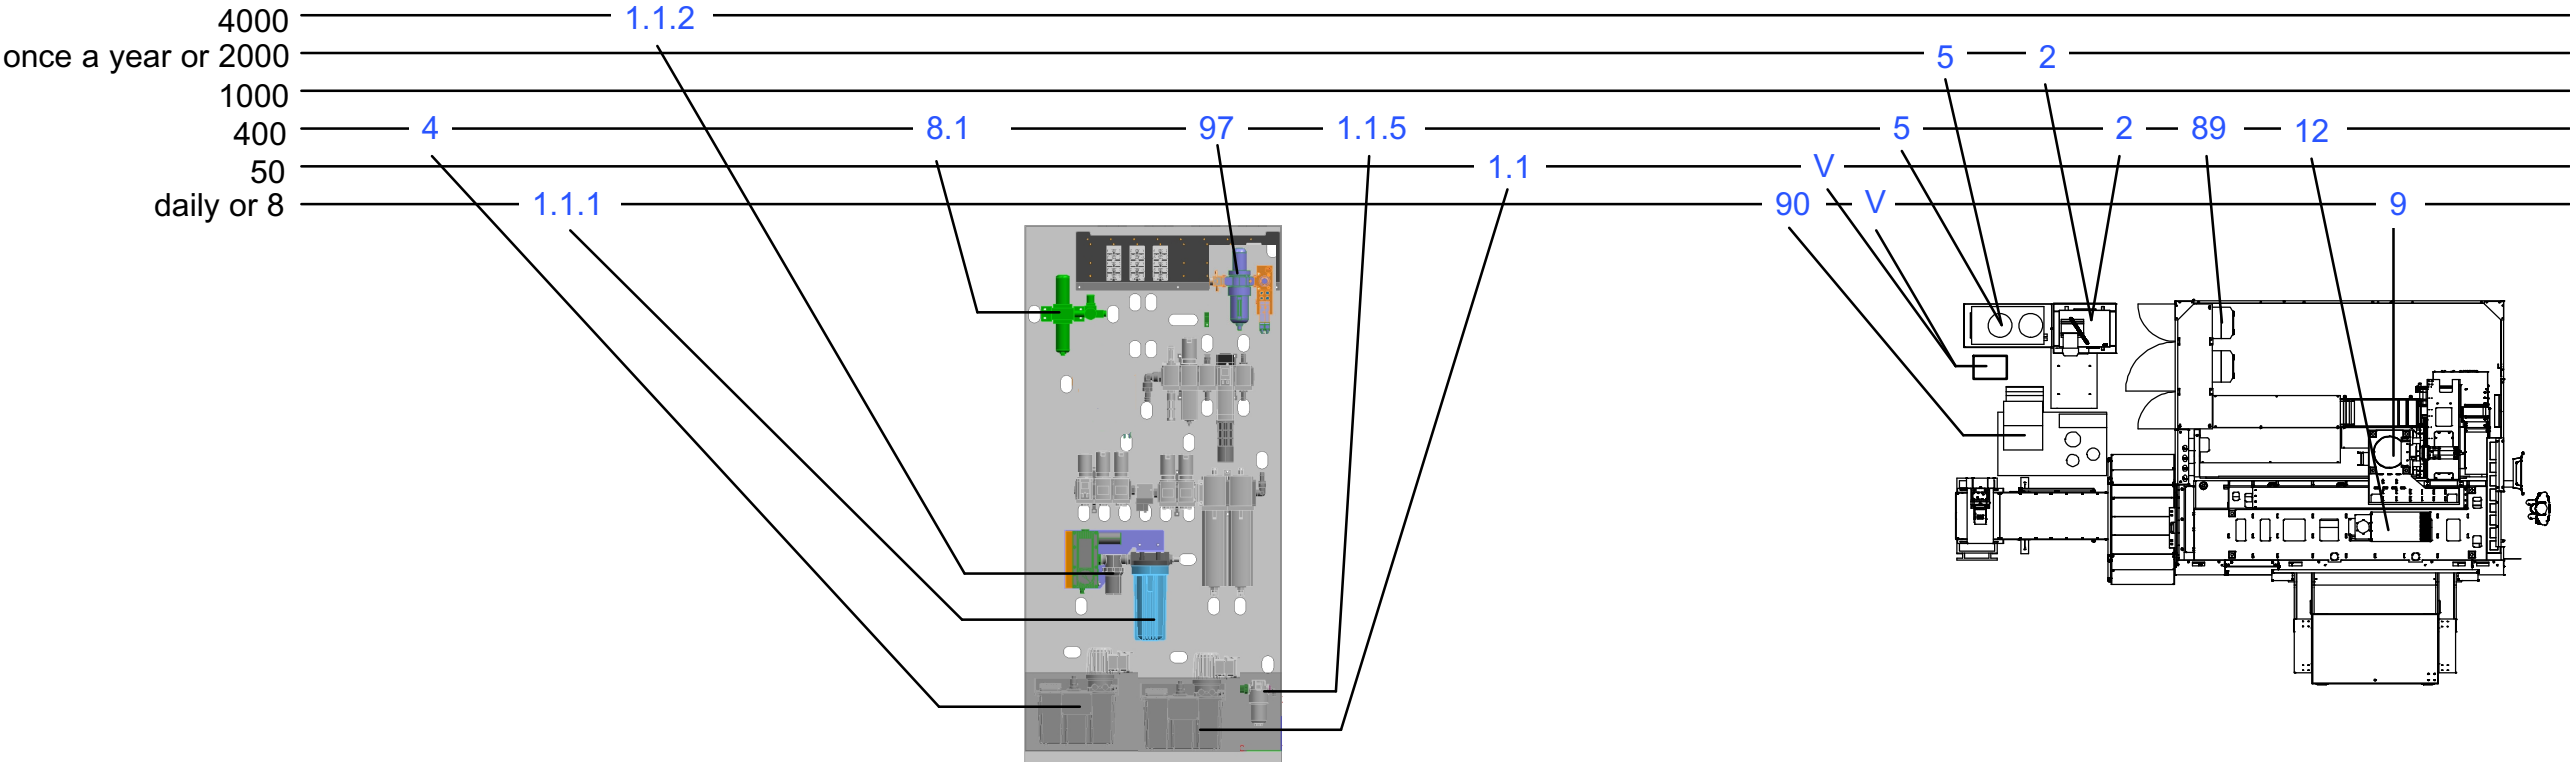


Caution ! Clean all intervention points prior to filling!

Machine parts	Central lubrication, spindle	Oil tank	Fine suction filter	Filter	Hydraulic unit	Hydraulic unit	Central grease lubrication	Cooling system	Cooling system	Spindle cone	Suction unit	Chip conveyer	Cooling unit	Coolant mixing unit	Vacuum pump	Vacuum tank	
Intervention point no.	1.1	1.1.1	1.1.2	1.1.5, 8.1, 97	2	2	4	5	5	9	12	56	89	90	V	V	
Intervention symbol																	
Operating hours	50 h	8 h	4000 h	400 h	400 h	once a year	400 h	400 h	once a year	8 h	400 h	400 h	400 h	tägl.	8 h	50 h	
Lubricants					HLP 46 DIN 51524-2	HLP 46 DIN 51524-2						DIN 51385 E1 Emulsion		DIN 51385 E1 Emulsion			
Tank capacity	2 l	1.5 l			160 l	160 l	6 cdm	60 l	60 l			700 Ltr		1400 Ltr	2 Ltr		

1.3 Maintenance instructions: HBZ CC settings

Explanation of symbols (➡ 11.2.1).

Operating hours

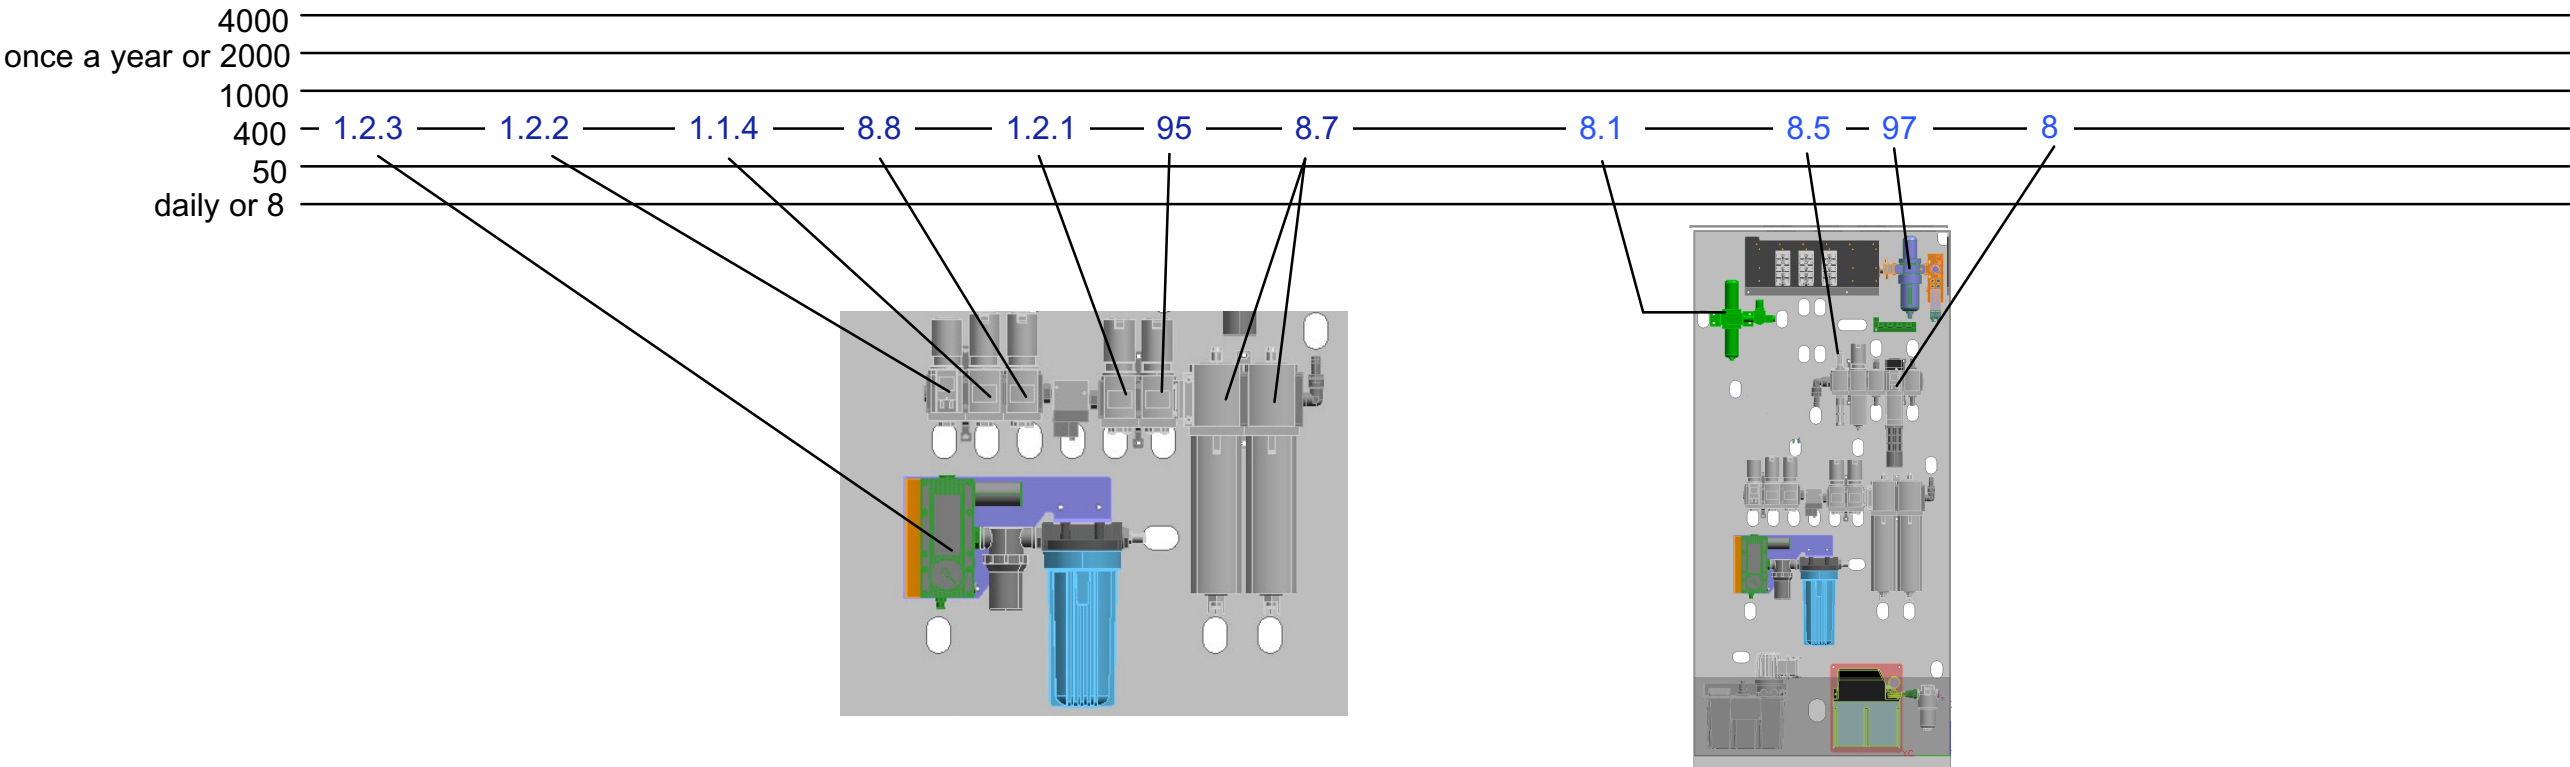




See fluid plan for settings

Machine parts	Water separator	Maintenance unit: Oil suction	Maintenance unit: Spindle sealing air	Oil/air spindle lubrication	Maintenance unit	Maintenance unit: Vacuum accelerator	Maintenance unit Taper cleaning	Maintenance unit for tool control	On-off valve	Vacuum pump gauge		Energy supply chains					
Intervention point no.	8.7	1.1.4	1.2.1	1.2.2	8, 8.1	8.8	95	97	8.5	1.1.3		67					
Intervention symbol																	
Operating hours	400 h	400 h	400 h	400 h	400 h	400 h	400 h	400 h	400 h	400 h		2000 h					

11. Maintenance and servicing

1.4 Lubrication instructions: HBZ CC automation

Explanation of symbols (↗ 11.2.1)

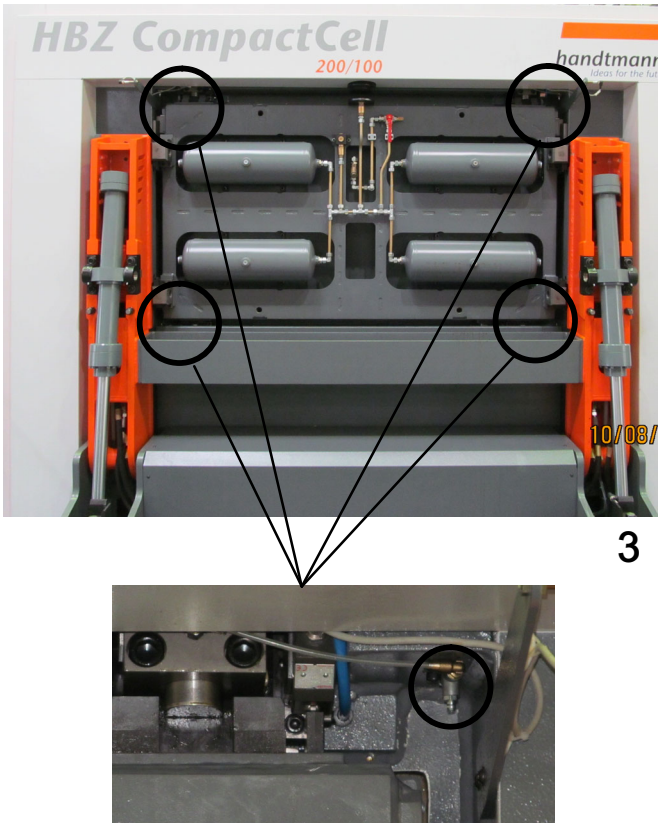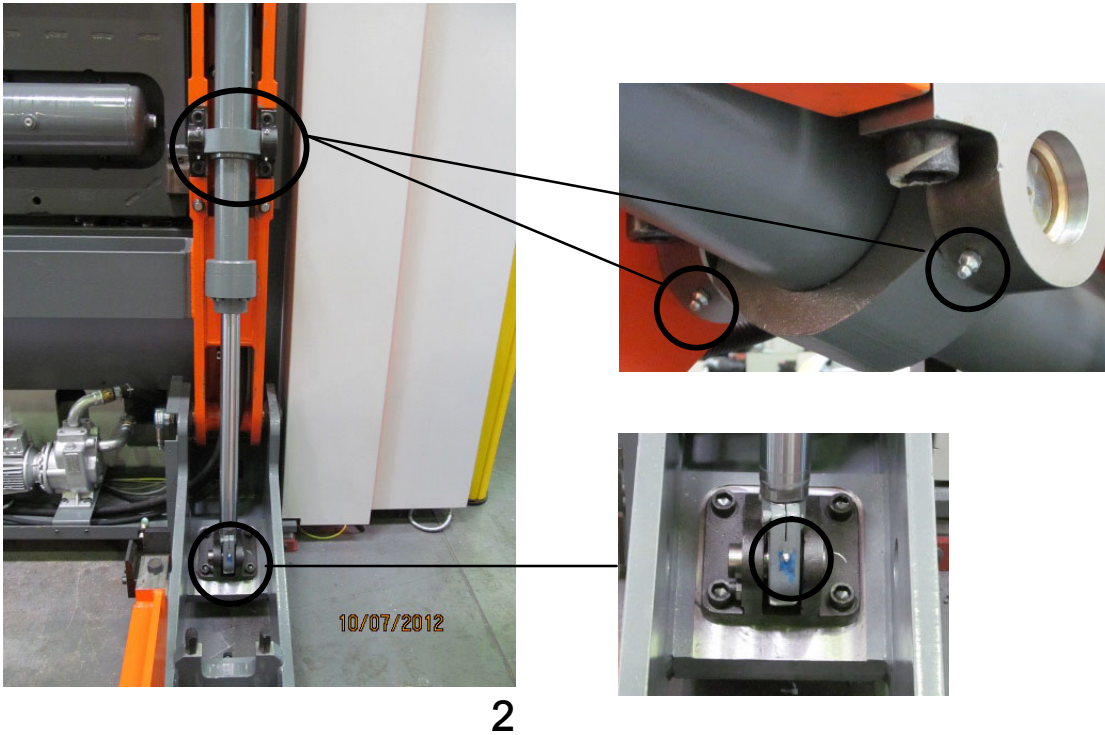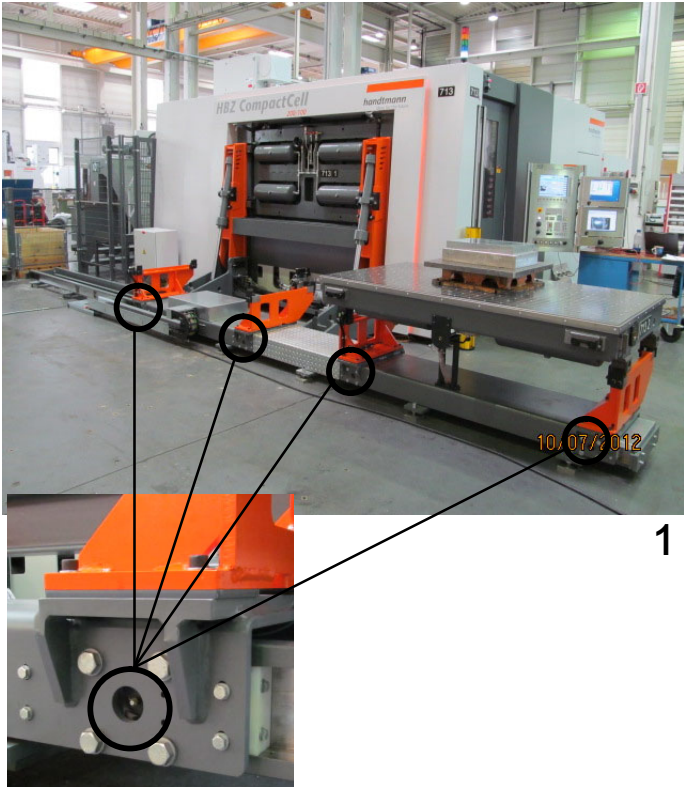

Caution ! Clean all intervention points prior to greasing! Specifications apply for single shift operation!

Machine parts	Guide rollers, slewing cylinder	Rack (see Tool change cart instruction manual)	Motor (see Tool change cart instruction manual)	Wedge clamp										
Intervention point no.	1, 2			3										
Intervention symbol														
Operating hours	every six months	every six months	every six months	once a fortnight										
Lubricants	Renolit LZR 2H	Renolit LZR 2H		Renolit LZR 2H										
		Check, grease if necessary	Check oil level, change if necessary											