

SOUTH CENTRAL RAILWAY
MONTHLY SAFETY BULLETIN — OCTOBER 2025

(HQ SAFETY BRANCH)

S.N	DATE	DIV	DESCRIPTION	CAUSE / SHORTFALL	ACTION
1	10.08.2025 (Misc incident) 14.27 hrs	SC	While T. No. IOH spl on run between Malkhaid Road (MQR) – Sedam (SEM) stations, Key man heard unusual sound from 2 nd wagon (BVZI - later found to be flat tyre) from TE at Km 29/4-6 and informed to SSE/PW /SEM.	SSE/C&W at UTCM Siding/MQR did not check the wagon properly even after noticing metal deposition on wheels before giving fit to run.	All the divisions are advised to check all the wagons including those due for IOH/POH as per the safety norms stipulated in maintenance manual.
2	13.08.2025 (Misc Incident) 23.00 hrs	GNT	LP of T. No. 12604 Exp while on run between Reddigudam (REM) – Sattenapalli (SAP) stations, experienced oscillation at Km 53/10-8 at a speed of 107 Kmph. Immediately reduced the speed to safe level and stopped at Home signal of SAP station and informed to SM/SAP.	Water stagnation on the track due to heavy rain resulted in disturbance of track on the approach of bridge No. 48B (built in Mar/2024) between REM – SAP stations.	• GNT Division shall carryout detailed investigation and corrective action shall be taken to avoid recurrence of such incidents. • All Divisions to ensure special monitoring of newly constructed/under construction bridge works during the monsoon period without fail for safe running of trains.
3	27.08.2025 (Unusual Incident) 05.00 hrs	HYB	On duty Pointsman at Sriramnagar (SRNR) station observed sparks in T. No. 17604 Exp (waiting for crossing) between S5 & S6 coach and informed TMR. AC mechanic in train checked and found upper portion of feeder-junction box (exit point) of Coach no. 195753, SC/LWSCNA was in burnt condition and same isolated and permitted the train.	Due to 150 sq.mm e-beam cables (Y-phase & B-phase) rubbing with feeder-junction box grommet and body got earthed due to insulation breakage.	All divisions shall carry out special drive for checking condition of couplers & feeder-junction box and cables to avoid recurrence of such incidence.
4	03.09.2025 (Yard derailment) 08.13 hrs	NED	At Nanded (NED) yard, while performing shunting of 3 Empty coaches from Pit line No.2 to Stable line No.4, 3 rd coach (203387 LVPH) rearmost from TE front trolley all wheels derailed at Km 349/9-11 on top of pit line No.2.	Track defect – versine variation (120mm to 270mm), twist in track (40mm) and check rail not provided which is mandatory beyond 8° curve (available 9.6° Curve).	All divisions to check all yard lines thoroughly and take necessary action to avoid recurrence of such incidents.
5	07.09.2025 (Unusual incident) 11.52 hrs	NED	LP of T. No. 12715 Exp while on run between Nandapur (NDPR) – Dhamni (DNE) stations, observed Engineering push trolley (Dual Rail tester – DRT) on track at Km 882/8-6 and applied emergency brake and stopped.	• SSE/USFD/NED in-charge of DRT did not give prior intimation to the SM. • Crew failed to enter the unusual incident in CMS	• Detailed investigation to be carried out by the NED division and strict action shall be taken against staff responsible. • PCE to issue suitable instructions to the divisions for taking necessary precautions where DRT is working to ensure safety of the staff working and safety of train operations. • All the crew shall be counselled to report the abnormality noticed during train running without fail.

SOUTH CENTRAL RAILWAY
MONTHLY SAFETY BULLETIN — OCTOBER 2025

(HQ SAFETY BRANCH)

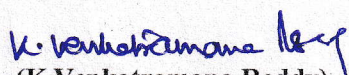
S.N	DATE	DIV	DESCRIPTION	CAUSE / SHORTFALL	ACTION
6	09.09.2025 (Unusual incident) 00.35 hrs	NED	LP of T. No. 11001 Exp while on run between Chikalthan (CTH) - Karmad (KMY) stations, hit earth pit enclosure at km 126/07-08.	Miscreant activity	- A special drive may be conducted by all divisions to ensure that no loose materials are kept in the vicinity of track which endangers the safety of train operations. - Vigilance shall be stepped up at all vulnerable locations and all front line staff shall watch out for any suspicious activities near the track and promptly report to all concerned.
7	10.09.2025 (Misc incident) 13.00 hrs	GTL	At Raichur (RC) station, TI/RC reported that two tractors were found plying unauthorizedly on PF Nos. 02 & 03 without permission of on-duty SMR/Dy.SS, endangering passenger safety.	Contractor staff was shifting sand from FOB foundation work across track lines 04 & 05 through Platform No.02 & 03 at Raichur station without permission.	- Detailed investigation shall be carried out by GTL division and person responsible shall be taken up. - All divisions shall ensure that proper monitoring systems are kept in place duly defining the protocols for the movement of vehicles/materials on execution of work. - Work site safety measures shall be ensured strictly. Open line officials shall do frequent surprise checks at the work spots and strict action shall be taken against defaulters.
8	12.09.2025 (Misc incident) 22.50 hrs	SC	At Sedam (SEM) station, a portion of plaster of ceiling of the portico of station building given up suddenly and fell on the passengers who were sleeping under the portico. 10 passengers were sleeping in which 4 passengers sustained minor injuries. All the passengers were given medical treatment and discharged.	Ceiling plaster become weak and fallen due to ingress of moisture in roof.	- Detailed investigation shall be carried out by SC division and appropriate action shall be taken against staff responsible. - All divisions shall strictly adhere the guidelines issued regarding inspection & maintenance of all the station buildings.
9	15.09.2025 (Unusual incident) 05.51 hrs	BZA	LP of DN T. No. 07003 (CHZ-DMM) observed a foreign body (wagon door) on UP main line track at Km 228/01-03 between Kavali (KVZ) - Tettu (TTU) stations and stopped at KVZ station and informed SS/KVZ.	Outgoing TMR of T. No. BOXNE goods informed SS/RU about the worked out wagon door kept inside the wagon but SS/RU failed to inform C&W staff about the same. Outgoing TMR/BTTR also failed to take necessary action after knowing (informed by incoming TMR) wagon door was kept inside the wagon.	- GTL and BZA divisions to conduct detailed investigation and to take action against staff responsible. - All divisions shall ensure proper securing of wagon doors at all loading/ unloading points and appropriate action to be taken for any deficiencies noticed enroute.
10	19.09.2025 (Misc incident) 17.00 hrs	SC	IPF/SC informed that at Secunderabad (SC) station a Battery Operated Car (BOC) fell onto the track at Platform No. 10 near the cloakroom.	Battery operator after dropping passengers at Platform No. 10, forgot to apply hand brake while collecting fare charges from the passengers due to which the battery car rolled down and fell onto the track.	- SC division to conduct detailed investigation and action shall be taken against person responsible. - All divisions to take necessary action for controlling the movement of BOCs and self-propelled vehicles in the stations areas to ensure safety of passengers and train operators.

SOUTH CENTRAL RAILWAY
MONTHLY SAFETY BULLETIN — OCTOBER 2025

(HQ SAFETY BRANCH)

S.N	DATE	DIV	DESCRIPTION	CAUSE / SHORTFALL	ACTION
11	29.09.2025 (Yard derailment) 10.25 hrs	SC	At washing siding/ Secunderabad (SC) yard, while performing shunting of 14 Empty LHB coaches from WS4 to WS3 line, 2 (12 th & 13 th) coaches derailed on hand operated point no. 33.	Prima facie: Pointsman had failed to set Hand Operated Point No. 31 to the required position in forward movement resulted in trail through of points over which reverse movement was carried out further. Correct setting of point was not ensured by the LP/Shunter.	- Detailed investigation shall be carried out by SC division and appropriate action shall be taken against the staff responsible. - All divisions to conduct frequent ambush checks to identify slack working & irregularities and staff responsible shall be taken up. The aspect of monitoring the working of staff through CCTV cameras provided in yards may be explored.
12	29.09.2025 (Unusual Incident) 12.45 hrs	GTL	In Pakala (PAK) – Putalapattu (PTT) stations, PQRS Block was permitted from 10:25 hrs. to 13:25 hrs. Tower Car (SCRU 42304) was also permitted in the same section for Stagger adjustment work. Tower car driver moved at speed of 46 kmph at the work site of PQRS disregarding the caution order of 20 kmph and got derailed by front truck all wheels at Km 55/25-27.	Negligence of Tower Car Driver in observance of speed restriction and inadequate work site protection measures.	- Detailed investigation shall be carried out by GTL division and appropriate action shall be taken against the staff responsible. - All divisions shall counsel the field staff for taking necessary precautions & work site protection measures to avoid recurrence of such incidents.
13	30.09.2025 (Unusual Incident) 10.05 hrs	SC	LP of T. No.22533 Exp while on run between Wirur (WIRR) – Makudi (MKDI) Stations, hit the rail drilling machine of TRD at Km 161/12.	- TRD staff had undertaken rail hole drilling work without any block and not followed prescribed procedure/ safety protocol. - Crew did not report the incident in CMS at the time of signing OFF.	- Detailed investigation to be carried out by the division and strict action shall be taken against staff responsible. - Prescribed procedures & Proper work site protection measures shall be taken while carrying out the work on track / in the vicinity of the track. - Suitable action shall be taken against crew for not reporting in CMS.
14	30.09.2025 (Unusual Incident) 12.05 hrs	SC	UP EOG Goods stabled with Loco No. 60535 at MNSM Goods shed (Iron ore siding) / Manikgarh (MAGH) station was hit by tractor left unmanned by cleaning contractor and compressor pump base guard of the loco got damaged.	Negligence of Tractor driver of the cleaning contractor.	- Detailed investigation shall be carried out by SC division and action shall be taken against cleaning contractor. - All other divisions shall also identify such vulnerable areas and take preventive measures. - Contractual staff to be counselled for safe working in railway premises and commercial inspectors shall carryout frequent inspections.

All Divisions are advised to give wide publicity through special instructions & take suitable corrective action at their end.
No. Safety.387/Monthly Safety Bulletin/Vol. II Dated 03.11.2025


(K Venkatramana Reddy)
Principal Chief Safety Officer

Copy to Secy. to GM, AGM, PCOM, PCME, PCEE, PCSTE, PCSC, PCE & PCCM
Copy to DRM/SC, HYB, GTL, GNT, BZA & NED.
Copy to Sr.DSO/ SC, HYB, GTL, GNT, BZA & NED.