HOUSE PRE-PURCHASE INSPECTIONS

Property Inspection Report

IMAGE OF PROPERTY

SAMPLE

Client Name ******

Address of Inspection ********

JOB NUMBER: ****
INSPECTION DATE: *******
INSPECTION TYPE: Written Property Report.
INSPECTOR: *******
QUALIFICATIONS: Trade certificate in carpentry
PERSONS ON SITE DURRING INSPECTION: Agent
OBJECTIVE: To provide a description of the property's attributes, identify significant defects and maintenance visible at the time of inspection with non-invasive techniques.

HOUSE PRE-PURCHASE INSPECTIONS

Table of Contents

SUMMARY OF REPORT 3
WEATHERTIGHTNESS RISK AWARENESS 5
WEATHERTIGHTNESS RISK IMAGES 6
TERMS AND CONDITIONS 8
THE SCOPE OF HPPI INSPECTIONS 9
MOISTURE TESTING INFORMATION 15
MOISTURE METERS USED 16
OVERVIEW 17
DEFECTS IMAGES 19
EXTERNAL INSPECTION 25
EXTERNAL & LANDSCAPING 26
RETAINING WALLS 26
EXTERNAL CLADDING 27
EXTERNAL JOINERY 27
ROOF AND ROOF COMPONENTS 28
INTERNAL ROOF CAVITY & INSULATION 29
SERVICES 34
REFERENCE SITES BASED ON AGE OF CONSTRUCTION 35

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

SUMMARY OF REPORT

On the day of the inspection the house was occupied which makes inspecting some areas of the home not possible. These areas include and cupboards and kitchen pantries, wardrobes, and areas with furniture etc.

When considered against homes from a similar construction period and type we find the home to be in **average condition.**

We have noted in our report the visible defects and concerns, these need to be considered but there were twelve more urgent defects that require further advice and inspection from appropriate and qualified contractors.
There are;
List of major concerns/defects & significant maintenance:

- There is insufficient ground clearance on the eastern side of the house between the ground and the bottom of the cladding. In some areas concrete was actually poured against a weatherboard. This may lead to moisture wicking up through the cladding and into internal framing. The minimum ground clearance requirements are 100 millimeters from paved areas and 175 millimeters to unpaved areas. Recommend contacting a licensed building practitioner for improvements to these areas.
- The downpipe to the carport requires reattachment by a registered plumber.
- There is denting to some roofing panels. These may need to be replaced by a licensed building practitioner as they have creased, and creases may turn to rusty splits. Contact license building practitioner for further advice.
- The roofing to the carport has not been secured under the soffit on the southern side of the house. This may lead to a rattling when wind is blowing in the wrong direction, as well as the gap between the soffit and the roof being so narrow, maintenance to the roof would be impossible.
- The roof coating is peeling off in multiple areas and may require recoating by suitably qualified professional.
- Internal gutter systems are high risk of moisture ingress. If it becomes blocked or leaks, moisture has the ability to travel through the soffit lining and into the internal timber framing. This risk factor is reduced with the presence of overflows. However, periodic monitoring and maintenance is recommended.
- The end of the Ridge flashing on the roof requires fixing as it appears to be lifted. Recommend contacting a licensed building practitioner for further advice.
- The rubber to the rubber boot of the roofing penetration is aged and is splitting. The rubber boot may need to be replaced by a licensed building practitioner.
- There were signs of moisture running underneath the house with heavy corrosion to some pile fixings and some water staining to others. Recommend contacting a registered drainlayer for improvements to water collection along the western side of the driveway where the driveway meets the house. As well as contacting a licensed building practitioner to replace rusty fixings and metal plates in the subfloor area. The property would benefit by the installation of a vapor barrier and subsequent also.

SAMPLE

- There were signs of water Staining to the subfloor area. The majority of this area appears to have been replaced with plywood and there were no elevated moisture levels on the day of the inspection, which would indicate the issue has possibly been resolved. However, this cannot be confirmed, and further monitoring is recommended as well as an inspection of the subfloor by a licensed building practitioner to determine if there is any deterioration.
- No drainage tray has been installed below the hot water cylinder. This is required to prevent deterioration to particle board flooring. Contact a registered plumber for further advice.
- The range hood is not vented to the outside atmosphere. Recommend a ducting system is installed to the exterior of the building by suitably qualified professional.

Please note: We have noted major concerns in our summary, please ensure you read each section to fully understand 'ALL' the concerns. We may advise of other concerns that are not considered 'major concerns'. These will be listed in the relative sections, they may still require action, and could have costs of repair to be considered.

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

WEATHERTIGHTNESS RISK AWARENESS

Assessing the Weathertightness risk

Providing shelter from the weather is one of a building's primary functions. In recent times, the advent of more complex buildings, new materials and systems, and different construction practices mean it is even more important for buildings to be properly designed to ensure they remain weathertight throughout their lives. From early 2000, there has been a growing body of evidence pointing to common weathertightness problems associated with certain design features. These include flat roofs, complex building shapes and junctions, parapets, narrow or no eaves (roof overhang), monolithic claddings, sealed decks, built-in balconies and inadequate flashings around windows and doors. Our experience over the last decade has shown that buildings with these types of design feature are more likely to leak and will therefore require extra protection through careful water management, design, and detailing. Environmental factors such as wind, extreme height, and site exposure, should also be considered.

In E2/AS1 There is a risk matrix tool which can be used to assess and potentially reduce the overall weathertightness risk of a building design by allowing incorporation of design features that can compensate for some of those risks. In a HPPI Pre-purchase inspection report we will consider the weathertightness risk, but we will not measure or provide details of its risk score. We will advise areas of heightened risk, and also look at particular attributes of the building.

Particular Attributes:

Particular attributes (at risk areas) are included in our report as required by the NZS:4306-2005 standard regardless of whether they have moisture ingress issues at the time of our inspection. This allows you to be aware of at risk areas to assess not only the condition of the property on the day of inspection, but also to take into consideration the particular attributes (at risk areas) associated with the property.

This also provides the purchaser the information regarding risk management, preventative maintenance, and any expected regular maintenance.

Risk Assessment

Site Exposure and Wind Zone:	Urban terrain, Sheltered, Land topography Steep, High wind zone
Complexity of Building Envelope :	Medium complexity of design
Number of Stories:	Single level home
Number of Cladding Types:	1
Roof Planes and penetrations:	Simple roof design
Monolithic Cladding:	No
Cavity System:	No
Eaves:	High risk

Particular Attributes (Risk Areas): When looking at this particular home and its weathertightness risk- Refer to the images below this table (Weathertightness risk images). Also, it is important to consider;

- Areas of the home with large penetrations in the cladding that are un-flashed such as electrical boxes and vents are a high risk of moisture ingress. Recommend contacting a licensed building practitioner for possible upgrades to these areas.
- Internal gutter systems are high risk of moisture ingress. If it becomes blocked or leaks, moisture has the ability to travel through the soffit lining and into the internal timber framing. This risk factor is reduced with the presence of overflows. However, periodic monitoring and maintenance is recommended.
- There is an insufficient threshold between the interior floor level and the exterior ground level. This makes this area a high risk of moisture ingress.
- Areas of the home with small or no soffit overhang are high risk for moisture ingress. Recommend periodic monitoring and maintenance.

SAMPLE

These areas may still be performing but it is important to consider any current but also the ongoing requirements to check and maintain these areas. Further advice from a Licenced Building Practitioner may also help to look at ways to reduce or mitigate these risk factors. Further advice regarding a long-term maintenance plan is recommended, all homes require ongoing care to help improve and maintain performance.
Refer to the base of this report under the heading 'Recommendations' for helpful links and resources

WEATHERTIGHTNESS RISK IMAGES

Blue: Areas of the home with large penetrations in the cladding that are un-flashed such as electrical boxes and vents are a high risk of moisture ingress. Recommend contacting a licensed building practitioner for possible upgrades to these areas.	

SAMPLE

Blue: There is an insufficient threshold between the interior floor level and the exterior ground level. This makes this area a high risk of moisture ingress. **Orange :-** Areas of the home with small or no soffit overhang are high risk for moisture ingress. Recommend periodic monitoring and maintenance.	

Blue: Internal gutter systems are high risk of moisture ingress. If it becomes blocked or leaks, moisture has the ability to travel through the soffit lining and into the internal timber framing. This risk factor is reduced with the presence of overflows however periodic monitoring and maintenance is recommended.	

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

TERMS AND CONDITIONS

applicable to inspection reports prepared by

House Pre-Purchase Inspections Ltd.

From here on referred to as HPPI

These terms and conditions apply to the inspection undertaken by House Pre-Purchase Inspections Ltd. (HPPI) and the Inspection Report to which these terms and conditions apply.

As part of House Pre-Purchase Inspections (HPPI'S) compliance with New Zealand Property Inspection Standards NZS 4306:2005 (the Standards) we are required to outline:

- The scope of our inspection and report.
- Any limitations to our inspection and report; and
- Our terms of trade
- Your name
- Our Inspection Company Name
- The Date the report is due by
- The Scope of report
- Any special-purpose property inspection items
- Our Fee
- Any Limitations and conditions
- Our Professional liability covers.

This must be accepted by you/the client, and this acceptance must be sent to HPPI by email before any inspection can be carried out.

1. TERMS OF TRADE

2. In consideration for us providing you with the Inspection and report, you agree:
3. Once our terms have been accepted via our web site Payment is required. The report will only be released once paid. Accounts not paid by the due date shall incur a late payment interest charge of 15% of the total amount owing for each calendar month the account is overdue, together with all debt collection costs.
4. All work in progress will be billed monthly, with a final invoice issued on completion.
5. If a quotation is given for the Inspection/report, any expenses incurred in addition to the quote, will be on the basis of cost to us, plus 15%.
6. If, after a subsequent quotation/estimate, any additional work is found to be required you will be contacted for your approval before any further work is completed.
7. We have no responsibility or liability for any cost, loss or damage arising from:
8. any errors or omissions from information, data or documents not prepared by us, our employees, or other persons under the direct control of us.
9. any outcomes and reports from any form of sampling or testing.
10. any act or omission, lack of performance, negligent or fraudulent act by you.
11. any act or omission, lack of performance, negligence or fraud by any consultant, contractor, or supplier to you, or any of your employees or agents.
12. Any samples taken from any property for testing for products such as methamphetamine or asbestos, are random samples and may not be representative of the presence or absence of the product being tested for in the property, or any other area where samples were not taken.

SAMPLE

13. Any test samples, results, and reports produced are neither a warranty or guarantee of the presence or absence of the product being tested in the property.
14. That all commercially sensitive information obtained by either party during the preparation of the report shall remain confidential.
15. The contents of the report, or any other work prepared by us is confidential and has been prepared solely for you and shall not be relied upon by any third parties. We accept no responsibility for anything done or not done by any third party in reliance, whether wholly or partially, on any of the contents of the report.
16. Where the content of any report is relied upon for industry research or evaluation purposes, such research or evaluation shall not include any data that may allow for the identification of any property or any personal information included in the report in any way.
17. You shall pay all costs and expenses (including legal costs on a solicitor/Client basis) resulting from any breach of these terms of trade by you or the enforcement by us of these terms of trade.
18. The parties agree that the Laws of New Zealand govern these terms and conditions and proceedings taken by the other party shall be heard in the District or High Court at Auckland, New Zealand, regardless of the location of your place of business/residence.
19. materials when not able to be fully investigated (whether for the reasons stated above or far any other reason).

20. REFUND POLICY

21. Once the client has given direction for HPPI to undertake an inspection and/or report, and they have accepted our terms and conditions, payment is required. If the purchaser has paid for the report and he or she has difficultly viewing the report on their device other arrangements can be made by contacting HPPI. The report can be emailed or posted if required. The client not being happy with the contents of the report is not grounds for a refund. We will meet our Obligations under the Consumer Guarantees Act. Note if a refund is given the said report cannot be used by the client or any other entity.

22. CANCELLATION FEE

23. If you cancel the inspection you agree, in consideration for us arranging a time for the inspection, to pay us a cancellation fee equal to the full cost of the inspection and report, provided however that if we have received twenty-four hours' (one full working day), written notice of cancellation no fee will be payable.

THE SCOPE OF HPPI INSPECTIONS

This has been undertaken in accordance with NZS4306:2005 and House Pre-purchase Inspections Terms and Conditions.

24. Inspection and Report prepared in accordance with the Standards.

25. For the purpose of pre-sale or pre-purchase inspections, the inspection process will be carried out in accordance with the Standards. You agree to be bound by the Standards.
26. A copy of the Standards is available at our office for your inspection, or alternatively you may contact Standards New Zealand and purchase a copy.
27. We will have a qualified person with a relevant qualification and building inspection experience carry out the inspection in accordance with the Standards ("the Inspection").
28. We will certify that the Inspection has been carried in accordance with the Standards and the Inspector meets the competences of that standard.
29. We will consider Weather Tightness, regardless of age, however it will not be measured against appendix A of the Standards or to E2/AS1 of the Building Code, Matrix and Evaluation, as this would be subject to a specialist report.
30. We will undertake moisture testing and will advise if we have detected any raised moisture readings. We will show their position but may not show images of the readings or advise of the actual moisture reading. Non-invasive moisture meters have limitations with trying to determine high or low range readings, and this should be considered qualitative report only. You must consider that all raised moisture readings will require further invasive investigations.

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

31. INSPECTION AND REPORT LIMITATION AND SCOPE

32. We use our experience in the New Zealand residential construction market to provide a "visual and non-invasive" inspection reporting on: The properties attributes, Significant defects and maintenance visible at the time of the inspection (when considered against homes of a similar age and construction type) & Weathertightness risk.
33. The report expresses the opinions of the inspector, based on his or her visual impressions of the condition that existed on the date of the inspection only.
34. The Inspection and report are not intended to be technically exhaustive, or to imply that every component was inspected, or every possible defect was discovered.
35. We will consider Weather Tightness, regardless of age, however it will not be measured against appendix A of the Standards or to E2/AS1 of the Building Code, Matrix and Evaluation, as this would be subject to a specialist report.
36. The report should be seen as a reasonable attempt to identify any Significant Fault or Defect visible at the time of the visual Inspection rather than an all-encompassing report dealing with the home from every aspect.
37. While all care and effort is taken to discover and record major defects and significant maintenance in the building at the time of the inspection. Inspection Reports are based on a visual above-ground non-invasive inspection using a surface moisture meter. Due to the size, complexity and hidden nature of construction, irregularities and defects may not always be visible at the time of the inspection.
38. The Inspection and report is intended only as a general guide to help you make up your own evaluation of the overall condition of the home, and is not intended to reflect the value of the premises, nor make any representation as to the advisability of the purchase.
39. HPPI accepts no responsibility or liability for any omission in the inspection or the Inspection Report related to defects or irregularities which are not reasonably visible at the time of inspection or which relates to the components of the building which are below ground.
40. The Client accepts that the visual inspection is limited to those areas of the building which are reasonably and safely accessible at the time of inspection. HPPI has not opened, uncovered, or dismantled any part of the building during inspection, or undertaken any internal inspection of concealed areas of the building.
41. The inspection did not include any of the areas as or components which were concealed or closed in behind finished surfaces (such as plumbing, drainage, heating, framing, ventilation, insulation or wiring) or which require the moving of anything which impeded access or limited visibility (such as floor coverings, furniture, appliances, personal property, vehicles, vegetation, debris, or soil).
42. HPPI did not move occupier-owned items for the purpose of undertaking the inspection.
43. HPPI is not responsible and the inspection will not cover any part of the building or property to which access is not reasonably and safely available to carry out a visual inspection. This may include roofs, sub floor areas and ceiling cavities. High, constricted, or dangerous areas cannot be inspected if in conflict with Occupational Safety and Health Regulations.
44. Inspections of the systems at the home are outside of the scope of a HPPI inspection report. The inspector will however conduct a cursory inspection of the hot water system, the plumbing and electrical system (including testing the accessible power points and light in each room). You should note that this will be the opinion of the inspector, who is not a qualified plumber, electrician, or gas fitter. You should note that our inspector did not inspect the air conditioning system, dishwashers, stoves, hobs, heating system, aerials, swimming pools or spas, footings, concealed damp proof membraines, concealed drainage, plumbing pipes, electrical cabling or fixtures and fittings,the operation of Chimneys or fire places, floor coverings,
45. We will not insect or report on telecomunications or aerials and antennae
46. It is not our policy to give oral advice; we will provide a written report. If you do require us to give you oral/ verbal advice we shall not be held liable for that advice.
47. **Asbestos based products** can be difficult to determine unless the material is tested. HPPI may not identify all possible materials with our visual inspection. An asbestos survey is the only way to identify 'all' Asbestos products- this is a special purpose inspection report not covered by a HPPI pre-purchase inspection.
48. HPPI will take care to advise of possible concerns and advise if, in our experience we expect a material to contain Asbestos but cannot be held liable in the event a product is missed. The client must at their own expense arrange for an Asbestos survey to fully detail materials that contain Asbestos.
49. As a product, Asbestos performs well and if it is in good condition the only issue to consider is if you are planning to undertake any upgrade or renovation that may affect the material.

SAMPLE

50. If the material is damaged and not performing or is used in an internal plaster system, removal may be required, and costs should be considered, these cost will vary depending on the amount to be removed and the location and access and will need to be quoted by a third party or Asbestos removal contractor.
51. If you are planning renovation or upgrade an Asbestos survey should be undertaken
52. The Client accepts that HPPI will not detect some faults because the fault only occurs intermittently; part of the building has not been used for a while and the fault usually occurs after regular use (or detection of the fault would only occur after regular use); the type of weather that would normally reveal the fault is not prevailing at or around the time of the inspection; the fault has been deliberately concealed; furnishings are obscuring the fault (see below); HPPI has been given incorrect information by the Client; the vendor (if any), the real estate consultant, or any other person; and/or the fault is/was not apparent on a visual inspection
53. Product names, materials and systems are not generalized to help in reading and understanding the Inspection Report. All materials and systems are assumed to be standard typical construction or materials when not able to be fully investigated (whether for the reasons stated above or far any other reason).
54. Unless otherwise stated the inspection did not access compliance with the New Zealand Building Code's, including the code's weather-tightness requirement, or structural aspects.
55. Compliance with Statute Regulations, Territorial or Other Relevant Authorities
56. Unless otherwise stated, HPPI has not and will not make any inquiries or undertake any inspections of any third party, territorial or other relevant authority records in respect of the building. The Inspection Report does not replace and is not intended to replace a council issued Land Information Memorandum or Council file search. HPPI recommends a Land Information Memorandum report is obtained and council file search conducted. If the Inspection Report contains any information obtained from the Council, then such information is only as accurate as the Council information on which such information is based. HPPI accepts no responsibility for any error or omission in such information as a result of inaccurate Council records.
57. HPPI makes no representation that the building complies with the requirements of any legislation (including any act, regulations, by-laws, etc), including but not limited to, the Building Act 2004, Health and Safety in Employment Act 1992, Fire Safety and Evacuation of Buildings Regulations 2006 or the Disabled Persons Community Welfare ACT 1975. The Inspection Reports is not a site or environmental report and HPPI makes no representation as to the existence of or absence of any "contaminated" (as that term is defined in the Resource Management Act) or any "hazard" (as that term is defined in the Health and Safety in Employment Act) in the building or property.
58. HPPI does not guarantee or warrant the work of any contractor or service, or the integrity of any product, appliance or fixture, natural or processed or any building system or cladding system applied. The Inspection Reports is not a guarantee or Warranty as to the state of the building.

REPORT SCOPE

The following areas will be included in the inspection report:

59. Site, Subfloor/Foundations, Exterior, Roof exterior, roof space (interior), Interior, Services and also Identified ancillary spaces, and accessory units. *(Note these areas will only be inspected if we are advised prior to quoting)*
60. Although it is necessary to inspect the areas advised, it is not necessary to report on each one. Inspectors may choose to report only on an 'exceptions' or 'information basis' i.e listing only significant defects rather than also reporting on items that are in acceptable condition.
61. The report should be seen as a reasonable attempt to identify any significant Fault or Defect visible at the time of the inspection rather than an all-encompassing report dealing with the home from every aspect. The reporting of any Significant Fault or Defect is on an exception only basis, rather than reporting on items, which are in acceptable condition for their age.
62. **"Significant Fault or Defect"** is defined in the Standards as – "A matter which requires substantial repairs or urgent attention and rectification."
63. **A Significant Fault or Defect** will be addressed in the summary section of the report as maintenance or remedial work.
64. **A minor fault or defect is described as;** A matter, in view of the age, type or condition of the building, does not require substantial repairs or urgent attention and rectification and which could be attended to during normal maintenance.

Multi-unit premises

65. With an inspection carried out on large commercial or multi-level dwellings, external inspection may not be possible due to access to these areas!

SAMPLE

66. With multi-unit properties, the inspector shall inspect and assess only the condition of the interior and **accessible parts of the immediate exterior** of the particular unit, and all related accessory units. (accessory units must be advised and noted in the engagement letter or further added charges may apply)
67. Note- A complete survey of the other common property areas would, if requested, be the subject of a special purpose property report, as the purchaser would have additional liability for the general maintenance of the common property.
68. The person requesting the report shall identify any accessory units and ancillary spaces for the inspector.
69. It is important to be aware of any 'unit title' or 'Body corporate' requirements, as the external areas generally fall under their jurisdictions.
70. surveys of multi-unit buildings are often not requested under the mistaken belief that an examination of the body corporate or company records alone will adequately inform the purchaser. These records will only disclose defects which have been documented by the body corporate, company or the lessors in a cross lease. The records will not necessarily reveal all the defects.
71. To determine the extent of any defects in the whole of the property, a survey of all the common property, and the interior of every unit would need to be carried out.
72. A prospective purchaser should be aware that their liability to contribute to the cost of rectifying the building defects is not restricted by reference to the particular unit which they are proposing to purchase, but may extend to the whole common property. Thus, an inspection of the particular unit and its immediate surrounds may be of limited assistance to the prospective purchaser as a determinant of the possible total extent of their overall liability to contribute to the total cost of the work. Consequently, appropriate professional advice should be obtained.
73. The purchaser agrees that with any commercial inspection report, the inspection and report 'scope' is required to be clearly advised in our engagement letter and agreed upon prior to any inspection taking place.

74. PRELIMINARY RUN DOWN or QUICK RUNDOWN

75. At HPPI, we provide written reports to the New Zealand standard 4306-2005. We understand that in some cases prospective purchasers may benefit from verbal reports, but these do not meet the NZS4306-2005 standard.
76. With the extensive detail provided in a '**HPPI Full written inspection report'**, verbal advice can easily be misunderstood.
77. To provide this sort after service to prospective purchasers, we have developed a HPPI '**Preliminary run down'**, a quick run-down of our inspection that may allow our clients to gain a basic understanding of the overall condition of the home and any expected **'Special purpose reports'** or recommended '**further investigation'** outside the scope of a pre-purchase report that may be required or referred to in any **'Full written inspection report'.**
78. HPPI can undertake a full inspection of a property and retain the findings and information to complete a '**Full written inspection report'**. Once the site inspection has been undertaken our inspector can provide a '**Preliminary run down'** over the phone or on site. This will advise of the major concerns and risk factors regarding a specific property. This is not a verbal report but rather an opportunity for buyers to decide if they wish to proceed and outlay the cost of a HPPI **'full written inspection report'** to the NZS-4306 standard.
79. A deposit for a full report will be required and if after a preliminary run down, the client decides not to proceed with any further due diligence, they can withdraw from our service at no added charge. If the client decides to proceed with a purchase, they can make full payment and request a full pre-purchase inspection report.
80. If a purchaser proceeded with a purchase without obtaining a full written inspection report prior to any unconditional offer, HPPI cannot be held liable for any perceived omission or misunderstanding as they have elected to withdraw from our service and the terms of our contract have not been fulfilled by the client.

81. DRONE ROOF INSPECTION

82. If we are unable to access the roof due to health and Safety requirements, we can use a drone to undertake a visual inspection of over height areas. If a drone inspection is to be undertaken it will be shown in our quote/ letter of engagement. Drone inspections are a visual inspection of the roof surface, to advise of any major visible defects and weather tightness risks.
83. The drone has limitations being that we have not physically walked on the roof. We will observe images and provide advice on further actions that may be required or recommended. You the client, agree and understand that we may not detect some roof defects that may have been detected had we physically accessed the roof.

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

84. THE PURCHASER AGREES

85. The purchaser agrees that the written Inspection report remains the property of HPPI. If another party requests a report on the same property HPPI can on sell the report at its discretion. You the purchaser of the report receive and own your named copy of the written inspection report, and agree it is view only and cannot be passed on or re-sold to any other party.
86. The person requesting the report shall arrange reasonable access to the building and any locked or blocked spaces, this includes contents items. If items prevent access HPPI not move any personal effects.
87. The Person requesting the inspection shall inform the Inspector of any accessory buildings and/or spaces like self contained granny flats, second kitchen, accessory units.
88. Our inspectors will inspect all areas of the building that are reasonably accessible. For example;
89. If there is an access hatch available to the roof space at least 450mm x 450mm that is not blocked, has a crawl space of at least 600mm x 600mm and is accessible from a standard 3.6-metre ladder.
90. If there is access to the subfloor of at least 500mm x 400mm and a clearance of at least 400mm.
91. For roof inspections the roof height needs to be accessible from a 3.6m ladder
92. If there is risk of damage to any part of the building material, we will not access.

92.1.1. Note- access is also limited to the safety requirements of OSH.

93. INDEMNITY INSURANCE COVER

94. HPPI has in place the following insurance cover -Professional Indemnity**,** General Liability**,** Statutory Liability

95. WHAT IS EXCLUDED FROM A STANDARD HPPI INSPECTION?

96. The report will not normally include any of the following unless a special requested is made and agreed in writing.

97. footings,
98. concealed damp proof membraines,
99. concealed drainage, plumbing pipes, electrical cabling or fixtures and fittings
100. the operation of Chimneys or fire places,
101. floor coverings,
102. Appliances,
103. ventilation systems,
104. hot water systems,
105. Hazards
106. Pools, spa's, saunas and equipment

107. Also, the report will not include any of the following;

108. Legal title issues,
109. Building warrant of fitness or services described on a compliance schedule,
110. Planning or resource consent issues,
111. Consent issues (although any possible issues may be notified if picked up),
112. Long term maintenance planning,
113. Heritage obligations
114. Body corporate rules, terms of cross lease or occupation agreements.

115. LIMITATIONS OF LIABILITY

116. Subject to any statutory provisions, if HPPI becomes liable to the Client, for any reason, for any loss, damage, harm or injury in any way connected with the completion of inspection and/or the Inspection Report, HPPI's liability shall be limited to a sum not exceeding the cost of the inspection and the Inspection Report.
117. HPPI will not be liable to the Client for any consequential or special loss of whatever nature suffered by the Client or nay other persons injured and the Client indemnifies HPPI in respect of any claims concerning any such loss.
118. HPPI accepts no liability in relation to the inspection or this Inspection Report to any other person than the Client which this report is addressed too. HPPI will not be held responsible for any damage to the building when not directly the fault of HPPI.

119. GENERAL

120. Nothing contained in these terms and conditions shall be deemed to exclude or restrict any rights or remedies that the Client may have under the Fair-Trading Act 1986 or the Consumer Guarantees Act 1993 or at law. If any provision of these

SAMPLE

terms and conditions is illegal, invalid or unenforceable, such provision shall be deemed to be excluded or read down to the extent necessary to make the provision legal, valid or enforceable, and the remaining provisions shall not be affected.

121. DISPUTES

122. Should any dispute rise as a result of the inspection or Inspection Report, it must be submitted to HPPI in writing immediately.
123. The Client agrees that in the event of a dispute, the contents of the Inspection Report may not be used to satisfy any terms of a sale and purchase agreement until the disagreement/dispute has been resolved.
124. The Client agrees that if, after raising a dispute, the Client uses the inspection or Inspection Report to make an unconditional offer or confirm a sale and purchase agreement, the Client shall be deemed to have waived all rights to continue the dispute, and/or raise any future dispute or claim against HPPI.
125. in the event of a claim/dispute regarding damage to a home, the Client will allow HPPI to investigate the claim prior to any repairs to the home being undertaken or completed. The client agrees that if it does not allow HPPI to investigate the claims of damage before repairs are carried out the Client shall be deemed to have waived its rights to continue with and/or make any future claim against HPPI.
126. In the event of any dispute, the Client agrees not to disturb, repair, or attempt to repair anything that may constitute evidence relating to the dispute, except in the case of an emergency.

127. TITLE AND BOUNDARIES

128. HPPI has not undertaken a search of the title to the property, or a survey of the property and assumes no responsibility in connection with such matters. Unless otherwise stated it is assumed that all improvements lie within the title boundaries.

129. NOT A GUARANTEE OR WARRANTY

130. HPPI does not guarantee or warrant the work of any contractor or service, or the integrity of any product, appliance or fixture, natural or processed or any building system or cladding system applied. The Inspection Reports is not a guarantee or Warranty as to the state of the building.

131. PUBLICATION AND USE

132. Neither the whole or any part of this Inspection Report or any other report (whether verbal, video or written) or any reference to this Inspection Report or any such other report may be: included in any published document, circular or statement, whether hardcopy or electronic; transferred to any persons other than the Client; or distributed or sold, in each case without first obtaining the written approval of HPPI. The Inspection Report is not to be used in any litigation except with the prior written approval of HPPI.

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

MOISTURE TESTING INFORMATION

We have undertaken moisture testing around external risk points, external penetrations, and major plumbing areas although this is not required under the standard. We will advise if we have detected any raised moisture readings and show their position, **but we may not show images of the readings**.

Non-invasive inspections have limitations with advising of high or low range readings. We must consider these limitations.

- What is the timespan or longevity of issues,
- areas exposed by particular weather conditions that may mean they fluctuate in moisture,
- seasonal changes, and
- differing construction materials.

The above examples of limitations show that with an inspection undertaken on a single day, an issue may be at any stage of its possible wet/dry cycle, so advising an issue is minor could be misleading, for example- it may have been a small leak for 20 years+ and could have caused significant hidden gradual damage.

This should be considered qualitative report only. You must consider that all raised moisture readings will require further invasive investigations to determine-

- the severity of any hidden damage,
- to obtain an accurate moisture content of any concealed material.

If you or your lender require us to show moisture readings into your report, this can be requested through the HPPI office- this will inquire additional fees.

Our non-invasive moisture meters will not penetrate full depth of the structure or thick claddings.

It should be considered that any raised moisture readings or signs of historic issues will require further invasive testing to determine the extent of an issue. This may require invasive removal of internal and/or external linings. If we advise- **'further investigation required'**, it is imperative that this direction is followed prior to any agreement or purchase as if it is not, there is risk of unknown costs.

If we detect weathertightness concerns we may advise or recommend a further 'Weathertightness survey', This is a specialist report not undertaken by HPPI. HPPI can undertake invasive investigations to determine the extent of hidden damage to localised issues but in some cases a full detailed invasive weathertightness survey is required to determine not only the extent of any hidden damage but to determine the failures in the design and or materials and advise of required remediations.

Please refer to our terms and conditions for standard limitations as set out by NZS4306-2005

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

MOISTURE METERS USED

Trotec T660	
The T660 is ideally suited for the quick, non-destructive determination of moisture distribution in near-surface areas to about 4 cm. Based on the T660's integrated material pre-selection function for anhydrite and cementitious screed the measurement results (indicative) can on demand be shown directly on the colour display of the T660. The T660 is also suited for non-destructive wood moisture measurements according to the dielectric measurement method (indicative). The numerical range of the T660 runs from 0-200 units with 0-79 generally indicating dry and 80-200 showing wet or elevated moisture. In some cases, readings below this may be advised as elevated depending on different factors. (Note: Metal and some other materials can increase the readings of capacitance meters). Materials with higher density may show higher readings on the Trotec T660, and in these cases we will find the expected ambient reading of the material taken from various points in the material to base our readings on.	

Protimeter Surveymaster	
Well known throughout NZ, the Surveymaster is a dual function non-invasive PLUS probe moisture meter. It is ideal for locating and measuring moisture problems in homes and building materials such as timber/wood, gib board etc. The unit will scan (using the capacitance method), typically up to 19mm from the surface. Where moisture is located, the readings from the meter, which are displayed as digits from 70 to 999 on the LCD screen. (Note: Metal and some other materials can increase the readings of capacitance meters). The Surveymaster also features a green, amber and red LED light scale which provides the user with a DRY (green), RISK (amber) and WET (red) visual indicator of moisture levels. Dry- 70-170, at risk 170-200, wet 200-999 Materials with higher density may show higher readings on the Protimeter Surveymaster, and in these cases we will find the expected ambient reading of the material taken from various points in the material to base our readings on. Generally we will use this meter if there is any surface moisture on materials to be tested as this meter has no effect on reading by surface moisture	

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

OVERVIEW

THE SITE
This is a Single level home situated on a shared site. The construction type is Timber framed. With three bedrooms and one bathroom, the home faces an Eastern direction. On the date of the inspection the weather was fine with light winds from a Northern direction, the ground/soil condition was dry. Due to the current dry season all external and internal moisture readings are particularly lower than normal due and without any visual damage an issue is harder to detect. Further moisture testing is recommended within the next 6-8 months. **Finished floor levels, Surface water and drainage:** The finished floor level of the lowers area looks to be, below the road height but appears 150mm above the lowest point of the boundary. Topography directs surface water towards the home on the, East side(s).

FEATURE	DESCRIPTION
Approximate Age	1997 **Refer to the base of this report under the heading 'Recommendations' for helpful links and resources**
Detached Buildings	Garden shed
Special Features (not inspected)	Garden shed

Homes Built Between 1995 to 2005

The **leaky homes crisis** is a crisis in New Zealand concerning a number of timber framed buildings constructed from 1995 to 2005 that suffered from weather-tightness problems. The problem was primarily related to the decay of timber framing which, in extreme cases, made buildings structurally unsound. Some buildings became unhealthy to live in due to mould and spores developing within the damp timber framing.

In 1998, a change in the New Zealand standard for Timber Treatment (as referenced in Acceptable Solution B2/AS1) allowed the use of untreated kiln-dried timber in wall framing. This framing was not required to be treated and is susceptible to rot and mould growth. Some homes as part of an alternative solution sign of could have this issue dating back as early as 1995.

B2/AS1 (about timber durability) and E2/AS1 External Moisture (keeping the weather out) These have since been amended. Problems with the administration of the Building Code by councils and building certifiers have also been identified.

Monolithic cladding systems, such as textured wall surfaces made from plaster on polystyrene or fibre cement sheet, have often been used outside their specifications or have been installed incorrectly.

SAMPLE

The Building Act 1991 was replaced by the Building Act 2004, which introduced a licensing scheme for building designers, builders and related trades. Along with the amendments to B2/AS1 & E2/AS1 have increased or corrected the inadequacies of this period.

When undertaking an inspection on home from this period we need to consider these concerns and our report will look at risk levels design and workmanship.

With all homes from this more modern period design and materials became more diverse and without the most recent council plans to refer to it is impossible to advise of things like timber treatment and design issues and/or attributes.

Were possible and practicable we will investigate the construction methods and can advise of other services in regard to timber treatment tests that can be undertaken but these tests can be costly.

Due to the more stringent requirements of the building code and regional authority requirements it is possible to obtain up to date council records by requesting the **Property bag file.** There is a cost with this but it will provide detailed information on the homes plans and specifications and more.

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

DEFECTS IMAGES

HPPI uses Images to show areas of concern and to give an idea on their position. It is common to have some similar defects in multiple areas and Images may be used to give a one-off example of this issue.

Location: Eastern side of house

Material: Multiple building materials

Defect: There is insufficient ground clearance on the eastern side of the house between the ground and the bottom of the cladding. In some areas concrete was actually poured against a weatherboard. This may lead to moisture wicking up through the cladding an into internal framing. The minimum ground clearance requirements are 100 millimeters from paved areas and 175 millimeters to unpaved areas. Recommend contacting a licensed building practitioner for improvements to these areas.

Next action: Contact/seek advice from a licenced building practitioner

Location: South side

Material: Concrete

Defect: The concrete path to the rear of the house appears to have been lifted up by a tree root. This path may need to be relayed for it to be level. Further movement may not happen. However, recommend further in monitoring.

Next action: Further investigation required

SAMPLE

Location: Carport	
Material: PVC	
Defect: The downpipe to the carport requires reattachment by a registered plumber.	
Next action: Contact/seek advice from a registered Plumber	

Location: South east corner of roof	
Material: Metal	
Defect: There is dent to some roofing panels. These may need to be replaced by a licensed building practitioner as they have creased, and creases may turn to rusty splits. Contact license building practitioner for further advice.	
Next action: Contact/seek advice from a licenced building practitioner	

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

Location: Carport roof	
Material: metal	
Defect: The roofing to the carport has not been secured under the soffit on the southern side of the house. This may lead to a rattling with the wind when blowing in the wrong direction as well as the gap between the soffit and the roof being so narrow maintenance to the roof would be impossible.	
Next action: Contact/seek advice from a licenced building practitioner	

Location: Roof	
Material: Paint	
Defect: The roof coating is peeling off in multiple areas and may require recoating by suitably qualified professional.	
Next action: Contact/seek advice from a qualified Professional	

SAMPLE

Location: Roof

Material: Metal

Defect: The end of the Ridge flashing on the roof requires fixing as it appears to be lifted. Recommend contacting a licensed building practitioner for further advice.

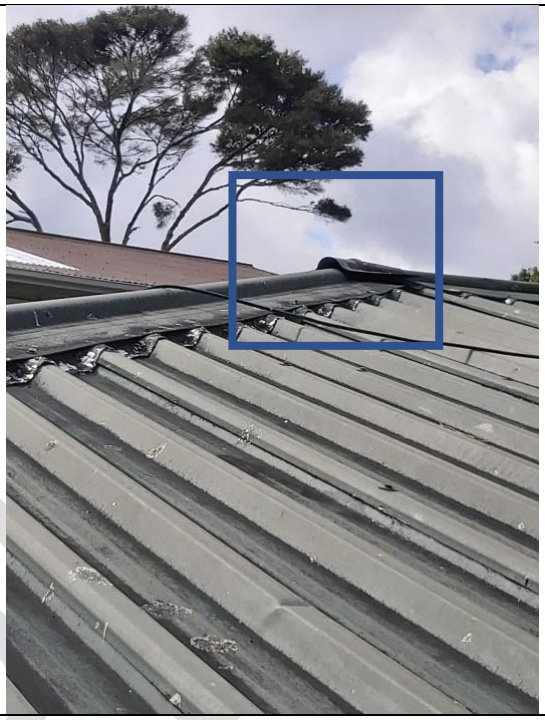

Next action: Contact/seek advice from a licenced building practitioner

Location: Western side of roof

Material: Rubber boot

Defect: The rubber to the rubber boot of the roofing penetration is aged and is splitting. The rubber boot may need to be replaced by a licensed building practitioner.

Next action: Contact/seek advice from a licenced building practitioner

SAMPLE

Location: Subfloor	
Material: Multiple building materials	
Defect: There were signs of moisture running underneath the house with heavy corrosion to some pile fixings and some water staining to others. Recommend contacting a registered drainlayer for improvements to water collection along the western side of the driveway where the driveway meets the house. As well as contacting a licensed building practitioner to replace rusty fixings and metal plates in the subfloor area. The property would benefit by the installation of a vapor barrier and subsequent also.	
Next action: Contact/seek advice from a licenced building practitioner	

Location: Subfloor	
Material: Multiple building materials	
Defect: There were signs of water Staining to the subfloor area. The majority of this area appears to have been replaced with plywood and there were no elevated moisture levels on the day of the inspection, which would indicate the issue has possibly been resolved. However, this cannot be confirmed and further monitoring is recommended as well as an inspection of the subfloor by a licensed building practitioner to determine if there is any deterioration.	
Next action: Contact/seek advice from a licenced building practitioner	

SAMPLE

Location: Laundry

Material: Hot water cylinder

Defect: No drainage tray has been installed below the hot water cylinder. This is required to prevent deterioration to particle board flooring. Contact a registered plumber for further advice.

Next action: Contact/seek advice from a registered Plumber

Location: Kitchen

Material: Multiple building materials

Defect: The range hood is not vented to the outside atmosphere. Recommend a ducting system is installed to the exterior of the building by suitably qualified professional.

There are some kitchen pantry doors that are out of alignment and require maintenance by suitably qualified professional.

There were visual signs of moisture damage to the cabinet doors under the kitchen sink. There were no elevated moisture readings on the day of the inspection and the cause of the damage is unknown. Recommend further monitoring for potential leaks in the future.

Next action: Contact/seek advice from a qualified Professional

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

EXTERNAL INSPECTION

FOUNDATIONS & SUBFLOOR

The condition or performance of concrete foundations or concealed footings is outside the scope of this inspection. We will advise of the type of foundation if known and look for any 'visible' major defects.

Foundation type: Timber piles in concrete footings

Access hatch location and condition	Access was on the southern side of the house and was in good order
Accessibility of subfloor	The subfloor area was accessible
Fixing on piles, bearers and joists	Metal brackets, Steel bolts, rust concerns, we recommend further advise from a licenced builder
Flooring Type	Particle board
Subfloor Insulation Type; **R-Value and/or approximate thickness.**	Polyester R1.5
Subfloor Electrical materials **Notes**	Appears to have TPS (tough plastic sheath) in visible areas (modern wiring)
Subfloor Plumbing materials **Notes (secured in place ,signs of leaks)**	Copper pipe, PVC pipe, grey plastic pipe

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

EXTERNAL & LANDSCAPING

RETAINING WALLS

Location:	Carport
Material:	Timber pole, Timber rails

Location:	Eastern side of house
Material:	Timber pile, Timber rails

DECK(S)

Location:	North and west side of house
Material:	100 x 100mm timber piles, timber bearers, timber joists, Pine timber deck surface
Balustrade:	Timber

Driveway

Location:	Leading from the road to a carport on the southern side of the house
Material:	Concrete

Path(s)

Location:	Western side of house
Material:	Concrete

Fencing

Location:	North eastern and south side
Material:	Timber posts and rails, Timber paling, varies between, 1.5m, 2.2m

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

EXTERNAL CLADDING

Cladding Name: Fibre cement weatherboards

Cladding description:	Wood grain textured fiber cement weatherboards direct fixed to timber framing, with concealed soakers to the joints and metal flashings to the exterior corners. Timber scriber is around joinery units
Cladding location:	Perimeter of house

Fibre cement Weatherboards

Fibre cement is a durable and resilient material, it still requires ongoing care to ensure it performs to its capability. Things like ensuring a good paint cover and that it is not held in direct contact with the ground or damp materials like exposed timber. These products can often contain synthetic fibres and/or Asbestos depending on their age.

Over recent years we have come to realise that any areas that are in contact with or have little ground clearance less than 50mm, the material can suffer from gradual deterioration and sometimes moisture can be transferred into the home. This can occur around the ground, roofs or areas like decks that are attached to the structure. It is recommended to remove ground away from these areas, things like strip drains can be fitted to concrete or areas were the ground cannot be lowered, flashings area also a good method to protect these areas.

EXTERNAL JOINERY

Some elements of any flashing systems are concealed due to the nature of their installation and position. We cannot advise of concealed elements, and in some cases, we may not be able to visually see them at all.

Type of Joinery : Single glazed, Aluminium

Joinery component	Material/Type
Head Flashing	Aluminium with 15 degrees of fool and a 17 millimeter turndown
Sill Flashing	Not visible as concealed
Glazing Type	*Glazing noted will be found under the **'Rooms and ancillary spaces'** section of this report*
Joinery edge seals	Timber scriber
Other notes	N/A

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

ROOF AND ROOF COMPONENTS

Roofing Type: Factory finished long run roofing

Roofing component	Material/Type
Roofing fixings	Tek Screws with rubber washer
Roof flashings	Factory finished steel
Roof penetration flashings	Rubber boot
Roof or Gutter membrane	Metal concealed guttering
Other notes	Concealed gutter and fascia systems really came onto the market in the 90s and where developed to hide the spouting (internal gutter) behind a fascia to create a clean visual line. There are about 5 or 6 systems found today. The system was popular on new builds for some time, but the system comes with some inherent design faults- • Overflows or leaks can occur that can in some circumstances lead to water getting inside the house or rotting the soffit framing. • The fascia is also prone to rusting on the bottom lip of the fascia due to the angle that its on reducing the natural effect of the rain washing the fascia. • Hidden leaks are hard to detect until visible damage is found or noticed There are several recommendations to follow with these systems • Keep the gutter clean and clear annually and check for leaks • HPPI will check the presence of overflow prevention pipes that in most cases are a part of the system • Inspect the gutter and the underside of the soffit annually to make sure any leaks are picked up early.

Corrugated Iron Roofing, Factory Finished Steel Roofing, Pressed Metal Tile Roofing,
When inspecting this type of roofing material, we will also consider its design features as methods have changed in recent times due to failure in the durability of some older features.
We will check the condition of the laps and the joints
With newly painted surfaces or indeed when looking at options of re-coating, careful surface preparation, the application of rust treatment, and a good quality paint system can prolong the life of a metal roof. It is common to see older roofs in poor shape that have had a new coating roughly coated over underlying issues meaning wear and tear may damage the roof faster than we would expect.
It is important to keep metal and all roofing materials clean and free of growth like moss, mould and lichen as these can affect the performance and speed up deterioration.
Another important issue is 'electrolysis' that can be caused by incompatible metals, basically a lesser metal will corrode or sacrifice itself when in contact with each other. (refer to E2as1- table 20 for details) or discuss with a qualified roofer.
Surfaces should be manually washed with water and a sponge or a soft nylon bristled brush. For large areas, it may be more appropriate to use water blasting at pressures up to 20Mpa.

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

SPECIAL ROOF COMPONENTS

Roofing component	Material/Type
Soffits/Eaves	Fibre cement sheet
Gable Ends	N/A
Parapets	N/A
Dorma Roofs	N/A
Fascia	Factory coated steel
Spouting	Metal, Concealed gutter system
Downpipes	uPVC
Concealed gutter system	Yes-refer to https://www.buildmagazine.org.nz/index.php/articles/show/concealed-guttering
Internal gutter system	N/A
Overflow prevention present	Yes adequate

INTERNAL ROOF CAVITY & INSULATION

Roof cavity accessibility	No access to the roof cavity was available as the panel was secured shut with screws.
Roofing materials	Unable to access
Underlay and support or sarking	Unable to access
Special features or defects	Unable to access
Plumbing materials and visible defects *(secured, signs of leaks?)*	Unable to access
Electrical materials and visible defects	Unable to access
Roof space insulation type	Unable to access
Roof space insulation *R-Rating*	Unable to access

* 'R' stands for resistance – an R-value is a measure of how well insulation resists heat flow.

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

Rooms and Ancillary Spaces

It is important to consider that vacant homes that have not had plumbing systems used for some time may present with no moisture issues due to the non-use.

Name of Room : Kitchen

Item/Area	Material/type
Cabinetry	Under bench cabinetry, Overhead cabinetry, -MDF
Benchtop	Laminated
Walls	Plasterboard
Floor Covering	Tiles
Ceilings	Plasterboard
Doors (Internal)	Hollow core, Timber jambs/revels
External Joinery and glazing	Aluminium sliding window, single glazed with standard glass, no windows security, facing West
Under-Sink Materials	SINK- stainless steel, WASTE PIPES-, uPvc, WATER PIPES-, Stainless steel flexi pipe, DISHWASHER PLUMBING-, Rubber pipes
Extraction system	Turbo
Dishwasher	Vogue.-Not tested
Oven	Unknown.-Not tested
Hobbs/Cooktop	Electric.-Not tested

Name of Room : Laundry

Item/Area	Material/type
Cabinetry	Supper-tub fitted
Benchtop	No bench top fitted
Walls	Plasterboard
Floor Covering	Tiles
Ceilings	Plasterboard
Doors (Internal)	Hollow core, Timber jambs/revels
External Joinery and glazing	Aluminium door with an opening window to the left, single glazed with the standard glass, no window or door security, facing West
Under-Sink Materials	SINK- stainless steel, WASTE PIPES-, uPvc, WATER PIPES-, Stainless steel flexi pipe, WASHING MACHINE PLUMBING-, Plastic pipes
Extraction system	N/A

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

Name of Room: Bathroom

Item/Area	Material/type
Shower	Acrylic Liner, Acrylic tray, Slide rail set up, Pivoting, Glass door, shower pressure good
Vanity	Wall hung unit, MDF Cabinetry, Acrylic top, No Overflow in Sink, WASTE PIPE-, uPvc, WATER PIPES-, Stainless steel flexi pipe
Bath	Acrylic bath
Toilet	Separate toilet, Dual Flush, cannot confirm trap type as concealed
External Joinery and glazing	Aluminum single glazed opaque glass, no visible safety stamp and no windows stays installed, this is a safety concern . Hinged at the top and facing West.
Air Extractor System	Ceiling light and fan unit
Floor coverings	Tiles
Internal doors	Hollow core, Timber jambs/revels
Ceiling lining	Plasterboard
Wall lining	Plasterboard, Tiles

Acrylic showers

It is a common issue with this shower type for the lower external corners to bleed or leak moisture. In the early stages the moisture is localised to within 50mm of the shower edge and on the bathroom side of the wall only- at this stage we would recommend consultation with a registered plumber to re-seal the shower surround. This will involve removing the surround, cleaning the old silicon off and re-fitting the surround.

If the moisture has spread outside this 50mm zone we would be expecting some internal mould inside the wall and damage to the Wall board and trims and minor floor damage for particle board floors- this may require some repair to the wall and trims and possibly replacement of the wall liner.

If moisture has spread through the wall or there are clear signs of mould on the outside of the wall we would expect repairs that would require the shower to be replaced.

For these concerns/defects' consultation with a registered plumber and/or licenced builder will be required.

- It is important to consider the age of the fittings and fixtures as we expect a high risk of failure with fittings over 10 years old
- It is not advised to have the internal wall liner and surround silicon sealed on the inside! The outside edges should be sealed but not the inside as this will trap moisture and can cause mould and leaking.

The expected life of an acrylic shower 10-15 years

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

South east bedroom

Item/Area	Material/type
Ceiling lining	Plasterboard, Scotia is, timber
Wall lining	Plasterboard, Trims are, Timber
External Joinery and Glazing	Aluminium single glazed window with one opening sash at the right, standard glass, window stays installed, facing East
Internal doors	Hollow core, Timber jambs/revels
Wardrobe/Cupboard description	Double doors, steel hanging rail with timber shelf, Unable to fully access as full of contents
Floor coverings	Carpet
Other notes	N/A

South western bedroom

Item/Area	Material/type
Ceiling lining	Plasterboard, Scotia is, timber
Wall lining	Plasterboard, Trims are, Timber
External Joinery and Glazing	Aluminum single glazed window with one opening sash at the right, standard glass, window stays installed, facing West
Internal doors	Hollow core, Timber jambs/revels
Wardrobe/Cupboard description	Single door, steel hanging rail with timber shelf, Unable to fully access as full of contents
Floor coverings	Carpet
Other notes	N/A

North eastern bedroom

Item/Area	Material/type
Ceiling lining	Plasterboard, Scotia is, timber
Wall lining	Plasterboard, Trims are, Timber
External Joinery and Glazing	Aluminium single glazed window with one opening sash at the right, standard glass, window stays installed, facing East
Internal doors	Hollow core, Timber jambs/revels
Wardrobe/Cupboard description	Single door, steel hanging rail with timber shelf, Unable to fully access as full of contents
Floor coverings	Carpet
Other notes	N/A

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

Lounge

Item/Area	Material/type
Ceiling lining	Plasterboard, Scotia is, timber
Wall lining	Plasterboard, Trims are, Timber
External Joinery and Glazing	Two Aluminium single glazed window with one opening sash at the right, standard glass window stays installed, facing East and North Two Aluminium ranch sliders, single glazed with standard glass, one facing North and one facing West
Internal doors	Hollow core, Timber jambs/revels
Wardrobe/Cupboard description	N/A
Floor coverings	Carpet
Other notes	N/A

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

SERVICES

Hot Water System

We have inspected the hot water system for any visible issues only. Not tested its operation.

Type of hot water system :	Electric cylinder, Mains pressure, 180
Location :	Laundry

Other Systems

These systems have not been tested for their operation.

Area/System	Type/Materials	Location
Meter box	Metal box	Eastern side of house
Fuse box	Plastic box	Laundry
Fire/smoke alarms:	Plastic surface mounted systems, Battery powered	Hallway and bedrooms
Ventilation System :	N/A	
Heating Systems	Heat Pump, Panasonic	Lounge 3.5kw
Central Vacuum:	N/A	
Security System:	Yes, Alarm system, Cameras noted	Entry way
Gas Services	N/A	
Water services	Metered Mains Water	
Foul water disposal	Mains Sewerage Connection	
Grey water recycling systems	N/A Not located, consult council documents, the agent, or vendor for further details	
Solar heating	N/A	
Shading systems	N/A	
Other systems	None noted	
Telecommunications systems	Not inspected	
Aerials and Antennae	Not Inspected	

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

RECOMMENDATIONS & GENERAL COMMENTS

Contact local authority and uplift L.I.M. report.
Also check council records to ensure all work has been approved.
Refer to BRANZ maintaining my home website for further information on caring for your home.
https://www.maintainingmyhome.org.nz/maintenance-guides/

The New Zealand Building Code recognizes that building maintenance is an important feature in achieving the minimum durability requirements in the building code. It is the responsibility of the building/homeowner to maintain the building or dwelling to the required standard in the building code.
It is important that the building/homeowner(s), acquaint themselves with the standard maintenance requirements and the various manufacturers products maintenance requirements applicable to this building/dwelling. HPPI ltd does not take any responsibility for the accuracy or completeness of the above maintenance requirements or any failure of the building/homeowner to carry out the required maintenance. This is the responsibility of the building/homeowner.

REFERENCE SITES BASED ON AGE OF CONSTRUCTION

Bungalow
https://www.renovate.org.nz/bungalow/
Villa
https://www.renovate.org.nz/villa/
1940'S-1960'S
https://www.renovate.org.nz/1940-60s/
Art Deco
https://www.renovate.org.nz/art-deco/
1970's
https://www.renovate.org.nz/1970s/
1980-1990
https://www.maintainingmyhome.org.nz/maintenance-guides/building-periods/1980s/
1991-2004
https://www.maintainingmyhome.org.nz/maintenance-guides/building-periods/1990s-to-present/

Abbreviations

m meter
mm millimetre
OSH Occupational Safety and health
uPVC Unplasticized polyvinyl chloride
WC water closet
LPB Licenced building practitioner
StructE Structural engineer
TA- Territorial authority
DBH-Department of building and housing

SAMPLE

HOUSE PRE-PURCHASE INSPECTIONS

Definitions

Accessory unit(s)- (as defined by the Unit titles Act). Any area with a specified purpose, which does not comprise part of the dwelling unit footprint, but is intended to be used in conjunction with the unit. *(Note- costs may be the exclusive responsibility of the owner(s) of the dwelling(s) whose title(s) records their interest in the accessory unit. Such units might be a garage, carport, carpark, deck, garden, implement shed, landing, service area or access way*)

Ancillary spaces and buildings- Any area, usually with a specified purpose, which does not comprise part of the dwelling unit footprint

Building Consent or Consent- Local council or territorial authority building consent and resource consent sets out building and construction details and regulations.

Dux-Quest plumbing pipe- was a failed plumbing pipe withdrawn from the market in the 1980's. It is known to have issues with leaking, in most cases these leaks are hidden and difficult to detect. It is common for insurers to remove cover from properties that have more than one leak with this pipe until it is replaced but this is only in some cases.

Further investigation- When a concern has been detected or signs of a concealed issue are realised, HPPI will advise of further investigation required. This may require the employment of a specialist or require HPPI to undertake further investigations outside of the scope of a pre-purchase inspection completed to NZS4306-2005. Any further investigation will inquire added fees.

Invasive investigations-After a HPPI non-invasive inspection, there may be areas of concern that require further invasive investigation to determine any possible hidden damage. Invasive investigations can range from obtaining a true direct moisture content of the internal frame, to opening up of an area to view concealed areas or to a recommendation of a full weathertightness survey of a home.

Minor fault or defect is described as- A matter, in view of the age, type or condition of the building, does not require substantial repairs or urgent attention and rectification and which could be attended to during normal maintenance.

Non-Invasive Inspection- Non-invasive inspection means we can only advise on items and areas in clear line of sight. We cannot move contents or fixtures (cabinetry, beds, house etc) or any building material or product (insulation plastic sheet etc). We may open doors and access hatches only if they are not fixed shut in any way (locked, painted shut, screwed shut etc)

property inspection- The purpose of the property inspection is to identify significant defects and maintenance visible at the time of the inspection.

Property bag file- A property file provides documents not included in a LIM report, such as: Building and resource consent documents and any correspondence with us about the property. A property file does not replace a LIM report and you should get it in addition to a LIM report. The contents of the file depend on the work done on the property that the TA are aware of. If building work does not have a consent, it won't be in the file.

Significant Fault or Defect- is defined in the Standards as – "A matter which requires substantial repairs or urgent attention and rectification.

Significant Fault or Defect- will be addressed in the summary section of the report as maintenance or remedial work.

Special purpose property report- is a report outside the scope of a pre purchase inspection that may require specialist contractors, for example; a plumbing report, electrical report, stormwater drainage report, Sanitary drainage report, Gas report etc

The Building Act 2004- sets out the rules for the construction, alteration, demolition, and maintenance of new and existing **buildings** in New Zealand. It aims to improve control, encourage better design and construction, and provide greater assurance for consumers.

SAMPLE

Weathertightness risk-Factors in a buildings design and materials can increase or mitigate its risk factors regarding the buildings performance around keeping the building weathertight. The ministry of business innovation and employment have created a document to use as a guide by designers and builders to help in assessing the weathertightness risk of low rise, timber framed buildings using the 'risk matrix in Acceptable solution E2/AS1 (clause E2 External moisture). In a pre-purchase inspection it is not a requirement to measure a home against the risk matrix but we will provide details regarding a buildings weathertightness risk factors and also any mitigating attributes as a part of the NZS4306-2005 standard.

Weathertightness survey- A specialised report carried out on at risk homes. HPPI will undertake a non-invasive inspection and may recommend a weathertightness survey! A weathertightness survey may use several different methods to determine – Is the building leaking? Where does it leak and why? What damage has been caused by the leaks? Where and why might it leak in the future? What damage is likely to be caused in the future? What remediation work is recommended? And in some cases- What is the estimated cost for the recommended remediation? This is a specialist report currently not undertaken by HPPI. HPPI can help by providing a list of suitably qualified weathertightness specialists if required.

SAMPLE