END OF WELL REPORT

AZADEGAN OIL FIELD

END OF WELL REPORT

AZNS – 116 (PAD #81), TYPE: IIIF

Drilling Department

JUNE 2025

MSA/OEOC			
	Position	**Name**	**Date & Signature**
Prepared by	Drilling Engineering Department	M.H.Haji Taleb	
Approved by	Project Head of Drilling Engineering	Masoud Babakhani	
	Project Head of Drilling Operation	Piran Farzaneh	
	Project Manager	Rashid Ansari	
PPL			
	Position	**Name**	**Date & Signature**
Check & Approved by	Drilling Operation Manager	Majid Nariman	
	Subsurface Engineering Manager	Mahdi Salim Mehr	
	Head of Drilling Engineering	Soheil Shadizadeh	
	Subsurface Project Manager	Ali Maghzi	

TABLE OF CONTENTS

1. General Information *7*
1.1 Field Introduction 7
1.2 AZNS-116 Well Location Map 8
2. Well History *9*
2.1 Well Informaion 9
2.2 AZNS-116 Well History 10
26" Hole Section 10
17 – 1/2" Hole Section 10
12 – 1/4" Hole Section 11
8 – 1/2" Hole Section 14
Dry Test 15
Plug & Suspension 17
Work-Over#01 17
DST – TCP: 1st TCP Run 18
DST – TCP: 2nd TCP Run 19
WCP: 1st WCP Run 20
WCP: 2nd WCP Run 20
WCP: 3rd WCP Run 21
WCP: 4th WCP Run 21
1st Time Completion Running 22
2nd Time Completion Running 24
3rd Time Completion Running 27
4th Time Completion Running 29
Work-Over#02 31
2.3 Summary of Workover Operation 33
Workover Summary: 33
Wireline Logging Operation Summary: 52
Milling Operation Summary: 52
Perforation Operation Summary: 57
4 – 1/2" Tie-back Operation Summary: 60
Completion Operation Summary: 62
٢,٤ AZNS-116 Well Sketch 67
2.5 Bit Record Table 68
2.6 Hole Problem History 69
3. Time Analysis Report *70*
3.1 Time vs. Depth Chart 70
3.2 Total Time Break-Down of Operation 71
WorkOver Section 71
Completion Section 72
3.3 NPT Break-Down 73
4. Geological & Logging Reports *80*
4.1 Logging and Testing Reports 80
5. Bottom Hole Assembly Record *81*
6. Casing Information *104*

.۷ Cement Job Report 105
8. Completion Report 106
8.1 Completion Tubing Information 106
8.2 Completion Tools Specification Checklist 106
8.3 Assembling Test Report 110
8.4 Completion Operation Checklist 128
8.5 Completion Sketch & Tally 132
8.6 Completion String Pressure Test 142
9. Wellhead Report 144
9.1 Final Well Status 144
9.2 Wellhead & X-mass tree Specification 145
9.3 Wellhead Schematic 147
9.4 X-mass Tree Specification (Section D) 148
9.5 X-mass Tree Pressure Test Report (Section D – befor install) 149
9.6 X-mass Tree Pressure Test Report (Section D – after install) 149
9.7 Wellhead Related Test Reports 151
10. Drilling Fluid Information 157
10.1 Interval Remark 157
Operation Remark 157
Drilling Fluid Remark 158
10.2 Drilling Fluid type 159
10.3 Material Consumption Analysis 160
10.4 Volume Analysis 162
10.5 Daily volume Breakdown 163
10.6 Loss Distribution 167
10.7 Interval Fluid Properties Recap 171
10.8 Solid Control Disscusion 174
10.9 Inhibited $CaBr_2$ Brine 175
11. Waste Management Service 176
11.1 Well & Hole Section 176
11.2 Operation's Recap 177
12. List of Contractors 189
13. Appendix 190
13.1 DDR Summary 190
14. Comments & Revision 211

LIST OF TABLES

TABLE 2-1: AZNS-116 WORKOVER WELL INFORMATION 9
TABLE 2-2: AZNS-١١٦ CASING HISTORY 32
TABLE 2-3: AZNS-١١٦ WORKOVER INFORMATION 33
TABLE 3-1: AZNS-116 WORKOVER TIME BREAKDOWN 71
TABLE 3-2: AZNS-116 COMPLETION TIME BREAKDOWN 72
TABLE 3-3: AZNS-116 NPT TIME BREAKDOWN 79
TABLE 4-1: AZNS-116 LOGGING INFORMATION 80
TABLE 6-1: AZNS-116 FINAL CASING DATA 104
TABLE 8-1: AZNS-116 TUBING DATA 106
TABLE 8-2: AZNS-116 EQUIPMENT CHECKLIST 108
TABLE 8-3: AZNS-116 EQUIPMENT CHECKLIST 109
TABLE 8-4: AZNS-116 OPERATION CHECKLIST 131
TABLE 8-5: AZNS-116 COMPLETION TALLY 141
TABLE 9-1: AZNS-116 FINAL WELL STATUS 144
TABLE 9-2: AZNS-116 EQUIPMENT SPECIFICATION 146
TABLE 9-3: AZNS-116 SECTION "D" SPECIFICATION 148
TABLE 9-4: AZNS-116 SECTION "D" TEST REPORT BEFOR INSTALLATION 149
TABLE 9-5: AZNS-116 SECTION "D" TEST REPORT AFTER INSTALLATION 150
TABLE 10-1: AZNS-116 FLUID PROPERTIES RECAP TABLE 159
TABLE 10-2: AZNS-116 MATERIAL CONSUMPTION ANALYSIS TABLE 160
TABLE 10-3: AZNS-116 VOLUME ANALYSIS TABLE 162
TABLE 10-4: AZNS-116 DAILY VOLUME BREAK DOWN TABLE 165
TABLE 10-5: AZNS-116 LOSS DISTRIBUTION 169
TABLE 10-6: AZNS-116 FLUID PROPERTIES RECAP 173
TABLE 10-7: AZNS-116 SOLID CONTROL DESSCUSION 174
TABLE 10-8: AZNS-116 INHIBITED $CaBr_2$ BRINE 175
TABLE 11-1: AZNS-116 FIXATION RECAP TABLE 179
TABLE 11-2: AZNS-116 FIXATION ANALYSIS TABLE 182
TABLE 11-3: AZNS-116 DEWATERING RECAP TABLE 184
TABLE 11-4: AZNS-116 DEWATERING ANALYSIS TABLE 187
TABLE 11-5: AZNS-116 CHEMICAL TABLE 188
TABLE 12-1: AZNS-116 CONTRACTORS INVOLVED 189
TABLE 13-1: AZNS-116 DAILY DRILLING REPORT SUMMARY 210

LIST OF FIGURES

FIGURE 1-1: AZNS OILFIELD LOCATION MAP 7
FIGURE 1-2: AZNS-116 WELL LOCATION MAP 8
FIGURE 2-1: AZNS-116 WELL SKETCH 67
FIGURE 3-1: AZNS-116 NPT BREAK-DOWN CHART 73
FIGURE 8-1: AZNS-116 ASSEMBLING & TEST REPORT 127
FIGURE 8-2: AZNS-116 COMPLETION SKETCH 132
FIGURE 8-3: AZNS-116 SETTING PACKER, ANNULUS & FINAL COMPLETION STRING PRESSURE TEST 142
FIGURE 8-4: AZNS-116 COMPLETION STRING & TRSSSV PRESSURE TEST GRAPH 143
FIGURE 9-1: AZNS-116 WELLHEAD SKETCH 147
FIGURE 9-2: AZNS-116 X-MASS TREE BODY PRESSURE TEST GRAPH BEFORE INSTALLATION 153
FIGURE 9-3: AZNS-116 X-MASS TREE BODY PRESSURE TEST GRAPH AFTER INSTALLATION 154
FIGURE 9-4: AZNS-116 WELLHEAD MOM BEFOR INSTALLATION 155
FIGURE 9-5: AZNS-116 WELLHEAD MOM AFTER INSTALLATION 156
FIGURE 10-1: AZNS-116 MUD CHEMICAL USAGE 161
FIGURE 10-2: AZNS-116 EFFECTIVE CONCENTRATION 161
FIGURE 10-3: AZNS-116 VOLUME ANALYSIS CHART 162
FIGURE 10-4: AZNS-116 DAILY VOLUME BREAK DOWN CHART 166
FIGURE 10-5: AZNS-116 LOSS ANALYSIS 170
FIGURE 11-1: AZNS-116 FIXATION RECAP 179
FIGURE 11-2: AZNS-116 DEWATERING RECAP 184

1. General Information

1.1 Field Introduction

Azadegan South Oil Field is situated in West Karoun, Khuzestan province on a large long – axis anticline with N – S trending with approximate dimensions about 20^{km} width and 60^{km} length near to Iran – Iraq border, It is located in The Northwest of The YADAVARAN Field and in The West of JUFEYR Field. The Average Monthly Temperature is 45$^{°c}$ in summer and Highest Temperature is 52$^{°c}$. The Lowest Temperature is -4.4$^{°c}$ in winter. Maximum Rainfall is 78^{mm} in February, Winter Season.

The trap area of the south Azadegan is limited to 43.2x17.2km. The Azadegan Oil field was discovered in 1999, when Well AZN-1 was drilled vertically down to the Cretaceous Fahliyan Formation with total depth of 4,643m. The results of this well, revealed the reservoir characteristics of the field. Following to the result of the well no. AZN-1, another 5 exploration wells was drilled in different parts of this huge field down to Fahliyan Formation. In the later stage the well No.10 assumed as exploration well for evaluation of deeper formations. This well was drilled in 2008, down to the depth of 5340m (Neyriz Fm.), mainly to evaluate the Jurassic formations.

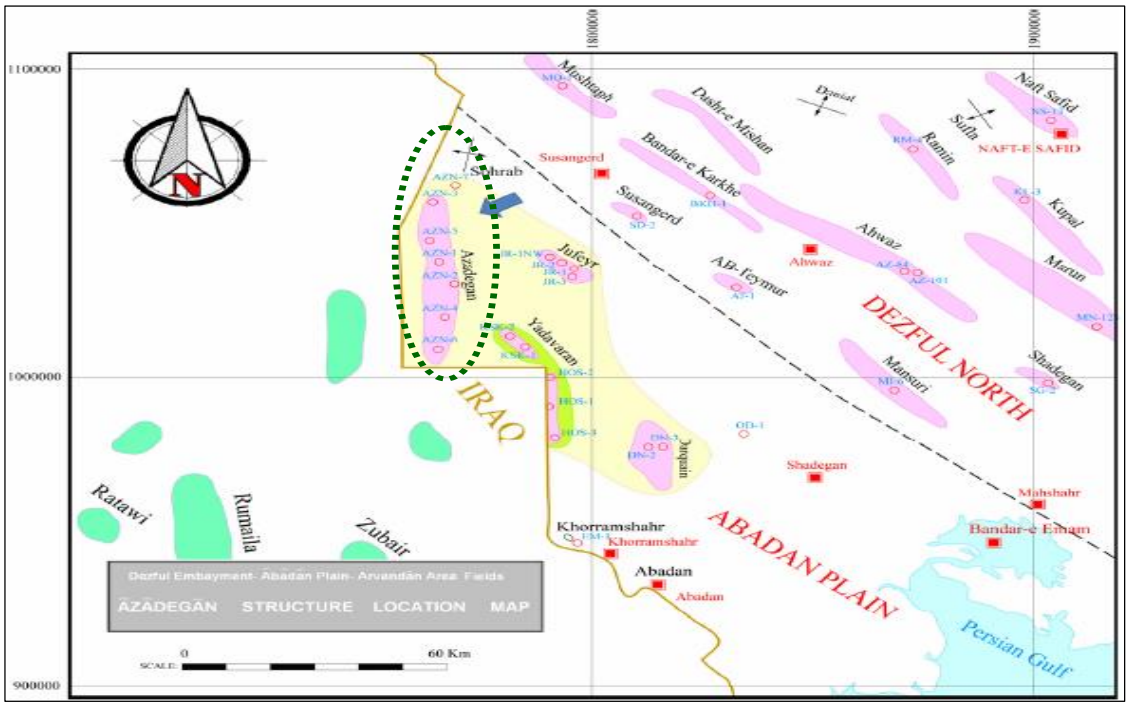


Figure 1-1: AZNS Oilfield Location Map

1.2 AZNS-116 Well Location Map

This well is located on "Pad – 81" of South Azadegan Oil field in Block-III.

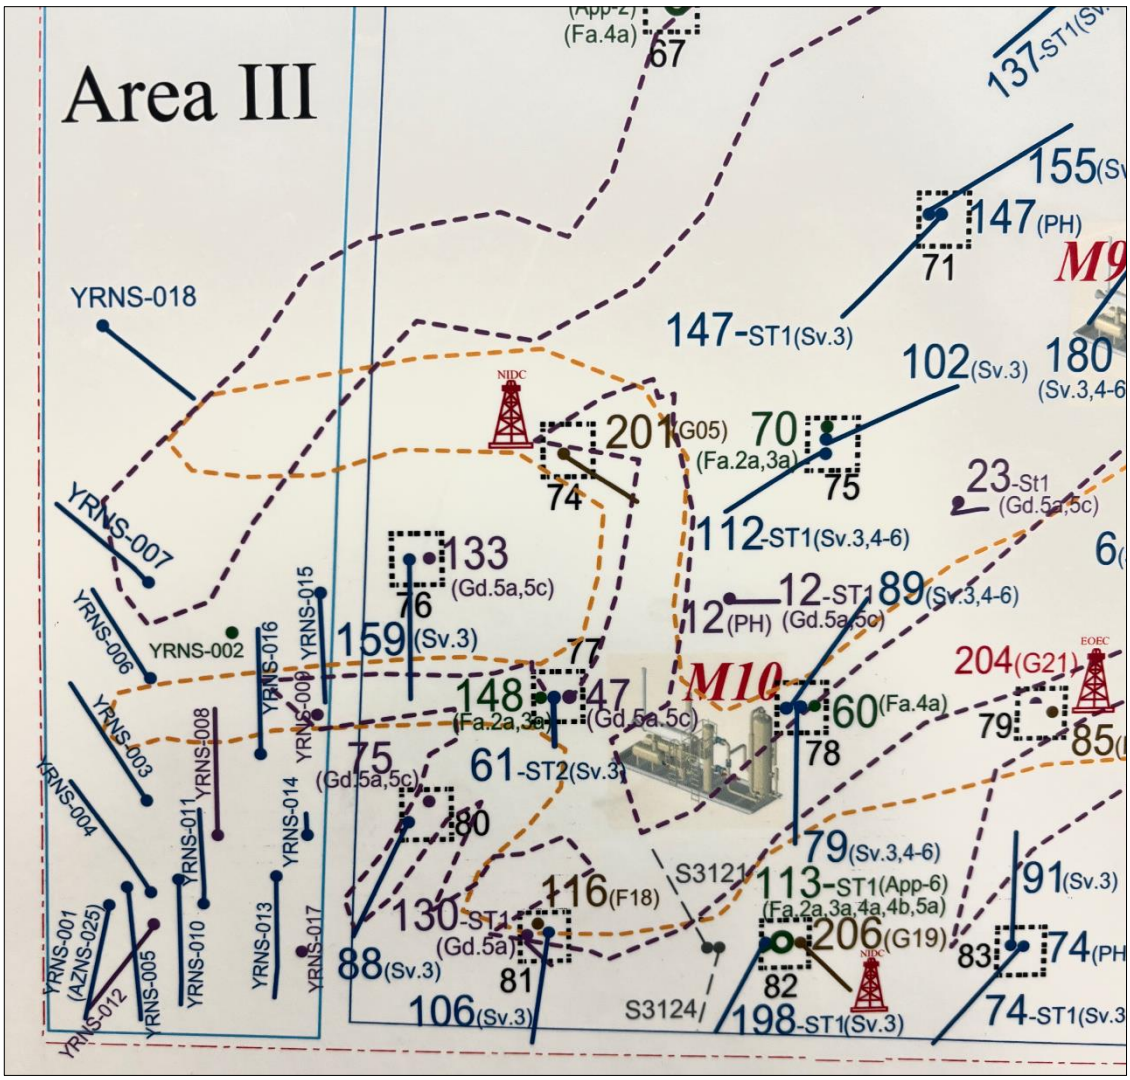


Figure 1-2: AZNS-116 Well Location Map

2. Well History

2.1 Well Informaion

Rig name	OEOC 201	Owner	PEDEC/PPL
Rig type	Land Rig 2000HP	Contractor	MSA/OEOC
Well Name	AZNS – 116	Management Contractor	MSA
Well Type	Vertical IIIF	Field	South Azadegan
Completion Type	4-1/2" * 3-1/2" 10K	RTE	12.65
Actual TD	4150^{m}	GLE	3.95
Surface Coordinate		N: 3,443,999 – E: 187,374	
TD Coordinate		N: 3,434,988.61 – E: 187,364.61	
Drilling & Suspension		Completion	
Spud Date	07/06/2024	Spud Date	24/09/2024
Released Date	02/10/2024	Released Date	02/10/2024
End of Drilling	-	End of Drilling	-
Rig Days Actual/Plan	116.5 / 89	Rig Days Actual/Plan	-

Size (in)	Shoe Depth (mMD)	Specification
20	146	K – 55, 94^{ppf}, BTC
13 – 3/8	2033	N – 80, 68^{ppf}, BTC
9 – 5/8	3884.5	T – 95, 53.5^{ppf}, TSH
7	3802 – 4150	110S, 29^{ppf}, TPCQ
4 – 1/2 P.L	3896 – 3966	T – 95, 15.2^{ppf}, TPCQ
4 – 1/2 P.L	3966 – 4089	T – 95, 13.5^{ppf}, Tenaris

Table 2-1: AZNS-116 Workover Well Information

2.2 AZNS-116 Well History

26" Hole Section

Rig 304 was ready to spud on 1395/04/11 but due to unavailability of 26" hole equipment rig spud was postponed to 1395/04/14.

Rig 304 was spudded on 1395/04/14 at 12:00 &drilling 26" hole section commenced to TD at 150^{m} while bit balled up was experienced several times & ran totco at 70^{m} & 140^{m} which both survey result showed inclination of 0 degree.

Then ran 12 joints 20" casing, 94^{ppf} K – 55, BTC, Nippon steel, Japan (shoe: 94^{ppf}, K-55, BTC, stab in type, Kherad Sanat) to 146^{m} & cemented by stinger without any major problem. installed 20 – 3/4" 3k CHH (MSP DRILEX) with 2 number 2 – 1/16" 5k gate valve on left & right side & set casing slips as well & injected plastic packing & tested the same with 400^{psi}, Ok.

After nipple up BOP (21 – 1/4" – 2k drilling spool & 21 – 1/4" double rams (top & blind rams, 21 – 1/4" 2k annular preventer) & BOP test, ran in hole with 17 – 1/2" rock bit & drilled out hard cement & shoe to 150^{m} while working on junk sub several times.

17 – 1/2" Hole Section

17 – 1/2" hole section was started on 1395/04/18 & drilling commenced from 150^{m} to 170^{m} while working on junk sub several times. (Recovered 4^{lbs} junk)

Drilling of 17 – 1/2" hole section was continued from 170 to 1327^{m} while at 340^{m} displaced hole with 70^{pcf} PHPA mud & also due to increase losses from 4 to 15^{bph} at 1275^{m} & 1298^{m} pumped 30^{bbl} 20^{ppb} hi-vis LCM pill (10^{ppb} mica+10^{ppb} walnut), losses decreased to 4 – 5BPH & continued drilling 17 – 1/2" hole section from 1327^{m} to 1535^{m}, due to increase losses from 5 to 90BPH, stopped drilling & pumped 30^{ppb} hi-vis LCM pill (15^{ppb} mica+15^{ppb} walnut) in several stage (totally pumped 100^{bbl} LCM pill), losses decreased from 90 to 60BPH. Continued slow circulation & pumped 30^{bbl} 30^{ppb} hi-vis LCM pill (15^{ppb} mica+15^{ppb} walnut) in two stages (totally pumped 160^{bbl} LCM pill) with 60BPH loss. Then Spotted 50^{bbl} 40^{ppb} hi-vis LCM pill (20^{ppb} mica+20^{ppb} walnut) & pulled out from 1535 to 1480^{m} while slowing circulation through string. Losses decreased from 60 to 5^{bph}.

Continued drilling 17 – 1/2" hole size section from 1535 to 1990^{m} with 10 – 2BPH losses while pumped 30^{ppb} hi-vis LCM pill (15^{ppb} mica+15^{ppb} walnut) periodically. (At 1966^{m} Due to increasing of Ca++ from 800 to 1300$^{mg/l}$ increased Mw from 77.5 to 81^{pcf}).

Continued drilling 17 – 1/2" hole section from 1990^{m} to 13 – 3/8" casing shoe at 2034^{m} w/ 3 – 4BPH loss. After condition trip RIH with wire line CDR/GR logging tool string to 2020^{m} (14^{m} off bottom) & logged up from 2020^{m} to 146^{m} & continued POOH to surface & laid down tools.

After 12 days waiting on receiving 13 – 3/8" casing performed condition trip & ran 13 – 3/8" as following:

- Casing 13 – 3/8" float shoe 68^{ppf}, N-80, BTC
- 2 joints 13 – 3/8" casing 68^{ppf}, N-80, BTC
- 13 – 3/8" float collar 68^{ppf}, N-80, BTC
- 178 joints 13 – 3/8" casing 68^{ppf}, N-80, BTC TO 35

As cement job, pumped 40bbl chemical wash, 80bbl 85pcf spacer & mixed & pumped 246sxs cement class G" Delijan (SW: 85pcf, SV: 150bbl) as pre-flush, mixed & pumped 3762sxs cement class "G" Delijan (SW: 98pcf, SV: 1471bbl) as lead cement, mixed & pumped 741sxs cement class "G" delijan (SW:118pcf, SV:181bbl) as tail cement. Dropped top plug (Kherad Sanat Ariya), displaced with 987bbl mud & bumped plug with 1500psi & kept for 15min as CIT. during cement job got 700bbl slurry cement on surface & recorded totally 250bbl loss.

RIH with 12 – 1/4" R. bit & 8 – 1/2" Junk sub & tagged top of cement at 1990m. Commenced drill out from 1990 to 2028m while D/O float collar at 2009m & worked on junk sub several times. Continued D/O hard cement & 13 – 3/8" casing shoe at 2034m.

12 – 1/4" Hole Section

Drilling of 12 – 1/4" hole section started on 8/23/2016 (1395/06/02) & drilled from 2034 to 2044^{m}, to change BHA & cement bond logging POOH to surface & L/D 8 – 1/2" junk sub, recovered: 3.5^{lb} junk.

RIH with CBL/VDL/CCL/GR logging tool string to 2027^{m} (6^{m} above shoe) & logged up to 136^{m}, POOH to surface.

Resumed drilling 12 – 1/4" hole section from 2044 to 2251^{m} with 2 – 3BPH loss while continuously pumped 30^{bbl} hi-vis pill to sweep hole. At 2251^{m} mud loss increased to 70BPH, reduced pumping flow rate & spotted totally 100^{bbl} 10^{ppb} hi-vis LCM pill, loss decreased to 15BPH.

Continued drilling 12 – 1/4" hole size section to 2303[m] & again due to increase loss from 10 to 50BPH in interval of 2255[m] to 2274[m], pumped 15[ppb] hi-vis LCM pill several times. Loss decreased from 50 to 15BPH. Cut mud weight from 80 to 79[pcf] & loss decreased from 15 to 5BPH.

Continued drilling 12 – 1/4" hole section from 2303 to 2364[m], while pumping 30[bbl] hi vis pill periodically w/3-5BPH loss & experienced high & abnormal torque. Ran Gyro to 2335[m] & took surveyed (depth: 2335[m], dev.:1.11degree, azimuth: 170.8 degree) & at 2135[m] (dev.:0.42 degree, azimuth: 330 degree).

POOH to surface & RIH with new bit & junk sub & resumed drilling 12 – 1/4" hole with 2364[m] to 2375[m] w/2 – 3BPH loss while worked on junk sub several times. POOH to surface.

RIH with same used bit & resumed drilling 12 – 1/4" hole size section from 2375[m] to 2385[m], due to low ROP POOH to surface & due to unavailability of 12 – 1/4" PDC bit, RIH with 12" used PDC bit & 8" PDM to bottom at 2385[m] & commenced performance drilling as 12" hole size from 2385 to 2648[m] w/1 – 5BPH loss. Due to low progress POOH to surface & RIH with used 12 – 1/4" b. bit.

Enlarged 12" hole to 12 – 1/4" size from 2385[m] to 2648[m] & resumed drilling 12 – 1/4" hole to 2817[m]. Due to torque fluctuation & low ROP POOH to surface while ran Gyro at 2780[m] (well deviation: 0.23 deg, azimuth: 106.4 deg).

RIH with new 12 – 1/4" PDC bit & resumed drilling from 2817[m] to 3200[m] while pumping hi-vis pill periodically w/3 – 4BPH loss. Performed condition trip, RIH to bottom at 3200[m] & ran Gyro 7 took survey each 100[m]. (3100[m], incl.: 0.99 deg, azimuth: 178.10 deg-3000[m], incl.: 1.04 deg, azimuth: 153.40 deg-2900[m], incl.: 1.15deg, 166.70 deg-2800[m], incl.: 0.95deg, azimuth:181 deg- 2700[m], incl. :1.82 deg, azimuth: 201 deg-2600[m], incl.:1.40 deg, azimuth:212 deg-2500[m], incl.: 1.44 deg, azimuth:179 deg-2400[m], incl.: 0.44 deg, azimuth:222.5 deg).

Continued drilling 12 – 1/4" hole from 3200 to 3490.5[m] w/3 – 6BPH loss. At 3490[m] pressure decreased from 2750 to 2400[psi], checked surface equipment-ok & decided to POOH to check string. At surface observed 8 – 1/2" DC twisted off from 10[cm] under box (left in hole:12 – 1/4" b. bit, 8 – 1/2" b. sub, 1 joint 8 – 1/2" DC).

RIH with 11 – 3/4" overshot (assembled with 8 – 3/4" mill control & 8 – 1/2" basket grapple), string got stuck at 2043[m], worked on stuck several with max over pull 120[klb] & jarring up, string got free, POOH to surface 7 laid down overshot, RIH with 12 – 1/4" bit to condition hole. POOH to Surface, RIH with 10 – 1/8" over shot (assembled with 8

– 5/8" control & 8 – 1/2" spiral), engaged fish &d POOH to 3477^{m} with tight hole, string got stuck, worked on stuck pipe with applying 100^{klb} over pull & jarring up several times while pumping salt saturated water (caustic pill) & hi-vis pill, string got free, POOH to surface, recovered the fish completely. RIH with 12 – 1/4" PDC bit to 2055^{m} & continued RIH with hard W&R to 2907^{m}, due to full gauge size of 12 – 1/4" string stabilizer & inability to continue RIH, POOH to change string stabilizer to surface & L/D 12 – 1/4" string stabilizer.

RIH with 12 – 1/4" PDC bit to bottom at 3490.5^{m} & resumed drilling 12 – 1/4" hole from 3490.5 to 3669^{m} w/3 – 6BPH loss. Continued drilling from 3669 to 3671^{m} while due to increase loss from 3 to 30BPH, pumped 15^{ppb} hi-vis LCM pill (mica & wall nut) in 2 stage, loss decreased to 6 – 8BPH.

Continued drilling 12 – 1/4" hole from 3671 to 3730^{m} while increased mud weight from 82 to 84^{pcf} & continued drilling from 3730 to 3885^{m} (9 – 5/8" casing shoe) w/6 – 4BPH loss. POOH to surface.

Ran full suite logging tool string (first run, MSFL/DAL/DLL/CDR/GR) to bottom at 3885^{m}, logged up from 3885 to 2033^{m} (13 – 3/8" casing shoe), & continued POOH with logging tools to surface. To condition hole prior to second logging, RIH with 12 – 1/4" PDC bit to bottom while increasing mud weight from 84 to 85^{pcf}. POOH to surface.

Run full suite logging tool string (second run, CNT/ZDL/NGS) to 3300^{m}, due to missed signal from TCS tools, POOH to surface & change TCS tools, RIH bottom at 3885^{m}, logged up from 3885 to 3400^{m} while circulating cross well head w/1 – 2BPH loss. Again recorded resistivity log data as client request from 3885 to 2033^{m}.

Rigged up full suite logging tool string (third run, MSFL/DLL/GR) to 2000^{m}. Due to GR failure, POOH to surface, changed GR tools & RIH with same logging tool string to bottom at 3885^{m}, logged up from 3885 to 2033^{m} (13 – 3/8" casing shoe), continued POOH with logging tools to surface, L/D logging tool string.

After 26 days wait on receiving 9 – 5/8" casing, ran 9 – 5/8" Casing as following:

- 9 – 5/8" F. shoe (Nasr Mobtakeran, 53.5#, T95, TSH)
- 3 joints 9 – 5/8" casing 53.5#, T-95, TSH blue as shoe track
- 9 – 5/8" F. Collar (Nasr Mobtakeran, 53.5#, T-95, TSH)
- 341 joints 9 – 5/8" Casing 53.5#, T-95, TSH blue

Pumped 36[bbl] pre-flush & 10[bbl] 85[pcf] spacer, mixed & pumped 2465[sxs] cement" G" delijan with cenosphere (slurry volume:1033[bbl], slurry weight:92[pcf]) as lead & mixed & pumped 312[sxs] cement" G" delijan with o-silica flour (slurry volume:100[bbl], slurry weight:110 – 118[pcf]) as tail (due to pump truck failure, pumped 16[bbl] less than program), dropped top plug (Nasr Mobtakeran Co.), bumped plug w/3000[psi] for 15min, Ok. While after displaced 702[bbl] got cement slurry on surface (dumped 151[bbl] slurry cement on surface) & totally recorded 21[bbl] loss & 40[bbl] contaminated cement, checked back flow, Ok. RIH with 8 – 1/2" bit to 3848[m] & D/O plugs & float collar at 3848[m] & hard cement to 3881[m], displaced hole with 100[pcf] mud 7 continued D/O hard cement, shoe track 7 shoe to 3885[m] (float shoe at 3882[m]) while worked on junk sub several times.

8 – 1/2" Hole Section

Commenced drilling 8 – 1/2" hole section from 3885 to 3888[m], performed FIT by applying 620[psi] (EMW: 107[pcf]) pressure step by step & hold for 15min, Ok. POOH to surface & recovered 1[lb] junk. RIH with 9 – 5/8" casing scrapper & scraped from 3760 to 3881[m], POOH to surface & rigged up logging equipment.

Ran SBT/VDL/CCL/GR logging tool string to 3885[m], logged up from 3885 to 2025[m] (8[m] above casing shoe 13 – 3/8") & continued POOH to surface. RIH with 8 – 1/2" bit &continued drilling to TD at 4150[m] while experienced no major drilling problems on this hole section.

Condition hole prior logging, POOH to surface, RIH with run 1[st] full suite log as: MSFL/DDL/SONIC/CALIPER/CDR/GR tool string to bottom at 4150[m] with good hole condition, logged up from 4150[m] to 9 – 5/8" casing shoe at 3882[m] & continued POOH from 3882[m] to surface.

Ran 2[nd] full suite log as: ZDL/CNT/SLT tool string to 3890[m] (8[m] below show), string held up at 3890[m], tried to pass this point several times, no success, POOH to 3887[m], tool string stuck at 3887[m], worked on stuck with 1500[lb] overpull, string got free, continued POOH from 3887[m] to surface.

RIH with 8 – 1/2" bit & condition hole prior run 7" liner, ran 347[m] 7" liner as:

- 7" float shoe 29[ppf], 110S, TPCQ (Pars Poolad Aghaei Co.)
- 2 joints 7" liner 29[ppf], 110S, TPCQ
- 7" float collar 29[ppf], 110s, TPCQ (Pars Poolad Aghaei Co.)
- 1 joint 7" liner 29[ppf], 110s, TPCQ

- 7" LDC 29^{ppf}, 110s, TPCQ (Pars Poolad Aghaei Co.)
- 27 joint 7" liner 29^{ppf}, 110s, TPCQ
- 7" Hydraulic liner hanger 29^{ppf}, 110S, TPCQ (Pars Poolad Aghaei Co.)
- POB, 29^{ppf}, 110S (Pars Poolad Aghaei Co.)
- Tie back sleeve (Pars Poolad Aghaei Co., ID: 7 – 3/8")


Circulated btm's up, observed hydrocarbon on shakers & got cut Mw from 105 to 98^{pcf} & 150^{bbl} contaminated mud. Continued circulation & balanced mud at 105^{pcf}. Set hydraulic liner hanger, release setting tool. L/U cement line & pumped 9^{bbl} pre-flush & 7^{bbl} 85^{pcf} spacer, mixed & pumped 169^{sxs} cement class "G" Delijan with silica flour (slurry weight: 118^{pcf}, slurry volume: 53^{bbl}), dropped pump down plug, displaced w/259^{bbl} 105^{pcf} mud, Obs. shearing after 221^{bbl} w/1600^{psi} & bumped plug w/3000^{psi} for 15min, Ok, released pressure, checked back flow, Ok.

POOH to surface, RIH with 8 – 1/2" bit to 3695^{m}, tagged cement with 20^{klb} & 350gpm, Ok, D/O medium to hard cement from 3695 to 3802^{m} while confirming 7" liner lap at 3802^{m}. POOH to surface, P/U & M/U 6 – 1/8" bit 7 RIH to 4090^{m}, tagged cement with 20^{klb} & 350gpm, Ok. POOH to surface while performing pressure test against 7" liner lap at 3700^{m} w/2000^{psi} for 15min, Ok. RIH with 9 – 5/8" scraper & scraped from 3650 to 3800^{m}. POOH to surface.

Dry Test

RIH with dry test tools while filling up string with water cushion as per program (KCl mud, 85^{pcf}) to 3770^{m}. Tried to set packer at 3770^{m} several times, no success. POOH to 3760^{m}, revers circulated & got 205^{bbl} 85^{pcf} mud, POOH to surface & L/D 9 – 5/8" dry test tools, worked on dry test packer. RIH with same dry test tools to packer depth at 3780^{m} while filling up 3557^{m} of string w/85^{pcf} KCl mud as per program to 3785^{m}.

Set packer at 3780^{m}, opened hyd. spring valve for 3hrs, no bubble observed on surface & monitored annulus, static, closed DCIP for 6hrs meanwhile observed the annuls, static. Dropped bar & shear reveres sub, revers circulated, got 207^{bbl} 197^{bbl} 85^{pcf} KCl mud & 10^{bbl} 75^{pcf} hi-vis pill, circulated & balanced mud weight at 105^{pcf}, unset packer & observed well, static. POOH to surface & L/D test tools.

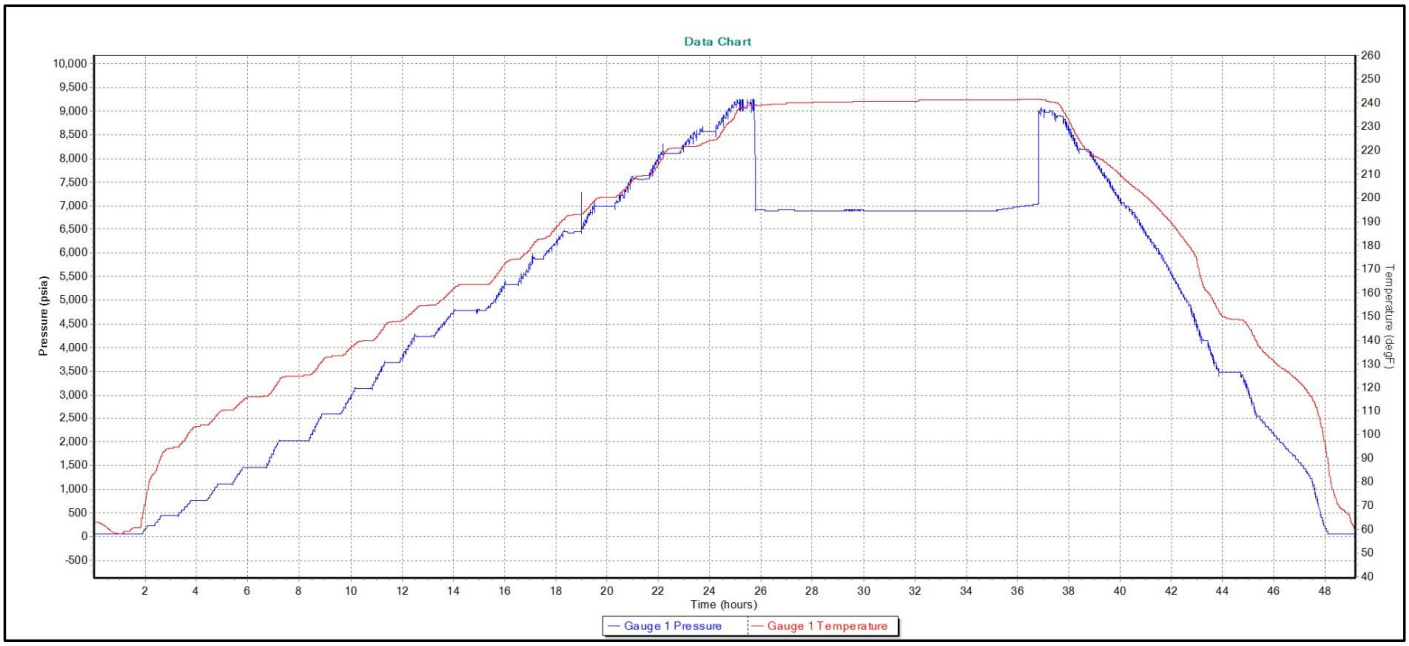

Oil Exploration Operations Company MDST RTTS Report		TDDC
Job: DRY TEST	Region:	Operation Date: 2016/12/12
Filed: AZAS	Well: 116	Rig: TODC 304

Set Packer Depth:		Water Cushion:	
Middle B.T. Depth:		Bottom B.T. Depth:	

Row	Discription	Buttom Bt.	Middle Bt.	Comment
1	Initial Mud Static Pressure	۹۱۰۵	۹۱۰۴	
2	Initial Flow Pressure	۴۹۰۹	۴۹۰۸	
3	Final Flow Pressure	۴۸۹۹	۴۸۹۴	
4	Close Pressure	۷۰۳۵	۷۰۳۴	
5	Final Hydrostatic Pressure	۹۰۴۷	۹۰۴۹	

Plug & Suspension

Due to unavailability of completion string decided to plug back 7 temporarily suspend well AZNS-116. To set 1st cement plug RIH w/open ended DPs to top of cement at 4090m. Added 0.5% volume corrosion inhibitor & 0.5% volume bio side to mud system & adjust PH on 10.5. Then pumped 7bbl salt saturated mud ahead as spacer, mixed & pump 75sxs cement class "G" delijan (slurry weight.:118pcf, slurry volume: 24bbl), pumped 0.9bbl salt saturated mud as behind spacer then displaced w/192bbl mud as balance plug, after 15 hrs wait on cement RIH & tagged cement at 3434m, washed down to 3440m, & tagged hard cement with 450gpm & 20klb, POOH to 3400m, performed pressure test against cement plug w/2000psi for 20min, Ok, POOH from 3400 to 2030m.

At 2030m to set 2nd cement plug, L/U cement line & pumped 7bbl salt saturated mud ahead as spacer, mixed & pump 99sxs cement class "G" delijan (SW: 118pcf, SV: 24bbl), pumped 1bbl salt saturated mud as behind spacer then displaced w/99bbl mud as balance plug, after 15hrs wait on cement, RIH & tagged soft cement at 1948m, washed down & tagged hard cement at 1949m with 450gpm & 20klb. POOH to surface while performing pressure test against 2nd cement plug w/2000psi for 20min, Ok at 1890m.

N/D 13 – 5/8" BOP stack, installed 11" 10,000psi blind flange (Pars Poolad Aghaei) & tested w/2000psi, Ok. Released rig on: 95/09/27 at 20:00.

Work-Over#01

Spudded rig 303 on 1396/08/02 at 00:00, ran in hole to 1951m, tagged upper cement plug, circulated mud & adjusted mud properties & mud weight to 105pcf, drilled out medium to hard cement plug from 1951m to 2018m, washed down from 2018m to 2040m, pumped 30bbl hi-vis pill, circulated mud & adjusted mud properties & mud weight to 105pcf, observed the well – static, continued run in hole to top of second cement plug at 3440m, circulated mud & adjusted mud weight to 105pcf, drilled out medium cement from 3440 to 3472m, washed down from 3472 to 3560m, continued drill out medium to hard cement from 3560 to 3790m while pumped hi-vis pill periodically with NL-NG, continued run in hole to 7” liner lap at 3804m, pumped 30bbl hi-vis pill & circulated & uniform mud properties & adjusted mud weight to 105pcf with NL-NG, suddenly pressure decreased from 1860 to 1420psi.

Pulled out to surface, ran in hole with 7” scraper to top of cement at 4090m while scraped 7" liner, circulated mud & increased mud weight from 105 to 106pcf, spot 35bbl 84pcf $CaCl_2$ at bottom to 7" liner lap, observed the well – static, pulled out to surface & laid down DPs.

To run cement evaluation log of 9 – 5/8" Casing, rigged up Sealand logging equipment & ran in hole with CCL/GR/SBT/VDL logging tool string to 1^{m} above top of Cement at 4089^{m}, logged up from 4089^{m} to 3770^{m}, pulled out to surface & laid down logging tools, ran in hole with NGS logging tool string to 1^{m} above top of cement at 4089^{m}, logged up from 4089 to 3750^{m}, pulled out to surface & rigged down logging equipment.

DST – TCP: 1st TCP Run

After 70hrs wait on receive Explosive, loaded 7 No. 4 – 1/2" HMX TCP guns, totally 10m, 72 degree phasing & 5SPF, arranged to perforate from 4001 to 3991m, ran in hole with DST – TCP string to 4003.75m (bull nose depth) while filled up string with 80pcf CaCl2 as cushion & passed drift & pressure tested at 90m, 1000m, 2000m & 3000m with 6000psi, Ok, rigged up logging equipment & to correlate depth, ran GR/CCL tool string to 3923m, confirmed RA marker depth. Pulled out to surface & laid down equipment, space out, installed flow head & connected to chock manifold & pressure tested same with 6000psi, Ok, by 6 right turn & applying 20klb weight set packer 3952.87m.To perform perforation job, closed the well, applied 1800psi pressure into annulus to open TTV, bleed off pressure to 1000psi, fired guns by applying 7000psi pressure in string several times, no success, to check string & function test of TTV & POTV, unset packer, closed the well & applied 2000psi pressure in annulus, no pressure indication inside string on chock manifold, closed the well & applied 2000psi pressure in annulus, no pressure indication inside string on chock manifold, bleed off pressure & again applied 2200psi pressure in annulus, suddenly string pressure increased to 3300psi & detected indication that POTV became opened, bleed off annulus pressure to zero & opened the well, set packer, applied 1000psi in annulus while observed inside string pressure constant at 3300psi, increased annulus pressure to 2000psi, to fire guns applied 8000psi pressure in string, no success, released annulus pressure to zero, opened the well, unset packer, by opening chock manifold valve tried to release string pressure, no success, set packer, again tried to release string pressure, no success & detected indication that AORV (secondary reversing valve) in open position, closed the well & to balance mud weight reverse circulated with Max 500psi pressure from annulus meanwhile got 200bbl 80pcf CaCl2 & dumped 40bbl contaminated mud, opened the well, unset packer with Max 35klb over pull, laid down flow head & observed the well – static.

Pulled out with TCP – DST to 50^{m} meanwhile checked tools, observed primary circulation valve in closed position, tubing fill test valve in opened position, pressure operated tester valve in opened position, function tested the same, Ok, secondary tester valve in opened positon, checked fire head & observed all pins sheared & first cord on blank gun was operated led to bullets misfired. Due to misfired guns, waited on daylight while slow circulated with NL- NG. Pulled out with TCP – DST string from 50^{m} to

surface, all fire head pins sheared & first cord on blank gun was operated & blank gun detonator cord on gun #5 was disconnected from booster, retrieved all bullets & detonator cord.

DST – TCP: 2nd TCP Run

Loaded 7 No. 4 – 1/2" HMX TCP guns, totally 10^{m}, 72 degree phasing & 5SPF arranged to perforate from 4001 to 3991^{m}, ran in hole with TCP – DST string to 3942^{m} while filled up string with 80^{pcf} $CaCl_2$ as cushion & passed drift & pressure tested at 90^{m}, 1000^{m}, 2000^{m} & 3000^{m} with 6000^{psi}, Ok, at 3942^{m} observed shock & vibration on string (no drag was experienced) & string weight increased from 210^{klb} to 330^{klb} on weight indicator, continued run in hole with 20^{klb} drag down to 3950^{m}, tried to continue run in hole, observed 50^{klb} drag, attempted to pull out with Max 30^{klb} over pull, suddenly observed u – tub from annulus to inside string, monitored string pressure – constant at 2300^{psi}, closed the well & reverse circulated with Max 1000^{psi} pressure from annulus & applied 300^{psi} as back pressure from choke manifold, could not balance mud weight due to shortage of mud on surface & got 147^{bbl} $CaCl_2$ as return & dumped 160^{bbl} contaminated mud, opened the well & observed well – static, to check string & equipment pulled out with TCP – DST from 3950^{m} to surface, checked equipment, MRCV in close position, TTV in open position & AORV in close position, FIS in open position, all 14 pins of fire head sheared & guns fired completely.

Rigged up logging equipment & to check perforation interval ran in hole with multi finger Caliper/GR/CCL tool string to 3932^{m}, tool string held up, tried to pass, no success, logged up from 3932 to 3700^{m}, pulled out wire line to surface.

To check 3932^{m} (the point of logging tool string held up) ran in hole with 6" Metal muncher junk mill to 3932^{m}, circulated mud, ran in hole with soft ream from 3932 to 3970^{m} while checked interval stand by stand at several time – found no obstruction, continued run in hole to 4090^{m}, circulated mud, spotted $CaCl_2$ from 4090^{m} to 7" liner lap at 3802^{m} & observed the well – static.

Pulled out to surface, rigged up logging equipment to check & confirm perforated interval ran in hole with multi finger Caliper/GR/CCL to 3700^{m}, tool string held up & tried to pass several times, no success, pulled out to surface & observed finger probe failure, again ran in hole with same logging tool string to 3700^{m}, tool string held up & tried to pass several times, no success, pulled out to surface & again found finger probe failed, for 4th time ran in hole with GR/CCL logging tool string to 4050^{m}, logged up from 4050 to 3850^{m}, continued pull out to surface & laid down logging tools.

NOTE:

4th log result showed wrong interval was perforated by TCP, the confirmed perforated depth: 3930m – 3940m.

To double check perforated interval ran in hole with GR/CCL to 3700m, tool string held up & tried to pass several times, no success, pulled out to surface. Ran in hole with 6 – 1/8" b. bit & 7" scrape to 3930m meanwhile scrape inside 9 – 5/8" casing & 7" liner, pulled out to surface. To re – check perforation interval ran MTT/GR to 4050m, logged up from 4050 to 3880m, pulled out with wire line to surface & laid down logging tools. Ran in hole with 6" Metal muncher junk mill to 7" liner lap at 3802m & circulated mud with NL-NG while wait on decision. Decided to perforate planned interval on WCP, ran in hole from 3770 to 4090m & spotted 45bbl 80pcf $CaCl_2$, observed the well – Static, pulled out to surface.

WCP: 1st WCP Run

Rigged up Asmari wireline equipment, ran in hole with 4 – 1/2" HMX gun, 6m, 83 charge, 72-degree phasing, 5SPF arranged to perforate from 4001 to 3996m with CCL to 4030m while correlated depth at 7" liner lap & correlated perforation interval, fired guns, checked perforation interval with CCL, confirmed perforated interval as plan, 4001 – 3996m, pulled out to surface, all 83 No. bullets were fired.

WCP: 2nd WCP Run

Rigged up Asmari wireline equipment, ran in hole with 4 – 1/2" HMX gun, 6m, 83 No. bullet, 72-degree phasing, 5SPF arranged to perforate from 3996 to 3991m with CCL to 3996m while correlated depth at 7" liner lap & correlated perforation interval, fired guns, pulled out to surface, all 83 No. bullets were fired.

To check perforated depth ran in hole with MTT logging tool string to 4030m, logged up from 4030 to 3880m, ran back to 4030m, logged up from 4030 to 3880m, pulled out to surface.

NOTE:
As per MTT log result & interpretation, wrong interval 3913.5 to 3918.5m was perforated, the planned interval was from 3996 to 3991m.

WCP: 3rd WCP Run

To perforate planned interval ran in hole with 4 – 1/2" HMX gun, 6m, 83 No. bullet, 72 degree phasing, 5SPF arranged to perforate from 3996 to 3991m & CCL to 7" liner lap 3810m, CCL showed noise, tool string held up, after several attempts passed the point, ran in hole to 3818m, tool string held up, tried to pass several times, No success, pulled out to surface, laid down perforation tools, rigged down Asmari wireline equipment, ran in hole with 6" junk mill & 7" Scraper to 4050m while scraped from liner lap at 3802 to 3910m several times, pulled out to 3780m & waited on receive perforation head to rig site meanwhile circulated mud with 0 – 1bph loss, ran in hole to 4050m while scraped 3802 to 3910m, spotted 42bbl 80pcf $CaCl_2$, observed the well – static, pulled out to surface.

WCP: 4th WCP Run

Rigged up Asmari wireline equipment, ran in hole with 4 – 1/2" HMX gun, 6m, 83 bullets, 72degree phasing, 5SPF with CCL to 3996m, correlated depth at 7" liner lap & at planned perforation interval at 3991 – 3996m, fired guns, logged up to 3779m & confirmed perforated interval with CCL successfully as per plan from 3996 to 3991m, pull out to surface, check tools & all bullets fired completely.

To check perforated interval, ran in hole with MTT/GR to 3890m, due to missed signal check tools pulled out to surface, changed Telemetry & ran in hole to top of perforated interval at 3990m, tool string held up, tried to pass – No success, tried to pass the point – No success, logged up from 3990 to 3770m, pulled out to surface.

To clean out inside liner ran in hole with 4 – 1/8" Metal muncher junk mill to 4010m while dressed 3991 to 3995m with Max 2 – 4klb weight, Ok, circulated bottoms up, pulled out to 3780m, circulated mud meanwhile waited on receive DHPG, ran back to 4010m, pumped 80pcf $CaCl_2$ as spacer ahead, displaced inside 7" liner with $CaBr_2$ as completion fluid with 0 – 1bph loss ($CaBr_2$ from 4010 to 3890m & $CaCl_2$ from 3890 to 3700m), pulled out from 4010 to 3890m, displaced hole with $CaBr_2$ as completion fluid till got net completion fluid. As return, totally pumped 927bbl, loss 25bbl & dumped 30bbl contaminated fluid, circulated with completion fluid to balance in & out weight at 106pcf meanwhile added O_2 scavenger & inhibitor to system.

Pulled out from 2200 to 700m, observed the well – 0.1bph gain, closed the well & monitored pressure for 1.5hrs – zero, opened the well & continued pull out to surface. Waited on receive DHPG while rack back 10 stands 3 – 1/2" tubing & 47 stands 4 – 1/2" tubing, ran in hole with 4 – 1/8" Metal muncher junk mill to 3900m while filled up string with 105pcf completion fluid, observed the well – 0.1bph gain, circulated completion fluid & got return with 101 – 105& weight.

Waited on receive DHPG while continued circulation with completion fluid meanwhile added O2 scavenger & balanced in & out weight at 105pcf, observed the well – 0.1bph gain. To run completion pulled out from 1450m to surface while laid down 262 joint 5" DPs with 0.1bph gain (oil lubricated to surface).

1st Time Completion Running

Rigged up Completion running equipment, ran completion string as per program as below:

- 3 – 1/2" mule shoe 10.2^{ppf}, L – 80, HSM-1, weiqixin
- 1 joint 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM-1
- 3 – 1/2" bottom No-Go landing nipple 10.2^{ppf}, L – 80, HSM-1, Seal bore: 2.562", type: XN, weiqixin , without plug inside
- 3 – 1/2" pup joint 10.2^{ppf}, L – 80, HSM-1, 1 joint 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM-1, 3 – 1/2" pup joint 10.2^{ppf}, L – 80, HSM-1
- XOS 4 – 1/2" HSM pin X TPG2 box
- Mill out extension 18.9^{ppf}, TPG2, Super 13Cr – 110ksi7" hydraulic permanent production packer, model WSDP to be run in 7" 29 – 32^{ppf} casing, 13Cr – 110ksi, Anchor seal 18.9^{ppf}, TPG2, Super 13Cr – 110ksi, 3 – 1/2" pup joint 10.2^{ppf}, L – 80, HSM-1, 1 joint 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM-1 to 36^{m} with 0.1bph gain (oil lubricated to surface).

Rigged up OTS slickline equipment, ran 2.8” gauge ring, Ok. Continued run completion string as:

- 3 – 1/2" pup joint 10.2^{ppf}, L – 80, HSM-1, 3 – 1/2" sliding side door, 2.75" check valve plug inside in close position, type X, profile 2.750", 3 – 1/2" pup joint 10.2^{ppf}, L – 80, HSM-1
- 1 joint 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM-1
- 3 – 1 /2" pup joint 10.2^{ppf}, L – 80, HSM-1, 3 – 1/2" Expansion joint 10.2^{ppf}, L – 80, HSM-1 10^{ft} stroke, in fully open position dressed with 5 No. shear pin, 3 – 1/2" pup joint 10.2^{ppf}, L – 80, HSM-1
- 1 joint 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM-1 to 67^{m}.

Pressure tested completion string with 8000^{psi}, Ok, rigged up slickline equipment, ran 2.8" gauge ring, Ok, continued run completion string as:

- 3 – 1/2" pup joint 10.2^{ppf}, L – 80, Vam top box X HSM-1 pin, 3 – 1/2" DHPG 10.2^{ppf}, Super 13Cr – 110ksi Vam top, 3 – 1/2" pup joint 10.2^{ppf}, L – 80, Vam top box X HSM-1 pin to 72^{m} with 0.1bph gain (oil lubricated to surface).

Connected gauge to cable head, tested all connections, Ok, function tested, pressure tested & checked temperature, all Ok, set pressure gauge in place on gauge mandrel & tested connection, Ok, tested completion string with 8000psi for 15min, Ok, continued run completion string as:

- 1 joint 3 – 1/2" tubing, 10.2^{ppf}, L – 80, HSM-1
- 3 – 1/2" pup joint 10.2^{ppf}, L – 80, HSM-1, 3 – 1/2" CIV #1 on tubing retrievable chemical injection mandrel 10.2^{ppf}, HSM-1, Super 13Cr – 110ksi with dual check valve & rupture disk, weiqixin

Connected 3/8" control line, tested rupture disk with 2000psi, Ok, continued run completion string as:

- 3 – 1/2" pup joint 10.2^{ppf}, L – 80, HSM-1, 1 joint 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM-1, 3 – 1/2" pup joint 10.2^{ppf}, L - 80, HSM-1
- 3 – 1/2" CIV #2 on tubing retrievable chemical injection mandrel 10.2^{ppf}, HSM-1, Super 13Cr – 110ksi with dual check valve & rupture disk, weiqixin

Connected 3/8" control line, tested rupture disk with 2000psi, Ok, continued run completion string as:

- Ran 3 – 1/2" pup joint 10.2^{ppf}, L – 80, HSM-1, 1 joint 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM-1.

Tested completion string with 8000psi, Ok, rigged up slickline equipment, ran 2.8" gauge ring, Ok, & continued run completion string as:

- 29 joints 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM-1
- XOS 3 – 1/2" HSM-1 pin X 4 – 1/2" HSM-1 box

Tested completion string with 8000psi, Ok, rigged up slickline equipment, & ran 2.8" gauge ring, Ok, continued run completion string as:

- 72 joints 4 – 1/2" tubing, 18.9^{ppf}, L – 80, New Vam to 650^{m} while use cross coupling as per program with 0.1bph gain (oil lubricated to surface).

Tested completion string with 8000psi-ok, continued run completion string as:

- 169 joints 4 – 1/2" tubing, 18.9^{ppf}, L – 80, New Vam to 2000^{m}

Tested completion string with 8000psi, not Ok, rigged up slickline BOP, lubricator & pressure tested slickline BOP with 3000psi, Ok, ran in hole with pulling tools & retrieve 2.750" check valve, pulled out to surface, laid down BOP & lubricator.

Circulated through string & added O2 scavenger as per program with 0.1bph gain (oil lubricated to surface), rigged up slickline BOP, lubricator & pressure tested slickline BOP with 3000psi, Ok, ran in hole with 2.750" check valve & set it in SSD, pressure tested of completion string with 8000psi, not Ok, pulled out to surface, changed check valve & packing, ran again & set in SSD, pressure tested completion string with 8000psi, not Ok, pulled out to surface, ran in hole with 2.750" plug & tried to set SSD several times, no success, pulled out to surface, changed plug, ran in hole & set 2.750" plug in SSD, pulled out to surface, ran in hole with prong & set it in plug of SSD, pulled out to surface, pressure tested completion string with 8000psi, not Ok.

Pulled out from 2000 to 1100^{m} meanwhile pressure tested completion string at 1700^{m}, 1400^{m} & 1100^{m} with 8000^{psi}, not Ok. Rigged up slickline, retrieved plug & prong from SSD, laid down slickline, Pulled out from 1100^{m} to above 2nd CIV at 110^{m}, set check valve in SSD, pressure tested completion string with 8000^{psi}, not Ok, changed check valve packing & set again in SSD, pressure tested string with 8000^{psi}, not Ok, laid down CIV #2, pulled out to above 1st CIV at 80^{m}, pressure tested completion string with 8000^{psi}, not Ok, laid down 1st CIV, continued pull out to above expansion joint at 55^{m}, laid down DHPG, pressure tested above expansion joint with 3000^{psi} & observed leakage from top connection of expansion joint, laid down same.

2nd Time Completion Running

Changed 3 – 1/2" 10.2^{ppf}, L – 80, HSM-1 (10^{ft} stroke in full open position) expansion joint with new one & also changed above & below 3 – 1/2" 10.2^{ppf}, L – 80, HSM-1 pup joint, pressure tested with 8000^{psi}, Ok, rigged up slickline, ran 2.8" gauge ring, Ok & continued run completion string as:

- 1 joint 3 – 1/2" tubing, 10.2^{ppf}, L – 80, HSM-1

- 3 – 1/2" pup joint, 10.2^{ppf}, L – 80, Vam top box X HSM-1 pin, 3 – 1/2" DHPG, $^{10.2}$ppf, Super 13Cr – 110k, 3 – 1/2" pup joint, 10.2^{ppf}, L – 80, Vam top pin X HSM-1 box

Tested all connections, Ok, function tested, pressure tested & checked temperature, Ok, tested completion string with 8000psi, Ok, continued run completion string as:

- 1 joint 3 – 1/2" tubing, 10.2^{ppf}, L – 80, HSM-1
- 3 – 1/2" pup joint, 10.2^{ppf}, L – 80, HSM-1, 3 – 1/2" CIV #1, 10.2^{ppf}, HSM-1, Super 13Cr – 110ksi with dual check valve & rupture disk, weiqixin

Connected 3/8" control line, tested rupture disk with 2000psi, Ok, continued run completion string as:

- 3 – 1/2" pup joint 10.2^{ppf}, L – 80, HSM-1, 1 joint 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM-1
- 3 – 1/2" pup joint 10.2^{ppf}, L-80, HSM-1, 3 – 1/2" CIV #2, tubing receivable chemical injection mandrel, 10.2^{ppf}, HSM-1, Super 13Cr – 110ksi with dual check valve & rupture disk, weiqixin

Connected 3/8" control line, tested rupture disk with 2000psi, Ok, continued run completion string as:

- 3 – 1/2" pup joint 10.2^{ppf}, L – 80, HSM-1, 1 joint 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM1

Tested completion string with 8000psi, Ok, rigged up slickline equipment, ran 2.8" gauge ring, Ok, continued run completion string as with 0.1bph gain (oil lubricated to surface):

- 29 joints 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM-1, XOS 3 – 1/2" HSM-1 pin X 4 – 1/2" HSM-1 box

Tested completion string with 8000psi, Ok, rigged up slickline equipment, ran 2.8" gauge ring, Ok, continued run completion string as with 0.1bph gain (oil lubricated to surface):

- 111 joints 4 – 1/2" tubing, 18.9^{ppf}, L – 80, New Vam to 930^{m} while used cross coupling

Pressure tested completion string with 8000^{psi}, not Ok, rigged up slickline, ran in hole with pulling tools & retrieved 2.750" check valve, circulated through string to uniform completion fluid while added O_2 scavenger as per program.
Rigged up lubricator & ran in hole with 2.750" check valve, set it in SSD, pressure tested string with 8000^{psi}, Ok, continued run in hole from 2000^{m} as with 0.1bph gain (oil lubricated to surface):

- 109 joints 4 – 1/2" tubing, 18.9^{ppf}, L – 80, New Vam

Pressure tested completion string with 8000^{psi}, not Ok, rigged up slickline, ran in hole with pulling tools & tried to retrieve 2.750" check valve, no success, pulled out to surface, again ran in hole & after several attempts retrieved 2.750" check valve from SSD, pulled out to surface.

Ran in hole with 2.750" plug & set it in SSD, pulled out to surface, ran in hole with prong & set it in SSD plug, pulled out to surface & rigged down slickline, pressure tested completion string with 8000^{psi}, not Ok, rigged up slickline & lubricator, ran in hole & retrieved plug & prong from SSD in 2 runs, ran in hole with 2.750" check valve & set it in SSD, pulled out to surface, rigged down slickline equipment, pressure tested string with 7000^{psi}, not Ok, pulled out from 3000 to 2000^{m} meanwhile pressure tested string at 2500^{m} & 2000^{m} with 8000^{psi}, not Ok, rigged up slickline, ran in hole with pulling tools & retrieved 2.750" check valve from SSD, rigged up slickline equipment, pulled out from 2000^{m} to above CIV #2 110^{m}, rigged up slickline, set 2.750" check valve in SSD, pressure tested completion string with 8000^{psi}, not Ok, continued pull out to above expansion joint at 70^{m}. Laid down both CIV & DHPG, pressure tested completion string with 8000^{psi}, not Ok, observed leakage from expansion joint, laid down expansion joint, pulled out above SSD at 40^{m}, pressure tested with 8000^{psi}, Ok, continued pull out to surface, observed packer rubber element damaged.

Ran in hole with 15 joints 4 – 1/2” tubing to 145^{m} & circulated completion fluid with 0.1bph gain (oil lubricated to surface) while waited on receive new expansion joint.

3rd Time Completion Running

Ran completion string for 3rd time as below:

- 3 – 1/2" mule shoe 10.2ppf, L – 80, HSM-1
- 1 joint 3 – 1/2" tubing 10.2ppf, L – 80, HSM-1
- 3 – 1/2" bottom No-Go landing nipple 10.2ppf, L – 80, HSM-1, seal bore: 2.562", type: XN, without plug inside)
- 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1, 1 joint 3 – 1/2" tubing 10.2ppf, L – 80, HSM-1, 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1
- XOS 4 – 1/2" HSM-1 pin X TPG2 box
- Mill out extension 18.9ppf, TPG2, Super 13Cr – 110ksi
- 7" hydraulic permanent production packer, model: WSDP to be run in 7" 29 – 32ppf casing, 13Cr – 110ksi, anchor seal 18.9ppf, HSM-1, Super 13Cr – 110ksi
- 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1, 1 joint 3 – 1/2" tubing 10.2ppf, L – 80, HSM1
- 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1, 3 – 1/2" SSD, 2.750" check valve plug inside in & closed, type: X, profile: 2.750", 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1

Pressure tested with 8000psi, Ok, continued run string as:

- 1 joint 3 – 1/2" tubing 10.2ppf, L – 80, HSM-1, 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1, 3 – 1/2" expansion joint 10.2ppf, L – 80, HSM-1, 10ft stroke in fully open position with 4no shear pin 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1

Pressure tested with 8000psi, Ok, rigged up slickline equipment, ran 2.8” gauge ring, Ok, continued run string as:

- 1 joint 3 – 1/2" tubing 10.2ppf, L – 80, HSM-1
- 3 – 1/2" XOS 10.2ppf, L – 80, Vam top box X HSM-1 pin, 3 – 1/2" DHPG, 10.2ppf, Super 13Cr – 110ksi, Vam top, 3 – 1/2" pup joint 10.2ppf, L – 80, Vam top pin X HSM-1 box
- 1 joint 3 – 1/2" tubing, 10.2ppf, L – 80, HSM-1

- 3 – 1/2" pup joint 10.2^{ppf}, HSM-1, 3 – 1/2" CIV #1, 10.2^{ppf}, HSM-1, Super 13Cr – 110ksi with dual check valve & rupture disk, weiqixin

Connected 3/8" control line, tested rupture disk with 2000^{psi}, Ok, continued run completion string as:

- 3 – 1/2" pup joint, 10.2^{ppf}, HSM-1, 1 joint 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM-1
- 3 – 1/2" pup joint, 10.2^{ppf}, HSM-1, 3 – 1/2" CIV #2 10.2+, HSM-1, Super 13Cr – 110ksi with dual check valve & rupture disk, weiqixin

Connected 3/8" control line, tested rupture disk with 2000^{psi}, Ok, continued run with 3 – 1/2" pup joint, 10.2^{ppf}, HSM-1

Rigged up slickline equipment, ran gauge ring, Ok, continued run completion string as:

- 3 stands 3 – 1/2" tubing, 10.2^{ppf}, L – 80, HSM-1 to 180^{m} while used cross coupling as per program with 0.1bph lubricate, continued run completion string as:
- 7 stands 3 – 1/2" tubing 10.2^{ppf}, L – 80, HSM-1
- XOS 3 – 1/2" HSM-1 pin X 4 – 1/2" HSM-1 box
- 2 stand 4 – 1/2" tubing, 18.9^{ppf}, L – 80, New Vam to 450m with 0.1bph gain (oil lubricated to surface)

Pressure tested completion string with 8000^{psi}, not Ok, rigged up slickline 7 retrieved SSD check valve, redressed same, set check valve in SSD, pressure tested, not Ok, to check string pull out from 450^{m} to above CIV #2 at 100^{m}, pressure tested, not Ok, laid down CIV #2, continued pull out to above CIV #1 at 82^{m}, pressure tested with 8000^{psi}, observed leakage from check valve of CIV #1, laid down, waited on receive new CIV meanwhile pull out to above DHPG at 75^{m}, pressure tested completion string with 8000^{psi}, Ok, laid down same & pulled out to 65^{m} above expansion joint, pressure tested completion string with 8000^{psi}, Ok.

4th Time Completion Running

Received new CIV check valve, changed same, to check 7" hydraulic packer pulled out to 25m & checked same, ok meanwhile laid SSD. Continued run completion string as:

- 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1, 3 – 1/2" new sliding side door, 2.750" check valve plug inside in close position, type X, profile: 2.750", 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1 to 40m

Pressure tested with 8000psi, Ok, continued run as:

- 1 joint 3 – 1/2" tubing 10.2ppf, L – 80, HSM-1
- 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1, 3 – 1/2" expansion joint 10.2ppf, L – 80, HSM-1, 10ft stroke – in fully open position with 4no shear pin, 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1
- 1 joint 3 – 1/2" tubing 10.2ppf, L – 80, HSM-1
- 3 – 1/2" XOS 10.2ppf, L – 80, Vam top box X HSM-1 pin, 3 – 1/2" DHPG, 10.2ppf, Super 13Cr – 110ksi, Vam top, 3 – 1/2" pup joint 10.2ppf, L – 80, Vam top pin X HSM-1 box
- 1 joint 3 – 1/2" tubing, 10.2ppf, L – 80, HSM-1
- 3 – 1/2" pup jt. 10.2ppf, L – 80, HSM-1, 3 – 1/2" CIV #1, tubing retrievable chemical injection mandrel, 10.2ppf, HSM-1, Super 13Cr – 110ksi with dual check valve & rupture disk, weiqixin

Connected 3/8" control line, tested rupture disk with 2000psi, Ok, continued run completion string as:

- 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1, 1 joint 3 – 1/2" tubing 10.2ppf, L – 80, HSM1
- 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1, 3 – 1/2" CIV #2, tubing retrievable chemical injection mandrel 10.2ppf, L – 80, HSM-1, Super 13Cr – 110ksi with dual check valve & rupture disk, weiqixin

Connected 3/8" control line, tested rupture disk with 2000psi, Ok, continued run as:

- 3 – 1/2" pup joint 10.2ppf, L – 80, HSM-1, 1 joint 3 – 1/2" tubing 10.2ppf, L – 80, HSM1 to 106m with 0.1bph gain (oil lubricated to surface)
- Pressure tested completion string with 8000psi, Ok, rigged up slickline equipment, ran 2.8" gauge ring, Ok, continued run completion string as:

Pressure tested completion string with 8000psi, Ok, rigged up slickline equipment, ran 2.8" gauge ring, Ok, continued run completion string as:

- 29 joints 3 – 1/2" tubing, 10.2ppf, L – 80, HSM-1
- XOS 3 – 1/2" HSM-1 pin X 4 – 1/2" HSM-1 box

- 1 stand 4 – 1/2" tubing, 18.9^{ppf}, L – 80, New Vam to 406^{m}

Rigged up slickline equipment, ran 2.8" gauge ring, Ok, continued run as:

- 37 stands 4 – 1/2" tubing, 18.9^{ppf}, L – 80, New Vam to 1470^{m} while use cross coupling with 0.1bph gain (oil lubricated to surface).

Continued run completion string as:

- 31 stands 4 – 1/2" tubing, 18.9^{ppf}, L – 80, New Vam to 2350^{m}

Pressure tested completion string with 8000^{psi}, Ok, rigged up slickline equipment, ran 2.8 gauge ring, Ok, continued run completion string as:

- 156 joints 4 – 1/2" tubing, 18.9^{ppf}, L – 80, New Vam to 3300^{m} while use cross coupling with 0.1bph gain (oil lubricated to surface)

Pressure tested completion string with 8000^{psi}, Ok, continued run completion string as:

- 4 – 1/2" XOS New Vam pin X TPG2 box, 4 – 1/2" flow coupling 18.9^{ppf}, L – 80, TPG2, Super 13Cr – 110ksi, 4^{ft}, weiqixin
- 4 – 1/2" TRSSSV, tubing retrievable safety valve, 18.9^{ppf}, L – 80, TPG2 with 3.437" seal bore, Super 13Cr – 110ksi, weiqixin
- 4 – 1/2" flow coupling, 18.9^{ppf}, L – 80, TPG2 Super 13Cr – 110ksi, 6^{ft}, weiqixin
- 4 – 1/2" pup joint 18.9^{ppf}, L – 80, TPG2, 4 – 1/2" XOS TPG2 pin X 4 – 1/2" New Vam box to 3841^{m}

Connected 1/4" control line to TRSSV, tested control line with 10,000^{psi}, Ok, continued run completion string as:

- 4 joints 4 – 1/2" tubing 18.9^{ppf}, L – 80, New Vam to 3880^{m} while held 4000^{psi} pressure inside control line.
- XOS 4 – 1/2" New Vam pin X 4 – 1/2" TPG2 box
- 4 – 1/2" fluted swage double pin Vam top X TPG2
- Tubing hanger MSP 11" X 4 1/2" ACME box up X 4 1/2" Vam top box down
- XOS 4 – 1/2" ACME Pin X new Vam box to 3883^{m} with 0.1bph gain (oil lubricated to surface)

Tested completion string with 8000^{psi}, Ok & inflow tested while held pressure inside string, released control line pressure to zero, closed TRSSV, bleed off pressure above TRSSV to 500^{psi}, observed pressure

for 15min, constant, increased pressure inside string to 6000^{psi} (above flapper) then opened TRSSV flapper with 3700^{psi}, observed pressure inside pressure increased to 7000^{psi}, Ok, released pressure.

Connected 1/4" control line 7 2no 3/8" CIL & 1/4" DHPG line to tubing hanger, picked up 4 – 1/2" landing joint 18.9^{ppf}, L – 80, New Vam & 2no 4 – 1/2" pup joint New Vam, 18.9^{ppf}, L – 80 & ran in hole to 3894^{m}, touch THS, to space out picked up string as 1.5^{m}.

Rigged up slickline, as 1st run; installed 3.437" protection sleeve of TRSSV, as 2nd run; retrieved 2.750" check valve plug from SSD, as 3rd run; installed 2.560" plug & prong in No-Go, as 4th run; opened SSD by shifting tool.

Lined up pump truck to completion string increased press step by step to 4000^{psi}, set 7" hydraulic permanent production packer at 3870^{m}, pressure tested string with 8000^{psi}, Ok, over pull tested packer, Ok, landed tubing hanger in THS & slack off completely string weight while shear expansion joint pins (Expansion joint in closed position as 1.5^{m}), tighten tie down screws, closed rams & tested tubing hanger with 1000^{psi}, Ok, tested completion string with 8000^{psi}, Ok, rigged up slickline equipment, as 5th run: retrieved 2.560" prong from No-Go, retrieved 2.560 plug from No-Go landing nipple, tested annulus with 2000^{psi}, Ok, retrieved protection sleeve from TRSSV landing nipple, function tested TRSSV as open & close, Ok, back off landing joint, installed 2-way BPV, tested two way & tubing hanger body with 7500^{psi}, Ok, nipple down BOP stack, checked hanger neck, Ok, installed MSP bottom master valve, 11" X 4 – 1/16" 10k, feed control line, CIL & DHPG cable through X-mass tree, tested all P. seals, Ok, applied pressure inside control line & rupture disk & flushed same, function tested TRSSV as open & close, Ok. Nipple up 4 – 1/16" X 4 – 1/16" X 4 – 1/16" X 4 – 1/16" 10k MSP solid block, pressure tested X-mass tree with 7500^{psi}, Ok, removed 2-way BPV & installed one way, closed X-mass tree valves except bottom master valve.

Release rig 303 on 1396/10/16 at 06:00.

Work-Over#02

Spud Rig TDDC301 on 13/09/1398 at 10:30

after the end of well test & acidizing operation, it was reported that the annulus pressure has been raised up to maximum of 3960^{psi} & maximum recorded wellhead pressure was 3750^{psi}. After further investigations, it was decided to de-complete the well & re-complete the well with new completion string.

The well was de-complete, new completion string was running. Several rans tried to retrieve plug & prong from No-Go landing nipple, No success. It was tried to unload the well above plug with water & diesel to retrieve the plug, No success. Left on top of Plug: Fish#1 Include: 2.15" GS Pulling (39.15cm) + 2" XOS (30cm) + 2.125" KNUCKLE Jt. (28cm) + 1.678" HYD. Jar (173cm) + 2" XOS (20cm) + 2.125" HSM (32cm). Totally Length: 3.32 mt.

Coiled tubing was parted about 21^{m} above DIMPLE connector. Fish left in hole: 1st CT BHA (3.32^{m}) + 2nd CT BHA (4.35^{m}) + 21^{m} of coiled tubing. Totally about 28.5^{m}. TOF @3837.5^{m}. R/D coiled tubing. Fish #2: Include: 2" GS Pulling Hyd. Rel. (46cm) + 2 1/8" Hyd. Jar (207cm) + 2 1/8" Weight Bar (122cm) + MHA (60cm). Totally Length: 4.35 mt & 1.5 CTU Pipe (About 21.33 cm). Overall Fish Length: 29m. TOF: 3837.5m

Monitor WHP: 100^{psi}, annulus pressure, Zero. Perforated intervals are as following depths:

- 3930 – 3940^{m}
- 3996 – 4001^{m}
- 3913 – 3918.5^{m}

3996 – 3991^{m}Release rig 303 on 1400/03/04 at 24:00

Casing Spec.	20"	K – 55, 94^{ppf}, BTC	0 – 146^{m}
	13-3/8"	N – 80, 68^{ppf}, BTC	0 – 2033^{m}
	9-5/8"	T - 95, 53.5^{ppf}, TSH	0 – 388٤,٥^{m}
	7"	110S, 13.5^{ppf}, TPCQ	3802 – 4150^{m}
	4 – 1/2" P.L	T – 95, 13.5^{ppf}, Tenaris	3966 – 4089^{m}

Table 2-2: AZNS-١١٦ Casing History

2.3 Summary of Workover Operation

The AZNS-116 workover well was De-Complete by rig OEOC – 201 from "06 – June – 2024" to "٠٢ – October – 2024" as described in the following:

Workover Summary:

Date	25 – January – 2024
WorkOver Depth	4090^{m}
Formation	Fahliyan
Mud Weight	103 – 106^{pcf}

Table 2-3: AZNS-١١٦ WorkOver Information

Line up & connected pump truck line to wellhead & ann, chockmanifold for test all equip & wellhead valve @ several tims's, no succ. obs leakage from ring gasket bx-152 - 2-1/16" flange ann. change it @ try to test again no. success. Continue work on leakage from ring gasket bx-152 - 2-1/16" flange ann. change it @ several time's, ok.

Monitorng ANN. Pressure : 2400 psi & Release Pressure And Drop to Zero (10 Min), Close Release Valve & Again Monitorng Pressure While OBS Increase Pressure to 400 psi & Stable It On 400 psi (3Hrs Stable Time) Meanwhile Monitoring Presuure, M/U & Coneected Well Head Lubricator To Well Head and Retrieve TWCV . Pressure Test Deeping Valve , Ok. L/D Well Head Lubricator. Perform H2S Drill. Monitoring Presuure Simultaneous ANN & TBG & OBS Pressure Stable On 500 Psi , Release TBG Pressure To Zero While OBS Stable, ANN Pressure on 500 Psi.

R/U Slik Line , Test It, Ok. Run Gauge Cutter 3.5" OD to 3SV (66.6 mt) , POOH To Surf, RIH & Set Protection Sleeve, POOH To Surf, Run Gauge Cutter 2.5" OD to 554m , Took Weight , Try To Pass This Point @ Several Time's , No Succ, POOHTo Surf . Run 2.25 Bailer , Pass. Same depth @554m, Ok. Pull Out To Surface , No Obs, Samplel.'Run Gauge Cutter 2.5" OD to 3186 m , Took Weight , Try To Pass This Point Several Time's , No Succ, POOH To Surf . Run Slickline Sample Bailer 2.25" To 3186 m Took Weight Pass This depth W/ Jaring , Cont Run to 3600m Meanwhile Monitoring Presuure ANN & TBG OBS Stable Press On 200 Psi. Cont Run Slickline Sample Bailer 2.2" To 3748m Took Weight, Try To Pass This Point @ Several Time's , No Succ, POOH To Surf .

Rack Back & M/U Stand In Derrick While monitoring wellhead & ann. pressure, both 400psi. L/U Pump Truck to Xmass Tree & T.H.S and Connect both to the Choke Manifold, Displace the Well Fluid w/ Drilling Water (62.4pcf) w/ F.R: 1-3BPM, Max Press. : 400-1300psi, CSG Press. : 800-1000psi, Tot. Pumping: 840bbl, Sample Wt: 50-67pcf , while Obs. 100% LEL. Cont. Rack Back & M/U Stand In Derrick. while Killing the Well w/ 106pcf Mud w/ parameters: F.R: 4BPM, Max Press. :0- 1150psi, CSG Press. :700- 1500psi, Tot. Pumping: 840bbl 106pcf Mud meanwhile Prepare 80bbl Hi-Vis Pill (40bbl pumpable) and Circ. w/ Low Rate to prevent getting Mud Air-Cut cause of Pit Level shortage. Spot 40bbl Hi-Vis Pill at 200m above SSD Depth in both Ann. & TBG w/ Low Rate and Disp. w/ Low Rate again.

R/U Slick Line, RIH w/ Slick Line GS Pulling to 3SV Depth and attempt to retrieve Protection Sleeve, POOH to Surface, Protection Sleeve got retrieved successfully, R/D Slick Line. P/U & M/U Lubricator, Set TWCV, Perform Press. Test against TWCV w/ 4000psi, Ok, while monitoring the Well Press. In both Ann. & TBG was zero. Check first CIL, Ok, cut and filing the same and install plug on, try to check second CIL, Obs. Reservoir Fluid w/ high Press. & Detect 10ppm H2S and 60% LEL in presence of H2S Supervisor, Prepare Mask up assets and the involved personnel got masked up, then Cont. work on second CIL, cut & filing the second CIL, Install Plug on the same, take some CIL from Reel, Connect that to the port installed on and set that in Burning Pit, for at least 2Hrs. Obs. the second CIL output to release Toxic Gases and Reservoir fluid completely.

Prepare to N/D X-Mass Tree, attempt to open the Stud and Nuts of DSA & BTM Master Valve, Obs. them hard tightened, make them loose finally, retrieve Metal seal and used Ring Gasket between T.H.S & X-Mass Tree, perform visual check on T.H.S head, Ok, check the compatibility of Running Tool Adaptor ACME BTM * TPCQ Top and TBH HGR, ok. N/D X-Mass Tree & N/U BOP w/ drlg spool. Make all connections tightened. Connect all hydraulic lines accumulator unit & 4” coflexs hose to choke manifold.

Try to perform BOP test as NIOC policy using test pump. Observe leakage on 7500 psi pressure. Rectify leakage & perform BOP pressure test in two steps for 15 min. Ok. Release pressure.

Hang Up BOP, Dress & Bevel 1/4" CL TBG HGR Exit and add some 1/4" CL to the same, N/U BOP Stack and Make all Connections tightened, Close 13-5/8" 5k Annular and Perform Press. Test w/ 3500psi-15min, Ok, Ret. TWCV, Install Bell Nipple while passing 1/4" CL Throu. It, R/U & Set Mousehole, P/U & M/U 1 Jt of 4-1/2" Landing

Joint (18.9#, TPCQ) + 4-1/2" Adaptor (TPCQ * ACME) and Screw the same to TBG HGR. 13-5/8" 10k Shear/Blind Rams got operated by Rig Crew, unscrew 4-1/2" Adaptor (TPCQ * ACME) f/ TBG HGR, then B/O & L/D 4-1/2" damaged Landing Joint, Hang Up BOP f/ 13-5/8" 10K Blind/Shear Rams, Retrieve crumple and cut 1/4" CL, Dress & Bevel 1/4" cut CLs and connect both using connector, Assemble BOP again and make connection tightened, P/U & M/U Golpa. FLG + 1 Jt of 4-1/2" received Landing Joint (18.9#, TPCQ) + 4-1/2" Adaptor (TPCQ * ACME) and Screw the same in TBG HGR. M/U 4-1/16" Gate Valve to Golpa. FLG and make all Stud & Nuts tightened in both top & bottom FLGs.

R/U Slick Line Eqp. (4-1/16" 10k BOP + Lubricator), Open 3SV & RIH w/ 3.437" Protection Sleeve and set the same in its position, POOH Protection Sleeve Running Tool and L/D the same, P/U & M/U 2.250" Bailer w/ Weight Bar and RIH to 3733m, try to pass the same point Sev. times, No success, POOH 2.250" Bailer to surface, Obs. settlement in Bailer. Perform short Circ. RIH w/ 2.250" Bailer w/ Weight Bar to 3733m, try to pass the same point Sev. times, No success, POOH 2.250" Bailer to surface, Obs. No Settelment in bailer. Perform short Circ. w/ Low Rate and Obs. the Well w/ NL-NG.

RIH w/ 2.250" Bailer w/ Weight Bar to 60m, due to changing the plan, POOH 2.250" Bailer to surface, R/D Slick Line Tools & Lubricator + 4-1/16" 10k BOP + 4-1/16" Gate Valve + Golpa. FLG + 4-1/2" Landing Joint (18.9#, TPCQ) + 4-1/2" TBG HGR Adaptor (TPCQ * ACME), P/U & M/U 4-1/2" TBG HGR Adaptor (TPCQ * ACME) + 4-1/2" IF * TPCQ Pup Jt + 5" Pup Jt + 1Jt of 5" DP and Screw the same in 11" TBG HGR. Connect TDS, CBU till homogenizing the In/Out Mud, w/ NL-NG. Record Upward & Downward Weight of Comp. Strg, Rotate Comp Strg. 14 turn clockwise w/ 2-3klbft torque, then w/ apply 10klbs Over pull, Release Comp. Strg f/ Anchor Seal successfully.

R/U Casing Running Eqp. , Held PJSM, Prepare CL & CIL Spools, Cut 3/4" CILs & 1/4" CL, B/O & L/D 4-1/2" Adaptor (TPCQ * ACME) + 4-1/2" Pup Jt (IF * TPCQ) + 5" Pup Joint + 1Jt of 5" DP + 11" TGB HGR +4-1/2" Fluted Swage + XOS 4-1/2" T95 15.2# TS-MS Pin * TPG2 Box, Change Elevator and Handling Eqp. , while Circ. CWH, w/ NL-NG. Cont. POOH Comp. Strg ([5 Jts of 4 1/2" TUBING, 15.1#, T-95, TENARIS] + [XOS 4 1/2" T95 VAM TOP Pin * TS-MS Box + XOS 4 1/2" T95 TPG2 PIN * VAM TOP Box + 4 1/2" PUP JOINT, TPG2, 18.9#, L-80, TYPE-1 + 4-1/2" FLOW COUPLING, 18.9#, L-80.,SUPER 13CR-110KSI,TP-G2, 6" FT (WEIQIXIN) + TRSSV-5 Tubing Retrievable Saftey Valve, 4 1/2", 18.9# W/ 3.437" Seal bore, TP-G2, L-80, SUPER 13CR-110KSI, 10KWP With AF Profile, Flapper Type, (WEIQIXIN) + 4-1/2" FLOW COUPLING, 18.9#, L-80.,SUPER 13CR-110KSI,TP-G2, 4' FT

(WEIQIXIN) + 4 1/2" PUP JOINT, TPG2, 18.9#, L-80, TYPE-1 + XOS 4 1/2" T95 15.2# TS-MS Pin * TPG2 Box] + [7 Jts of 4 1/2" TUBING, 15.1#, T-95, TENARIS]) , while Circ. CWH, w/ NL-NG.

Cont. POOH 4 1/2" TBG, 17#, T-95, VAM TOP (Summitomo) f/ 3883 to 361m, while open Cross Coupling Protector using Air Impact Wrench and Winding 3/4" CILs on the Spools, Circ. CWH, w/ NL-NG. 3-1/2" TBG 10.2#, L-80, TPEX f/ 361 to 153m, while open Cross Coupling Protector using Air Impact Wrench and Winding 3/8" and Winding 3/8" CILs on the Spools, Circ. CWH, w/ NL-NG. 3-1/2" TBG 10.2#, L-80, TPEX f/ 273 to 153m, After POOH 19Jts of 3-1/2" TBG 10.2#, L-80, TPEX, Obs. the last pulled out 3-1/2" TBG had been parted form its Pin, Pin of the last pulled out3-1/2" TBG remained in the coupling of the first joint of remaining part of Comp. Strg in the well, the last Cross Coupling Protector set on 20th 3-1/2" TBG Coupling and both 3/8" CILs attached on 19th 3-1/2" TBG , about 9.5m, also remained in the Well, Depth of top of theremaining part of Comp. Strg in the well: 3698/3m, Length of the remaining part of Comp. Strg in the well: 153/32m, L/D the Parted 3-1/2" TBG and Casing Running Eqp. And prepare Rig floor to Run Milling BHA, some 3/8" CIL parts got stuck in BOP Stack, attempt to Ret. them, No Succ.

P/U & M/U 8-3/8" Milling + 6-1/2 DC [1Std, jt by jt, using safety clamp] and RIH to remove the stuck 3/8" CILs, POOH to Surface. P/U & M/U 11" Plug Tester w/ 11" Wear Bushing install on and Set the same in T.H.S Bowl, POOH 11" Plug Tester, P/U & M/U 8-3/8" Milling BHA including 8-3/8" Mill + 6-15/16" Junk Sub + Double Pin + 6-15/16" Junk Sub + Bit Sub + 6-1/2" DC + 5" HWDP and RIH to 141.79m, F/U the String, all Tubular got Connected Jt by Jt and using safety clamp. Cont. RIH w/ 8-3/8" Milling BHA f/ 141.79 to 355m followed by 5" DPs, Jt by Jt, while F/U the String after running every 15Jts and perform Break Circ. for 5min, w/ NL-NG. Cont. RIH w/ 8-3/8" Milling BHA f/ 355 to 844m followed by 5" DPs, Jt by Jt, while F/U the String after running every 15Jts and perform Break Circ. for 5min, w/ NL-NG.

Cont. RIH w/ 8-3/8" Milling BHA to 3578m followed by 5" DPs on Elevator, Std by Std, while F/U the String after running every 10Stds and perform Break Circ. for 5min, w/ NL-NG. perform Break Circ. for 5min, w/ NL-NG, Obs. Holding up Strg Weight, connect TDS and pump out, then try to pass this point, Sev. times, No success.

Start Milling the Fish f/ 3578 to 3703m w/ soft & hard Parameters [Rotation: 20-60RPM, TQ: 2-5klbft, F.R: 150-250gpm, SPP: 200-600psi, WOB: 2-5klb], Obs. & confirm Hard Milling indications in last 4 meters and attempt to dress Top of Fish, while pump 50bbl

Hi-Vis, w/ NL-NG. Pump 50bbl Hi-Vis Pill, then perform CBU till getting Hi-Vis Pill on Sh.Shakers. Work on Junk Sub.

POOH 8-3/8" Milling BHA f/ 3703m to Surf. on Elevator, while Circ. C.W.H, w/ NL-NG, L/D 8-3/8" Mill (65%) & Rest of BHA, about 20lb 3/8" CILs in a cut & piece manner got caught by Junk Subs.

P/U & M/U 7-7/8" Fishing BHA including 7-7/8" Overshot dressed w/ 3-1/2" Control Mill, 3-1/2" Basket Grapple, Top Packer + 6-1/2" DC [1Jt] + 5" HWDP [2 Stds] and RIH to 65.

R/D to 4078^{m}. POOH milling BHA to surface & L/D. P/U & M/U 11" plug tester & RIH, unset & retrieved wear bushing.

P/U & M/U 9 – 5/8" * 7" tandem scraper with used 5 – 7/8" B.bit & RIH to 4076^{m} & pumped 60^{bbl} Hi-Vis Pill while scraping SN packer position several times w/NL-NG. Displaced the in hole mud with low solid fresh mud. Pumped 30^{bbl} $CaCl_2$ 85^{pcf} & spotted in 7" liner as non-solid fluid. Commenced POOH scraping BHA to surface while B/O & L/D BHA & bit. Cont. RIH w/ 7-7/8" Fishing BHA f/ 2020 to 3703m followed by 5" DPs on Elevator, while Circ. C.W.H & Monitor the Well, w/ NL-NG, , Wash Dn last Std, Pefrom Circ. @ 3701m w/ F.R: 330gpm, SPP: 900psi at TOF RIH w/ 7-7/8" Overshot to 3703m w/ F.R: 155gpm, SPP: 250-260psi, Rotation: 10RPM, while Obs. Holding up Strg Weight continuously, P/U Strg to check Strg, Obs. Over pull, back to Neutral point, again P/U Strg till Obs. Over pull , then apply Torque to unlatch Comp. Strg f/ Anchor Seal, applied Over pull & Torque got released spontaneity, check the Weight On Hook & Stand Pipe Pressure, Ok, Obs. 1-2klbs Strg Weight Overweight in Weight On Hook. POOH 7-7/8" Fishing BHA f/ 3703m to Surface on Elevator, while Circ. C.W.H, w/ NL-NG, some 6.6m of Comp. Strg including 3-1/2" TGB parted from its pin got recovered by Overshot, release the recovered 3-1/2" TBG f/ 7-7/" Overshot and prepare to M/U 7-7/8" Overshot dressed w/ 4-1/4" Control Mill & Basket Grapple.

P/U & M/U 7-7/8" Fishing BHA including 7-7/8" Overshot dressed w/ 4-1/2" Control Mill, 4-1/4" Basket Grapple, Top Packer + 6-1/2" DC [1Jt] + 5" HWDP [2 Stds] and RIH to 65.96m, while using Safety Clamp in Tubular Connections. Cont. RIH w/ 7-7/8" Fishing BHA f/ 65.96 to 554m followed by 5" DPs on Elevator, while using Safety Clamp till getting Strg Weight more heavy enough, Circ. C.W.H & Monitor the Well, w/ NL-NG, Perform Break Circ. at 2000m, for 15min, to make sure Strg is not plugged. Cont. RIH w/ 7-7/8" Fishing BHA f/ 554 to 3700m followed by 5" DPs on Elevator, while Circ. C.W.H & Monitor the Well, w/ NL-NG, , Wash Dn last Std, Pefrom Circ. @

3700m at TOF. RIH w/ 7-7/8" Overshot to 3704m w/ F.R: 155gpm, SPP: 250-260psi, Rotation: 10RPM, while Obs. Obstructon, try to pass the same point applying parameters [F.R: 200gpm, SPP: 400psi, Tq: 1-3klbft, WOB: 7klb] & Cont. RIH to 3709.5m, attempt to Engage w/ Fish Sev. Times, No Succ. POOH 7-7/8" Fishing BHA f/ 3705 to 842m on Elevator, while Circ. C.W.H, w/ NL-NG. Cont. POOH 7-7/8" Fishing BHA f/ 842m to Surf. on Elevator, while Circ. C.W.H , w/ NL-NG, Obs. some coiled 3/8" CIL in overshot Basket Grapple.

P/U & M/U 8-3/8" Milling BHA including 8-3/8" Mill (used - 65%) + 6-15/16" Junk Sub + Double Pin + 6-15/16" Junk Sub + Bit Sub + 6-1/2" DC + 5" HWDP and RIH to 141.79m, F/U the String, all Tubular got Connected using safety clamp, Cont. RIH w/ 8-3/8" Milling BHA f/ 141.79 to 3709m followed by 5" DPs, while F/U the String after running every 15Jts and perform Break Circ. for 5min, w/ NL-NG. Work on Junk Subs, then Start Milling f/ 3709 to 3711/69m w/ Parameters [Rotation: 20-25RPM, TQ: 2-3klbft, F.R: 150gpm, SPP: 200psi, WOB: 2-5klb] w/ NL-NG, Pump 50bbl Hi-Vis Pill, CBU till getting Hi-Vis Pill on Sh.Shakers. POOH 8-3/8" Milling BHA f/ 3703m to surface on Elevator, while Circ. W.H, w/ NL-NG, L/D 8-3/8" Milling BHA (8-3/8" Mill, 65%) and Recover 4lb Debris in Junk Subs.

P/U & M/U 7-7/8" Fishing BHA including 7-7/8" Overshot dressed w/ 3-1/2" Control Mill, 3-1/2" Basket Grapple, Top Packer + 6-1/2" DC [1Jt] + 5" HWDP [2 Stds] and RIH to 65.96m, while using Safety Clamp in Tubular Connections, Cont. RIH w/ 7-7/8" Fishing BHA f/ 65.96 to 1099m followed by 5" DPs on Elevator, while using Safety Clamp till getting Strg Weight more heavy enough, Circ. C.W.H & Monitor the Well, w/ NL-NG. Slip & Cut the Drilling Line. Cont. RIH w/ 7-7/8" Fishing BHA f/ 1099 to 1677m followed by 5" DPs on Elevator, while Circ. C.W.H & Monitor the Well, w/ NL-NG. Cont. RIH w/ 7-7/8" Fishing BHA f/ 1099 to 3711m followed by 5" DPs on Elevator, while Circ. C.W.H & Monitor the Well, w/ NL-NG. Resume Wash Dn w/ 7-7/8" Fishing BHA to TOF, Engage w/ Fish, try to Catch Fish, Check Strg Wt. W/ Apply Over pull, attempt to release Comp. Strg f/ Anchor Seal w/ 6 turn, Obs. applied Torque got released, Decide to POOH 7-7/8" Fishing BHA. POOH 7-7/8" Fishing BHA f/ 3711m to Surface on Elevator, while Circ. C.W.H & Monitor the Well, w/ NL-NG, L/D 7-7/8" BHA & Overshot, No part of Comp. Strg was recovered.

P/U & M/U 5-5/8" Fishing BHA including 5-5/8" Overshot dressed w/ 3-3/8" Control Mill, 3-3/8" Basket Grapple + Extension sub + Top Packer + X.O.S [3-1/2" IF × 4-1/2" IF] + 6-1/2" DC [1Jt] + 5" HWDP [2 Stds] and RIH to 67.77m, while using Safety Clamp in Tubular Connections, Cont. RIH w/ 5-5/8" Fishing BHA f/ 67.77 to 1240m followed

by 5" DPs on Elevator, while using Safety Clamp till getting Strg Weight more heavy enough, Circ. C.W.H & Monitor the Well, w/ NL-NG. Cont. RIH w/ 5-5/8" Fishing BHA f/ 1240 to 3680m followed by 5" DPs on Elevator, while Circ. C.W.H & Monitor the Well, w/ NL-NG. Resume Wash Dn w/ 5-5/8" Fishing BHA to TOF, Engage w/ Fish, try to Catch Fish, Check Strg Wt. W/ Apply Over pull, attempt to release Comp. Strg f/ Anchor Seal w/ 6 turn, Obs. applied Torque got released, Decide to POOH 5-5/8" Fishing BHA. POOH 5-5/8" Fishing BHA f/ 3711 to 2020m on Elevator, while Circ. C.W.H & Monitor the Well, w/ NL-NG.

Due to a technical fault, TDS Elevator collided with Rotary Table & Drawworks cable got tangling, decide to hang up TDS, change Elevator and 5" Slips, maintain Drlg Line, Work on TDS links and L/D 1 Jt of 5" DP. POOH 5-5/8" Fishing BHA f/ 2020 to 410m on Elevator, while Circ. C.W.H & Monitor the Well, w/ NL-NG. Cont. POOH 5-5/8" Fishing BHA f/ 410m to Surface on Elevator, while Circ. C.W.H & Monitor the Well, w/ NL-NG, L/D 5-5/8" BHA & Overshot, No part of Comp. Strg was recovered, Change Basket Grapple & Mill Control f/ 3-3/8" to 3-1/2".

P/U & M/U 5-5/8" Fishing BHA including 5-5/8" Overshot dressed w/ 3-1/2" Control Mill, 3-1/2" Basket Grapple + Extension sub +Top Packer + X.O.S [3-1/2" IF × 4-1/2" IF] + 6-1/2" DC [1Jt] + 5" HWDP [2 Stds] and RIH to 67.77m, while using Safety Clamp in Tubular Connections, Cont. RIH w/ 5-5/8" Fishing BHA f/ 67.77 to 1700m followed by 5" DPs on Elevator, while using Safety Clamp getting Strg Weight more heavy enough, Circ. C.W.H & Monitor the Well, w/ NL-NG. Cont. RIH W/5-5/8" O.Shot BHA & Follow By 5" DP To 3711.3m (TOF). Try To engage & Catch The fish. Several times by different parameters. POOH For Checking 5-5/8" O.Shot to 2420m while Circ. Cross wellhead, NL-NG. Cont. POOH For Checking 5-5/8" O.Shot to 1700m while Circ. Cross wellhead, NL-NG. Cont. POOH For Checking 5-5/8" O.Shot to Surface, OBS. Not Catching The Fish, L/D O.Shot while Circ. Cross wellhead, NL-NG. Ret. Wear Bushing ,Set Plug Tester , Test BOP Stack , Ok. Ret. Plug Tester. Set Wear Bushing.

M/U & RIH W/ 8-3/8"New M.M.J.Mill(5*24/32 Port) + 6 15 / 16" JUNK SUB +D.PIN + 6 5/8" JUNK SUB +BIT SUB + 10jts 6-1/2" DC + 6 Jts 5" HWDP & Follow By 5"DP To 178m. Cont. RIH W/ Milling BHA & Follow By 5" DP To 600m. POOH As Change Program To Surface.L/D 8-3/8" M.M.J.Mill & 2No.J.Sub , D.P , B.Sub. RIH W/7-7/8" O.Shot Included(3-1/2" M.C.+ 3-1/2"B.G) + Ext.Jt + Same BHA(1 Jt 6-1/2" DC + 2 Std 5" HWDP) & Follow By 5" DP To 400 m. W/NL-NG. RIH W/7-7/8" O.Shot Included(3-1/2" M.C.+ 3-1/2"B.G) + Ext.Jt + Same BHA(1 Jt 6-1/2" DC + 2 Std 5" HWDP) & Follow By 5" DP To TOF. Obs. Holding up Strg Wt. & TOF got confirmed w/ appling

some Wt. , pass & guide Fish Neck inside Overshot guide in the range of 223cm From Confirmed TOF, due to high corrosion and decay of Comp. Strg, No Succ. No signs of Engagement with Fish were observed. POOH to Surf & L/D 7-7/8" O.Shot & ext. Jt.

M/U & RIH W/ 8-3/8" New M.M.J.Mill(5*24/32 Port) + 6 15 / 16" JUNK SUB +D.PIN + 6 5/8" JUNK SUB +BIT SUB + 10 jts 6-1/2" DC + 6 Jts 5" HWDP & Follow By 5"DP To 294 m. Cont RIH W/ 8-3/8" New M.M.J.Mill(5*24/32 Port) + 6 15 / 16" JUNK SUB +D.PIN + 6 5/8" JUNK SUB + BIT SUB + 10 jts 6-1/2" DC + 6 Jts 5" HWDP & Follow By 5"DP F/294m To 3711/95m (TOF)While Fill Up STRG Every 15 STD. Start Milling the Fish f/ 3711.95 to 3713.7m w/ Parameters [WOB: 2-15klb, Rot.: 15-60RPM,TQ: 2-5klbft,F.R: 150-250gpm,SPP: 200-500psi)] Cont. Milling & Dress F/3713.7 To 3714m W/Low Parameters while pump 50bbl Hi-Vis, W/ NL-NG Pump 50bbl Hi-Vis Pill, then perform CBU till getting Hi-Vis Pill on Sh.Shakers, Work on Junk Sub @ Several Times. POOH F/3714 To 3100m While Circ. Cross Well Head NL-NG. Cont POOH F/3100 To To Surface.L/D 8-3/8" M.M.J.Mill (40%) & 2No. J.Sub. Recover 2.4lb Junk While Circ. Cross Well Head NL-NG.

M/U & RIH W/5-5/8" O.Shot W/7" Over Size Guide, Included:(3-1/2" M.C + 3-1/2"B.G) +Extension Jt + top Sub + X.O.S 3-1/2" * 4-1/2" IF + 1 Jt 6-1/2" DC + 2 STD 5" HWDP & Follow By 5" DP To 1000m While Circ. Well Head NL-NG. Cont. RIH W/5-5/8" O.Shot W/7" Over Size Guide To 3250m. While Circ. Well Head, NL-NG. Cont. RIH W/5-5/8" O.Shot W/7" Over Size Guide F/ 3250m TO 3714m (TOF) ,Took Weight , Confirmed TOF . Try To Catch The Fish @ Several Time & Guide Fish Neck Inside Overshot, Check It, Ok. Attempt for Release The Fish From A.Seal with Rotation Due To Hi Corrosion of Comp STRG, Released The Fish, Try To Catch The Fish, Succ. (OBS . Indication F/ Exp.Joint), Work On Release The Fish With UpWard & Downward, Sevral Times. Release The Fish With Over Pull & Movment UpWard STRG 44m . POOH W/O.Shot To Surface, No Obs. The Fish. L/D it. Make 3-1/2" DP New Stand in Derrick.

M/U & RIH W/5-5/8" O.Shot W/7" Over Size Guide, Included:(3-1/2" M.C + 3-1/2"B.G) +Extension Jt + top Sub + X.O.S 3-1/2" * 4-1/2" IF + 1 Jt 6-1/2" DC TO 11m. RIH W/5-5/8" O.Shot W/7" Over Size Guide, Included:(3-1/2" M.C + 3-1/2"B.G) +Extension Jt + top Sub + X.O.S 3-1/2" * 4-1/2" IF + 1 Jt 6-1/2" DC + 2 STD 5" HWDP & Follow By 5" DP To 3669.66m While Circ. Well Head NL-NG. Engage The Fish , POOH W/ Max.400klb Weight in Driller Indicator, Work on Fish W/ downward & upward Several times, Pull Out 10m of Fish Step by Step & Movement The Fish from 7" liner to 9-5/8" Casing, Obs. Drop Overpull, Check String weight(4klb over) POOH

one Stand W/drag, Cont. POOH to 300 m., while check string weight & Circ. Well Head NL-NG. Cont. POOH to Surface, Obs. Recover Fish : 3 Jts 3-1/2" tubing With Hi CORROSION Along The Pipes + CIV #1 + CIL (View as rolled up CIL) + 1 Jt P.J 3-1/2" Tubing + 1 Jt 3-1/2" Tubing + 1 Jt P.J 3-1/2" Tubing + CIV #2+ 1 Jt P.J 3-1/2" Tubing + 5 Jts3-1/2" Tubing + 1 Jt P.J 3-1/2" Tubing + 1 Jt Traveling Jt + 1 Jt P.J 3-1/2" Tubing + 1 Jt 3-1/2" Tubing + 1 Jt P.J 3-1/2" Tubing + SSD +1 Jt P.J 3-1/2" Tubing + 1 Jt 3-1/2" Tubing + 1 Jt P.J 3-1/2" Tubing + Ancher Seal while Obs. Plug String Below Each Conn. CIV#2 & & Detect 100% LEL , Try To Circ. In String No Succ Circ. Cross Well Head W/NL-NG. Perform BOP Test As NIOC Policy.

M/U & RIH W/8-3/8" M.M.J.Mill + J.Sub#1 + D.Pin + J.Sub#2 + J.Sub#3 + D.Pin + J.Sub#4 + B.Sub Inclued F.Valve + 7 Jts 6-1/2" DC + 6 Jts 5" HWDP & Follow By 5" Dp To 1650 m While F/Up String W/ NL-NG Till M.N. Cont RIH W/8-3/8" M.M.J.Mill + J.Sub#1 + D.Pin + J.Sub#2 + J.Sub#3 + D.Pin + J.Sub#4 + B.Sub Inclued F.Valve + 7 Jts 6-1/2" DC + 6 Jts 5" HWDP & Follow By 5" Dp F/ 1650 To 3571m While F/Up String String Took Weight Cont. RIH W/ Rot. & pumping To 3594m While F/Up String W/ NL-NG Cont. RIH To 3771m Apply W/max. 20klb for Checking String, No drop Weight, Cont. RIH f/3771 to 3780m W/WOB: 2-10klb, RPM: 40rpm, TQ: 1-4klb.ft, F.Rate: 140gpm, Press.: 240psi,While Check String Every 5 meters Cont. RIH f/3780 to 3786 W/WOB: 1-4klb, RPM: 40rpm, TQ: 1-4klb.ft, F.Rate: 140gpm, Press.: 240psi, Cont. RIH f/3786 to 3790 W/Normal trip, Cont. RIH W/Hard Milling f/3790 to 3793m, Cont. RIH f/3793 to 3802.7 w/Normal trip, String Took weight @3802.7, Pump mud w/Hi rate for Cleaning, Work on j.sub Several times, Check & Confirm 7"L.L@3802.7, Pump hi.vis pill, Cont. Pump mud till shaker out the pill, Work on j.sub , w/NL-NG POOH to 2535m While Circ. Cross Well Head w/NL-NG. Cont. POOH F/2040 To surface While Circ. Cross well Head W/NL-NG. W/8-3/8" M.M.J.Mill to Surface, Recover 10Ib. Junk f/J.subs, L/D , 4 NO. J.sub & 8-3/8" M.M.J.Mill.

M/U & RIH W/ New 6" M.M.J.Mill (5*16/32" nozzle, T.S.E.KH, S/N: 430)& 2 No. J.sub + B.sub + 6 stand 4-3/4"DC (jt by jt)+ 2 stand 3-1/2" DP Follow by 5" DP to 250m, POOH To 58m While Rack Back 4 STD 4-3/4" DC + 2 STD 3-1/2" DP W/NL-NG M/U X.O.S 3-1/2" IF pin* 4-1/2" IF box + D.Pin +2 No. 5-5/8" J.Sub & Follow by 5" DP to 1350m.w/NL-NG. Cont RIH F/ 1350m to 2350 m, w/NL-NG. Cont RIH W/ New 6" M.M.J.Mill + 2 No. 4-3/4" J.sub(above The Mill) & 2 No. 5-5/8" J.Sub(@58m) on BHA & Follow by 5" DP To 3802.7 (7" LNR LAP) Took weight, Cont. RIH F/ 3802.7m To 3808m W/Soft wash & Ream, Cont. RIH W/Normal trip to 3831m,(Apply Max. 1klb Weight @ 3831m, Confirmed TOF by Client), Pump Hi Vis Pill, Pump Mud Till Shaker out The Pill, Work on junk sub Several Times W/NL-NG. POOH F/3831 To 1029m

While Circ. F/Cross Well Head W/NL-NG. Cont POOH F/1029m To Surf. W/6" M.M.J.Mill & Recover 8Ib. Junk f/J.subs. L/D 2 NO. 5-5/8" J.sub & 2 NO. 4-3/4" J.sub & 6" M.M.J.Mill.

M/U & RIH W/ 5 1/4" O.Shot, Included: Wall Hook Guide + Bowl Included (1-1/2" M.C NEW + 1-1/2" B.G NEW) + Extension Jt + Top Sub + 1 Jts 4 3/4" DC + 5 STD 3 1/2" D.P To 3830m, Upward & Downward, Record string weights. Cont. RIH to 3833.4m obs. Inc. prees. Pull out string obs. W/Max. 10klb @ 3833.4m Cont. POOH W/Normal trip to 3830m, RIH To 3835m w/RPM:15-20,F.rate: 150gpm,Press.:80psi, Pull out for checking, obs. Overpull , (Max.400klb weight in indicator), RIH To neutral point Apply Rot. & F.rate: 320gpm, Press :250psi, POOH to 3800m(2m above 7"L.L)W/GPM: 500gpm, Press.: 1700-1800psi)RIH to 3837m W/WOB:0-5Klb, Rot.: 20rpm, TQ: 0-4klb.ft, F.Rate: 220gpm, Press.: 850psi, Obs. Inc. Pressure, Cont. RIH To 3838.4m, Work On Fish, POOH To 3800m(2m Above 7" L.L) Flow Check, Static. POOH For Checking to 3450m W/NL-NG. Till M.N. POOH For Checking Fishing Tools to Surface, While Flow Check @ 3000m, Static, Recover Tot.: 8.1m of the Fish(1-1/2" CTU),L/D Overshot & Chech it, No Damage.

P/U & Assemble Same 5-1/4" Overshat Included : Wallhook Guide + Bowl(1-1/2 M.C & B.G)+ E.J+ Top sub + 1 jts 4-3/4" DC + 5 jts 3-1/2" DP To 61m, Change Elevator, Cont. RIH W/X.O.S 3-1/2" IF Pin * 4-1/2" IF Box + D.P 4-1/2" IF + 2 No. 5-5/8" J.Subs to 63m. Cont. RIH W/ 5-1/4" Over Shot & Same BHA & Follow By 5" DP To 1480m W/NL-NG. Cont. RIH To 3420m While Circ. F/Cross well Head W/NL-NG @ M.N. Cont. RIH W/ 5-1/4" Over Shot & Same BHA & Follow By 5" DP F/ 3420m To 3836m. Record String Weight @ 3836m, Pump 50 BBL HI-Vis Pill To Clean The Hole & Work On Junk Sub @ Several times. Cont RIH To 3844.6m W/ Parameters (WOB : 0-4 Klb, RPM: 15-20, TQ: 1-4 Klb.ft, Flow Rate : 200 GPM, Press: 400-700 psi), OBS. INC Press. Cont RIH To 3846.5m W/ Pump Off & No RPM, POOH For Check String To 3824m W/ Over Pull (Min: 10 Klb To Max : 110 Klb), Cont POOH W/ Normal Trip To 3800m(2m Above 7" L.L). Apply Pumping, Obs. In. Sharp Press. POOH To 3752m While Obs. String Full Of Mud. Flow Check The Well, Static.POOH To 3750m, Flow Check The Well, Static. Cont POOH For Checking Fishing Tools F/ 3750m To 1000m W/NL-NG. Cont POOH For Checking Fishing Tools F/ 500m To Surface, Recoverd 3m Of Fish(1-1/2" CTU) + 4.5Ib Junk f/J.Subs. L/D 5-1/4" Overshot & Subs, Release The Fish From Engaged W/ B.G inside The Bowl. Check 1-1/2" M.C. & B.G.

P/U & Assemble Same 5-1/4" Overshat Included : Wallhook Guide + Bowl(1-1/2 M.C & B.G)+ E.J+ Top sub + 1 jts 4-3/4" DC + 2 STD 3-1/2" DP To 73m, Change Elevator,

Cont. RIH W/X.O.S 3-1/2" IF Pin * 4-1/2" IF Box + D.P 4-1/2" IF + 2 No. 5-5/8" J.Subs & Follow By 5" DP To 216m While Circ. F/Cross Well Head W/NL-NG Till M.N. Cont RIH W/ 5-1/4" Overshat Included : Wallhook Guide + Bowl (1-1/2 M.C & B.G)+ E.J+ Top sub + 1 jts 4-3/4" DC + 2 STD 3-1/2" DP + X.O.S 3-1/2" IF Pin * 4-1/2" IF Box + D.P 4-1/2" IF + 2 No. 5-5/8" J.Subs & Followed By 5" DPs To 3845.2m While Circ. C.W.H, w/ NL-NG. Obs. Hoding up Strg Weight, Pump 40bbl Hi-Vis Pill and Perform CBU till Shakering out the same, Work on Junk subs Sev. Times, attempt to resume RIH w/ 5-1/4" Fishing BHA and Engage with Fish Neck w/ applying parameters, No Success. POOH 5-1/4" Fishing BHA f/ 3845 to 1080m on Elevator, While Circ. C.W.H, w/ NL-NG @ M.N. Cont. POOH 5-1/4" Fishing BHA f/ 1080m to surface on Elevator, L/D 5-1/4" Overshot & Rest of Fishing BHA, Obs. No part of remaining Fish was recovered, While using safety clamp in B/O BHA Connections & Circ. C.W.H, w/ NL-NG.

P/U & M/U 6" Milling BHA including [6" M.M.J.Mill + 4-3/4" Bit Sub + 6 Stds 4-3/4" DC + 1 Jt 3-1/2" DP + X.O.S + D.P + 1/2" Junk Sub + 6 15 / 16" Junk Sub] while using safety clamp and Clean & Pass Rabit Thru. Tubular and RIH w/ same BHA to 180m, F/U BHA and Break Circ. Cont. RIH w/ 6" Milling BHA f/ 180 to 3336m on Elevator, while F/U Strg & Break Circ. after running every 15 Stds, w/ NL-NG. Resume RIH w/ 6" Milling BHA f/ 3336 to 3794m on Elevator, while F/U Strg & Break Circ. after running every 15 Stds, w/ NL-NG, Conn. TDS and Wash Dn f/ 3794 to 3845.39m, Obs.holding up Strg Wt. @ 3845.39m. Start Milling Op. w/ applying parameters [Rotation: 40-60RPM, Tq: 1-4klbft, F.R:90-220GPM, SPP: 200-1020psi, WOB: 5-15klbs] f/ 3845.39 to 3845.55m, w/ NL-NG @ M.N. Cont. Milling Op. w/ applying parameters [Rotation: 40-60RPM, Tq: 1-4klbft, F.R: 100-220GPM, SPP: 200-1020psi, WOB: 5-15klbs] f/ 3845.55 to 3846.1m , while reciprocate Strg and apply different parameters as DOT & Pump Hi-Vis Pill periodically, w/ NL-NG @ R.T. Push Fish w/ applying 0-18klbs Wt. f/ 3846.1m to 3876.1m, then resume Milling Op. w/ applying parameters [Rotation: 40-60RPM, Tq: 1-4klbft, F.R: 50-220GPM, SPP: 100-1020psi, WOB: 5-15klbs] f/ 3876/1 to 3876/15m, try to perform milling the rest of fish w/ different parameters & Pump Hi-Vis Pill periodically, w/ NL-NG, Obs. No Progress. Try to Cont. Milling Op. w/ 6" Milling BHA w/ applying parameters [Rotation: 40-60RPM, Tq: 1-4klbft, F.R: 100-220GPM, SPP: 200-1020psi, WOB: 5-15klbs] @ 3876/15m, Obs. No Progress, while reciprocate Strg and apply different parameters as DOT & Pump Hi-Vis Pill periodically, w/ NL-NG.

Pump 30bbl Hi-Vis Pill @ 3875m and CBU till Shakering it out, w/ NL-NG. POOH 6" Milling BHA f/3875 to 3070m on Elevator, while Circ. C.W.H, w/ NL-NG. Resume

POOH 6" Milling BHA f/3070m to surface on Elevator, L/D 6" Mill (10%) and rest of BHA, while Circ. C.W.H, w/ NL-NG.

P/U & M/U 5-7/8" Milling BHA including [5-7/8" M.M.J.Mill (New, S/N: 620, 5*15/32) + 4-3/4" Bit Sub (float in) + 7 Stds 4-3/4" DC + 1 Jt 3-1/2" DP + X.O.S + D.Pin (4-1/2" IF) + 6-1/2" Junk Sub + 6 15/16" Junk Sub], while clean junk subs (recovered 2lb debris), change float valve w/ new one, using safety clamp, Clean & Pass Rabbit Thru. the added Std of 4-3/4" DC to the same BHA (Jt by Jt) and RIH to 207.19m, F/U BHA and Break Circ. Cont. RIH w/ 5-7/8" Milling BHA f/ 209.19 to 3849m followed by 5" DPs on Elevator, while F/U String every 15 Stds, w/ NL-NG. Conn. TDS & Wash Dn w/ 5-7/8" Milling BHA f/ 3849m to 3876.15m (TOF), Obs. holding up Strg Weight, w/ NL-NG. Pump 40bbl Hi-Vis Pill & CBU till shakering it out to clean TOF & 7" LNR & 9-5/8" CSG, Work on J.Subs Sev. times, w/ NL-NG. Start Milling Op. f/ 3876.15 to 3878.20m w/ applying parameters while pump Hi-Vis Pill periodically, suddenly Obs. applied WOB on Fish fully gave way and got 0 klbs & applied TQ got back to off-BTM Torque, w/ NL-NG. Wash Dn w/ 5-7/8" Milling BHA f/ 3878.20 to 3919.54m followed by 5" DPs, Obs. holding up Strg Weight, Confirm TOF w/ applying some WOB at 3919.58m, while recriprocate Strg every 5m to make sure Strg is free, Obs. No Tq & Drag at all, w/ NL-NG.

Pump 40bbl Hi-Vis Pill & CBU till shakering it out to clean TOF & 7" LNR & 9-5/8" CSG, Work on J.Subs Sev. times, w/ NL-NG. POOH 5-7/8" Milling BHA f/ 3919.58m to surface on Elevator, while Circ. C.W.H, w/ NL-NG, L/D 5-7/8" Mill (15%) & Junk sub and clean them (recovered 7/5lb debris), and rest of BHA.

P/U & M/U 4" Fishing BHA including [2" × 4" Taper tap (New, S/N: 025) + 4-3/4" D.Box + 1Jt 4-3/4" DC + Fishing jar + 6 Stds 4-3/4" DC + 1 Jt 3-1/2" HWDP + X.O.S], while using safety clamp and RIH to 188m, F/U BHA and Break Circ. Cont. RIH w/ 4" Fishing BHA f/ 188 to 1340m followed by 5" DPs on Elevator, while Circ. C.W.H, w/ NL-NG. Conn. TDS & try to Cont. RIH w/ 4" Fishing BHA w/ Wash Dn f/ 3888m to TOF, Obs. Strg got pressured up, work on Strg to make SPP back to normal Press. Sev. times, No Succ. , decided to POOH 4" Fishing BHA f/ 3888 to 3753m (out of 7" LNR), Cont. Work on Strg Sev. Times, Obs. SPP got back to normal successfully. Perform CBU at 3753m, w/ NL-NG. Resume RIH w/ 4" Fishing BHA w/ Wash Dn f/ 3753 to 3919.7m followed by 5" DPs and Perform Break Circ. On TOF, w/ NL-NG. Record Up & Dnward Strg Weight with & without Pupming, Try to Recover Fish w/ applying parameters, indicate catch the fish w/ Press. Up 40psi & Overpull 5-15klb, POOH f/ 3920.6 to 3898m while Obs. 5-20klb Overpull, Run Back to 3920.5m, Push the fish to

3926m, two times try recover fish w/ 2" * 4" Taper tap to 3926.7m w/ applying parameters, w/ NL-NG. POOH 4"Fishing BHA f/ 3926.7 to 1597m on Elevator, while Circ. C.W.H, w/ NL-NG. Cont. POOH 4" Fishing BHA f/ 1597m to surface on Elevator, while Circ. C.W.H, w/ NL-NG, L/D rest of BHA & 4" Taper Tap, Obs. No part of fishwas recovered, about 15cm of length of 4" Taper Tap was broken & remained in the well.

P/U & M/U 5-7/8" Milling BHA including [5-7/8" M.M.J.Mill (5% Used, S/N: 620, 5*15/32) + 4-3/4" Bit Sub (float in) + 7 Stds 4-3/4" DC + 1 Jt 3-1/2" DP + X.O.S + D.Pin (4-1/2" IF) + 6-1/2" Junk Sub + 6 15/16" Junk Sub] and RIH to 207m, F/U BHA and Break Circ. , while using safety clamp, Cont. RIH w/ 5-7/8" Milling BHA f/ 207 to 407m followed by 5" DPs on Elevator, while F/U Strg every 15Stds, w/ NL-NG. Cont. RIH w/ 5-7/8" Milling BHA f/ 407 to 3200m followed by 5" DPs on Elevator, while F/U Strg every 15Stds, w/ NL-NG. Cont. RIH w/ 5-7/8" Milling BHA f/ 3200 to 3802m (7" L.Lap) followed by 5" DPs on Elevator, while F/U Strg every 15Stds, w/ NL-NG. Conn. TDS & RIH w/ 5-7/8" Milling BHA w/ Wash Dn f/ 3802 to 3926m, Obs. Holding up Strg Weight, perform Break Hi-Rate Circ. to clean TOF, Record Up & Dnward Strg Weight with & without Pupming, w/ NL-NG. Try to Milling Op. @3926m w/ 5-7/8" w/ applying parameters, while reciprocate Strg and using different parameters as DOT and Pump Hi-Vis Pill periodically, w/ NL-NG, Obs. No Progress. POOH w/ 5-7/8" Milling BHA f/ 3926 to 3878m and perform Circ. , then work on Draworks, w/ NL-NG. Resume try to Milling Op. @ 3926m w/ 5-7/8" w/ applying parameters, while reciprocate Strg and using different parameters as DOT and Pump Hi-Vis Pill periodically, w/ NL-NG, Obs. No Progress. POOH 5-7/8" Milling BHA f/ 3926 to 3535m on Elevator, while Circ. C.W.H, w/ NL-NG and POOH 5-7/8 Milling BHA w/ speed control in 7" LNR @ M.N. POOH 5-7/8" Milling BHA f/ 3535 to surface on Elevator, L/D 5-7/8" Mill & rest of BHA, recover 4/5lb debris f/ junk subs, while Circ. C.W.H, w/ NL-NG.

P/U & M/U 2-1/2" × 4" Fishing BHA including [2-1/2" × 4" Taper tap + 4-3/4" D.Box + 1Jt 4-3/4" DC + Fishing jar + 6 Stds 4-3/4" DC + 1 Jt 3-1/2" HWDP + X.O.S], while using safety clamp and RIH to 188m, F/U BHA and Break Circ. , w/ NL-NG. Cont. RIH w/ 2-1/2" × 4" Fishing BAH f/ 188 to 1049m followed by 5" DPs on Elevator, while Circ. C.W.H, w/ NL-NG. Resume RIH w/ 2-1/2" × 4" Fishing BAH f/ 1049 to 3000m followed by 5" DPs on Elevator, while Circ. C.W.H, w/ NL-NG. Cont. RIH w/ 2-1/2" × 4" Fishing BHA w/ Wash Dn to 3926.5m (TOF), while pass 7" L.Lap gently, Obs. Took Weight at 3926.5m, w/ NL-NG. Record Up & Downward Strg Wt. with & without Pumping and Rotation, RIH w/ 2-1/2" × 4" Fishing BHA to 3926.5m and Apply 8klbs WOB on TOF w/Low Flow Rate, then Apply 10RPM Rotation, while increasing WOB

to 12klbs to perform Tapping Op. , Obs. Increasing Torque to 7klbft, finally increase the applied WOB to 18klbs, try to Check Strg Wt. while having 20-40klbs Overpull and POOH f/ 3926.5 to 3919m, suddenly Obs. Strg Wt. got back to recorded Strg Weight, try to Fishing Op. for second time, Obs. No sign of engagement w/ Fish.

POOH 2-1/2" × 4" Fishing BAH f/ 3926.5 to surface on Elevator, L/D 2-1/2" × 4" Taper Tap & rest of BHA, No part of Fish was recovered & about 12cm of length of 2-1/2" × 4" Taper Tap was broken and remained in the well, while Circ. C.W.H, w/ NL-NG.

P/U & M/U 11" Wear Bushing and Install it on Wear Bushing Running & Retrieving Tool and RIH the same and set it on T.H.S Bowl, POOH Wear Bushing Running & Retrieving Tool and R/B 5" Std on Derrick.

Milling BHA including [6" M.M.J.Mill (New, S/N: CS6222, 5*16/32) + 4-3/4" Bit Sub (float in) + 7 Stds 4-3/4" DC + 1 Std 3-1/2" DP + X.O.S + D.Pin (4-1/2" IF) + 6-1/2" Junk Sub + 6 15/16" Junk Sub] and RIH to 226m, while using safety clamp & change Elevator, F/U BHA and Break Circ. Cont. RIH w/ 6" Milling BHA BAH f/ 226 to 3802m (7" L.Lap) followed by 5" DPs on Elevator, while Break Circ. Every 15Stds, w/ NL-NG. Conn. TDS & RIH w/ 6" Milling BHA w/ Wash Dn f/ 3802 to 3926.6m, Obs. Holding up Strg Weight, perform Break Hi-Rate Circ. to clean TOF, Record Up & Dnward Strg Weight with & without Pupming, w/ NL-NG. Perform Milling Op. w/ 6" Milling BHA f/ 3926.6 to 3926.65m w/ applying parameters, while reciprocate Strg and using different parameters as DOT and Pump Hi-Vis Pill periodically, w/ NL-NG. Try to Cont. Milling Op. w/ 6" Milling BHA @ 3926.65m w/ applying parameter, while reciprocate Strg and using different parameters as DOT and to make sure Strg is free, Obs. No Progress, Fish got Pushed f/ 3926.65 to 3931.6m, then try to resume Milling Op. w/ same procedure, No Progress, w/ NL-NG.

Try to perform Milling Op. w/ 6" Milling BHA @ 3931.6m w/ applying parameters, while periodically reciprocating Strg and using different parameters as DOT, No Progress, Fish got Pushed f/ 3931.6 to 3932.6m, w/ NL-NG. Resume trying to perform Milling Op. w/ 6" Milling BHA @ 3932.6m w/ applying parameters, while periodically reciprocating Strg and using different parameters as DOT, No Progress, w/ NL-NG. POOH 6" Milling BHA f/ 3932.6 to surface, 'while Circ. C.W.H, W/ NL-NG. L/D 6" Mill (20%) & rest of BHA, while Circ. C.W.H, W/ NL-NG.

P/U & M/U 2" × 4" Fishing BHA including [2" × 4" Taper tap + 4-3/4" Bit Sub + 1Jt 4-3/4" DC + Fishing jar + 6 Stds 4-3/4" DC + 1 Jt 3-1/2" HWDP + X.O.S], while using safety clamp and RIH to 188m, F/U BHA and Break Circ. , w/ NL-NG. Cont. RIH w/

2" × 4" Fishing BAH f/ 188 to 3802m (7" L.Lap) followed by 5" DPs on Elevator, while F/U Strg every 15Stds, w/ NL-NG. Conn. TDS & Resume RIH w/ 2" × 4" Fishing BAH w/ Wash Dn f/ 3802 3930m, w/ NL-NG. Record Up & Dnward Strg Wt. with & without Pumping, Perform Break Circ. On TOF, Work on Fish w/ 2" * 4" Taper Tap Sev. Times to engage w/ Fish, No Succ. , w/ NL-NG. Work on Fish w/ 2" * 4" Taper Tap Sev. Times to engage w/ Fish, No Succ. , w/ NL-NG. POOH 2" × 4" Fishing BAH f/ 3932.6 to Surface, L/D Taper Tap, Without Obs. Effect Of Engage , while Circ. C.W.H, w/ NL-NG.

M/U & RIH W/5-3/4" Impression Block + X.O.S 3-1/2" Reg pin * If Box + 2 STDs 4-3/4" DC + 4 STDs 3-1/2" DP + X.O.S & Follow By 5" DP to 2700m While F/U String W/NL-NG Till M.N. Cont RIH W/5-3/4" Impression Block + X.O.S 3-1/2" Reg pin * If Box + 2 STDs 4-3/4" DC + 4 STDs 3-1/2" DP + X.O.S & Follow By 5" DP to 3932m (TOF) While F/U String W/NL-NG. Work On Fish W/Impression Block, RIH To TOF Took Weight W/Max 1 Klbs, (Confirm TOF), Circ Mud 'For Cleaning TOF, Apply Max 15Klbs Weight On Impression Block & Jerk Down W/ 'Max 15Klbs, 2 Steps. POOH W/5-3/4" Impression Block to Surface. Obs. Marks On the IB. Change TDS IBOP.

M/U & RIH W/5-7/8" M.M.J.Mill(5*15/32", T.S.E.KH, S/N: 621)+ B.Sub + 7 STDs 4-3/4" DC + 1 STDs 3-1/2" DP + X.O.S & Follow By 5" DP To 1200m While F/U string W/NL-NG Till M.N. Cont. RIH W/5-7/8" M.M.J.Mill BHA & Follow by 5" DP to 3802.7m(7"L.L) on Elevator While F/U String. Cont. RIH W/Wash Down to 3932.6m (TOF) W/NL-NG. Start Milling The Fish F/ 3932/6m to 3933m. Cont Milling W/5-7/8" M.M.J.Mill The Fish F/ 3933m to 3933.3m. Pump Hi Vis Pill, Pump Mud To Clean The Shakers. POOH To 3300m While Circ. F/Cross Wellhead W/NL-NG. L/D 5-7/8" M.M.J.Mill While Circ. F/Cross Wellhead W/NL-NG.

M/U & RIH W/Taper Tap 2" * 4" Catch Size (Cylindersazi, 3*16/32" port, S/N:CS6668) + B.sub + 1 jt 4-3/4" DC + 4-3/4" Fishing Jar + 6 STD 4-3/4" DC + 1 Jt 3-1/2" HWDP+ X.O.S & Follow by 5" DP to 3802.7"m(7" L.L). Cont. RIH W/Wash Down To 3933.3m (TOF). Record String Weight W/Downward & Upward W/Pump Off & Diff. F.rate, 'Catch The Fish W/Taper Tap 2" * 4", Pull Out String W/Max. 40klb Weight,Obs. Release The Fish F/Taper Tap @ several Times Till M.N. Catch The Fish W/Taper Tap 2" * 4" W/Fishing Parameters. Try To Pull Out String, Obs. Max.120klb Overpull on Indicator, Work On The Fish W/Downward & Upward & Firing Fishing Jar Several times, Release the Fish F/Taper tap while Work on it & Re-Catching Several Step's, Succ. in Movement Fish, Pull out String W/max. 130klb Overpull To 3875m. Cont.

POOH W/max.Drag 20-40klb to 3802.7(7" L.L), Cont. POOH to 820m While Circ. F/Cross Well head, NL-NG. Cont POOH W/Taper Tap 2" * 4" to Surf, No. Observe Recover Any Fish. L/D It.

M/U & RIH W/Taper Tap 2" * 4" Catch Size(Cylindersazi) + Same BHA & Follow By 5" DP To 2772 m While F/U String NL-NG Till M.N. Cont. RIH W/Taper Tap 2" * 4" Catch Size(Cylindersazi) + Same BHA & Follow by 5" DP to 3802.7"m(7" L.L). Cont. RIH W/Wash Down To 3925.2m, Took Weight. Record String Weight W/Downward & Upward String W/Pump Off & Diff. F.Rate, Catch The Fish & Work on It. Release Fish While Pull Out (10m) 'W/Max.50klb Overpull & Re-Catching Several Step's, Finally Decided To POOH In Order To Check The String. Cont POOH To 97m While Circ. F/Cross Well Head NL-NG Till M.N. Cont. POOH W/Taper Tap 2" * 4" Catch Size(Cylindersazi) To Surf, No. Observe Recover Any Fish. L/D It.

M/U & RIH W/6" M.M.J.Mill (T.S.E.KH)+ B.Sub + 7 STDs 4-3/4" DC + 1 STDs 3-1/2" DP + X.O.S & Follow By 5" DP To 1660m While F/U string W/NL-NG. Cont. RIH W/ 6" M.M.J.Mill (T.S.E.KH)+ B.Sub + 7 STDs 4-3/4" DC + 1 STDs 3-1/2" DP + X.O.S & Follow By 5" DP To 3230 m While F/U String W/NL-NG. Cont. RIH W/ 6" M.M.J.Mill (T.S.E.KH)+ B.Sub + 7 STDs 4-3/4" DC + 1 STDs 3-1/2" DP + X.O.S & Follow By 5" DP To 3933/44 m Took Weight While F/U String W/NL-NG. Start Milling & Pushing F/ 3933/44 m to 3938/35m. Cont Milling & Pushing F/ 3938.35m T/ 3940.3 m (Totally : 6.86m) While Pump Hi-Vis Peridically, Try To Cont Milling & Pushing With Applying Different Parameters, No Progress. Pump Hi Vis Pill, Pump Mud To Clean The Shakers. POOH W/ 6" M.M.J.Mill to Surface, Obs. 70% Used, L/D It.

M/U & RIH W/Assembly 5-5/8" O. Shot GJ-TY Type Included: Guide+Bowel(Loaded W/ 3-1/2"M.C & 3-1/2" B.G)+Top Sub + 2 STDs 4-3/4 DC + 11 Jts 3-1/2" DP + X.O.S + 1jt 5" DP + 6-1/2" Fishing .Jar & Follow by 5" DP to 2636m NL-NG Cont. RIH w/ Assembly 5-5/8"O.Shot BHA & Followed by 5"DPs f/ 2636 to 3940.68m (Confirm Top Fish), Pump 30 BBL HI.Vis Pill & Break Circ. to Cleanning The Top of Fish, Record String Weight w/ Downward & Upward w/ Pump off & Diff. F.Rate, Catch The Fish w/ 5-5/8"O.Shot w/ Fishing Parameters. Try to Pull Out String w/ Max. 150klb Overpull on Indicator With 5.20m Movement Fish, Work on the Fish Downward & Upward in Several Times, Cont. Work on Fish w/ Max. 180 Klb Overpull, Obs. Drop Overpull Suddenly. POOH For Check String to Surf., L/D Overshot, Obs. Recover 38cm of Fish Neck f/ Inside Overshot (Obs. Crossion & Washout on Fish Neck), Work on Release Fish in Progress, While Circ. Cross Wellhead, w/ N.L-N.G.

M/U & RIH w/ Assembly 5-5/8"Over Shot GJ-TY Type Included: Guide + Bowel (Loaded w/ 3-1/2"M.C & 3-1/2"B.G) + EXT. Joint + Top Sub + 7 Jts 4-3/4"DC + 10 Jts 3-1/2"DP + X.O.S + 1Jt 5"DP + 6-1/2"Fishing Jar & Followed by 5"DPs to 310m, w/ N.L-N.G, Cont. RIH f/ 310 to 3930m, Break Circ. Mud, Record String Weight w/ Downward & Upward w/ Pump off & Diff. Flow Rate, Cont. RIH to 3939.3m, Took Weight (Confirm Top of Fish). Pump 30 bbl HI-Vis Pill & Circ. Out the Pill to Cleanning the Top of Fish, Catch the Fish w/ 5-5/8"O.Shot w/ Fishing Parameters. Try to Pull Out String w/ Max. 100 klb Overpull on Indicator, Work on the Fish Downward & Upward in Several Times, No Success, w/ N.L-N.G. Cont. Work on the Fish & Try to Pull Out String Upward w/ Max. 170 klb Overpull & Downward w/ Max. 40klb Weight w/ Apply Max. 4 Kft.lb Torque Downward in Several Times, No Success, w/ N.L-N.G. Cont. Work on the Fish & Try to Pull Out String Upward w/ Max. 210klb Overpull & Downward w/ Max. 100klb Weight in Several Times, No Success, w/ N.L-N.G. Apply Max. 4 Kft.lb Torque, Obs. Rotation of String, Work on Pull Out the String w/ Rotation (RPM: 20), Obs. Got Free Pipes. POOH 5-5/8"O.Shot to Check String f/ 2939.3 to 2430m on Elevator, While Obs. Inside the String is Full of Mud & Using Mud Box, While Circ. Cross Wellhead. Cont. POOH 5-5/8" Fishing BHA f/ 2430m to surface on Elevator, Obs. Fish Got Recovered [Total Length: 17.49m (3-1/2" Pup Jt: 0.93m + 1Jt of 3-1/2"TBG: 9.5m + 3-1/2" X.O.S: 0.87m + 3-1/2" NO-GO L.Nipple: 0.39m + 3-1/2" Pup Jt: 1.435m + 3-1/2" X.O.S: 0.88m + 3-1/2"TBG Fish Neck: 3.49m)], Release Fish f/ 5-5/8"Overshot and L/D the Same, while Circ. Cross Wellhead, w/ N.L-N.G.

P/U & M/U 6"M.M Junk Mill (New, T.S.E.KH.Co Esfahan, S/N: 433, w/ 5*16/32"Nozzle Port) & RIH w/ 4-3/4"Bit Sub (Float in) + 7 STDs 4-3/4"DC + 3 Jts 4-3/4"DC (Jt by Jt) + 1Jt 3-1/2"DP + X.O.S + D.Pin (4-1/2"IF) + 6-1/2"Junk Sub + 6 15/16"Junk Sub] & 1 STD 5"DP to 263m, Circ. Mud as 1 Cap of String, Cont. RIH w/ 6"Clean Out BHA Followed by 5"DPs f/ 263 to 1050m, w/ N.L-N.G. Cont. RIH w/ 6"Clean Out BHA & Followed by 5"DPs f/ 1050 to 3400m, While F/U String & Break Circ. Every 15 STDs, w/ NL-NG. Cont. RIH f/ 3400 to 3930m, While Pass 7"L.Lap (@3802m) Gently, F/U String & Break Circ. Every 15 STDs, w/ NL-NG. Cont. RIH w/ Pumping & Rotation f/ 3930 to 3951.5m, Took Weight. Start Milling f/ 3951.5 to 3951.75m, While Due to an Unusual & Sudden Increase in Torque, String Got Stalled During Milling Operation in Several Times, While Pump 30 bbl Hi-Vis Pill, w/ N.L-N.G. Decided to POOH, Circ. BTM's Up & work on junk subs, Start POOH 6"Clean Out BHA f/ 3951.75 to 3078m on Elevator, While Circ. Cross Well Head, w/ N.L-N.G. Cont. POOH 6"Clean Out BHA f/ 900m to surface, While L/D 2No J.Sub (4lb Junk Recoverd), While Circ. Cross Well Head, w/ N.L-N.G. L/D 6"M.M Junk Mill (15%Used, Obs. 5 2/16"-6"Ring Out) & While Circ. Cross Wellhead, w/ N.L-N.G.

P/U & M/U 5-3/4"Taper Mill (New, T.S.E.KH.Co Esfahan, S/N: 040, w/ 6*18/32"Nozzle Port) + 4-3/4"Bit Sub (Float in) + 1Jt 3-1/2"DP + X.O.S + D.Pin (4-1/2"IF) + 7-1/2"Junk Sub + 6-15/16"Junk Sub and RIH to 234m, F/U BHA & Break Circ. Mud. Cont. RIH Followed by 5"DPs f/ 234 to 400m, w/ N.L-N.G. Cont. RIH Followed by 5"DPs f/ 400 to 1673m, While F/U String & Break Circ. Every 15 STDs, w/ N.L-N.G. Cont. RIH w/ 5-3/4"Clean Out BHA Followed by 5"DPs f/ 1673 to 3936m, While F/U String & Break Circ. Every 15 STDs, w/ N.L-N.G. Cont. RIH w/ Wash Down f/ 3936 to 3951.75m, Took Weight, Perform Milling to Take Mark on Taper Mill, Pump 30bbl Hi-Vis Pill, Circ. BTM's Up, w/ N.L-N.G. POOH 5-3/4" Clean Out BHA f/ 3951.75 to 532m, while Circ. Cross Well Head, w/ N.L-N.G. Cont. POOH 5-3/4"Clean Out BHA f/ 532m to Surface, L/D 5-3/4"Taper Mill & Rest of BHA, Obs. Mark on 5-3/4"Taper Mill, While Circ. C.W.H, w/ N.L-N.G.

P/U & M/U 3-1/2"M.M Junk Mill (w/ 5*10/32"Nozzle Port) + 3-1/8"Bit Sub + 17Jts 3-1/8"DC (Jt by Jt)+ 3-1/2"X.O.S (2-7/8"Pac Pin * 3-1/2"IF Box) + 4-3/4"D.Pin + 4-3/4"Bit Sub (Float in) + 5 STDs 3-1/2"DP (M/U 1 STD Jt by Jt) + 6-1/2"X.O.S, While Clean & Pass 1"Rabbit Thru. all Added 3-1/8"DC & 3-1/2"DP to the Current BHA & using safety clamp and RIH to 307m, Break Circ. To make sure Strg is not plugged, Change Elevator f/ 3/5" to 5". Cont. RIH w/ 3-1/2" Clean out BHA f/ 307 to 2407m On Elevator, while F/U Strg and Break Circ. Every 5 Stds, w/ NL-NG. Perform Circ. @ 2407m, w/ NL-NG. Cont. RIH w/ 3-1/2" Clean out BHA f/ 2407 to 2552m On Elevator, attempt to Break Circ. After RIH 5 Stds, , No Success, Obs. String is plugged, Work on Strg to make it Unplugged, Strg got unplugged, Perform Circ. (300bbl Mud), w/ NL-NG. Resume RIH w/ 3-1/2" Clean out BHA f/ 2552 to 2692m On Elevator, attempt to Break Circ. After RIH 5 Stds, No Success, again Obs. String is plugged, Work on Strg. Cont. Work on Strg to make it unplugged, Strg got unplugged and SPP got back to Normal, Perform Circ. (150bbl), attempt to Resume RIH w/ 3-1/2" Clean BHA, Obs. Pipe Screen Stem is stuck in upper IBOP, Work on stuck Pipe Screen Stem and make it free, check the IBOP functionality and prepare to Resume RIH w/ 3-1/2" Clean out BHA, while Circ. C.W.H, w/ NL-NG. Cont. RIH w/ 3-1/2" Clean out BHA f/ 2692 to 3580m On Elevator, while F/U Strg and Break Circ. Every 2 Stds. Meanwhile Perform Circ. w/ 150bb Fresh Mud, after RIH the Last two 5" DPs attempt to Break Circ. , Obs. Strg is plugged, Work on Strg to make it Unplugged, Strg got unplugged, Perform Circ. (150bbl Mud), w/ NL-NG. Resume RIH w/ 3-1/2" Clean out BHA w/ Wash Dn f/ 3580 to 3951.75m (Obstruction Depth), w/ NL-NG. Try to pass Obstruction w/ applying 2klbs WOB, No Success, BTM's Up and POOH 3-1/2" BHA. POOH 3-1/2" Clean out BHA f/ 3951.75 to 2432m On Elevator, while Circ. C.W.H, w/ NL-NG. Cont. POOH 3-1/2"

Clean out BHA f/ 2432m to surface On Elevator, L/D 3-1/2" M.M.J.Mill & Rest of BHA, while Circ. C.W.H, w/ NL-NG.

P/U & M/U 7" × 9-5/8" Scrapping BHA including 6" J.J.M.Mill + 7" Scraper + 4-3/4" Bit Sub + 11 Jts of 4-3/4" DC + 6-1/2" X.O.S + 6-1/2" D.Pin + 9-5/8" Scraper + 4-3/4" Bit Sub [float-in] + 1 Std of 6-1/2" DC and RIH to 135m, F/U BHA & Break Circ. w/ NL-NG. Cont. RIH w/ 7" × 9-5/8" Scrapping BHA f/ 135 to 3605m On Elevator, while F/U Strg Every 15Stds, w/ NL-NG. Seek to perform Break Circ. at last 15Stds @ 3605m, Obs. Strg is plugged, work on Strg to make it unplugged, No success, w/ NL-NG. POOH 7" × 9-5/8" Scrapping BHA f/ 3605 to 3464m On Elevator, while Circ. C.W.H, Conn. TDS and Work on String to make it unplugged, No Success, Attempt to POOH 10Stds of 5" DPs more, Obs. Pipe Screen Stem is stuck on Upper IBOP, Work on stuck Pipe Screen Stem to make it free, Ok, w/ NL-NG. POOH 7" × 9-5/8" Scrapping BHA f/ 3464 to 3176m On Elevator, while Circ. C.W.H, Conn. TDS and Work on String to make it unplugged, No Success, w/ NL-NG. POOH 7" × 9-5/8" Scrapping BHA f/ 3176m to surface On Elevator, L/D 6" Mill & Rest of BHA, Obs. Debris resulting of preforming Scrapping Operation in both 6" Mill & 4-3/4" Bit Sub, while Circ. C.W.H, w/ NL-NG.

P/U & M/U 7" × 9-5/8" Open-End Scrapping BHA including 4-3/4" X.O.S + 7" Scraper + 4-3/4" Bit Sub [float-in] + 11 Jts of 4-3/4" DC + 6-1/2" X.O.S + 6-1/2" D.Pin + 9-5/8" Scraper + 4-3/4" Bit Sub + 1 Std of 6-1/2" DC and RIH to 134m, F/U BHA & Break Circ. w/ NL-NG. Cont. RIH w/ 7" × 9-5/8" Open-End Scrapping BHA f/ 134 to 3802m (7" L.Lap) On Elevator, while Scrapping 9-5/8" CSG & F/U Strg Every 15Stds, w/ NL-NG. Cont. RIH w/ 7" × 9-5/8" Open-End Scrapping BHA f/ 3802 to 3900m w/ Wash Dn, while Scrapping 7" LNR & 9-5/8" CSG, Pump 50bbl Hi-Vis Pill, then perform Hi-Rate CBU till Shakering it out @ 3900m, w/ NL-NG. POOH 7" × 9-5/8" Open-End Scrapping BHA f/ 3900 to 1830m On Elevator, while Circ. C.W.H, w/ NL-NG. POOH 7" × 9-5/8" Open-End Scrapping BHA f/ 1830m to Surface On Elevator, L/D BHA, while Circ. C.W.H, w/ NL-NG.

Wireline Logging Operation Summary:

Change 13-5/8" 10k Top Rams f/ 2-7/8" - 5" VBR to 4-1/2" * 7" VBR, perform Press. Test on BOP, Ok, L/D Mouse Hole & R/U & set 7" Shooting Nipple, P/U & M/U Wire Line BOP on Shooting Nipple, held PJSM, perform Wire Line BOP Test and R/U Wire Line Tools and prepare for RIH w/ Wire line Tools, while Circ. C.W.H, w/ NL-NG. RIH w/ Wire Line Tools as Run1# CBIL-CDR-GR-CCL for 7" LNR f/ surface to 3944m with 30 m/min speed and record normal tension every 500m, Took Weight, Start Log Up f/ 3944 to 3797m (5m above 7" L.Lap) with 4m/min speed and fully cover the logging interval, all in presence of Client Wellsite Witness, Log Dn in 7" LNR was considered as Repeat section at the request of Client Wellsite Witness, , POOH Wire Line Tools f/ 3797m to surface with 30 m/min speed while Circ. C.W.H, w/ NL-NG.

Change the overbody Centralizers according to 9-5/8" CSG size, M/U Tool string and perform surface checks, RIH w/ Wire Line Tools as Run2# CBIL-CDR-GR-CCL for 9-5/8" CSG f/ surface to 3802m (7" L.Lap) with 30 m/min speed and record normal tension every 500m, Start Log Up f/ 3802 to 1500m with 4m/min speed and fully cover the logging interval, all in presence of Client Wellsite Witness, while Circ. C.W.H, w/ NL-NG.

Cont. Log Up f/ 1500m to surface with 4m/min speed and fully cover the logging interval, all in presence of Client Wellsite Witness, while Log Up f/ 260 to 160m as Repeat section at the request of Client Wellsite Witness, R/D Wire Line Eqp. & 7" Shooting Nipple, R/U & Set Mouse Hole, Change 13-5/8" 10k Top Rams f/ 4-1/2" * 7" VBR to 2-7/8" - 5" VBR, perform Press. Test on BOP, Ok, prepare for P/U & M/U 6" Clean Out BHA, while Circ. C.W.H, w/ NL-NG.

Milling Operation Summary:

P/U & M/U 6"M.M.J Mill (New, T.S.E.KH.Co Esfahan, w/ 5*16/32"Nozzle Port) & RIH w/ 4-3/4"Bit Sub (Float in) + 7 STDs 4-3/4"DC + 1Jt 3-1/2"DP + X.O.S + D.Pin (4-1/2"IF) + 7-1/2"Junk Sub + 6 3/4"Junk Sub] to 207m, F/U BHA & Break Circulation, w/ N.L-N.G. Cont. RIH w/ 6"Clean Out BHA f/ 207 to 3802m (7" L.Lap) Followed by 5"DPs On Elevator, While Break Circ. Every 15 STDs, w/ N.L-N.G. Conn. TDS & Cont. RIH w/ 6"Clean Out BHA f/ 3802.7 to 3840m Followed by 5"DPs w/ Wash Dn, w/ N.L-N.G. Cont. RIH w/ 6"Clean Out BHA f/ 3840 to 3951.5m (Obstruction Depth) Followed by 5"DPs w/ Wash Dn, Took Weight @ 3951.5m, Pump 20bbl Hi-Vis Pill and attempt to pass Obstruction w/ applying parameters. Strg got stalled, check Strg, Obs. Strg is

stuck, work on Strg to make it free, Strg got free, Attempt to RIH w/ 6"Milling BHA to pass Obstruction, Took Weight @ 3951m, try to Cont. RIH w/ applying parameters. suddenly Obs. Strg Wt. got back to normal Weight, attempt to chase the Obstruction w/ 6" Clean out BHA, Took Weight @ 3951.75m, w/ NL-NG.

Cont. Milling w/ 6" Clean out BHA f/ 3951.75 to 3952.3m w/ applying parameters while periodically check Strg Every 0/5m to make sure Strg is free, Pump Hi-Vis, check the Ditch Magnet and Sh.Shakers, Obs. LCM and Debris on Shale Shakers during Milling & Cleaning, w/ NL-NG. Perform Circ. @ 3952.3m , w/ NL-NG. Cont. Milling w/ 6" Clean out BHA f/ 3952.3 to 3952.4m w/ applying parameters. while periodically check Strg to make sure Strg is free, Pump Hi-Vis, check the Ditch Magnet and Sh.Shakers, Obs. LCM, Magneset and Debris on Shale Shakers during Milling & Cleaning, w/ NL-NG. Cont. Milling & Cleaning w/ 6" Clean out BHA f/ 3952.4 to 3956.3m w/ applying parameters. while periodically check Strg Every 0/5m to make sure Strg is free, Pump Hi-Vis, check the Ditch Magnet and Sh.Shakers, Obs. Debris on Shale Shakers during Milling & Cleaning, w/ NL-NG. Cont. Milling w/ 6" Clean out BHA f/ 3956.3 to 3956.4m w/ applying parameters. while periodically check Strg to make sure Strg is free, Pump Hi-Vis, check the Ditch Magnet and Sh.Shakers, Obs. Debris on Shale Shakers during Milling & Cleaning, w/ NL-NG. Cont. Milling & Cleaning w/ 6" Clean out BHA f/ 3956.4 to 3960.8m w/ applying parameters. while periodically check Strg Every 0/5m to make sure Strg is free, Pump Hi-Vis, check Ditch Magnet and Sh.Shakers, Obs. Debris on Shale Shakers during Milling & Cleaning, w/ NL-NG.

Cont. Milling & Cleaning w/ 6" Clean out BHA to 3965m w/ applying parameters, Strg got stalled and stuck Sev. Times, work on it and make it free, while periodically check Strg Every 0/5m to make sure Strg is free, Pump Hi-Vis, check Ditch Magnet and Sh.Shakers, Took Weight @ 3965m (4m above the depth of 4-1/2" Production L.Lap announced by client, 3969m), attempt to pass the obstruction @ 3965m w/ applying different parameters, No success, to avoid damaging 7" LNR and 4-1/2" Production L.Lap, a decision was made to POOH, Pump Hi-Vis Pill and prepare for start POOH 6" Clean out BHA to check 6" M.M.J.Mill, w/ NL-NG. POOH 6" Clean out BHA f/ 3965 to 3831m On Elevator, then RIH back w/ same BHA to 3965m to check the passed interval in 7" LNR , Ok, while Break Circ. @ 3965m, w/ NL-NG. POOH 6" Clean out BHA f/ 3965 to 3347m On Elevator, while Circ. C.W.H, w/ NL-NG.

Cont. POOH cheching 6” M.mill to surface while recover 10lb junk (related to corrosion on Com. String) f/ junk sub.

M/U & RIH W/3-1/2" M.Mill + B.Sub (float in) + 10 jts 3-1/8" DC Jts By Jts + x o.s + 9 jts 2-7/8" DP Jts By Jts + X.O.S + D.pin + 4-3/4" j.Sub + 5" STD 3-1/2" 'DP + X.O.S & Follow by 5" DP to 1270 m While F/U String Each 5 STDs W/NL-NG. Cont. RIH W/3-1/2" M.Mill BHA & Follow by 5 DP to 3802.7m (7"L.L) While F/U String Each 5 STDs , Cont. RIH W/Wash Down to 3965m, Took weight. Cont. RIH W/Milling & Cleaning to 3973m, Stall String & Overpull @ Several point, Cont. RIH W/Milling & Cleaning To 3985m, While Checking the Condition Of The Drilling String Every 5m by Upward and Downward the string,Ok. Meanwhile Obs. Trace of oil on the Shaker, Check Mwt Conditions Regularly, Ok. W/NL-NG.

Cont. RIH W/Milling & Cleaning To 3990m, Try to Cont. Cleaning & Milling, W/Pump Hi Vis Pill , Upward & Downward String .Obs. Stall String @3990m, POOH & String Stuck @ 3986m, Work on Stuck, Finally got free. POOH W/Pump out to 3790m (Above 7" L.L), Circ. Mud, RIH W/Pumping to 3990m, Resume Milling & Cleaning F/3990 to 3990.2m, Try To Cont. OP. No Progress. Start POOH W/ 3 1/2" J.MILL To Surface, L/D 10 Jts 3-1/8" DC '9 jts 2-7/8" DP, 5-3/8" J.Sub & 3-1/2" J.Mill: 100% Used, ,While Change Tools For '3-1/2" & 2-7/8" DP &3-1/8" DC & Circ.Mud F/Cross Wellhead W/NL-NG.

RIH W/ Clean out BHA As Open End W/10 Jts 3-1/8" DC + X.O.S + 10 Jts 2-7/8" + X.O.S + 5 STDs 3-1/2" DP + X.O.S + D.Pin + B.Sub(Float in) & Follow By 5"DP To 337 m. Cont. RIH W/ Clean out BHA As Open End & Follow By 5"DP To 3450m While F/U String Every 10 STDs, Cont. RIH to 3802.7m(7" L.L) While F/U String Every 5 STDs, Cont. W/Wash Down to 3990m, Took Weight , Try to Pass This Point W/Max. F.rate & Pump Hi Vis Pill For Cleaning, No. Succ. Circ BTM's Up & Work On Junk Sub @ Several Time. Start POOH W/ Clean out BHA As Open End T/ 3494m & NL.NG.

Cont RIH W/5-1/8" Dressing Mill BHA & Follow By 5" DP To 3800m While F/U String W/ NL-NG Cont. RIH W/Wash Down To 3966m,Took Weight, Pumping W/Hi F.Rate, Apply Parameters For Dressing & Cleaning the Entry Profile @ Tieback Sleeve(ID:5-1/4") : Weight on:max.:2Klb, Rot.: 30rpm, F.rare:60gpm, 'Press.: 250-550psi. Check Again @ 2 Steps, Ok. POOH W/5-1/8" Dressing Mill BHA To 2130m While Circ. F.Cross Well Head W/ NL-NG.

Cont POOH W/5-1/8" Dressing Mill BHA To 460 m While Circ. F.Cross Well Head W/ NL-NG. Cont POOH W/5-1/8" Dressing Mill BHA F/ 460m To Surface & L/D 5-1/8" Dressing , Change Handling Tools 3 1/8" D.C & 2 7/8" D.P.

M/U & RIH W/ 3 1/2" M.M.J.Mill (T.S.E.KH, S/N: 097, 5-10/32" Port) + Bit Sub (Float In) + 10 Jts 3 1/8" D.C (Jts By Jts) + X.O.S + 9 Jts 2 7/8" D.P (Jts By Jts) + XOS + D.PIN + 5 3/8" J.SUB + 5 STD 3 1/2" DP + X.O.S & Follow By 5" D.P To 3056m While Fill Up String Every 15 STD W/ NL-NG. Cont RIH W/ 3 1/2" M.M.J.Mill (T.S.E.KH, S/N: 097, 5-10/32" Port) + Bit Sub (Float In) + 10 Jts 3 1/8" D.C (Jts By Jts) + X.O.S + 9 Jts 2 7/8" D.P (Jts By Jts) + XOS + D.PIN + 5 3/8" J.SUB + 5 STD 3 1/2" DP + X.O.S & Follow By 5" D.P F/3056 T/3850m While Fill Up String Every 10 STD & Cont RIH With Pump Down T/ 3990.4m, Took Weigh, Pump 20 BBl Hi-Vis Pill, W/NL.NG.

Start Milling F/3990.4m T/3990.65m, Try To Cont. Milling & Apply Different Parameters, No Progress, Pump 30BBL Hi.Vis Pill& Circ BTM's Up, Work On J.Sub, Several Times. Start POOH F/3990.65m T/ 3969m, Obs. Over Pull, String Stuck @3969m (Inside 4-1/2" P.Liner), Work On Stuck ' With Max 15Klb Weight Downward & Apply 3KLb.Ft TQ Several Times, String Got Free. Cont. 'POOH On Elevator F/3990.65 To 3313m While Circ Mud Cross Well Head W/ NL.NG. Cont. POOH W/ 3-1/2 M.Mill F/3313m to Surface While L/D 5-3/8" J.sub (No Junk Reco.) & 3-1/2" M.Mill, Change Handling Tools.

M/U & RIH W/5-1/8" Polish Mill(PPA) + 2 STDs 4-3/4 DC + 1STDs 3-1/2" DP to 80m W/ NL.NG, Cont. RIH W/5-1/8" Polish Mill (PPA) + 2 STDs 4-3/4 DC + 5 STDs 3-1/2" DP + X.O.S + D.Pin + B.Sub (Float in) & Follow by 5" DP to 3188m While Fill Up String Every 10 STD W/ NL.NG. Cont. RIH W/5-1/8" Polish Mill (PPA) BHA & Follow By 5" DP To 3966.12m(4-1/2" L.L), Pump Mud W/Hi F.Rate. W/NL.NG. String Took Weight, Obs. Inc, Press. To 550psi, Work on it & Pass This Point, Cont. RIH To 3967.82m W/Out Took Weight, Obs. Stall String @ 3967.82m Several Times. Finally Polishing & Cleaning the entry profile At the top of the PBR @ 3967.84m W/ NL.NG.

Start POOH On Elevator F/3967.82 To 2709m While Circ Mud Cross Well Head W/ NL.NG. Cont POOH W/5-1/8" Polish Mill (PPA) BHA On Elevator To Surface & L/D 5-1/8" Polish Mill (PPA) and Obs 1/8" Under Gauge without observe Ring mark on it.

M/U & RIH W/ 3-1/2" M.Mill (HD Cylindersazi, S/N: CS6645, 4*12/32" Port) + Bit Sub (Float In) + 10 Jts 3 1/8" D.C + X.O.S to 93m. Cont. RIH W/ 3-1/2" M.Mill BHA (HD Cylindersazi, S/N: CS6645, 4*12/32" Port) & Follow By 5" D.P To 3802.7m(7" L.L), Cont. Wash Down to 3967m, Took weight, Cont. RIH W/Cleaning & Smooth Interval Depth (3967-3968m), Cont. Wash Down to 3990.65m, Took weight, Start Milling to 3990.78m, Try To Cont Milling Operation With Apply Different Parametrs.

Try to Cont. Milling Operation w/ 3-1/2"M.M Junk Mill BHA (HD Cylindersazi, S/N: CS6645, w/ 4*12/32"Port) & Apply Different Parametrs & Pump Hi-Vis Pill @ Several Time, No Success. POOH f/ 3990.78m to 320m, While L/D 5-3/8"J.sub (Obs. Recovered 1.2 lb Junk), While Circ. Cross Wellhead, w/ N.L-N.G . Cont. POOH f/ 320m to Surf., L/D 3-1/2"M.M Junk Mill (40%Used, Obs. 3" to 3-1/2"Ring Out) L/D 9 JTs 6-1/2"DC, While Circ. Cross Wellhead, w/ N.L-N.G.

P/U & M/U 3-1/2"M.M Junk Mill (Cylindersazi, S/N: CS6627, w/ 4*12/32"Port) & RIH w/ 3 1/8"Bit Sub (Float in) + 10 Jts 3 1/8"DC + X.O.S + 6 Jts 3 1/2"DP + D.PIN + 5 3/8"Junk Sub + 12 Jts 3 1/2"DP + X.O.S & Followed By 5"DPs to 2600m, While Fill Up String Every 10 STDs, Cont. RIH to 3900m, While Fill Up String Every 10 STDs, w/ N.L-N.G. Cont. RIH w/ Pump Out (GPM: 70, SPP: 570psi) to 3971m (4-1/2"L.Lap@ 3966m), P/U New Stand of 5"DP, Try to Circ. Mud Inside String, Obs. Increased Pressure & Plugged String, Rack Back Last Stand in Derrick, POOH to 3943m, Work on String & Uplugged it, Run Back w/ Pumping (GPM: 100, SPP: 1190psi) to 3990.6m, Took Weight, w/ N.L-N.G.

Start Milling & Cleaning f/ 3990.6 to 3996m, While Pump Hi-His Pill Periodically & Check String to Make Sure It is Free. Cont. RIH w/ W&R & Cleaning to 4029m, While Check String to Make Sure It is Free, Ok, w/ N.L-N.G. Cont. RIH w/ W&R & Cleaning f/ 4029 to 4050m, While Check String to Make Sure It is Free, Ok, w/ N.L-N.G. Pump 20bbl Hi-Vis Pill @ 4050m, Circ. BTM's Up, While Reciprocate String, w/ N.L-N.G, Work on Junk Sub Several Times. Start POOH 3-1/2" Clean out BHA f/ 4050 to surface (4-1/2" P.L.Lap) w/ Pump out & Rotation, w/ N.L-N.G. L/D 3-1/2"M.M Junk Mill & Rest of BHA, Obs. Negligible Amount of Junk in Junk Subs, While Circ. Cross Wellhead, w/ N.L-N.G.

P/U & M/U 3-1/2"M.M Junk Mill (Cylindersazi, S/N: CS6627, w/ 4*12/32"Port) & RIH w/ 3 1/8"Bit Sub (Float in) + 10 Jts 3 1/8"DC + X.O.S + 6 Jts 2-7/8"DP + X.O.S + D.PIN + 5 3/8"Junk Sub + 18 Jts 3 1/2"DP + X.O.S & Followed by 5"DPs On Elevator to 3966m, while F/U String & Break Circ. Every 10STDs, w/ N.L-N.G. Cont. RIH w/ Wash Down f/ 3966 (4-1/2"P.L.Lap) to 4050m, Pump 20bbl Hi-Vis Pill and Circ. to Pill out Through 3-1/2"M.M.J.Mill, Cont. RIH w/ W&R f/ 4050 to 4050.8m, String Got Stalled, Attempt to P/U String, Obs. String is Stuck, Work on String Upward w/ Max. 25klbs Overpull in Several Times, No Success, Apply Max. 3kft.lb Torque at Neutral Point, String Got Free, w/ N.L-N.G. Cont. RIH w/ Wash & Ream Down f/ 4050.8 to 4057.5m, While Obs. Fluctuated Torque & Stall String Several Times, Meanwhile P/U & Check String Every 30cm to Make Sure it is Free, w/ N.L-N.G.

Cont. RIH w/ 3-1/2"Clean out BHA w/ Wash & Ream Down f/ 4057.5 to 4065m, String Got Stalled @ 4065, While Obs. Fluctuated Torque & Stall String Several Times, Meanwhile P/U & Check String Every 30cm to Make Sure it is Free, w/ N.L-N.G. Try to Pull Out String, Obs. Obstacle Upward, Work on it in Several Times, While Obs. Fluctuated & Sudden Increase in Torque, Pull Out String f/ 4065 to 4060m Centimeter by Centimeter w/ Speed Control to Avoid Sudden Increase in Torque, Cont. POOH to 4057m & Rack Back Last Stand, w/ N.L-N.G. Cont. POOH to 4057m & Rack Back Last Stand, w/ N.L-N.G. POOH 3-1/2" Clean out BHA f/ 4057 to 3969m (4-1/2" P.L.Lap) w/ Pump out & Rotation, w/ N.L-N.G. Cont. POOH 3-1/2" Clean out BHA f/ 3969 to 1940m On Elevator, while Circ. Cross Well Head, w/ N.L-N.G. Run Back f/ 1940 to 3929m On Elevator, While F/U & Break Circ. Every 10Stds, w/ N.L-N.G.

Cont. RIH w/ 3-1/2" Clean out BHA f/ 3929 to 4050m On Elevator, While F/U & Break Circ. Every 10STDs, w/ N.L-N.G. Pump & Spot 20bbl Salt Saturated Water (75pcf), Obs. The Well, Static. POOH 3-1/2" Clean out BHA f/ 4050 to surface, While Circ. Cross Well Head, w/ N.L-N.G. L/D 3-1/2"M.M.J.Mill (90% Used), While L/D 5-3/8"Junk Sub (Recovered 0.5 lb Junk). While Circ. Cross Well Head, w/ N.L-N.G.

Perforation Operation Summary:

R/U Sealand Wire Line Eqp. , RIH w/ Wire Line Tools Including [CCL + 2No. Dummy Gun (Max OD: 2-7/8", Length: 14m, Type: HSD, Wt: 430lb) as Run#1 to 4020m, POOH Wire Line Tools to Surface and L/D the same, All Done by Supervision of Client Witness, while Circ. C.W.H, w/ N.L-N.G.

Held PJSM, Announce Radio Silence and Connect Detonator, and RIH w/ Wire Line Tools Including [CCL + 1No. Loaded Gun w/ Max OD: 2-7/8", Length:6.45m, Type: HSD, Shot density: 6SPF, Phasing: 60° and Armed w/ 80 BulletsD, Wt: 480lb, Net Length: 4m] as Run#2 to 3979m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 3979 to 3975m, Obs. Electrical & Tension Cable Indications, POOH Wire Line Tools and L/D Wire Line Tools, Obs. All Bullets were Shot successfully, All Done by Supervision of Client Witness, while Circ. C.W.H, w/ N.L-N.G.

RIH w/ Wire Line Tools Including [CCL + 1No. Dummy Gun (Max OD: 4-1/2", Length: 6.45m, Type: HSD, Wt:500lb) as Run#3 to 3969m, POOH Wire Line Tools to Surface and L/D the same, All Done by Supervision of Client Witness, while Circ. C.W.H, w/ N.L-N.G. Wait on Day Light, while Circ. C.W.H and Monitor the Well, w/ N.L-N.G.

Prepare to Cont. Perforation Operation as per plan and Make Perforation Assy. Ready For Run#4, while Circ. C.W.H and Monitor the Well, Announce Radio Silence & Connect Detonator, and RIH w/ Wire Line Tools Including [CCL + 1No. Loaded Gun w/ Max OD: 4-1/2", Length:6.45m, Type: HSD, Shot density: 5SPF, Phasing: 72° and Armed w/ 67 Bullets, Wt: 570lb, Net Length: 4.02m] as Run#4 to 3963m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 3963 to 3959m, Obs. Electrical & Tension Cable Indications, POOH Wire Line Tools and L/D Wire Line Tools, Obs. All Bullets were Shot successfully, All Done by Supervision of Client Witness, while prepare Perforation Toos String as Run#5 and Circ. C.W.H, w/ N.L-N.G.

Announce Radio Silence & Connect Detonator, and RIH w/ Wire Line Tools Including [CCL + 1No. Loaded Gun w/ Max OD: 4-1/2", Length:6.45m, Type: HSD, Shot density: 5SPF, Phasing: 72° and Armed w/ 67 Bullets, Wt: 570lb, Net Length: 4.02m] as Run#5 to 3959m, Correlate the Depth, Fire the Gun & Shoot the Bullets at Interval 3959 to 3955m, Obs. Electrical & Tension Cable Indications, POOH Wire Line Tools and L/D Wire Line Tools, Obs. All Bullets were Shot successfully, All Done by Supervision of Client Witness, while Circ. C.W.H, Wait on Day Light, while Circ. C.W.H and Monitor the Well, w/ N.L-N.G.

Prepare to Cont. Operation as per plan and Make Perforation Assy. Ready For Run#6, while Circ. C.W.H and Monitor the Well, w/ N.L-N.G. Announce Radio Silence, Connect Detonator, and RIH w/ Wire Line Tools Including [CCL + 1No. Loaded Gun w/ Max OD: 4-1/2", Length:6.45m, Type: HSD, Shot density: 5SPF, Phasing: 72° and Armed w/ 67 Bullets, Wt: 570lb, Net Length: 4.02m] as Run#6 to 3953.5m , Obs. Holding Up, Attempt to Pass the same Depth Sev. Times, No Success, POOH Wire Line Tools f/ 3953.5m to surface, Disarm Loaded Gun and L/D Wire Line Equipment, while Circ. C.W.H and Monitor the Well, w/ N.L-N.G.

M/U and RIH w/ Wire Line Tools Including [CCL + 1No. Dummy Gun (Max OD: 4-1/2", Length: 7m, Type: HSD, Wt: 500lb) to 3953.5m, Attempt to Pass This Depth Sev. Times, No Success, POOH Wire Line Tools to Surface and L/D the same, while Circ. C.W.H and Monitor the Well, w/ N.L-N.G.

R/D Wire Line Equipment, 7" Shooting Nipple and Wire line BOP, P/U Mouse Hole and install in its position, P/U & M/U 11" Wear Bushing and RIH w/ the same and Set in T.H.S Bowl, while Monitor the Well, w/ N.L-N.G

P/U & M/U 5-7/8" M.M.J.Mill (10% Used, S/N: 618, T.S.E.KH, 5*15/32) and RIH w/ 4-3/4" Bit Sub (float-in) + 7Stds 4-3/4" DC + 1Stds 3-1/2" DP to 233m, Try to F/U BHA

& Break Circulation, Obs. String is Plugged, Work on String to make it unplugged, No Success, while Monitor the Well, w/ N.L-N.G. POOH 5-7/8" M.M.J.Mill & Clean out BHA to surface, Obs. Pipe Coating inside 5-7/8" M.M.J.Mill, Make it Unplugged, while Monitor the Well, w/ N.L-N.G.

P/U & M/U 5-7/8" M.M.J.Mill (10% Used, S/N: 618, T.S.E.KH, 5*15/32) and RIH w/ 4-3/4" Bit Sub (float-in) + 3Stds 4-3/4" DC + 4Stds 3-1/2" DP to 199.5m, F/U BHA & Break Circulation after RIH first 3-1/2" DP, w/ N.L-N.G. Cont. RIH w/ 5-7/8" Clean out BHA f/ 199.5 to 3645m followed by 5" DPs On Elevator, while F/U Strg & Break Circ. Every 15Stds, w/ N.L-N.G. Resume RIH w/ 5-7/8" Clean out BHA f/ 3645 to 3802m (7"L.Lap) followed by 5" DPs On Elevator, w/ N.L-N.G. Conn. TDS and Cont. RIH w/ 5-7/8" Clean out BHA w/ Wash Dn f/ 3802 to 3940m, w/ N.L-N.G. Cont. RIH w/ Soft Wash & Ream Dn f/ 3940 to 3951m, Took Weight @ 3951m, Start Milling & Smoothing 7" LNR f/ 3951 to 3969m (4-1/2" L.Lap) w/ Applying Parameters. Circ. 1.5times the Hole Volume, while Reciprocate Strg with/Without Pump out and Rotation Sev. Times to Make Sure the Interval is Smooth Enough, Obs. No Hold up and Overpull, then Spot 10bbl Salt Saturated Water (75pcf) as Balance @ 3969m, w/ N.L-N.G.

Start POOH 5-7/8" M.M.J.Mill & Clean out BHA f/ 3969 to 3710 On Elevator w/ Speed Control, while Circ. C.W.H, w/ N.L-N.G, Perform Static Flow Check @ 3710m for 30min, Well Static. Cont. POOH 5-7/8" M.M.J.Mill & Clean out BHA f/ 3710 to 3312m On Elevator, while Circ. C.W.H, w/ N.L-N.G. Cont. POOH 5-7/8" M.M.J.Mill & Clean out BHA f/ 3312m to Surface On Elevator, L/D 5-7/8" M.M.J.Mill (10% Used) and Rest of BHA, while Circ. C.W.H, w/ N.L-N.G.

Close Blind Rams, Set and Hang 7"Shooting Nipple & Installed 5K Wire Line BOP, Close 13-5/8"-10K Top Rams on Shooting Nipple, Perform Pressure Test on 7"Shooting Nipple & 5K Wire Line BOP Step by Step to 1200psi for 15min, Ok.

R/U Sealand Wire Line Eqp. , RIH w/ Wire Line Tools Including [CCL + 1No. Dummy Gun (Max OD: 4-1/2", Length: 6.45m, Type: HSD, Wt: 500lb) as Run#8 to 3957m, the Planned Perforation Interval Got Passed Successfully, POOH Wire Line Tools to Surface and L/D the same, All Done by Supervision of Client Witness, while Circ. C.W.H, w/ N.L-N.G.

Held PJSM, Announce Radio Silence and Connect Detonator, and RIH w/ Wire Line Tools Including [CCL + 1No. Loaded Gun w/ Max OD: 4-1/2", Length:6.45m, Type: HSD, Shot density: 5SPF, Phasing: 72° and Armed w/ 67 Bullets, Wt: 570lb, Net Length: 4.02m] as Run#9 to 3955m, Correlate the Depth, Fire the Gun & Shoot the Bullets at

Interval 3955 to 3951m, Obs. Electrical & Tension Cable Indications, POOH Wire Line Tools and L/D Wire Line Tools, Obs. All Bullets were Shot successfully, All Done by Supervision of Client Witness, while Circ. C.W.H, w/ N.L-N.G.

RIH w/ 2-1/8" CCL as Run#10 to 3979m to Check the Perforated Interval 3979 to 3951m, POOH Wire Line Tools to Surface and L/D the same, All Done by Supervision of Client Witness, while Circ. C.W.H, w/ N.L-N.G.

R/D Wire Line Equipment & 7" Shooting Nipple & 5k Wire Line BOP, Change 13-5/8" Top Rams f/ 4-1/2"-7" to 2-7/8"-5", Perform Press. Test on Changed Rams, 3500psi, 15min, Ok, P/U & M/U 11" Wear Bushing and Set in T.H.S Bowl, R/U Mouse Hole & Set in its Position, R/U Casing Running Tools, Check the 4-1/2" Seal Assembly Visually and Running Tool Functionality, All Ok, while Circ. C.W.H, w/ N.L-N.G.

4 – 1/2” Tie-back Operation Summary:

Prepare to Run 4-1/2" LNR Tie-Back, P/U & M/U 4 1/2" Seal Assembly belong to PPA to set in 4-1/2" LNR HGR w/ Tie-Back Sleeve, and RIH w/ 2Jts 4-1/2" Perforated LNR (T-95, 15.2PPF, R3, TPCQ), while using Joint Analyzed System to Monitor Connections, Applying Thread Compound to LNR Connections, and Circ. C.W.H, w/ N.L-N.G. Cont. RIH w/ 4-1/2" LNR Tie-Back Assy. f/ 24 to 68m Followed by 4Jts 4-1/2" Perforated LNR (T-95, 15.2PPF, R3, TPCQ) [Totally 6Jts], then P/U & M/U 4-1/2" L.G (T-95, ACME×TPCQ) + 4-1/2" Tie-Back Sleeve (T-95, 10ft) + Running & Setting Tool and RIH to 71.95m, while using Joint Analyzed System to Monitor Connections, Applying Thread Compound to LNR Connection, and Circ. C.W.H, w/ N.L-N.G.

Cont. RIH w/ 4-1/2" LNR Tie-Back Assy. f/ 71.95 to 188m followed by 3-1/2" DPs, while After RIH First 3-1/2" Std, Break Circ. & Record Upward and Downward String Weight, with and without Pump out and Pass 1-3/8" Rabbit Thru. All 3-1/2" Stds, w/ N.L-N.G.

Change Elevator f/ 3-1/2" to 5", Cont. RIH w/ 4-1/2" LNR Tie-Back f/ 188 to 3950m followed by 5" DPs w/ Speed Control of 10Stds per Hour at the Request of PPA Supervisor, Took Weight @ 3950m, Attempt to Pass this Point Sev. Times, No Success, A Decision was made to POOH while Break Circ. Every 20Stds, w/ N.L-N.G. Cont. POOH 4-1/2" LNR Tie-Back Assy. to 71.9m On Elevator, while using Safety Clamp f/ 340m Before B/O Each Connection, Change Elevator f/ 5" to 3-1/2" @ 187m and Circ. C.W.H, w/ N.L-N.G.

B/O & L/D 4-1/2" L.G (T-95, ACME×TPCQ) + 4-1/2" Tie-Back Sleeve (T-95, 10ft) + Running & Setting Tool by Supervision of PPA Supervisor, R/U Casing Running Tools and B/O & L/D 6Jts 4-1/2" Perforated LNR (T-95, 15.2PPF, R3, TPCQ) + 1/2" Seal Assembly belong to PPA, while using Thread Protector to not damaging LNR Threads and Circ. C.W.H, w/ N.L-N.G. R/D Casing Running Tools, Change Elevator to 5", P/U & M/U 11" Wear Bushing & Set that in T.H.S Bowl, Change Elevator f/ 5" to 3-1/2".

P/U & M/U 5-7/8" M.M.J.Mill (10% Used, S/N: 618, T.S.E.KH, 5*15/32) and RIH w/ 4-3/4" Bit Sub (float-in) + 3Stds 4-3/4" DC + 4Stds 3-1/2" DP to 199.5m, F/U BHA & Break Circulation, w/ N.L-N.G. Cont. RIH w/ 5-7/8" Clean out BHA f/ 199.5 to 3950m Followed by 3-1/2" On Elevator, Took Weight @ 3950m, while F/U Strg & Break Circ. Every 15Stds, w/ N.L-N.G. Conn. TDS and Perform Milling & Smoothing The Interval 3947 to 3969m With & Without Rotation and Pump out A Dozen Time, while CBU Till Uniform In/Out Mud, w/ N.L-N.G.

Cont. Perform Milling & Smoothing The Interval 3947 to 3969m With & Without Rotation and Pump out A Dozen Of Time, , w/ N.L-N.G. Static Flow Check, Well Static, POOH 5-7/8" Clean out BHA f/ 3969m to Surface On Elevator, L/D 5-7/8" M.M.J.Mill (10%Used) & Rest of BHA, while Circ. C.W.H, w/ N.L-N.G.

R/U Casing Running Tools, Check 4-1/2" Seal Assembly Visually and Ru nning Tool Functionality, All Ok, P/U & M/U 4 1/2" Seal Assembly belong to PPA to Set in 4-1/2" LNR HGR w/ Tie-Back Sleeve and RIH w/ 6Jts 4-1/2" Perforated LNR (T-95, 15.2PPF, R3, TPCQ) + 4-1/2" L.G (T-95, ACME×TPCQ) + 4-1/2" Tie-Back Sleeve (T-95, 10ft) + Running & Setting Tool to 71.95m, while using Joint Analyzed System to Monitor Connections, Applying Thread Compound to LNR Connections, while Circ. C.W.H, w/ N.L-N.G.

Cont. RIH w/ 4-1/2" LNR Tie-Back Assy. f/ 71.95 to 188m followed by 3-1/2" DPs, while After RIH First 3-1/2" Std, Break Circ. & Record Upward and Downward String Weight, with and without Pump out, w/ N.L-N.G. Change Elevator f/ 3-1/2" to 5", Cont. RIH w/ 4-1/2" LNR Tie-Back f/ 188 to 1064m followed by 5" DPs w/ Speed Control of 10Stds per Hour at the Request of PPA Supervisor, while Break Circ. Every 30Stds, w/ N.L-N.G. Cont. RIH w/ 4-1/2" LNR Tie-Back f/ 1064 to 3966m followed by 5" DPs w/ Speed Control of 10Stds per Hour at the Request of PPA Supervisor, while Break Circ. Every 30Stds, w/ N.L-N.G.

Circ. As 1 Strg Cap @ 3966m, Record Upward & Downward Strg Wt. , Cont. RIH w/ 4-1/2" LNR Tie-Back f/ 3966 (Previous 4-1/2" Perf. L.Lap) to 3967.44m, Took Weight

@ 3967.44m, while Guide 5-3/16"Seal Nipple In 5-1/4" Tie-Back Sleeve of Previous 4-1/2" Perf. LNR and Simultaneously Obs. Indication of Guiding that on Weight Indicator, Slack-off Strg Weight 10klbs, Rotate Strg 30 Turns Clockwise to Release Setting Tool, P/U Strg to Check Strg Weight, Obs. 3Klbs WOH Drop, w/ N.L-N.G.

POOH Running & Setting Tool f/ 3895m to Surface On Elevator, while Circ. C.W.H, w/ N.L-N.G. L/D Running & Setting Tool Belong to PPA, Change Elevator f/ 3-1/2" To 5", P/U & M/U 11" Wear Bushing and Set in T.H.S Bowl, Change Elevator f/ 5" To 2-7/8".

P/U & M/U 3-1/2"M.M Junk Mill (Cylindersazi, S/N: CS6645, w/ 4*12/32"Port) & RIH w/ 3-1/8"Bit Sub (Float-in) + 10Jts 3-1/8"DC (M/U One of Stds Jt by Jt and Pass Rabbit Thru. Added Jts) + X.O.S + 4Stds 2-7/8"DP + X.O.S + 5Stds 3-1/2"DP + X.O.S Followed By 5"DPs to 3896m, while F/U String and Break Circ. After RIH Last Std of 2-7/8" DP & 3-1/2" DP, and Every 10 Stds 5" DPs, Using Safety Clamp, Change Elevator F/ 2-7/8" to 3-1/2", and F/ 3-1/2" to 5", Cont. RIH W/Pumping To 4065m.W/ N.L-N.G. Circ. BTM's Up.'Spot 10bbl Non Solid Fluied. POOH W/3-1/2" Clean Out BHA To surface W/NL-NG, While L/D 9 Jts 3-1/2" D.P & 12 Jts 2-7/8" D.P & 10 Jts 3-1/8" D.C.

Completion Operation Summary:

M/U & RIH W / 7" Scraper + B.Sub (Float In) + 8 STD 4-3/4" D.C & POOH While L/D 18 Jts 4-3/4" D.C & RIH With 4 STD 5" D.P & 2 STD 5" H.W.D.P While L/D 12 Jts 5" D.P & 6 Jts 5" H.W.D.P. Cont RIH W / 7" Scraper + B.Sub (Float In) + 2 STD 4-3/4" D.C + 2 STD 3-1/2" D.P & Follow By 5" D.P To 3870m While Fill Up String Every 15 STD. Perform Scrape From 3835 To 3870m @ Several Time. Cont RIH To 3890m, Circ BTM's Up Till M.N.

R/U & L/U Pump Truck & Perform Press Test CMT Line With 1000Psi , Ok. Pump 50BBL Hi-vis Pill & 27 BBL Hi-Vis Calcium chloride, Start Displace Mud 103PCF In Well With Comp. Fluid (Calcium bromide) 105PCF. POOH F/3890 While L/D 5" D.Pipe & Fill Up The Well With Comp. Fluid. Cont POOH W/ 7" Scraper to 115m On Elevator, While L/D 5" D.Pipe & Fill Up The Well With Comp. Fluid & NL.NG. Change Handling Tools & Elevator, Cont POOH While L/D 4-3/4" Bit sub + 6 Jts 4 3/4" DC + 6 Jts 3-1/2" DP & 7" Scraper. Retrieved 11" Wear Bushing & L/D 1 STD 5" D.P In Derrick.

R/U CSG Crew & completion running tools Meanwhile Prapare Rig Floor For Run Completion String. Perform pre-job safety meeting, P/U & M/U 3-1/2" Re-entry guide(10.2 #,HSM3 Con,Super 13CR-110KSI, Weiqixin Co, S/N: 2307 Y230418-05) + 3-1/2" Bottom No-Go Landing (HSM3 , 10.2#, Super 13CR-110KSI W/ Seal Bore 2.75", Weiqixin Co, S/N: 2307 Y230416-06) + 3-1/2" Pup Jt (SM3 , 10.2#, L-80) + 1 Jts TBG 3-1/2" (10.2#, L-80,HSM3) + 1 Jts 3-1/2" Pup Jt (HSM3 , 10.2#, L-80) + 7" Hydraulic set permanent production PKR (Super 13CR-110KSI, UPPER SEAL BORE: 4", Weiqixin Co, S/N : 2308 23062-06) + 3-1/2" Anchor seal assembly (HSM3, 10.2#,Super 13CR-110KSI, 4" Packing OD, S/N : 2308 23063-06) + 3-1/2" Pup Jt (HSM3 , 10.2#, L-80) + 1 Jts TBG 3-1/2" (10.2#, L-80,HSM3) + 3-1/2" SSD (Super 13CR-110KSI, HSM3, Profile: 2.750", Close Position) + 1 Jts 3-1/2" Pup Jt (HSM3 , 10.2#, L-80) + 1 Jts TBG 3-1/2" (10.2#, L-80,HSM3).

R/U Slick Line & RIH with 2/750" SB Pulling tools to top of SSD, 2/750" SB Pulling Tool Stuck in SSD, Work On It With Jaring UP And Suddenly Cutting of the Slick Line Wire. POOH String & L/D 1 Jts TBG 3-1/2" Top Of SSD, Retrivered 2/750" SB Pulling In SSD & RIH For Check Srting W/ 2/700" Gage Ring To Top Of No Go. Ok. RIH with 2/750" SB Pulling tools & Set 2.750” check valve in SSD, R/D Slick Line, SSD in close position.

Cont Run Comp Strong According Program By Follow : 1 Jt TBG 3-1/2" (10.2#, L-80,HSM3) + 3-1/2" Pup Jt (10.2#,HSM3) + 3-1/2" EXP. Joint (HSM3, Super 13CR-110KSI, Full Open) + 3-1/2" Pup Jt (HSM3, 10.2#, L-80) + 1 Jt TBG 3-1/2" (10.2#, L-80,HSM3) + 3 1/2" CIV No#1 (HSM3 , 10.2#,Super 13CR-110KSI) + 3-1/2" Pup Jt (HSM3 , 10.2#, L-80) & Connected 3/8" CIL To CIV No#1 & Press Test Fitting Connection With 2000Psi/15min, OK. Cont RIH w/ 1 Jt TBG 3-1/2" (10.2#, L-80,HSM3) + 3 1/2" CIV No#2 (HSM3, 10.2#, Super 13CR-110KSI) + 3-1/2" Pup Jt (HSM3 , 10.2#, L-80) & Connected 3/8" CIL To CIV No#2 & Press Test Fitting Connection With 2000Psi/15min, OK. Press Hold 1000Psi In CIL NO #1 & #2 While Used 3-1/2" Cross Coupling On Each Jt.

Cont RIH w/ 9 Jts TBG 3-1/2" (10.2#, L-80,HSM3) + X.O.S (4-1/2"HSM3, 18.9# BOX * 3-1/2"HSM3 , 10.2# PIN) + 1 Jt 4-1/2" TBG(18.9#, L-80,HSM3). R/U Slik Line & Run 2.8" G.Ring To Top Of SSD, R/D Slik Line. R/U CMT Line & Test It, Ok. Connected To Comp. String & Perform Press Test String W/7000Psi/15min, Ok. Cont RIH w/ 1 Jts Jt 4-1/2" TBG(18.9#, L-80,HSM3) (Totally Run 1 Jts 4-1/2" TBG) To 311m & Used 4-1/2" Cross Coupling On Each Jt Till M.N.

Cont RIH Comp String W/ 90 Jts Jt 4-1/2" TBG (18.9#, L-80, HSM3) To 1024m (Totally Run 91 Jts 4-1/2" TBG) & R/U CMT Line & Test It, Ok. Connected CMT Line To Comp. String & Perform Press Test String W/7000Psi/15min, Ok. Cont RIH w/ 64 Jts Jt 4-1/2" TBG(18.9#, L-80,HSM3) To 1633m (Totally Run 155 Jts 4-1/2" TBG) & Used 4-1/2" Cross Coupling On Each Jts & Hold 1000Psi Press in CILs Meanwhile Well Monitoring In All Time Operation, NL.NG Till M.N.

Cont RIH Comp String W/ 45 Jts Jt 4-1/2" TBG (18.9#, L-80, HSM3) To 2060m (Totally Run 200 Jts 4-1/2" TBG) & R/U CMT Line & Connected CMT Line To Comp. String & Perform Press Test String W/7000Psi/15min, Ok. Cont RIH w/ 82 Jts Jt 4-1/2" TBG(18.9#, L-80,HSM3) To 2840m (Totally Run 282 Jts 4-1/2" TBG) & Used 4-1/2" Cross Coupling On Each Jts & Hold 1000Psi Press in CILs Meanwhile Well Monitoring In All Time Operation, NL.NG Till M.N.

Cont RIH Comp String W/ 18 Jts Jt 4-1/2" TBG (18.9#, L-80, HSM3) To 3011m (Totally Run 300 Jts 4-1/2" TBG) & R/U CMT Line & Connected CMT Line To Comp. String & Perform Press Test String W/7000Psi/15min, Ok. Cont RIH w/ 81 Jts Jt 4-1/2" TBG(18.9#, L-80,HSM3) To 3783.65m (Totally Run 381 Jts 4-1/2" TBG) + 3-1/2" Pup Jt (HSM3 , 10.2#, L-80) + 4-1/2" S.FLOW COUPLING(OD:5.5",18.9#,S13CR-110KSI 10KSI, HSM3 , 4FT, S/N : 2307 Y230415-06) + 4-1/2" TRSSV (OD: 7.5", 18.9#, W/ 3.437" Seal bore, HSM3, 10K WP With AF Profile, S/N : 2308 23038-06) + 4-1/2" L.FLOW COUPLING (OD:5.5", 18.9#,S13CR-110KSI, 10KSI, HSM3 , 6FT, S/N : 2307 Y230414-06) + 3-1/2" Pup Jt (HSM3 , 10.2#, L-80) CONNECTED 1/4" C.LINE TO TRSSV & Press Test C/L INC. Gradually To 7500Psi/15min, Ok. Keep 5000psi In C/L While RIH. Cont RIH Comp String W/ 1 Jts Jt 4-1/2" TBG (18.9#, L-80, HSM3) To 3801m (Totally Run 382 Jts 4-1/2" TBG) & R/U CMT Line & Connected CMT Line To Comp. String, Perform Press Test String W/7000Psi/15min, Ok. Perform TRSCSSV InFlow test As following (Close TRSCSSV by releasing C/L pressure slowly. Release String Pressure Through to 1000 Psi. Observe String Pressure for 15min/Ok) Used 4-1/2" Cross Coupling On Each Jts & Hold 1000Psi Press in CILs & 5000Psi in C/L Meanwhile Well Monitoring In All Time Operation, NL.NG Till M.N.

Cont RIH w/ 4 Jts Jt 4-1/2" TBG(18.9#, L-80,HSM3) To 3839.13m (Totally Run 386 Jts 4-1/2" TBG) & Perform Rupture Test As Following : Check pressure in 3/8” CILs and 1/4” C/L, pressure up CILs to Rupture CIV Rupture disk (about 7000Psi, Ok). Cont RIH W/ 4-1/2" FLUTED SWAGE ADAPTER (D/P, 18.9# TPCQ-EX PIN ON TOP X HSM3 PIN ON DOWN* Super 13CR-110KSI) + TBG HANGER MSP (10K, 11" * 4 1/2" ACME Box up * 4 1/2" TPCQ-EX Box Down , M/C: FF-0.5 T/C: UPSL: 3G PR:

2, 4" Type "H" Two Way) + TBG Hanger Running Tool + L/Joint & Pass C/L & Injection lines through Fluted Swage sluts. Land T.B.H inside T.H.S, pull Out 1.5m space out, Mark String.

R/U CMT Line & Connected CMT Line To Comp. String & Perform Press Test String W/7000Psi/15min,Ok. No Return. P/U & M/U Golpa Flang + 4-1/2" G.Valve + Slik Line BOP. Prepare To R/U & Running Slik Line As Follow Program : (Run#1: Install 3.437" protection Sleeve of TRSSSV, Run#2: Retrieve 2.75" WFB-2 Check valve from SSD. Run#3: Set 2.75" plug in NO GO, Run#4: Set 2.75" prong in NO GO, Run#5: Run with shifting tool to confirm SSD is full close, Ok.), R/D Slik Line @ Acc. Set Packer as Per Following procedure: R/U pump unit, flush the surface line to ensure there is not any trash inside. Pressure test the line with 8000 psi for 5-10 mins. Connect the surface line to tubing. Pressurize inside tubing to 300-500psi to ensure Traveling joint is full open. Increase Pressure gradually to SET PACKER. (500psi 5min, 2000psi 5min,3000psi 10min, 3500psi 10min), OBS Shear Slips PKR @ 2400PSi & Increase pressure to 7000 Psi To Test String, OK. Over Pull string (Max. 15 Kips) to test PKR. Slack off Weight to shear expansion joint. (shear Pins : 22 kips)(Set PKR Depth : 3833/53m) & Keep 5000 Psi Pressure in C/L while RIH. Till M.N.

Land tubing hanger in Tubing Head Spool According Procedure, OK. Tighten all Tie-Down screws. Connected Pump Truck line to comp. string & Perform press test string W/5000Psi/15min, Ok. No Return (Final Completion String Test). Close Hydrill, test Tubing Hanger & All Tie-Down screws With 2000 psi from top, Ok. test PKR & hanger seals by connected pump truck line to 9 5/8” TBG annulus & Pressure up to 1000psi/15min To test hanger seals from bottom and PKR element from top, Ok. No Return Till R.T. Retrieve 3.437" protection Sleeve of TRSSSV, Cut C/L, Back off & L/D landing joint. Install 4" 10k two way check valve (2WCV), Close Shear Rams & Test Same again W/5000psi/15min, Ok. N/D BOP Stack. Till M.N.

Cont N/D BOP Stack. N/U BTM Master Valve & Pass CIL & Connect C/L to Exit Cap Install companion flange on top of bottom section and Pressure test metal seal with 8000/1000psi 15/5 min, OK. Press test C/L to 8,000psi/15min, Ok. Pressure test CIL 2000psi/15min Press test between lower S-seal and cavity through test port with 8000 psi/15 min. Ok. Press test between neck of hanger S-seal and cavity through test port with 8000 psi/15 min. Ok. Install Xmas tree & Pressure test X-Mas tree body and connection to 1000/8000 psi for 5/15 min, OK. Open X-Mas Tree cap and Retrieve 2WCV , R/U Slik Line and Acc & Set protection sleeve in TRSSSV Till M.N.

Retrieve plug & prong in NO-GO landing nipple, Retrieve protection sleeve in TRSSSV, R/D Slik Line and Acc, Set BPV. Install Xmas tree cap and close all valves except bottom master valve. Till R.T. Rig Release @ 1403-07-11 (2024.10.02) @ 06:00 O'Clock

2.4 AZNS-116 Well Sketch

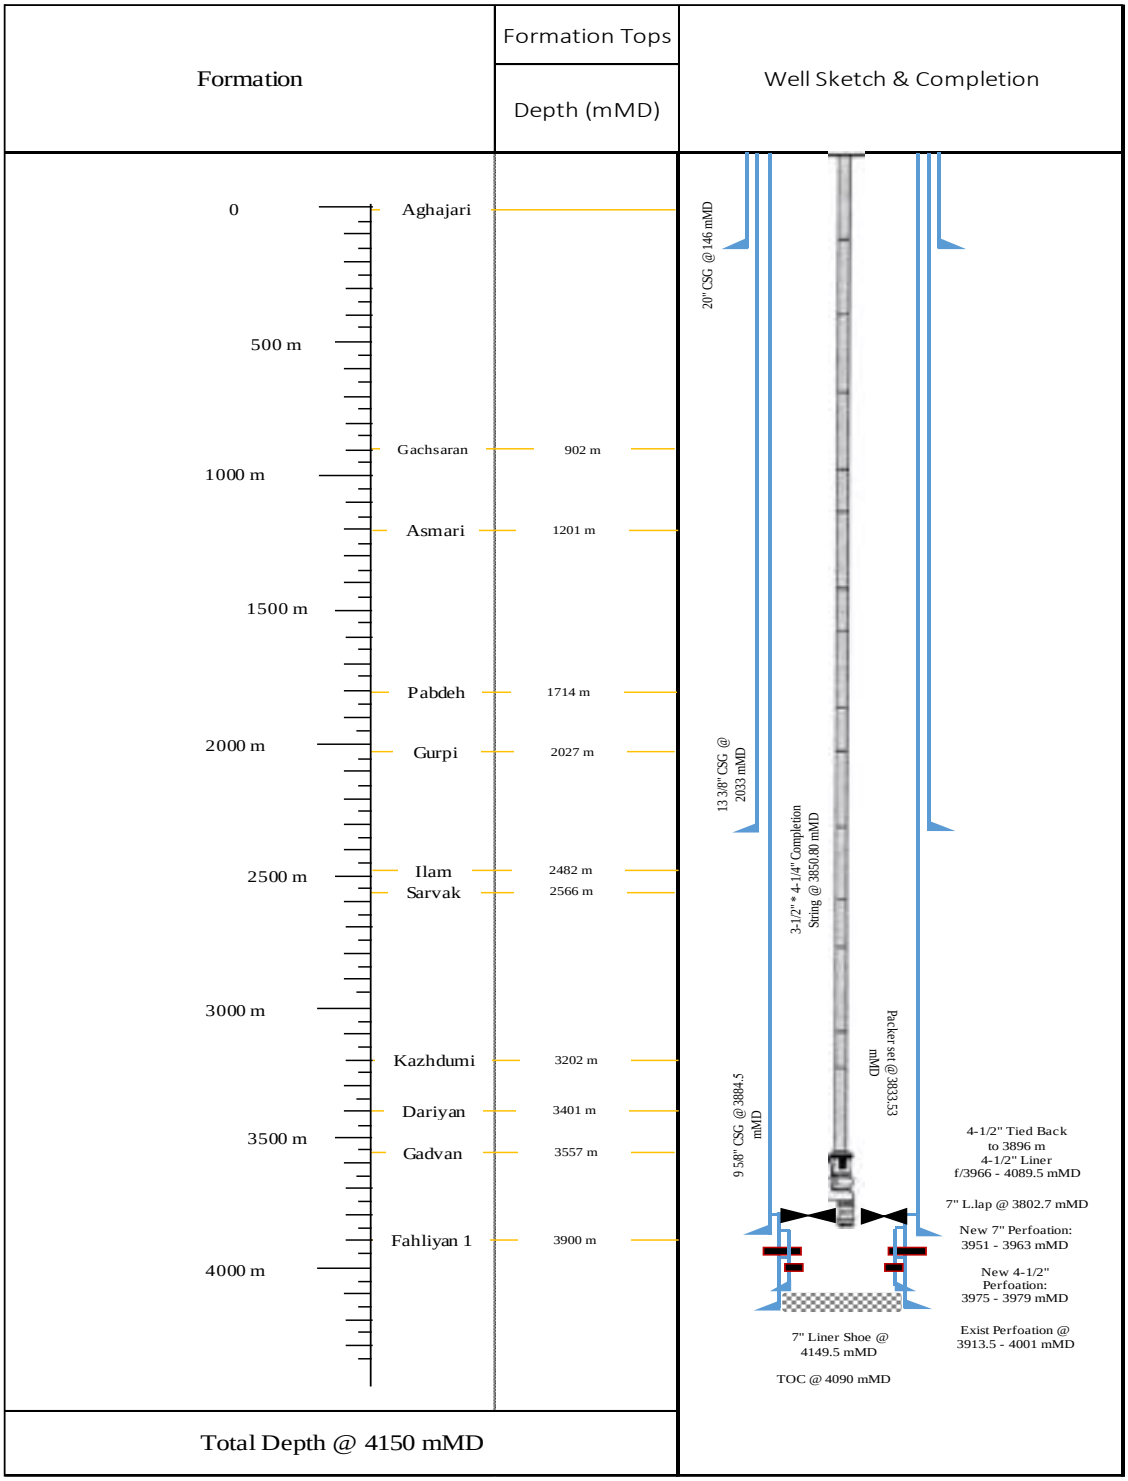


Figure 2-1: AZNS-116 Well Sketch

2.5 Bit Record Table

Not Applicable.

2.6 Hole Problem History

Not Applicable.

3. Time Analysis Report

3.1 Time vs. Depth Chart

Not Applicable.

3.2 Total Time Break-Down of Operation

WorkOver Section

De-Complete, Re-Complete Operation TBD of Well: AZNS-116 Work-over	IADC Code	Depth (meters)	Time Duration (Hours)	Time Duration (Days)	Total Duration (Days)	Contingency (%) 10	Time Duration w/ contingency (Hours)	Time Duration w/ contingency (Days)	Total Duration w/ contingency (Days)	Actual Depth (m)	Time Duration (Actual Hours)	Time Duration (Actual Days)	Total Time Duration (Actual Days)
Work-over													
Held PJSM. Spud the Rig. Stand Back required 5" & 3-1/2" DPs, 5" HWDPs and 6-1/2" DC. (Actual: 18/03/1403 00:00 to 18/03/1403 18:00 & 20/03/1403 03:00 to 24:00 & 21/03/1403 00:00 to 09:00 & 28/03/1403 05:00 to 06:30)	Trip	4150	48	2.00	2.0	2.2	52.8	2.20	2.20	4150	50	2.06	2.1
Check the wellhead for any damage or leakage. Record well head pressures; check the all annulus pressure. Check the return fluid & Bleed off any annulus pressure to Zero upon client's approval and recheck the well status. (Actual: 18/03/1403 18:00 to 19/03/1403 14:30)	Wellhead	4150	48	2.00	4.0	2.2	52.8	2.20	4.4	4150	20.5	0.85	2.9
Secure the well by close 35V and X-Mass Tree Valves, Remove 7-1/16" XMT cap, R/U Slick line and perform pressure test,RIH w/Gauge Cutter to top of 35V, RIH & set protection sleeve, RIH w/Gauge Cutter to top of fish .Note: If unable to pass to the bottom, follow contingency plan #1. Note:Chemical Wash May be Needed while RIH W/CT. (Actual: 19/03/1403 14:30 to 20/03/1403 03:00 & 23/03/1403 23:00 to 24/03/1403 19:30)	Trip	4150	40	1.67	5.7	1.8	44.0	1.83	6.2	4150	33	1.38	4.3
R/U CT. RIH to top of fish@3837.5m.displace the well with heavy weitgh mud POOH and R/D CT.R/U Slick Line, Retrieve Protection Sleeve, Close 35V, R/D S/L. (Actual: 21/03/1403 09:00 to 21/03/1403 13:00)	Trip	4150	72	3.00	8.7	3.3	79.2	3.30	9.5	4150	4	0.17	4.5
Set TWCV inside tubing hanger & pressure test, N/D XMT & N/U BOPs, open tie down screws,perform BOP pressure Test,if observe any leakage follow contingency plan#2 Tie down screw shall be provided by client. (Actual: 21/03/1403 13:00 to 23/03/1403 23:00)	Wellhead	4150	60	2.50	11.2	2.8	66.0	2.75	12.3	4150	58	2.42	6.9
Retrieve TWCV, R/U casing running equipment, RIH with TBH retrieving tool & engage with THT, apply over pull/Rotation to un-latch the seal assembly, circulate to balance mud weight and flow check before pulling out. Note: if observe any damage on THS, follow contingency plan#2 Note: If unable to un-latch seal assembly, follow contingency plan #3. (Actual: 24/03/1403 19:30 to 24/03/1403 24:00)	Completion	4150	50	2.08	13.3	2.3	55.0	2.29	14.6	4150	4.5	0.19	7.1
Pull out the completion string from anchor seat and lay down completion string precautionary due to probable trapped pressure below plug & Prong. While POOH monitor the well and annulus to make sure the well is safe and over balance. (Actual: 25/03/1403 00:00 to 28/03/1403 05:00)	Trip	4150	90	3.75	17.0	4.1	99.0	4.13	18.7	4150	77	3.21	10.3
Perform BOP Test. (Actual: 08/04/1403 09:00 to 08/04/1403 14:00 & from 14/04/1403 12:00 to 14/04/1403 17:00 & 31/04/1403 19:30 to 24:00)	BOP	4150	6	0.25	17.3	0.3	6.6	0.28	19.0	4150	14.5	0.60	10.9
RIH with 6" mill assembly, resume mill fish (CTU PIPE) & permanent packer, chase to 4-1/2" Perforated liner Lap @ 3968.9m (or where ever packer stopped), POOH. Note: If due to milling operation ctu pipe observe any deviation on well refer to contigency plan#4. (Actual: 28/03/1403 06:30 to 02/04/1403 24:00 & 03/04/1403 00:00 to 04/04/1403 17:30 & 04/04/1403 19:30 to 06/04/1403 24:00 & 07/04/1403 00:00 to 08/04/1403 09:00 & from 14:00 to 11/04/1403 15:30 & from 18:00 to 14/04/1403 12:00 & from 16/04/1403 08:30 to 31/04/1403 19:30 & from 01/05/1403 00:00 to 06/05/1403 24:00 & from 07/05/1403 00:00 to 19:00 & from 20:30 to 11/05/1403 24:00 & from 12/05/1403 00:00 to 17/05/1403 05:30 & from 07:30 to 19/05/1403 12:00)	Trip	4150	500	20.83	38.1	22.9	550.0	22.92	41.9	4150	1215.5	50.65	61.5
RIH with taper tap & catch the packer, recover the completion packer, POOH, L/D BHA .Note: If no success to catch and recover packer, refer to contigenc plan #4	Trip	4150	150	6.25	44.3	6.9	165.0	6.88	48.8	4150		0.00	61.5
RIH with 8-1/2" bit and clean out BHA to 7" liner lap @ 3802m.CBU. POOH to surface. (Actual: 14/04/1403 17:00 to 16/04/1403 08:30)	Trip	4150	48	2.00	46.3	2.2	52.8	2.20	51.0	4150	39.5	1.65	63.2
Perform BOP Test. (Actual: 19/05/1403 12:00 to 16:30)	BOP	4150	6	0.25	46.6	0.3	6.6	0.28	51.2	4150	4.5	0.19	63.4
RIH with 5-7/8" to 6" Mill and clean out BHA to 4-1/2" Perforated liner Lap @ 3968.9m.CBU till hole clean. POOH to surface. (Actual: 19/05/1403 16:30 to 20/05/1403 14:30)	Trip	4150	60	2.50	49.1	2.8	66.0	2.75	54.0	4150	22	0.92	64.3
Start milling f/3951.5 to 3951.75, while due an unusual & sudden increase torque, string got stalled several times. Decided to CBU, POOH. (Actual: 20/05/1403 14:30 to 21/05/1403 13:00)	Trip	4150	0	0.00	49.1	0.0	0.0	0.00	54.0	4150	22.5	0.94	65.2
P/U & M/U 5-3/4" taper mill & C/O BHA & RIH to 3951.75m, Perform milling, CBU & POOH. (Actual: 21/05/1403 13:00 to 23/05/1403 03:00)	Trip	4150	0	0.00	49.1	0.0	0.0	0.00	54.0	4150	38	1.58	66.8
P/U & M/U 3 1/2" mill & C/O BHA to & RIH 3951.75m & try to pass obstraction at this point, No Success. CBU & POOH. (Actual: 23/05/1403 03:00 to 25/05/1403 13:30)	Trip	4150	0	0.00	49.1	0.0	0.0	0.00	54.0	4150	58.5	2.44	69.2
P/U & M/U 7" * 9-5/8" scrapper BHA & 6" mill & RIH to 3605m, observe string got plugged, No sucsed to unplug string, POOH to surface, L/D same. (Actual: 25/05/1403 13:30 to 26/05/1403 22:00)	Trip	4150	0	0.00	49.1	0.0	0.0	0.00	54.0	4150	32.5	1.35	70.6
P/U & M/U 7" * 9-5/8" open end scrapping BHA & RIH to 3900m while scrapping inside 7" liner & 9-5/8" CSG, CBU till shakering out @3900m, POOH to surface, L/D same. (Actual: 27/05/1403 00:00 to 28/05/1403 06:30)	Trip	4150	36	1.50	50.6	1.7	39.6	1.65	55.6	4150	30.5	1.27	71.9
R/U wireline logging tools as CBIL-CDR-GR-CCL, log up f/3900m inside 7" liner & 9-5/8" CSG in separate runs. (Actual: 28/05/1403 06:30 to 29/05/1403 09:30)	Trip	4150	40	1.67	52.3	1.8	44.0	1.83	57.5	4150	27	1.13	73.0
P/U & M/U 6" mill & C/O BHA & RIH to 3695m (4m above the depth of 4-1/2" P. liner lap), try to pass this depth, No Success. POOH to surface.(Actual: 29/05/1403 09:30 to 01/06/1403 10:30)	Trip	4150	0	0.00	52.3	0.0	0.0	0.00	57.5	4150	73	3.04	76.0
M/U & RIH w/ 3-1/2" M. mill BHA to 3990.2m, try to Cont. operation, No Success. POOH to surface. (Actual: 01/06/1403 10:30 to 04/06/1403 15:00)	Trip	4150	0	0.00	52.3	0.0	0.0	0.00	57.5	4150	76.5	3.19	79.2
Perform BOP Test. (Actual: 04/06/1403 15:00 to 04/06/1403 19:00)	BOP	4150	6	0.25	52.5	0.3	6.6	0.28	57.8	4150	4	0.17	79.4
M/U & RIH w/ C/O BHA as open end to 3990m, took weight, try to pass this depth several times, No Success, CBU, POOH to surface.(Actual: 04/06/1403 19:00 to 06/06/1403 16:00)	Trip	4150	0	0.00	52.5	0.0	0.0	0.00	57.8	4150	45	1.88	81.3
M/U & RIH w/ 5-1/8" dressing mill to 3966m, took weight, apply parameters for dressing & cleaning the entry profile tie-back sleeve, POOH to surface. (Actual: 06/06/1403 16:00 to 08/06/1403 05:00 & from 07:00 to 09:30)	Trip	4150	0	0.00	52.5	0.0	0.0	0.00	57.8	4150	39.5	1.65	82.9
M/U & RIH w/ 3-1/2" M.M.J. mill BHA to 3990.65m, try to Cont. operation, No Success. Work on J. sub several times, POOH to surface. (Actual: 08/06/1403 09:30 to 10/06/1403 11:00)	Trip	4150	0	0.00	52.5	0.0	0.0	0.00	57.8	4150	49.5	2.06	85.0
P/U & M/U 5-1/8" polish mill & RIH to polishing & cleaning the entry profile @ the top of PBR @3967.84m, POOH to surface & L/D same. (Actual: 10/06/1403 11:00 to 11/06/1403 23:00)	Trip	4150	0	0.00	52.5	0.0	0.0	0.00	57.8	4150	36	1.50	86.5
P/U & M/U 3-1/2" M. mill BHA & RIH to 3990.78m, try to Cont. operation, No Success, POOH to surface while L/D 5-3/8" J. sub. (Actual: 11/06/1403 23:00 to 13/06/1403 21:00)	Trip	4150	0	0.00	52.5	0.0	0.0	0.00	57.8	4150	46	1.92	88.4
Perform BOP Test. (Actual: 13/06/1403 21:00 to 14/06/1403 05:00)	BOP	4150	0	0.00	52.5	0.0	0.0	0.00	57.8	4150	8	0.33	88.7
L/D 6-1/2" DC. (Actual: 14/06/1403 05:00 to 14/06/1403 08:00)	Trip	4150	0	0.00	52.5	0.0	0.0	0.00	57.8	4150	3	0.13	88.8
P/U & M/U 3-1/2" M. mill BHA & RIH to 4050m, CBU, work on J. sub several times, POOH to surface. (Actual: 14/06/1403 08:00 to 17/06/1403 03:00)	Trip	4150	0	0.00	52.5	0.0	0.0	0.00	57.8	4150	67	2.79	91.6
P/U & M/U 3-1/2" M.M. Junk mill BHA & RIH to 4065m, string got stuck at this point, CBU, POOH to 1940m & RIH back to 4059m, Pump & Spot sat.based water, POOH to surface & L/D same. (Actual: 17/06/1403 03:00 to 19/06/1403 15:00 & from 17:30 to 20:30)	Trip	4150	0	0.00	52.5	0.0	0.0	0.00	57.8	4150	63	2.63	94.3
Perform 4-1/2" liner perforation from 3975m to 3979m (Fah-3a) (Actual: 19/06/1403 20:30 to 20/06/1403 15:30)	perforation	4150	48.00	2.0	54.5	2.2	52.8	2.20	60.0	4150	19.00	0.79	95.0
Perform 7" liner perforation from 3963 to 3951m (Fah-2a) (Actual: 20/06/1403 15:30 to 22/06/1403 14:00 & from 24/06/1403 08:30 to 23:30)	perforation	4150	48.00	2.0	56.5	2.2	52.8	2.20	62.2	4150	61.50	2.56	97.6
Run Dummy gun to 3953.5m, held up, try to pass w/o success, POOH to surface & R/D same. (Actual: 22/06/1403 14:00 to 22/06/1403 19:30)	perforation	4150	0.00	0.0	56.5	0.0	0.0	0.00	62.2	4150	5.50	0.23	97.8
P/U & M/U 5-7/8" M.M.J. Mill & C/O BHA & RIH to 233m, string get plug, work on string to unplug, No Success, POOH to surface, Obs. Pipe coating inside 5-7/8" M.M.J.Mill, make it unplug while Obs. The well w/ NL-NG. (Actual: 22/06/1403 19:30 to 22/06/1403 24:00)	Trip	4150	0	0.00	56.5	0.0	0.0	0.00	62.2	4150	4.5	0.19	98.0
P/U & M/U 5-7/8" M.M.J.Mill & C/O BHA & RIH to 3802m (7" L.Lap), Cont. RIH w/ wash & ream down 3951m, took weight at this point, start milling & smoothing 7" liner 3969m (4-1/2" L.Lap), Circ. & Obs. The well, POOH to surface. (Actual: 23/06/1403 00:00 to 24/06/1403 08:30)	Trip	4150	36	1.50	58.0	1.7	39.6	1.65	63.8	4150	32.5	1.35	99.4
P/U & M/U 4-1/2" seal assembly to set in TBG HGR w/ tie-back sleeve & RIH 2 JTs 4-1/2" perforated liner to 3950m, took weight at this depth, attempt to pass this depth several times, No success. Decision was made to POOH to surface. (Actual: 24/06/1403 23:30 to 25/06/1403 07:00)	CSG RNG	4150	0	0.00	58.0	0.0	0.0	0.00	63.8	4150	31.5	1.31	100.7
P/U & M/U 5-7/8" M.M.J. Mill & C/O BHA & RIH to 3950m, took weight, perform milling & smoothing the interval 3947m to 3969m with & without rotation & pumping out while CBU till uniform in/out mud w/NL-NG.POOH to Surafce.Perform BOP Test. (Actual: 26/06/1403 07:00 to 27/06/1403 16:30)	Trip	4150	0	0.00	58.0	0.0	0.0	0.00	63.8	4150	33.5	1.40	102.1
R/U Casing Running Tools, RIH w/ 4-1/2" LNR Tie-Back Assy. f/ 71.95 to 3967.44, guide 5-3/16" Seal Nipple in 5-1/4" Tie Back sleeve of previous 4-1/2" perf. Liner & Obs. indication of guilding that on Weight indicator, Release Setting tools, POOH to Surface,L/D running & setting tools, Change elevator & set 11" wear bushing in T.H.S (Actual: 27/06/1403 16:30 to 28/06/1403 23:00)	CSG RNG	4150	0	0.00	58.0	0.0	0.0	0.00	63.8	4150	30.5	1.27	103.4
P/U & M/U 3-1/2"M.M Junk Mill & Clean out BHA to 4069m, POOH to Surafce (Actual: 28/06/1403 23:00 to 30/06/1403 16:00)	Trip	4150	120	5.00	63.0	5.5	132.0	5.50	69.3	4150	17	0.71	104.1
RIH with 5-7/8" mill and clean BHA and spot non solid fluid in front of perforation interval.	Trip	4150	36	1.50	64.5	1.7	39.6	1.65	71.0	4150		0.00	104.1
P/U & M/U 3-1/2" Mill BHA, RIH to 8tm while smoothing Perforated intervals, CBU shakers clean,POOH.	Trip	4150	60.00	2.5	67.0	2.8	66.0	2.75	73.7	4150		0.00	104.1

Table 3-1: AZNS-116 WorkOver Time Breakdown

Completion Section

RIH with tandem 7" scrapers to top of Perforation intervals, Displace the well w/ Completion Fluid, POOH while L/D all DPs, DCs & Tools. (Actual: 30/06/1403 16:00 to 03/07/1403 23:00)	Trip	4150	72.00	3.0	70.0	3.3	79.2	3.30	77.0	4150	103	4.29	108.4	
Run 10K completion string as per program. (Actual: 03/07/1403 23:00 to 09/07/1403 20:00) NOTE: Annulus pressure test during completion operation is related to corrosion log result.	Completion	4150	125	5.21	75.2	5.7	137.5	5.73	82.7	4150	141	5.88	114.2	
Set BPV inside TBH, N/D BOP's & install new 10K XMT. (Actual: 09/07/1403 20:00 to 09/07/1403 24:00)	Completion	4150	48	2.00	77.2	2.2	52.8	2.20	84.9	4150	4	0.17	114.4	
Retrive BPV, install TWCV and Pressure test the XMT. (Actual: 10/07/1403 00:00 to 10/07/1403 04:00)	Completion	4150	24	1.00	78.2	1.1	26.4	1.10	86.0	4150	4	0.17	114.6	
Secure the well by set BPV in TBG Hanger, close all X-mas Tree valves except BMV, and Release the Rig. (Actual: 10/07/1403 04:00 to 11/07/1403 06:00)	Completion	4150	10	0.42	78.6	0.5	11.0	0.46	86.5	4150	26	1.08	115.6	
Retrieve TWCV,R/U Slick Line, Set protection sleeve, retrieve plug & prong from NO GO landing nipple, POOH.	Completion	4150	Rig Less	0.00	78.6	0.0	0.0	0.00	86.5	4150		0.00	115.6	
RIH with CT to bottom, displace the well with diesel or nitrogen & observ well, POOH.	Completion	4150	Rig Less	0.00	78.6	0.0	0.0	0.00	86.5	4150		0.00	115.6	
R/U SL, RIH & retrieve protection sleeve, POOH, R/D SL.	Completion	4150	Rig Less	0.00	78.6	0.0	0.0	0.00	86.5	4150		0.00	115.6	
Flow the well as pre-acid clean up till acceptable BSW & reading stable flow rate on 2 different choke size for 72 hrs.	Completion	4150	Rig Less	0.00	78.6	0.0	0.0	0.00	86.5	4150		0.00	115.6	
RIH with C/T & perform acid wash as per program, POOH to surface.	Completion	4150	Rig Less	0.00	78.6	0.0	0.0	0.00	86.5	4150		0.00	115.6	
Flow the well as post-acid clean-up till acceptable BSW & reading stable flow rate on 2 different choke size for min 96 hrs. Note 1: The time is only for flowing duration (R/U, R/D & preparation time is excluded). Note 2: Acidizing & post-acid clean-up maybe perform as rig less job upon contractor request & client approval but in case of any failure in well integrity the contractor should provide drilling rig & required services in own responsibility & fix the problem.	Completion	4150	Rig Less	0.00	78.6	0.0	0.0	0.00	86.5	4150		0.00	115.6	
RIH with S/L, set protection Sleeve, POOH & R/D SL.	Completion	4150	Rig Less	0.00	78.6	0.0	0.0	0.00	86.5	4150		0.00	115.6	
RIH with C/T to bottom & displace the well with diesel, POOH.	Completion	4150	Rig Less	0.00	78.6	0.0	0.0	0.00	86.5	4150		0.00	115.6	
RIH with S/L, install plug & prong into NO GO landing nipple, POOH.	Completion	4150	Rig Less	0.00	78.6	0.0	0.0	0.00	86.5	4150		0.00	115.6	
RIH with S/L, retrieve protection sleeve.	Completion	4150	Rig Less	0.00	78.6	0.0	0.0	0.00	86.5	4150		0.00	115.6	
Secure the well by set BPV in TBG Hanger, close all X-mas Tree valves except BMV.	Completion	4150	Rig Less	0.00	78.6	0.0	0.0	0.00	86.5	4150		0.00	115.6	
Total Duration of Work-over:				**78.6**	**78.6**			**86.5**	**86.5**				**115.6**	
NOTE:														
Total Duration for Cut & Slip DL in all hole section. (Actual: 04/04/1403 17:30 to 19:30 & 11/04/1403 15:30 to 18:00 & 07/05/1403 19:00 to 20:30 & 17/05/1403 05:30 to 07:30 & 26/05/1403 22:00 to 24:00 & 08/06/1403 05:00 to 07:00 & 19/06/1403 15:00 to 17:30)	Cut & Slip	4150	10	0.42	79.0	0.5	11.0	0.46	86.9	4150	14.5	0.60	116.3	
Total Duration for Rig Service (Consider 0.5hr per day) in all hole section.	Rig Service	4150	44.00	1.83	80.9	2.0	48.4	2.02	89.0	4150				
Total Duration of AZNS-116 Work-over Well:		4250			80.9				89.0				116.3	

Table 3-2: AZNS-116 Completion Time Breakdown

3.3 NPT Break-Down

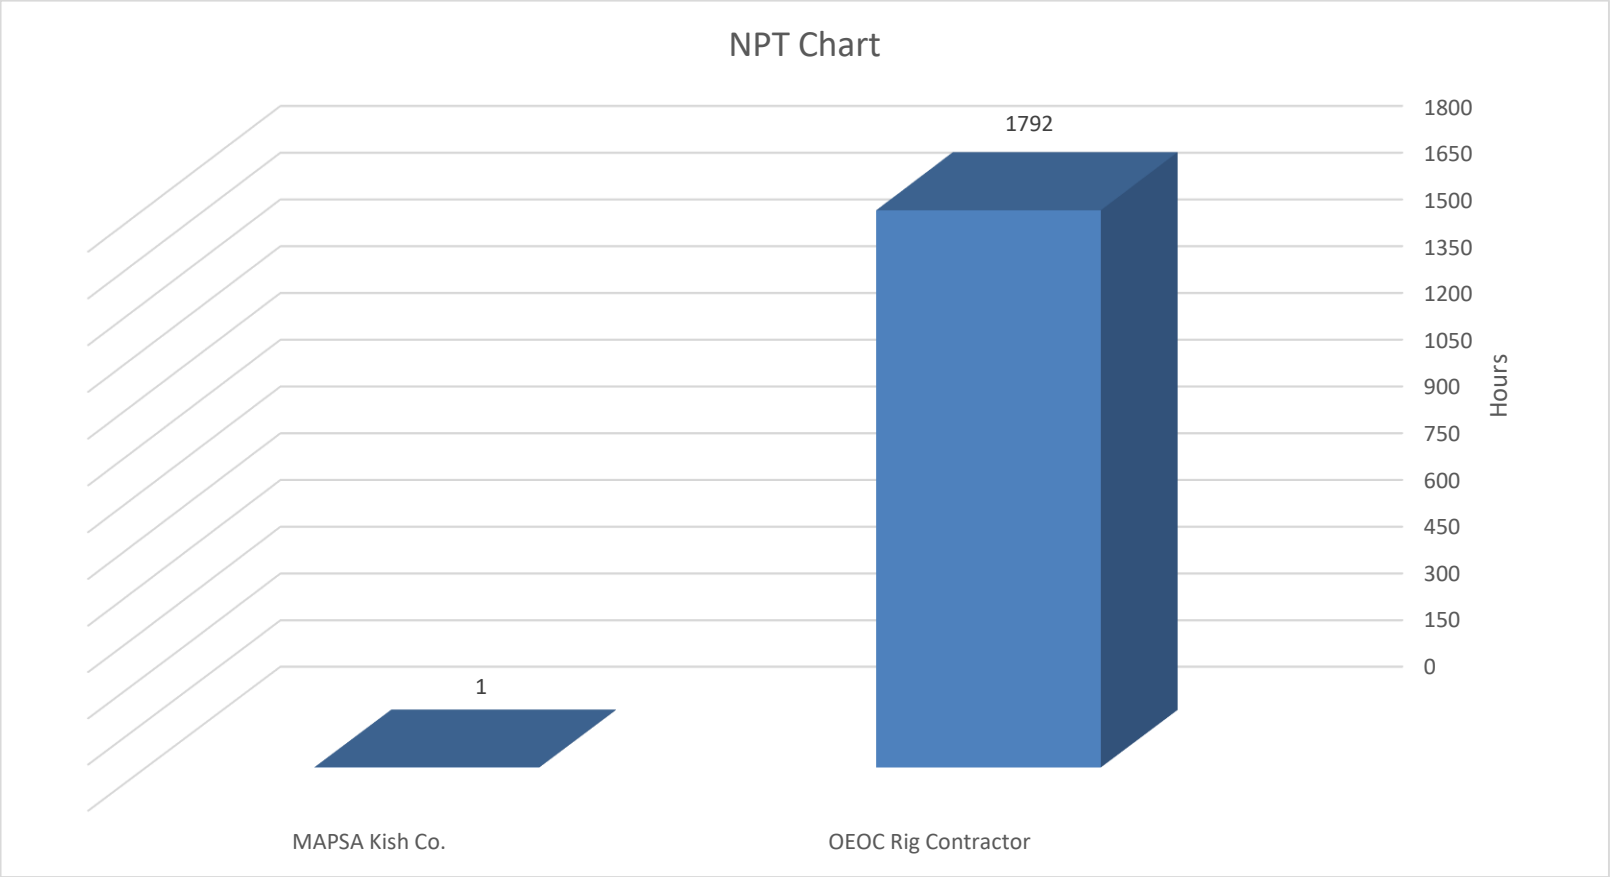


Figure 3-1: AZNS-116 NPT Break-Down Chart

Item	Company	Date	Problem event	Lost Time (hrs)
1	EOEC Rig	1403. 03. 23	Obs. leakage in shear / blind rams	3.5
			Crane being out of service & human failure, 13-5/8" 10k shear/blind rams got operated by rig crew	5
		1403. 03. 24	Failure of rig tong torque cylinder	1
		1403. 03. 28	Failure of rig tong torque cylinder & lack of crew	7
			Fishing Com. String / Extra work	12
		1403. 03. 29		24
		1403. 03. 30		24
		1403. 03. 31		24
		1403. 04. 01		24
		1403. 04. 02		24
		1403. 04. 03		24
		1403. 04. 04		22
		1403. 04. 05		24
		1403. 04. 06		22
			Work on TDS	2
		1403. 04. 07	Fishing Com. String / Extra work	22
			Work on TDS	2
		1403. 04. 08	Fishing Com. String / Extra work	23
			Work on TDS	1
		1403. 04. 09	Fishing Com. String / Extra work	24

		1403. 04. 10		24
		1403. 04. 11		22
			Slip & cut	2
		1403. 04. 12	Fishing Com. String / Extra work	18
			Wait on Rec. 3 – ½" new B. grapple	6
		1403. 04. 13	Fishing Com. String / Extra work	24
		1403. 04. 14		20
		1403. 04. 15		24
		1403. 04. 16		24
		1403. 04. 17		14.5
		1403. 04. 18		24
		1403. 04. 19		20.5
			Delay in operation	2
		1403. 04. 20	Fishing Com. String / Extra work	22
2	Mapsa Kish Co.		Mud logging failure	1
3	OEOC Rig		Delay in operation	1
		1403. 04. 22		2
			Failure in hoisting system, Work on darwworks	2
			Fishing Com. String / Extra work	2
		1403. 04. 24	Windy weather & force majeure	1
			Delay in operation	4

1403. 04. 25		4
	Weakneass in welfare services	1
1403. 04. 28	Broken taper tap & fishing it	19
	Windy weather & force majeure	3
1403. 04. 29	Broken taper tap & fishing it	22
	Work on TDS	2
1403. 04. 30	Broken taper tap & fishing it	20.5
	Delay in operation	2
	Work on TDS	1.5
1403. 04. 31	Fishing Com. String / Extra work	19
1403. 05. 01	Delay in operation	1.5
	Broken taper tap & fishing it	22.5
1403. 05. 02		24
1403. 05. 03	Work on taper tap	24
1403. 05. 04		24
1403. 05. 05	POOH w/ impression block	16
	Wait on Rec. junk mill	3
	RIH w/ M.M.J. mill	5
1403. 05. 06	Milling Com. String	24
1403. 05. 07		24
1403. 05. 08	Fishing Com. String	24

1403. 05. 09		24
1403. 05. 10		13.5
	Make decision	10.5
1403. 05. 11	Fishing Com. String	24
1403. 05. 12	Milling Com. String	15
	Windy weather & force majeure	9
1403. 05. 13	Milling Com. String	24
1403. 05. 14		24
1403. 05. 15	Fishing Com. String	24
1403. 05. 16		24
1403. 05. 17		20
	Slip & cut	2
	Mud pump repair	2
1403. 05. 18	Fishing Com. String	24
1403. 05. 20	Work on driller panel	5
	No progress in milling operation	19
1403. 05. 21	Shut down generator	3.5
	No progress to C/O inside 7” liner	20.5
1403. 05. 22		24
1403. 05. 23		20
	String got plugged	4

	1403. 05. 24	Wait on pipe screen	1
		Unplug string	1.5
		No success to pass obstruction	20
	1403. 05. 25		11
	1403. 05. 26	Plugged string	24
	1403. 05. 27		13
	1403. 05. 30	Low progress	13
	1403. 05. 31		24
	1403. 06. 01		13
	1403. 06. 04	Delay in operation	5
	1403. 06. 05		24
	1403. 06. 06		24
	1403. 06. 07		24
	1403. 06. 08		10
	1403. 06. 10		13
	1403. 06. 11		23
	1403. 06. 12	Low progress	16.5
	1403. 06. 13	No progress to C/O inside 4 – 1/2” liner	24
	1403. 06. 14		24
	1403. 06. 15		24
	1403. 06. 16		1.5

			C/O BHA design not suitable	**17.5**
			Force majeure	**5**
		1403. 06. 17	C/O BHA design not suitable	**18.5**
			Delay in operation	**5.5**
		1403. 06. 18		**24**
		1403. 06. 19		**18**
			Slip & cut	**2.5**
		1403. 06. 20	Wait on daylight	**3**
		1403. 06. 21		**10**
		1403. 06. 22	NPT	**24**
		1403. 06. 23		**24**
		1403. 06. 24		**12.5**
		1403. 06. 25	Tie – back	**24**
		1403. 06. 26		**24**
		1403. 06. 27		**17**
		1403. 06. 30	Slip & cut	**2**
		1403. 07. 03	Low progress	**23**
		1403. 07. 10	Force majeure	**10**
	Total NPT (hrs.)			**1793**
	Total NPT (days)			**74.7**

Table 3-3: AZNS-116 NPT Time BreakDown

4. Geological & Logging Reports

4.1 Logging and Testing Reports

Run	Date	Depth Interval (m)	Log Suite
1	19 – 08 – 2024	3804 to surface	CBIL

Table 4-1: AZNS-116 Logging Information

5. Bottom Hole Assembly Record

Tool Description	Length (m)	Cum. Length (m)
BHA No. #1		
8 – ٣/٨" Mill	1.14	1.14
Junk sub	0.91	2.05
Double pin	0.55	2.60
Junk sub	1.07	3.67
Bit sub	1.16	4.83
6 – 1/2" DC	81.08	85.91
5" HWDP	55.88	141.79
Total Length (m)		**141.79**
Mud Weight		
Mw (pcf)		103.00
BHA No. #2		
7 – 7/8" Overshot	1.18	1.18
6 – 1/2" DC	8.90	10.08
5" HWDP	55.88	65.96
Total Length (m)		**65.96**
Mud Weight		
Mw (pcf)		103.00
BHA No. #4		
8 – 3/8" Mill	1.14	1.14

Junk sub	0.91	2.05
Double pin	0.55	2.60
Junk sub	1.07	3.67
Bit sub	1.16	4.83
6 – 1/2" DC	81.08	85.91
5" HWDP	55.88	171.79
Total Length (m)		**141.79**
Mud Weight		
Mw (pcf)		103.00
BHA No. #5		
7 – 7/8" Overshot	1.18	1.18
6 – 1/2" DC	8.9	10.08
5" HWDP	55.88	65.96
Total Length (m)		**65.96**
Mud Weight		
Mw (pcf)		103.00
BHA No. #6		
5 – 5/8" Overshot	2.13	2.13
X.O.S	0.86	2.99
6 – 1/2" DC	8.9	11.89
5" HWDP	55.88	67.77
Total Length (m)		**67.77**

Mud Weight		
Mw (pcf)		103.00
BHA No. #7		
5 – 5/8" Overshot	2.13	2.13
X.O.S	0.86	2.99
6 – 1/2" DC	8.90	11.89
5" HWDP	55.88	67.77
Total Length (m)		**67.77**
Mud Weight		
Mw (pcf)		103.00
BHA No. #8		
8 – 3/8" M.M.J Mill	1.14	1.14
Junk Sub	0.91	2.05
Double pin	0.55	2.60
Junk Sub	1.07	3.67
Bit sub	1.16	4.83
6 – 1/2" DC	89.00	93.83
5" HWDP	55.88	149.71
Total Length (m)		**149.71**
Mud Weight		
Mw (pcf)		103.00
BHA No. #10		

8 – 3/8" M.M.J Mill	1.14	1.14
Junk Sub	0.92	2.05
D.pin	0.55	2.60
Junk Sub	1.07	3.67
Bit sub	1.16	4.83
6 – 1/2" DC	89.98	94.81
5" HWDP	55.88	150.69
Total Length (m)		**150.69**
Mud Weight		
Mw (pcf)		103.00
BHA No. #11		
5 – 5/8" Overshot	2.31	2.31
X.O.S	0.86	3.17
6 – 1/2" DC	8.90	12.07
5" HWDP	55.88	67.95
Total Length (m)		**67.95**
Mud Weight		
Mw (pcf)		103.00
BHA No. #13		
8 – 3/8" M.M.J Mill	1.14	1.14
Junk sub	0.91	2.05
D. pin	0.67	2.72

Junk sub	0.92	3.64
Junk sub	0.71	4.35
D. pin	0.55	4.90
Junk sub	1.07	5.97
Bit sub	1.16	7.13
6 – 1/2" DC	63.01	70.14
5" HWDP	55.88	126.02
Total Length (m)		**126.02**
Mud Weight		
Mw (pcf)		103.00
BHA No. #14		
6" M.M.J Mill	0.91	0.91
4 – 1/2" Junk sub	1.04	1.95
4 – 7/8" junk sub	0.78	2.73
4 – 3/4" bit sub	1.07	3.80
4 – 3/4" DC	55.05	58.85
X.O.S	0.86	59.71
6 – 1/2" D. pin	0.67	60.38
7 – 1/2" junk sub	0.71	61.09
6 – 5/8" junk sub	1.07	62.19
Total Length (m)		**62.19**
Mud Weight		

Mw (pcf)		103.00
BHA No. #15		
5 – 7/8" Overshot	3.01	3.01
4 – 3/4" DC	9	12.01
3 – 1/2" DP	144.69	156.70
X.O.S	0.86	157.56
Total Length (m)		**157.56**
Mud Weight		
Mw (pcf)		103.00
BHA No. #16		
5 – 1/4" Overshot	3.01	3.01
4 – 3/4" DC	9	12.01
3 – 1/2" DP	48.38	60.39
X.O.S	0.86	61.25
6 – 1/2" D. pin	0.67	61.92
7 – 1/2" junk sub	0.71	62.63
6 – 15/16" junk sub	0.92	63.55
Total Length (m)		**63.55**
Mud Weight		
Mw (pcf)		103.00
BHA No. #17		
5 – 1/4" Overshot	3.01	3.01

4 – 3/4" DC	9	12.01
3 – 1/2" DP	58.06	70.07
X.O.S	0.86	70.93
6 – 1/2" D. pin	0.67	71.60
7 – 1/2" junk sub	0.71	72.31
6 – 15/16" junk sub	0.92	73.23
Total Length (m)		**73.23**
Mud Weight		
Mw (pcf)		103.00
BHA No. #18		
6" M.M.J. Mill	0.91	0.91
4 – 3/4" bit sub	1.07	1.98
4 – 3/4" DC	164.84	166.82
3 – 1/2" DP	9.68	176.50
X.O.S	1.09	177.59
6 – 1/2" D. pin	0.67	178.26
7 – 1/2" junk sub	0.71	178.97
6 – 15/16" junk sub	1.07	180.04
Total Length (m)		**180.04**
Mud Weight		
Mw (pcf)		103.00
BHA No. #19		

5 – 7/8" M.M.J. Mill	0.93	0.93
4 – 3/4" bit sub	1.07	2.00
4 – 3/4" DC	191.97	193.97
3 – 1/2" DP	9.68	203.65
X.O.S	1.09	204.74
6 – 1/2" D. pin	0.67	205.41
7 – 1/2" junk sub	0.71	206.12
6 – 15/16" junk sub	1.07	207.19
Total Length (m)		**207.19**
Mud Weight		
Mw (pcf)		103.00
BHA No. #20		
2 * 4" taper tap	0.97	0.97
D. box	0.85	1.82
4 – 3/4" DC	8.90	10.72
Fishing jar	2.29	13.01
4 – 3/4" DC	164.84	177.85
3 – 1/2" HWDP	9.12	186.97
X.O.S	1.09	188.06
Total Length (m)		**188.06**
Mud Weight		
Mw (pcf)		103.00

BHA No. #21		
5 – 7/8" M.M.J. Mill	0.93	0.93
4 – 3/4" bit sub	1.07	2.00
4 – 3/4" DC	191.97	193.97
3 – 1/2" DP	9.68	203.65
X.O.S	1.09	204.74
6 – 1/2" D. pin	0.67	205.41
7 – 1/2" junk sub	0.71	206.12
6 – 15/16" junk sub	1.07	207.19
Total Length (m)		**207.19**
Mud Weight		
Mw (pcf)		103.00
BHA No. #22		
2 – 1/2 * 4" taper tap	0.97	0.97
D. box	0.85	1.82
4 – 3/4" DC	8.90	10.72
Fishing jar	2.29	13.01
4 – 3/4" DC	164.84	177.85
3 – 1/2" HWDP	9.12	186.97
X.O.S	1.09	188.06
Total Length (m)		**188.06**
Mud Weight		

Mw (pcf)		103.00
BHA No. #23		
6" M.M.J. Mill	0.93	0.93
4 – 3/4" bit sub	1.07	2.00
4 – 3/4" DC	191.97	193.97
3 – 1/2" DP	29.22	223.19
X.O.S	1.09	224.28
6 – 1/2" D. pin	0.67	224.95
6 – 1/2" junk sub	0.71	225.66
6 – 15/16" junk sub	1.07	226.73
Total Length (m)		**226.73**
Mud Weight		
Mw (pcf)		103.00
BHA No. #24		
2 * 4" taper tap	0.97	0.97
4 – 3/4" bit sub	1.07	2.04
4 – 3/4" DC	8.90	10.94
Fishing jar	2.29	13.23
4 – 3/4" DC	164.84	178.07
3 – 1/2" HWDP	9.12	187.19
X.O.S	1.09	188.28
Total Length (m)		**188.28**

Mud Weight		
Mw (pcf)		103.00
BHA No. #25		
5 – 3/4" impression block	0.395	0.395
X.O.S	0.25	0.65
4 – 3/4" DC	55.05	55.70
3 – 1/2" DP	115.99	171.69
Total Length (m)		**171.69**
Mud Weight		
Mw (pcf)		103.00
BHA No. #26		
5 – 7/8" M.M.J. Mill	0.495	0.495
4 – 3/4" bit sub	1.07	1.57
4 – 3/4" DC	191.97	193.54
3 – 1/2" DP	29.22	222.76
X.O.S	1.09	223.85
Total Length (m)		**223.85**
Mud Weight		
Mw (pcf)		103.00
BHA No. #27, 28		
2 * 4" taper tap	0.97	0.97
4 – 3/4" bit sub	1.07	2.04

4 – 3/4" DC	8.90	10.94
Fishing jar	2.29	13.23
4 – 3/4" DC	164.84	178.07
3 – 1/2" HWDP	9.12	187.19
X.O.S	1.09	188.28
Total Length (m)		**188.28**
Mud Weight		
Mw (pcf)		103.00
BHA No. #29		
6" M.M.J. Mill	0.91	0.91
4 – 3/4" bit sub	1.07	1.98
4 – 3/4" DC	191.97	193.95
3 – 1/2" DP	29.22	223.12
X.O.S	1.09	224.26
Total Length (m)		**224.26**
Mud Weight		
Mw (pcf)		103.00
BHA No. #30		
5 – 5/8" Overshot	1.00	1.00
4 – 3/4" DC	55.05	56.05
3 – 1/2" DP	106.26	162.31
X.O.S	1.09	163.40

5" DP	9.49	172.89
6 – 1/2" jar	2.95	175.84
Total Length (m)		**175.84**
Mud Weight		
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #31		
5 – 5/8" Overshot	2.14	2.14
4 – 3/4" DC	64.38	66.52
3 – 1/2" DP	96.48	163.00
X.O.S	1.09	164.09
5" DP	9.49	173.58
6 – 1/2" jar	2.95	176.53
Total Length (m)		**176.53**
Mud Weight		
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #32		
6" M.M.J. Mill	0.93	0.93
4 – 3/4" bit sub	1.07	2.00
4 – 3/4" DC	219.38	221.38
3 – 1/2" DP	9.69	231.07

X.O.S	1.09	232.16
6 – 1/2" D. pin	0.67	232.83
6 – 1/2" junk sub	0.71	233.54
6 – 15/16" junk sub	1.07	234.61
Total Length (m)		**234.61**
Mud Weight		
Mw (pcf)		103.00
BHA No. #33		
5 – 3/4" taper tap	1.02	1.02
4 – 3/4" bit sub	1.07	2.09
4 – 3/4" DC	219.38	221.47
3 – 1/2" DP	9.69	231.16
X.O.S	1.09	232.25
6 – 1/2" D. pin	0.67	232.92
7 – 1/2" junk sub	0.71	233.63
6 – 5/8" junk sub	1.07	234.70
Total Length (m)		**234.70**
Mud Weight		
Mw (pcf)		103.00
BHA No. #34		
3 – 1/2" M.M.J. Mill	0.66	0.66
3 – 1/8" bit sub	0.80	1.46

3 – 1/8" DC	158.08	159.51
X.O.S	0.69	160.20
4 – 3/4" D. pin	0.32	160.52
4 – 3/4" bit sub	1.07	161.59
3 – 1/2" DP	144.69	306.28
X.O.S	1.09	307.37
Total Length (m)		**307.37**
Mud Weight		
Mw (pcf)		103.00
BHA No. #3٥		
٦" J.J.M Mill	0.93	0.93
7" scraper	1.01	1.94
4 – 3/4" bit sub	1.07	3.01
4 – 3/4" DC	100.89	103.90
X.O.S	1.09	107.99
6 – 1/2" D. pin	0.55	105.54
9 – 5/8" scraper	1.38	106.92
6 – 1/2" bit sub	1.15	108.07
6 – 1/2" DC	27.06	135.13
Total Length (m)		**135.13**
Mud Weight		
Mw (pcf)		103.00

BHA No. #36		
X.O.S	0.25	0.25
7" scraper	1.01	1.26
4 – 3/4" bit sub	1.07	2.33
4 – 3/4" DC	100.89	103.22
X.O.S	1.09	104.31
6 – 1/2" D. pin	0.55	104.86
9 – 5/8" scraper	1.38	106.24
6 – 1/2" bit sub	1.15	107.39
6 – 1/2" DC	27.06	134.45
Total Length (m)		**134.45**
Mud Weight		
Mw (pcf)		103.00
BHA No. #37		
6" M.M.J. Mill	0.93	0.93
4 – 3/4" bit sub	1.07	2.00
4 – 3/4" DC	191.97	193.97
3 – 1/2" DP	9.69	203.66
X.O.S	1.09	204.75
6 – 1/2" D. pin	0.67	205.42
7 – 1/2" junk sub	0.71	206.13
6 – 3/4" junk sub	1.07	207.20

Total Length (m)		207.20
Mud Weight		
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #38		
3 – 1/8" J. Mill	0.66	0.66
3 – 1/8" bit sub	0.80	1.46
3 – 1/8" DC	92.61	94.07
X.O.S	0.80	94.87
2 – 7/8" DP	85.33	180.20
X.O.S	1.16	181.36
D. pin	0.67	182.03
3 – 1/8" junk sub	0.92	182.95
3 – 1/2" DP	144.69	327.64
X.O.S	1.09	328.73
Total Length (m)		**328.73**
Mud Weight		
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #39		
3 – 1/8" DC	92.61	92.61
X.O.S	0.80	93.41

2 – 7/8" DP	94.47	187.88
X.O.S	1.17	189.05
D. pin	0.32	189.37
5 – 3/8" junk sub	0.92	190.29
3 – 1/2" DP	144.69	334.98
X.O.S	1.09	336.07
6 – 1/2" D. pin	0.67	336.74
6 – 1/2" bit sub	0.89	337.63
Total Length (m)		**337.63**
Mud Weight		
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #40		
5 – 1/8" D. mill	0.35	0.35
4 – 3/4" DC	55.05	55.40
3 – 1/2" DP	144.69	200.09
X.O.S	1.09	201.18
D. pin	0.67	201.85
Bit sub	0.89	202.74
Total Length (m)		**202.74**
Mud Weight		
Mw (pcf)		103.00

Tool Description	Length (m)	Cum. Length (m)
BHA No. #41		
3 – 1/2" J. mill	0.87	0.87
3 – 1/8" bit sub	0.80	1.67
3 – 1/8" DC	92.61	94.28
X.O.S	0.80	95.08
2 – 7/8" DP	85.33	180.41
X.O.S	1.17	181.58
D. pin	0.32	181.90
5 – 3/8" junk sub	0.92	182.82
3 – 1/2" DP	144.69	327.51
X.O.S	1.09	328.60
Total Length (m)		**328.60**
Mud Weight		
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #42		
5 – 1/8" polish mill	0.35	0.35
4 – 3/4" DC	55.05	55.40
3 – 1/2" DP	144.69	200.09
X.O.S	1.09	201.18
D. pin	0.67	201.85

Bit sub	0.89	202.74
Total Length (m)		**202.74**
Mud Weight		
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #43		
3 – 1/2" J. mill	0.43	0.43
3 – 1/8" bit sub	0.80	1.23
3 – 1/8" DC	92.61	93.84
X.O.S	0.80	94.64
2 – 7/8" DP	85.33	179.97
X.O.S	1.17	181.14
3 – 1/2" D. pin	0.32	181.46
5 – 3/8" junk sub	0.92	182.38
3 – 1/2" DP	144.69	327.07
X.O.S	1.09	328.16
Total Length (m)		**328.16**
Mud Weight		
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #44		
3 – 1/2" J. mill	0.43	0.43

3 – 1/8" bit sub	0.80	1.23
3 – 1/8" DC	92.61	93.84
X.O.S	0.80	94.64
X.O.S	1.17	95.81
3 – 1/2" DP	58.06	153.87
3 – 1/2" D. Pin	0.32	154.19
5 – 3/8" junk sub	0.92	155.11
3 – 1/2" DP	115.58	270.69
X.O.S	1.09	271.78
Total Length (m)		**271.78**
Mud Weight		
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #45		
3 – 1/2" J. mill	0.43	0.43
3 – 1/8" bit sub	0.80	1.23
3 – 1/8" DC	92.61	93.84
X.O.S	0.80	94.64
2 – 7/8" DP	57.15	151.79
X.O.S	1.17	152.96
3 – 1/2" DP	58.06	211.02
3 – 1/2" D. pin	0.32	211.34

5 – 3/8" junk sub	0.92	212.26
3 – 1/2" DP	115.58	327.84
X.O.S	1.09	328.93
Total Length (m)		**328.93**
Mud Weight		
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #46, 47		
5 – 7/8" M.M.J. mill	0.92	0.92
4 – 3/4" bit sub (float in)	1.07	1.99
4 – 3/4" DC	82.84	84.83
3 – 1/2" DP	115.99	200.82
Total Length (m)		**200.82**
Mud Weight		
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #48		
3 – 1/2" M.M.J. mill	0.43	0.43
3 – 1/8" bit sub	0.80	1.23
3 – 1/8" DC	92.61	93.84
X.O.S	0.80	94.64
2 – 7/8" DP	115.08	209.72

X.O.S	1.17	210.89
3 – 1/2" DP	144.69	355.58
X.O.S	1.09	356.67
Total Length (m)		**356.67**
Mud Weight		
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #49		
7" scraper	1.01	1.01
4 – 3/4" bit sub	1.07	2.08
4 – 3/4" DC	55.05	57.13
3 – 1/2" DP	58.06	115.19
Total Length (m)		**115.19**
Mud Weight		
Mw (pcf)		105.00

6. Casing Information

Casing Spec.	20"	K – 55, 94^{ppf}, BTC	0 – 146^{m}
	13-3/8"	N – 80, 68^{ppf}, BTC	0 – 2033^{m}
	9-5/8"	T-95, 53^{ppf}, TSH	0 – 3882^{m}
	7"	110S, 29^{ppf}, TPCQ	3802 – 4150^{m}
	4-1/2" P.L	T – 95, 15.2^{ppf}, TPCQ	3896 – 3966^{m}
	4-1/2" P.L	T – 95, 13.5^{ppf}, TENARIS	3966 – 4089^{m}

Table 6-1: AZNS-116 Final Casing Data

7. Cement Job Report

Not Applicable.

8. Completion Report

8.1 Completion Tubing Information

Tubing Size (in)	Weight (ppf)	Grade	Ultimate Strengths	Connection	Collapse Pressure (psi)	Burst Pressure (psi)	Interval (m)
4 – 1/2	18.9	L – 80	233^{klb}	HSM3	13830	13380	0 – 3691.15
3 – 1/2	10.2	L – 80	440^{klb}	HSM3	12120	11560	3691.15 – 3850.8

Table 8-1: AZNS-116 Tubing Data

8.2 Completion Tools Specification Checklist

Item	Equipment Description	
1	**CONTROL LINE "WEIQIXIN":**	
	THINKNESS:	0.065"
	WORK PRESSURE:	15000 PSI
	O.D.:	0.25"
	TYPE:	SEAMLESS
	MATERIAL:	INC 825
	LENGTH:	120m/Roll
2	**UPPER FLOW COUPLING " WEIQIXIN" :**	
	OD:	**5.5"**
	ID:	3.640"
	THREADS:	4-1/2" 18.9 PPF, HSM3
	WORKING PRESSURE:	10000 PSI
	LENGTH:	6 FT
	MATERIAL:	13CR-110KSI
	LOWER FLOW COUPLING " WEIQIXIN" :	
	OD:	5.550"
	ID:	3.640"
	THREADS:	4-1/2" 18.9 PPF, HSM3
	WORKING PRESSURE:	10000 PSI
	LENGTH:	4 FT
	MATERIAL:	13CR-110KSI
3	**TUBING RETRIEVABL SAFETY VALVE " WEIQIXIN" :**	
	SETTING DEPTH:	62.62^{m}
	WORKING PRESSURE:	10000 PSI
	TEMPERATURE:	325 DEG F

	MAX O.D.:	7.5"
	MIN. I.D.:	3.437"
	PROFILE:	AF
	SELF-EQUALIZING FEATURE	HYDRAULIC CONTROL
	MATERIAL:	13CR-110KSI
	THREADS:	4-1/2" 18.9 PPF HSM3
	PROTECTION SLEEVE	
	PROFILE	AF
	MIN ID	2.9"
4	**TRAVELING JOINT " WEIQIXIN" :**	
	STROKE LENGTH	10 FT
	SHEAR PIN SET:	15000LB
	ELASTOMER:	AFLAS
	WORKING PRESSURE:	10000 psi
	TEMPERATURE:	300 DEG F
	TOOL OD:	5.315"
	TOOL ID:	2.922"
	THREADS:	3-1/2" 10.20 PPF HSM3 B*P
	MATERIAL:	13CR-110KSI
	TRANSFER TORQUE FEATURE	YES
5	**SLIDING SIDE DOOR " WEIQIXIN" :**	
	PROFILE:	X
	MAX.OD:	4.551"
	MIN ID:	2.750"
	PRESSURE RATING:	10000 PSI
	TEMPERATURE:	300 DEG F
	THREADS:	3-1/2" 10.20 PPF HSM3 B*P
	MATERIAL:	13CR-110KSI
	OPEN METHOD	DOWNWARD OPEN
6	**COMPLETION PACKER " WEIQIXIN" :**	
	TYPE:	PERMANENT
	CASING :	7" 32 PPF
	OD:	5.689"
	ID:	2.922"
	WORKING PRESSURE:	10000 PSI
	TEMPERATURE:	300 DEG F
	THREADS:	3-1/2" 10.20 PPF HSM3 B*P
	MATERIAL:	13CR-110KSI
	ELEMENT MATERIAL:	AFLAS
	4.0" ANCHOR SEAL	
	MAX OD (PACKING):	4"
	ID:	2.922"
	WORKING PRESSURE:	10000PSI
	TEMPERATURE:	300 DEG F
	THREADS:	3-1/2" 10.20 PPF HSM3 B
	TYPE:	RATCH LATCH

7	**LANDING NIPPLE " WEIQIXIN" :**	
	PROFILE TYPE:	XN
	WORKING PRESSURE:	10000 PSI
	MAX O.D.:	4.5"
	SEAL BORE:	2.75”
	MIN ID:	2.635"
	THREADS:	3-1/2" 10.20 PPF HSM3 B*P
	TEMPERATURE:	300 DEG F
	MATERIAL:	13CR-110KSI
8	**RE-ENTRY GUIDE SHOE " WEIQIXIN" :**	
	OD:	4.5"
	MIN ID:	2.922"
	TOP CONNECTION	3-1/2" 10.20 PPF HSM3 BOX
	MATERIAL:	13CR-110KSI
9	**3-1/2" CHEMICAL INJECTION" WEIQIXIN" :**	
	TYPE	TUBING RETRIVABLE
	MAX OD	5.00"
	MIN ID	2.922"
	MATERIAL:	13CR-110KSI
	TEMPERATURE	300 DEG F
	CONNECTION	3-1/2" 10.20 PPF HSM3 B*P
	CIV CONNECTION	NPT 3/8" BOX FOR CIV
	1.00"CIV VALVE	
	TYPE	DUAL CHECK VALVE WITH RUPTURE DISC
	WORKING PRESSURE	15000PSI
	MARERIAL	13CR-110KSI
	TEMPERATURE:	300 DEG F
	TOP CONNECTION	3/8" AUTOCLAVE
	BOTTOM CONNECTION	3/8" NPT
	RUPTURE DISC PRESSURE	6000PSI

Table 8-2: AZNS-116 Equipment Checklist

Item	Name	Description
1	**Tubing Hanger**	11" BOWL x 4-1/2" 18.9 PPF BOX TPCQ-EX CONNECTION BOTTOM & 4-1/2" 4-2G ACME BOX TOP WITH 4-1/2" EXTENDED NECK, WITH ONE CONTINUOUS 1/4" NPT C.LINE EXIT FOR SSSV, ONE 1/4" LINE EXIT FOR DHPG, INSTALLATION COMPLETE WITH RELATED FITTINGS AND PLUGS, WITH TWO CHANNEL FOR 3/8" CHEMICAL, C/W ALIGNMENT PREPATION FOR ESP. BPV: 4" TYPE H THREAD PREPARATION, THREE FS SEAL TO PACK OFF THE UPPER NECK AND TWO S SEAL TO PACK OFF THE BODY OF HANGER, MATERIAL: 410SS. M.C: FF-0.5 T.C: U PSL:3G PR:2 COMPANY: MSP
2	**Fluted Adaptor**	4 1/2" 18.9 PPF, L-80 HSM3 PIN * TPCQ EX PIN, OD: 5.5'' ID: 3.64'' SLOTS: 6 * 1 INCH WIDTH


Table 8-3: AZNS-116 Equipment Checklist

8.3 Assembling Test Report

WEIQIXIN PETROLEUM MACHINERY(TIANJIN)CO.LTD

惟其信 WEIQIXIN


SCSSV Test Report

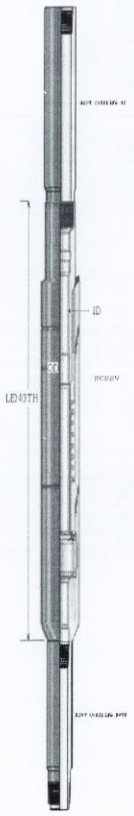


Type:	210W 343-AF04	
Serial Number:	2308 23038-06	
Connection Size:	4-1/2" 18.90 PPF HSM3 BOX × PIN	
Working Pressure	10,000Psi	
OD:	7.500"	
ID:	3.437"	
Length:	1.784 m	
Material:	S13CR-110 KSI	
Hydraulic Control Pressure	Full Open	Full Closed
	1800 Psi	800 Psi
8,000 Psi Hydraulic Control Pressure No Drop in 15 Minutes	ok	
8,000 Psi Pressure No Drop in 15 Minutes	ok	
8,000 Psi flapper Pressure No Drop in 15 Minutes	ok	
Top Connection	Length:	1.620 m
Top Flow Coupling:	Serial Number:	2307 Y230414-06
	Length:	1.724 m
Bottom Flow Coupling:	Serial Number:	2307 Y230415-06
	Length:	1.118 m
Bottom Connection:	Length:	1.624m
Well Name and Location:	AZNS-116	
MSA Project Manager: **Name/Title:** **Date:**	Hajitaleb 24	
WQX: **Name/Title:** **Date:**	2024. 9. 30	

Page 1 of 18


ماهان صنعت آریا
Drilling Supervisor
South Azadegan Project
Rig No:
EPDS CONTRACTOR Date:

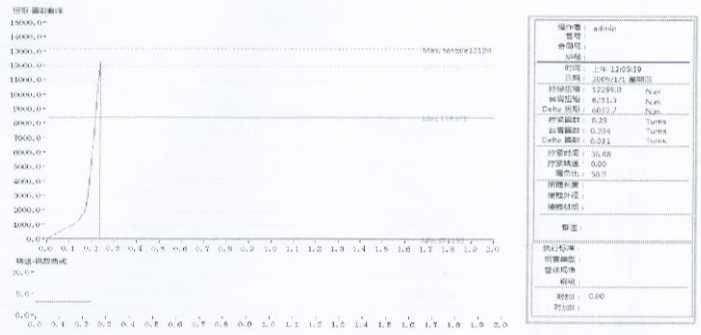

Top pup joint-top flow coupling

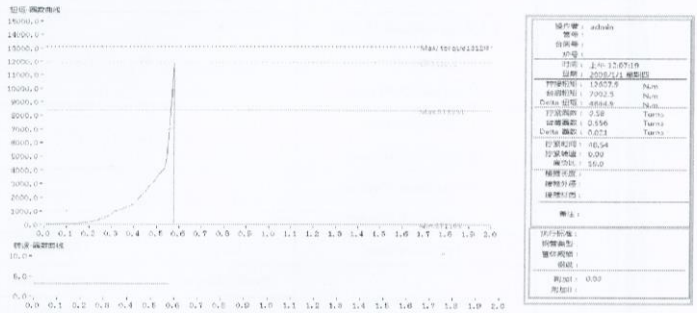


Top flow coupling – 3SV

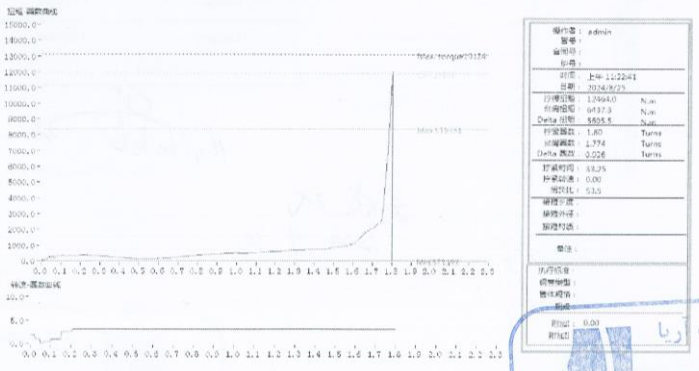


3SV - bottom flow coupling

ماهان صنعت زریا
Drilling Supervisor
South Azadegan Project
Rig No:
PDS CONTRACTOR Date:

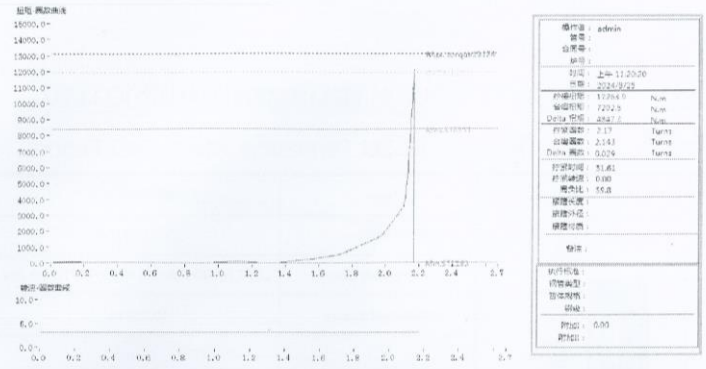

Bottom flow coupling - bottom pup joint

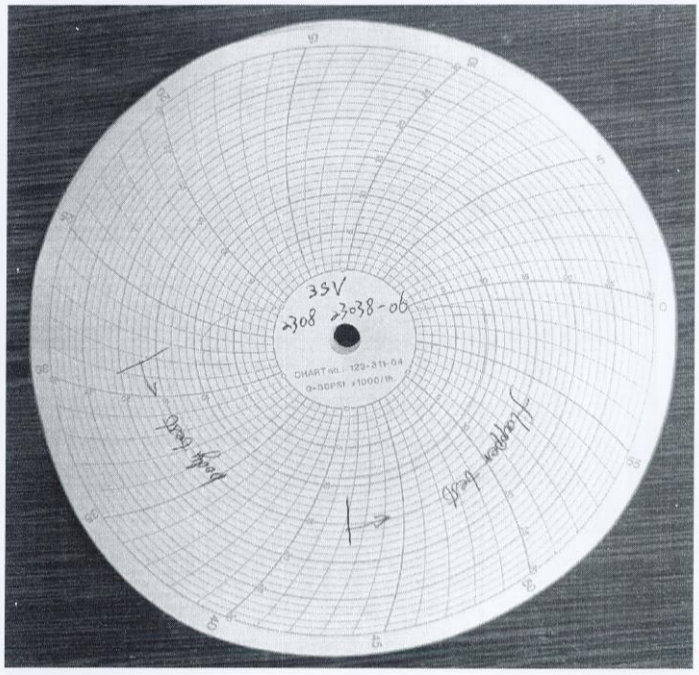


Pressure test curve

WEIQIXIN PETROLEUM MACHINERY(TIANJIN)CO.LTD

WEIQIXIN

WSDP Hydraulic Set Permanent Packer Test Report

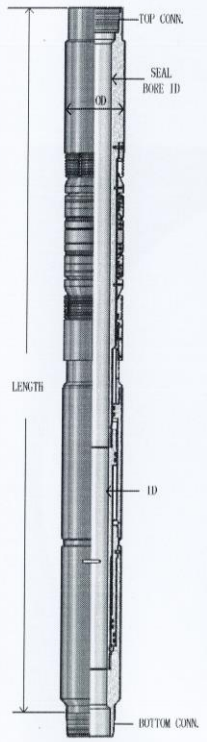

Type:	336W150-000	
Serial Number:	2308 23062-06	
Connection Size:	LEFT HAND X 3-1/2" 10.20 PPF HSM3 PIN	
Working Pressure	10,000 Psi	
OD:	5.910"	
ID:	2.922"	
Length:	4.445m	
Material:	S13CR-110KSI	
Temperature:	300 DEG F	
Element :	Aflas	
Setting Pressure:	3,500 Psi	
Seal Bore Size:	Upper Seal Bore ID:4.00" & Lower Seal Bore ID:2.922"	
Top Connection:	Length:	1.553m
Bottom Connection:	Length:	1.553 m
Well Name and Location:	AZNS-116	

MSA Project Manager:
Name/Title:
Date: Hajitaleb 24


WQX:
Name/Title:
Date: 2024.9.30

MSA — Drilling Supervisor — South Azadegan Proj. — Rig No: — EPDS CONTRACTOR — Date:

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

惟其信 WEIQIXIN

Model WK Anchor Tubing Seal Report

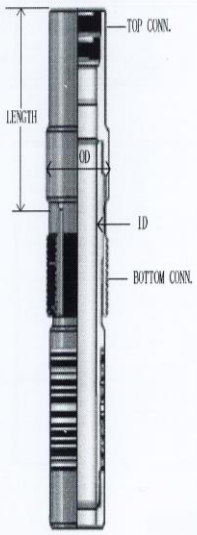


Type:	360W150-000
Serial Number:	2308 23063-06
Connection Size:	3-1/2" 10.20 PPF HSM3 BOX X MULE SHOE GUIDE
OD:	5.689"
ID:	2.922"
Seal OD:	4.000"
Working pressure:	10,000Psi
Length:	230mm
Material:	S13CR-110 KSI
Well Name and Location	AZNS-116

MSA Project Manager:
Name/Title: Hajitaleb
Date:


WQX:
Name/Title:
Date: 2024. 9. 30

Page 5 of 18


ساهان صنعت آریا
Drilling Supervisor
South Azadegan Proj.
Rig No:
EPDS CONTRACTOR Date:

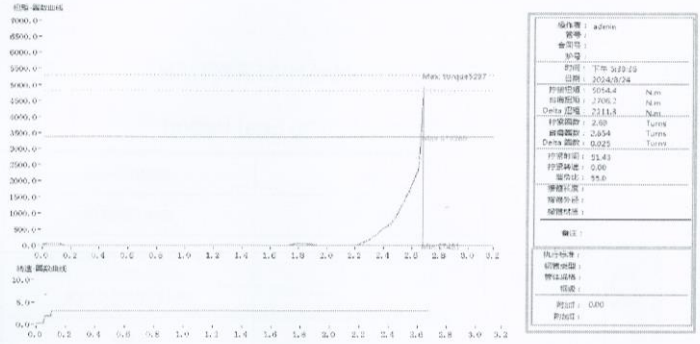

Top pup joint – anchor seal

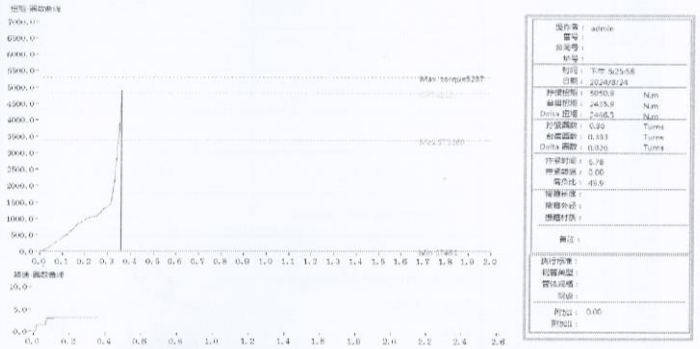

Packer – bottom pup joint

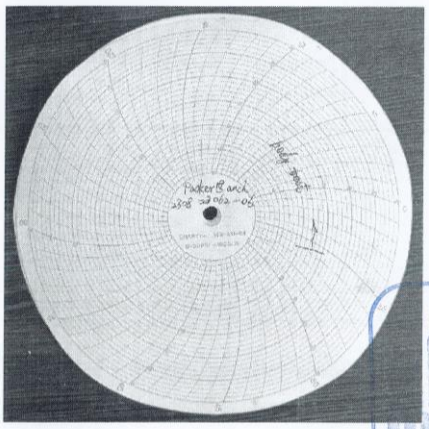


Pressure test curve

شاهان صنعت آریا
Drilling Supervisor
South Azadegan Proj...
Rig No:
EPDS CONTRACTOR Date:

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

惟其信 WEIQIXIN

Sliding Side Door Test Report

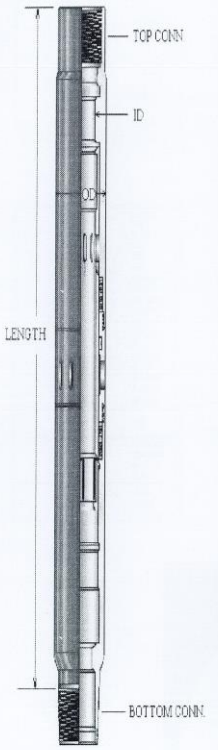


Type:	750W275-X39	
Serial Number:	2308 23039-06	
Connection Size:	3-1/2" 10.20 PPF HSM3 BOX× PIN	
Working Pressure	10,000 Psi	
OD:	4.551"	
ID:	2.750"	
Seal Bore ID :	2.750"	
Length:	1.200m	
Temperature	300 DEG F	
Material:	S13CR-110KSI	
Profile:	X	
Shifting Direction:	DOWNWARD OPEN	
Top Connection:	Length:	1.556 m
Bottom Connection:	Length:	9.522 m
8,000 Psi Pressure No Drop in 15 Minutes	Ok	
8,000 Psi blanking plug Pressure No Drop in 15 Minutes	Ok	
Well Name and Location:	AZNS-116	

MSA Project Manager:
Name/Title: Hajitaleb
Date:


WQX:
Name/Title:
Date: 2024. 9. 30

Page 7 of 18


ماهان صنعت آریا
Drilling Supervisor
South Azadegan Project
Rig No:
MSA EPDS CONTRACTOR Date:

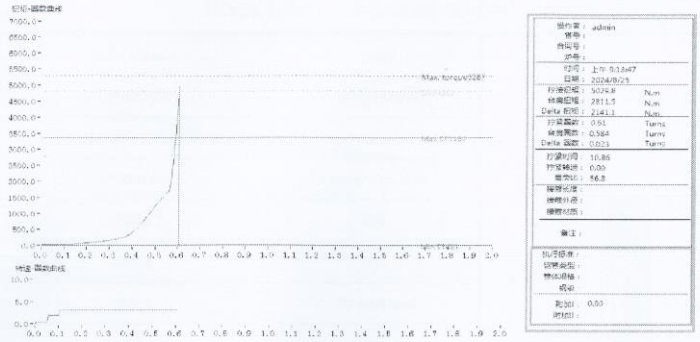

Top pup joint – SSD

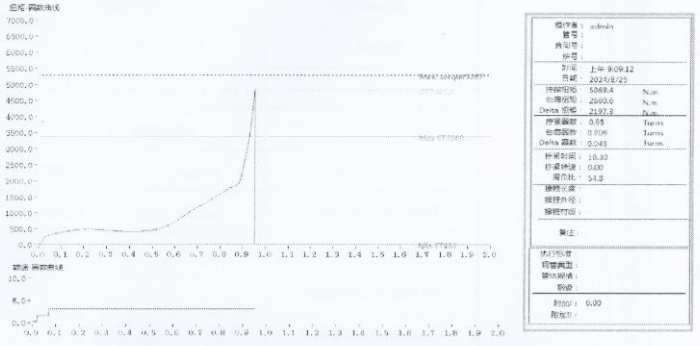

SSD – bottom joint

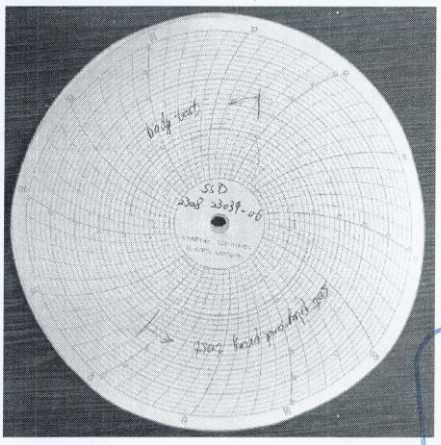


Pressure test curve

ماهان صنعت آریا
Drilling Supervisor
South Azadegan Project
Rig No:
EPDS CONTRACTOR Date:

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD


惟其信 WEIQIXIN

Expansion Joint Test Report

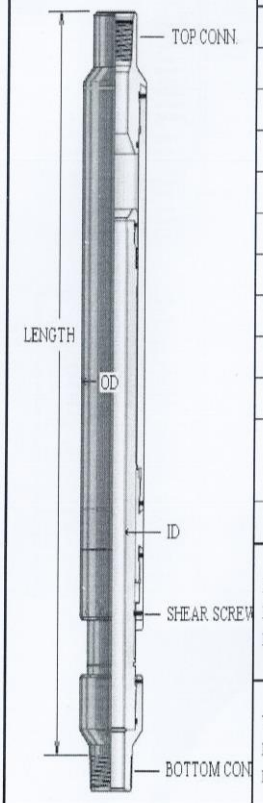


Type:	370W350-030	
Serial Number:	2308 23040-06	
Connection Size:	3-1/2" 10.20 PPF HSM3 BOX× PIN	
Working Pressure	10,000 Psi	
OD:	5.315"	
ID:	2.922"	
Length:	5.782 m	
Material	S13CR-110KSI	
Share Screw:	3	
Top Connection:	Length:	1.552 m
Bottom Connection:	Length:	1.555 m
8,000 Psi Pressure No Drop in 15 Minutes	ok	
Well Name and Location:	AZNS-116	
MSA Project Manager: **Name/Title:** **Date:**	Hajitaleb 2/5	
WQX: **Name/Title:** **Date:**	2024. 9. 30	


ماهان صنعت آریا
Drilling Services
South Azadegan Project
Rig No:
EPDS CONTRACTOR Date:

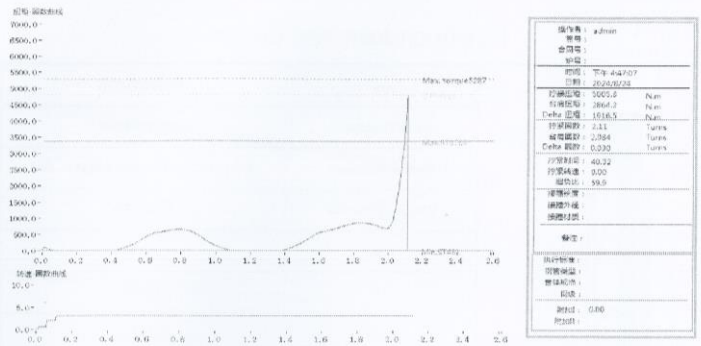

Top pup joint – EX.J

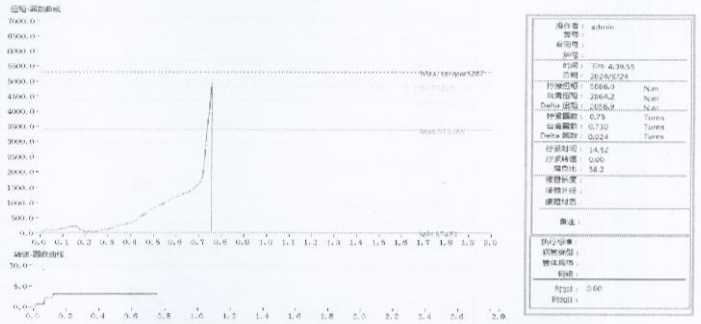

EX.J – bottom pup joint

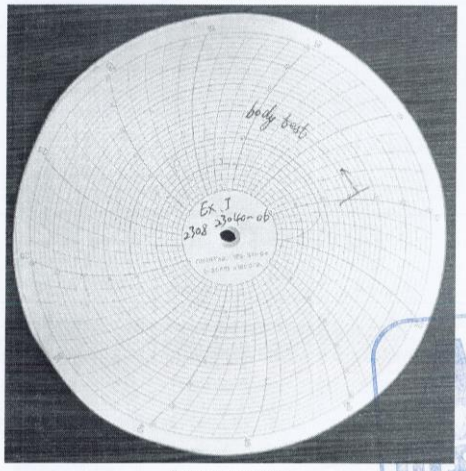


Pressure test curve

Drilling Supervisor
South Azadegan Proje
Rig No:
EPDS CONTRACTOR Date:

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

惟其信 WEIQIXIN

Landing Nipple Test Report

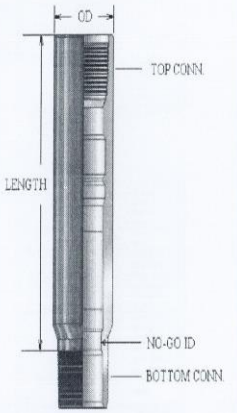


Type:	706W275-N24	
Serial Number:	2307 Y230416-06	
Connection Size:	3-1/2"10.22 PPF HSM3 BOX × PIN	
OD:	4.500"	
ID:	2.750"	
NO-GO ID:	2.635"	
Length:	0.374m	
Material:	S13CR-110 KSI	
Top Connection:	Length:	1.560m
8,000 Psi check valve Pressure No Drop in 15 Minutes	Ok	
Well Name and Location	AZNS-116	


MSA Project Manager:
Name/Title: Hajitaleb
Date:

WQX:
Name/Title:
Date: 2024. 9. 30


ماهان صنعت آریا
Drilling Supervisor
South Azadegan Project
Rig No:
EPDS CONTRACTOR Date:

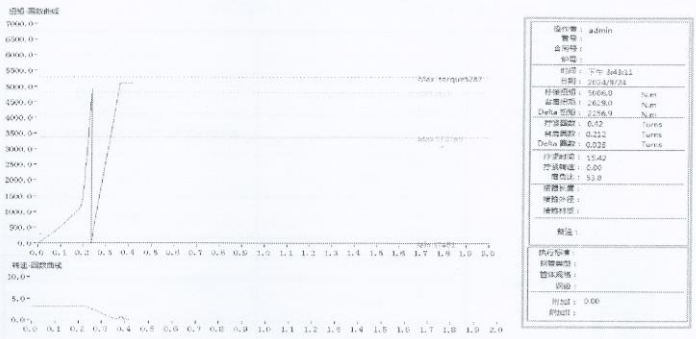

Top point – L.N

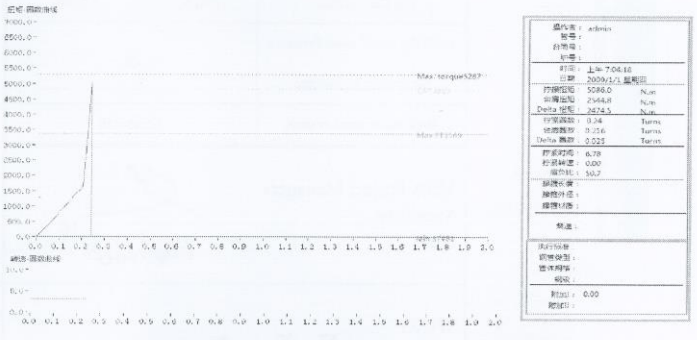

L.N – Muleshoe

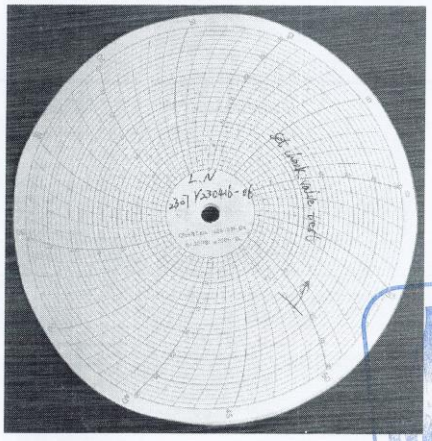

Pressure test curve

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

Chemical Injection Valve Test Report



Type:	802W100-601
Serial Number:	2309 23104-05
Connection Size:	3/8" JAM NUT BOX x 3/8" NPT PIN
OD:	1"
ID:	0.299"
Rupture DISK:	6000Psi
Spring open pressure:	500Psi
Length:	310mm
Material:	S13CR-110 KSI
8,000 Psi Pressure No Drop in 15 Minutes	Ok
Well Name and Location	AZNS-116


MSA Project Manager:
Name/Title:
Date: Hajitaleb 24

WQX:
Name/Title:
Date: 2024.9.30

ماهان صنعت آریا
Drilling Supervisor
South Azadegan Proj.
Rig No:
MSA CONTRACTOR Date:

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

Chemical Injection Mandrel Test Report

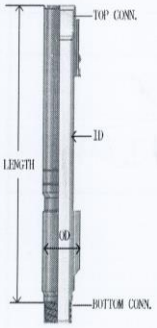


Type:	800W350-028	
Serial Number:	2309 Y230826-03	
Connection Size:	3-1/2" 10.2PPF HSM3 BOX × PiN	
OD:	5.000"	
ID:	2.922"	
Working pressure:	15,000Psi	
Temperature:	300 DEG F	
Length:	0.728m	
Top Connection:	Length:	1.560 m
Bottom Connection:	Length:	9.519 m
Material:	S13CR-110KSI	
8,000 Psi Pressure No Drop in 15 Minutes	Ok	
Well Name and Location	AZNS-116	


MSA Project Manager:
Name/Title:
Date: Hajitaleb 26

WQX:
Name/Title:
Date: 2024.9.30


ماهان صنعت آریا
Drilling Supervisor
South Azadegan Proj...
Rig No:
CONTRACTOR Date:

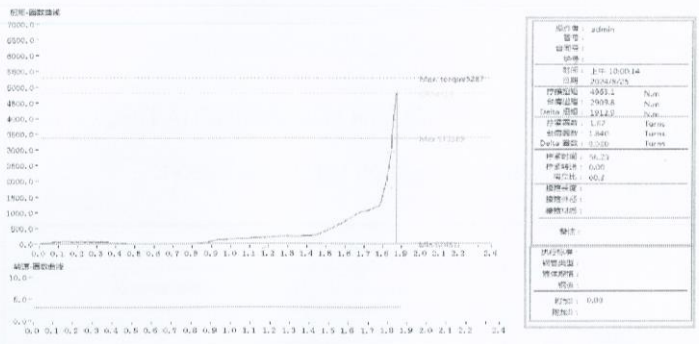

Top pup joint - CIM

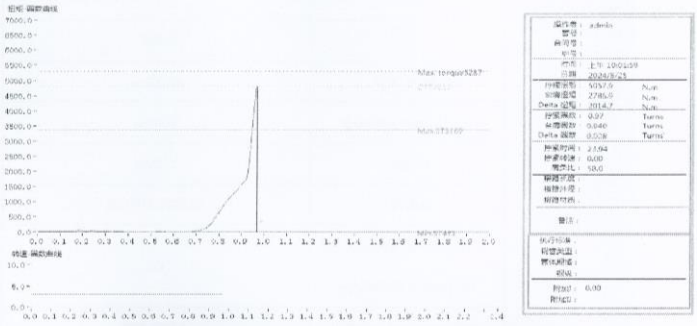

CIM – bottom joint

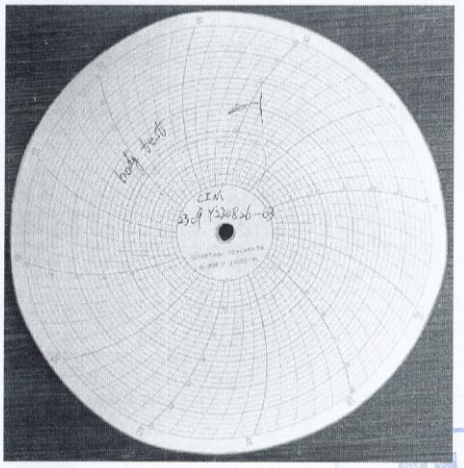

Pressure test curve

Page 15 of 18

ماهان صنعت آریا
Drilling Supervisor
South Azadegan Project
Rig No:
CONTRACTOR Date:

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

Chemical Injection Valve Test Report



Type:	802W100-601
Serial Number:	2309 23104-04
Connection Size:	3/8" JAM NUT BOX x 3/8" NPT PIN
OD:	1"
ID:	0.299"
Rupture DISK:	6000Psi
Spring open pressure:	500Psi
Length:	310mm
Material:	S13CR-110 KSI
8,000 Psi Pressure No Drop in 15 Minutes	Ok
Well Name and Location	AZNS-116

MSA Project Manager:
Name/Title: Haji taleb
Date:


WQX:
Name/Title:
Date: 2024.9.30

ماهان صنعت آریا
Drilling Supervisor
South Azadegan Project
Rig No:
EPDS CONTRACTOR Date:

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

惟其信 WEIQIXIN

Chemical Injection Mandrel Test Report

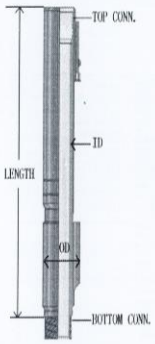

Type:	800W350-028	
Serial Number:	2309 Y230826-04	
Connection Size:	3-1/2" 10.2PPF HSM3 BOX × PIN	
OD:	5.000"	
ID:	2.922"	
Working pressure:	15,000Psi	
Temperature:	300 DEG F	
Length:	0.728m	
Top Connection:	Length:	1.552 m
Bottom Connection:	Length:	9.515 m
Material:	S13CR-110KSI	
8,000 Psi Pressure No Drop in 15 Minutes	Ok	
Well Name and Location	AZNS-116	
MSA Project Manager: **Name/Title:** **Date:** Hajitaleb		
WQX: **Name/Title:** **Date:** 2024.9.30		

ماهان صنعت آریا
Drilling Supervisor
South Azadegan Project
Rig No:
EPDS CONTRACTOR Date:

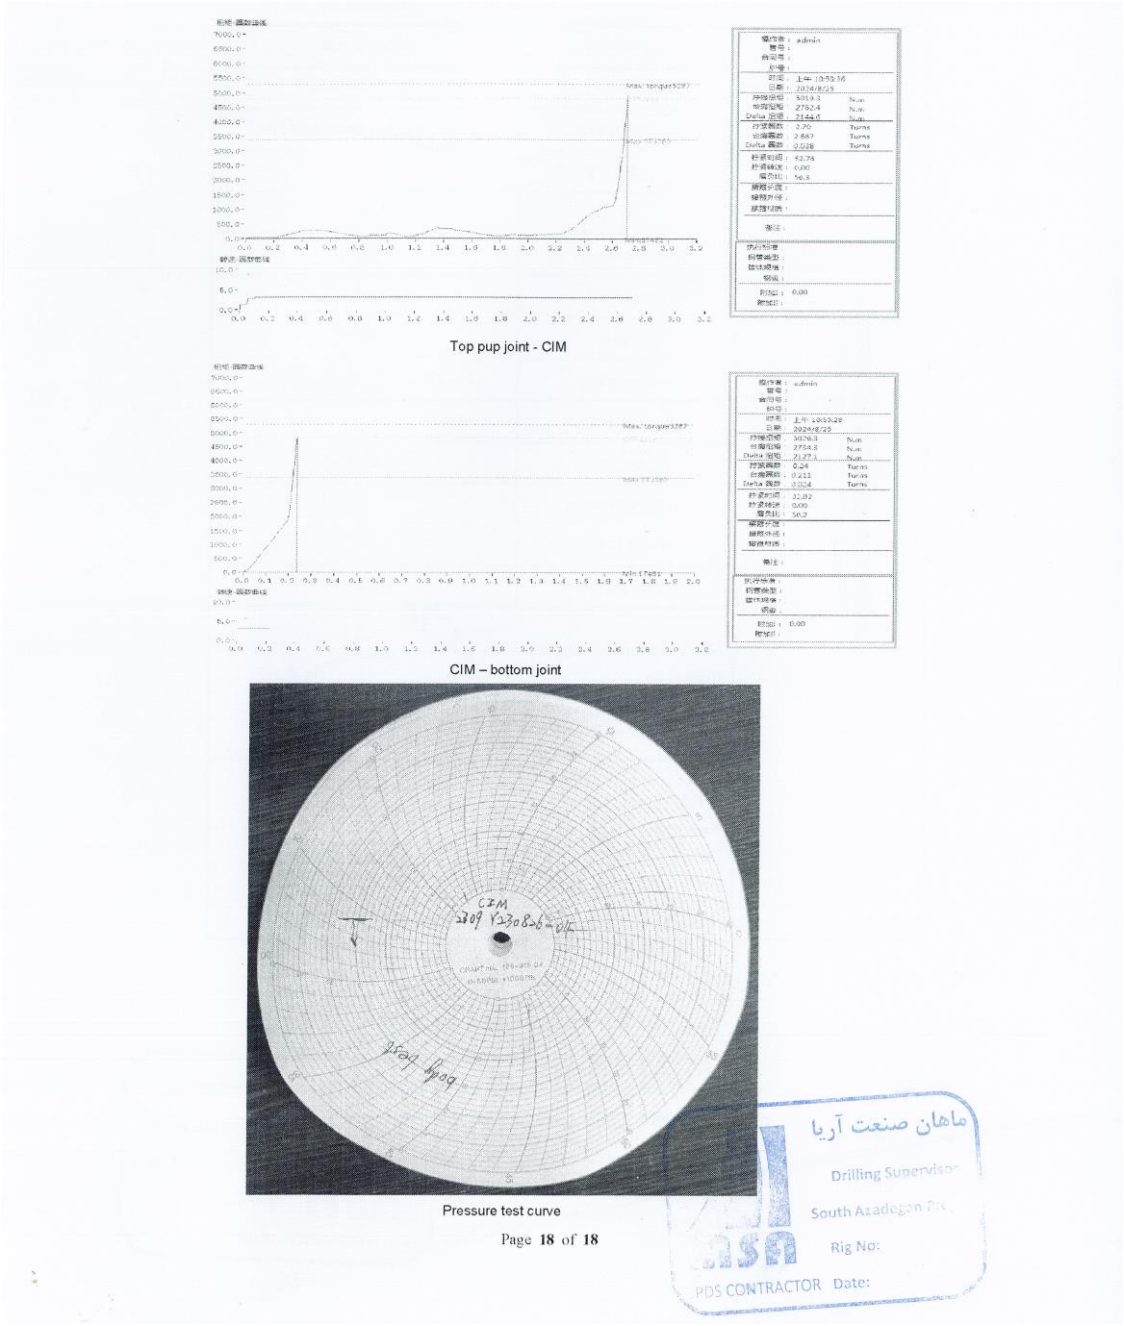


Figure 8-1: AZNS-116 Assembling & Test Report

8.4 Completion Operation Checklist

Item	Operation Name	Remark	Check Mark✓
1	Scraper Trip	Packer depth should be scraped	√
2	Pre-job preparation	Pre-connection All Down Hole Equipment With Upper & Lower Pup Joints On Confirmed Thread-makeup at Workshop, And Pressure Test Prior To Being Transported To Well Site.	√
		Retrieve Wear Bushing, M/U Jet Sub And Flush Bop Stack & Well Head With Fresh Water.	√
		All Crossovers, Pup Joints For Space Out Measured Put In Right Place.	√
		Lift Control Line And Protectors On Rig Floor.	√
		Hold A Pre-Job Safety Meeting For Running Upper Completion String.	√
3	Assembling and RIH	M/U 3-1/2" Re-entry Guide Shoe And 3-1/2" BTM No Go Landing Nipple	√
		Check The Conditions Landing Nipple To Make Sure There Is No Damage, Observe There Is No Any Trash Trapped Inside.	√
		Assemble Landing Nipple.	√
		RIH 1 Joint Tubing As Per Tally	√
		P/U And M/U Hydraulic-Set PERMANENT Production Packer.	√
		Much More Care Should Be Taken When Packer Is Passing Well Head And Liner Hanger While RIH,	√
		Assemble Ratch Latch If Packer	-
		Slack Off Packer Assembly, Double Check The Quantity Of Shear Pins,	√

		Remove The Tape On The Element, Check If Any Damages On It.	
		RIH 1 Joint Tubing As Per Tally	√
		M/U Pup Joint And SSD (close Position) To Tubing String With check valve Inside.	√
		Pressure Test Tubing String 7000psi/15min Every 50 JTs.	√
		RIH Completion String and M/U traveling joint as per running tally.	√
		M/U 2 NO. CIV as per running tally& Press Test to 2000 Psi.	-
		Cont. Running Tubing as per Tally while Install Cross protector for the 2 NO. 3/8"control line.	-
		M/U TRSSSV	√
		Install control line to TRSSSV and pressure test control line 8000psi x 15mins. And then keep 5000psi pressure while running to ensure TRSSSV open. Install TRSSSV protector for the 1/4" control line. Continue to run 4-1/2" tubing as per running tally.	√
4	M/U and Space out Tubing Hanger	Pick up & M/U tubing hanger with double pin crossover. M/U landing joint. Check string weight upward and downward.	√
		Roughly cut control line about 2 meters above tubing hanger, wrap 2-3 turns and then feed through Tubing Hanger.	√
		Check string weight upward and downward and Space out Tubing Hanger 1.5 m (Half stroke) above tubing head spool	√
Item	**Operation Name**	**Remark**	**Check Mark✓**
5	Set	R/Up Slick Line. Remove Check valve inside SSD	√

	production packer	RIH and Set check vlve in Landing Nipple. POOH to surface.	√
		Pressurize inside tubing to 500psi to ensure traveling joint is full open. Increase Pressure gradually to SET PACKER. Increase pressure to 7000 Psi to Test String.	√
7	Land Tubing hanger	Move down completion string and apply required weight to shear traveling joint load pins and Land Tubing hanger in T.H.S. Slack off completely & Record the weight.	√
		Drain the BOP stack through the gate valves of tubing head before landing hanger in THS. Leave the valves open.	√
		Tie Down Screws on THS should be fully open before Operation	√
8	N/D BOP & N/U X-mas tree	Tighten tie down screws.	√
		Test inside string w/ 5000 psi, 15 min.	√
		R/Up Slick Line. RIH with slick line and Ret. Check valve from Landing Nipple. POOH to surface.	√
		Test Annulus w/ 2000 Psi 15min.	√
		Close BOP ram and test above tubing hanger (annulus between BOP and landing joint) to 1000psi.	√
		B/O & L/D landing joint.	√
		Set 4” 2Way in TBG Hanger & Test it, Back off and L/D Running Tool.	√
		N/D BOP.	√
		Feed control line, through head bonnet.	√
		Check hanger for any damage and pressure test control line to 5000psi	√


		Pressure test chemical injection line & rapture the disc after installing Bonnet.	-
		N/U x-mass tree as program.(Bottom Master)	√
		Perform required tests for X-mass tree. (Bottom Master)	√
		Connect from X-mass tree production valve to the pump unit & well test choke manifold with T-type connection & test all lines to 7500 Psi.	√
		Remove 4" two way, install 4" one way	√
		Close TRSSSV	√
		Release the rig. Clean the well site.	√

Table 8-4: AZNS-116 Operation Checklist

8.5 Completion Sketch & Tally

AZNS-116 Completion Sketch

Field	AZADEGAN	Description	7"Liner	new 4 1/2" Liner	4 1/2" Tubing	3 1/2" Tubing	7'' Liner Lap:	3802.7
Well Number:	AZNS-116	OD[in]	7.00	4.50	4.50	3.50	7'' Liner Shoe:	4149.5
Rig :	201-OEOC	Nominal weight [lb/ft]	29.00	15.20	18.90	10.20	4.5'' tie back Liner Lap:	3896
RTE-GLE	14.45	Grade	110SS	T-95	L-80	L-80	4.5" Liner Shoe:	4089.5
RTE-THF	10/2	Thread	TPCQ	TPCQ	HSM3	HSM3	Total Depth:	4150
Rig Spudded Date :		Inside diameter [in]	6.184	3.628	3.640	2.922	X-mass Tree:	MSP-T Type
End of Operation		API Drift Diameter	6.059	3.795	3.515	2.797	Size & Rating:	4-1/16" 10K

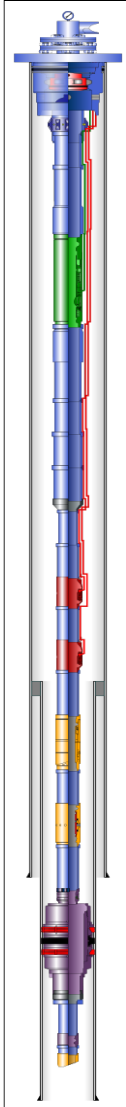

	Description	Max OD	Min ID	Length(m)	BTM(m) F/ RTE	TOP(m) F/ RTE
1	Elevation (Floor - TBG Head Flange) + Running			11.448	10.187	9.637
2	TBG HANGER MSP, 10K, 11" * 4 1/2" ACME Box up * 4 1/2" TPCQ-EX Box Down , M/C: FF-0.5 T/C: UPSL: 3G PR: 2, 4" Type "H" Two Way	5.118	3.64	0.520	10.707	10.187
3	4-1/2" FLUTED SWAGE ADAPTER D/P, 18.9# TPCQ-EX PIN ON TOP X HSM3 PIN ON DOWN* Super 13CR-110KSI, Weiqixin Co	6.1	3.64	0.964	11.671	10.707
4	5 JOINTs TUBING 4 1/2",HSM3 ,18.9#, L-80, Type-1	5.118	3.64	47.601	59.272	11.671
5	PUP JOINT 4 1/2",HSM3 ,18.9#, L-80, Type-1	5.118	3.64	1.624	60.896	59.272
6	4-1/2" FLOW COUPLING,18.9#,Super 13CR-110KSI,HSM3 , 6 FT, Weiqixin Co	5.5	3.64	1.726	62.622	60.896
7	TRSSV-10 TBG Retrievable Saftey Valve, 4 1/2", 18.9# W/ 3.437" Seal bore,HSM3 , Super 13CR-110KSI, 10K WP With AF Profile, Flapper Type, Weiqixin Co	7.5	3.437	1.783	64.405	62.622
8	4-1/2" FLOW COUPLING, 18.9#,Super 13CR-110KSI,HSM3 , 4' FT, Weiqixin Co	5.5	3.64	1.117	65.522	64.405
9	PUP JOINT 4 1/2",HSM3 ,18.9#, L-80, Type-1	5.118	3.64	1.624	67.146	65.522
10	383 JOINTs TUBING 4-1/2"HSM3 18.9#, L-80	5.118	3.64	3624.009	3691.155	67.146
11	X-over 4-1/2"HSM3, 18.9# BOX * 3-1/2"HSM3 , 10.2# PIN,	5.118	2.922	0.944	3692.099	3691.155
12	9 JOINTs TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	85.238	3777.337	3692.099
13	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.560	3778.897	3777.337
14	3 1/2" CIV TBG Retrievable Chemical Injection Mandrel, HSM3 , 10.2#,Super 13CR-110KSI w/ check valve, dual type & rupture disc, Weiqixin Co	5	2.922	0.730	3779.627	3778.897
15	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.564	3789.191	3779.627
16	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.517	3790.708	3789.191
17	3 1/2" CIV TBG Retrievable Chemical Injection Mandrel, HSM3 , 10.2#,Super 13CR-110KSI w/ check valve, dual type & rupture disc, Weiqixin Co	5	2.922	0.730	3791.438	3790.708
18	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.554	3800.992	3791.438
19	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.557	3802.549	3800.992
20	3-1/2" EXP. Joint,HSM3 , Super 13CR-110KSI, 10'STK (Half Open) Splind Rotational Lock System Any Position, Shear Pin Set 20,000 lbs, Weiqixin Co	5.135	2.922	5.760	3808.309	3802.549
21	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.530	3809.839	3808.309
22	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.520	3819.359	3809.839
23	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.556	3820.915	3819.359
24	3-1/2" Non-Elastomeric Sliding Side Door, Super 13CR-110KSI, HSM3 With Type X Selective Profile (Profile: 2.750" X, Downward open), Weiqixin Co	4.551	2.75	1.196	3822.111	3820.915
25	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.554	3831.665	3822.111
26	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.64	3833.305	3831.665
27	3-1/2" Anchor seal assembly,HSM3, 10.2#,Super 13CR-110KSI, 4" Packing OD, Weiqixin Co	4.000	2.922	0.230	3833.535	3833.305
28	7' Hydraulic set permanent production PKR, model WSDP to be run in 7.00" 29-32 PPF CSG, Super 13CR-110KSI, UPPER SEAL BORE: 4", Weiqixin Co	5.689	2.922	4.443	3837.978	3833.535
29	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.250	2.922	1.484	3839.462	3837.978
30	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.213	3848.675	3839.462
31	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.561	3850.236	3848.675
32	3-1/2" Bottom No-Go Landing,HSM3 , 10.2#, Super 13CR-110KSI W/ Seal Bore 2.75" Type XN, Weiqixin Co	4.5	2.562	0.374	3850.610	3850.236
33	3-1/2" Wirline Re-entry guide, 10.2 #,HSM3 Con,Super 13CR-110KSI, Weiqixin Co	4.25	2.922	0.190	3850.800	3850.610
	END OF COMPLETION STRING					3850.800

TR3SV	64.405	62.622
Traveling Joint	3808.309	3802.549
CIV 1	3779.627	3778.897
CIV 2	3791.438	3790.708
SSD	3822.111	3820.915
7'' HYDRAULIC SET PERMANENT PRODUCTION PACKER	3837.978	3833.535
NO-GO Landing Nipple	3850.610	3850.236
Entry Guide	3850.800	3850.610
End of String	3850.800	

Figure 8-2: AZNS-116 Completion Sketch

MSA

Field :	S.Azadegan	Well NO:	AZNS116	Rig NO:	OEOC201	Drig CO:	OEOC
PEDEC, PPL		Completion String					

Grade	ID "	Drift "	Weight lb/ft	Burst psi	Collaspse psi	Yield klbs	Coupling "	TQ ft x lb	Nominal Dia. OD
L-80	2.922	2.797	10.2	11,560.0	12,120.0	233	3.962	3200-3550-3900	3-1/2"
L-80	3.640	3.515	18.9	13,380.0	13,820.0	440	5.137	7920-8800-9680	4-1/2"

BTM NO GO Depth:	3850.24	Formation Name :	Fahliyan	Hook Weight :	68 k lb
BTM of String	3850.80	Formation Top :	3989	VOLUME (TOTAL)	160.27
Packer Depth :	3833.54			Mud Weight (pcf) :	105

Number on jt	Grade	Run In No.	Jt Length (m)	Cum Length (m)	Dist to RT (m)	M/D weight (Klbs)	VOL(BBL)	Remarks	
								joint no	IN / OUT
					3850.8	68.00			
3-1/2" Wirline Re-entry guide, 10.2 #,HSM3 Con,Super 13CR-110KSI, Weiqixin Co	3-1/2" Mule Shoe		0.190	0.19	3850.610	68.00	0.01		
3-1/2" Bottom No-Go Landing,HSM3 , 10.2#, Super 13CR-110KSI W/ Seal Bore 2.75" Type XN, Weiqixin Co	3-1/2" BTM NO GO		0.374	0.56	3850.236	68.01	0.02		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		1.561	2.13	3848.675	68.06	0.06		
#A1	TBG 3-1/2", 10.2#, L-80,HSM3	1	9.213	11.34	3839.462	68.30	0.31	1	
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		1.484	12.82	3837.978	68.34	0.35		
7' Hydraulic set permanent production PKR, model WSDP to be run in 7.00" 29-32 PPF CSG, Super 13CR-110KSI, UPPER SEAL BORE: 4", Weiqixin Co	PKR		4.443	17.27	3833.535	68.45	0.47		
3-1/2" Anchor seal assembly,HSM3, 10.2#,Super 13CR-110KSI, 4" Packing OD, Weiqixin Co	Ratch Lach		0.230	17.50	3833.305	68.46	0.48		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		1.64	19.14	3831.665	68.50	0.52		
3-1/2" Jt,HSM3 , 10.2#, L-80,	TBG 3-1/2", 10.2#, L-80,HSM3	2	9.554	28.69	3822.111	68.75	0.78	2	
3-1/2" Non-Elastomeric Sliding Side Door, Super 13CR-110KSI, HSM3 With Type X Selective Profile (Profile: 2.750" X, Downward open), Weiqixin Co	SSD		1.196	29.89	3820.915	68.79	0.81		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		1.556	31.44	3819.359	68.83	0.86		
#A2	TBG 3-1/2", 10.2#, L-80,HSM3	3	9.520	40.96	3809.839	69.08	1.11	3	
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		1.530	42.49	3808.309	69.12	1.16		
3-1/2" EXP. Joint,HSM3 , Super 13CR-110KSI, 10'STK (Half Open) Splind Rotational Lock System Any Position, Shear Pin Set 20,000 lbs, Weiqixin Co	Traveling Jt		5.760	48.25	3802.549	69.27	1.31		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		1.557	49.81	3800.992	69.31	1.36		
3-1/2" Jt,HSM3 , 10.2#, L-80,	TBG 3-1/2", 10.2#, L-80,HSM3	4	9.554	59.36	3791.438	69.56	1.62	4	
3 1/2" CIV TBG Retrievable Chemical Injection Mandrel, HSM3 , 10.2#,Super 13CR-110KSI w/ check valve, dual type & rupture disc, Weiqixin Co	CIV #1		0.730	60.09	3790.708	69.58	1.64		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		1.517	61.61	3789.191	69.62	1.68		
3-1/2" Jt,HSM3 , 10.2#, L-80,	TBG 3-1/2", 10.2#, L-80,HSM3	5	9.564	71.17	3779.627	69.87	1.94	5	
3 1/2" CIV TBG Retrievable Chemical Injection Mandrel, HSM3 , 10.2#,Super 13CR-110KSI w/ check valve, dual type & rupture disc, Weiqixin Co	CIV #2		0.730	71.90	3778.897	69.89	1.96		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		1.560	73.46	3777.337	69.93	2.00		Protector
#A3	TBG 3-1/2", 10.2#, L-80,HSM3	6	9.528	82.99	3767.809	70.18	2.26	6	Protector
#A4	TBG 3-1/2", 10.2#, L-80,HSM3	7	9.527	92.52	3758.282	70.43	2.52	7	Protector
#A5	TBG 3-1/2", 10.2#, L-80,HSM3	8	9.508	102.03	3748.774	70.68	2.78	8	Protector
#A6	TBG 3-1/2", 10.2#, L-80,HSM3	9	9.528	111.55	3739.246	70.93	3.04	9	Protector
#A7	TBG 3-1/2", 10.2#, L-80,HSM3	10	9.523	121.08	3729.723	71.18	3.29	10	Protector
#A8	TBG 3-1/2", 10.2#, L-80,HSM3	11	9.515	130.59	3720.208	71.43	3.55	11	Protector
1	TBG 3-1/2", 10.2#, L-80,HSM3	12	9.526	140.12	3710.682	71.68	3.81	12	Protector
2	TBG 3-1/2", 10.2#, L-80,HSM3	13	9.524	149.64	3701.158	71.93	4.07	13	Protector
7	TBG 3-1/2", 10.2#, L-80,HSM3	14	9.059	158.70	3692.099	72.17	4.32	14	Protector
X-over 4-1/2"HSM3, 18.9# BOX * 3-1/2"HSM3 , 10.2# PIN,	TBG 3-1/2", 10.2#, L-80,HSM17		0.944	159.65	3691.155	72.20	4.34		

#33	TBG 4-1/2", 18.9#, L-80,HSM3	1	9.430	169.08	3681.725	72.65	4.74	1	Protector
#34	TBG 4-1/2", 18.9#, L-80,HSM3	2	9.528	178.60	3672.197	73.12	5.15	2	Protector
#35	TBG 4-1/2", 18.9#, L-80,HSM3	3	9.527	188.13	3662.670	73.58	5.55	3	Protector
#36	TBG 4-1/2", 18.9#, L-80,HSM3	4	9.424	197.55	3653.246	74.04	5.95	4	Protector
#38	TBG 4-1/2", 18.9#, L-80,HSM3	5	9.526	207.08	3643.720	74.51	6.35	5	Protector
#39	TBG 4-1/2", 18.9#, L-80,HSM3	6	9.439	216.52	3634.281	74.97	6.75	6	Protector
#40	TBG 4-1/2", 18.9#, L-80,HSM3	7	9.541	226.06	3624.740	75.43	7.15	7	Protector
#41	TBG 4-1/2", 18.9#, L-80,HSM3	8	9.567	235.63	3615.173	75.90	7.55	8	Protector
#42	TBG 4-1/2", 18.9#, L-80,HSM3	9	9.551	245.18	3605.622	76.36	7.96	9	Protector
#43	TBG 4-1/2", 18.9#, L-80,HSM3	10	9.574	254.75	3596.048	76.83	8.36	10	Protector
#44	TBG 4-1/2", 18.9#, L-80,HSM3	11	9.144	263.90	3586.904	77.27	8.75	11	Protector
#45	TBG 4-1/2", 18.9#, L-80,HSM3	12	9.550	273.45	3577.354	77.74	9.15	12	Protector
#46	TBG 4-1/2", 18.9#, L-80,HSM3	13	9.547	282.99	3567.807	78.20	9.55	13	Protector
#47	TBG 4-1/2", 18.9#, L-80,HSM3	14	9.532	292.53	3558.275	78.67	9.96	14	Protector
#48	TBG 4-1/2", 18.9#, L-80,HSM3	15	9.530	302.06	3548.745	79.13	10.36	15	Protector
#49	TBG 4-1/2", 18.9#, L-80,HSM3	16	9.535	311.59	3539.210	79.59	10.76	16	Protector
#52	TBG 4-1/2", 18.9#, L-80,HSM3	17	9.534	321.12	3529.676	80.06	11.16	17	Protector
#63	TBG 4-1/2", 18.9#, L-80,HSM3	18	9.432	330.56	3520.244	80.52	11.56	18	Protector
#66	TBG 4-1/2", 18.9#, L-80,HSM3	19	9.307	339.86	3510.937	80.97	11.96	19	Protector
#68	TBG 4-1/2", 18.9#, L-80,HSM3	20	9.537	349.40	3501.400	81.44	12.36	20	Protector
#69	TBG 4-1/2", 18.9#, L-80,HSM3	21	9.534	358.93	3491.866	81.90	12.76	21	Protector
#70	TBG 4-1/2", 18.9#, L-80,HSM3	22	9.537	368.47	3482.329	82.36	13.16	22	Protector
#71	TBG 4-1/2", 18.9#, L-80,HSM3	23	9.535	378.01	3472.794	82.83	13.57	23	Protector
#72	TBG 4-1/2", 18.9#, L-80,HSM3	24	9.534	387.54	3463.260	83.29	13.97	24	Protector
#75	TBG 4-1/2", 18.9#, L-80,HSM3	25	9.532	397.07	3453.728	83.76	14.37	25	Protector
#76	TBG 4-1/2", 18.9#, L-80,HSM3	26	9.529	406.60	3444.199	84.22	14.77	26	Protector
#78	TBG 4-1/2", 18.9#, L-80,HSM3	27	9.530	416.13	3434.669	84.69	15.18	27	Protector
#79	TBG 4-1/2", 18.9#, L-80,HSM3	28	9.527	425.66	3425.142	85.15	15.58	28	Protector
#82	TBG 4-1/2", 18.9#, L-80,HSM3	29	9.524	435.18	3415.618	85.61	15.98	29	Protector
#83	TBG 4-1/2", 18.9#, L-80,HSM3	30	9.532	444.71	3406.086	86.08	16.38	30	Protector
#85	TBG 4-1/2", 18.9#, L-80,HSM3	31	9.525	454.24	3396.561	86.54	16.79	31	Protector
#86	TBG 4-1/2", 18.9#, L-80,HSM3	32	9.189	463.43	3387.372	86.99	17.17	32	Protector
#87	TBG 4-1/2", 18.9#, L-80,HSM3	33	9.527	472.96	3377.845	87.45	17.58	33	Protector
#88	TBG 4-1/2", 18.9#, L-80,HSM3	34	9.525	482.48	3368.320	87.92	17.98	34	Protector
#89	TBG 4-1/2", 18.9#, L-80,HSM3	35	9.424	491.90	3358.896	88.38	18.38	35	Protector
#90	TBG 4-1/2", 18.9#, L-80,HSM3	36	9.521	501.43	3349.375	88.84	18.78	36	Protector
#91	TBG 4-1/2", 18.9#, L-80,HSM3	37	9.533	510.96	3339.842	89.30	19.18	37	Protector
#92	TBG 4-1/2", 18.9#, L-80,HSM3	38	9.527	520.49	3330.315	89.77	19.58	38	Protector
#93	TBG 4-1/2", 18.9#, L-80,HSM3	39	9.531	530.02	3320.784	90.23	19.99	39	Protector
#94	TBG 4-1/2", 18.9#, L-80,HSM3	40	9.533	539.55	3311.251	90.70	20.39	40	Protector
#95	TBG 4-1/2", 18.9#, L-80,HSM3	41	9.535	549.08	3301.716	91.16	20.79	41	Protector
#96	TBG 4-1/2", 18.9#, L-80,HSM3	42	9.532	558.62	3292.184	91.62	21.19	42	Protector
#97	TBG 4-1/2", 18.9#, L-80,HSM3	43	9.531	568.15	3282.653	92.09	21.60	43	Protector
#98	TBG 4-1/2", 18.9#, L-80,HSM3	44	9.532	577.68	3273.121	92.55	22.00	44	Protector
#99	TBG 4-1/2", 18.9#, L-80,HSM3	45	9.531	587.21	3263.590	93.02	22.40	45	Protector
#100	TBG 4-1/2", 18.9#, L-80,HSM3	46	9.525	596.74	3254.065	93.48	22.80	46	Protector
#101	TBG 4-1/2", 18.9#, L-80,HSM3	47	9.523	606.26	3244.542	93.94	23.20	47	Protector
#102	TBG 4-1/2", 18.9#, L-80,HSM3	48	9.528	615.79	3235.014	94.41	23.61	48	Protector
#103	TBG 4-1/2", 18.9#, L-80,HSM3	49	9.518	625.30	3225.496	94.87	24.01	49	Protector
#104	TBG 4-1/2", 18.9#, L-80,HSM3	50	9.528	634.83	3215.968	95.34	24.41	50	Protector
#105	TBG 4-1/2", 18.9#, L-80,HSM3	51	9.518	644.35	3206.450	95.80	24.81	51	Protector
#106	TBG 4-1/2", 18.9#, L-80,HSM3	52	9.528	653.88	3196.922	96.26	25.22	52	Protector
#107	TBG 4-1/2", 18.9#, L-80,HSM3	53	9.531	663.41	3187.391	96.73	25.62	53	Protector
#108	TBG 4-1/2", 18.9#, L-80,HSM3	54	9.527	672.94	3177.864	97.19	26.02	54	Protector
#109	TBG 4-1/2", 18.9#, L-80,HSM3	55	9.530	682.47	3168.334	97.65	26.42	55	Protector
#110	TBG 4-1/2", 18.9#, L-80,HSM3	56	9.533	692.00	3158.801	98.12	26.83	56	Protector

#111	TBG 4-1/2", 18.9#, L-80,HSM3	57	9.528	701.53	3149.273	98.58	27.23	57	Protector
#112	TBG 4-1/2", 18.9#, L-80,HSM3	58	9.523	711.05	3139.750	99.05	27.63	58	Protector
#113	TBG 4-1/2", 18.9#, L-80,HSM3	59	9.527	720.58	3130.223	99.51	28.03	59	Protector
#114	TBG 4-1/2", 18.9#, L-80,HSM3	60	9.523	730.10	3120.700	99.97	28.43	60	Protector
#115	TBG 4-1/2", 18.9#, L-80,HSM3	61	9.525	739.63	3111.175	100.44	28.84	61	Protector
#116	TBG 4-1/2", 18.9#, L-80,HSM3	62	9.431	749.06	3101.744	100.90	29.24	62	Protector
#117	TBG 4-1/2", 18.9#, L-80,HSM3	63	9.521	758.58	3092.223	101.36	29.64	63	Protector
#118	TBG 4-1/2", 18.9#, L-80,HSM3	64	9.523	768.10	3082.700	101.82	30.04	64	Protector
#119	TBG 4-1/2", 18.9#, L-80,HSM3	65	9.421	777.52	3073.279	102.28	30.44	65	Protector
#120	TBG 4-1/2", 18.9#, L-80,HSM3	66	9.442	786.96	3063.837	102.74	30.84	66	Protector
#121	TBG 4-1/2", 18.9#, L-80,HSM3	67	9.528	796.49	3054.309	103.21	31.24	67	Protector
#122	TBG 4-1/2", 18.9#, L-80,HSM3	68	9.526	806.02	3044.783	103.67	31.64	68	Protector
#123	TBG 4-1/2", 18.9#, L-80,HSM3	69	9.527	815.54	3035.256	104.13	32.04	69	Protector
#124	TBG 4-1/2", 18.9#, L-80,HSM3	70	9.536	825.08	3025.720	104.60	32.45	70	Protector
#125	TBG 4-1/2", 18.9#, L-80,HSM3	71	9.525	834.61	3016.195	105.06	32.85	71	Protector
#126	TBG 4-1/2", 18.9#, L-80,HSM3	72	9.531	844.14	3006.664	105.53	33.25	72	Protector
#127	TBG 4-1/2", 18.9#, L-80,HSM3	73	9.142	853.28	2997.522	105.97	33.64	73	Protector
#128	TBG 4-1/2", 18.9#, L-80,HSM3	74	9.529	862.81	2987.993	106.44	34.04	74	Protector
#129	TBG 4-1/2", 18.9#, L-80,HSM3	75	9.520	872.33	2978.473	106.90	34.44	75	Protector
#130	TBG 4-1/2", 18.9#, L-80,HSM3	76	9.529	881.86	2968.944	107.36	34.84	76	Protector
#131	TBG 4-1/2", 18.9#, L-80,HSM3	77	9.519	891.38	2959.425	107.83	35.25	77	Protector
#132	TBG 4-1/2", 18.9#, L-80,HSM3	78	9.527	900.90	2949.898	108.29	35.65	78	Protector
#133	TBG 4-1/2", 18.9#, L-80,HSM3	79	9.525	910.43	2940.373	108.76	36.05	79	Protector
#134	TBG 4-1/2", 18.9#, L-80,HSM3	80	9.519	919.95	2930.854	109.22	36.45	80	Protector
#135	TBG 4-1/2", 18.9#, L-80,HSM3	81	9.437	929.38	2921.417	109.68	36.85	81	Protector
#136	TBG 4-1/2", 18.9#, L-80,HSM3	82	9.534	938.92	2911.883	110.14	37.25	82	Protector
#137	TBG 4-1/2", 18.9#, L-80,HSM3	83	9.529	948.45	2902.354	110.61	37.66	83	Protector
#138	TBG 4-1/2", 18.9#, L-80,HSM3	84	9.430	957.88	2892.924	111.07	38.05	84	Protector
#139	TBG 4-1/2", 18.9#, L-80,HSM3	85	9.432	967.31	2883.492	111.53	38.45	85	Protector
#140	TBG 4-1/2", 18.9#, L-80,HSM3	86	9.424	976.73	2874.068	111.98	38.85	86	Protector
#141	TBG 4-1/2", 18.9#, L-80,HSM3	87	9.273	986.01	2864.795	112.44	39.24	87	Protector
#142	TBG 4-1/2", 18.9#, L-80,HSM3	88	9.529	995.53	2855.266	112.90	39.64	88	Protector
#143	TBG 4-1/2", 18.9#, L-80,HSM3	89	9.527	1005.06	2845.739	113.36	40.05	89	Protector
#144	TBG 4-1/2", 18.9#, L-80,HSM3	90	9.530	1014.59	2836.209	113.83	40.45	90	Protector
#145	TBG 4-1/2", 18.9#, L-80,HSM3	91	9.532	1024.12	2826.677	114.29	40.85	91	Protector
#146	TBG 4-1/2", 18.9#, L-80,HSM3	92	9.532	1033.66	2817.145	114.76	41.25	92	Protector
#147	TBG 4-1/2", 18.9#, L-80,HSM3	93	9.532	1043.19	2807.613	115.22	41.66	93	Protector
#148	TBG 4-1/2", 18.9#, L-80,HSM3	94	9.532	1052.72	2798.081	115.68	42.06	94	Protector
#149	TBG 4-1/2", 18.9#, L-80,HSM3	95	9.532	1062.25	2788.549	116.15	42.46	95	Protector
#150	TBG 4-1/2", 18.9#, L-80,HSM3	96	9.532	1071.78	2779.017	116.61	42.86	96	Protector
#151	TBG 4-1/2", 18.9#, L-80,HSM3	97	9.532	1081.32	2769.485	117.08	43.27	97	Protector
#152	TBG 4-1/2", 18.9#, L-80,HSM3	98	9.532	1090.85	2759.953	117.54	43.67	98	Protector
#153	TBG 4-1/2", 18.9#, L-80,HSM3	99	9.533	1100.38	2750.420	118.01	44.07	99	Protector
#154	TBG 4-1/2", 18.9#, L-80,HSM3	100	9.536	1109.92	2740.884	118.47	44.47	100	Protector
#155	TBG 4-1/2", 18.9#, L-80,HSM3	101	9.523	1119.44	2731.361	118.93	44.88	101	Protector
#156	TBG 4-1/2", 18.9#, L-80,HSM3	102	9.534	1128.97	2721.827	119.40	45.28	102	Protector
#157	TBG 4-1/2", 18.9#, L-80,HSM3	103	9.190	1138.16	2712.637	119.85	45.67	103	Protector
#158	TBG 4-1/2", 18.9#, L-80,HSM3	104	9.186	1147.35	2703.451	120.29	46.06	104	Protector
#159	TBG 4-1/2", 18.9#, L-80,HSM3	105	9.539	1156.89	2693.912	120.76	46.46	105	Protector
#160	TBG 4-1/2", 18.9#, L-80,HSM3	106	9.535	1166.42	2684.377	121.22	46.86	106	Protector
#161	TBG 4-1/2", 18.9#, L-80,HSM3	107	9.537	1175.96	2674.840	121.69	47.26	107	Protector
#162	TBG 4-1/2", 18.9#, L-80,HSM3	108	9.538	1185.50	2665.302	122.15	47.67	108	Protector
#163	TBG 4-1/2", 18.9#, L-80,HSM3	109	9.409	1194.91	2655.893	122.61	48.06	109	Protector
#164	TBG 4-1/2", 18.9#, L-80,HSM3	110	9.528	1204.44	2646.365	123.07	48.47	110	Protector
#165	TBG 4-1/2", 18.9#, L-80,HSM3	111	9.527	1213.96	2636.838	123.54	48.87	111	Protector

#166	TBG 4-1/2", 18.9#, L-80,HSM3	112	9.529	1223.49	2627.309	124.00	49.27	112	Protector
#167	TBG 4-1/2", 18.9#, L-80,HSM3	113	9.530	1233.02	2617.779	124.46	49.67	113	Protector
#168	TBG 4-1/2", 18.9#, L-80,HSM3	114	9.533	1242.55	2608.246	124.93	50.08	114	Protector
#169	TBG 4-1/2", 18.9#, L-80,HSM3	115	9.533	1252.09	2598.713	125.39	50.48	115	Protector
#170	TBG 4-1/2", 18.9#, L-80,HSM3	116	9.526	1261.61	2589.187	125.86	50.88	116	Protector
#171	TBG 4-1/2", 18.9#, L-80,HSM3	117	9.528	1271.14	2579.659	126.32	51.28	117	Protector
#172	TBG 4-1/2", 18.9#, L-80,HSM3	118	9.529	1280.67	2570.130	126.78	51.69	118	Protector
#173	TBG 4-1/2", 18.9#, L-80,HSM3	119	9.530	1290.20	2560.600	127.25	52.09	119	Protector
#174	TBG 4-1/2", 18.9#, L-80,HSM3	120	9.532	1299.73	2551.068	127.71	52.49	120	Protector
#175	TBG 4-1/2", 18.9#, L-80,HSM3	121	9.530	1309.26	2541.538	128.18	52.89	121	Protector
#176	TBG 4-1/2", 18.9#, L-80,HSM3	122	9.527	1318.79	2532.011	128.64	53.30	122	Protector
#177	TBG 4-1/2", 18.9#, L-80,HSM3	123	9.401	1328.19	2522.610	129.10	53.69	123	Protector
#178	TBG 4-1/2", 18.9#, L-80,HSM3	124	9.531	1337.72	2513.079	129.56	54.09	124	Protector
#179	TBG 4-1/2", 18.9#, L-80,HSM3	125	9.531	1347.25	2503.548	130.03	54.50	125	Protector
#180	TBG 4-1/2", 18.9#, L-80,HSM3	126	9.527	1356.78	2494.021	130.49	54.90	126	Protector
#181	TBG 4-1/2", 18.9#, L-80,HSM3	127	9.567	1366.35	2484.454	130.96	55.30	127	Protector
#182	TBG 4-1/2", 18.9#, L-80,HSM3	128	9.571	1375.92	2474.883	131.42	55.71	128	Protector
#183	TBG 4-1/2", 18.9#, L-80,HSM3	129	9.527	1385.44	2465.356	131.89	56.11	129	Protector
#184	TBG 4-1/2", 18.9#, L-80,HSM3	130	9.533	1394.98	2455.823	132.35	56.51	130	Protector
#185	TBG 4-1/2", 18.9#, L-80,HSM3	131	9.531	1404.51	2446.292	132.81	56.91	131	Protector
#186	TBG 4-1/2", 18.9#, L-80,HSM3	132	9.529	1414.04	2436.763	133.28	57.32	132	Protector
#187	TBG 4-1/2", 18.9#, L-80,HSM3	133	9.527	1423.56	2427.236	133.74	57.72	133	Protector
#188	TBG 4-1/2", 18.9#, L-80,HSM3	134	9.527	1433.09	2417.709	134.21	58.12	134	Protector
#189	TBG 4-1/2", 18.9#, L-80,HSM3	135	9.191	1442.28	2408.518	134.65	58.51	135	Protector
#190	TBG 4-1/2", 18.9#, L-80,HSM3	136	9.528	1451.81	2398.990	135.12	58.91	136	Protector
#191	TBG 4-1/2", 18.9#, L-80,HSM3	137	9.530	1461.34	2389.460	135.58	59.31	137	Protector
#192	TBG 4-1/2", 18.9#, L-80,HSM3	138	9.533	1470.87	2379.927	136.05	59.72	138	Protector
#193	TBG 4-1/2", 18.9#, L-80,HSM3	139	9.532	1480.41	2370.395	136.51	60.12	139	Protector
#194	TBG 4-1/2", 18.9#, L-80,HSM3	140	9.555	1489.96	2360.840	136.98	60.52	140	Protector
#195	TBG 4-1/2", 18.9#, L-80,HSM3	141	9.554	1499.51	2351.286	137.44	60.93	141	Protector
#196	TBG 4-1/2", 18.9#, L-80,HSM3	142	9.543	1509.06	2341.743	137.91	61.33	142	Protector
#197	TBG 4-1/2", 18.9#, L-80,HSM3	143	9.535	1518.59	2332.208	138.37	61.73	143	Protector
#198	TBG 4-1/2", 18.9#, L-80,HSM3	144	9.542	1528.13	2322.666	138.84	62.14	144	Protector
#199	TBG 4-1/2", 18.9#, L-80,HSM3	145	9.534	1537.67	2313.132	139.30	62.54	145	Protector
#200	TBG 4-1/2", 18.9#, L-80,HSM3	146	9.554	1547.22	2303.578	139.76	62.94	146	Protector
#201	TBG 4-1/2", 18.9#, L-80,HSM3	147	9.555	1556.78	2294.023	140.23	63.35	147	Protector
#202	TBG 4-1/2", 18.9#, L-80,HSM3	148	9.543	1566.32	2284.480	140.69	63.75	148	Protector
#203	TBG 4-1/2", 18.9#, L-80,HSM3	149	9.553	1575.87	2274.927	141.16	64.15	149	Protector
#204	TBG 4-1/2", 18.9#, L-80,HSM3	150	9.547	1585.42	2265.380	141.62	64.55	150	Protector
#205	TBG 4-1/2", 18.9#, L-80,HSM3	151	9.555	1594.98	2255.825	142.09	64.96	151	Protector
#206	TBG 4-1/2", 18.9#, L-80,HSM3	152	9.555	1604.53	2246.270	142.56	65.36	152	Protector
#207	TBG 4-1/2", 18.9#, L-80,HSM3	153	9.553	1614.08	2236.717	143.02	65.77	153	Protector
#208	TBG 4-1/2", 18.9#, L-80,HSM3	154	9.530	1623.61	2227.187	143.48	66.17	154	Protector
#209	TBG 4-1/2", 18.9#, L-80,HSM3	155	9.530	1633.14	2217.657	143.95	66.57	155	Protector
#210	TBG 4-1/2", 18.9#, L-80,HSM3	156	9.532	1642.68	2208.125	144.41	66.97	156	Protector
#211	TBG 4-1/2", 18.9#, L-80,HSM3	157	9.534	1652.21	2198.591	144.88	67.38	157	Protector
#212	TBG 4-1/2", 18.9#, L-80,HSM3	158	9.193	1661.40	2189.398	145.32	67.76	158	Protector
#213	TBG 4-1/2", 18.9#, L-80,HSM3	159	9.528	1670.93	2179.870	145.79	68.17	159	Protector
#214	TBG 4-1/2", 18.9#, L-80,HSM3	160	9.527	1680.46	2170.343	146.25	68.57	160	Protector
#215	TBG 4-1/2", 18.9#, L-80,HSM3	161	9.527	1689.98	2160.816	146.72	68.97	161	Protector
#216	TBG 4-1/2", 18.9#, L-80,HSM3	162	9.531	1699.52	2151.285	147.18	69.37	162	Protector
#217	TBG 4-1/2", 18.9#, L-80,HSM3	163	9.528	1709.04	2141.757	147.64	69.78	163	Protector
#218	TBG 4-1/2", 18.9#, L-80,HSM3	164	9.533	1718.58	2132.224	148.11	70.18	164	Protector
#219	TBG 4-1/2", 18.9#, L-80,HSM3	165	9.534	1728.11	2122.690	148.57	70.58	165	Protector
#220	TBG 4-1/2", 18.9#, L-80,HSM3	166	9.528	1737.64	2113.162	149.04	70.98	166	Protector

#221	TBG 4-1/2", 18.9#, L-80,HSM3	167	9.532	1747.17	2103.630	149.50	71.39	167	Protector
#222	TBG 4-1/2", 18.9#, L-80,HSM3	168	9.568	1756.74	2094.062	149.97	71.79	168	Protector
#223	TBG 4-1/2", 18.9#, L-80,HSM3	169	9.533	1766.27	2084.529	150.43	72.19	169	Protector
#224	TBG 4-1/2", 18.9#, L-80,HSM3	170	9.430	1775.70	2075.099	150.89	72.59	170	Protector
#225	TBG 4-1/2", 18.9#, L-80,HSM3	171	9.544	1785.25	2065.555	151.36	72.99	171	Protector
#226	TBG 4-1/2", 18.9#, L-80,HSM3	172	9.567	1794.81	2055.988	151.82	73.40	172	Protector
#227	TBG 4-1/2", 18.9#, L-80,HSM3	173	9.533	1804.35	2046.455	152.29	73.80	173	Protector
#228	TBG 4-1/2", 18.9#, L-80,HSM3	174	9.433	1813.78	2037.022	152.74	74.20	174	Protector
#229	TBG 4-1/2", 18.9#, L-80,HSM3	175	9.537	1823.32	2027.485	153.21	74.60	175	Protector
#230	TBG 4-1/2", 18.9#, L-80,HSM3	176	9.418	1832.73	2018.067	153.67	75.00	176	Protector
#231	TBG 4-1/2", 18.9#, L-80,HSM3	177	9.417	1842.15	2008.650	154.13	75.40	177	Protector
#232	TBG 4-1/2", 18.9#, L-80,HSM3	178	9.418	1851.57	1999.232	154.58	75.79	178	Protector
#233	TBG 4-1/2", 18.9#, L-80,HSM3	179	9.425	1860.99	1989.807	155.04	76.19	179	Protector
#234	TBG 4-1/2", 18.9#, L-80,HSM3	180	9.531	1870.52	1980.276	155.51	76.59	180	Protector
#235	TBG 4-1/2", 18.9#, L-80,HSM3	181	9.422	1879.95	1970.854	155.97	76.99	181	Protector
#236	TBG 4-1/2", 18.9#, L-80,HSM3	182	9.528	1889.47	1961.326	156.43	77.40	182	Protector
#237	TBG 4-1/2", 18.9#, L-80,HSM3	183	9.529	1899.00	1951.797	156.89	77.80	183	Protector
#238	TBG 4-1/2", 18.9#, L-80,HSM3	184	9.529	1908.53	1942.268	157.36	78.20	184	Protector
#239	TBG 4-1/2", 18.9#, L-80,HSM3	185	9.528	1918.06	1932.740	157.82	78.60	185	Protector
#240	TBG 4-1/2", 18.9#, L-80,HSM3	186	9.527	1927.59	1923.213	158.29	79.00	186	Protector
#241	TBG 4-1/2", 18.9#, L-80,HSM3	187	9.527	1937.11	1913.686	158.75	79.41	187	Protector
#242	TBG 4-1/2", 18.9#, L-80,HSM3	188	9.527	1946.64	1904.159	159.21	79.81	188	Protector
#243	TBG 4-1/2", 18.9#, L-80,HSM3	189	9.531	1956.17	1894.628	159.68	80.21	189	Protector
#244	TBG 4-1/2", 18.9#, L-80,HSM3	190	9.530	1965.70	1885.098	160.14	80.61	190	Protector
#245	TBG 4-1/2", 18.9#, L-80,HSM3	191	9.527	1975.23	1875.571	160.61	81.02	191	Protector
#246	TBG 4-1/2", 18.9#, L-80,HSM3	192	9.530	1984.76	1866.041	161.07	81.42	192	Protector
#247	TBG 4-1/2", 18.9#, L-80,HSM3	193	9.529	1994.29	1856.512	161.53	81.82	193	Protector
#248	TBG 4-1/2", 18.9#, L-80,HSM3	194	9.522	2003.81	1846.990	162.00	82.22	194	Protector
#249	TBG 4-1/2", 18.9#, L-80,HSM3	195	9.521	2013.33	1837.469	162.46	82.63	195	Protector
#250	TBG 4-1/2", 18.9#, L-80,HSM3	196	9.527	2022.86	1827.942	162.93	83.03	196	Protector
#251	TBG 4-1/2", 18.9#, L-80,HSM3	197	9.531	2032.39	1818.411	163.39	83.43	197	Protector
#252	TBG 4-1/2", 18.9#, L-80,HSM3	198	9.532	2041.92	1808.879	163.85	83.83	198	Protector
#253	TBG 4-1/2", 18.9#, L-80,HSM3	199	9.427	2051.35	1799.452	164.31	84.23	199	Protector
#254	TBG 4-1/2", 18.9#, L-80,HSM3	200	9.530	2060.88	1789.922	164.78	84.63	200	Protector
#255	TBG 4-1/2", 18.9#, L-80,HSM3	201	9.440	2070.32	1780.482	165.24	85.03	201	Protector
#256	TBG 4-1/2", 18.9#, L-80,HSM3	202	9.534	2079.85	1770.948	165.70	85.43	202	Protector
#257	TBG 4-1/2", 18.9#, L-80,HSM3	203	9.544	2089.40	1761.404	166.17	85.84	203	Protector
#258	TBG 4-1/2", 18.9#, L-80,HSM3	204	9.533	2098.93	1751.871	166.63	86.24	204	Protector
#259	TBG 4-1/2", 18.9#, L-80,HSM3	205	9.540	2108.47	1742.331	167.09	86.64	205	Protector
#260	TBG 4-1/2", 18.9#, L-80,HSM3	206	9.533	2118.00	1732.798	167.56	87.05	206	Protector
#261	TBG 4-1/2", 18.9#, L-80,HSM3	207	9.535	2127.54	1723.263	168.02	87.45	207	Protector
#262	TBG 4-1/2", 18.9#, L-80,HSM3	208	9.589	2137.13	1713.674	168.49	87.85	208	Protector
#263	TBG 4-1/2", 18.9#, L-80,HSM3	209	9.534	2146.66	1704.140	168.95	88.26	209	Protector
#264	TBG 4-1/2", 18.9#, L-80,HSM3	210	9.528	2156.19	1694.612	169.42	88.66	210	Protector
#265	TBG 4-1/2", 18.9#, L-80,HSM3	211	9.527	2165.72	1685.085	169.88	89.06	211	Protector
#266	TBG 4-1/2", 18.9#, L-80,HSM3	212	9.528	2175.24	1675.557	170.35	89.46	212	Protector
#267	TBG 4-1/2", 18.9#, L-80,HSM3	213	9.531	2184.77	1666.026	170.81	89.87	213	Protector
#268	TBG 4-1/2", 18.9#, L-80,HSM3	214	9.523	2194.30	1656.503	171.27	90.27	214	Protector
#269	TBG 4-1/2", 18.9#, L-80,HSM3	215	9.533	2203.83	1646.970	171.74	90.67	215	Protector
#270	TBG 4-1/2", 18.9#, L-80,HSM3	216	9.524	2213.35	1637.446	172.20	91.07	216	Protector
#271	TBG 4-1/2", 18.9#, L-80,HSM3	217	9.532	2222.89	1627.914	172.67	91.48	217	Protector
#272	TBG 4-1/2", 18.9#, L-80,HSM3	218	9.531	2232.42	1618.383	173.13	91.88	218	Protector
#273	TBG 4-1/2", 18.9#, L-80,HSM3	219	9.531	2241.95	1608.852	173.59	92.28	219	Protector
#274	TBG 4-1/2", 18.9#, L-80,HSM3	220	9.530	2251.48	1599.322	174.06	92.68	220	Protector
#275	TBG 4-1/2", 18.9#, L-80,HSM3	221	9.530	2261.01	1589.792	174.52	93.08	221	Protector

#276	TBG 4-1/2", 18.9#, L-80,HSM3	222	9.533	2270.54	1580.259	174.99	93.49	222	Protector
#277	TBG 4-1/2", 18.9#, L-80,HSM3	223	9.530	2280.07	1570.729	175.45	93.89	223	Protector
#278	TBG 4-1/2", 18.9#, L-80,HSM3	224	9.530	2289.60	1561.199	175.92	94.29	224	Protector
#279	TBG 4-1/2", 18.9#, L-80,HSM3	225	9.193	2298.79	1552.006	176.36	94.68	225	Protector
#280	TBG 4-1/2", 18.9#, L-80,HSM3	226	9.527	2308.32	1542.479	176.83	95.08	226	Protector
#281	TBG 4-1/2", 18.9#, L-80,HSM3	227	9.529	2317.85	1532.950	177.29	95.49	227	Protector
#282	TBG 4-1/2", 18.9#, L-80,HSM3	228	9.258	2327.11	1523.692	177.74	95.88	228	Protector
#283	TBG 4-1/2", 18.9#, L-80,HSM3	229	9.532	2336.64	1514.160	178.21	96.28	229	Protector
#284	TBG 4-1/2", 18.9#, L-80,HSM3	230	9.527	2346.17	1504.633	178.67	96.68	230	Protector
#285	TBG 4-1/2", 18.9#, L-80,HSM3	231	9.527	2355.69	1495.106	179.13	97.08	231	Protector
#286	TBG 4-1/2", 18.9#, L-80,HSM3	232	9.523	2365.22	1485.583	179.60	97.49	232	Protector
#287	TBG 4-1/2", 18.9#, L-80,HSM3	233	9.531	2374.75	1476.052	180.06	97.89	233	Protector
#288	TBG 4-1/2", 18.9#, L-80,HSM3	234	9.526	2384.27	1466.526	180.53	98.29	234	Protector
#289	TBG 4-1/2", 18.9#, L-80,HSM3	235	9.527	2393.80	1456.999	180.99	98.69	235	Protector
#290	TBG 4-1/2", 18.9#, L-80,HSM3	236	9.554	2403.36	1447.445	181.45	99.10	236	Protector
#291	TBG 4-1/2", 18.9#, L-80,HSM3	237	9.532	2412.89	1437.913	181.92	99.50	237	Protector
#292	TBG 4-1/2", 18.9#, L-80,HSM3	238	9.528	2422.42	1428.385	182.38	99.90	238	Protector
#293	TBG 4-1/2", 18.9#, L-80,HSM3	239	9.450	2431.87	1418.935	182.84	100.30	239	Protector
#294	TBG 4-1/2", 18.9#, L-80,HSM3	240	9.526	2441.39	1409.409	183.31	100.70	240	Protector
#295	TBG 4-1/2", 18.9#, L-80,HSM3	241	9.527	2450.92	1399.882	183.77	101.10	241	Protector
#296	TBG 4-1/2", 18.9#, L-80,HSM3	242	9.528	2460.45	1390.354	184.23	101.51	242	Protector
#297	TBG 4-1/2", 18.9#, L-80,HSM3	243	9.450	2469.90	1380.904	184.69	101.91	243	Protector
#298	TBG 4-1/2", 18.9#, L-80,HSM3	244	9.438	2479.33	1371.466	185.15	102.30	244	Protector
#299	TBG 4-1/2", 18.9#, L-80,HSM3	245	9.533	2488.87	1361.933	185.62	102.71	245	Protector
#300	TBG 4-1/2", 18.9#, L-80,HSM3	246	9.553	2498.42	1352.380	186.08	103.11	246	Protector
#301	TBG 4-1/2", 18.9#, L-80,HSM3	247	9.537	2507.96	1342.843	186.55	103.51	247	Protector
#302	TBG 4-1/2", 18.9#, L-80,HSM3	248	9.537	2517.49	1333.306	187.01	103.92	248	Protector
#303	TBG 4-1/2", 18.9#, L-80,HSM3	249	9.530	2527.02	1323.776	187.48	104.32	249	Protector
#304	TBG 4-1/2", 18.9#, L-80,HSM3	250	9.535	2536.56	1314.241	187.94	104.72	250	Protector
#305	TBG 4-1/2", 18.9#, L-80,HSM3	251	9.541	2546.10	1304.700	188.41	105.12	251	Protector
#306	TBG 4-1/2", 18.9#, L-80,HSM3	252	9.543	2555.64	1295.157	188.87	105.53	252	Protector
#307	TBG 4-1/2", 18.9#, L-80,HSM3	253	9.551	2565.19	1285.606	189.34	105.93	253	Protector
#308	TBG 4-1/2", 18.9#, L-80,HSM3	254	9.530	2574.72	1276.076	189.80	106.33	254	Protector
#309	TBG 4-1/2", 18.9#, L-80,HSM3	255	9.543	2584.27	1266.533	190.26	106.74	255	Protector
#310	TBG 4-1/2", 18.9#, L-80,HSM3	256	9.557	2593.82	1256.976	190.73	107.14	256	Protector
#311	TBG 4-1/2", 18.9#, L-80,HSM3	257	9.555	2603.38	1247.421	191.19	107.54	257	Protector
#312	TBG 4-1/2", 18.9#, L-80,HSM3	258	9.555	2612.93	1237.866	191.66	107.95	258	Protector
#313	TBG 4-1/2", 18.9#, L-80,HSM3	259	9.532	2622.47	1228.334	192.12	108.35	259	Protector
#314	TBG 4-1/2", 18.9#, L-80,HSM3	260	9.532	2632.00	1218.802	192.59	108.75	260	Protector
#315	TBG 4-1/2", 18.9#, L-80,HSM3	261	9.527	2641.53	1209.275	193.05	109.15	261	Protector
#316	TBG 4-1/2", 18.9#, L-80,HSM3	262	9.528	2651.05	1199.747	193.52	109.56	262	Protector
#317	TBG 4-1/2", 18.9#, L-80,HSM3	263	9.530	2660.58	1190.217	193.98	109.96	263	Protector
#318	TBG 4-1/2", 18.9#, L-80,HSM3	264	9.525	2670.11	1180.692	194.44	110.36	264	Protector
#319	TBG 4-1/2", 18.9#, L-80,HSM3	265	9.417	2679.53	1171.275	194.90	110.76	265	Protector
#320	TBG 4-1/2", 18.9#, L-80,HSM3	266	9.420	2688.95	1161.855	195.36	111.16	266	Protector
#321	TBG 4-1/2", 18.9#, L-80,HSM3	267	9.433	2698.38	1152.422	195.82	111.56	267	Protector
#322	TBG 4-1/2", 18.9#, L-80,HSM3	268	9.423	2707.80	1142.999	196.28	111.95	268	Protector
#323	TBG 4-1/2", 18.9#, L-80,HSM3	269	9.403	2717.20	1133.596	196.74	112.35	269	Protector
#324	TBG 4-1/2", 18.9#, L-80,HSM3	270	9.435	2726.64	1124.161	197.20	112.75	270	Protector
#325	TBG 4-1/2", 18.9#, L-80,HSM3	271	9.417	2736.06	1114.744	197.66	113.15	271	Protector
#326	TBG 4-1/2", 18.9#, L-80,HSM3	272	9.544	2745.60	1105.200	198.12	113.55	272	Protector
#327	TBG 4-1/2", 18.9#, L-80,HSM3	273	9.547	2755.15	1095.653	198.59	113.95	273	Protector
#328	TBG 4-1/2", 18.9#, L-80,HSM3	274	9.547	2764.69	1086.106	199.05	114.36	274	Protector
#329	TBG 4-1/2", 18.9#, L-80,HSM3	275	9.541	2774.24	1076.565	199.51	114.76	275	Protector
#330	TBG 4-1/2", 18.9#, L-80,HSM3	276	9.569	2783.80	1066.996	199.98	115.16	276	Protector

#331	TBG 4-1/2", 18.9#, L-80,HSM3	277	9.555	2793.36	1057.441	200.45	115.57	277	Protector
#332	TBG 4-1/2", 18.9#, L-80,HSM3	278	9.541	2802.90	1047.900	200.91	115.97	278	Protector
#333	TBG 4-1/2", 18.9#, L-80,HSM3	279	9.530	2812.43	1038.370	201.37	116.37	279	Protector
#334	TBG 4-1/2", 18.9#, L-80,HSM3	280	9.533	2821.96	1028.837	201.84	116.77	280	Protector
#335	TBG 4-1/2", 18.9#, L-80,HSM3	281	9.534	2831.50	1019.303	202.30	117.18	281	Protector
#336	TBG 4-1/2", 18.9#, L-80,HSM3	282	9.529	2841.03	1009.774	202.77	117.58	282	Protector
#337	TBG 4-1/2", 18.9#, L-80,HSM3	283	9.528	2850.55	1000.246	203.23	117.98	283	Protector
#338	TBG 4-1/2", 18.9#, L-80,HSM3	284	9.533	2860.09	990.713	203.70	118.38	284	Protector
#339	TBG 4-1/2", 18.9#, L-80,HSM3	285	9.534	2869.62	981.179	204.16	118.79	285	Protector
#340	TBG 4-1/2", 18.9#, L-80,HSM3	286	9.525	2879.15	971.654	204.62	119.19	286	Protector
#341	TBG 4-1/2", 18.9#, L-80,HSM3	287	9.525	2888.67	962.129	205.09	119.59	287	Protector
#342	TBG 4-1/2", 18.9#, L-80,HSM3	288	9.527	2898.20	952.602	205.55	119.99	288	Protector
#343	TBG 4-1/2", 18.9#, L-80,HSM3	289	9.522	2907.72	943.080	206.01	120.40	289	Protector
#344	TBG 4-1/2", 18.9#, L-80,HSM3	290	9.523	2917.24	933.557	206.48	120.80	290	Protector
#345	TBG 4-1/2", 18.9#, L-80,HSM3	291	9.532	2926.78	924.025	206.94	121.20	291	Protector
#346	TBG 4-1/2", 18.9#, L-80,HSM3	292	9.525	2936.30	914.500	207.41	121.60	292	Protector
#347	TBG 4-1/2", 18.9#, L-80,HSM3	293	9.532	2945.83	904.968	207.87	122.00	293	Protector
#348	TBG 4-1/2", 18.9#, L-80,HSM3	294	9.532	2955.36	895.436	208.33	122.41	294	Protector
#349	TBG 4-1/2", 18.9#, L-80,HSM3	295	9.532	2964.90	885.904	208.80	122.81	295	Protector
#350	TBG 4-1/2", 18.9#, L-80,HSM3	296	9.531	2974.43	876.373	209.26	123.21	296	Protector
#351	TBG 4-1/2", 18.9#, L-80,HSM3	297	9.527	2983.95	866.846	209.73	123.61	297	Protector
#352	TBG 4-1/2", 18.9#, L-80,HSM3	298	9.533	2993.49	857.313	210.19	124.02	298	Protector
#353	TBG 4-1/2", 18.9#, L-80,HSM3	299	9.532	3003.02	847.781	210.66	124.42	299	Protector
#354	TBG 4-1/2", 18.9#, L-80,HSM3	300	9.524	3012.54	838.257	211.12	124.82	300	Protector
#355	TBG 4-1/2", 18.9#, L-80,HSM3	301	9.529	3022.07	828.728	211.58	125.22	301	Protector
#356	TBG 4-1/2", 18.9#, L-80,HSM3	302	9.530	3031.60	819.198	212.05	125.63	302	Protector
#357	TBG 4-1/2", 18.9#, L-80,HSM3	303	9.528	3041.13	809.670	212.51	126.03	303	Protector
#358	TBG 4-1/2", 18.9#, L-80,HSM3	304	9.525	3050.66	800.145	212.98	126.43	304	Protector
#359	TBG 4-1/2", 18.9#, L-80,HSM3	305	9.530	3060.19	790.615	213.44	126.83	305	Protector
#360	TBG 4-1/2", 18.9#, L-80,HSM3	306	9.528	3069.71	781.087	213.90	127.24	306	Protector
#361	TBG 4-1/2", 18.9#, L-80,HSM3	307	9.537	3079.25	771.550	214.37	127.64	307	Protector
#362	TBG 4-1/2", 18.9#, L-80,HSM3	308	9.536	3088.79	762.014	214.83	128.04	308	Protector
#363	TBG 4-1/2", 18.9#, L-80,HSM3	309	9.527	3098.31	752.487	215.30	128.44	309	Protector
#364	TBG 4-1/2", 18.9#, L-80,HSM3	310	9.527	3107.84	742.960	215.76	128.85	310	Protector
#365	TBG 4-1/2", 18.9#, L-80,HSM3	311	9.527	3117.37	733.433	216.22	129.25	311	Protector
#366	TBG 4-1/2", 18.9#, L-80,HSM3	312	9.529	3126.90	723.904	216.69	129.65	312	Protector
#367	TBG 4-1/2", 18.9#, L-80,HSM3	313	9.532	3136.43	714.372	217.15	130.05	313	Protector
#368	TBG 4-1/2", 18.9#, L-80,HSM3	314	9.566	3145.99	704.806	217.62	130.46	314	Protector
#369	TBG 4-1/2", 18.9#, L-80,HSM3	315	9.539	3155.53	695.267	218.08	130.86	315	Protector
#370	TBG 4-1/2", 18.9#, L-80,HSM3	316	9.538	3165.07	685.729	218.55	131.26	316	Protector
#371	TBG 4-1/2", 18.9#, L-80,HSM3	317	9.549	3174.62	676.180	219.01	131.67	317	Protector
#372	TBG 4-1/2", 18.9#, L-80,HSM3	318	9.159	3183.78	667.021	219.46	132.05	318	Protector
#373	TBG 4-1/2", 18.9#, L-80,HSM3	319	9.552	3193.33	657.469	219.92	132.46	319	Protector
#374	TBG 4-1/2", 18.9#, L-80,HSM3	320	9.543	3202.87	647.926	220.39	132.86	320	Protector
#375	TBG 4-1/2", 18.9#, L-80,HSM3	321	9.524	3212.40	638.402	220.85	133.26	321	Protector
#376	TBG 4-1/2", 18.9#, L-80,HSM3	322	9.192	3221.59	629.210	221.30	133.65	322	Protector
#377	TBG 4-1/2", 18.9#, L-80,HSM3	323	9.529	3231.12	619.681	221.76	134.05	323	Protector
#378	TBG 4-1/2", 18.9#, L-80,HSM3	324	9.528	3240.65	610.153	222.23	134.46	324	Protector
#379	TBG 4-1/2", 18.9#, L-80,HSM3	325	9.528	3250.18	600.625	222.69	134.86	325	Protector
#380	TBG 4-1/2", 18.9#, L-80,HSM3	326	9.526	3259.70	591.099	223.15	135.26	326	Protector
#381	TBG 4-1/2", 18.9#, L-80,HSM3	327	9.528	3269.23	581.571	223.62	135.66	327	Protector
#382	TBG 4-1/2", 18.9#, L-80,HSM3	328	9.545	3278.77	572.026	224.08	136.07	328	Protector
#383	TBG 4-1/2", 18.9#, L-80,HSM3	329	9.537	3288.31	562.489	224.55	136.47	329	Protector
#384	TBG 4-1/2", 18.9#, L-80,HSM3	330	9.527	3297.84	552.962	225.01	136.87	330	Protector
#385	TBG 4-1/2", 18.9#, L-80,HSM3	331	9.535	3307.37	543.427	225.48	137.27	331	Protector

#386	TBG 4-1/2", 18.9#, L-80,HSM3	332	9.417	3316.79	534.010	225.93	137.67	332	Protector
#387	TBG 4-1/2", 18.9#, L-80,HSM3	333	9.538	3326.33	524.472	226.40	138.07	333	Protector
#388	TBG 4-1/2", 18.9#, L-80,HSM3	334	9.543	3335.87	514.929	226.86	138.48	334	Protector
#389	TBG 4-1/2", 18.9#, L-80,HSM3	335	9.527	3345.40	505.402	227.33	138.88	335	Protector
#390	TBG 4-1/2", 18.9#, L-80,HSM3	336	9.527	3354.93	495.875	227.79	139.28	336	Protector
#391	TBG 4-1/2", 18.9#, L-80,HSM3	337	9.527	3364.45	486.348	228.26	139.68	337	Protector
#392	TBG 4-1/2", 18.9#, L-80,HSM3	338	9.528	3373.98	476.820	228.72	140.09	338	Protector
#394	TBG 4-1/2", 18.9#, L-80,HSM3	339	9.528	3383.51	467.292	229.18	140.49	339	Protector
#395	TBG 4-1/2", 18.9#, L-80,HSM3	340	9.528	3393.04	457.764	229.65	140.89	340	Protector
#396	TBG 4-1/2", 18.9#, L-80,HSM3	341	9.529	3402.57	448.235	230.11	141.29	341	Protector
#397	TBG 4-1/2", 18.9#, L-80,HSM3	342	9.525	3412.09	438.710	230.58	141.70	342	Protector
#399	TBG 4-1/2", 18.9#, L-80,HSM3	343	9.528	3421.62	429.182	231.04	142.10	343	Protector
#400	TBG 4-1/2", 18.9#, L-80,HSM3	344	9.528	3431.15	419.654	231.50	142.50	344	Protector
#401	TBG 4-1/2", 18.9#, L-80,HSM3	345	9.532	3440.68	410.122	231.97	142.90	345	Protector
#402	TBG 4-1/2", 18.9#, L-80,HSM3	346	9.554	3450.23	400.568	232.43	143.31	346	Protector
#403	TBG 4-1/2", 18.9#, L-80,HSM3	347	9.536	3459.77	391.032	232.90	143.71	347	Protector
#404	TBG 4-1/2", 18.9#, L-80,HSM3	348	9.536	3469.30	381.496	233.36	144.11	348	Protector
#405	TBG 4-1/2", 18.9#, L-80,HSM3	349	9.529	3478.83	371.967	233.83	144.51	349	Protector
#406	TBG 4-1/2", 18.9#, L-80,HSM3	350	9.532	3488.37	362.435	234.29	144.92	350	Protector
#407	TBG 4-1/2", 18.9#, L-80,HSM3	351	9.531	3497.90	352.904	234.75	145.32	351	Protector
#408	TBG 4-1/2", 18.9#, L-80,HSM3	352	9.539	3507.44	343.365	235.22	145.72	352	Protector
#409	TBG 4-1/2", 18.9#, L-80,HSM3	353	9.534	3516.97	333.831	235.68	146.12	353	Protector
#410	TBG 4-1/2", 18.9#, L-80,HSM3	354	9.422	3526.39	324.409	236.14	146.52	354	Protector
#411	TBG 4-1/2", 18.9#, L-80,HSM3	355	9.533	3535.92	314.876	236.61	146.92	355	Protector
#412	TBG 4-1/2", 18.9#, L-80,HSM3	356	9.372	3545.30	305.504	237.06	147.32	356	Protector
#413	TBG 4-1/2", 18.9#, L-80,HSM3	357	9.534	3554.83	295.970	237.53	147.72	357	Protector
#414	TBG 4-1/2", 18.9#, L-80,HSM3	358	9.537	3564.37	286.433	237.99	148.13	358	Protector
#415	TBG 4-1/2", 18.9#, L-80,HSM3	359	9.569	3573.94	276.864	238.46	148.53	359	Protector
#416	TBG 4-1/2", 18.9#, L-80,HSM3	360	9.528	3583.46	267.336	238.92	148.93	360	Protector
#417	TBG 4-1/2", 18.9#, L-80,HSM3	361	9.535	3593.00	257.801	239.38	149.33	361	Protector
#418	TBG 4-1/2", 18.9#, L-80,HSM3	362	9.524	3602.52	248.277	239.85	149.74	362	Protector
#419	TBG 4-1/2", 18.9#, L-80,HSM3	363	9.529	3612.05	238.748	240.31	150.14	363	Protector
#420	TBG 4-1/2", 18.9#, L-80,HSM3	364	9.528	3621.58	229.220	240.78	150.54	364	Protector
#421	TBG 4-1/2", 18.9#, L-80,HSM3	365	9.530	3631.11	219.690	241.24	150.94	365	Protector
#422	TBG 4-1/2", 18.9#, L-80,HSM3	366	9.527	3640.64	210.163	241.70	151.35	366	Protector
#423	TBG 4-1/2", 18.9#, L-80,HSM3	367	9.528	3650.17	200.635	242.17	151.75	367	Protector
#424	TBG 4-1/2", 18.9#, L-80,HSM3	368	9.535	3659.70	191.100	242.63	152.15	368	Protector
#425	TBG 4-1/2", 18.9#, L-80,HSM3	369	9.541	3669.24	181.559	243.10	152.55	369	Protector
#426	TBG 4-1/2", 18.9#, L-80,HSM3	370	9.534	3678.78	172.025	243.56	152.96	370	Protector
#427	TBG 4-1/2", 18.9#, L-80,HSM3	371	9.533	3688.31	162.492	244.03	153.36	371	Protector
#428	TBG 4-1/2", 18.9#, L-80,HSM3	372	9.534	3697.84	152.958	244.49	153.76	372	Protector
#429	TBG 4-1/2", 18.9#, L-80,HSM3	373	9.537	3707.38	143.421	244.95	154.17	373	Protector
#430	TBG 4-1/2", 18.9#, L-80,HSM3	374	9.538	3716.92	133.883	245.42	154.57	374	Protector
#431	TBG 4-1/2", 18.9#, L-80,HSM3	375	9.535	3726.45	124.348	245.88	154.97	375	Protector
#432	TBG 4-1/2", 18.9#, L-80,HSM3	376	9.537	3735.99	114.811	246.35	155.37	376	Protector
#433	TBG 4-1/2", 18.9#, L-80,HSM3	377	9.533	3745.52	105.278	246.81	155.78	377	Protector
#434	TBG 4-1/2", 18.9#, L-80,HSM3	378	9.533	3755.06	95.745	247.28	156.18	378	Protector
#435	TBG 4-1/2", 18.9#, L-80,HSM3	379	9.530	3764.59	86.215	247.74	156.58	379	Protector
#436	TBG 4-1/2", 18.9#, L-80,HSM3	380	9.534	3774.12	76.681	248.20	156.98	380	Protector
#437	TBG 4-1/2", 18.9#, L-80,HSM3	381	9.535	3783.65	67.146	248.67	157.39	381	Protector

Pup Jt 4 1/2",HSM3 ,18.9#, L-80, Type-1	TBG 4-1/2", 18.9#, L-80,HSM3	0	1.624	3785.28	65.522	248.75	157.45	0	
4-1/2" FLOW COUPLING, 18.9#,Super 13CR-110KSI,HSM3 , 4' FT, Weiqixin Co	TBG 4-1/2", 18.9#, L-80,HSM3	0	1.117	3786.40	64.405	248.80	157.50	0	
TRSSV-10 TBG Retrievable Saftey Valve, 4 1/2", 18.9# W/ 3.437" Seal bore,HSM3 , Super 13CR-110KSI, 10K WP With AF Profile, Flapper Type, Weiqixin Co	TBG 4-1/2", 18.9#, L-80,HSM3	0	1.783	3788.18	62.622	248.89	157.58	0	
4-1/2" FLOW COUPLING,18.9#,Super 13CR-110KSI,HSM3 , 6 FT, Weiqixin Co	TBG 4-1/2", 18.9#, L-80,HSM3	0	1.726	3789.90	60.896	248.97	157.65	0	
Pup Jt 4 1/2",HSM3 ,18.9#, L-80, Type-1	TBG 4-1/2", 18.9#, L-80,HSM3	0	1.624	3791.53	59.272	249.05	157.72	0	
#441	TBG 4-1/2", 18.9#, L-80,HSM3	382	9.548	3801.08	49.724	249.52	158.12	382	Protector
#442	TBG 4-1/2", 18.9#, L-80,HSM3	383	9.560	3810.64	40.164	249.98	158.53	383	Protector
#443	TBG 4-1/2", 18.9#, L-80,HSM3	384	9.545	3820.18	30.619	250.45	158.93	384	Protector
#444	TBG 4-1/2", 18.9#, L-80,HSM3	385	9.553	3829.73	21.066	250.91	159.33	385	Protector
#445	TBG 4-1/2", 18.9#, L-80,HSM3	386	9.395	3839.13	11.671	251.37	159.73	386	Protector
4-1/2" FLUTED SWAGE ADAPTER D/P, 18.9# TPCQ-EX PIN ON TOP X HSM3 PIN ON DOWN* Super 13CR-110KSI, Weiqixin Co	Fluted Swage	0	0.964	3840.09	10.707	251.42	159.77	0	
TBG HANGER MSP, 10K, 11" * 4 1/2" ACME Box up * 4 1/2" TPCQ-EX Box Down , M/C: FF-0.5 T/C: UPSL: 3G PR: 2, 4" Type "H" Two Way	TBG HGR	0	0.520	3840.61	10.187	251.44	159.79	0	
TBG Hanger Running Tool	TBG Hanger Running Tool	0	0.550	3841.16	9.637	251.47	159.81	0	
L/Joint	L/Joint	0	10.898	3852.06	-1.261	252.00	160.27	0	

Table 8-5: AZNS-116 Completion Tally

8.6 Completion String Pressure Test

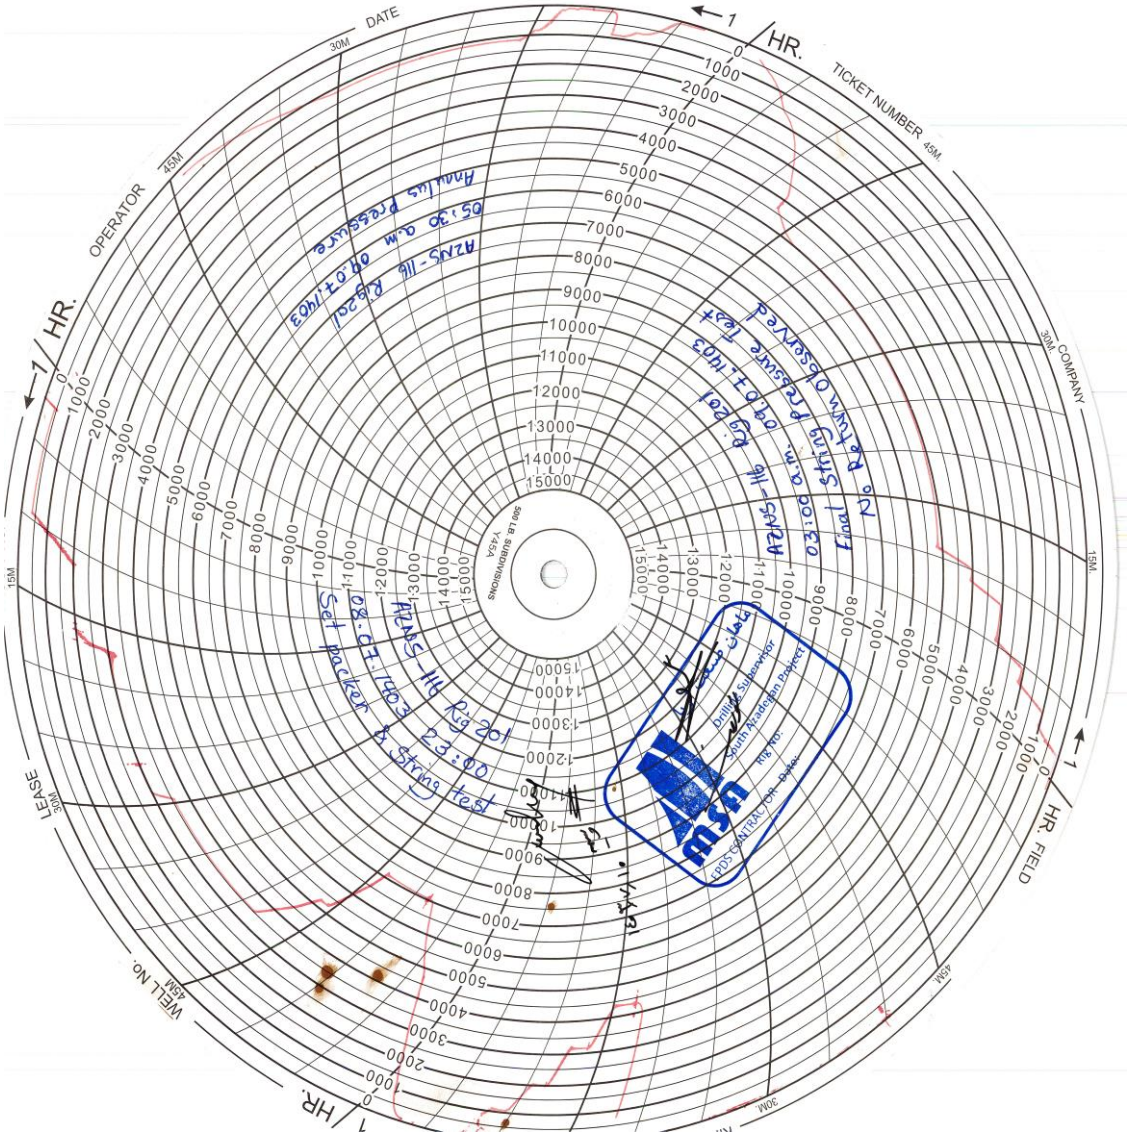


Figure 8-3: AZNS-116 Setting Packer, Annulus & Final Completion String Pressure Test

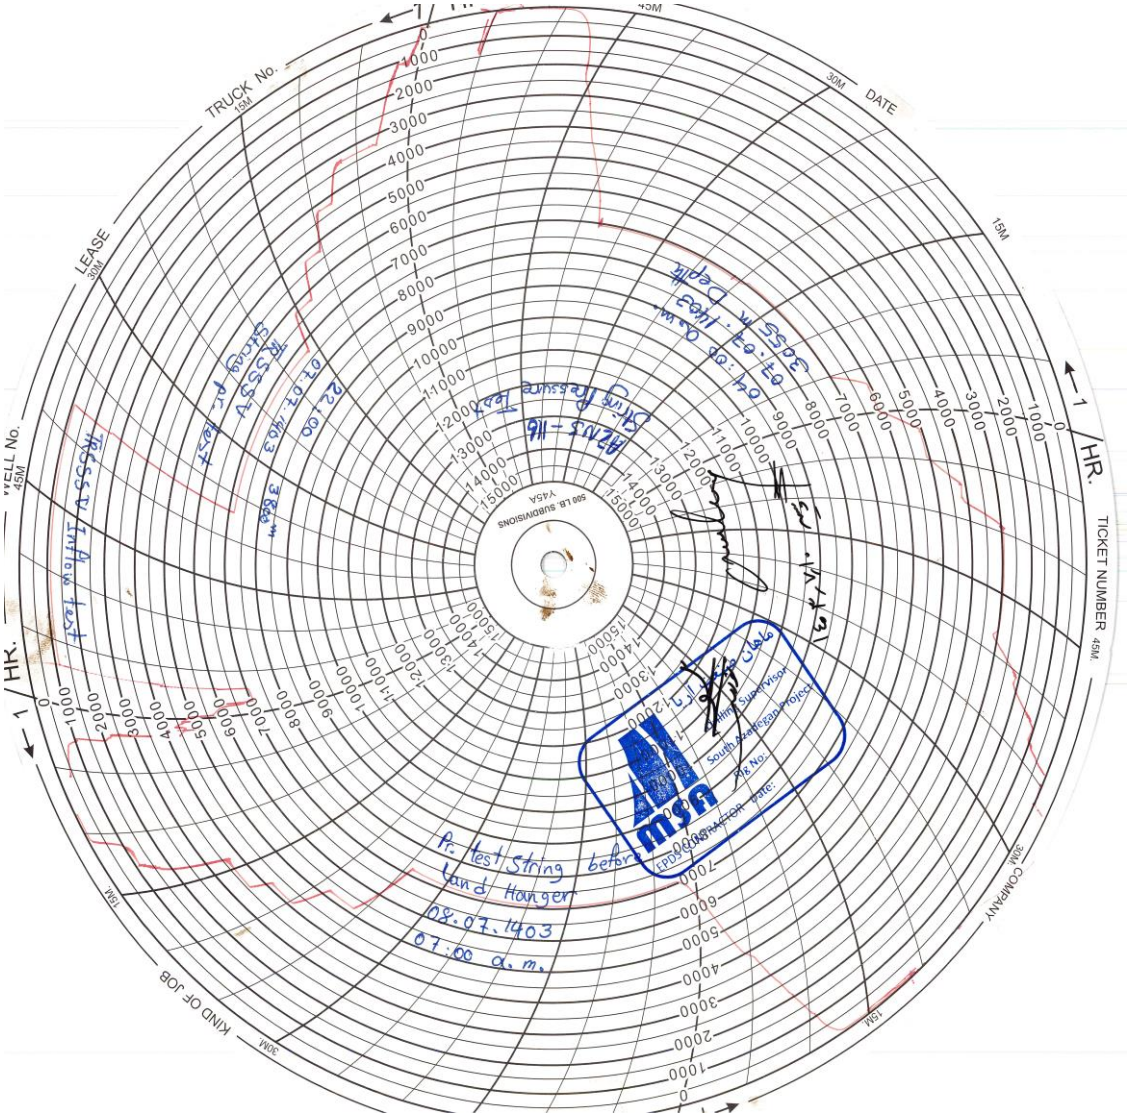


Figure 8-4: AZNS-116 Completion String & TRSSSV Pressure Test Graph

9. Wellhead Report

9.1 Final Well Status

Well Head

Item	Specification (size, pressure rating, M/C)	Test Pressure	Test Duration
C.H.H	20-3/4'' 3K, DD-0.5 PSL1, PR1	Already Installed	
C.H.S	20-3/4'' 3K * 13-5/8'' 5K , DD-0.5, PSL1, PR1	Already Installed	
MSP Drilex T.H.S.	13-5/8'' 5K * 11''-10K, FF-0.5, PSL3, PR2	Already Installed	
MSP Drilex X-MASS TREE(BTM)	4-1/16''-10K, FF-0.5, PSL3G, PR2	8000 psi	15 MIN

Wellbore Completion Fluids

Well bore	Fluid Type	Weight (pcf)
Cased Hole	$CaBr_2$	103 – 104

Well Head Pressure Recor

Annulus	Pressure (psi)	Date / Time
Wellhead	0	1403.07.05
Tubing- 9 5/8"	0	1403.07.05
9 5/8" – 13 3/8"	0	1403.07.05
13 3/8" – 20"	0	1403.07.05

Barriers

Barrier Type	Depth	Pressure Test	Date Tested
Close TRSSSV	62.62 m	500 psi (inflow test after finish flow the well)	1403.10.07

Temporary Installed Equipment:

After Completing the well, Plug & Prong have been installed in No-Go landing nipple

Table 9-1: AZNS-116 Final Well Status

9.2 Wellhead & X-mass tree Specification

Well Type	Specification	Check and Remark
MSP Drilex Well Head 10,000 Psi for Fahliyan Wells	**TUBING HEAD ADAPTOR** BOTTOM STUDDED FLANGE 11", 10000 PSI, BX158 TOP STUDDED FLANGE 4-1/16" 10000 PSI BX155 FULL BORE PREPARED WITH TWO S-SEAL AND ONE METAL TO METAL SEAL TO PACK TOP NECK OF TUBING HANGER C/W RELATED TEST AND INJECTION PORTS PREPARTION. C/W TWO CONTINUOUS FEED THROUGH TYPE 1/4" NPT CONTROL LINE EXITS PREPARTION (ONE FOR 1/4" TRSSSV CL AND ONE FOR 1/4" DOWNHOLE PRESSURE GAUGE) AND TWO 3/8" NPT CONTINUOUS FEED THROUGH TYPE LINE PORTS FOR CHEMCIAL INJECTION LINE EXIT INCLUDING RELATED SWAGE LOCK FITTINGS C/WITH ONE 4-1/16", 10K WP FULL BORE MANUAL GATE VALVE FORGED BODY AND BONNET, ALLOY STAINLESS STEEL 410SS GATE & SEAT AISI 410 COATED WITH TUNGSTEN CARBIDE USING HVOF METHOD STEM: INCONEL 718 WITH BACK SEAT CAPABILITY, NON RISING STEM METAL TO METAL SEAL BETWEEN SEAT AND GATE C/W HAND WHEEL FORGED BODY ALLOY STEEL AISI 410 MAXIMUM HEIGHT: 800MM M/C:FF-0.5 T/C:U PSL:3G PR:2 CROSS T-TYPE SOLID BLOCK CROSS T-TYPE SOLID BLOCK, BOTTOM FLANGED 4-1/16" API 10000 PSI WP TOP FLANGED STUDDED 4-1/16" API 10000 PSI WP FOR TREE CAP WITH TWO STUDDED SIDE OUTLETS 4-1/16" 10000PSI WP ELEVATED AT 900 DEG AND TWO 4-1/16", 10000 PSI MANUAL GATE VALVE AT THE TOP AND BOTTOM AND ONE 4-1/16", 10000 PSI WP SAFETY VALVE EQUIPPED WITH HYDRAULIC WIRE CUT	

	ACTUATOR AS UPPER MASTER VALVE MATERIAL OF BODY,BONNET: AISI 410 SEAT, GATE: AISI 410SS HARD FACED WITH TUNGSTEN CARBIDE UASING HVOP METHOD MATERIAL OF STEM: INCONEL 718 M/C:FF-0.5 T/C:U PSL:3G PR:2G. MANUAL GATE VALVE API 4-1/16" 10000 PSI WP. FLANGED ENDS AND FULL BORE METAL TO METAL SEAL BETWEEN BODY/SEAT/GATE WITH BACK SEAT CAPABILITY, NON RISING STEM C/W HANDWHEELS MATERIAL OF BODY,BONNET,SEAT,GATE: AISI 410SS MATERIAL OF STEM: INCONEL 718 GATE&SEAT HARD FACED WITH TUNGSTEN CARBIDE BY HOVF METHOD M/C:FF-0.5 T/C:U PSL:3G PR:2 X-MAS TREE CAP 4-1/16" API 10000 PSI WP, FLANGED BOTTOM (4-1/16", BORE) 8-3/8"-4ACME-2G THREAD TOP, BLANKING PLUG TAPPED WITH 1/2" NPT THREAD, FORGED BODY, MATERIAL: STAINLESS STEEL 410 M/C:FF-0.5 T/C:U PSL:3G PR:2	

Table 9-2: AZNS-116 Equipment Specification

9.3 Wellhead Schematic



Figure 9-1: AZNS-116 Wellhead Sketch

9.4 X-mass Tree Specification (Section D)

Item	Equipment	M/C	T/C	PSL	Qty
1	BTM Master Valve 11” * 4 1/16” 10K	FF-0.5	U	3G	1
2	TOP Master Valve 4 1/16” 10K	FF-0.5	U	3G	1
3	Surface Safety Valve 4 1/16” 10K	FF-0.5	U	3G	1
4	Deeping Valve 4 1/16” 10K	FF-0.5	U	3G	1
5	Wing gate valve-1 (Kill Valve) 4 1/16" 10K	FF-0.5	U	3G	1
6	Wing gate valve-2 (production valve) 10K	FF-0.5	U	3G	1
7	41/16" Choke valve 4 1/16" 10K	FF-0.5	U	3G	1
8	Christ Mas Tree	FF-0.5	U	3G	1

Table 9-3: AZNS-116 Section "D" Specification

9.5 X-mass Tree Pressure Test Report (Section D – befor install)

Item	Test	Check Mark and Result
1	Pressure test for the kill Valve W/ 1000 & 8000 Psi / 15 min	OK
2	Pressure test for the SSV W/ 1000 & 8000 Psi / 15 min	OK
3	Pressure test for the top master valve W/ 1000 & 8000 Psi / 15 min	OK
4	Pressure test for Swab valve W/ 1000 & 8000 Psi / 15 min	OK
5	Pressure test for the Production valve W/ 1000 & 8000 Psi / 15 min	OK

Table 9-4: AZNS-116 Section "D" Test Report Befor Installation


9.6 X-mass Tree Pressure Test Report (Section D – after install)


Item	Test	Check mark and Result
1	Pressure test X-MAS TREE solid block and bottom section W/1000 &8000 psi for 15min	OK
2	Pressure test for the SSV Exit block W/ 8000 Psi / 15 min	OK
3	Pressure test neck of tubing hanger metal seal W/1000 &8000 psi for 15min	OK

4	Pressure test for Swab valve W/ 4500 Psi / 15 min	OK
5	Pressure test for Production valve W/4500 Psi / 15 min	OK
6	Pressure test cavity of FS.seal and Ring Gasket W 8000 Psi / 15 min	OK
7	Pressure test CIV line to 2000psi	OK

Table 9-5: AZNS-116 Section "D" Test Report After Installation

9.7 Wellhead Related Test Reports

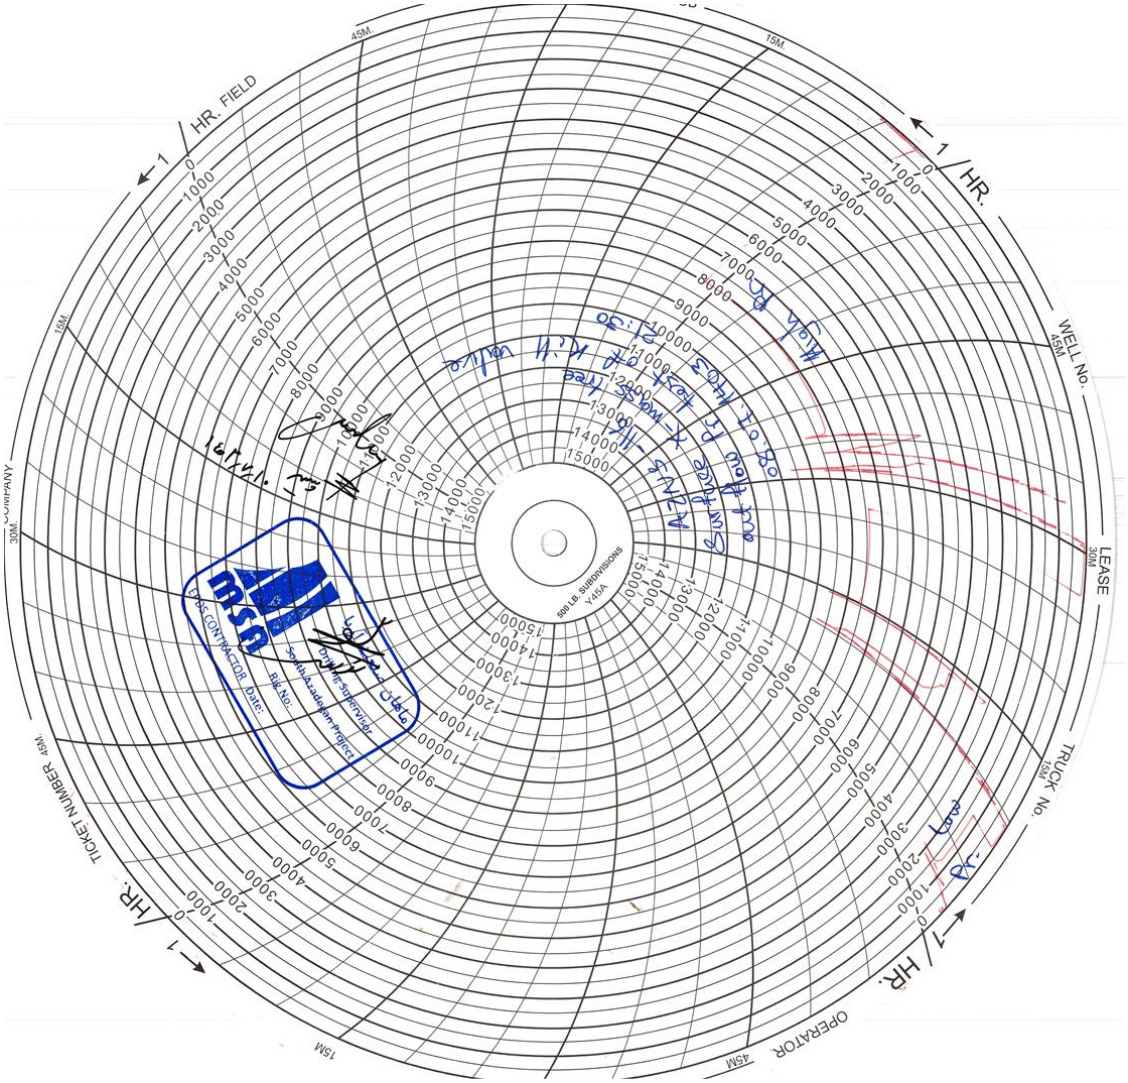

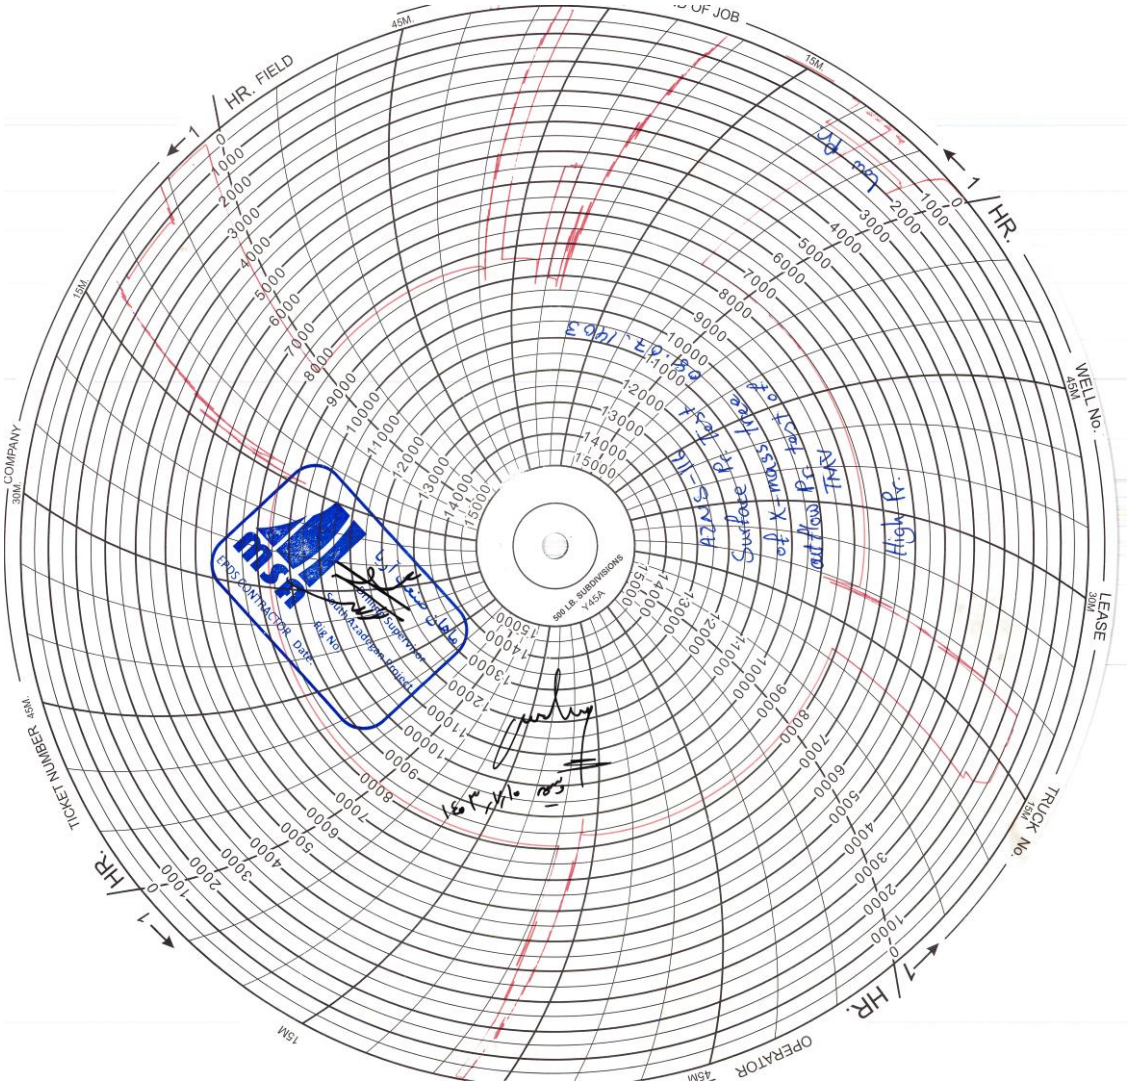
HR.
FIELD
WELL NO.
LEASE
TRUCK No.
OPERATOR
TICKET NUMBER
COMPANY
HR.
HR.
HR.
High Pr.
Surface Pr.
Total Pump Time
Max Pr.
Avg Pr.
Total Fluid Pumped
Max Rate
Avg Rate
Total Sand
Azad Pr.
Tubing Pr.
Casing Pr.
Slurry Rate
Fluid Rate
Nitrogen Rate
Acid Rate
Foam Rate
Foam Quality
Slurry Volume
Fluid Volume
Nitrogen Volume
Acid Volume
Foam Volume
Proppant Type
Proppant Size
Proppant Conc.
Proppant Amount
Gel Type
Gel Conc.
Gel Amount
Breaker Type
Breaker Conc.
Breaker Amount
Crosslinker Type
Crosslinker Conc.
Crosslinker Amount
Buffer Type
Buffer Conc.
Buffer Amount
Surfactant Type
Surfactant Conc.
Surfactant Amount
Iron Control Type
Iron Control Conc.
Iron Control Amount
Clay Control Type
Clay Control Conc.
Clay Control Amount
Biocide Type
Biocide Conc.
Biocide Amount
Friction Reducer Type
Friction Reducer Conc.
Friction Reducer Amount
Scale Inhibitor Type
Scale Inhibitor Conc.
Scale Inhibitor Amount
Gas Type
Gas Conc.
Gas Amount
Diverter Type
Diverter Conc.
Diverter

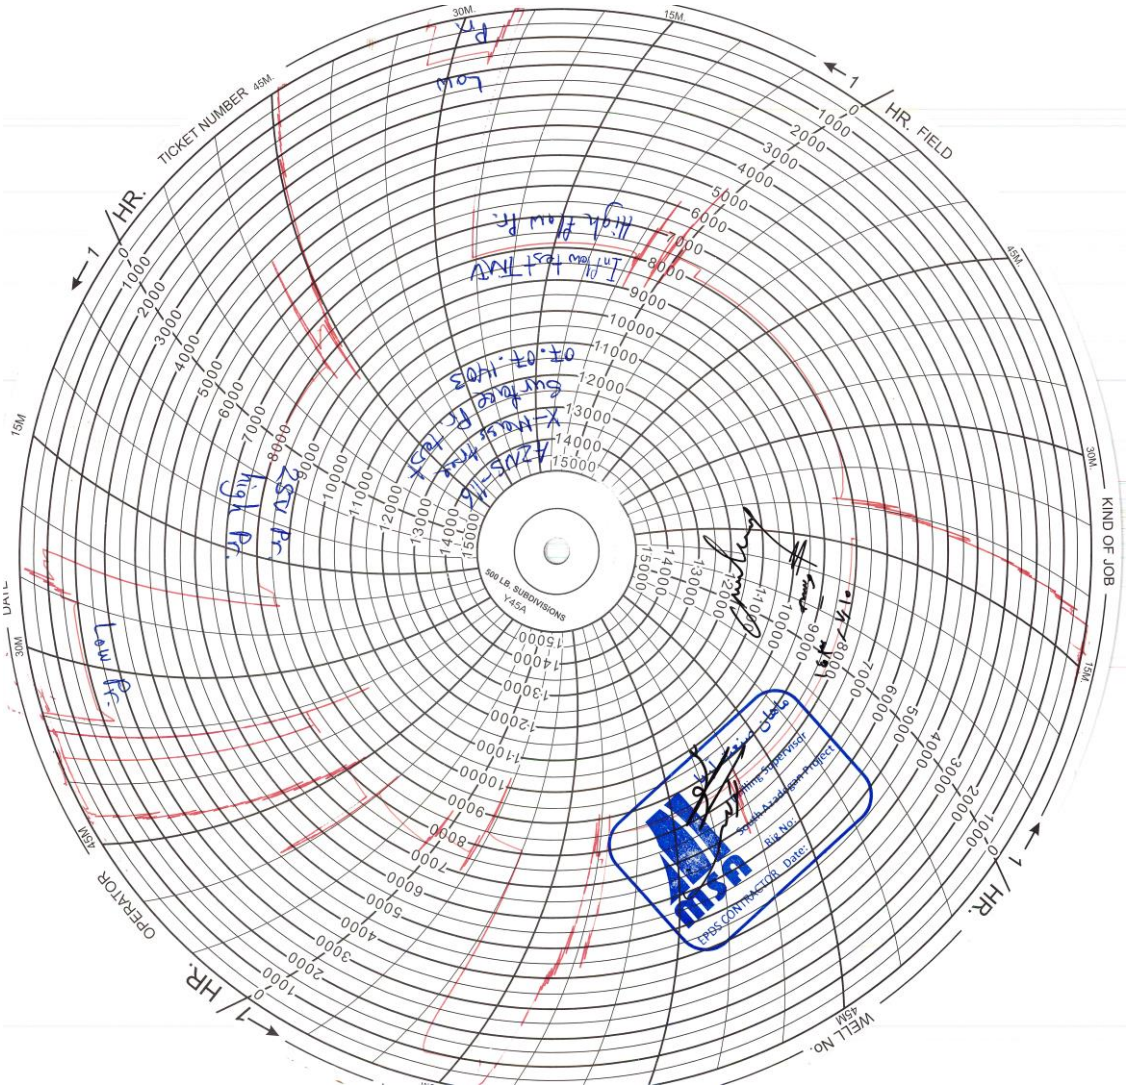


Figure 9-2: AZNS-116 X-Mass Tree Body Pressure Test Graph Before Installation

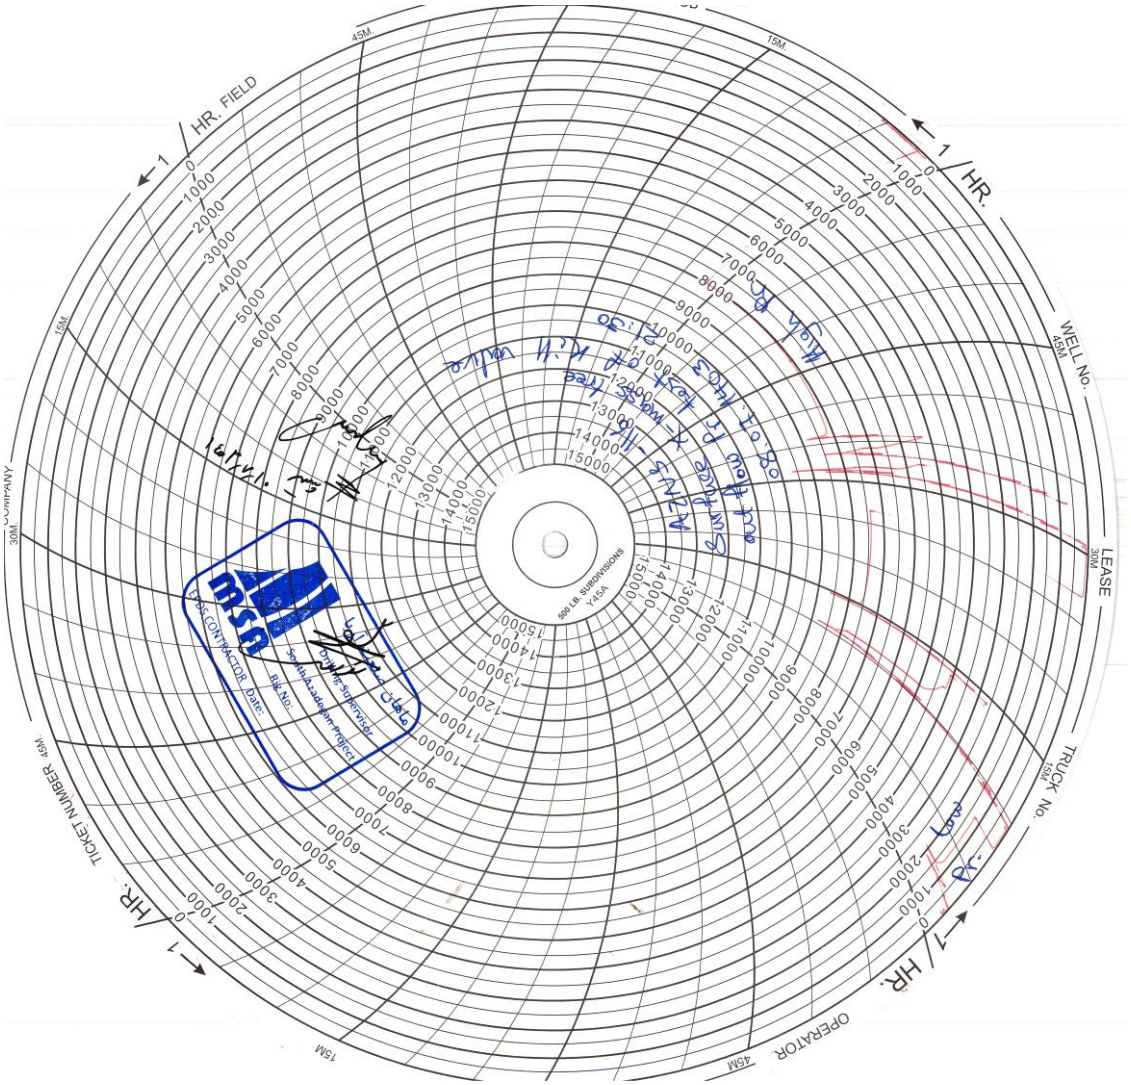


Figure 9-3: AZNS-116 X-Mass Tree Body Pressure Test Graph After Installation

تاریخ: ۱۴۰۳/۰۷/۰۷
پیوست: دارد

بسمه تعالی

موضوع: صورتجلسه تست سطحی تاج چاه ۱۱۶ آزادگان جنوبی قبل از نصب در دکل ۲۰۱ عملیات اکتشاف نفت

بدینوسیله در مورخه ۱۴۰۳/۰۷/۰۷ تست‌های سطحی تاج چاه X-Mass Tree Solid Block "T" Type 4-1/16" 10k, MSP Drilex مرتبط به چاه شماره ۱۱۶ آزادگان جنوبی با حضور نماینده محترم کارفرما (پتروپارس) در محل دستگاه ۲۰۱ عملیات اکتشاف نفت قبل از نصب بر روی تاج چاه به شرح ذیل انجام پذیرفت:

- Body Pressure Test of X-Mass Tree Solid Block w/ 1000psi, 5min & 8000psi, 15min "OK". S/N: 0269167CXC230004
- Inflow Pressure Test of 4-1/16" Production (WING) valve w/ 1000psi, 5min & 8000psi, 15min "OK". S/N: 002929BXC230003
- Inflow Pressure Test of 4-1/16" Dipping (SWAB) valve w/ 1000psi, 5min & 8000psi, 15min "OK". S/N: 008929KXC230004
- Inflow & Outflow Pressure Test of 4-1/16" Kill valve w/ 1000psi, 5min & 8000psi, 15min "OK". S/N: 002929BS210033
- Inflow Pressure Test of 4-1/16" Surface Safety valve w/ 1000psi, 5min & 8000psi, 15min "OK". S/N: 09604SY011809003
- Inflow & Outflow Pressure Test of 4-1/16" Top Master Valve w/ 1000psi, 5min & 8000psi, 15min "OK". S/N: 0089929LXC230004

- گراف مربوط به تست فشار پیوست صورتجلسه گردید.

ناظر عملیات حفاری
ماهان صنعت آرتا
Drilling Supervisor
South Azadegan Project
Rig No:
EPDS CONTRACTOR Date:

نماینده محترم تکمیل چاه کارفرما
شرکت نفت کیش

Figure 9-4: AZNS-116 Wellhead MOM Befor Installation

تاریخ: ۱۴۰۳/۰۷/۰۸
پیوست: دارد

بسمه تعالی

موضوع: صورتجلسه تست‌های تاج و ولهد چاه ۱۱۶ آزادگان جنوبی پس از نصب در دکل ۲۰۱ عملیات اکتشاف نفت

بدینوسیله در مورخه ۱۴۰۳/۰۷/۰۸ تست‌های تاج چاه X-Mass Tree Solid Block "T" Type 4-1/16" 10k, MSP Drilex و ولهد مرتبط به چاه شماره ۱۱۶ آزادگان جنوبی با حضور نماینده محترم کارفرما (پتروپارس) و نماینده عملیات حفاری ماهان صنعت آریا در محل دستگاه ۲۰۱ عملیات اکتشاف نفت پس از نصب بر روی چاه به شرح ذیل انجام پذیرفت:

- Body Pressure Test of X-Mass Tree Solid Block w/ 10k, 11" * 4-1/16" 10k Tubing Head Adaptor (Bottom Master Valve) 10k MSP Drilex w/ 8000^{psi}, 15min "OK". S/N: 0269167CXC230004
- Pressure Test TBG HGR Metal Seal to 800^{psi} for 5min & 8000^{psi} for 15min, "OK".
- Pressure Test F-Seal & Ring Gasket between T.H.S & T.H.A (BMV) to 8000^{psi} for 15min, "OK".
- Pressure Test Neck of TBG HGR F-Seal to 8000^{psi} for 15min, "OK".
- Pressure Test ¼" Control Line (CL) to 8000^{psi} for 15min, "OK".
- Pressure Test 3/8" Chemical Injection Lines (CIL) to 2000^{psi}, "OK".

- فشار تمامی دالیزها بررسی گردید که فشار آنها صفر بود.
- بعد از اتمام نصب تاج چاه درون آویزه لوله مغزی Two Way Check Valve (TWCV) جهت انگیزش چاه خارج گردید و BPV نصب گردید.
- خروجی کنترل لاین شیر ایمنی درون چاهی در جهت شیر اصلی پایینی می‌باشد و همچنین CIV شماره یک در جهت ویست‌پیت و CIV شماره دو در خلاف جهت ویست‌پیتمی‌باشند. همچنین بر روی دو CIV و کنترل لاین پلاگ‌کپ نصب گردید.
- گراف مربوط به تست فشار پیوست صورتجلسه گردید.

نماینده محترم تکمیل چاه کارفرما
شرکت نفت کیش

ماهان صنعت آریا
ناظر عملیات حفاری
Drilling Supervisor
Rig No:
EPDS CONTRACTOR Date:

Figure 9-5: AZNS-116 Wellhead MOM After Installation

10. Drilling Fluid Information

10.1 Interval Remark

Operation Remark

Spud the rig & 07/06/2024 on AZN-116. Work on well head & set the protection sleeve with No “SUCC”, Kill the well with 106 pcf mud and set the protection sleeve.

POOH with completion string to surface & OBS, completion string got parted.

RIH with 8 3/8” milling BHA to 3658 m, start milling the fish to 3703 POOH to surface.

RIH with fishing BHA to top of fish & work on fish & cached 6/6 m fish.

RIH with 8 3/8” milling BHA to top of fish start milling to 3711 m, POOH to surface.

RIH with fishing BHA to top of fish, work on fish and POOH to surface, string got recovered.

RIH with fishing BHA to top of fish & POOH with “NO SUCC”, Work on fish several times with recovered the fish successfully.

RIH with junk Sub & milling BHA, work on junk & POOH to surface several times.

RIH with fishing BHA & Work on fish several times with “SUCC”, recovered 8.1+ 3 m fish, while RIH with milling BHA work on milling & push the fish

RIH with taper tap & POOH to surface & OBS, taper tap was broken.

RIH with milling BHA & work on milling then POOH to surface several times.

RIH with fishing BHA several times and recovered the fish.

RIH clean out BHA and then POOH to surface.

Performed scraping operation.

Performed logging job.

RIH with clean out BHA to 3960 m, wash down to 3965 m, POOH to surface.

RIH with 3 ½" BHA to 3990 m, start milling to 3996 POOH to surface while stall string.

Performed polish mill job.

RIH with 3 ½" J.MIIL to 3990.6 m, wash down to 4050 m, POOH to surface.

RIH with clean out BHA to 3966 m, wash down to 4065.2 m, POOH to surface.

Performed perforation Job.

Performed tie back liner job (4 ½").

Performed clean out & scraping job.

Drilling Fluid Remark

Based on client decision kill the well with 106-103 PCF Salt/Polymer mud was used for commencing this interval.

The MW increased up to by adding Limestone Powder & Hematite up to 103 PCF at end of this interval.

Treated frequently with essential chemical such as lime as Alkalinity controller to adjust pH, Starch LV for control FL, Soda Ash for control hardness & Xanthan gum as Viscosifier.

10.2 Drilling Fluid type

KCl Pol Mud		Drilling Start	Range		Drilling End
Mw (min)	pcf	103	103	103	103
Funnel Viscosity	sec/qt	45	45	53	50
PV	cps	21	28	33	22
YP	lb/100sq.ft	12	9	18	18
pH	-	9.7	9.2	9.7	9.5
Cl (NaCl)	mg/L	180,000	160,000	180,000	165,000
Total Hardness	mg/L	1240	1240	1240	1240
Ca Hardness	mg/L	1000	1000	1000	1000

Table 10-1: AZNS-116 Fluid Properties Recap Table

10.3 Material Consumption Analysis

Product	Units Used	Units Wt (lb)	Total Wt	Effective Concentration
Bentonite	1	2,200	2,200	20.00 ppb
Caustic Soda	79	55	4,345	1.02 ppb
Hematite	70	3,300	229,350	263.62 ppb
Lime	130	55	7,150	1.68 ppb
Limestone	456	2,200	1,003,200	235.23 ppb
Salt (NaCl)	121	2,200	266,200	62.42 ppb
Starch LV	429	55	23,595	5.53 ppb
Soda Ash	48	55	2,640	0.62 ppb
Xanthan Gum	51	55	2,805	0.66 ppb

Initial Volume	0.0 bbl
Total Volume Built	4,264.8 bbl
Volume Received	0.0 bbl
Volume Returned	0.0bbl
Total Volume Consumed	2,992 bbl
Volume Transfer to Next Section	1,272.8 bbl
Meter Drilled	0 m

Table 10-2: AZNS-116 Material Consumption Analysis Table

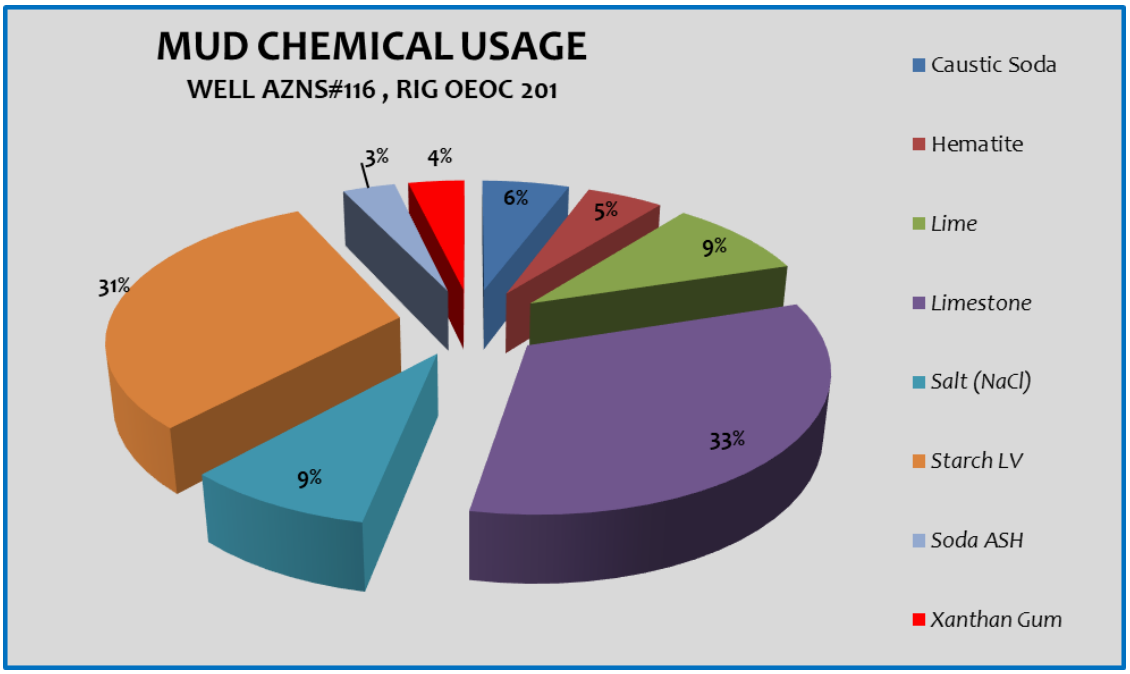


Figure 10-1: AZNS-116 Mud Chemical Usage

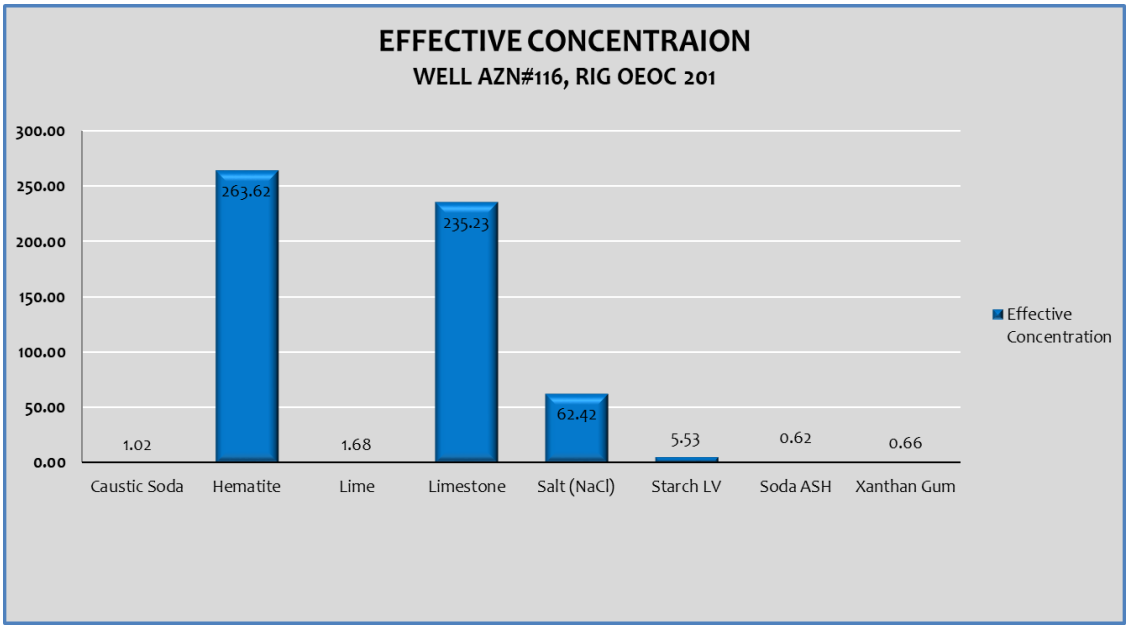


Figure 10-2: AZNS-116 Effective Concentration

10.4 Volume Analysis

Initial Volume (bbl)	0.0
Received Volume (bbl)	0.0
Volume Return (bbl)	0.0
Volume Built (bbl)	4,264.8
Surface Losses/Dumped (bbl)	2,992.0
Formation Losses (bbl)	0.0
Total Losses (bbl)	2,992.0
Volume Transfer Out (bbl)	1,273.0

Table 10-3: AZNS-116 Volume Analysis Table

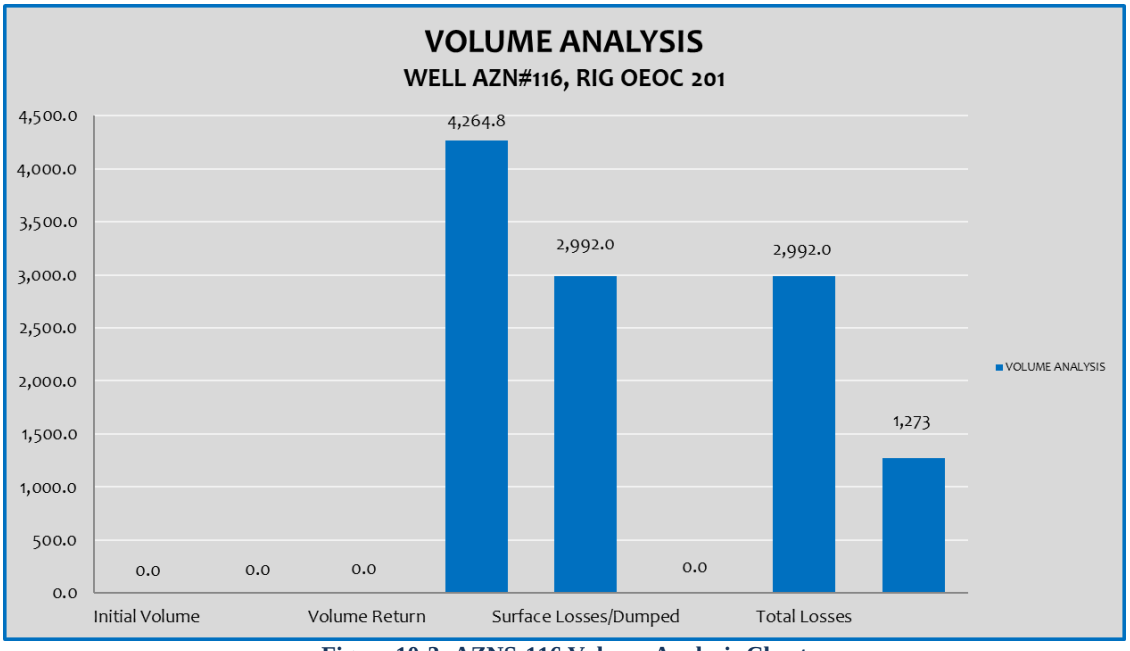


Figure 10-3: AZNS-116 Volume Analysis Chart

10.5 Daily volume Breakdown

Date/DMR.N		Volume of Built	Surface Losses	Formation Losses
7-Jun-24	01	2.3	0	0
8-Jun-24	02	620.8	0	0
9-Jun-24	03	552.0	0	0
10-Jun-24	04	189.4	39	0
11-Jun-24	05	0.1	0	0
12-Jun-24	06	190.3	0	0
13-Jun-24	07	411.1	226	0
14-Jun-24	08	119.8	10	0
15-Jun-24	09	21.4	90	0
16-Jun-24	10	102.9	31	0
17-Jun-24	11	24.8	30	0
18-Jun-24	12	311.9	30	0
19-Jun-24	13	0.5	27	0
20-Jun-24	14	0.0	54	0
21-Jun-24	15	0.0	33	0
22-Jun-24	16	0.2	7	0
23-Jun-24	17	0.3	6	0
24-Jun-24	18	0.1	45	0
25-Jun-24	19	0.0	40	0
26-Jun-24	20	0.0	13	0
27-Jun-24	21	0.0	12	0
28-Jun-24	22	0.2	25	0
29-Jun-24	23	0.0	18	0
30-Jun-24	24	0.3	35	0
1-Jul-24	25	0.0	46	0
2-Jul-24	26	0.2	18	0
3-Jul-24	27	151.1	28	0
4-Jul-24	28	2.1	150	0
5-Jul-24	29	0.4	60	0
6-Jul-24	30	0.0	41	0
7-Jul-24	31	0.4	26	0
8-Jul-24	32	0.1	15	0
9-Jul-24	33	168.5	95	0
10-Jul-24	34	0.1	46	0
11-Jul-24	35	0.4	30	0
12-Jul-24	36	0.5	0	0
13-Jul-24	37	0.8	25	0
14-Jul-24	38	0.4	52	0
15-Jul-24	39	182.3	10	0
16-Jul-24	40	4.9	73	0
17-Jul-24	41	0.1	23	0
18-Jul-24	42	0.0	11	0

19-Jul-24	43	0.4	5	0
20-Jul-24	44	0.0	5	0
21-Jul-24	45	0.1	45	0
22-Jul-24	46	166.6	5	0
23-Jul-24	47	0.3	98	0
24-Jul-24	48	9.4	42	0
25-Jul-24	49	0.1	33	0
26-Jul-24	50	0.1	20	0
27-Jul-24	51	2.8	22	0
28-Jul-24	52	30.3	28	0
29-Jul-24	53	0.2	37	0
30-Jul-24	54	0.0	27	0
31-Jul-24	55	0.0	20	0
1-Aug-24	56	187.0	25	0
2-Aug-24	57	0.0	20	0
3-Aug-24	58	0.6	12	0
4-Aug-24	59	0.5	22	0
5-Aug-24	60	0.1	22	0
6-Aug-24	61	0.1	22	0
7-Aug-24	62	30.1	22	0
8-Aug-24	63	0.0	40	0
9-Aug-24	64	0.0	50	0
10-Aug-24	65	0.1	8	0
11-Aug-24	66	0.0	34	0
12-Aug-24	67	0.1	24	0
13-Aug-24	68	0.1	4	0
14-Aug-24	69	118.1	16	0
15-Aug-24	70	0.0	18	0
16-Aug-24	71	0.0	105	0
17-Aug-24	72	122.5	29	0
18-Aug-24	73	4.7	25	0
19-Aug-24	74	0.1	4	0
20-Aug-24	75	0.3	5	0
21-Aug-24	76	0.1	55	0
22-Aug-24	77	0.0	38	0
23-Aug-24	78	162.5	8	0
24-Aug-24	79	0.3	22	0
25-Aug-24	80	0.0	28	0
26-Aug-24	81	0.0	8	0
27-Aug-24	82	171.4	41	0
28-Aug-24	83	0.0	14	0
29-Aug-24	84	0.0	18	0
30-Aug-24	85	0.2	15	0
31-Aug-24	86	0.0	36	0
1-Sep-24	87	0.0	23	0
2-Sep-24	88	0.1	8	0
3-Sep-24	89	0.7	21	0
4-Sep-24	90	2.3	7	0
5-Sep-24	91	0.2	8	0
6-Sep-24	92	4.9	38	0

7-Sep-24	93	110.0	8	0
8-Sep-24	94	0.0	25	0
9-Sep-24	95	35.8	26	0
10-Sep-24	96	0.0	8	0
11-Sep-24	97	0.0	7	0
12-Sep-24	98	0.0	8	0
13-Sep-24	99	37.7	11	0
14-Sep-24	100	0.0	20	0
15-Sep-24	101	0.0	9	0
16-Sep-24	102	0.1	4	0
17-Sep-24	103	0.0	17	0
18-Sep-24	104	0.0	14	0
19-Sep-24	105	3.1	10	0
20-Sep-24	106	0.0	23	0
21-Sep-24	107	0.0	0	0
22-Sep-24	108	0.0	0	0
Total (bbl)		Volume of Built	Surface Losses	Formation Losses
		4,264.8	2,992	0

Table 10-4: AZNS-116 Daily Volume Break Down Table

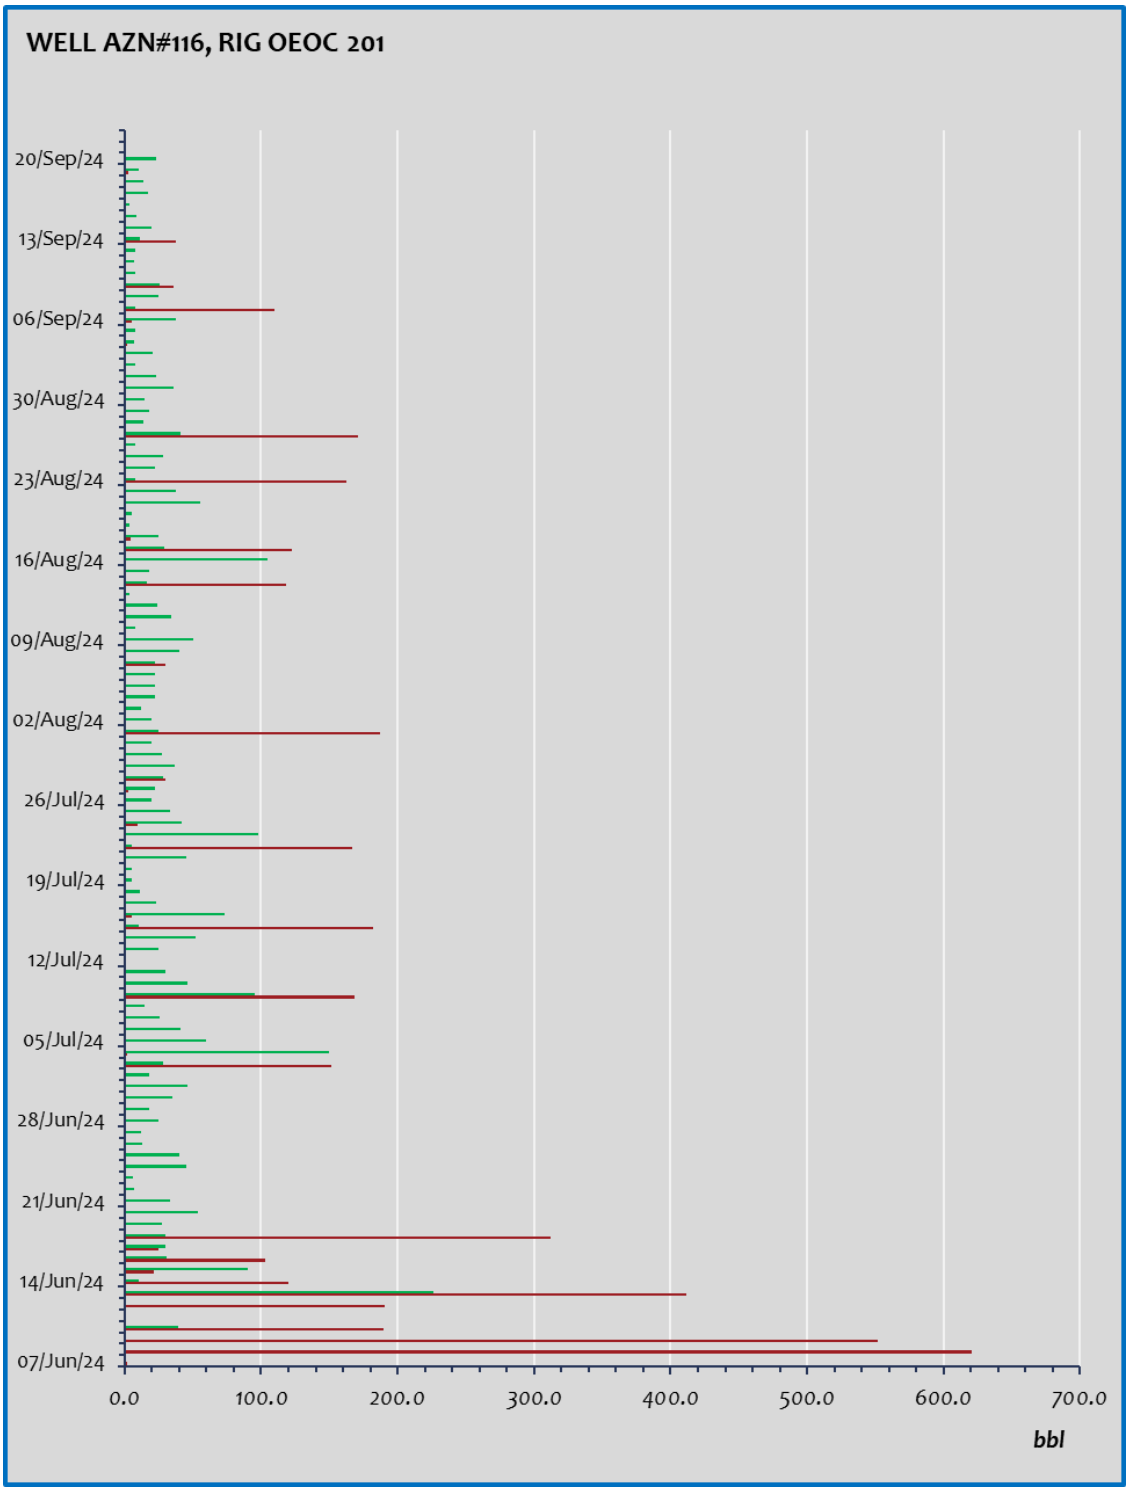


Figure 10-4: AZNS-116 Daily Volume Break Down Chart

10.6 Loss Distribution

Date/DMR.N		Volume of Built	Dump/Contamination	Shakers	Evaporation	Centrifuge	Trip	Mud cleaner	Pit Cleaning	Formation	Other
7-Jun-24	01	2.3	0	0	0	0	0	0	0	0	0
8-Jun-24	02	620.8	0	0	0	0	0	0	0	0	0
9-Jun-24	03	552.0	0	0	0	0	0	0	0	0	0
10-Jun-24	04	189.4	20	0	0	0	0	0	0	0	19
11-Jun-24	05	0.1	0	0	0	0	0	0	0	0	0
12-Jun-24	06	190.3	0	0	0	0	0	0	0	0	0
13-Jun-24	07	411.1	186	0	5	0	0	0	35	0	0
14-Jun-24	08	119.8	0	0	0	0	10	0	0	0	0
15-Jun-24	09	21.4	0	0	10	0	40	0	40	0	0
16-Jun-24	10	102.9	0	0	5	0	26	0	0	0	0
17-Jun-24	11	24.8	0	0	5	0	0	0	25	0	0
18-Jun-24	12	311.9	0	0	5	0	0	0	25	0	0
19-Jun-24	13	0.5	0	12	15	0	0	0	0	0	0
20-Jun-24	14	0.0	0	0	8	0	21	0	0	0	25
21-Jun-24	15	0.0	0	0	6	0	27	0	0	0	0
22-Jun-24	16	0.2	0	0	0	0	7	0	0	0	0
23-Jun-24	17	0.3	0	0	6	0	0	0	0	0	0
24-Jun-24	18	0.1	0	0	7	0	18	0	0	0	20
25-Jun-24	19	0.0	0	0	7	0	15	0	0	0	18
26-Jun-24	20	0.0	0	0	5	0	8	0	0	0	0
27-Jun-24	21	0.0	0	0	5	0	7	0	0	0	0
28-Jun-24	22	0.2	0	0	0	0	15	0	0	0	10
29-Jun-24	23	0.0	0	0	7	0	11	0	0	0	0
30-Jun-24	24	0.3	0	0	0	0	0	0	0	0	35
1-Jul-24	25	0.0	0	0	6	0	15	0	16	0	9
2-Jul-24	26	0.2	0	0	5	0	13	0	0	0	0
3-Jul-24	27	151.1	0	0	5	0	13	0	0	0	10
4-Jul-24	28	2.1	145	0	5	0	0	0	0	0	0
5-Jul-24	29	0.4	0	0	0	0	0	0	0	0	60
6-Jul-24	30	0.0	0	0	6	0	26	0	0	0	9
7-Jul-24	31	0.4	0	0	4	0	22	0	0	0	0
8-Jul-24	32	0.1	0	0	0	0	0	0	0	0	15
9-Jul-24	33	168.5	0	0	0	0	95	0	0	0	0
10-Jul-24	34	0.1	0	0	0	0	31	0	0	0	15
11-Jul-24	35	0.4	0	5	10	0	15	0	0	0	0
12-Jul-24	36	0.5	0	0	0	0	0	0	0	0	0
13-Jul-24	37	0.8	0	5	10	0	0	0	0	0	10
14-Jul-24	38	0.4	0	5	12	0	25	0	0	0	10
15-Jul-24	39	182.3	0	2	8	0	0	0	0	0	0
16-Jul-24	40	4.9	0	15	10	0	18	0	0	0	30
17-Jul-24	41	0.1	0	0	8	0	15	0	0	0	0
18-Jul-24	42	0.0	0	0	6	0	5	0	0	0	0

19-Jul-24	43	0.4	0	0	5	0	0	0	0	0	0
20-Jul-24	44	0.0	0	0	0	0	5	0	0	0	0
21-Jul-24	45	0.1	0	0	10	0	25	0	0	0	10
22-Jul-24	46	166.6	0	0	5	0	0	0	0	0	0
23-Jul-24	47	0.3	0	5	8	0	20	0	40	0	25
24-Jul-24	48	9.4	0	0	12	0	30	0	0	0	0
25-Jul-24	49	0.1	0	0	10	0	23	0	0	0	0
26-Jul-24	50	0.1	0	0	8	0	12	0	0	0	0
27-Jul-24	51	2.8	0	0	12	0	0	0	0	0	10
28-Jul-24	52	30.3	0	0	8	0	5	0	0	0	15
29-Jul-24	53	0.2	0	0	12	0	10	0	0	0	15
30-Jul-24	54	0.0	0	0	12	0	15	0	0	0	0
31-Jul-24	55	0.0	0	0	10	0	10	0	0	0	0
1-Aug-24	56	187.0	0	0	10	0	15	0	0	0	0
2-Aug-24	57	0.0	0	0	10	0	10	0	0	0	0
3-Aug-24	58	0.6	0	0	12	0	0	0	0	0	0
4-Aug-24	59	0.5	0	0	12	0	0	0	0	0	10
5-Aug-24	60	0.1	0	0	7	0	10	0	0	0	5
6-Aug-24	61	0.1	0	0	12	0	10	0	0	0	0
7-Aug-24	62	30.1	0	10	7	0	0	0	0	0	5
8-Aug-24	63	0.0	0	0	10	0	30	0	0	0	0
9-Aug-24	64	0.0	0	0	10	0	30	0	0	0	10
10-Aug-24	65	0.1	0	0	8	0	0	0	0	0	0
11-Aug-24	66	0.0	0	0	6	0	21	0	0	0	7
12-Aug-24	67	0.1	0	0	6	0	18	0	0	0	0
13-Aug-24	68	0.1	0	0	4	0	0	0	0	0	0
14-Aug-24	69	118.1	0	0	6	0	10	0	0	0	0
15-Aug-24	70	0.0	0	0	5	0	13	0	0	0	0
16-Aug-24	71	0.0	0	0	7	0	98	0	0	0	0
17-Aug-24	72	122.5	0	0	5	0	3	0	21	0	0
18-Aug-24	73	4.7	0	0	6	0	19	0	0	0	0
19-Aug-24	74	0.1	0	0	4	0	0	0	0	0	0
20-Aug-24	75	0.3	0	0	5	0	0	0	0	0	0
21-Aug-24	76	0.1	0	7	8	0	10	0	30	0	0
22-Aug-24	77	0.0	0	0	8	0	20	0	0	0	10
23-Aug-24	78	162.5	0	0	8	0	0	0	0	0	0
24-Aug-24	79	0.3	0	4	8	0	0	0	0	0	10
25-Aug-24	80	0.0	0	0	8	0	20	0	0	0	0
26-Aug-24	81	0.0	0	0	8	0	0	0	0	0	0
27-Aug-24	82	171.4	0	0	8	0	18	0	0	0	15
28-Aug-24	83	0.0	0	0	8	0	6	0	0	0	0
29-Aug-24	84	0.0	0	0	8	0	10	0	0	0	0
30-Aug-24	85	0.2	0	0	8	0	7	0	0	0	0
31-Aug-24	86	0.0	0	0	8	0	28	0	0	0	0
1-Sep-24	87	0.0	0	0	8	0	15	0	0	0	0
2-Sep-24	88	0.1	0	0	8	0	0	0	0	0	0
3-Sep-24	89	0.7	0	0	7	0	14	0	0	0	15
4-Sep-24	90	2.3	0	0	7	0	0	0	0	0	0

5-Sep-24	91	0.2	0	0	8	0	0	0	0	0	8
6-Sep-24	92	4.9	0	0	0	8	30	0	0	0	13
7-Sep-24	93	110.0	0	0	8	0	0	0	0	0	0
8-Sep-24	94	0.0	0	0	7	0	18	0	0	0	0
9-Sep-24	95	35.8	0	0	8	0	18	0	0	0	0
10-Sep-24	96	0.0	0	0	8	0	0	0	0	0	15
11-Sep-24	97	0.0	0	0	7	0	0	0	0	0	0
12-Sep-24	98	0.0	0	0	8	0	0	0	0	0	0
13-Sep-24	99	37.7	0	0	7	0	4	0	0	0	10
14-Sep-24	100	0.0	0	0	8	0	12	0	0	0	0
15-Sep-24	101	0.0	0	0	4	0	5	0	0	0	0
16-Sep-24	102	0.1	0	0	4	0	0	0	0	0	0
17-Sep-24	103	0.0	0	0	5	0	12	0	0	0	0
18-Sep-24	104	0.0	0	0	4	0	10	0	0	0	18
19-Sep-24	105	3.1	0	0	5	0	5	0	0	0	0
20-Sep-24	106	0.0	0	0	5	0	18	0	0	0	0
21-Sep-24	107	0.0	0	0	0	0	0	0	0	0	0
22-Sep-24	108	0.0	0	0	0	0	0	0	0	0	0
Total (bbl)		Volume of Built	Dump/Contaminate	Shakers	Evaporation	Centrifuge	Trip	Mud cleaner	Pit Cleaning	Formation	Other
		4,264.8	351	70	669	8	1,220	0	232	0	521.0

Note: Prepared 161.4 Cacl2 brine & Completion fluid inhibitor (DMR#106,107,108) that is consider in next section.

Table 10-5: AZNS-116 Loss Distribution

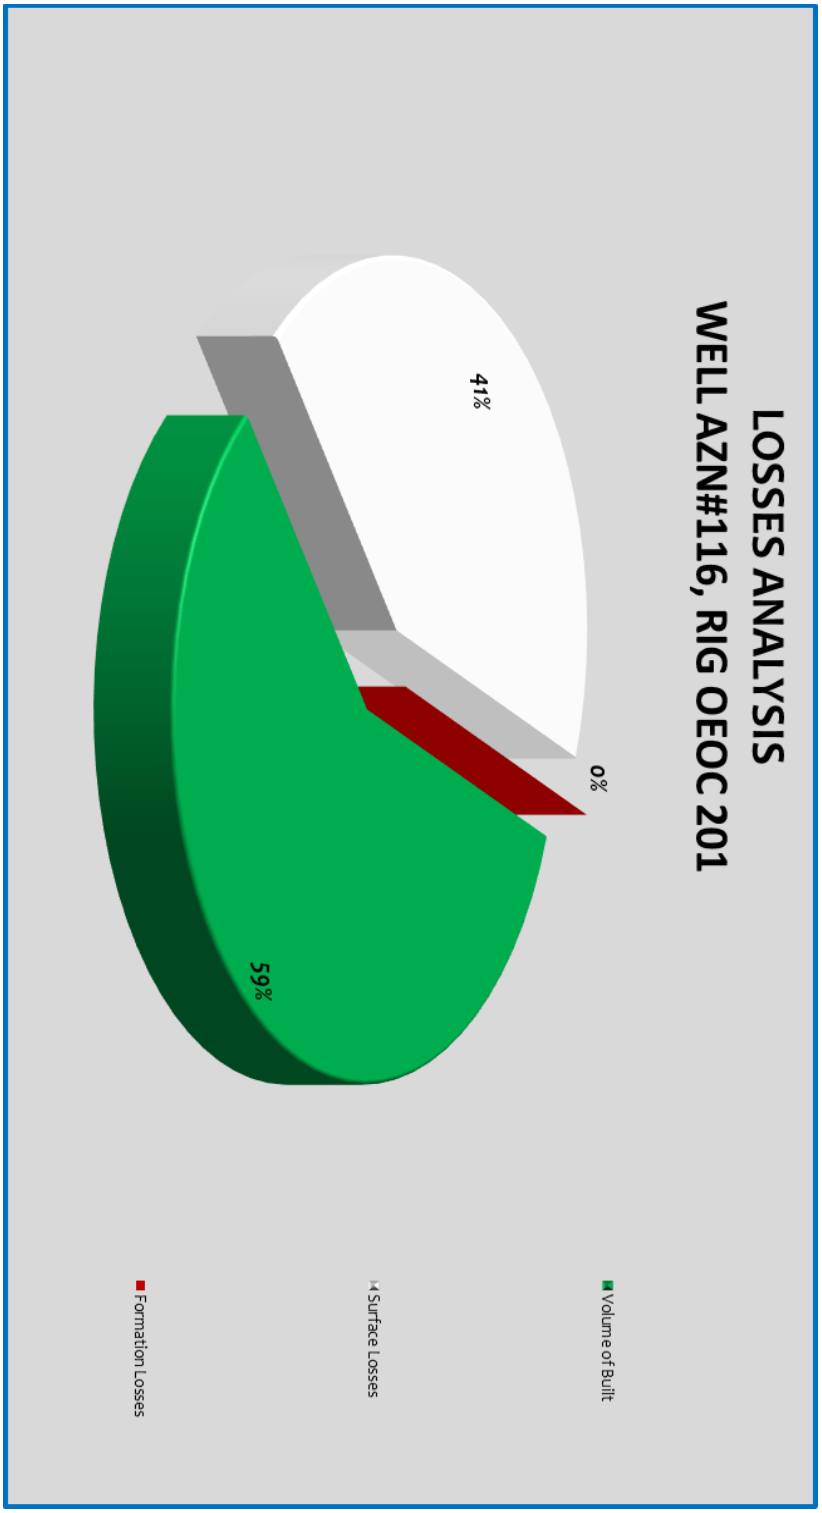


Figure 10-5: AZNS-116 Loss Analysis

10.7 Interval Fluid Properties Recap

Date	DEPTH	Density	VIS	PV	YP	Water Loss	pH	Chloride	Calcium	Total Hardness	Mud Type
7-Jun-24											
8-Jun-24											
9-Jun-24											
10-Jun-24	4090	103	45	33	12	6	9.7	180,000	1000	1240	Salt/Poly Mud
11-Jun-24	4090	103	45	30	9	10	9.7	180,000	1000	1240	Salt/Poly Mud
12-Jun-24	4090	103	48	30	10	10	9.7	180,000	1000	1240	Salt/Poly Mud
13-Jun-24	4090	103	52	28	14	15	9.2	180,000	1000	1240	Salt/Poly Mud
14-Jun-24	4090	103	50	28	12	15	9.4	180,000	1000	1240	Salt/Poly Mud
15-Jun-24	4090	103	52	28	14	15	9.4	180,000	1000	1240	Salt/Poly Mud
16-Jun-24	4090	103	52	30	12	18	9.4	180,000	1000	1240	Salt/Poly Mud
17-Jun-24	4090	103	53	30	12	15	9.4	180,000	1000	1240	Salt/Poly Mud
18-Jun-24	4090	103	53	30	13	20	9.3	180,000	1000	1240	Salt/Poly Mud
19-Jun-24	4090	103	50	29	11	20	9.4	180,000	1000	1240	Salt/Poly Mud
20-Jun-24	4090	103	50	29	11	20	9.4	180,000	1000	1240	Salt/Poly Mud
21-Jun-24	4090	103	50	29	11	20	9.3	180,000	1000	1240	Salt/Poly Mud
22-Jun-24	4090	103	50	28	10	20	9.4	180,000	1000	1240	Salt/Poly Mud
23-Jun-24	4090	103	50	28	10	20	9.4	180,000	1000	1240	Salt/Poly Mud
24-Jun-24	4090	103	51	28	10	20	9.5	180,000	1000	1240	Salt/Poly Mud
25-Jun-24	4090	103	51	28	10	20	9.4	180,000	1000	1240	Salt/Poly Mud
26-Jun-24	4090	103	50	28	10	20	9.4	180,000	1000	1240	Salt/Poly Mud
27-Jun-24	4090	103	50	28	10	20	9.3	180,000	1000	1240	Salt/Poly Mud
28-Jun-24	4090	103	50	28	10	20	9.3	180,000	1000	1240	Salt/Poly Mud
29-Jun-24	4090	103	51	28	10	20	9.2	180,000	1000	1240	Salt/Poly Mud
30-Jun-24	4090	103	54	28	12	20	9.5	180,000	1000	1240	Salt/Poly Mud
1-Jul-24	4090	103	54	28	12	20	9.5	180,000	1000	1240	Salt/Poly Mud
2-Jul-24	4090	103	52	28	12	20	9.3	180,000	1000	1240	Salt/Poly Mud
3-Jul-24	4090	103	52	28	12	20	9.4	180,000	1000	1240	Salt/Poly Mud
4-Jul-24	4090	103	52	28	12	20	9.4	180,000	1000	1240	Salt/Poly Mud
5-Jul-24	4090	103	54	28	13	20	9.5	180,000	1000	1240	Salt/Poly Mud
6-Jul-24	4090	103	54	28	13	20	9.4	180,000	1000	1240	Salt/Poly Mud
7-Jul-24	4090	103	48	28	13	20	9.6	180,000	1000	1240	Salt/Poly Mud
8-Jul-24	4090	103	49	28	13	20	9.5	180,000	1000	1240	Salt/Poly Mud
9-Jul-24	4090	103	55	28	17	20	9.5	180,000	1000	1240	Salt/Poly Mud
10-Jul-24	4090	103	52	28	16	20	9.4	180,000	1000	1240	Salt/Poly Mud
11-Jul-24	4090	103	49	28	16	20	9.6	180,000	1000	1240	Salt/Poly Mud
12-Jul-24	4090	103	49	28	17	20	9.6	180,000	1000	1240	Salt/Poly Mud
13-Jul-24	4090	103	50	28	17	20	9.5	180,000	1000	1240	Salt/Poly Mud
14-Jul-24	4090	103	50	28	17	20	9.5	180,000	1000	1240	Salt/Poly Mud
15-Jul-24	4090	103	49	28	17	20	9.6	165,000	1000	1240	Salt/Poly Mud
16-Jul-24	4090	103	50	28	17	20	9.6	165,000	1000	1240	Salt/Poly Mud
17-Jul-24	4090	103	50	28	17	20	9.5	165,000	1000	1240	Salt/Poly Mud
18-Jul-24	4090	103	50	28	17	20	9.5	165,000	1000	1240	Salt/Poly Mud

19-Jul-24	4090	103	48	28	16	20	9.5	176,000	1000	1240	Salt/Poly Mud
20-Jul-24	4090	103	48	28	16	20	9.5	176,000	1000	1240	Salt/Poly Mud
21-Jul-24	4090	103	48	28	16	20	9.5	177,000	1000	1240	Salt/Poly Mud
22-Jul-24	4090	103	48	28	16	20	9.5	164,000	1000	1240	Salt/Poly Mud
23-Jul-24	4090	103	49	28	17	20	9.5	160,000	1000	1240	Salt/Poly Mud
24-Jul-24	4090	103	49	28	17	20	9.6	164,000	1000	1240	Salt/Poly Mud
25-Jul-24	4090	103	49	28	17	20	9.6	164,000	1000	1240	Salt/Poly Mud
26-Jul-24	4090	103	49	28	17	20	9.5	164,000	1000	1240	Salt/Poly Mud
27-Jul-24	4090	103	49	28	17	20	9.6	165,000	1000	1240	Salt/Poly Mud
28-Jul-24	4090	103	49	28	17	20	9.6	168,000	1000	1240	Salt/Poly Mud
29-Jul-24	4090	103	49	28	17	20	9.6	168,000	1000	1240	Salt/Poly Mud
30-Jul-24	4090	103	49	28	17	20	9.6	168,000	1000	1240	Salt/Poly Mud
31-Jul-24	4090	103	49	28	17	20	9.6	168,000	1000	1240	Salt/Poly Mud
1-Aug-24	4090	103	49	28	17	20	9.5	168,000	1000	1240	Salt/Poly Mud
2-Aug-24	4090	103	49	28	17	20	9.5	168,000	1000	1240	Salt/Poly Mud
3-Aug-24	4090	103	49	28	17	23	9.6	177,000	1000	1240	Salt/Poly Mud
4-Aug-24	4090	103	52	28	18	22	9.6	163,000	1000	1240	Salt/Poly Mud
5-Aug-24	4090	103	53	28	18	22	9.6	163,000	1000	1240	Salt/Poly Mud
6-Aug-24	4090	103	50	28	18	22	9.6	163,000	1000	1240	Salt/Poly Mud
7-Aug-24	4090	103	49	28	17	22	9.6	163,000	1000	1240	Salt/Poly Mud
8-Aug-24	4090	103	48	28	17	23	9.6	163,000	1000	1240	Salt/Poly Mud
9-Aug-24	4090	103	48	28	17	23	9.5	165,000	1000	1240	Salt/Poly Mud
10-Aug-24	4090	103	50	28	17	23	9.6	165,000	1000	1240	Salt/Poly Mud
11-Aug-24	4090	103	52	28	17	23	9.6	165,000	1000	1240	Salt/Poly Mud
12-Aug-24	4090	103	51	28	18	23	9.6	165,000	1000	1240	Salt/Poly Mud
13-Aug-24	4090	103	52	28	18	23	9.6	165,000	1000	1240	Salt/Poly Mud
14-Aug-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt/Poly Mud
15-Aug-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt/Poly Mud
16-Aug-24	4090	103	51	28	18	23	9.5	165,000	1000	1240	Salt/Poly Mud
17-Aug-24	4090	103	51	28	18	23	9.5	165,000	1000	1240	Salt/Poly Mud
18-Aug-24	4090	103	51	28	18	23	9.5	165,000	1000	1240	Salt/Poly Mud
19-Aug-24	4090	103	51	28	18	23	9.4	165,000	1000	1240	Salt/Poly Mud
20-Aug-24	4090	103	49	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
21-Aug-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
22-Aug-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
23-Aug-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
24-Aug-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
25-Aug-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
26-Aug-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
27-Aug-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
28-Aug-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud

29-Aug-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
30-Aug-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
31-Aug-24	4090	103	49	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
1-Sep-24	4090	103	49	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
2-Sep-24	4090	103	49	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
3-Sep-24	4090	103	49	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
4-Sep-24	4090	103	49	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
5-Sep-24	4090	103	49	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
6-Sep-24	4090	103	49	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
7-Sep-24	4090	103	49	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
8-Sep-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
9-Sep-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
10-Sep-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
11-Sep-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
12-Sep-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
13-Sep-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
14-Sep-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
15-Sep-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
16-Sep-24	4090	103	49	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
17-Sep-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
18-Sep-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
19-Sep-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
20-Sep-24	4090	103	50	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud
21-Sep-24	4090	103	49	28	18	23	9.5	165,000	1000	1240	Salt Poly Mud

Table 10-6: AZNS-116 Fluid Properties Recap

10.8 Solid Control Disscusion

Rig OEOC 201 has 3 shale shakers were dressed with:

Shaker#1: 120 – 140 Mesh Screen

Shaker#2: 120 – 140 Mesh Screen

Shaker#3: 120 – 140 Mesh Screen

WELL AZN#85, RIG OEOC 201	
Solid Control Equipment Working Hr.s	
Shaker # 01	736
Shaker # 02	1122
Shaker # 03	360

Table 10-7: AZNS-116 Solid Control Desscusion

10.9 Inhibited $CaBr_2$ Brine

The completion fluid for this section will be $CaCl_2$ brine mixed with $CaBr_2$ brine treated with a scavenger, inhibitor.

Completion						
Products	Units Used	Unit wt lbs	Total wt		Effective Concentration	
998 bbl Completion fluid has been made						
CaBr2		BBL	908	gals	1.24	gpb
CaCl2		1 MT	13	lbs	165.80	ppb
Corrision Inhibitor		55 Gal	8	gals	0.44	gpb
O2 Scavenger		55 Gal	4	gals	0.22	gpb
H2S Scavenger		55 Gal	4	gals	0.22	gpb
Cacl2 Brine			*70 bbl*			
MW :			*105.0*			*pcf*
Initial Volume :			*0.0*			*bbl*
Total Volume Built (Completion Fluid) :			*998.0*			*bbl*

Note: prepared 30^{bbl} Hi-Vis $CaCl_2$ Brine pumping as spacer & 35^{bbl} dead Vol. in the pit

Table 10-8: AZNS-116 Inhibited $CaBr_2$ Brine

11. Waste Management Service

11.1 Well & Hole Section

Country / Area	Iran, Khuzestan.
Client	MSA
Field	Azadegan
Well	AZNS-116
Location	PAD-81 (Block: III)
Well head co-ordinate [UTM39N, WGS84]	E 187,374.0 m
	N 3,434,999.0 m
Type	IIF Vertical Well
Objective	De-complete the well, Re-complete the well, Due to abnormal annulus , find leakage point and cure it, Check and smooth collapse interval from 3889-3911.

Hole Section	**De-Completion**
Rig	201 OEOC
Start date	July. 14th 2024
Ended date	Oct. 06th 2024
Stardet depth (m)	0 m
Ended depth (m)	0 m
Duration	85 days

11.2 Operation's Recap

Fixation									
Report No.	Date	Depth	Drilled	Total Cuttings		Fixed Cuttings		Sent to Disposa	
				Daily	Cum.	Daily	Cum.	Daily	Cum.
-	dd-M-yy	m	m	bbl.	bbl.	bbl.	bbl.	bbl.	bbl.
1	14-Jul-24	0	0	0	200	0	0	0	0
2	15-Jul-24	0	0	0	200	0	0	0	0
3	16-Jul-24	0	0	0	200	200	200	0	0
4	17-Jul-24	0	0	0	200	0	200	0	0
5	18-Jul-24	0	0	5	205	0	200	0	0
6	19-Jul-24	0	0	0	205	0	200	0	0
7	20-Jul-24	0	0	5	210	0	200	0	0
8	21-Jul-24	0	0	5	215	0	200	0	0
9	22-Jul-24	0	0	0	215	0	200	0	0
10	23-Jul-24	0	0	85	300	0	200	0	0
11	24-Jul-24	0	0	30	330	0	200	0	0
12	25-Jul-24	0	0	23	353	0	200	0	0
13	26-Jul-24	0	0	12	365	0	200	0	0
14	27-Jul-24	0	0	10	375	0	200	0	0
15	28-Jul-24	0	0	20	395	0	200	0	0
16	29-Jul-24	0	0	25	420	0	200	0	0
17	30-Jul-24	0	0	15	435	0	200	0	0
18	31-Jul-24	0	0	10	445	0	200	0	0
19	1-Aug-24	0	0	15	460	0	200	0	0
20	2-Aug-24	0	0	10	470	0	200	0	0
21	3-Aug-24	0	0	0	470	0	200	0	0
22	4-Aug-24	0	0	10	480	0	200	0	0
23	5-Aug-24	0	0	15	495	0	200	0	0
24	6-Aug-24	0	0	10	505	0	200	0	0
25	7-Aug-24	0	0	15	520	0	200	0	0

26	8-Aug-24	0	0	30	550	0	200	0	0
27	9-Aug-24	0	0	40	590	0	200	0	0
28	10-Aug-24	0	0	0	590	0	200	0	0
29	11-Aug-24	0	0	28	618	0	200	0	0
30	12-Aug-24	0	0	18	636	0	200	0	0
31	13-Aug-24	0	0	0	636	0	200	0	0
32	14-Aug-24	0	0	10	646	0	200	0	0
33	15-Aug-24	0	0	13	659	0	200	0	0
34	16-Aug-24	0	0	0	659	0	200	0	0
35	17-Aug-24	0	0	24	683	0	200	0	0
36	18-Aug-24	0	0	19	702	0	200	0	0
37	19-Aug-24	0	0	0	702	0	200	0	0
38	20-Aug-24	0	0	0	702	0	200	0	0
39	21-Aug-24	0	0	47	749	0	200	0	0
40	22-Aug-24	0	0	30	779	0	200	0	0
41	23-Aug-24	0	0	0	779	0	200	0	0
42	24-Aug-24	0	0	14	793	0	200	0	0
43	25-Aug-24	0	0	20	813	0	200	0	0
44	26-Aug-24	0	0	0	813	0	200	0	0
45	27-Aug-24	0	0	33	846	0	200	0	0
46	28-Aug-24	0	0	6	852	0	200	0	0
47	29-Aug-24	0	0	10	862	0	200	0	0
48	30-Aug-24	0	0	67	929	0	200	0	0
49	31-Aug-24	0	0	28	957	0	200	0	0
50	1-Sep-24	0	0	15	972	0	200	0	0
51	2-Sep-24	0	0	0	972	0	200	0	0
52	3-Sep-24	0	0	29	1,001	0	200	0	0
53	4-Sep-24	0	0	0	1,001	0	200	0	0
54	5-Sep-24	0	0	8	1,009	0	200	0	0
55	6-Sep-24	0	0	51	1,060	0	200	0	0
56	7-Sep-24	0	0	0	1,060	0	200	0	0
57	8-Sep-24	0	0	18	1,078	200	400	0	0
58	9-Sep-24	0	0	0	1,078	0	400	0	0
59	10-Sep-24	0	0	15	1,093	0	400	0	0
60	11-Sep-24	0	0	0	1,093	250	650	0	0
61	12-Sep-24	0	0	0	1,093	0	650	0	0
62	13-Sep-24	0	0	14	1,107	0	650	0	0
63	14-Sep-24	0	0	12	1,119	0	650	0	0
64	15-Sep-24	0	0	5	1,124	300	950	0	0
65	16-Sep-24	0	0	0	1,124	0	950	0	0
66	17-Sep-24	0	0	12	1,136	0	950	0	0
67	18-Sep-24	0	0	18	1,154	0	950	0	0
68	19-Sep-24	0	0	5	1,159	0	950	0	0
69	20-Sep-24	0	0	5	1,164	0	950	0	0
70	21-Sep-24	0	0	0	1,164	0	950	0	0

71	22-Sep-24	0	0	0	1,164	0	950	0	0
72	23-Sep-24	0	0	0	1,164	200	1,150	0	0
73	24-Sep-24	0	0	125	1,289	0	1,150	0	0
74	25-Sep-24	0	0	0	1,289	0	1,150	0	0
75	26-Sep-24	0	0	0	1,289	0	1,150	0	0
76	27-Sep-24	0	0	0	1,289	0	1,150	0	0
77	28-Sep-24	0	0	0	1,289	0	1,150	0	0
78	29-Sep-24	0	0	0	1,289	0	1,150	0	0
79	30-Sep-24	0	0	1,188	2,477	0	1,150	0	0
80	1-Oct-24	0	0	0	2,477	0	1,150	0	0
81	2-Oct-24	0	0	0	2,477	0	1,150	0	0
82	3-Oct-24	0	0	0	2,477	0	1,150	0	0
83	4-Oct-24	0	0	0	2,477	0	1,150	0	0
84	5-Oct-24	0	0	0	2,477	0	1,150	0	0
85	6-Oct-24	0	0	0	2,477	370	1,520	80	80

Table 11-1: AZNS-116 Fixation Recap Table

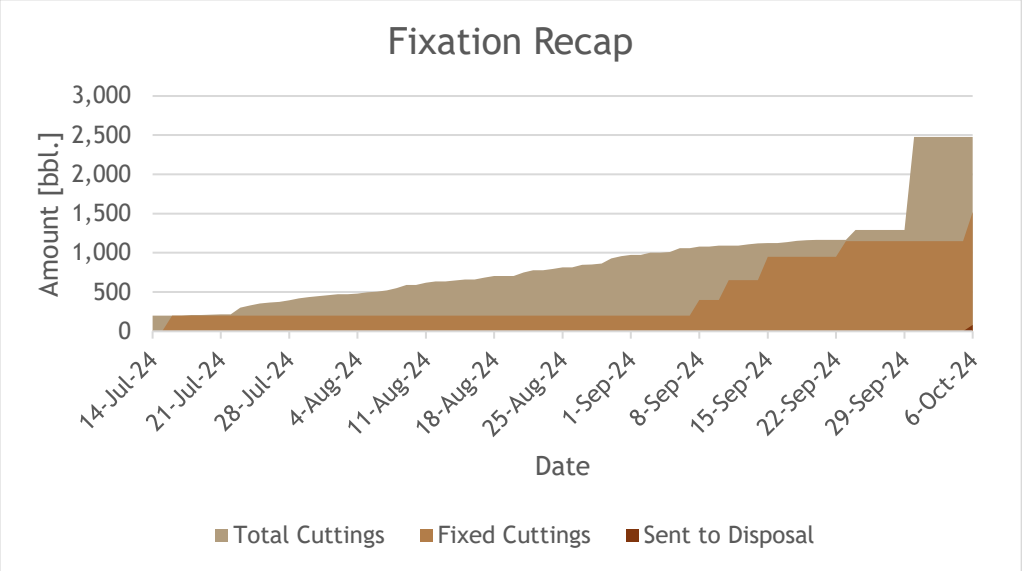


Figure 11-1: AZNS-116 Fixation Recap

Fixation analysis								
Report No.	Date	Depth	Drilled	Can test	Cement/Waste		SodSil/Waste	
				Daily	Daily	Average	Daily	Average
-	dd-M-yy	m	m	Pass/NA	kg/M3	kg/M3	kg/M3	kg/M3
1	14-Jul-24	0	0	NA	0.000	0.000	0.000	0.000
2	15-Jul-24	0	0	NA	0.000	0.000	0.000	0.000
3	16-Jul-24	0	0	NA	5.000	5.000	0.000	0.000
4	17-Jul-24	0	0	NA	0.000	5.000	0.000	0.000
5	18-Jul-24	0	0	Pass	0.000	5.000	0.000	0.000
6	19-Jul-24	0	0	NA	0.000	5.000	0.000	0.000
7	20-Jul-24	0	0	Pass	0.000	5.000	0.000	0.000
8	21-Jul-24	0	0	Pass	0.000	5.000	0.000	0.000
9	22-Jul-24	0	0	NA	0.000	5.000	0.000	0.000
10	23-Jul-24	0	0	Pass	0.000	5.000	0.000	0.000
11	24-Jul-24	0	0	Pass	0.000	5.000	0.000	0.000
12	25-Jul-24	0	0	Pass	0.000	5.000	0.000	0.000
13	26-Jul-24	0	0	Pass	0.000	5.000	0.000	0.000
14	27-Jul-24	0	0	Pass	0.000	5.000	0.000	0.000
15	28-Jul-24	0	0	Pass	0.000	5.000	0.000	0.000
16	29-Jul-24	0	0	Pass	0.000	5.000	0.000	0.000
17	30-Jul-24	0	0	Pass	0.000	5.000	0.000	0.000
18	31-Jul-24	0	0	Pass	0.000	5.000	0.000	0.000
19	1-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
20	2-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
21	3-Aug-24	0	0	NA	0.000	5.000	0.000	0.000
22	4-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
23	5-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
24	6-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
25	7-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
26	8-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
27	9-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
28	10-Aug-24	0	0	NA	0.000	5.000	0.000	0.000
29	11-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
30	12-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000

31	13-Aug-24	0	0	NA	0.000	5.000	0.000	0.000
32	14-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
33	15-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
34	16-Aug-24	0	0	NA	0.000	5.000	0.000	0.000
35	17-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
36	18-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
37	19-Aug-24	0	0	NA	0.000	5.000	0.000	0.000
38	20-Aug-24	0	0	NA	0.000	5.000	0.000	0.000
39	21-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
40	22-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
41	23-Aug-24	0	0	NA	0.000	5.000	0.000	0.000
42	24-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
43	25-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
44	26-Aug-24	0	0	NA	0.000	5.000	0.000	0.000
45	27-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
46	28-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
47	29-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
48	30-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
49	31-Aug-24	0	0	Pass	0.000	5.000	0.000	0.000
50	1-Sep-24	0	0	Pass	0.000	5.000	0.000	0.000
51	2-Sep-24	0	0	NA	0.000	5.000	0.000	0.000
52	3-Sep-24	0	0	Pass	0.000	5.000	0.000	0.000
53	4-Sep-24	0	0	NA	0.000	5.000	0.000	0.000
54	5-Sep-24	0	0	Pass	0.000	5.000	0.000	0.000
55	6-Sep-24	0	0	Pass	0.000	5.000	0.000	0.000
56	7-Sep-24	0	0	NA	0.000	5.000	0.000	0.000
57	8-Sep-24	0	0	Pass	3.750	4.375	0.444	0.444
58	9-Sep-24	0	0	NA	0.000	4.375	0.000	0.444
59	10-Sep-24	0	0	Pass	0.000	4.375	0.000	0.444
60	11-Sep-24	0	0	NA	3.200	3.983	0.000	0.444
61	12-Sep-24	0	0	NA	0.000	3.983	0.000	0.444
62	13-Sep-24	0	0	Pass	0.000	3.983	0.000	0.444
63	14-Sep-24	0	0	Pass	0.000	3.983	0.000	0.444
64	15-Sep-24	0	0	Pass	2.667	3.654	2.000	1.222
65	16-Sep-24	0	0	NA	0.000	3.654	0.000	1.222

66	17-Sep-24	0	0	Pass	0.000	3.654	0.000	1.222
67	18-Sep-24	0	0	Pass	0.000	3.654	0.000	1.222
68	19-Sep-24	0	0	Pass	0.000	3.654	0.000	1.222
69	20-Sep-24	0	0	Pass	0.000	3.654	0.000	1.222
70	21-Sep-24	0	0	NA	0.000	3.654	0.000	1.222
71	22-Sep-24	0	0	NA	0.000	3.654	0.000	1.222
72	23-Sep-24	0	0	NA	2.000	3.323	0.000	1.222
73	24-Sep-24	0	0	Pass	0.000	3.323	0.000	1.222
74	25-Sep-24	0	0	NA	0.000	3.323	0.000	1.222
75	26-Sep-24	0	0	NA	0.000	3.323	0.000	1.222
76	27-Sep-24	0	0	NA	0.000	3.323	0.000	1.222
77	28-Sep-24	0	0	NA	0.000	3.323	0.000	1.222
78	29-Sep-24	0	0	NA	0.000	3.323	0.000	1.222
79	30-Sep-24	0	0	Pass	0.000	3.323	0.000	1.222
80	1-Oct-24	0	0	NA	0.000	3.323	0.000	1.222
81	2-Oct-24	0	0	NA	0.000	3.323	0.000	1.222
82	3-Oct-24	0	0	NA	0.000	3.323	0.000	1.222
83	4-Oct-24	0	0	NA	0.000	3.323	0.000	1.222
84	5-Oct-24	0	0	NA	0.000	3.323	0.000	1.222
85	6-Oct-24	0	0	NA	2.973	3.265	0.000	1.222

Table 11-2: AZNS-116 Fixation Analysis Table

Dewatering											
Report No.	Date	Depth	Drilled	Total waste-water		Total Dewater		Recycled		Disposed and Lo	
				Daily	Cum.	Daily	Cum.	Daily	Cum.	Daily	Cum.
-	dd-M-yy	m	m	bbl.	bbl.	bbl.	bbl.	bbl.	bbl.	bbl.	bbl.
0	13-Jul-24	0	0	4,000	4,000	0	0	0	0	0	0
1	14-Jul-24	0	0	0	4,000	0	0	0	0	0	0
2	15-Jul-24	0	0	0	4,000	0	0	0	0	0	0
3	16-Jul-24	0	0	0	4,000	250	250	200	200	0	0
4	17-Jul-24	0	0	0	4,000	300	550	200	400	0	0
5	18-Jul-24	0	0	0	4,000	300	850	200	600	0	0
6	19-Jul-24	0	0	0	4,000	0	850	0	600	0	0
7	20-Jul-24	0	0	0	4,000	350	1,200	200	800	0	0
8	21-Jul-24	0	0	0	4,000	0	1,200	200	1,000	0	0
9	22-Jul-24	0	0	0	4,000	350	1,550	150	1,150	0	0
10	23-Jul-24	0	0	50	4,050	0	1,550	100	1,250	0	0
11	24-Jul-24	0	0	100	4,150	0	1,550	100	1,350	0	0
12	25-Jul-24	0	0	200	4,350	400	1,950	150	1,500	50	50
13	26-Jul-24	0	0	0	4,350	0	1,950	150	1,650	0	50
14	27-Jul-24	0	0	0	4,350	0	1,950	100	1,750	0	50
15	28-Jul-24	0	0	100	4,450	0	1,950	100	1,850	0	50

16	29-Jul-24	0	0	50	4,500	0	1,950	0	1,850	0	50
17	30-Jul-24	0	0	100	4,600	0	1,950	50	1,900	0	50
18	31-Jul-24	0	0	0	4,600	400	2,350	0	1,900	0	50
19	1-Aug-24	0	0	0	4,600	0	2,350	100	2,000	0	50
20	2-Aug-24	0	0	100	4,700	0	2,350	100	2,100	0	50
21	3-Aug-24	0	0	50	4,750	0	2,350	100	2,200	0	50
22	4-Aug-24	0	0	150	4,900	0	2,350	100	2,300	0	50
23	5-Aug-24	0	0	150	5,050	350	2,700	0	2,300	50	100
24	6-Aug-24	0	0	0	5,050	0	2,700	100	2,400	0	100
25	7-Aug-24	0	0	100	5,150	0	2,700	200	2,600	0	100
26	8-Aug-24	0	0	150	5,300	0	2,700	0	2,600	0	100
27	9-Aug-24	0	0	200	5,500	400	3,100	300	2,900	0	100
28	10-Aug-24	0	0	200	5,700	0	3,100	100	3,000	0	100
29	11-Aug-24	0	0	200	5,900	400	3,500	0	3,000	0	100
30	12-Aug-24	0	0	100	6,000	0	3,500	150	3,150	0	100
31	13-Aug-24	0	0	200	6,200	400	3,900	250	3,400	0	100
32	14-Aug-24	0	0	50	6,250	0	3,900	150	3,550	0	100
33	15-Aug-24	0	0	0	6,250	0	3,900	0	3,550	0	100
34	16-Aug-24	0	0	200	6,450	400	4,300	250	3,800	0	100
35	17-Aug-24	0	0	200	6,650	0	4,300	150	3,950	0	100
36	18-Aug-24	0	0	100	6,750	0	4,300	0	3,950	0	100
37	19-Aug-24	0	0	100	6,850	0	4,300	150	4,100	0	100
38	20-Aug-24	0	0	100	6,950	0	4,300	100	4,200	0	100
39	21-Aug-24	0	0	100	7,050	400	4,700	0	4,200	0	100
40	22-Aug-24	0	0	100	7,150	0	4,700	100	4,300	0	100
41	23-Aug-24	0	0	150	7,300	0	4,700	150	4,450	0	100
42	24-Aug-24	0	0	50	7,350	400	5,100	150	4,600	0	100
43	25-Aug-24	0	0	100	7,450	0	5,100	100	4,700	0	100
44	26-Aug-24	0	0	100	7,550	0	5,100	150	4,850	0	100
45	27-Aug-24	0	0	50	7,600	0	5,100	150	5,000	0	100
46	28-Aug-24	0	0	200	7,800	400	5,500	100	5,100	0	100
47	29-Aug-24	0	0	150	7,950	0	5,500	150	5,250	0	100
48	30-Aug-24	0	0	200	8,150	400	5,900	150	5,400	0	100
49	31-Aug-24	0	0	150	8,300	0	5,900	150	5,550	0	100
50	1-Sep-24	0	0	200	8,500	0	5,900	100	5,650	0	100
51	2-Sep-24	0	0	100	8,600	400	6,300	150	5,800	0	100
52	3-Sep-24	0	0	50	8,650	0	6,300	100	5,900	0	100
53	4-Sep-24	0	0	100	8,750	0	6,300	100	6,000	0	100
54	5-Sep-24	0	0	300	9,050	0	6,300	200	6,200	0	100
55	6-Sep-24	0	0	100	9,150	400	6,700	100	6,300	0	100
56	7-Sep-24	0	0	100	9,250	0	6,700	300	6,600	0	100
57	8-Sep-24	0	0	100	9,350	400	7,100	400	7,000	0	100
58	9-Sep-24	0	0	100	9,450	400	7,500	400	7,400	0	100
59	10-Sep-24	0	0	100	9,550	400	7,900	400	7,800	0	100
60	11-Sep-24	0	0	50	9,600	0	7,900	0	7,800	0	100

61	12-Sep-24	0	0	50	9,650	400	8,300	250	8,050	0	100
62	13-Sep-24	0	0	100	9,750	0	8,300	150	8,200	0	100
63	14-Sep-24	0	0	100	9,850	400	8,700	200	8,400	0	100
64	15-Sep-24	0	0	100	9,950	400	9,100	300	8,700	0	100
65	16-Sep-24	0	0	200	10,150	0	9,100	300	9,000	0	100
66	17-Sep-24	0	0	200	10,350	400	9,500	0	9,000	0	100
67	18-Sep-24	0	0	200	10,550	0	9,500	0	9,000	0	100
68	19-Sep-24	0	0	200	10,750	0	9,500	0	9,000	0	100
69	20-Sep-24	0	0	200	10,950	300	9,800	300	9,300	0	100
70	21-Sep-24	0	0	20	10,970	300	10,100	300	9,600	0	100
71	22-Sep-24	0	0	20	10,990	400	10,500	400	10,000	0	100
72	23-Sep-24	0	0	400	11,390	0	10,500	0	10,000	0	100
73	24-Sep-24	0	0	20	11,410	300	10,800	300	10,300	0	100
74	25-Sep-24	0	0	100	11,510	0	10,800	0	10,300	0	100
75	26-Sep-24	0	0	100	11,610	0	10,800	0	10,300	0	100
76	27-Sep-24	0	0	100	11,710	400	11,200	400	10,700	0	100
77	28-Sep-24	0	0	100	11,810	0	11,200	0	10,700	0	100
78	29-Sep-24	0	0	100	11,910	0	11,200	0	10,700	0	100
79	30-Sep-24	0	0	100	12,010	0	11,200	0	10,700	0	100
80	1-Oct-24	0	0	100	12,110	0	11,200	0	10,700	0	100
81	2-Oct-24	0	0	200	12,310	0	11,200	0	10,700	0	100
82	3-Oct-24	0	0	0	12,310	0	11,200	0	10,700	0	100
83	4-Oct-24	0	0	0	12,310	0	11,200	0	10,700	0	100
84	5-Oct-24	0	0	0	12,310	0	11,200	0	10,700	0	100
85	6-Oct-24	0	0	0	12,310	0	11,200	0	10,700	0	100

Table 11-3: AZNS-116 Dewatering Recap Table

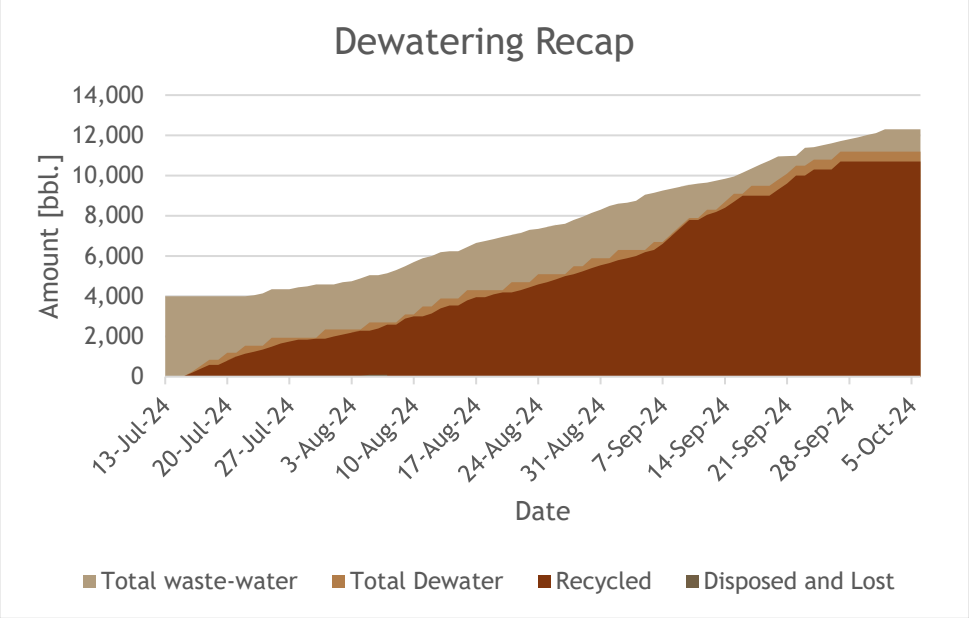


Figure 11-2: AZNS-116 Dewatering Recap

Dewatering Analysis											
Report No.	Date	Depth	Drilled	pH	Hardn.	Turb.	TSS	Nitrate	Al	Sulfate	Ca
				7-9	<800	<50	< 80	< 50	< 3	< 50	< 600
-	dd-M-yy	m	m	-	mg/L	NTU	mg/L	mg/L	mg/L	mg/L	mg/L
0	13-Jul-24	0	0	0	0	0	0	0	0	0	0
1	14-Jul-24	0	0	0	0	0	0	0	0	0	0
2	15-Jul-24	0	0	0	0	0	0	0	0	0	0
3	16-Jul-24	0	0	0	0	0	0	0	0	0	0
4	17-Jul-24	0	0	0	0	0	0	0	0	0	0
5	18-Jul-24	0	0	0	0	0	0	0	0	0	0
6	19-Jul-24	0	0	0	0	0	0	0	0	0	0
7	20-Jul-24	0	0	0	0	0	0	0	0	0	0
8	21-Jul-24	0	0	0	0	0	0	0	0	0	0
9	22-Jul-24	0	0	8	1,280	30	50	15	1	45	1,000
10	23-Jul-24	0	0	0	0	0	0	0	0	0	0
11	24-Jul-24	0	0	0	0	0	0	0	0	0	0
12	25-Jul-24	0	0	8	1,280	30	50	15	1	45	1,000
13	26-Jul-24	0	0	0	0	0	0	0	0	0	0
14	27-Jul-24	0	0	0	0	0	0	0	0	0	0
15	28-Jul-24	0	0	0	0	0	0	0	0	0	0
16	29-Jul-24	0	0	0	0	0	0	0	0	0	0
17	30-Jul-24	0	0	0	0	0	0	0	0	0	0
18	31-Jul-24	0	0	8	1,280	30	48	15	1	45	1,000
19	1-Aug-24	0	0	0	0	0	0	0	0	0	0
20	2-Aug-24	0	0	0	0	0	0	0	0	0	0
21	3-Aug-24	0	0	0	0	0	0	0	0	0	0
22	4-Aug-24	0	0	0	0	0	0	0	0	0	0
23	5-Aug-24	0	0	0	0	0	0	0	0	0	0
24	6-Aug-24	0	0	0	0	0	0	0	0	0	0
25	7-Aug-24	0	0	7	1,200	30	48	0	1	45	1,000
26	8-Aug-24	0	0	0	0	0	0	0	0	0	0
27	9-Aug-24	0	0	8	1,200	30	48	15	1	45	1,000
28	10-Aug-24	0	0	8	1,200	30	48	15	1	45	1,000
29	11-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000
30	12-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000
31	13-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000
32	14-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000
33	15-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000
34	16-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000
35	17-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000

Dewatering Analysis											
Report No.	Date	Depth	Drilled	pH	Hardn.	Turb.	TSS	Nitrate	Al	Sulfate	Ca
				7-9	<800	<50	< 80	< 50	< 3	< 50	< 600
-	dd-M-yy	m	m	-	mg/L	NTU	mg/L	mg/L	mg/L	mg/L	mg/L
0	13-Jul-24	0	0	0	0	0	0	0	0	0	0
1	14-Jul-24	0	0	0	0	0	0	0	0	0	0
2	15-Jul-24	0	0	0	0	0	0	0	0	0	0
3	16-Jul-24	0	0	0	0	0	0	0	0	0	0
4	17-Jul-24	0	0	0	0	0	0	0	0	0	0
5	18-Jul-24	0	0	0	0	0	0	0	0	0	0
6	19-Jul-24	0	0	0	0	0	0	0	0	0	0
7	20-Jul-24	0	0	0	0	0	0	0	0	0	0
8	21-Jul-24	0	0	0	0	0	0	0	0	0	0
9	22-Jul-24	0	0	8	1,280	30	50	15	1	45	1,000
10	23-Jul-24	0	0	0	0	0	0	0	0	0	0
11	24-Jul-24	0	0	0	0	0	0	0	0	0	0
12	25-Jul-24	0	0	8	1,280	30	50	15	1	45	1,000
13	26-Jul-24	0	0	0	0	0	0	0	0	0	0
14	27-Jul-24	0	0	0	0	0	0	0	0	0	0
15	28-Jul-24	0	0	0	0	0	0	0	0	0	0
16	29-Jul-24	0	0	0	0	0	0	0	0	0	0
17	30-Jul-24	0	0	0	0	0	0	0	0	0	0
18	31-Jul-24	0	0	8	1,280	30	48	15	1	45	1,000
19	1-Aug-24	0	0	0	0	0	0	0	0	0	0
20	2-Aug-24	0	0	0	0	0	0	0	0	0	0
21	3-Aug-24	0	0	0	0	0	0	0	0	0	0
22	4-Aug-24	0	0	0	0	0	0	0	0	0	0
23	5-Aug-24	0	0	0	0	0	0	0	0	0	0
24	6-Aug-24	0	0	0	0	0	0	0	0	0	0
25	7-Aug-24	0	0	7	1,200	30	48	0	1	45	1,000
26	8-Aug-24	0	0	0	0	0	0	0	0	0	0
27	9-Aug-24	0	0	8	1,200	30	48	15	1	45	1,000
28	10-Aug-24	0	0	8	1,200	30	48	15	1	45	1,000
29	11-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000
30	12-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000
31	13-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000
32	14-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000
33	15-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000
34	16-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000
35	17-Aug-24	0	0	7	1,200	30	48	15	1	45	1,000

76	27-Sep-24	0	0	7	1,200	45	30	47	1	25	800
77	28-Sep-24	0	0	0	0	0	0	0	0	0	0
78	29-Sep-24	0	0	0	0	0	0	0	0	0	0
79	30-Sep-24	0	0	0	0	0	0	0	0	0	0
80	1-Oct-24	0	0	0	0	0	0	0	0	0	0
81	2-Oct-24	0	0	0	0	0	0	0	0	0	0
82	3-Oct-24	0	0	0	0	0	0	0	0	0	0
83	4-Oct-24	0	0	0	0	0	0	0	0	0	0
84	5-Oct-24	0	0	0	0	0	0	0	0	0	0
85	6-Oct-24	0	0	0	0	0	0	0	0	0	0

Table 11-4: AZNS-116 Dewatering Analysis Table

Chemical																	
No.	Date	Cement		Na_2SiO_3		Coagulant		Polymer		Lime		Soda ash		Citric acid		Caustic soc	
		Daily	Cum.	Daily	Cum.	Daily	Cum.	Daily	Cum.	Daily	Cum.	Daily	Cum.	Daily	Cum.	Daily	Cum
-	dd-M-yy	Kg		Lit.		Kg		Kg		Kg		Kg		Kg		Kg	
1	14-Jul-24	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2	15-Jul-24	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3	16-Jul-24	1,000	1,000	0	0	0	0	0	0	75	75	50	50	0	0	0	0
4	17-Jul-24	0	1,000	0	0	0	0	0	0	100	175	50	100	0	0	0	0
5	18-Jul-24	0	0	0	0	0	0	1	1	75	250	50	150	0	0	0	0
6	19-Jul-24	0	0	0	0	0	0	0	1	0	250	0	150	0	0	0	0
7	20-Jul-24	0	0	0	0	0	0	1	2	75	325	50	200	0	0	0	0
8	21-Jul-24	0	1,000	0	0	0	0	0	2	0	325	0	200	0	0	0	0
9	22-Jul-24	0	1,000	0	0	0	0	2	4	100	425	50	250	0	0	0	0
10	23-Jul-24	0	1,000	0	0	0	0	0	4	0	425	0	250	0	0	0	0
11	24-Jul-24	0	1,000	0	0	0	0	0	4	0	425	0	250	0	0	0	0
12	25-Jul-24	0	1,000	0	0	0	0	1	5	75	500	50	300	0	0	0	0
13	26-Jul-24	0	1,000	0	0	0	0	0	5	0	500	0	300	0	0	0	0
14	27-Jul-24	0	1,000	0	0	0	0	0	5	0	500	0	300	0	0	0	0
15	28-Jul-24	0	1,000	0	0	0	0	0	5	0	500	0	300	0	0	0	0
16	29-Jul-24	0	1,000	0	0	0	0	0	5	0	500	0	300	0	0	0	0
17	30-Jul-24	0	1,000	0	0	0	0	0	5	0	500	0	300	0	0	0	0
18	31-Jul-24	0	1,000	0	0	0	0	1	6	75	575	50	350	0	0	0	0
19	1-Aug-24	0	1,000	0	0	0	0	0	6	0	575	0	350	0	0	0	0
20	2-Aug-24	0	1,000	0	0	0	0	0	6	0	575	0	350	0	0	0	0
21	3-Aug-24	0	1,000	0	0	0	0	0	6	0	575	0	350	0	0	0	0
22	4-Aug-24	0	1,000	0	0	0	0	0	6	0	575	0	350	0	0	0	0
23	5-Aug-24	0	1,000	0	0	25	25	1	7	50	625	50	400	0	0	0	0
24	6-Aug-24	0	1,000	0	0	0	25	0	7	0	625	0	400	0	0	0	0
25	7-Aug-24	0	1,000	0	0	0	25	0	7	0	625	0	400	0	0	0	0
26	8-Aug-24	0	1,000	0	0	0	25	0	7	0	625	0	400	0	0	0	0
27	9-Aug-24	0	1,000	0	0	25	50	1	8	25	650	50	450	0	0	0	0
28	10-Aug-24	0	1,000	0	0	0	50	0	8	0	650	0	450	0	0	0	0
29	11-Aug-24	0	1,000	0	0	25	75	1	9	0	650	50	500	0	0	0	0
30	12-Aug-24	0	1,000	0	0	0	75	0	9	0	650	0	500	0	0	0	0

35	17-Aug-24	0	1,000	0	0	0	125	0	11	0	650	0	600	0	0	0	0
36	18-Aug-24	0	1,000	0	0	0	125	0	11	0	650	0	600	0	0	0	0
37	19-Aug-24	0	1,000	0	0	0	125	0	11	0	650	0	600	0	0	0	0
38	20-Aug-24	0	1,000	0	0	0	125	0	11	0	650	0	600	0	0	0	0
39	21-Aug-24	0	1,000	0	0	25	150	1	12	0	650	50	650	0	0	0	0
40	22-Aug-24	0	1,000	0	0	0	150	0	12	0	650	0	650	0	0	0	0
41	23-Aug-24	0	1,000	0	0	0	150	0	12	0	650	0	650	0	0	0	0
42	24-Aug-24	0	1,000	0	0	25	175	1	13	0	650	50	700	0	0	0	0
43	25-Aug-24	0	1,000	0	0	0	175	0	13	0	650	0	700	0	0	0	0
44	26-Aug-24	0	1,000	0	0	0	175	0	13	0	650	0	700	0	0	0	0
45	27-Aug-24	0	1,000	0	0	0	175	0	13	0	650	0	700	0	0	0	0
46	28-Aug-24	0	1,000	0	0	25	200	1	14	0	650	50	750	0	0	0	0
47	29-Aug-24	0	1,000	0	0	0	200	0	14	0	650	0	750	0	0	0	0
48	30-Aug-24	0	1,000	0	0	25	225	1	15	0	650	50	800	0	0	0	0
49	31-Aug-24	0	1,000	0	0	0	225	0	15	0	650	0	800	0	0	0	0
50	1-Sep-24	0	1,000	0	0	0	225	0	15	0	650	0	800	0	0	0	0
51	2-Sep-24	0	1,000	0	0	25	250	1	16	0	650	50	850	0	0	0	0
52	3-Sep-24	0	1,000	0	0	0	250	0	16	0	650	0	850	0	0	0	0
53	4-Sep-24	0	1,000	0	0	0	250	0	16	0	650	0	850	0	0	0	0
54	5-Sep-24	0	1,000	0	0	0	250	0	16	0	650	0	850	0	0	0	0
55	6-Sep-24	0	1,000	0	0	25	275	1	17	0	650	50	900	0	0	0	0
56	7-Sep-24	0	1,000	0	0	0	275	0	17	0	650	0	900	0	0	0	0
57	8-Sep-24	750	1,750	8	8	25	300	1	18	0	650	50	950	0	0	0	0
58	9-Sep-24	0	1,750	0	8	12	312	1	19	0	650	50	1,000	0	0	0	0
59	10-Sep-24	0	1,750	0	8	13	325	1	20	0	650	50	1,050	0	0	0	0
60	11-Sep-24	800	2,550	9	17	0	325	0	20	0	650	0	1,050	0	0	0	0
61	12-Sep-24	0	2,550	0	17	13	338	1	21	0	650	50	1,100	0	0	0	0
62	13-Sep-24	0	2,550	0	17	0	338	0	21	0	650	0	1,100	0	0	0	0
63	14-Sep-24	0	2,550	0	17	25	363	1	22	0	650	50	1,150	0	0	0	0
64	15-Sep-24	800	3,350	10	27	12	375	1	23	0	650	50	1,200	0	0	0	0
65	16-Sep-24	0	3,350	0	27	0	375	0	23	0	650	0	1,200	0	0	0	0
66	17-Sep-24	0	3,350	0	27	25	400	1	24	0	650	50	1,250	0	0	0	0
67	18-Sep-24	0	3,350	0	27	0	400	0	24	0	650	0	1,250	0	0	0	0
68	19-Sep-24	0	3,350	0	27	0	400	0	24	0	650	0	1,250	0	0	0	0
69	20-Sep-24	0	3,350	0	27	25	425	1	25	0	650	50	1,300	0	0	0	0
70	21-Sep-24	0	3,350	0	27	0	425	0	25	0	650	0	1,300	0	0	0	0
71	22-Sep-24	0	3,350	0	27	25	450	1	26	0	650	50	1,350	0	0	0	0
72	23-Sep-24	400	3,750	30	57	0	450	0	26	0	650	0	1,350	0	0	0	0
73	24-Sep-24	0	3,750	0	57	25	475	1	27	0	650	50	1,400	0	0	0	0
74	25-Sep-24	0	3,750	0	57	0	475	0	27	0	650	0	1,400	0	0	0	0
75	26-Sep-24	0	3,750	0	57	0	475	0	27	0	650	0	1,400	0	0	0	0
76	27-Sep-24	0	3,750	0	57	25	500	1	28	0	650	50	1,450	0	0	0	0
77	28-Sep-24	0	3,750	0	57	0	500	0	28	0	650	0	1,450	0	0	0	0
78	29-Sep-24	0	3,750	0	57	0	500	0	28	0	650	0	1,450	0	0	0	0
79	30-Sep-24	0	3,750	0	57	0	500	0	28	0	650	0	1,450	0	0	0	0
80	1-Oct-24	0	3,750	0	57	0	500	0	28	0	650	0	1,450	0	0	0	0
81	2-Oct-24	0	3,750	0	57	0	500	0	28	0	650	0	1,450	0	0	0	0
82	3-Oct-24	0	3,750	0	57	0	500	0	28	0	650	0	1,450	0	0	0	0
83	4-Oct-24	0	3,750	0	57	0	500	0	28	0	650	0	1,450	0	0	0	0
84	5-Oct-24	0	3,750	0	57	0	500	0	28	0	650	0	1,450	0	0	0	0
85	6-Oct-24	1,100	4,850	20	77	0	500	0	28	0	650	0	1,450	0	0	0	0

Table 11-5: AZNS-116 Chemical Table

12. List of Contractors

Item	Service Item	Contractor
1	Drilling Rig, Mobilization and Demobilization the Rig, Rig Move Between Well Pads	OEOC
2	Drilling Fluids and Completion Fluids	VIRA
3	Waste Management	Pars Haffaran Arvand
4	Electrical Logging and Perforation	PANIZ
5	Mud Logging	MAPSA KISH
6	Directional Drilling (MWD)	VIRA
7	H2S Monitoring and Control	MAPSA KISH BONYAN IMEN
8	Casing and Tubing Running	OEOC
9	Cementing	SPAD ENERGY & Mehran
10	Dry Test, DST and RTTS	OEOC
11	Slick Line	OEOC
12	Stimulation (Coiled Tubing and Acidizing and Nitrogen Lifting)	OEOC
13	Surface Well Testing	OEOC
14	Liner Hanger	PARS POOLAD
15	Well Head	OEOC

Table 12-1: AZNS-116 Contractors Involved

13. Appendix

13.1 DDR Summary

Item	Date	Remark
1	08 – June	'RIG SPUD @ 08-06-2024 (1403-03-18) & 18:00 O'CLOCK. LINE UP & CONNECTED PUMP TRUCK LINE TO WELLHEAD & ANN, CHOCKMANIFOLD FOR TEST All EQUIP & WELLHEAD VALVE @ SEVERAL TIMS's, No SUCC. OBS LEAKAGE FROM RING GASKET BX-152 - 2-1/16" FLANGE ANN. CHANGE IT @ TRY TO TEST AGAIN NO. SUCC @ M.N.
2	09 – June	Work On WellHead & Check All Press & Equipment , Retrieve TWCV . Perform H2S Drill. Run Slikline @ several time (3.5 Gage Cutter to 66m SSD Depth, Run & set protection Sleeve, 2.5 Gage Cutter to 554 took Weight, Run Bailer 2.25" To 554m, 2.5 Gage Cutter to 3186m took Weight, Run Bailer 2.25" To 3186m, Jar down , cont RIH to 3600m @ M.N.
3	10 – June	Run Slickline Sample Bailer 2.2" To 3600m Took Weight, Try To Pass This Point @ Several Time's , No Succ, POOH To Surf , P/U & M/U New 5-1/2" STDs, while Disp. The Well w/ Drill Water, Monitor the Well, Static, prepare to Kill the Well.
4	11 – June	'Kill the Well w/ 106pcf Mud, CBU till balance the In/Out Mud Wt. , Spot Hi-Vis Pill, Monitor the Well, if Ok, R/U Slick Line and RIH to Retrieve Protection Sleeve, secure the Well by closing the 3SV, Prepare to N/U BOP.
5	12 – June	'Change Blind/Shear Rams, attempt to Press. Test on same, all Ok, P/U & M/U assets to prepare to open 3SV and set Protection Sleeve, shear/ blind rams got operated, fix the problem and P/U & M/U assets again, R/U Slick Line Tools
6	13 – June	'Set Protection Sleeve in 3SV, POOH to surface & RIH w/ bailer, POOH to surface, CBU till uniform the Mud, Release the Comp. Strg from Anchor Seal, POOH Comp. Strg @ R.T.

		is in progress.
7	14 – June	'Cont. POOH 4 1/2" TBG f/ 3851 to 2601m, while open Cross Coupling Protector using Air Wrench and Winding 3/4" CILs on the Spools, Circ. CWH, w/ NL-NG.
8	15 – June	'Cont. POOH 4 1/2" TBG f/ 26011 to 1265m, while open Cross Coupling Protector using Air Wrench and Winding 3/4" CILs on the Spools, Circ. CWH, w/ NL-NG.
9	16 – June	'Cont. POOH 4 1/2" & 3-1/2" TBG f/ 1265 to 273m, while open Cross Coupling Protector using Air Wrench and Winding 3/8" CILs on the Spools, Circ. CWH, w/ NL-NG.
10	17 – June	Cont. POOH 3-1/2" TBG to 153, Obs. Comp. Strg got parted, R/D Casing Running Eqp. & Prepare for RIH w/ 8-3/8" Milling BHA, remove stuck 3/8" CILs , then Set 11" Wear Bushing & RIH w/ 8-3/8" Milling BHA to 844m
11	18 – June	Cont. RIH w/ 8-3/8" Milling BHA f/ 1502 to 3353m, while perform Break Circ. after running every 10Stds/15Jts , w/ NL-NG.
12	19 – June	'Cont. RIH w/ 8-3/8" Milling BHA f/ 3353 to 3658m, Start Milling the Fish f/ 3658 to 3703m, while Pump 100bbl Hi-Vis Pill in two steps and perform CBU till getting Hi-Vis Pill on Sh.Shakers, Work on Junk Sub is in progress @ M.N.
13	20 – June	'Cont. Work on Junk Sub, POOH 8-3/8" Milling BHA f/ 3703m to surface, P/U & M/U 7-7/8" Fishing BHA and RIH to 2020m
14	21 – June	Cont. RIH w/ 7-7/8" Fishing BHA, work on Fish and catch about 6/6m of Comp. Strg, POOH to surface P/U & M/U 7-7/8" Fishing BHA and RIH to 554m
15	22 – June	Cont. RIH w/ 7-7/8" Fishing BHA, try to Engage w/ Fish Sev. Times, No Succ, POOH 7-7/8" Fishing BHA to 842m.
16	23 – June	POOH 7-7/8" Fishing BHA f/ 842m to surface, check the Overshot and Obs. Some Coiled 3/8" CIL in Basket Grapple,

		P/U & M/U 8-3/8" Milling BHA & RIH w/ same to TOF, work on junk subs, Start Milling f/ 3709 to 3711m, Pump 50bbl Hi-Vis Pill, CBU is in progress.
17	24 – June	'Cont. CBU, POOH 8-3/8" Milling BHA to Surface, P/U & M/U 7-7/8" Fishing BHA & RIH the same to 1677m, while Circ. C.W.H, w/ NL-NG.
18	25 – June	'Cont. RIH w/ 7-7/8" Fishing BHA to TOF and Engage w/ Fish. POOH 7-7/8" Fishing BHA to surface, No part of Comp. Strg got recovered, P/U and M/U 5-5/8" Fishing BHA dressed w/ 3-3/8" Ass. and RIH w/ same to 1240m.
19	26 – June	'Cont. RIH w/ 5-5/8" Fishing BHA to TOF and Engage w/ Fish. POOH 5-5/8" Fishing BHA to 410m.
20	27 – June	POOH 5-5/8" Fishing BHA to Surf, No Recover Any Part of fish in the well, L/D O.Shot, Change B.G & M.C f/ 3-3/8" to 3-1/2", RIH W/ 5-5/8" O.Shot & Same BHA To 1700m, Waiting For OEOC Rig 201 Due to Change TDS Saver sub, Cont. RIH W/5-5/8" O.Shot BHA & Follow By 5" DP To 3711.3m (TOF). Try To engage & Catch The Fish. Several Times by Different Parameters. POOH For Checking 5-5/8" O.Shot to 2420m while Circ. Cross wellhead, NL-NG.
21	28 – June	Cont. POOH For Checking 5-5/8" O.Shot to Surf. OBS. Not Catching The Fish, L/D O.Shot , 3Hrs Waiting For OEOC Rig 201 due To Delay in Operation, Test BOP Stack , Ok. M/U & RIH W/ 8-3/8"New M.M.J.Mill + 6 15/16" JUNK SUB +D.PIN + 6 5/8" JUNK SUB +BIT SUB + 10jts 6-1/2" DC + 6 Jts 5" HWDP & Follow By 5"DP To To 600m. 1 Hr Waiting For OEOC Rig 201 due To Work On Drawworks. POOH As Change Program To Surface. RIH W/7-7/8" O.Shot Included(3-1/2" M.C.+ 3-1/2"B.G) + Ext.Jt + Same BHA to 400 m.
22	29 – June	RIH W/7-7/8" O.Shot Included(3-1/2" M.C.+ 3-1/2"B.G) + Ext.Jt + Same BHA To TOF. Obs. Holding up Strg Wt. & TOF got confirmed w/ appling some Wt. , pass & guide Fish Neck inside Overshot guide in the range of 223cm From Confirmed TOF, due to high corrosion and decay of Comp.

		Strg, No Succ. No signs of Engagement with Fish were observed. POOH to Surf & L/D 7-7/8" O.Shot . RIH W/ 8-3/8" New M.M.J.Mill(5*24/32 Port) + 6 15 / 16" JUNK SUB +D.PIN + 6 5/8" JUNK SUB +BIT SUB To 294 m.
23	30 – June	Cont RIH W/ 8-3/8" New M.M.J.Mil+ 6 15 / 16" JUNK SUB +D.PIN + 6 5/8" JUNK SUB & Same BHA By 5"DP F/294m To 3711/95m (TOF) While Fill Up STRG Every 15 STD. Start Milling the Fish f/ 3711.95 to 3713.7m w/ Parameters [WOB: 2-15klb, Rot.: 15-60RPM,TQ: 2-5klbft,F.R: 150-250gpm,SPP: 200-500psi) Cont. Milling & Dress F/3713.7 To 3714m W/Low Parameters while pump 50bbl Hi-Vis, W/ NL-NG, Pump 50bbl Hi-Vis Pill, CBU till getting Hi-Vis Pill on Sh.Shakers, Work on Junk Sub @ Several Times. POOH To 3100m While Circ. Cross Well Head.
24	01 – July	Cont POOH F/3100 To To Surface.L/D 8-3/8" M.M.J.Mill (40%) & 2No. J.Sub. Recover 2.4lb Junk , M/U & RIH W/5-5/8" O.Shot W/7" Over Size Guide, Included:(3-1/2" M.C + 3-1/2"B.G) +Extension Jt & SAME BHA To 1000m, Cut & Slip 102Ft Drilling Line. Cont. RIH W/5-5/8" O.Shot W/7" Over Size Guide To 3250m. While Circ. Well Head NL-NG.
25	02 – July	'Cont. RIH W/5-5/8" O.Shot W/7" Over Size Guide TO 3714m (TOF) . Try To Catch The Fish, Ok. Attempt for Release The Fish From A.Seal with Rotation Due To Hi Corrosion of Comp STRG, Released The Fish, Try To Catch The Fish, Succ. Work On Release The Fish . Release The Fish With Over Pull & Movment UpWard STRG 44m . POOH W/O.Shot To Surface, No Obs. The Fish. L/D it. M/U & RIH W/5-5/8" O.Shot W/7" Over Size Guide + Extension Jt + top Sub + X.O.S 3-1/2" * 4-1/2" IF + 1 Jt 6-1/2" DC TO 11m @ M.N.
26	03 – July	'RIH W/5-5/8" O.Shot W/7" Over Size Guide + Ext Jt + Top Sub + X.O.S + 1 Jt 6-1/2" DC + 2 STD 5" HWDP & Follow By 5" DP To 3669.66m While Circ. Well Head. Engage The Fish , POOH W/ Max.400klb Weight in Driller Indicator, Work on Fish W/ downward & upward Several times, Pull Out 10m of Fish Step by Step & Movement The Fish from 7"

		liner to 9-5/8" Casing, Obs. Drop Overpull, Check String weight(4klb over) POOH one Stand W/drag, Cont. POOH to 300 m., while check string weight & Circ. Well Head NL-NG.
27	04 – July	'Cont. POOH to Surface, Obs. Recover Fish : 3 Jts 3-1/2" tubing + CIV #1 + CIL + 1 Jt P.J 3-1/2" Tubing + 1 Jt 3-1/2" Tubing + 1 Jt P.J 3-1/2" Tubing + CIV #2+ 1 Jt P.J 3-1/2" Tubing + 5 Jts3-1/2" Tubing + 1 Jt P.J 3-1/2" Tubing + 1 Jt Traveling Jt + 1 Jt P.J 3-1/2" Tubing + 1 Jt 3-1/2" Tubing + 1 Jt P.J 3-1/2" Tubing + SSD +1 Jt P.J 3-1/2" Tubing + 1 Jt 3-1/2" Tubing + 1 Jt P.J 3-1/2" Tubing + Ancher Seal while Obs. Plug String Below Each Conn. CIV#2 & & Detect 100% LEL , Try To Circ. In String No Succ Circ. Cross Well Head W/NL-NG. M/U & RIH W/8-3/8" M.M.J.Mill + J.Sub#1 + D.Pin + J.Sub#2 + J.Sub#3 + D.Pin + J.Sub#4 + B.Sub Inclued F.Valve + 7 Jts 6-1/2" DC + 6 Jts 5" HWDP & Follow By 5" Dp To 1650 m While F/Up String W/ NL-NG Till M.N.
28	05 – July	RIH W/8-3/8" M.M.J.Mill & 4 No. Junk Backet to T/ 3571m, Took Weight, Cont. RIH W/ Rot. & pumping T/ 3594m , Cont. RIH T/ 3771m Apply W/max. 20klb for Checking String, No drop Weight, , Cont. RIH T/ 3780m (WOB: 2-10klb, RPM: 40rpm, TQ: 1-4klb.ft, F.Rate: 140gpm, Press.: 240psi), While Check String Every 5 meters Cont. RIH T/ 3786 (WOB: 1-4klb, RPM: 40rpm, TQ: 1-4klb.ft, F.Rate: 140gpm, Press.: 240psi), Cont. RIH T/3790 W/Normal trip, Cont. RIH W/Hard Milling T/3793m, Cont. RIH T/3802.7 W/Normal trip, String Took weight @3802.7, Pump mud w/Hi rate for Cleaning, Work on j.sub Several times, Check & Confirm 7"L.L@3802.7, Pump hi.vis pill, Cont. Pump mud till shaker out the pill, Work on j.sub , w/NL-NG, POOH to 2040 m While Circ. Cross Well Head w/NL-NG.
29	06 – July	Cont. POOH W/8-3/8" M.M.J.Mill to Surface, Recover 10Ib. Junk f/J.subs, 2 Hrs Waiting For OEOC Rig 201 Due To Delay In Operation, M/U & RIH W/ New 6" M.M.J.Mill & 2 No. J.sub + B.sub + 6 stand 4-3/4"DC (jt by jt)+ 2 stand 3-1/2" DP & Follow by 5" DP to 250m, POOH To 58m, M/U X.O.S 3-1/2" IF pin* 4-1/2" IF box + D.Pin +2 No. 5-5/8" J.Sub & Follow by 5" DP to 1350m, 1 Hr Waiting For OEOC Rig 201

		Due To Work On Mud Pump. Cont RIH to 2350 m, 1 Hrs Waiting For OEOC Rig 201 Due To Delay In RIH Operation.
30	07 – July	Cont RIH W/ New 6" M.M.J.Mill + 2 No. 4-3/4" J.sub(above The Mill) & 2 No. 5-5/8" J.Sub(@58m) on BHA & Follow by 5" DP To 3802.7m (7" LNR LAP) Took weight, Cont. RIH To 3808m W/Soft W&R, Cont. RIH W/Normal trip to 3831m,(Apply Max. 1klb weight @ 3831m, Confirmed TOF by Client), Pump Hi Vis Pill, Pump Mud Till Shaker out The Pill, Work on junk sub Several Times, POOH To 1029m While Circ. Cross Well Head W/NL-NG. 2 Hrs Waiting For OEOC Rig 201 Due To Delay In POOH Operation, Till M.N.
31	08 – July	Cont POOH F/1029m To Surf. W/6" M.M.J.Mill & Recover 8Ib. Junk f/J.subs. M/U & RIH W/ 5 1/4" O.Shot, Included: W.Hook Guide + Bowl (1-1/2" M.C NEW + 1-1/2" B.G NEW) + Ext.Jt + T.Sub + 1 Jts 4 3/4" DC + 5 STD 3 1/2" D.P T/3830m, Cont. RIH T/3833.4m obs. Inc. prees. Pull out string obs. W/Max. 10klb @ 3833.4m Cont. POOH W/Normal trip to 3830m, RIH To 3835m W/RPM:15-20,F.rate: 150gpm,Press.:80psi, Pull out for checking, obs. Overpull , (Max.400klb weight in indicator), RIH To neutral point Apply Rot. & F.rate: 320gpm, Press :250psi, POOH to 3800m(2m above 7"L.L)W/GPM: 500gpm, Press.: 1700-1800psi)RIH to 3837m W/WOB:0-5Klb, Rot.: 20rpm, TQ: 0-4klb.ft, F.Rate: 220gpm, Press.: 850psi, Obs. Inc. Pressure, Cont. RIH To 3838.4m, Work On Fish, POOH To 3800m(2m Above 7" L.L) Flow Check, Static. POOH For Checking to 3450m W/NL-NG. Till M.N
32	09 – July	POOH to Surf, Recover Tot.: 8.1m of the Fish(1-1/2" CTU). P/U & Assemble Same 5-1/4" Overshat Included : Wallhook Guide + Bowl(1-1/2 M.C & B.G)+ E.J+ Top sub + 1 jts 4-3/4" DC + 5 jts 3-1/2" DP To 61m, Change Elevator, Cont. RIH W/X.O.S 3-1/2" IF Pin * 4-1/2" IF Box + D.P 4-1/2" IF + 2 No. 5-5/8" J.Subs to 63m. Cont. RIH W/ 5-1/4" Over Shot & Same BHA & Follow By 5" DP To 1480m . Cut & Slip Drilling Line, Cont. RIH To 3420m While Circ. F/Cross well Head W/NL-NG @ M.N.

33	10 – July	Cont. RIH W/ 5-1/4" Over Shot & Same BHA & Follow By 5" DP To 3836m. Pump 50 BBL HI-Vis Pill To Clean The Hole & Work On Junk Sub @ Several times. Cont RIH To 3844.6m OBS. INC Press. Cont RIH To 3846.5m W/ Pump Off & No RPM, POOH For Check String To 3824m W/ Over Pull (Min: 10 Klb To Max : 110 Klb), Cont POOH W/ Normal Trip To 3800m(2m Above 7" L.L). Apply Pumping, Obs. In. Sharp Press. POOH To 3752m While Obs. String Full Of Mud. Cont POOH For Checking Fishing To Surface, Recoverd 3m Of Fish(1-1/2" CTU) + 4.5Ib Junk f/J.Subs. P/U & Assemble Same 5-1/4" Overshat BHA to 216m.
34	11 – July	Cont. RIH W/ 5-1/4" Fishing BHA to 3845m, Pump 40bbl Hi-Vis Pill & CBU, Work on Junk Sub Sev. times, try to Engage w/ Fish, POOH 5-1/4" Fishing BHA f/ 3845 to 1080m, while Circ. C.W.H, w/ NL-NG.
35	12 – July	Cont. POOH f/ 1080m to surface while Circ. C.W.H, w/ NL-NG, B/O & L/D Overshot, No part of fish was recovered, P/U & M/U Milling BHA and RIH to 3845.3m, Obs. Holding up Strg Wt. then start Milling Op. f/ 3845.3 to 3845.55m.
36	13 – July	start Milling Op. f/ 3845.3 to 3846.1m, then push the Fish f/ 3846.1 to 3876.1m, resume Milling Op. f/ 3876.1 to 3876.15m, Try ot Cont. Milling Op. , Obs. No Progress
37	14 – July	Try to Cont. Milling Op. @ 3876.15m , Obs. No Progress, decided to POOH 6" Milling BHA, POOH Op. stopped due to windy weather, Resume POOH Op. and B/O & L/D 6" Mill and rest of BHA
38	15 – July	P/U & M/U 5-7/8" Milling BHA and RIH to Cont. Milling f/ 3875.94 to 3878.20m, Obs. Applied WOB on Fish fully gave way & applied TQ got back to off bottom Tq, Cont. RIH Wash Dn to 3919.58m, Confirm TOF, Pump 40bbl Hi-Vis Pill and CBU
39	16 – July	ont. CBU, work on junk sub, POOH 5-7/8" Milling BHA to surface, L/D 6" Mill & rest of BHA, clean junk subs, 7.5lb debris got recovered, P/U & M/U Fishing BHA & RIH to

		1340m.
40	17 – July	Cont. RIH w/ 4" Fishing BHA f/ 1340 to 3888m, Try to Cont. RIH w/ Wahs Dn, Obs. SPP got pressured up, POOH to top of 7" LNR and Work on Strg, SPP got back to normal pressure, Cont. RIH w/ same BHA to TOF and Start to Engage w/ Fish, at frist time Obs. Overpull, during POOH, WOH got back to normal weight, RIH back and push the fish to 3926m and try to Engage w/ Fish two times, POOH 4" Fishing BHA f/ 3926.6 to 1597m.
41	18 – July	Cont. POOH f/ 1597 to surface, L/D 4" Taper tap & rest of BHA, about 15cm of length of 4" Taper Tap was broken & remained in the well, P/U & M/U 5-7/8" Milling BHA and RIH to 407m, perform slip & Cut, due to windy weather RIH Op. got stopped, resume RIH w/ 5-7/8" Milling BHA f/ 407 to 3200m, while Circ. C.W.H, w/ NL-NG.
42	19 – July	Cont. RIH w/ 5-7/8" Milling BHA f/ 3200 to 3926m, while Circ. C.W.H and Wash Dn last 3 Stds, w/ NL-NG, Start Milling Op. w/ 5-7/8" Milling BHA @ 3926m, Obs. No progress, Stop Op. due to Hoisting Sys. Failure, resume Milling Op. w/ 5-7/8" Milling BHA @ 3926m w/ applying different parameters, Obs. No Progress, POOH 5-7/8" Milling BHA f/ 3926 to 3535m.
43	20 – July	Cont. POOH 5-7/8" Milling BHA f/ 3535m to surface, L/D 5-7/8" Mill & rest of BHA, recover 4/5lb debris & junks, P/U & M/U 4" Fishing BHA and RIH to 3000m.
44	21 – July	Cont. RIH w/ 4" Fishing BHA, perform Break Circ. On TOF, work on Fish & try to Catch the same, POOH w/ same BHA to surface, Obs. No part of Fish was revovered & 15cm of length of Taper Tap was broken & left in the well, Perform H2S Drill and got ready to perform BOP Test As NIOC Policy.
45	22 – July	P/U & M/U 6" Milling BHA & RIH w/ same to TOF to perform Milling Op. on TOF, Perform Milling Op. f/ 3926.6

		to 3926.65m, try to Cont. Milling Op. w/ different parameters, No Success, Push the Fish f/ 3926.65 to 3931.6m, and Try to Cont. Milling Op. at 3931.6m, Obs. No Progress.
46	23 – July	try to Cont. Milling @ 3931.6m Op. w/ different parameters, No Success, Push the Fish f/ 3931.6 to 3932.6m, and Try to Cont. Milling Op. at 3932.6m, Obs. No Progress, POOH 6" Milling BHA f/ 3932.6 to 1670m.
47	24 – July	Cont. POOH 6" Milling BHA to surface, P/U & M/U 2"× 4" Fishing BHA to 3802m, Conn. TDS & RIH w/ same BHA f/ 3802 to 3930m, Record Up & Dnward Strg Wt. & Perform Break Circ. On TOF, Work on Fish w/ 2" × 4" Taper Tap is progress.
48	25 – July	Work on Fish w/ 2" * 4" Taper Tap Sev. Times to engage w/ Fish, No Succ. POOH 2" × 4" Fishing BAH f/ 3932.6 to Surface, L/D Taper Tap, Without Obs. Effect Of Engage , while Circ. C.W.H. M/U & RIH W/5-3/4" Impression Block + X.O.S 3-1/2" Reg pin * If Box + 2 STDs 4-3/4" DC + 4 STDs 3-1/2" DP + X.O.S & Follow By 5" DP to 2700m While F/U String W/NL-NG Till M.N.
49	26 – July	Cont RIH W/5-3/4" Impression Block To 3932m (TOF), Work On Fish W/ Impression Block, RIH To TOF Took Weight W/Max 1 Klbs, (Confirm TOF), Circ Mud 'For Cleaning TOF, Apply Max 15Klbs Weight On Impression Block & Jerk Down W/ 'Max 15Klbs, 2 Steps. POOH W/5-3/4" Impression Block to Surface. Obs. Marks On the IB. M/U & RIH W/5-7/8" M.M.J.Mill(5*15/32", T.S.E.KH, S/N: 621)+ B.Sub + 7 STDs 4-3/4" DC + 1 STDs 3-1/2" DP + X.O.S & Follow By 5" DP To 1200m While F/U string.
50	27 – July	2 hrs waiting for OEOC RIG 201 Due to delay in RIH Operation. Cont. RIH W/5-7/8" M.M.J.Mill BHA & Follow by 5" DP to 3802.7m(7"L.L) While F/U String. Cont. RIH W/Wash Down to 3932.6m (TOF) W/NL-NG. Start Milling The Fish F/ 3932/6m to 3933m (Milling Parameters : WOB: 20-25 KLBs, RPM: 60-70, F.Rate: 140-170 GPM, Torq: 3-5 Klb.ft, SPP: 600 Psi)

51	28 – July	Cont Milling W/5-7/8" M.M.J.Mill The Fish F/ 3933m to 3933.3m, Pump Hi Vis Pill, Pump Mud To Clean The Shakers. POOH To 3300m, Slip & Cut 112Ft Drilling Line. 1 HRS waiting for OEOC RIG 201 Due to Delay in Operation, While Cont. POOH To 2290 m While Circ. F/Cross Wellhead W/NL-NG.
52	29 – July	Cont. POOH F/ 2290 m To Surface, L/D 5-7/8" M.M.J.Mill , M/U & RIH W/Taper Tap 2" * 4" Catch Size (Cylindersazi, 3*16/32" port, S/N:CS6668) + B.sub + 1 jt 4-3/4" DC + 4-3/4" Fishing Jar + '6 STD 4-3/4" DC + 1 Jt 3-1/2" HWDP+ X.O.S & Follow by 5" DP to 3802.7"m(7" L.L). Cont. RIH W/Wash Down To 3933.3m (TOF). Record String Weight W/Downward & Upward W/Pump Off & Diff. F.rate, Catch The Fish W/Taper Tap 2" * 4", Pull Out String W/Max. 40klb Weight,Obs. Release The Fish F/Taper Tap @ several Times Till M.N.
53	30 – July	Catch The Fish W/Taper Tap 2" * 4" . Try To Pull Out String, Obs. Max.120klb Overpull on Indicator, Work On The Fish W/Downward & Upward & Firing Fishing Jar Several times, Release the Fish F/Taper tap while Work on it & Re-Catching Several Step's, Succ. in Movement Fish, Pull out String W/max. 130klb Overpull To 3875m. Cont. POOH W/max.Drag 20-40klb to 3802.7(7" L.L), Cont. POOH to 820m While Circ. F/Cross Well head, NL-NG
54	31 – July	Cont POOH W/Taper Tap 2" * 4" to Surf, No. Observe Recover Any Fish. L/D It. M/U & RIH W/Taper Tap 2" * 4" Catch Size(Cylindersazi) + Same BHA & Follow By 5" DP To 2772 m While F/U String NL-NG Till M.N.
55	01 – August	Cont. RIH W/Taper Tap 2" * 4" + Same BHA & Follow by 5" DP to 3802.7"m(7" L.L). Cont. RIH W/Wash Down To 3925.2m, Took Weight. Record String Weight W/Pump Off & Diff. F.Rate, Catch The Fish & Work on It. Release Fish While Pull Out (10m) 'W/Max.50klb Overpull & Re-Catching Several Step's, Finally Decided To POOH In Order To Check The String. POOH To 97m While Circ. F/Cross Well Head NL-NG Till M.N.

56	02 – August	Cont. POOH W/Taper Tap 2" * 4" To Surf, No. Observe Recover Any Fish. RIH W/6" M.M.J.Mill (T.S.E.KH)+ B.Sub + 7 STDs 4-3/4" DC + 1 STDs 3-1/2" DP + X.O.S & Follow By 5" DP To 1660m. Stop Operation Due to Force Majeure As Request OEOC Rig 201 HSE Officer Because Of Strong Wind. Max. 58 km/h. Cont. RIH W/ 6" M.M.J.Mill (T.S.E.KH)+ B.Sub + 7 STDs 4-3/4" DC 1 STDs 3-1/2" DP + X.O.S & Follow By 5" DP To 3230 m While F/U String W/NL-NG.
57	03 – August	Cont. RIH W/ 6" M.M.J.Mill (T.S.E.KH)+ B.Sub + 7 STDs 4-3/4" DC + 1 STDs 3-1/2" DP + X.O.S & Follow By 5" DP To 3933/44 m Took Weight While F/U String W/NL-NG Start Milling & Pushing F/ 3933/44 m to 3938/35m (With Parameter : WOB: 15-25 Klb, Torq : 5-7 Klb.ft, F.rate : 110-200 GPM, SPP: 400-1200 Psi)
58	04 – August	Cont Milling & Pushing F/ 3938.35m T/ 3940.3 m (Totally : 6.86m)(With Parameter : WOB: 15-25 Klb, Torq : 3-7 Klb.ft, F.rate : 110-200 GPM, SPP: 400-1200 Psi) While Pump Hi-Vis Peridically, Try To Cont Milling & Pushing W/ 6" Milling BHA F/ 3940.3 m While Applying Different Parameters, No Progress @ Several Times, No. Succ.
59	05 – August	Pump Hi Vis Pill, Pump Mud To Clean The Shakers. POOH W/ 6" M.M.J.Mill to Surface, Obs. 70% Used, L/D It.M/U & RIH W/Assembly 5-5/8" O. Shot GJ-TY Type Included: Guide+Bowel(Loaded W/ 3-1/2"M.C & 3-1/2" B.G)+Top Sub + 2 STDs 4-3/4 DC + 11 Jts 3-1/2" DP + X.O.S + 1jt 5" DP + 6-1/2" Fishing .Jar & Follow by 5" DP to 2636m NL-NG
60	06 – August	Cont. RIH w/ Assembly 5-5/8"O.Shot BHA to 3940.68m (Confirm Top Fish), Pump 30 BBL HI.Vis Pill & Break Circ. to Cleanning The Top of Fish, Record String Weight w/ Pump off & Diff. F.Rate, Catch The Fish w/ 5-5/8"O.Shot, Try to Pull Out String w/ Max. 150klb Overpull on Indicator With 5.20m Movement Fish, Work on the Fish ,Several Times, Cont. Work on Fish w/ Max. 180 Klb Overpull, Obs. Drop Overpull Suddenly. POOH For Check String to Surf., L/D Overshot, Obs. Recover 38cm of Fish Neck f/ Inside Overshot,

		Work on Release Fish in Progress, While Circ. Cross Wellhead, w/ N.L-N.G, Till M.N.
61	07 – August	Release the Fish f/ O.Shot, RIH 5-5/8"O.Shot (w/ 3-1/2"M.C & 3-1/2"B.G) to 310m, Slip & Cut DRLG Line, Cont. RIH to 3930m, Break Circ. Mud, Pump Hi-Vis Pill, RIH & Catch the Fish @ 3939.3m, Try to Pull Out String w/ Max. 100klb Over Pull in Several Times, No Success, w/ N.L-N.G, Till M.N.
62	08 – August	Cont. Work on the Fish & Try to Pull Out String Upward & Downward w/ Apply Torque in Several Times, Obs. Got Free Pipes, POOH to Check String f/ 2939/3 to 2430m, While Circ. Cross Wellhead, w/ N.L-N.G, Till M.N.
63	09 – August	Cont. POOH 5-5/8"Fishing BHA to surface, Obs. Fish Got Recovered, Release Fish f/ 5-5/8"Overshot, Perform BOP Stack Test, RIH w/ 6"J.Mill to 1050m, w/ N.L-N.G, Till M.N.
64	10 – August	Cont. RIH w/ 6"J.Mill to 3930m, W&R to 3951.5m, Took Weight, Start Milling to 3951.75m, C.B.U, POOH to 3078m, w/ N.L-N.G, Till M.N.
65	11 – August	As per Client Instruction, Cont. POOH f/ 900m to Surf., L/D 6"J.Mill (15%Used, Obs. 5-2/16"-6"Ring Out), RIH w/ 5-3/4"Taper Mill to 1673m, w/ N.L-N.G, Till M.N.
66	12 – August	RIH w/ 5-3/4"Taper Mill to 3951.75m, Took Weight, Perform Milling Operation to Take Mark on Taper Mill, C.B.U, POOH f/ 3951.75 to 532m, While Circ. Cross Well Head, w/ N.L-N.G, Till M.N.
67	13 – August	POOH 5-3/4" Clean out BHA to surface, While Circ. C.W.H, w/ N.L-N.G, Obs. Mark on 5-3/4" Taper tap, P/U & M/U 3-1/2" Clean out BHA and RIH to 2407, Obs. Strg is plugged, work on it, make it unplugged, Resume RIH w/ 3-1/2" BHA to 2552m, again Obs. Strg is plugged, work on it is in progress @ M.N.
68	14 – August	Cont. work on plugged Strg and make it unplugged, Resume RIH w/ 3-1/2" BHA to 3580m, Meanwhile Pump 150bbl Fresh Mud, attempt to Break Circ. , Obs. Strg is plugged, work

		on plugged Strg and make it unplugged, Resume RIH w/ 3-1/2" Wash Dn to 3951.75m, Try to pass Obstruction, No Success, POOH 3-1/2" Clean out BHA f/ 3951.75 to 2432m till M.N.
69	15 – August	Cont. POOH 3-1/2" Clean out BHA to surface, Prepare to RIH w/ 9-5/8"× 7" Tandem Scrapping BHA to 3605m.
70	16 – August	Cont. Work on Strg to make it unplugged several times, No Success, POOH 9-5/8"× 7" Tandem Scrapping BHA to surface, Obs. Debris resulting of performing Scrapping Operation in both 6" Mill & 4-3/4" Bit Sub, Slip & Cut Drlg Line
71	17 – August	P/U & M/U 9-5/8"× 7" Tandem Scrapping BHA and RIH to 3900m, Perform Scrapping Operation, CBU, POOH 9-5/8"× 7" Tandem Scrapping BHA to 1830m.
72	18 – August	Cont. POOH 9-5/8"× 7" Tandem Scrapping BHA to surface, Perform Logging Op. as Run#1: CBIL-CDR-GR-CCL for 7" LNR f/ 3944 to 3797m (5m above 7" L.Lap) and Run#2: CBIL-CDR-GR-CCL for 9-5/8" CSG f/ 3802 to 1500m @ M.N.
73	19 – August	Cont. Log Up w/ Wire Line Tools as Run#2: CBIL-CDR-GR-CCL for 9-5/8" CSG f/ 1500m to surface, while Log Up f/ 260 to 160m as Repeat section, R/D Logging Eqp. , P/U & M/U 6" Clean out BHA and RIH to 3840m
74	20 – August	Cont. RIH w/ 6" Milling BHA to 3840 to 3960.8m w/ applying Parameter as Miliing & Cleaning Operation, while periodically check Strg Every 0/5m to make sure Strg is free, Pump Hi-Vis, check the Ditch Magnet and Sh.Shakers, Obs. LCM, Magneset and Debris on Shale Shakers sometimes during Milling & Cleaning, w/ NL-NG.
75	21 – August	Cont. RIH w/ 6" Milling BHA to 3960.8 to 3965m w/ applying Parameter as Miliing & Cleaning Operation, while periodically check Strg Every 0/5m to make sure Strg is free, Pump Hi-Vis, check the Ditch Magnet and Sh.Shakers, Took

		Wt. @ 3965m w/ applying parameters, attempt to pass the Obstruction, No success, Pump Hi-Vis Pill and Check the pass interval in 7" LNR, POOH 6" Clean out BHA f/ 3965 to 3347m, w/ NL-NG.
76	22 – August	Cont. POOH for Checking 6" M.Mill to Surface While Recover 10Ib junk F/Junk Sub. Change TDS Saver Sub. M/U & RIH W/3-1/2" M.Mill + B.Sub (float in) + 10 jts 3-1/8" DC Jts By Jts + x o.s + 9 jts 2-7/8" DP Jts By Jts + X.O.S + D.pin + 4-3/4" j.Sub + 5" STD 3-1/2" 'DP + X.O.S & Follow by 5" DP to 1270 m While F/U String Each 5 STDs W/NL-NG Till M.N.
77	23 – August	Cont. RIH W/3-1/2" M.Mill BHA & Follow by 5 DP to 3802.7m (7"L.L) While F/U String Each 5 STDs , Cont. RIH W/Wash Down to 3965m, Took weight. Cont. RIH W/Milling & Cleaning to 3973m, Stall String & Overpull @ Several point, Cont. RIH W/Milling & Cleaning To 3985m, While Checking the Condition Of The Drilling String Every 5m by, Ok. Meanwhile Obs. Trace of oil on the Shaker, Check Mwt Conditions Regularly, Ok. W/NL-NG. Till M.N.
78	24 – August	Cont. RIH W/Milling & Cleaning To 3990m, Try to Cont. Cleaning & Milling, W/Pump Hi Vis Pill , Upward & Downward String .Obs. Stall String @3990m, POOH & String Stuck @ 3986m, Work on Stuck, Finally got free W/Applying Max.4klb.ft Torque,Rot.:25rpm, Downward : max.: 15klb Weight , Upward max.: 15klb Overpull, F.rate:120gpm, Press.:1300psi, POOH W/Pump out to 3790m(Above 7" L.L), Circ. Mud, RIH W/Pumping to 3990m, Resume Milling & Cleaning F/3990 to 3990.2m. Try To Cont. OP. No Progress. Start POOH To 3657m W/NL-NG. @ M.N.
79	25 – August	Cont. POOH W/ 3 1/2" J.MILL To Surface, L/D 10 Jts 3-1/8" DC '9 jts 2-7/8" DP, 5-3/8" J.Sub & 3-1/2" J.Mill: 100% Used, ,While Change Handing Tools For '3-1/2" & 2-7/8" DP &3-1/8" DC Circ. F/Cross Wellhead W/NL-NG Perform BOP Test As NIOC Policy. RIH W/ Clean out BHA As Open End W/10 Jts 3-1/8" DC + X.O.S + 10 Jts 2-7/8" + X.O.S + 5

		STDs 3-1/2" DP + X.O.S + D.Pin + B.Sub(Float in) & Follow By 5"DP To 337 m. Till M.N.
80	26 – August	Cont. RIH W/ Clean out BHA As Open End & Follow By 5"DP To 3450m While F/U String Every 10 STDs, Cont. RIH to 3802.7m(7" L.L) While F/U String Every 5 STDs, Cont. W/Wash Down to 3990m, Took Weight , Try to Pass This Point W/Max. F.rate & Pump Hi Vis Pill For Cleaning, No. Succ. Circ BTM's Up & Work On Junk Sub @ Several Time. Start POOH W/ Clean out BHA As Open End T/ 3494m & NL.NG. @ M.N.
81	27 – August	Cont. POOH W/ Clean out BHA As Open End To Surface, While 5-3/8" J.Subs (No Junk Recovering), 10 Jts 2-7/8" DP , 10 Jts 3-1/8" DC. Stop Operation Due To Request Of OEOC HSE Officer Because Of Strong Wind. M/U & RIH W/5-1/8" Dressing Mill + 2 STDs 4-3/4" DC + 5 STDs 3 1/2" DP + X.O.S + D.Pin + B.Sub (Float In) & Follow By 5" DP To 1064 m While F/U String Every 15 STDs NL-NG Till M.N
82	28 – August	24 Hrs Waiting For Client Due To Not Rec. 4-1/2" P.Liner While Cont RIH W/5-1/8" Dressing Mill BHA & Follow By 5" DP To 3800m. Stop RIH Due to Request OEOC HSE Officer Because of Strong Wind. Cont. RIH W/Wash Down To 3966m,Took Weight, Pumping W/Hi F.Rate, Apply Parameters For Dressing & Cleaning the Entry Profile @ "Tieback Sleeve (ID:5-1/4"") : Weight on:max.:2Klb, Rot.: 30rpm, F.rare:60gpm, 'Press.: 250-550psi. Check Again @ 2 Steps, Ok. POOH W/5-1/8" Dressing Mill BHA To 2130m Till M.N.
83	29 – August	Cont POOH W/5-1/8" Dressing Mill BHA To 460 m. Slip & Cut 100FT DRLG. Cont POOH To Surface & L/D 5-1/8" Dressing , M/U & RIH W/ 3 1/2" M.M.J.Mill (T.S.E.KH, S/N: 097, 5-10/32" Port) + Bit Sub (Float In) + 10 Jts 3 1/8" D.C (Jts By Jts) + X.O.S + 9 Jts 2 7/8" D.P (Jts By Jts) + XOS + D.PIN + 5 3/8" J.SUB + 5 STD 3 1/2" DP + X.O.S & Follow By 5" D.P To 3056m While Fill Up String Every 15 STD W/ NL-NG. @ M.N.

84	30 – August	Cont RIH W/ 3 1/2" M.M.J.Mill + Bit Sub (Float In) + 10 Jts 3 1/8" D.C (Jts By Jts) + X.O.S + 9 Jts 2 7/8" D.P (Jts By Jts) + XOS + D.PIN + 5 3/8" J.SUB + 5 STD 3 1/2" DP + X.O.S & Follow By 5" D.P T/ 3990.4m, Took Weigh, Pump 20 BBl Hi-Vis Pill. Milling T/3990.65m, Try To Cont. Milling & Apply Diff. Parameters, No Progress, Pump 30BBL Hi.Vis Pill & Circ BTM's Up, Work On J.Sub, Several Times. POOH F/3990.65m T/ 3969m, Obs. Over Pull, String Stuck @3969m (Inside 4-1/2" P.Liner), Work On Stuck ' With Max 15Klb Weight Downward & Apply 3KLb.Ft TQ Several Times, String Got Free. Cont. 'POOH On Elevator F/3990.65 To 3313m While Circ Mud Cross Well Head W/ NL.NG @ M.N.
85	31 – August	Cont. POOH W/ 3-1/2 M.Mill F/3313m to Surface While L/D 5-3/8" J.sub (No Junk Reco.) & 3-1/2" M.Mill, Change Handling Tools. M/U & RIH W/5-1/8" Polish Mill (PPA) + 2 STDs 4-3/4 DC + 1STDs 3-1/2" DP to 80m. Stop RIH Due to Force Majeure Because of Strong Wind. Cont. RIH W/5-1/8" Polish Mill (PPA) + 2 STDs 4-3/4 DC + 5 STDs 3-1/2" DP + X.O.S + D.Pin + B.Sub (Float in) & Follow by 5" DP to 3188m While Fill Up String Every 10 STD W/ NL.NG
86	01 – Sep.	Cont. RIH W/5-1/8" Polish Mill (PPA) BHA & Follow By 5" DP To 3966m, Pump Mud W/Hi F.Rate.Cont. RIH To 3966.12 String Took Weight, Obs. Inc, Press. , Work on it & Pass This Point, Cont. RIH To 3967.82m W/Out Took Weight, Obs. Stall String @ 3967.82m Several Times. Finally Polishing & Cleaning the entry profile At the top of the PBR @ 3967.84m. POOH W/5-1/8" Polish Mill (PPA) BHA On Elevator To Surface & L/D 5-1/8" Polish Mill (PPA) and Obs 1/8" Under Gauge without observe Ring mark on it. M/U & RIH W/ 3-1/2" M.Mill (HD Cylindersazi, S/N: CS6645, 4*12/32" Port) + Bit Sub (Float In) + 10 Jts 3 1/8" D.C + X.O.S to 93m @ M.N.
87	02 – Sep.	Cont. RIH W/ 3-1/2" M.Mill BHA (HD Cylindersazi, S/N: CS6645, 4*12/32" Port) & Follow By 5" D.P To 3802.7m(7" L.L), Cont. Wash Down to 3967m, Took weight, Cont. RIH W/Cleaning & Smooth Interval Depth (3967-3968m), Cont. Wash Down to 3990.65m, Took weight, Start Milling to

		3990.78m, Try To Cont Milling Operation With Apply Different Parametrs In Progress @ M.N
88	03 – Sep.	Try to Cont. Milling Operation, No Succ., POOH to Surf., L/D J.Sub (Recover 1.2lb Junk) & 3-1/2"M.M J.Mill (40%Used, Obs. 3"-3-1/2"Rong Out), Retreive 11"W.Bushing, Install P.Tester, Press. Test Hydril w/ 3500psi, Ok, w/ N.L-N.G, Till M.N.
89	04 – Sep.	Cont. Perform 13-5/8"-10K BOP Stack Test, L/D 9Jts 6-1/2"DC, RIH w/ 3-1/2"M.M J.Mill & Cleanout BHA to 2800m, w/ N.L-N.G, Till M.N.
90	05 – Sep.	Cont. RIH f/ 2800 to 3990.6m, Took Weight, Start Milling to 3996m, Cont. RIH w/ W&R to 4029m, While Pump Hi-His Pill Periodically, w/ N.L-N.G, Till M.N.
91	06 – Sep.	Cont. RIH w/ 3-1/2" Clean out BHA to 4050m, Pump Hi-Vis Pill and CBU till Shakering it out, Work on Junk sub Sev. Times, Start POOH 3-1/2" Clean out BHA w/ Rotation & Pump out f/ 4050 to 3969m, Cont. POOH 3-1/2" Clean out BHA f/ 3996 to 3742m On Elevator, due to windy weather, Stop Operation, Resume POOH 3-1/2" Clean out BHA f/ 3742 to 616m On Elevator till M.N.
92	07 – Sep.	Cont. POOH 3-1/2"Clean out BHA to Surface, RIH w/ 3-1/2"M.M Junk Mill to 3966m, Cont. RIH w/ Wash Down to 4050.8m, String Sot Stalled & Stuck, Work on it in Several Times, Got Free Pipes, Cont. RIH w/ Wash & Ream Down to 4057.5m, w/ N.L-N.G, Till M.N.
93	08 – Sep.	Cont. RIH w/ 3-1/2"Clean out BHA f/ 4057.5 to 4065m, String Got Stalled, try to POOH Obs. Fluctuated Torque & Stall String, Pull Out String to 4060m Centimeter by Centimeter, POOH to 4057m, Pump Hi-Vis Pill, C.B.U, POOH to 1940m, Run Back to 3929m, w/ N.L-N.G, Till M.N.
94	09 – Sep.	Cont. RIH w/ 3-1/2"Clean out BHA f/ 3929 to 4050m, Spot 20bbl S.S.Water, POOH to 327m, Slip & Cut DRLG Line, Cont. POOH to Surf., L/D 3-1/2"M.M.J.Mill (90% Used), Change Top Rams f/ 2-7/8"-5" to 4-1/2"-7" & Press. Test it,

		Ok, Till M.N.
95	10 – Sep.	Cont. Press. Test on Rig BOP and Wire Line BOP & Shooting Nipple, perform Perforation job as follow: Run#1: RIH w/ 2-7/8" Wire Line Tools and Assy. To 4020m as Dummy Run for 4-1/2" P.LNR, POOH to surface and L/D Tools, RIH w/ 2-7/8" Gun Armed w/ 80 Bullets to 3979m, Fire the Gun and POOH to surface and L/D Tools, Obs. All Bullets Shot, RIH w/ 4-1/2" Wire Line Tools and Assy. to 3969m as Dummy Run for 7" LNR, POOH to surface, L/D Tools, all done by supervision on client witness, wait on day light.
96	11 – Sep.	Cont. Wait on Day light, then perform Perforation job as follow: Run#4: RIH w/ 4-1/2" Wire Line Tools and Assy. To 3963m, Shoot Bullets at interval 3963 - 3959m, POOH to surface and L/D Tools, Run#5: RIH w/ 4-1/2" Wire Line Tools and Assy. To 3959m, Shoot Bullets at interval 3959 - 3955m, POOH to surface and L/D Tools, all done by supervision on client witness, wait on day light.
97	12 – Sep.	Cont. Wait on Day light, then perform Perforation job as follow: Run#6: RIH w/ 4-1/2" Wire Line Tools and Assy. To 3953.5m, Obs. Holding up Weight, Try to Pass This Depth Sev. Times, No Success, POOH to surface and RIH w/ 4-1/2" Dummy Gun to 3953.5m, Attempt to Pass This Depth, No Success, POOH to surface, L/D Wire Line Equipment, RIH w/ 5-7/8" BHA to 290m, Attempt to Break Circulation, Obs. String is Plugged, work on Strg Sev. Times to make it unplugged, No Success, POOH 5-7/8" BHA to surface.
98	13 – Sep.	P/U & M/U 5-7/8" Clean out BHA and RIH to 3951m, Took Weight, Cont. RIH w/ Wash & Ream Dn to 3969m, Make the Interval Smooth, Spot 10bbl Salt Saturated Water (75pcf), Static Flow Check, Well Static, POOH to 3312m @ M.N.
99	14 – Sep.	Cont. POOH 5-7/8" Clean out BHA f/ 3312 to surface, R/U Wire Line Tools and RIH w/ 4-1/2" Dummy Gun to 3957m, POOH to surface and RIH w/ 4-1/2" Loaded Gun and Perforate Interval 3955 to 3951m, POOH to surface, RIH w/ 2-1/8" CCL to check Perforated Interval to 3979, POOH Wire

		Line Tools, R/D Wire Line Tools and R/U Casing Running Tools and RIH w/ 4-1/2" Perforated LNR to 24m.
100	15 – Sep.	Cont. RIH w/ 4-1/2" LNR Tie-Back Assy. as per Tally to 3950m, Took Weight @ 3950m, Attempt to pass this point Sev. Times, No Success, POOH 4-1/2" LNR Tie-Back Assy. f/ 3950 to 1942m, while Circ. C.W.H, w/ N.L-N.G.
101	16 – Sep.	Cont. POOH 4-1/2" LNR Tie-Back Assy. To surface, L/D 4-1/2" L.G (T-95, ACME×TPCQ) + 4-1/2" Tie-Back Sleeve (T-95, 10ft) + Running & Setting Tool + 6Jts 4-1/2" Perforated LNR (T-95, 15.2PPF, R3, TPCQ) + 1/2" Seal Assembly belong to PPA, R/D Casing Running Tools, P/U & M/U 5-7/8" M.M.J.Mill and Clean out BHA and RIH to 3950m to make the interval 3947 to 3969m With & Without Rotation and Pump out.
102	17 – Sep.	Cont. Perform Milling & Smoothing The Interval 3947 to 3969m, POOH 5-7/8" Clean out BHA to surface, Perform BOP Test, R/U Casing Running Tools and RIH w/ 4-1/2" LNR Tie-Back to 1064m.
103	18 – Sep.	Cont. RIH w/ 4-1/2" LNR Tie-Back to 3967.44m and Set That in The Same Depth, Release Setting Tool and POOH to Surface, B/O & L/D Setting Tool, Set 11" Wear Bushing in T.H.S Bowl, P/U & M/U 3-1/2" Clean out BHA is in progress @ M.N.
104	19 – Sep.	Cont. P/U & M/U 3-1/2"M.M Junk Mill (Cylindersazi, S/N: CS6645, w/ 4*12/32"Port) & RIH To 4065m. Circ. BTM's Up.'Spot 10bbl Non Solid Fluied. POOH W/3-1/2" Clean Out BHA To 3398 m W/NL-NG Till M.N.
105	20 – Sep.	Cont POOH W/3-1/2" Clean Out BHA To Surface W/NL-NG. Slip & Cut 115Ft DRLG Line. M/U & RIH W / 7" Scraper + B.Sub (Float In) While L/D Extra Pipe In Derrick (Totall L/D : 9 Jts 3-1/2" D.P & 12 Jts 2-7/8" D.P & 10 Jts 3-1/8" D.C. + 18 Jts 4-3/4" D.C + 12 Jts 5" D.P & 6 Jts 5" H.W.D.P) Till M.N.
106	21 – Sep.	Cont RIH W / 7" Scraper + B.Sub (Float In) + 2 STD 4-3/4"

		D.C + 2 STD 3-1/2" D.P & Follow By 5" D.P To 3870m While Fill Up String Every 15 STD. Perform Scrape From 3835 To 3870m @ Several Time. Cont RIH To 3890m, Circ BTM's Up Till M.N.
107	22 – Sep.	L/U Pump Truck & Press Test It w/ 1000Psi , Ok. Pump 50BBL Hi-vis Pill & 27 BBL Hi-Vis Calcium chloride, Start Displace Mud 103PCF In Well With Comp. Fluid (Calcium bromide) 105PCF. Obs. The Well , Static. POOH F/3890 to 2900m While L/D 5" D.Pipe & Fill Up The Well With Comp. Fluid Till M.N.
108	23 – Sep.	Cont POOH F/2900 to 1277m While L/D 5" D.Pipe & Fill Up The Well With Comp. Fluid & NL.NG Till M.N.
109	24 – Sep.	Cont POOH W/ 7" Scraper F/860 to 115m On Elevator, While L/D 5" D.Pipe & Fill Up The Well With Comp. Fluid & NL.NG. Change Handling Tools & Elevator, Cont POOH While L/D 4-3/4" Bit sub + 6 Jts 4 3/4" DC + 6 Jts 3-1/2" DP & 7" Scraper. Retrieved 11" Wear Bushing & L/D 1 STD 5" D.P In Derrick. R/U CSG Crew & completion running tools Meanwhile Prapare Rig Floor For Run Completion String
110	25 – Sep.	Perform pre-job safety meeting & Run Complition String As Per Program To 311 m Till M.N.
111	26 – Sep.	Cont RIH w/ 154 Jts Jt 4-1/2" TBG(18.9#, L-80,HSM3) To 1633m (Totally Run 155 Jts 4-1/2" TBG) & Press Test String W/7000Psi/15min @ 1024m, Ok.
112	27 – Sep.	Cont RIH Comp String W/ 282 Jts Jt 4-1/2" TBG (18.9#, L-80, HSM3) To 2840m (Totally Run 282 Jts 4-1/2" TBG) & Perform Press Test String W/7000Psi/15min, Ok @ 2060m & Used 4-1/2" Cross Coupling On Each Jts & Hold 1000Psi Press in CILs Meanwhile Well Monitoring In All Time Operation, NL.NG Till M.N.
113	28 – Sep.	Cont RIH Comp String AS Program To 3801m Till M.N.
114	29 – Sep.	Cont Run complition String As program & Set PKR Till M.N.

115	30 – Sep.	Land tubing hanger in Tubing Head Spool According Procedure, OK. Perform press test string W/5000Psi/15min, Ok. No Return (Final Completion String Test) & Cont Operation & Test Comp String Acc Program.
116	01 – Oct.	N/D BOP & N/U X.Mass Tree.
117	02 – Oct.	N/U X.Mass Tree. Tear Out the rig. wait on day Light. Rig Release @ 1403-07-11 (2024.10.02) @ 06:00 O'Clock

Table 13-1: AZNS-116 Daily Drilling Report Summary

14. Comments & Revision

Drilling Engineering							
۱	**2.1 Well Information** • RTE must be corrected based on OEOC-201 rig. • Wellhead and TD coordinates must be corrected based on client's DDR. • Actual rig days must be corrected based on client's DDR. (116 Days+12 hours) • Rig days (plan) must be corrected based on program. • 9-5/8" casing shoe's not compatible with client's DDR. (3884.5 m)	9	CM	• اصلاح شد. • اصلاح شد. • اصلاح شد. • اصلاح شد. • اصلاح شد.			
2	**Table 2-2: AZNS-116 Casing History** • 9-5/8" casing shoe's not compatible with client's DDR. (3884.5 m) • There is another 4-1/2" P. L in well, hence add it in table.	32	CM	• اصلاح شد. • در این جدول صرفاً تاریخچه چاه قبل از تعمیر میباشد.			

3	**2.4 AZNS-116 Well Sketch** • 9-5/8” casing shoe’s not compatible with client’s DDR. (3884.5 m)	67	CM	• اصلاح شد.			
4	**3.2 Total Time Break-Down of Operation** • Nonproductive time must be reported separately based on each service companies. • Non productive time for client is not acceptable. • Table title must be corrected for AZNS-116.	71	CM	• اصلاح شد.			
5	**3.3 NPT Break-Down** • Nonproductive time (NPT) must be reported separately based on each service companies.	73,74	CM	• اصلاح شد.			
6	**4.1 Logging and Testing Reports** • All loggings and testing result must be mentioned.	75	CM	• به دلیل حجم بالای نتایج لاگ اخذ شده، فایل مورد نظر به پیوست ارائه می‌گردد.			

7	**8.2 Completion Tools Specification Checklist** • Completion tools manufacture must be mentioned to the table.	101	CM	• لحاظ گردیده است.			
8	**8.5 Completion Sketch & Tally** • Liner threads must be corrected based on client's liners running report. • There is another 4-1/2" P. Liner in the well, hence it must be added to the table. • The existence 4-1/2" P. Liner specification must be corrected. (ID, thread, grade) • Tubing 3-1/2" ID must be corrected.	127	CM	• اصلاح شد.			
9	Due to the fact that TEC does not receive any document related to the completion tools test in the presence of client's representative, hence the contractor must submit them for TEC's approval.		CM	• Handover Booklet تأیید شده توسط کارفرما به حضور ارسال می-گردد.			
Geology							

1	" تاپ سازندهای زیر نیاز به بررسی و Well Sketch در دیاگرام صفحه ۶۷ " تصحیح دارد. • عمقی که برای سرسازند پابده در مطالعات جامع اخیر تعیین شده است m۴۰۵ می باشد. (در دیاگرام ۱۷۰۵ ذکر شده) • عمقی که برای سازند فهلیان در دیاگرام آمده مر بوط به تاپ زون Fah-۱ می باشد. عمق سرسازند فهلیان بر اساس آخرین مطالعات چینه شناسی ۳۷۴۵ مشخص شده است.		CM	• سرسازندها مطابق با گزارش نهایی نمودار زمین‌شناسی تهیه گردیده است.			
Fluid Engineering							
	برنامه پسماند ذکر نشده است.		CM	• اضافه گردید.			