END OF WELL REPORT

AZADEGAN OIL FIELD

END OF WELL REPORT

AZNS-122 WORKOVER #2 (PAD #55),

TYPE: IIF

Drilling Department

JULY 2024

MSA/OEOC			
	Position	**Name**	**Date & Signature**
Prepared by	Drilling Engineering Department	M.H.Hajitaleb	
Approved by	Project Head of Drilling Engineering	Hojjat Makhsousi	
	Project Head of Drilling Operation	Piran Farzaneh	
	Project Manager	Rashid Ansari	
PPL			
	Position	**Name**	**Date & Signature**
Check & Approved by	Drilling Operation Manager	Majid Nariman	
	Subsurface Engineering Manager	Mahdi Salim Mehr	
	Head of Drilling Engineering	Soheil Shadizadeh	
	Subsurface Project Manager	Ali Maghzi	

TABLE OF CONTENTS

1. General Information 7
1.1 Field Introduction 7
1.2 AZNS-122 Well Location Map 9
2. Well History 10
2.1 Well Informaion 10
2.2 AZNS-122 Well History 11
2.3 AZNS-122 Workover #1 History 12
Workover Summary: 13
Side – Track Operation 18
Completion Summary 29
2.4 AZNS-122 Workover #2 Well Sketch 33
2.5 Bit Record Table 34
3. Time Analysis Report 35
3.1 Time vs. Depth Chart 35
3.2 Total Time Break-Down of Operation 36
WorkOver Section 36
Side – Track & Completion Section 38
3.3 NPT Break-Down 42
4. Geological Reports 49
4.1 Logging and Testing Reports 49
5. Bottom Hole Assembly Record 54
6. Casing Information 67
7. Cement Job Report 68
7.1 4 – 1/2" Liner Cement Job Report 68
8. Completion Report 69
8.1 Completion Tubing Information 69
8.2 Completion Tools Specification Checklist 69
8.3 Assembling Test Report 73
8.4 Completion Operation Checklist 91
8.5 Completion Sketch & Tally 95
8.6 Completion String Pressure Test 105
9. Wellhead Report 109
9.1 Final Well Status 109
9.2 Wellhead & X-mass tree Specification 110
9.3 Wellhead Schematic 112
9.4 X-mass Tree Specification (Section D) 113
9.5 X-mass Tree Pressure Test Report (Section D – befor install) 114
9.6 X-mass Tree Pressure Test Report (Section D – after install) 114
9.7 Wellhead Related Test Reports 116
10. Drilling Fluid Information 120

10.1 Interval Remark 120
Operation Remark 120
Drilling Fluid Remark 128
10.2 Drilling Fluid type 129
10.3 Material Consumption Analysis 130
10.4 Volume Analysis 132
10.5 Daily volume Breakdown 133
10.6 Loss Distribution 137
10.7 Interval Fluid Properties Recap 141
10.8 Solid Control Disscusion 149
10.9 Interval Completion Section 150
11. List of Contractors 151
12. Appendix 152
12.1 DDR Summary 152
13. Comments & Revision 172

LIST OF TABLES

TABLE 2-1: AZNS-122 WORKOVER #2 WELL INFORMATION 10
TABLE 2-2: AZNS-122 CASING HISTORY 11
TABLE 2-3: AZNS-122 WORKOVER #2 INFORMATION 13
TABLE 2-4: AZNS-122 BIT RECORD TABL 34
TABLE 3-1: AZNS-122 WORKOVER TIME BREAKDOWN 37
TABLE 3-2: AZNS-122 SIDE – TRACK & COMPLETION TIME BREAKDOWN 41
TABLE 3-3: AZNS-122 NPT TIME BREAKDOWN 48
TABLE 6-1: AZNS-122 FINAL CASING DATA 67
TABLE 8-1: AZNS-122 TUBING DATA 69
TABLE 8-2: AZNS-122 EQUIPMENT CHECKLIST 71
TABLE 8-3: AZNS-122 EQUIPMENT CHECKLIST 72
TABLE 8-4: AZNS-122 OPERATION CHECKLIST 94
TABLE 8-5: AZNS-122 COMPLETION TALLY 104
TABLE 9-1: AZNS-122 FINAL WELL STATUS 109
TABLE 9-2: AZNS-122 EQUIPMENT SPECIFICATION 111
TABLE 9-3: AZNS-122 SECTION "D" SPECIFICATION 113
TABLE 9-4: AZNS-122 SECTION "D" TEST REPORT BEFOR INSTALLATION 114
TABLE 9-5: AZNS-122 SECTION "D" TEST REPORT AFTER INSTALLATION 115
TABLE 11-1: AZNS-122 CONTRACTORS INVOLVED 151
TABLE 12-1: AZNS-122 DAILY DRILLING REPORT SUMMARY 171

LIST OF FIGURES

FIGURE 1-1: AZNS OILFIELD LOCATION MAP 8
FIGURE 1-2: AZNS-122 WELL LOCATION MAP 9
FIGURE 2-1: AZNS-122 WORKOVER #2 WELL SKETCH 33
FIGURE 3-1: AZNS-122 WORKOVER WELL TIME VS. DEPTH 35
FIGURE 3-2: AZNS-122 NPT BREAK-DOWN CHART 42
FIGURE 7-1: AZNS-122 LINER CEMENT JOB REPORT 68
FIGURE 8-1: AZNS-122 TRSSSV TEST REPORT 73
FIGURE 8-2: AZNS-122 TRSSSV CONNECTIONS & TEST GRAPH 75
FIGURE 8-3: AZNS-122 PERMANENT PACKER TEST REPORT 76
FIGURE 8-4: AZNS-122 ANCHOR TUBING SEAL TEST REPORT 77
FIGURE 8-5: AZNS-122 PACKER CONNECTIONS & TEST GRAPH 78
FIGURE 8-6: AZNS-122 SSD TEST REPORT 79
FIGURE 8-7: AZNS-122 SSD CONNECTIONS & TEST GRAPH 80
FIGURE 8-8: AZNS-122 EX JT TEST REPORT 81
FIGURE 8-9: AZNS-122 EX JT CONNECTIONS & TEST GRAPH 82
FIGURE 8-10: AZNS-122 LANDING NIPPLE TEST REPORT 83
FIGURE 8-11: AZNS-122 LANDING NIPPLE – MULE SHOE CONNECTIONS & TEST GRAPH 84
FIGURE 8-12: AZNS-122 FIRST CIV TEST REPORT 85
FIGURE 8-13: AZNS-122 FIRST CIM TEST REPORT 86
FIGURE 8-14: AZNS-122 CIM #1 CONNECTIONS & TEST GRAPH 87
FIGURE 8-15: AZNS-122 SECOND CIV TEST REPORT 88
FIGURE 8-16: AZNS-122 SECOND CIM TEST REPORT 89
FIGURE 8-17: AZNS-122 CIM #2 CONNECTIONS & TEST GRAPH 90
FIGURE 8-18: AZNS-122 COMPLETION SKETCH 95
FIGURE 8-19: AZNS-122 COMPLETION STRING PRESSURE TEST GRAPH 108
FIGURE 9-1: AZNS-122 WELLHEAD SKETCH 112
FIGURE 9-2: AZNS-122 X-MASS TREE BODY PRESSURE TEST GRAPH BEFORE INSTALLATION 116
FIGURE 9-3: AZNS-122 X-MASS TREE BODY PRESSURE TEST GRAPH AFTER INSTALLATION 117
FIGURE 9-4: AZNS-122 WELLHEAD MOM BEFOR INSTALLATION 118
FIGURE 9-5: AZNS-122 WELLHEAD MOM AFTER INSTALLATION 119
FIGURE 10-1: AZNS-122 FLUID PROPERTIES TABLE 129
FIGURE 10-2: AZNS-122 MATERIAL CONSUMPTION ANALYSIS TABLE 130
FIGURE 10-3: AZNS-122 MUD CHEMICAL USAGE 131
FIGURE 10-4: AZNS-122 EFFECTIVE CONCENTRATION 131
FIGURE 10-5: AZNS-122 VOLUME ANALYSIS TABLE 132
FIGURE 10-6: AZNS-122 VOLUME ANALYSIS CHART 132
FIGURE 10-7: AZNS-122 DAILY VOLUME BREAK DOWN TABLE 135
FIGURE 10-8: AZNS-122 DAILY VOLUME BREAK DOWN CHART 136
FIGURE 10-9: AZNS-122 LOSS DISTRIBUTION 139
FIGURE 10-10: AZNS-122 LOSS ANALYSIS 140
FIGURE 10-11: AZNS-122 FLUID PROPERTIES RECAP 143
FIGURE 10-12: AZNS-122 FLUID DENSITY CHART 144
FIGURE 10-13: AZNS-122 FLUID VISCOSITY CHART 144
FIGURE 10-14: AZNS-122 FLUID PV & YP CHART 145
FIGURE 10-15: AZNS-122 FLUID PH CHART 145
FIGURE 10-16: AZNS-122 FLUID CALCIUM CHART 146
FIGURE 10-17: AZNS-122 FLUID TOTAL HARDNESS CHART 146
FIGURE 10-18: AZNS-122 FLUID SOLID CHART 147
FIGURE 10-19: AZNS-122 FLUID CHLORIDE CHART 147
FIGURE 10-20: AZNS-122 FLUID WATER LOSS CHART 148
FIGURE 10-21: AZNS-122 SOLID CONTROL DESSCUSION 149
FIGURE 10-22: AZNS-122 VOLUME & MATERIAL CONSUMPTION 150

1. General Information

1.1 Field Introduction

Azadegan South Oil Field is situated in West Karoun, Khuzestan province on a large long – axis anticline with N – S trending with approximate dimensions about 20^{km} width and 60^{km} length near to Iran – Iraq border, It is located in The Northwest of The YADAVARAN Field and in The West of JUFEYR Field. The Average Monthly Temperature is 45$^{°c}$ in summer and Highest Temperature is 52$^{°c}$. The Lowest Temperature is -4.4$^{°c}$ in winter. Maximum Rainfall is 78^{mm} in February, Winter Season.

The trap area of the south Azadegan is limited to 43.2x17.2km. The Azadegan Oil field was discovered in 1999, when Well AZN-1 was drilled vertically down to the Cretaceous Fahliyan Formation with total depth of 4,643m. The results of this well, revealed the reservoir characteristics of the field. Following to the result of the well no. AZN-1, another 5 exploration wells was drilled in different parts of this huge field down to Fahliyan Formation. In the later stage the well No.10 assumed as exploration well for evaluation of deeper formations. This well was drilled in 2008, down to the depth of 5340m (Neyriz Fm.), mainly to evaluate the Jurassic formations.

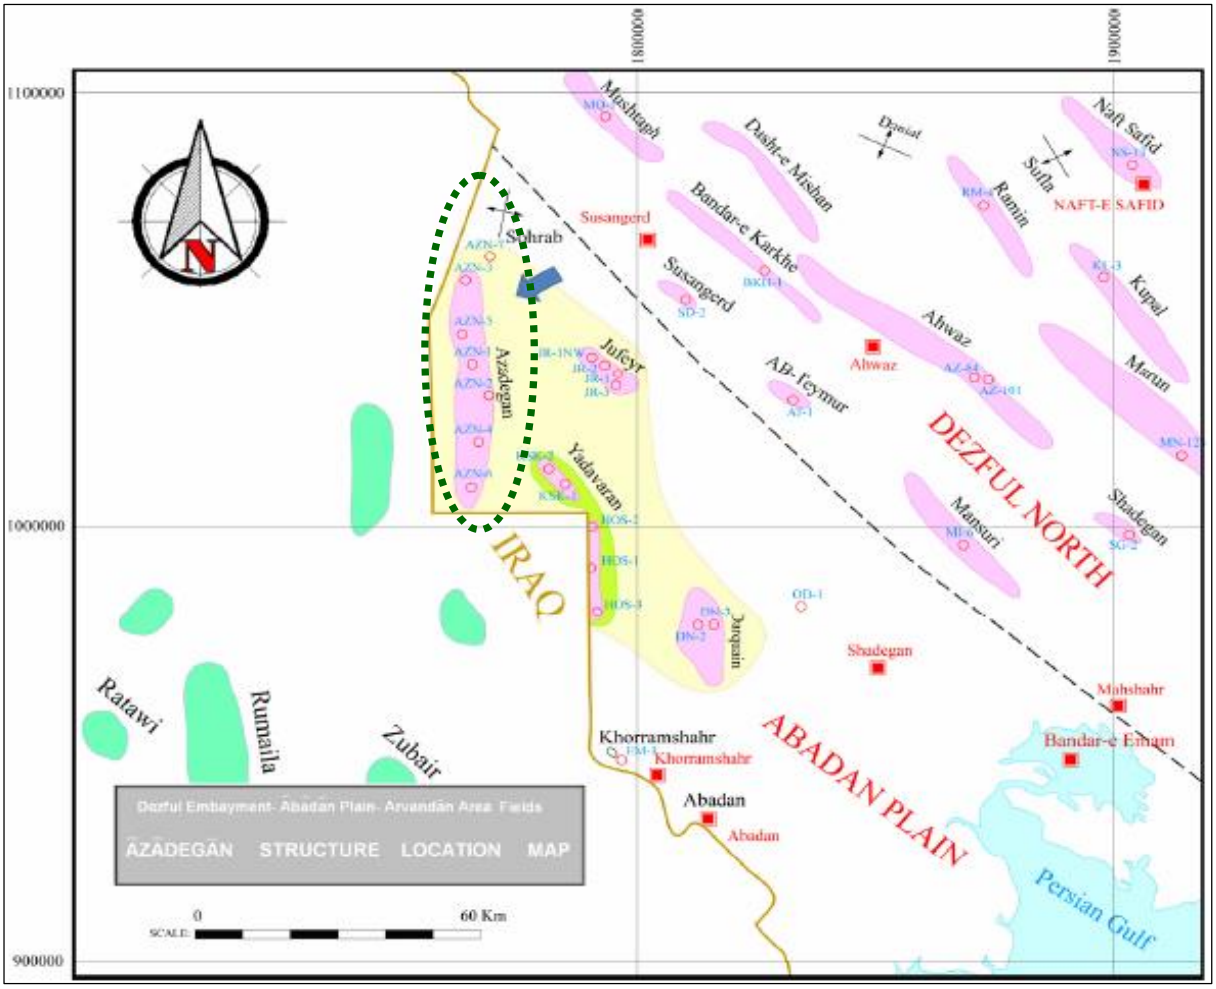


Figure 1-1: AZNS Oilfield Location Map

1.2 AZNS-122 Well Location Map

This well is located on "Pad – 55" of South Azadegan Oil field in Block-II.

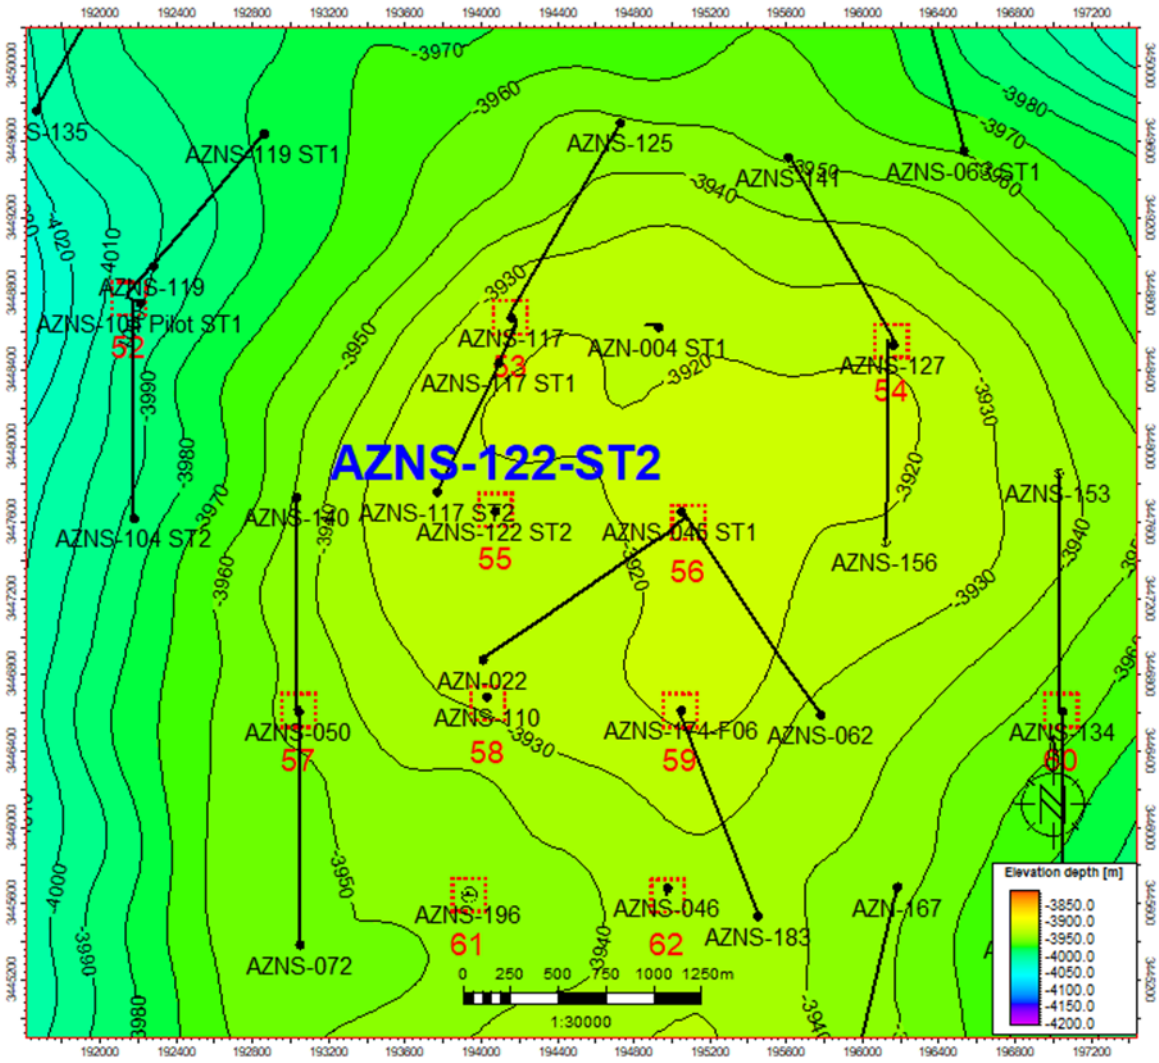


Figure 1-2: AZNS-122 Well Location Map

2. Well History

2.1 Well Informaion

Rig name	OEOC 201	**Owner**	PEDEC/PPL
Rig type	Land Rig 2000HP	**Contractor**	MSA/OEOC
Well Name	AZNS-122	**Management Contractor**	MSA
Well Type	Vertical IIF	**Field**	South Azadegan
Completion Type	4-1/2" * 3-1/2" 10K	**RTE**	12.96
Planned TD	-	**GLE**	3.95
Actual MD/TVD	4208 / 4205.5	-	
Surface Coordinate		N: 3,447,673 – E: 194,074	
Target Coordinate		N: 3,447,666.83 – E: 194,075.98	
Drilling & Suspension		**Completion**	
Spud Date	1403. 08. 06	**Spud Date**	1403. 11. 27
Released Date	1403. 12. 07	**Released Date**	1403. 12. 07
End of Drilling	-	**End of Drilling**	-
Rig Days Actual/Plan	121.5/42.6	**Rig Days Actual/Plan**	-

Size (in)	Shoe Depth (mMD)	Specification
20	155	K-55, 94^{ppf}, BTC
13 – 3/8	2169	N-80, 68^{ppf}, BTC
9 – 5/8	3909.5	C-110, 47^{ppf}, TPCQ
7	3778 – 4208	110-SS, 29^{ppf}, TPCQ
7 tie-back	1998 – 3775.4	L-80, 29^{ppf}, TPCQ
4 – 1/2 S.T	3871 – 4201	T-95, 15.2^{ppf}, TPCQ

Table 2-1: AZNS-122 Workover #2 Well Information

2.2 AZNS-122 Well History

The AZNS – 122 – ST1/F02 on "PAD – 55" was drilled by rig 92 Fath, which rig moving was spudded on 3 – October – 2016 @18:00.

- 26" hole was spudded @21:00 on 03 – Oct – 2016 & drilled to casing point 156^{m} with Mw 67^{pcf} & cased by 20" K55, 94$^{\#}$ BTC casing to 155^{m}.
- 17 – 1/2" hole was started @02:30 on 10 – Oct – 2016 & drilled to casing point 2170^{m} with Mw 67 – 83^{pcf} & cased by 13 – 3/8" N80, 68$^{\#}$ BTC casing to 2169^{m}. In this hole section, drill string was twist off at depths 1573^{m}, 1599^{m}, 1920^{m} & 1960.5^{m}. Fishing operation was performed & fish was recovered in each operation except 1573^{m} depth. Tried to recovered fish with no succeed at 1573^{m}. Set cement plug at this depth & side track the well, KOP @1416^{m}.
- 12 – 1/4" hole section was started @08:00 on 20 – Dec – 2016 & drilled to 3910^{m} with Mw 79 – 83^{pcf}. The 9 – 5/8" C110, 47$^{\#}$ TPCQ casing ran & cemented to 3909.5^{m} with slurry to surface.
- 8 – 1/2" hole section was drilled @17:00 on 08 – Feb – 2017 to 4208^{m} (TD) with Mw 100 – 107^{pcf} & 7" 110SS, 29$^{\#}$ TPCQ liner ran & cemented from 3778^{m} to 4208^{m}. The dry test results showed that the liner lap is OK.
- 2192.5 hrs. wait on receive completion fluid.
- Displaced mud in hole with completion fluid.
- 4 – 1/2" * 3 – 1/2" – 10k WEQIXIN Co. completion string was ran, packer set @3930^{m}. Tried to test completion string several times with no succeed. Disconnect completion string from anchor seal & POOH to surface. P/U & M/U 4" below first joint & RIH 4 – 1/2" * 3 – 1/2" – 10k ANTON OIL Co. completion string. Packer set @3832^{m}. performed pressure test was Ok. Install X – mass tree & test, Ok.
- The rig was released @24:00 on 08 – July – 2017.

Casing Spec.	20"	K-55, 94#, BTC	0 – 155^{m}
	13-3/8"	N-80, 68#, BTC	0 – 2169^{m}
	9-5/8"	C-110, 47#, TPCQ	0 – 3909.5^{m}
	7"	110-SS, 29#, TPCQ	3778 – 4208^{m}

Table 2-2: AZNS-122 Casing History

2.3 AZNS-122 Workover #1 History

The AZNS – 122 workover well was De-Completed by rig OEOC – 208 from 14 – January – 2024 & Re-Completed with new completion string to 09 – March – 2024 as described in the following.

- De – complete completion strring.
- Take CBIL (CDR/GR/CCL/Corrosion) from 3924 to 3752^{m} (26^{m} above the 7" liner lap).
- Run 4 – 1/2 * 3 – 1/2 " 10k completion string, including 2 CIVs was run & permanent packer set at 3720^{m}, displace the completion fluid w/ 130^{bbl} NaCl Brine (75^{pcf}, pH 9.8)
- Rig was released at 2024. 03. 09
- Rigless operation as flowing & acidizing job done, CT left in hole (roll on connector 1 – 7/8" + double flapper check valve 2" + wash nozzle 1 – 7/8") * about 9^{m} of CT pipe.

Summary of Workover #2 Operation

The AZNS – 122 workover 2 well was De-Completed by rig OEOC – 201 from 27 – Ocober – 2024 & Re-Completed with new completion string to 25 – February – 2025 as described in the following.

Workover Summary:

Date	27 – October – 2024
WorkOver Depth	4208^{m}
Formation	Fahliyan
Mud Weight	$103 – 106^{pcf}$

Table 2-3: AZNS-122 WorkOver #2 Information

Install 10k Pressure Gauge C/W 1/2" 10k Multiport Needle Valve on X-Mass Cap, and 10k Pressure Gauge C/W 1/2" 10k Multiport Needle Valve on T.H.S Instrument FLG, Record 2400psi On Comp. Strg and 0 psi on Annulus, Close 4-1/16" Top Master Valve, Then Release Pressure, M/U 4-1/16" 10k Comp. FLG C/W X.O.S Autoclave * Fig. 1502 on Kill Side, Disconnect 4-1/16" Choke Valve and Install 4" 10k CoFlex Hose on Production Side and Connect the same on Choke Manifold, M/U 2-1/16" Comp. FLG C/W X.O.S Autoclave * Fig. 1502 on T.H.S Outlet, M/U 2" Hose on 2" 10k Choke Manifold Outlet and Connect to Reserve Tank, F/U Burning Line and Perform Press. Test On It, Not Ok. While Work on Burning Line Connections and Then Perform Press. Test on The Same, Ok. P/U & M/U 5" DP Stds Jt by Jts and R/B in The Derrick.

R/U J-Lubricator and Set On X-Mass Cap, Perform Press. Test On w/ 5000psi, Ok, Back Off TWCV, While Apply 2500psi In Wellhead, Bleed Off Pressure and Attempt to Retrieve TWCV Sev. Times, TWCV Got Retrieved Successfully, R/D J-Lubricator, Close Deeping Valve. R/U Slick Line, P/U & M/U 10k 4-1/16" S/L BOP and Lubricator and Press. Test on w/4000psi, Ok, Start S/L Operation. POOH To Surf. , R/D Tool String, Pressurize Comp. Strg to 2500psi and Make 3SV Open w/ Max 7000psi, Bleed Off Comp. Strg Press. F/ 2500psi To 1000psi and Monitor The Well For A While, No Build Up, Release The Press.

Perform Press. Test w/ 5000psi On Comp. Strg To Make Sure Plug/Prong Is In The Place Perfectly, Ok, Cont. S/L Operation. RIH w/ Shifting Tool To 2000m, Pressurize Comp. Strg To 4500psi, Resume RIH w/ Same Tool String To SSD Depth, Open SSD and Start Direct Circ. Thru. The SSD, While Get 370bbl CaBr2 (103pcf) In A Reserve Tank + 60bbl CaBr2 In An Isolated Tank, Then Cont. Circ. Till UniformIn/Out Mud 101pcf, Obs. The Well For A While, Ok. Cont. S/L Operations As Run#8: RIH w/ GS Pulling To 64m and Ret. Protection Sleeve, POOH To Surface and R/D Tool String, Close 3SV & R/D S/L.

R/U Wellhead Lubricator and Set TWCV BPV In TBG HGR, Perform Press. Test Against TWCV w/ 5000psi, Ok, N/D X-Mass Tree. N/U 10k 13-5/8" BOP, Perform BOP Test As Per NIOC Policy: 5k 13-5/8" Annular w/ 3500psi, 15min, Ok, 10k 13-5/8" BTM Ram, w/ 7500psi, 15min, Ok, 10k 13-5/8" Top Ramw/ 7500psi, 15min, Ok, 10k 13-5/8" Shear Ram w/ 7500psi, 15min, Ok, While Press. Test All Choke Manifold Valves & Accumulator Unit Functionality, Ok, Open Tie-Down Screws and Perform Press. Test Against 5k 13-5/8" Annular w/ 2000psi, Ok, Retrieve TWCV BPV.

P/U & M/U 4-1/2" TBG HGR Running-Retrieving Tool RIH w/ Same and Screw Onto TBG HGR, Record Upward & Dnward String Weight, P/U Comp. String and Apply 10klbs Overpull and Then Turn Comp. Strg 17 Turns To Unlatch Anchor Seal, R/D Retrieving String, Cut 3/8" CILs & 1/4" CL f/ TBG HGR Slots, R/U Casing Running Eqp. , Spoolers. Start Retrieving Comp. Strg.

Install Wear bushing, M/U & RIH W/8-1/2" TCI Bit & Follwed by 5" to 1998m (7" L.LAP) Took Weight , While F/U String w/ N.L-NG. Start POOH W/ 8-1/2" TCI Bit From 1998 (7" L Lap) To Surf, L/D 8-1/2" TCI Bit While Fill Up Hole & Monitor The Well.

P/U & M/U 6" M.M.Junk Mill To 1635m While Fill Up Obs. String Plug. Work On String To Unplug W/Apply Max. Press. & Jerk @ Several time, No Succ.POOH F/ 1635m to 1270m, Check String, Obs. STD #36 Is Pluged, L/D It, Start Normal Circ. Mud, Ok. Run Back To 1635m. Cont RIH W/6" M.M. J.Mill & Milling BHA & Follow by 5" DP to 3721m Took weight (Top of the 7" Packer) Circ. Mud to balance MWt input & output @104pcf.

Start Milling The Packer F/3721 to 3721.8m. Obs. Trace of oil on the shaker & Detected H2S , Dec. Mwt to 72pcf, Close Hydrill , Cont. Circ. Through Chockmanifold to Burning line W/back pressure While Inc. Surface Sys Mwt to 106pcf. Cont. Circ. To Obs.Mud W/Out gas & oil @ 90Pcf Mwt, Open Hydrill, Establish Normal Circ. F/Shaker to

balance Mwt to 106pcf. OK. Obs. The Well, Static. Cont. Milling the 7"Packer F/3721 to 3722m, Obs. No progress, Try to Cont. Milling W/Apply Diff. Parameters No. Succ. Start POOH W/6" M.M. J.Mill(5* 15/32" Ports, S/N: 445, T.S.E.KH) + Milling BHA for Changing The Mill to Surface, NL-NG.

P/U & M/U new 6" M.M.J mill and RIH w/ same milling BHA to 3722m, F/U & Break Circ. Every 10 Stds, NL-NG. H/U and tag 7" PKR. Record off BTM parameters. Commence milling 7" PKR f/ 3722 to 3722.20m, W/NL-NG. Try to make progress in milling operation while applying different parameters; No Succ. Chase and Push Down 7" PKR to 4000m. Cont. Milling 7" PKR f/ 4000 to 4000.15m w/ NL-NG. Try to make progress in milling 7" PKR @4000.15m; No. Succ. Dress top of fish. POOH 6" M.M J.mill to Surface while F/U the well;

M/U & RIH W/ 2" * 4" Taper Tap To 4000.15m. Tag top of fish. Circ. With high F.R to clean top of fish. Record off btm parameters. Tap in fish (10 RPM, 5klb.ft TQ). Apply 15klbs weight. Release TQ. P/U string; engaged with fish and stuck. Cont Work on stuck; got free w/ max 40klbs over pull. POOH From 4000.15m To 3778m w/ continues 10klbs drag. Obs. Unable to pass this point. Check downward movement; Free. Work on string upward w/ max 40klbs Overpull; No Succ. Apply 10rpm and work on string gently to max 2klbs Overpull; successfully Passed 3778m. Cont. POOH From 3778m Surface. Obs Fish recovered successfully.

P/U & M/U 6" M.M.Junk Mill To 3965m While Fill Up & Break Circ String every 10 Stds. Cont. RIH W/6" M.M. J.Mill to 4008m while wash down last 5 Stds, Held up (T.O.F). PushDown With Max: 20 KLB Weight To 4011m. Commence Milling and clean out F/ 4011m to 4077m. Due to Obs. Gas cut mud and Oil Show on shaker, Stop Milling. Circ thru Choke manifold to uniform MW in & out on 106 pcf. Totally got 60 bbl gas cut mud (90-100 pcf) and 20% LEL. Open the well and perform Direct Circ. Meanwhile monitor pit level; NL-NG.

Commence Milling and clean out F/4077m To 4092.90m. Due to string stall and torque fluctuation, Dress 4091m to 4095.80m interval several times. Cont. Milling and clean out F/ 4092.90m to 4094.20m, NL-NG. Due To String Stall And Torque Fluctuation, Dress Interval 4090m to 4095.80m Several Times w/ Applying Parameters & Pump Hi-Vis Pill & CBU Till Shakering Out The Hi-Vis Pill To Sweep The Well, w/ NL-NG. Decided To POOH To Surface And Check 6" Mill Condition, POOH 6" Milling BHA f/ 4095.8 to Surface. L/D 6" Mill (100% Used), While Circ. C.W.H and Monitor The Well, NL-NG.

P/U & M/U new 6" M.M Junk mill to 1520m, While F/U Strg & Break Circ. Every 10 std, NL-NG. Resume RIH 6" Milling BHA F/ 1520 To 3900m On Elevator Followed By 3-1/2" & 5" DPs, While F/U Strg & Break Circ. Every 10 std, NL-NG. Connect TDS and Cont. RIH 6" Milling BHA with Wash Down F/ 3900 To 4093m, Obs. Holding Up Strg Wt. @ 4093m, NL-NG. Record P/U & S/O Wt. (280 Klbs), Attempt To Start Milling & Clean Out Operation, Obs. TQ Fluctuation & String Stall. POOH 6" Milling BHA F/ 4094.5 To 4079m to work on TDS saver sub while Slow Circ. Thru. Strg and Monitor The Well, NL-NG. RIH Back & Cont. Dressing F/ 4093 to 4103.8m W/ Applying Parameters. Cont. Hard Milling & Clean Out inside 7" LNR F/ 4103.8 To 4109.7m W/ Applying Parameters. String got Stuck @ 4109.7m, Work on Stuck and make it free W/ Applying 40klbs Overpull, Try to cont. milling, Obs. String Stall @ 4109.7m Several Times with different parameters. Cont. Hard Milling & Clean Out inside 7" LNR F/ 4109.7 To 4112.8m W/ Applying Parameters. String got Stuck @ 4112.8m, Work on Stuck W/ Applying Max. 10 Klbs.ft TQ, 150 Klbs Downward Wt. & 170klbs Overpull, While Circ. Thru. Strg. Prepare 65bbl Hi-Vis Pill (10% Lubricant), Circ. Pill out of mill & then Reduce Flow Rate to 50gpm, Cont. Work on Stuck W/ Applying Max. 10 Klbs.ft TQ, 150 Klbs Downward Wt. & 170 Klbs Overpull, No Success, NL-NG. Work on Stuck W/ Applying Max. 10 Klbs.ft TQ, 150 Klbs Downward Wt & 170 Klbs Overpull, While Circ. Thru. Strg No Success.

Pump 15 bbl pipelax pill (5%) & Circ. Out till 1 bbl of pipelax out of mill, pump off & Cont. work on stuck with same parameters meanwhile pump 1 bbl into string every half an hour, close annular BOP & Apply 1000psi in annulus, Obs. Pressure drop to zero due to injection into formation, no success to release the stuck @R.T.

R/D Mouse Hole, B/O & R/B Last 5" Std and P/U & M/U 5" Pup Joint, R/U Wireline Eqp. , Perform Op. P/U & Assemble Wire Line Tools As Dummy Run, RIH W/ 2-1/8" Tool String to 1722.5m, Obs. Cable Tension Drop @ 1722.5m (X.O.S 3-1/2" × 5" Depth), Try to pass this point Sev. Times, No Success, POOH 2-1/8" Tool String to surface and L/D the same.

P/U & Assemble Wire Line Tools As Dummy Run, RIH W/ 1-11/16" Tool String to 4100m, POOH 1-11/16" Tool String to surface and L/D the same., While Circ. C.W.H & Monitor the Well, NL-NG.

P/U & Assemble Wire Line Tools As FPIT, RIH W/ 1-3/8" Tool String Check the following depths: 1800m, 2000m, 2500m, 3000m, 3500m, 3800m, 3900m, 3940m, 4053m, 4078m (All Free), 4088(95% Free), 4098 (95% Stuck), 4107(100% Stuck),

POOH 1-3/8" Tool String to surface and L/D the same., R/U Wireline, While Circ. C.W.H & Monitor the Well, NL-NG.

R/U Mouse Hole, B/O & L/D 5" Pup Joint, M/U 5" Double Std, Cont. Work on Stuck W/ Applying Max. 80 Klbs Downward Wt. & 150 Klbs Overpull, While Circ. Thru. Strg W/ F.R: 100gpm, SPP: 1000-1200psi, No Success, While Monitor the Well, NL-NG. Cont. Work on Stuck No Success, Meanwhile Prepare & Mix 30PPB Citric Acid + 30bbl Water.

Disconnect TDS, B/O & R/B Double Std 5" DP, P/U & M/U 5" Pup Jt. And Disp. String Cap W/ Fresh Mud, R/U Wireline Eqp. & Perform Back off Wire line Operation. P/U & Assemble Wire Line Tools As Dummy Run, RIH W/ 1-11/16" Tool String to 4100m, POOH 1-11/16" Tool String And L/D the same. P/U & Assemble Wire Line Tools As Back off Tool String , HPJS, Announce Radio Silence and RIH 'W/ 1-11/16" BO Tool String To 4074m (BO depth), Correlate the CCL over the Backoff interval and position the Shot at the joint to be Backed off, Apply Left-hand Backoff Torque Before Firing The Back off Shot Using Rotary Table, While Holding applied Tq using Rig Tong and Monitor the Torque, Fire the Backoff shot, Obs. no obvious effect on String, Obs. String is plugged, Decided to POOH 1-11/16" BO Tool String, Shooting Bar (Len: 2.2m) left in String, Attempt to Perform Mechanical Back off. P/U String and check Upward Weight (295klbs), String plugged, Then POOH the first 60m with having Drag, NL-NG. R/D Wireline Eqp. And Prepare to Start POOH 6" Milling BHA To Surface to Check the Strg. Obs. String is Backed off according to planned Back-off depth 4074m and 6" M.M.J.Mill + 4-3/4" BIT SUB + 4 Jts 4-3/4" D.C left in the hole, While Circ. C.W.H, NL-NG.

P/U & M/U Open-End DPs & RIH To 4070m On Elevator, while Pass Rabbit Thru. Start to pumping 2.17 bbl (62.4 pcf) Ahead spacer (Rate:2 bpm), Mix & Pump 26.93 bbl Cement slurry (118 PCF) with rate 4 bpm, Pump 0.53 bbl (62.4 PCF) Spacer Behind (Rate:2 bpm), Displace mud With 153/5BBl (2 BBL Short). POOH To Surface While Change Handling Tools (2-7/8") & L/D 22 Jts's 2-7/8" Drill Pipe , NL.NG.

P/U & M/U 6-1/8" M.T & nt Run in hole from 3798m with Wash down to 3857m, Took weight (Tag CMT). Start D/O CMT from 3857m to 3945m meanwhile Pumping Hi-Vis pill Periodically & Check String with Movement Up & Down String. Perform Positive Pressure Test CMT Plug w/ 2000 psi, OK. POOH on elevator from 3915m to Surface while Fill up the well & OBS Well, Static.

P/U & Run in hole with 6-1/8" M.T Bit o 3945m while perform scrape two time's each stand's and Circulation mud periodically to prevent Plugging of the string. Pump 40 BBl Hi-Vis Pill , Circulate BTM's Up till uniform total mud system, Spot 30 bbl Hi-Vis Pill. Commence POOH from 3945m to Surface while fill up the well periodically & monitoring the well during pull out off hole & L/D.

P/U 1 Jts 3-1/2" D.pipe + 4-13/16 HFBPV & Safety Valve meanwhile Perform shaollow Test HFBPV , OK. Commence Operation with P/U and Run in hole with 7" Whipstock BHA & follow by 3-1/2" D.pipe to 528m. Rig up wireline logging crew & Equipment, Run Gyro tools as Dummy to 372m, Try to pass this depth, No success, Pull out of hole gyro tool. Commence Run in hole with 3-1/2" D.pipe to 3942m meanwhile pass rabbit thru each stands & break circ every 10 stands.

Side – Track Operation

R/U Gyro tools and Run to 3922m, Latch Gyro tools to Gyro sub but not Recorded Data due to temperature was 121 C, pull out of hole Gyro tools to surface & L/D Same.

R/U & L/U pump truck & pressure Test with 6000psi, OK. Try to Set Whipstock According procedure as Below By supervisor Whipstock. Try to shearing Pin HFBPV with pump Truck (Spad Energy), No success Due to Inability pump truck increase Pressure continuous in Operation & try several Time. shearing HFBPV pins with Rig pump With SPP: 2500psi/F.rate : 300Gpm, OK. Continue operation with try to set whipstock packer as below By Whipstock supervisor.

Try to set PKR with pump truck by Increase pressure step by step to 3000psi for 10min, release pressure slowly to Zero and check string with movement Up & Down , No Success to Set PKR. Try to set PKR with pump truck by Increase pressure step by step to 5000psi for 10min, release pressure slowly to Zero and check string with movement Up & Down , No Success to Set PKR. Run#3 : Try to set PKR with pump truck by Increase pressure step by step to 6000psi for 10min, release pressure slowly to Zero and check string with movement Up & Down , No Success to Set PKR. L/D pump truck line. Start Pull out of hole with 7" Whipstock from 3942m to Surface while Fill up well periodically & L/D. Run in hole by Open End BHA with 4 Stand 4-3/4" D.C & Follow by 3-1/2" D.P & 5" D.P to 3945m whit wash down 3 last stand. Circ BTM's UP , Spot 30 BBL Hi-vis pill BTM of hole . Start pull out of hole on elevator from 3945m to surface while mud Circ cross well head, NL.NG.

P/U and Run in hole with 7" Whipstock BHA & follow by 3-1/2" D.pipe. Line up Pump truck unit (OEOC) & press test with 6000Psi, OK. Set Whipstock With 25 Klb weight. Shear HFBPV with max 6 BPM flow rate & 4000 Psi Preesure, Set Paker Element whipstock with 3500Psi/10min according to Procedure, Broken The Nozzles Plug whipestock w/Rot. Strat open the window on 7" LNR from 3938.9m To 3941.5m (KOP) & Cofirm whit Geologist while pumping Hi-Vis pill several times. Continue Side Track Drilling formation fr 3941.5m (KOP) To 3942.6m while pumping Hi-Vis pill several times. Cont. Side Track Drilling Formation F/ 3942.6 To 3945m w/ Applying Parameters. Dress & Smooth The Opened Window, Attempt to Check the Window Condition With & Without Rotation and Pump out Sev. Times, Ok.

POOH 7" Side-Tracking BHA F/ 3945 To 2038m On Elevator, While Circ. C.W.H, w/ N.L-N.G. Change Handling Eqp. & Elevator F/ 5" To 3-1/2", Resume POOH 7" Side-Tracking BHA F/ 2038 To 122m On Elevator, While using Safety Clamp and Circ. C.W.H, w/ N.L-N.G and Perform Static Flow Check at 122m, Well Static.

Made 3-1/2" H.W.D.P Stds, RIH Back w/ 7"Side-Tracking BHA followed by 3-1/2" H.W.D.P Jt by Jt, while clean & pass Rabbit Thru. all Jts, w/ N.L-N.G. Cont. RIH Back w/ 7"Side-Tracking BHA To 237m followed by 3-1/2" H.W.D.P Jt by Jt (totally 15Jts), while clean & pass Rabbit Thru. all Jts. Perform Hi-Rate Circ. Thru. String to remove and clean probable Pipe Coating in the added 3-1/2" H.W.D.P, w/ N.L-N.G.

POOH 7"Side-Tracking BHA F/ 237m to surface, B/O & L/D 6-1/8" Tri-Mill and Rest of BHA, while Monitor the well, w/ N.L-N.G. Perform BOP Test as Per NIOC Policy.

P/U & M/U 3-1/2" H.W.D.Ps Jt by Jt and RIH to 105m (totally 11Jts), Circ. Thru. String for a while, POOH to Surface and R/B added Stds in Derrick, while Monitor the well, w/ N.L-N.G.

P/U & M/U 6-1/8" Directional BHA while Monitor the Well, w/ N.L-N.G. Perform Shallow Test w/ 200gpm, Got Diff. Press on SSP: 750psi and Cont. M/U 6-1/8"Directional BHA and RIH to 410m, while using safety clamp, change handling Eqp. and Monitor the Well, w/ N.L-N.G. Cont. RIH w/ 6-1/8" Directional BHA F/ 410 To 2891m Followed by 3-1/2" DPs On Elevator, While F/U String and Break Circ. Every 10Stds, w/ N.L-N.G and Perform Functional Tests during RIH. Cont. RIH w/ 6-1/8" Directional BHA F/ 2891 To 3945m Followed by 5" DPs On Elevator w/ Speed Control, While F/U String and Break Circ. Every 10 Stds, w/ N.L-N.G.

Disp. In-Hole Mud w/ Limestone Mud and Circ. Till unirofm the In/Out Mud Properties, w/ N.L-N.G. Directional Drilling w/ 6-1/8" Directional BHA as Rotating Mode F/ 3945 To 3956m w/ Applying Parameters. Resume Directional Drilling w/ 6-1/8" Directional BHA as Rotating Mode To 3966m w/ Applying Parameters. Due to MWD Signal lost, decided to POOH 6-1/8" Directional BHA to Surface, Monitor The Well as Static Flow Check @ 3966m for a while, Well Static, w/ N.L-N.G. POOH 6-1/8" Directional BHA F/ 3966 to Surface On Elevator, while Circ. C.W.H, using Mud Box, Change Elevator on 3-1/2" DPs, and Monitor the Well, w/ N.L-N.G. & L/D MWD Tools.

P/U 6-1/8" Back-up DHM, Perform Shallow Test w/ 200GPM, got 1200psi Diff. Pressure, R/D Dir. Eqp. P/U & M/U 6-1/8" PDC Bit and Cont. M/U 6-1/8" Directional BHA and RIH to 3966m, while using safety clamp. , Held up Strg Weight @ 3966m, Cont. Directional Drilling w/ 6-1/8" Directional BHA as Rotating Mode F/ 3966 To 3988m w/ Applying Parameters. Cont. Directional Drilling w/ 6-1/8" Directional BHA as Sliding Mode To 4208m (Target Depth) w/ Applying Parameters. Perform Hi-Rate CBU @ 4208m to Sweep the drilled hole, While reciprocate Strg and Monitor the Well, 0/5-1BPH Loss.

POOH W/ Back Ream w/ 6-1/8" Dir. Drilling BHA to Condition the drilled hole F/ 4208 To 3919m, While Monitor the Well, 0/5-1BPH Loss. RIH Back w/ 6-1/8" Dir. Drilling BHA F/ 3919 To 3967m On Elevator, Held Up Strg Wt. @ 3967m, While Monitor the Well, 0/5-1BPH Loss. Conn. TDS and Cont. RIH w/ 6-1/8" Dir. Drilling BHA w/ Wash & Ream Dn F/ 3967 To 3977m, Monitor the Well, 0/5-1BPH Loss. Cont. RIH w/ 6-1/8" Dir. Drilling BHA F/ 3977 To 4121m On Elevator, Held Up Strg Wt. @ 4121m, While Monitor the Well, 0/5-1BPH Loss.

Conn. TDS and Cont. RIH w/ 6-1/8" Dir. Drilling BHA w/ Wash & Ream Dn F/ 4121 To 4208m, While B/R & R/D Each Std two times and Monitor the Well, 0/5-1BPH Loss. Pump 30bbl Hi-Vis Pill @ 4208m and Hi-Rate CBU till Shakering out the Hi-Vis Pill to Sweep the hole, While Monitor the Well, 0/5-1BPH Loss. Cont. Hi-Rate CBU till Shakering out the Hi-Vis Pill to Sweep the hole, While Monitor the Well, 0/5-1BPH Loss.

POOH 6-1/8" Dir. Drilling BHA F/ 4208 To Surface W/ Pump out, While Monitor the Well, 0/5-1BPH Loss & L/D tools.

R/U SeaLand Wire Line Eqp. P/U & Assemble Wireline Tool String As CDR/GR Logging and RIH to 4206m, While Circ. C.W.H & Monitor the Well, 0/5-1BPH Loss. Record Data w/ Logging up w/ Wire Line Tools F/ 4206 to 4130m, Log Down F/ 4130

to 4135m to repeat pass, Obs. 100lb Cable Tension Drop, Attempt to Log up, Obs. Wire line Tools is stuck at 4134m, work on stuck to make Wire Line Tool String free Sev Times, No Success, Apply 8klbf Tension on Wire line using Wire Line unit winch, Obs. Sudden decrease in Cable Tension, POOH Wire Line Tool String to surface to check the same, Obs. All Wire Line Tool String, but Cable Head, is left in the hole, R/D Wire Line Eqp. , While Circ. C.W.H & Monitor the Well, w/ N.L-N.G.

Change Top Ram F/ 7" Fix to 2-7/8"- 5" VBR and Press. Test on that, Ok, P/U & M/U Wear Bushing Running & Retrieving Tool and RIH to set Wear Bushing, Set the same, P/U & M/U 5-1/2" Fishing BHA & RIH w/ 5-1/2" Fishing BHA To 3930m Followed by 3-1/2" & 5" DPs, While Break Circ. At 7" L.Lap, Change Elevator and Handling Eqp. F/ 3-1/2" To 5" and Circ. C.W.H & Monitor the Well, w/ N.L-N.G. Conn. TDS and Cont. RIH w/ 5-1/2" Fishing BHA w/ Wash Dn F/ 3930 To 4135m (TOF), Circ. to Clean off TOF, Take Up/Down and Rotating Weights. Lower Overshot Slowly to Touch TOF. Run Fishing Assembly Over Fish Until Swallow is Full Engaged, Stop and OBS. Inc Pressure, Pump off, Pull Up Slowly, Apply Pupming to Confirm Engaged Fish, No. Obs. Pressure ind, Run to T.O.F & Engaged, Apply Weight on Max. 3-4klb OBS. Drop The Fish, Chase the Fish to BTM, Perform Same Procedure. POOH For Check overshot to Surface, No. Recover The Fish , no observe any Indication on overshot (Sealand Co.) & L/D it.

P/U & run in hole with 5-1/4" overshot Assembly to To 4202m(TOF),Lower overshot slowly to touch TOF, Run over fish until swallow is full engaged, observe increase pressure & took weight, try to pull up.String Stuck, work on stuck , got free. Run in hole to check @ 2 step with max 5klb weight on it. Pull out of hole for checking to surface while circ mud cross well head with 0.5-1 BPH loss. observe recovered 1.13m of the logging tools fish including : (cable head + swivel). Perform Fire drill

P/U & run in hole with 5-1/4" overshot Assembly & Fishing BHA to 4201.5m (TOF) While Take Up/Down & Rotation Weights @ (K.O.P , 4150, 4198), Clean off TOF, Lower Overshot Slowly to Touch TOF, RUN OverShot Assembly over Fish Until Swallow is Full Engaged, Obsserve Increase Pressure, Try to Pull up W/Overpull, No.Succ. String Stuck, work on Stuck w/over pull several times no succ. Apply Torque & Rotation, Got Free, POH W/Drag, To 4180m, Pupming to Confirm Engaged Fish, Ok, Cont. pull out of hole Slowly to surface While No. Recover The Fish Meanwhile observe broken 3-5/8" Sprial grapple & 3-5/8 Sprial grapple control . Lay down Fishing BHA. Retrieve wear bushing W/0.5-1BPH Loss.

P/U & M/U 4-1/2" F.Shoe (15.2#,T-95, TPCQ , PPA) + 1 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) + 4-1/2" F.Coller (15.2#,T-95, TPCQ) + 1 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) + 4-1/2"LDC (15.2#,T-95, TPCQ) + 1 Jts 4 1/2" LNR (15.2#,T-95, TPCQ). Check F.Shoe & F.Collar function, (use thread lock component in Shoe Track Connections). Continue Run 4-1/2" LNR with : 29 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) (Totally : 32 jts 4-1/2" LNR) & ues Centralizer and fill up string According Program. P/U & M/U liner hanger assembly with top PKR to 4-1/2" liner, LWP is shear pinned to the bottom of running tools, Check setting tools and all connection, record up and down string weight. R/D LNR running equipment (OEOC Co.). Continue RIH W/4-1/2" liner follow by 5" Drill pipe to 3993m while pass rabbit through the drill pipes & fill up string.

Observed stopped string @ 3993m and Try to passing this depth by pumping & apply max 30 klb weight on it several times, no success. Pull out of hole from 3993m to 2311m on elevator , change elevator , Continue pull out of hole from 2311m to Surface while circulate mud Cross well head with 0.5 BPH loss and lay down 32 joint 4-1/2" liner + F.shoe + F.coller + LDC & Circulate mud Cross well head. Install wear bushing.

P/U & M/U 6-1/8" Tri-cone Bit & Follw by 3-1/2" & 5" drill pipe to 3991.6m, Encounter an Obstacle. Work on it and Push Down the Obstruction to 4083m meanwhile Check the interval With and without rotation. OK. Observe Gas Cut Mud in Return while BTM's Up at 4083m, Shut in the Well, SICP: Zero, Circ W/ 103 pcf Mud thru Wide-Open Chock. Cont RIH to 4145m And Push Down the Obstruction at 4086, 4092, 4095, 4098, 4104, 4109m & Med-Hard W&R Interval 4114-4201.5m (TOF) and Check Intervals with and without Rotation, OK. Mud Circ, BTM's up meanwhile reciprocate string. Start POOH from 4201.m (TOF) to Surface with Normal Open hole condition & L/D 6-1/8 Tri-cone bit.

R/U liner Running equipment. P/U & M/U 4-1/2" F.Shoe (15.2#,T-95, TPCQ , PPA) + 1 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) + 4-1/2" F.Coller (15.2#,T-95, TPCQ) + 1 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) + 4-1/2"LDC (15.2#,T-95, TPCQ) + 1 Jts 4 1/2" LNR (15.2#,T-95, TPCQ). Check F.Shoe & F.Collar function, (use thread lock Compound in Shoe Track Connections). Continue Run 4-1/2" LNR with : 29 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) to 358m (Totally : 32 jts 4-1/2" LNR) & Ues Centralizer and fill up string as Per Program. P/U & M/U liner hanger assembly with top PKR to 4-1/2" liner, LWP is shear pinned to the bottom Of running tools, Check setting tools and all connection, record up and down string weight. R/D LNR running equipment.

Cont. Run 4-1/2" Liner with 3-1/2" & 5" DPs to 3993m meanwhile Passed Rabbit Through DPs & F/U String; Noticed Strg Hold Up & No Passed From 3993m.Try to

Pass this Depth with Pump & max 30 Klb Weight @ Several times, No Success. Start Pull out of hole from 3993m to 365m & lay down liner hanger.

R/U LNR running equipment. Cont POOH to surface and lay down 32 joints: 4-1/2" liner + F.shoe + F.coller + LDC & Circulate mud Cross wellhead. R/D LNR running equipment. Perform BOP Test as Per NIOC Policy.

P/U & RIH with 6-1/8" PDC Bit used & run in hole with 4 Std 4-3/4" D.C + 3 Std 3-1/2" H.W.D.P & Follow by 3-1/2" D.pipe to 3305m. Cont RIH On elevator with 5" DPs to 3990m, Took weight. Cont Hard W&R to 4004m. Noticed Gas Cut Mud in Return while W&R at 4004m, Shut in the Well, SICP: Zero, Circ W/ 103 pcf Mud thru Poorboy Degasser meanwhile S-Trip Strg & Got 40 bbl Gas Cut Mud W/ min MW: 96 pcf, MW Balanced at 103 pcf, Open the Well. Cont Hard W&R to 4110m and check Interval W/ & W/O Parameters (Ok). Strg Stuck at 4110m after Connection Next STD, Work on Strg Stuck W/ Max 150 Klb Overpull (W.I: 430 Klb), 40 Klb Downward (W.I: 240 Klb) & Apply 9 Klb.ft TQ W/ No Success; Pump 50 bbl 72 pcf Salt Water; While Salt WaterReached to Annulus, Work on Strg Stuck W/ Last Parameters, Strg Got Free. Soft W&B.Ream to 4062m. Cont POOH on Elevator to 3920m.

Continue Circ W/ 103 pcf Mud thru wide-open Choke manifold & Got 160 bbl Gas Cut Mud W/ min MW: 80 pcf, MW Balanced at 103 pcf, Open the Well. Flow check, Static. RIH on elevator from 3920 to 4005m with normal hole condition. POOH on elevator to 3920m with normal hole condition. Flow check, Static. Cont POOH from 3920m to 1813m while circ mud cross well head. Cont POOH from 1813m & L/D 6-1/8" PDC Bit used.

P/U & M/U 4-1/2" F.Shoe (15.2#,T-95, TPCQ , PPA) + 1 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) + 4-1/2" F.Coller (15.2#,T-95, TPCQ) + 1 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) + 4-1/2"LDC (15.2#,T-95, TPCQ) + 1 Jts 4 1/2" LNR (15.2#,T-95, TPCQ). Check F.Shoe & F.Collar function, (use thread lock Compound in Shoe Track Connections). Cont Run 16 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) to 213m (Totally : 19 jts 4-1/2" LNR). Ues Centralizer and fill up string as Per Program. Cont Run 10 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) to 324m (Totally : 29 jts 4-1/2" LNR), P/U & M/U liner hanger assembly with top PKR to 4-1/2" liner, LWP is shear pinned to the bottom Of running tools, Check setting Tools and all connection, Record up and down string weight. R/D LNR running equipment.

Cont. RIH 4-1/2" Liner W/ DPs to 2483m meanwhile Passed Rabbit Through DPs, F/U String & L/D 2 jts Bended 3 1/2" DP Grade G. Noticed 10 bbl Gain. Shut-in the Well,

SICP: 600 psi, Circ 200 bbl 103 pcf Mud thru Choke & Poorboy Degasser W/ 1000 psi Back Pressure & min Return MW 52 pcf Meanwhile made 110 pcf Mud; Kill the Well W/ 270 bbl 110 pcf Mud & 1000 psi Back Pressure (SPP: 1015-1120 psi), Return: Gas Cut Mud W/ min MW: 57 pcf. shut in the well due to finished Pumpable Mud, prepare Kill Mud. Cont. Monitor the Well and Break Circ. At 2480m Every hour Thru. Choke Manifold and Poorboy Degasser to make sure Strg is not plugged, While Prepare 120pcf Kill Mud. Circ. 500 bbl 120 pcf Kill Mud in two steps Thru. Choke Manifold & Poorboy Degasser & Got 111pcf Mud in Return. Open the Well and Resume RIH w/ 4-1/2" LNR F/ 2480 To 3056m Followed by 3-1/2" & 5"DPs On Elevator, While Monitor the Well and Close the Well and Circ. w/ 110pcf Mud Thru. Choke Manifold & Poorboy Degasser & Got 95pcf Mud in Return. Perform Static Flow Check @ 3056m, Well Static.

Open the Well and Cont. RIH w/ 4-1/2" LNR F/ 3056 To 3771m Followed by 5"DPs On Elevator, While Monitor the Well, w/ N.L-N.G. Obs. U-Tube @ 3771m due to Unbalance MW in Strg and Annulus, Close the Well and Monitor SICP & SIDP, Respectively 0psi, 800psi, While Periodically Break Circ. w/ 108pcf Mud Thru. Choke Manifold & Poorboy Degasser to make sure Strg is not plugged & Got 95pcf Mud in Return, and Prepare 108 & 110pcf Mud. Cont. Monitor SICP & SIDP, Respectively 0psi, 800psi, While Periodically Break Circ. at 3771m w/ 108pcf Mud Thru. Choke Manifold & Poorboy Degasser to make sure Strg is not plugged and Got Min. 77pcf Mud in Return, and Cont. Prepare 108 & 110pcf Mud, w/ N.L-N.G. Kill the Well using W&W Method w/ 700bbl 108pcf & 153bbl 110pcf Mud in two steps Thru. Choke Manifold & Poorboy Degasser w/ SPP: 1290-1350psi, CP: 1000-950psi and Got Min. 40pcf Gas-Cut Mud in Return, w/ NL-NG.

Open the Well and Cont. RIH w/ 4-1/2" LNR F/ 3771 To 3914m Followed by 5"DPs On Elevator, While Monitor the Well, w/ N.L-N.G. Cont. Mud Circ. w/ 526bbl 108pcf Mud Thru. Choke Manifold & Poorboy Degasser w/ SPP: 1350psi, CP: 530-510psi and Got 90pcf Gas-Cut Mud in Return, w/ N.L-N.G. Stop Op. to Prepare 110pcf Mud, Close the Well and Monitor SICP & SIDP, Respectively 1300psi, 750psi, While Periodically Break Circ. w/ 110pcf Mud Thru. Choke Manifold & Poorboy Degasser to make sure Strg is not plugged & Got 95pcf Mud in Return, and Prepare 110pcf Mud, w/ N.L-N.G.

Kill the Well @ 3914m using W&W method w/ 654bbl 110pcf Mud in two steps Thru. Choke Manifold & Poorboy Degasser w/ SPP: 1350psi, CP: 650-250psi and Got Min. 86pcf Gas-Cut Mud in Return, Cont. Mud Circ. w/ 150bbl 110pcf Mud w/ SPP: 1350psi & Wide Open Choke, w/ N.L-N.G. Open the Well @ 3914 and Cont. Circ. w/ F.R: 121gpm, SPP: 1200-1300psi till uniform the In/Out MW, w/ N.L-N.G.

POOH 4-1/2" LNR Assy. F/ 3914 To 332m, While Monitor the Well and Circ. C.W.H, w/ N.L-N.G. R/U Casing Running Eqp. & Change Handling Tools, B/O & L/D 5-3/4" LNR HGR Assy. (Obs. Wiper Plug is stuck in next 4-1/2" LNR Jt), Then Cont. B/O & L/D 4-1/2" LNR Jts F/ 322 to Surface, While Monitor the Well and Circ. C.W.H, w/ N.L-N.G.

P/U & M/U 6-1/8"Condition BHA Including 6-1/8" Tri-Cone Bit and RIH to 3942m, Then Cont. RIH w/ W&R F/ 3942 to 3966m and check Interval W/ & W/O RPM. Med W&R Last Std & Cont. Hard W&R to 4166.6m and check Interval W/ RPM. Med W&R Last Std & Cont. Hard W&R to 4202m (Target Depth) and check Interval W/ RPM. POOH 6-1/8" Condition BHA w/ Back Ream f/ 4202 to Surface w/ Applying Parameters. L/D 6-1/8" Tri-Cone Bit While Circ. C.W.H, w/ N.L-N.G.

R/U Casing Running Tools, P/U & M/U 4-1/2" F.Shoe (15.2#,T-95, TPCQ , PPA) + 1 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) + 4-1/2" F.Collar (15.2#,T-95, TPCQ) + 1 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) + 4-1/2"LDC (15.2#,T-95, TPCQ) + 1 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) and RIH to 34.5m, While Function-Test F.Shoe & F.Collar, use Thread Lock Compound in Shoe Track Connections, and Break Circ. Thru. Shoe Track, w/ N.L-N.G. Cont. RIH w/ 4-1/2" LNR Assy. f/ 34.5 to 324m followed By 26 Jts 4 1/2" LNR (15.2#,T-95, TPCQ) (Totally : 29 Jts 4-1/2" LNR) While Use Thread Seal Compound, Torque Turn Monitoring System, and Break Circ. Thru. 4-1/2" LNR Assy. Every 10jts, w/ N.L-N.G.

P/U & M/U LNR HGR Assy. w/ Top PKR to 4-1/2" LNR, L.W.P Shear-Pinned to the BTM of Running Tools, check Setting Tools and all connections, Record Up & Downward Strg Wt. and Cont. RIH w/ RIH w/ 4-1/2" LNR Assy. f/ 324 to 3933m Followed by 3-1/2" & 5" On Elevator, While pass Rabbit Thru. all DPs, and F/U Strg, and Break Circ. Every 10Stds , w/ N.L-N.G. Conn. TDS @ 3933m, CBU, w/ N.L-N.G. Cont. RIH w/ 4-1/2" LNR Assy. f/ 3933m to BTM (4201m) Followed by 5" DPs On Elevator, w/ N.L-N.G. Dropped ball, connected TDS, and Circ. Thru. Strg to chase the ball. Increased SPP to 1800 psi to set 4-1/2” Hyd. Mech. Rot. LNR HGR. Slacked off 20klbs on HGR, then continued increasing SPP to 2600psi. Obs. LDC Blowing, released Setting Tool, and Stung out by 1m, w/ N.L-N.G.

P/U & M/U 5" Pup JT & CMT Head (Loaded DPWP) on Strg, Started Slow Circ. as Strg Cap. was reached, Meanwhile, L/U Surf. Lines and prepared CMT Solution, Tested CMT lines to 3000 psi, result OK. Pumped 15 bbl Fresh Water W/ Chemical Wash as Spacer Ahead, Mixed and pumped CMT Slurry Weight: 118 pcf, Slurry Volume: 40 bbl, Dropped Pump-Down Plug and pumped W/ 152bbl Mud, observed shearing, continued

Displacing w/ 166bbl, Obs. bumping increase pressure to 3000psi, hold Pressure 10min, ok, bled off pressure,checked backflow, result OK. (N.L-N.G. during cement job). Disconnected CMT head and attempted to sting out Setting Tools, but no result due to Drawworks malfunction. Attempted to Rotate Strg to avoid Sticking, No success due to Rotary Table No working, Worked on electrical problem of drawworks & Rot. Table, fixed the same. Sting out setting tool POOH F/ 4-1/2" L.Lap (3871m) to 3600m as fast as possible to avoid String sticking in CMT, Flushed string and continued POOH to 3322m, w/ N.L-N.G.

CBU @ 3322m, Surface sample after 3 hours: medium to hard, w/ N.L-N.G. POOH LNR HGR setting tools F/ 3322 to surface On Elevator, Surface sample: hard, While Circ. C.W.H, w/ N.L-N.G. , L/D LNR HGR Setting Tools.

P/U & M/U 6-1/8"Clean out BHA and RIH w/ Wash Dn f/ 3739 to 3765m, Held up Strg Weight @ 3765m, w/ N.L-N.G. art D/O CMT w/ 6-1/8" Clean out BHA f/ 3765 to 3830m w/ Applying Parameters. Stop Op. @ 3830m due to failure of TDS Saver sub, POOH to 3812m, Change the same, while Circ. Thru. Strg, w/ N.L-N.G. Conn. TDS & RIH to 3830, Tag TOC, Resume D/O CMT w/ 6-1/8" Clean out BHA f/ 3830 to 3871m w/ Applying Parameters. Set Top PKR Acc. to PPA procedure in the presence of Client Drilling Supervisor, w/ N.L-N.G. CBU @ 3871m to sweep the well, w/ N.L.N.G. POOH w/ 6-1/8" Clean out BHA f/ 3871m to surface on Elevator, L/D Bit with the same condition & BHA, While Circ. C.W.H, w/ N.L-N.G. Perform BOP Test As Per NIOC Policy.

P/U & M/U 3-1/2" Clean out BHA and RIH to 250m, While M/U all Tubular Jt by Jt, Wash and Pass Rabbit Thru. Them, Circ. C.W.H, Attempt to F/U BHA & Break Circ. @ 250m, Obs. Strg is plugged, Decided to POOH, w/ N.L-N.G. Install Secondary Fingerboard for 2-7/8"DPs & 3-1/8" DCs, POOH 3-1/2" Clean out BHA f/ 250m to surface, while R/B Made up BHA, B/O 3-1/2" Mill Clean and Unplug 3-1/2" Mill, while Circ. C.W.H, w/ N.L-N.G.

P/U & M/U 3-1/2" Clean out BHA to 3310 followed by 5" DPs on Elevator, w/ N.L-N.G. Attempt to Perform Break Circ. @3310m, Obs. Strg is plugged, Work on Strg and make it unplugged, Break Circ. for a while, w/ N.L-N.G. Resume RIH w/ 3-1/2" Clean out BHA f/ 3310 to 3874m followed by 5" DPs on Elevator, While F/U Strg & Break Circ. Every 7Stds, w/ N.L-N.G. D/O CMT inside 4-1/2" LNR & Packoff Bushing f/ 3874 to 4005m w/ Applying Parameters. ont. RIH w/ 3-1/2" Clean out BHA W/ Soft Wash & Ream Dn f/ 4005 to 4178m w/ Applying Parameters. Pump 20bbl CaCl2

solution @ 4178m as Balance and chase w/ 103pcf Mud to Spot it in 4-1/2" LNR, w/ N.L-N.G.

Start POOH 3-1/2" Clean out BHA f/ 4178 to 3870m On Elevator, While Circ. C.W.H, w/ N.L-N.G. Close Top Rams and Perform Positive Test @ 3870m w/ 1000psi, Ok, w/ N.L-NG. Pump 130bbl 105pcf Limestone Fresh Mud @ 3870m as Balance and chase w/ 103pcf Mud to Spot it in 7" LNR, w/ N.L-N.G. Cont. POOH to Surface and flow check in 540m, well Static. L/D 3-1/2 Mill.

R/U Wireline tools,Perform Wireline Operation: Run#1: Assemble 2 No. 2-7/8" B.Gun + CCL As Dummy Run to 4175m. Pull out of hole with 2-7/8" Dummy to Surface and L/D It. Assemble Logging tools Included : RBT/VDL/CCL/GR, Run to 4173m. Take log up to 3871m (4-1/2" LNR Lap), continue pull out of hole with logging tools to surface. As per client request Assemble same wireline Logging tools Included : RBT/VDL/CCL/GR, Run again to 3877m & held up wireline Logging tools. Attempte to pass This depth several times No success. Pull out to surface & L/D same.

R/U Wireline tools and run in hole with : 2 No. 2-7/8" B.Gun + CCL As Dummy Run to 4165m, Pull out of hole to surface and L/D it. continue operation according to procedure. 1No. Loaded Gun W/Specified Parameters, Armed W/ 99 Bullets, Net Length: 5m and Run Wireline Tools. Perform Run#1, Correlate Depth and then Fire the Gun, Shoot the Bullets.(Interval: 4101.8 - 4096.8). POOH to Surface, check Gun, Shoot All Bullet.

Run 2# : Armed W/ 99 Bullets, Net Length: 5m and Run Wireline Tools Including (CCL + Loaded Gun), Correlate Depth and then Fire the Gun, Shoot the Bullets.(Interval: 4096.8 - 4091.8m). POOH to Surface, Check Gun, Shoot All Bullet. Rebuild cable head. Run 3# : Armed W/ 99 Bullets, Net Length: 5m and Run Wireline Tools Including (CCL + Loaded Gun), Correlate Depth and then Fire the Gun, Shoot the Bullets.(Interval: 4091.8 - 4086.8m). POOH to Surface, Check Gun, Shoot All Bullet. Rebuild cable head. Run 4# : Armed W/ 80 Bullets, Net Length: 4m and Run Wireline Tools Including (CCL + Loaded Gun), Correlate Depth and then Fire the Gun, Shoot the Bullets.(Interval: 4077.3 - 4073.3m). POOH to Surface, Check Gun, Shoot All Bullet. Rebuild cable head. Run 5# : Armed W/ 70 Bullets, Net Length: 3.5m and Run Wireline Tools Including (CCL + Loaded Gun), Correlate Depth and then Fire the Gun, Shoot the Bullets.(Interval: 4073.3 - 4069.8m). POOH to Surface, Check Gun, Shoot All Bullet. Rebuild cable head. Run 6# : Armed W/ 99 Bullets, Net Length: 5m and Run Wireline Tools Including (CCL + Loaded Gun), Correlate Depth and then Fire the Gun, Shoot the Bullets.(Interval: 4056.5 - 4051.5m). POOH to Surface, Check Gun, Shoot All Bullet.

Rebuild cable head. Run 7# : Armed W/ 99 Bullets, Net Length: 5m and Run Wireline Tools Including (CCL + Loaded Gun), Correlate Depth and then Fire the Gun, Shoot the Bullets.(Interval: 4051.5 - 4046.5m). POOH to Surface, Check Gun, Shoot All Bullet. Rebuild cable head. Run 8# : Armed W/ 60 Bullets, Net Length: 3m and Run Wireline Tools Including (CCL + Loaded Gun), Correlate Depth and then Fire the Gun, Shoot the Bullets.(Interval: 4026.2 - 4023.2m). POOH to Surface, Check Gun, Shoot All Bullet. Rebuild cable head. Run 9# : Armed W/ 99 Bullets, Net Length: 5m and Run Wireline Tools Including (CCL + Loaded Gun), Correlate Depth and then Fire the Gun, Shoot the Bullets.(Interval: 4006.6 - 4001.6m). POOH to Surface, Check Gun, Shoot All Bullet. Rebuild cable head. Run 10# : Armed W/ 99 Bullets, Net Length: 5m and Run Wireline Tools Including (CCL + Loaded Gun), Correlate Depth and then Fire the Gun, Shoot the Bullets.(Interval: 4001.6 - 3996.6m). POOH to Surface, Check Gun, Shoot All Bullet. Rebuild cable head. Run 11# : Armed W/ 89 Bullets, Net Length: 4.5m and Run Wireline Tools Including (CCL + Loaded Gun), Correlate Depth and then Fire the Gun, Shoot the Bullets.(Interval: 3996.6 - 3992.1m). POOH to Surface, Check Gun, Shoot All Bullet. Rebuild cable head. Run 12# : Armed W/ 40 Bullets, Net Length: 2m and Run Wireline Tools Including (CCL + Loaded Gun), Correlate Depth and then Fire the Gun, Shoot the Bullets.(Interval: 3978.1 - 3976.1m). POOH to Surface, Check Gun, Shoot All Bullet. POOH to Surface. L/D Wire line Logging Equipment

P/U & M/U 3-1/2" Clean Out BHA & Run in hole 4178 (LDC) with Pumping & Rotation to ensure w/ good case hole condition in perforated interval. OK. Circ BTM's Up & NL.NG. Spot 20 BBL Completion fluid (CaBr2 102.5 PCF) Bottom of Hole. POOH on Elevator from 4178m to Surface & L/D 3 1/2" Junk Mill + 24 Jts 2-7/8" D.Pipe + 15 Jts 3-1/8" D.C Meanwhile F.Check @ 3871m & 1950m, 400m, Well Static.

Change Handling Tolls and P/U & Run in hole with 7" Scraper BHA to 3871.3m (4-1/2" LNR) While Scrape from 3400 to 3540m several times. While wait on Received Completion String, mud Circulate w/ NL-NG , Noticed 10 BBL Gain While BTM's Up (50 bbl Remaining To Finished), Close the well, SICP: ZERO, Mud Circ Thru Chock Manifold with NL-NG. While wait on Received Completion String & Completion Fluid, Cont Circ mud and L/D Extra Tubular in Derrick.

R/U Chicksan Pipes and L/U the same on 5"DPs & Pump Unit of Dana Energy Co. , Conn. Hose f/ Solution Tanks to Pump Unit, Perform Displacement of Comp. Fluid as follow: Pump 20bbl Hi-Vis Pill as Spacer, Pumping 675bbl Comp. Fluid (CaBr2 - 104.5 pcf - W/ added Corrosion inhibitor at concentration of 1% by volume + H2S Scavenger at concentration 0.5% by Volume, + O2 Scavenger at concentration 0.5% by Volume

prior to Start Pumping), Pump Rate: 3-4bbl/min, W/ NL-NG. Cont. Pumping Comp. Fluid till getting Hi-Vis Pill and then 104.5 pcf Comp. fluid on Sh.Shakers, Stop Pumping, w/ N.L-N.G. Flow Check at 3869m for 1Hr. , Well Static. L/D Chicksan Pipes and Start POOH 6-1/8" BHA F/ 3869 to 3529m, While L/D Tubular & clean and wash Mud Divider and Flow Lines. Resume POOH 6-1/8" BHA F/ 3529 to surface on Elevator, While L/D Tubular Jt by Jt, Monitor and Fill up the Well by Trip Tank, W/ N.L-N.G. Retrieve Wear Bushing, set Plug Tester, Perform BOP Test

Completion Summary

R/U NDCO LNR Running Tools, RIH w/ 7" Comp. Strg to 12m as follow: 3-1/2" Mule Shoe + 3-1/2" BTM NO GO + Pup Jt 3-1/2", 10.2#,HSM3 + 1Jt TBG 3-1/2", 10.2#, L-80,HSM3, Cont. RIH w/ 7" Completion Strg f/ 12 to 30m as follow: Pup Jt 3-1/2", 10.2#,HSM3 + 7' Hydraulic set permanent production PKR + 3-1/2" Anchor seal assembly + Pup Jt 3-1/2", 10.2#,HSM3 + 1Jt TBG 3-1/2", 10.2#, L-80,HSM3, While Clean & Wash all Connections, using Thread Seal Compound & Torque/Turn Monitoring System, and Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G.

R/U Slick Line Tools, P/U & Assemble 2.700" Guage Ring, RIH w/ Same Tool String to Top of NO-GO L.Nipple (Max ID: 2.562") to 30m, Ok, POOH to surface and R/D Slick Line Eqp. , While Circ. C.W.H by Trip Tank, W/ N.L-N.G.

Cont. RIH w/ 7" Completion Strg f/ 30 to 82m as follow: Pup Jt 3-1/2", 10.2#,HSM3 + 3-1/2" Non-Elastomeric Sliding Side Door + Pup Jt 3-1/2", 10.2#,HSM3 + 1Jt TBG 3-1/2", 10.2#, L-80,HSM3, Pup Jt 3-1/2", 10.2#,HSM3 + 3-1/2" EXP. Joint,HSM3 + Pup Jt 3-1/2", 10.2#,HSM3, 1Jt TBG 3-1/2", 10.2#, L-80,HSM3, Pup Jt 3-1/2", 10.2#,HSM3 + 3 1/2" CIV TBG Retrievable Chemical Injection Mandrel + Pup Jt 3-1/2", 10.2#,HSM3, 1Jt TBG 3-1/2", 10.2#, L-80,HSM3, Pup Jt 3-1/2", 10.2#,HSM3 + 3 1/2" CIV TBG Retrievable Chemical Injection Mandrel + Pup Jt 3-1/2", 10.2#,HSM3, While Conn. Both, 3/8" CILs to CIVs and Preform Pressure Test w/ 2200psi, 20min, Ok, While Clean & Wash all Connections, using Thread Seal, Compound & Torque/Turn Monitoring System, and Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G.

R/U Slick Line Tools, P/U & Assemble 2.80" Guage Ring, RIH w/ Same Tool String to Top of SSD (Max ID: 2.750") to 82m, Ok, POOH to surface and R/D Slick Line Eqp. , While Circ. C.W.H by Trip Tank, W/ N.L-N.G.

R/U CMT Unit and Connect Chiksan pipes to Circ. Swage, Perform Comp. Strg Press. Test at 82m w/ 7000psi, 15min, Ok.

Cont. RIH w/ 7"Comp. Strg w/ 17Jts (totally: 22Jts) TBG 3-1/2", 10.2#, L-80,HSM3 F/ 82 To 241m, While Clean & Wash all Connections, use Thread Seal Compound, Torque/Turn Monitoring System, and Cross Coupling Cable Protectors, Hold Pressure in both CILs, and Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G. Cont. RIH Comp. Strg w/ TBG 3-1/2", 10.2#, L-80,HSM3 (totally: 87Jts) F/ 241 To 857m, While Clean & Wash all Connections, use Thread Seal Compound, Torque/Turn Monitoring System, and Cross Coupling Cable Protectors, Hold Pressure in both CILs, and Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G. Prepare Pumping Unit and Chiksan pipes, Perform Comp. Strg Press. Test at 857m w/ 7000psi, 15min, Ok, W/ N.L-N.G.

Cont. RIH Comp. Strg w/ TBG 3-1/2", 10.2#, L-80,HSM3 (totally: 139Jts) F/ 857 To 1350m, While Clean & Wash all Connections, use Thread Seal Compound, Torque/Turn Monitoring System, and Cross Coupling Cable Protectors, Hold Pressure in both CILs, and Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G. Cont. RIH Comp. Strg w/ TBG 3-1/2", 10.2#, L-80,HSM3 (totally: 176Jts) F/ 1350 To 1700m, P/U & M/U X-over 4-1/2"HSM3, 18.9# BOX * 3-1/2"HSM3 , 10.2# PIN, Change Handling Eqp. & Elevator, P/U & M/U 1st Jt of TBG 4-1/2" 18.9#, L-80,HSM3, While Clean & Wash all Connections, use Thread Seal Compound, Torque/Turn Monitoring System, and Cross Coupling Cable Protectors, Hold Pressure in both CILs, and Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G.

R/U Slick Line Tools, Assemble 2.800" Guage Ring Tool Strg, RIH to Top of SSD, Ok, POOH to surface, L/D Slick Line Tools, While Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G.

Prepare Pumping Unit and Chiksan Pipes, Perform Comp. Strg Press. Test at 1700m w/ 7000psi, 15min, Ok, W/ N.L-N.G. Cont. RIH Comp. Strg w/ TBG 4-1/2" 18.9#, L-80,HSM3 (totally: 176 JTs 3-1/2" TBG+ 72JTs 4-1/2" TBG) F/ 1700 To 2384m, While Clean & Wash all Connections, use Thread Seal Compound, Torque/Turn Monitoring System, and Cross Coupling Cable Protectors, Hold Pressure in both CILs, and Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G. Cont. RIH Comp. Strg w/ TBG 4-1/2" 18.9#, L-80,HSM3 (totally: 176 JTs 3-1/2" TBG+ 103JTs 4-1/2" TBG) F/ 2384 To 2680m, While Clean & Wash all Connections, use Thread Seal Compound, Torque/Turn Monitoring System, and Cross Coupling Cable Protectors, Hold Pressure in both CILs (1000psi), and Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G.

Prepare Pumping Unit and Chiksan Pipes, Perform Comp. Strg Press. Test at 2680m w/ 7000psi, 15min, Ok, W/ N.L-N.G. Cont. RIH Comp. Strg w/ TBG 4-1/2" 18.9#, L-80,HSM3 (totally: 176 JTs 3-1/2" TBG+ 183JTs 4-1/2" TBG) F/ 2680 To 3430m, While Clean & Wash all Connections, use Thread Seal Compound, Torque/Turn Monitoring System, and Cross Coupling Cable Protectors, Hold Pressure in both CILs (1000psi), and Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G.

Cont. RIH Comp. Strg w/ TBG 4-1/2" 18.9#, L-80,HSM3 (totally: 176 JTs 3-1/2" TBG+ 195JTs 4-1/2" TBG) F/ 3430 To 3553m, then P/U & M/U Pup Jt 4 1/2",HSM3 ,18.9#, L-80, Type-1 + 4-1/2" FLOW COUPLING, 18.9#,Super 13CR-110KSI,HSM3 , 4' FT, Weiqixin Co + TRSSV-10 TBG Retrievable Saftey Valve, 4 1/2", 18.9# W/ 3.437" Seal bore,HSM3 , Super 13CR-110KSI, 10K WP With AF Profile, Flapper Type, Weiqixin Co + 4-1/2" FLOW COUPLING, 18.9#,Super 13CR-110KSI,HSM3 , 4' FT, Weiqixin Co + Pup Jt 4 1/2",HSM3 ,18.9#, L-80 + 1Jt TBG 4-1/2" 18.9#, L-80,HSM3, While Connect 1/4" CL Fitting to TRSSV Port and Perform Press. & Funtiocn Test on the same w/ 7500psi, Ok, Clean & Wash all Connections, use Thread Seal Compound, Torque/Turn Monitoring System, & Cross Coupling Cable Protectors, Hold Pressure in both CILs (1000psi), and Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G.

Prepare Pumping Unit and Chiksan Pipes, Perform Comp. Strg Press. Test at 3553m w/ 7000psi, 15min, Ok, Inflow Press. Test of TRSSV-10 Flapper As program Proccedure. OK. Cont Run in hole with 4 Jts 4-1/2" TBG/ Pressure Up CILs to (7000 psi) Rupture CIVs Rupture Disk, M/U Fluted Swage & Tubing Hanger/Cut & Conn. CILs & C/L to Tubing Hanger, M/U Running Tools + L/J Land T. hanger in THS. P/U 1.5m String/Test String W/7000psi, OK. M/U Golpa.F + 4-1/2 G.valve, Prepare to R/U & Running Slick Line. RIH W/Slick Line According Procedure : R#1: Install 3.437" Protection Sleeve in TRSSSV, R#2: Retrieve 2.75" Check.V F/SSD, R#3: Set. 2.562" Plug in NO-GO L.N., R#4: Set prong in NO GO, R#5: Run with shifting tool to confirm SSD is full close in Progress, NL.NG. R#5: Run with shifting tool to confirm SSD is full close.

Set Packer as Per procedure (Set PKR Depth : 3601.86m). Over Pull string (Max. 15 Kips) to test PKR, Slack off Weight to shear Expansion joint. (shear Pins : 22 kips), Land tubing hanger in Tubing Head Spool, Tighten all Tie-Down screws.Test TBG HGR & All Tie-Down screws W/2000psi, OK. Perform final completion string test w/5000 psi for 15min, OK. Test PKR & HGR Seals from ANN. With 2000psi/15min, OK. Retrieve 3.437" protection Sleeve of TRSSSV. Cut C/L & Lay Down L/Joint, install 4" 10K 2WCV in TGB HGR. Attempt to Test 2WCV no succ Duo to Observe Leakage on Top & BTM Kill Line @ Several Time. Finally Perform Test with 7000psi/15min, OK.

N/D BOP Stack. N/U X-Mas Tree Including: (BTM master Valve & pressure test M.Seal w/8000psi, Ok. Pressure Test Between Lower S.Seal & Cavity Through test port w/8000psi/15min, OK.Pressure Test Between Neck of HGR S.Seal & Cavity Through test port W/ 8000psi/15min, OK. Pressure Test C/L To 8000psi/15min,Ok. Test CILs w/2000psi/15min, Ok. Nipple-up Solid Block and Tree Cap on top, Preesure test X-Mas Tree Body with 8000psi/15min, OK. Open X-Mas Tree cap and Retrieve 2WCV. Install Xmas tree cap and close all valves Except bottom master valve.

Prepare To Displace complition Fluid ($CaBr_2$ Sloution) in String with salt water, Cont. run in string with C.T: 1-3/4” nozzle + 1-1/2” double flapper + roll-on connector to 3619^{m} (top of plug & prong in No-Go landing nipple). Start displace completion fluid ($CaBr_2$ Sloution) in string with pump 15^{bbl} Hi-Vis pill as spacer, Cont. pump salt wter added 1% corrosion inhibitor (pH:10). POOH C.T to surface, L/D & flush C.T line.R/U slickline & retrieve protection sleeve from 3SV, R/D slickline, close all X-mass tree valves except BTM master valve. Rig Release @ 2025.02.25 (1403.12.07) @ 24:00 O'clock.

2.4 AZNS-122 Workover #2 Well Sketch

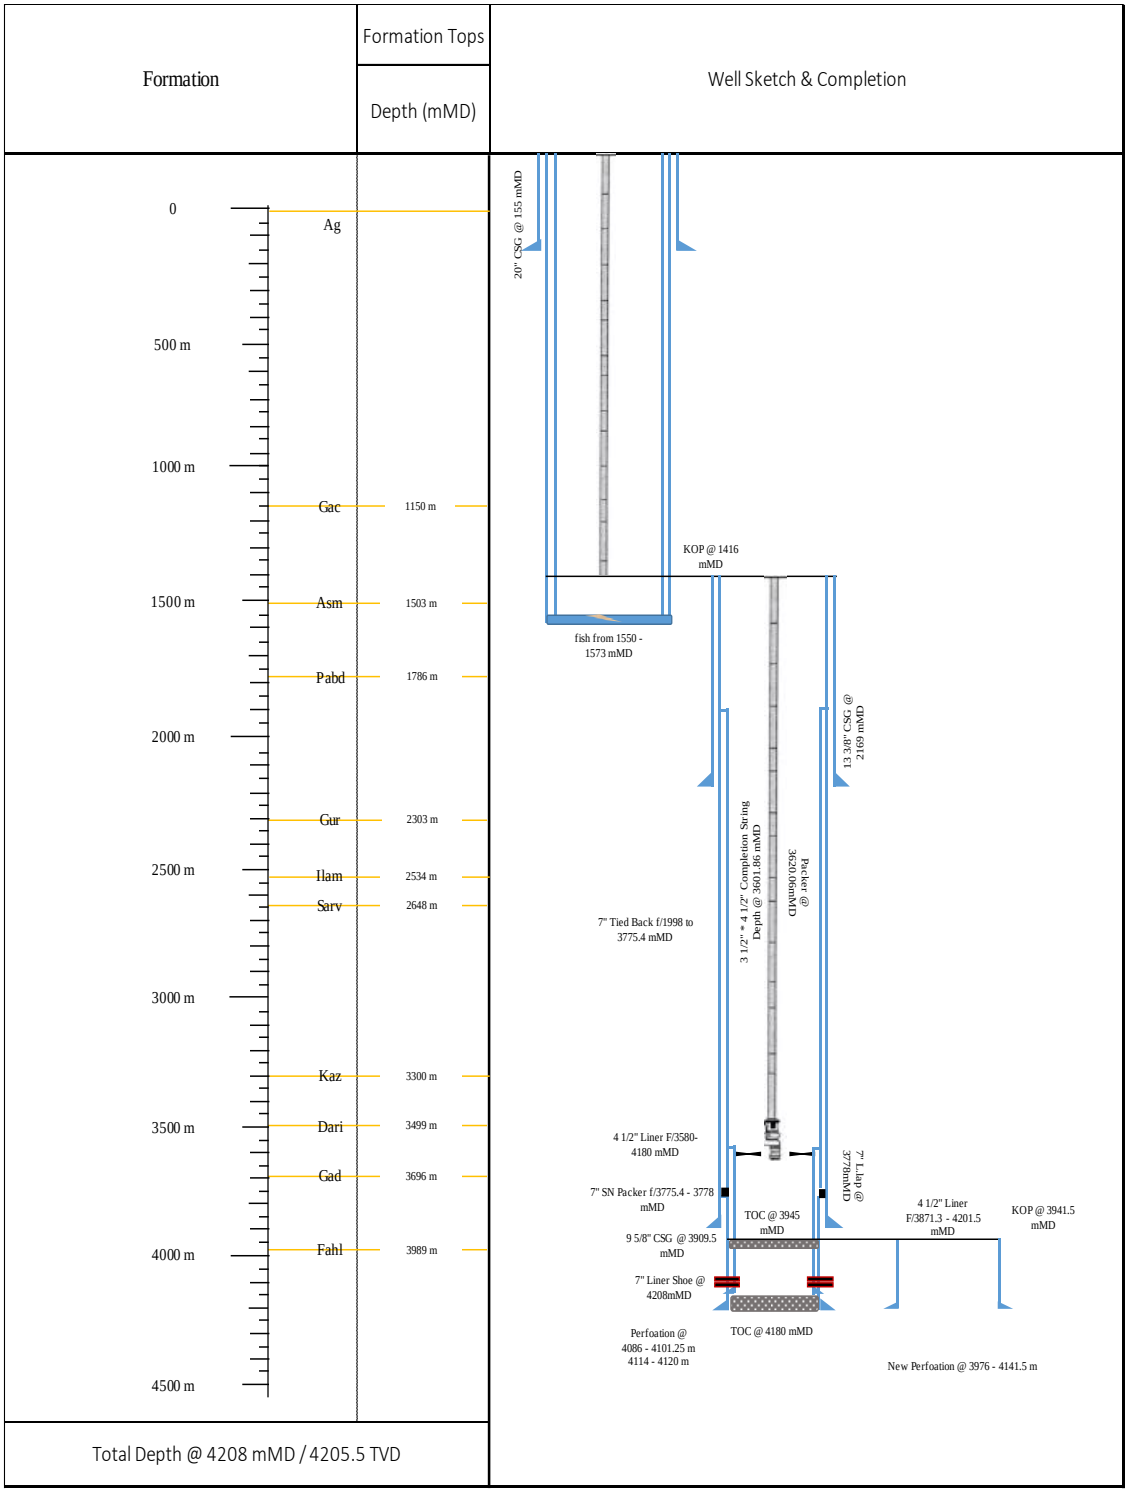


Figure 2-1: AZNS-122 Workover #2 Well Sketch

2.5 Bit Record Table

Bit No	Size	Bit Manufacture	Type	IADC Code	Serial No	Jets	CMT	Depth		Metres	Hrs	Krev (for all runs)	WOB (klb)	Surface RPM	Pump Press	GPM		Mud Weight pcf		TFA	IR	OR	DC	Loc	B/S	G/16	OC	R Pulled
						N x Si		In	Out																			
1	6-1/8"	King Dream	R.Bit			Open	Yes	3857	3945	88	-	-	-	-	-	-	-	106	106	-	1	1	WT	A	E	I	NO	BHA
2	6-1/8"	King Dream	Tri-Cone Bit (HJT537G)	537	2304674JH	Open	No	3945	3966	21	30	-	2 – 18	10 – 40	2550 – 2750	190	200	106	106	-	2	2	WT	G	E	I	BT	DTF
3	6-1/8"	BESTE	PDC Bit	M1665	255421	Open	No	3966	4208	242	85	-	3 – 12	35 – 40	2650 – 2850	190	200	103	103	-	1	1	WT	A	X	I	NO	TD
2RR1	6-1/8"	King Dream	Tri-Cone Bit (HJT537G)	537	2304674JH	Open	No	4201	4201	-	-	-	-	-	2650 – 2850	190	200	103	103	-	1	1	CT	G	E	I	WT	DTF
3RR1	6-1/8"	BESTE	PDC Bit	M1665	255421	Open	No	-	-	-	-	-	-	-	1500 – 1700	150	300	103	103	-	1	1	WT	A	X	I	NO	TD
2RR2	6-1/8"	King Dream	Tri-Cone Bit (HJT537G)	537	2304674JH	Open	No	-	-	-	26	-	1 – 10	20 – 70	2150 – 2200	195	200	105	105	-	1	2	CT	A	E	I	WT	TD
2RR3	6-1/8"	King Dream	Tri-Cone Bit (HJT537G)	537	2304674JH	Open	Yes	3765	3871	106	4.5	-	5 – 12	50 – 60	2100 – 2300	190	200	105	105	-	1	2	CT	A	E	I	WT	TD
2RR4	6-1/8"	King Dream	Tri-Cone Bit (HJT537G)	537	2304674JH	Open	No	-	-	-	-	-	-	-	-	-	-	104.5	104.5	-	2	2	WT	A	E	I	BT	DTF

Table 2-4: AZNS-122 Bit Record Tabl

3. Time Analysis Report

3.1 Time vs. Depth Chart

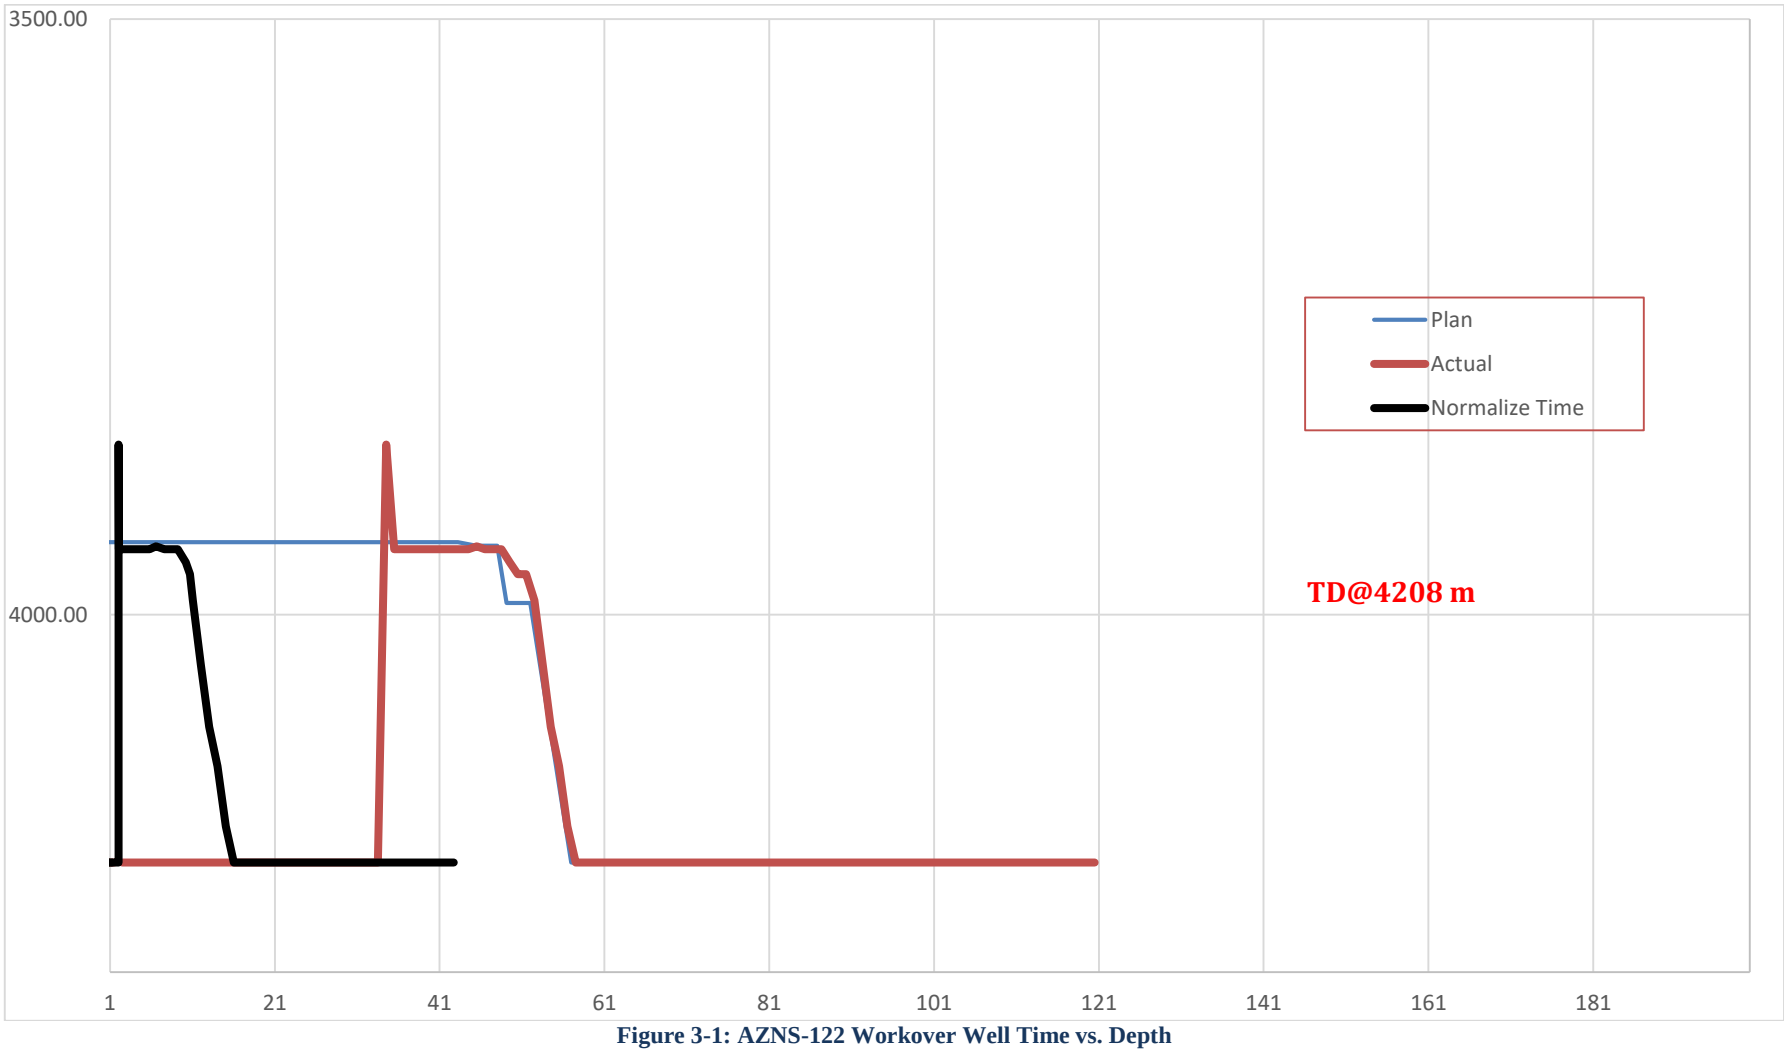


Figure 3-1: AZNS-122 Workover Well Time vs. Depth

3.2 Total Time Break-Down of Operation

WorkOver Section

De-Complete, Re-Complete Operation TBD of Well: AZNS-122 Work-over (Side Tracking)	IADC Code	Interval (meters)	Formation	Depth (meters)	ROP	Time Duration (Hours)	Time Duration (Days)	Total Duration (Days)	Contingency (%) 10	Time Duration w/ contingency (Hours)	Time Duration w/ contingency (Days)	Total Duration w/ contingency (Days)	Operation DESCRIPTION	Actual Hour	Comm Time. Days	NORM TIMES	Depth (m)	TIME	TIME
Work-over																			
Spud the Rig, Held PJSM. Check the wellhead for any damage or leakage. Record well head pressures; check the all annulus pressure. Check the return fluid & Bleed off any annulus pressure to Zero upon client's approval and recheck the well status. Spud the rig @ 2024/10/25 (04/08/1403) 00:00 to 2024/10/25 11:00)	Wellhead			3939		11	0.46	0.46	0.00	11.0	0.46	0.5	RIG UP: 100%, RIG SPUDDED @1403.08.06 12.00 OCLOCK WHILE STANS BACK TOTALLY 75 STD 3 1/2" & 75 STD 5" DPs & PREPARE 1000 BBL WBM (101 PCF), REMOVE TWCV F/TBG HGR, OPEN 35V WHILE APPLY 2500 PSI, BLEED OFF PRESS. TO 1000 PSI, NO BUILD UP THE WELL HD, RELEASE PRESS., SET 3.437" PROTECTION SLEEVE IN 35V, SET 2.75" PLUG & PRONG IN NO GO L.N., TEST SAME IN PROGRESS.	12.0	0.5	0.00	4208	2024.10.27	1403.08.6
Stand Back (75 Std 5" DP & 75 Std 3 1/2" DP) F/ 2024/10/25 11:00 to 2024/10/27 09:00)	Trip			3939		46.00	1.9	2.4	0.0	46.0	1.92	2.4	SET 2.75" PLUG & PRONG IN NO GO L.N., TEST SAME TO 5000 PSI, OK. OPEN SSD WHILE APPLY 4000PSI PRESS. IN STRG), POOH & R/D S/L TOOLS., START DIRECT CIRC. THRU. THE SSD WHILE GET 370BBL CABR2 (103PCF) IN A RESERVE TANK + 60BBL CABR2 (100 PCF) IN ISOLATED TANK, OBS. THE WELL, OK. RETRIEVE PROTECTION SLEEVE, CLOSE 35V, SET TWCV BPV IN TBG HGR, PERFORM PRESS. TEST AGAINST TWCV W/ 5000PSI, OK, N/D X-MASS TREE, N/U BOP STACK IS IN PROGRESS	24.0	1.50	0.00	4208	2024.10.28	1403.08.7
R/U J-Lubricator, R/U Slick Line, Set Protection Sleeve in 35V, set plug & prong in No-Go, Open SSD w/ shifting tools, displace the well w/ 101 PCF mud, retrive protection sleeve, set TWCV in TBG HGR	Completion			3939		39.00	1.6	4.0	0.0	39.0	1.63	4.0							
N/D X.M.T, N.U BOP & pressure test same F/2024/10/29 00:00 to 2024/10/29 19:00	N/D X.M.T & N/U BOP			3939		19.00	0.8	4.8	0.0	19.0	0.79	4.8	CONT. N/D X-MASS TREE, N/U 13 5/8"10K BOP STACK & TEST IT AS NIOC POLICY TO 7500 PSI (HYDRIL TO 3500 PSI) & RELATED LINES,OK. OPEN TIE-DOWN SCREWS AND PERFORM PRESS. TEST W/ 10000PSI, OK, RETRIEVE TWCV. UNLATCH COMP. ANCHOR SEAL, POOH & START RETRIEVING COMPL. STRG AS FOLLOW: B/O & L/D TBG HGR MSP, 10K, 11" * 4 1/2" + 4-1/2" FLUTED SWAGE+ 4JTS TBG 4-1/2"+ TRSSSV ASSY. +27 JTS TBG 4-1/2" TATALLY 31 JTS) WHILE CLEAN TBG BODY, THREADS & CROSS COUPLING PROTECTORS AND SPOOL BOTH 3/8" CILS ON REELS, CIRC. CROSS WELLHEAD, N.L-NG.	24.0	2.50	0.00	4208	2024.10.29	1403.08.8
M/U L.Jt, screw on TBG HGR, unlatch anchor seal. F/2024/10/29 19:00 to 2024/10/29 24:00	Completion			3939		5.00	0.2	5.0	0.0	5.0	0.21	5.0	CONT. POOH & RETRIEVING COMP. STRG TO 1750 M (L/D TOTALLY 205 JTS TBG 4-1/2", 18.9#, L-80,HSM3) WHILE CLEAN TBG BODY, THREADS & CROSS COUPLING PROTECTORS AND SPOOL BOTH 3/8" CILS ON REELS, CIRC. CROSS WELLHEAD AND MONITOR THE WELL, W/ N.L-NG.	24.0	3.50	0.00	4208	2024.10.30	1403.08.9
Retrieve completion string F/2024/10/30 00:00 to 2024/11/01 13:00	Completion			3939		61.00	2.5	7.5	0.0	61.0	2.54	7.5	CONT. POOH & RETRIEVING COMP. STRG TO 73 M (L/D 40 JTS TBG 4-1/2", 18.9#, L-80,HSM3, TOTALLY 205 JTS)+ XOS 4-1/2" HSM3 BOX * 3-1/2" HSM3 PIN+ 180 JTS TBG 3-1/2" 10.2#, L-80,HSM3 WHILE CLEAN TBG BODY, THREADS & CROSS COUPLING PROTECTORS AND SPOOL BOTH 3/8" CILS ON REELS, CIRC. CROSS WELLHEAD AND MONITOR THE WELL, W/ N.L-NG.	24.0	4.50	0.00	4208	2024.10.31	1403.08.10
RIH w/ 8 1/2" TCI Bit to 7" L.Lap, POOH to surface F/2024/11/01 13:00 to 2024/11/02 06:00	Trip			3939		17.00	0.7	8.3	0.0	17.0	0.71	8.3	CONT. POOH & RETRIEVING COMPL. STRG TO SURF. (L/D ALL COMPL. TOOLS), INSTALL WEAR BUSHING, RIH W/ 8 1/2" USED TCI BIT (OPEN) & CONVENTIONAL BHA TO 1998M, TAG WEIGHT & CONFIRMED 7" LNR LAP, CBU & POOH TO SURF. WHILE CIRC. CROSS WELLHEAD W/ N.L-NG. L/D BIT	24.0	5.50	0.00	4208	2024.11.01	1403.08.11
P/U & M/U & RIH w/ 6" M.M.J Mill to 1635m, Obs. Plug string, POOH to 1270 m, unplug string, Cont. RIH to 3721m. 2024/11/02 06:00 to 2024/11/03 09:00	Trip			3939		27.00	1.1	9.4	0.0	27.0	1.13	9.4	START POOH F/ 1998M (7" LNR LAP) TO SURF., L/D 8-1/2" TCI BIT, RIH W/6" J.MILL (5*15/32" PORT) TO 1635M WHILE F/U STRG PERIODICAL, OBS. STRING PLUG. WORK ON STRING TO UNPLUG, NO SUCC., POOH TO 1270M, CHECK STRING, OBS. STDM36 IS PLUGGED, L/D SAME, NORMAL CIRC. MUD & RUN BACK TO 3222M WHILE FILL UP STRING EVERY	24.0	6.50	0.00	4208	2024.11.02	1403.08.12
Start Milling the PKR, F/3721 to 3722 m 2024/11/03 09:00 to 2024/11/04 16:30	Milling			3939		31.50	1.3	10.7	0.0	31.5	1.31	10.7	CONT RIH W/6" JUNK MILL ASSY. TO 3721M (PKR DEPTH), TAG WEIGHT, START MILLING THE PACKER F/3721 TO 3721.8M WHILE PUMP HI VIS PILL SEVERAL STEPS W/NL-NG. OBS. TRACE OF OIL ON THE SHAKER & DEC. MW TO 72PCF, CLOSE HYDRILL & CIRC. VIA CHOCK MANIFOLD W/500 PSI BACK PRESSURE (DUMP 150 BBL MUD TO BURNING PIT) WHILE INC. SURFACE SYS. TO 108PCF, OPEN HYDRILL (MW/OUT-90 PCF), ESTABLISH NORMAL CIRC. F/SHAKER TO BALANCE MUD SYS. TO 108PCF W/NL-NG @R.T.	24.0	7.50	0.00	4208	2024.11.03	1403.08.13
due to ROP, POOH to surface, P/U & M/U 6" new M.M. Junk Mill & RIH to BTM 2024/11/04 16:30 to 2024/11/05 23:00	Trip			3939		30.50	1.3	12.0	0.0	30.5	1.27	12.0	CONT CIRC. VIA CHOCK MANIFOLD W/500 PSI BACK PRESSURE (DUMP 100 BBL MUD TO BURNING PIT) WHILE INC. SURFACE SYS. TO 109PCF, OPEN HYDRILL (MW/OUT-90 PCF), ESTABLISH NORMAL CIRC. F/SHAKER TO BALANCE MUD SYS. TO 109PCF, OBS. THE WELL. W/NL-NG, RESUME MILLING THE PACKER F/3721.8 TO 3722M, STOP MILLING DUE TO NO PROGRESS, CBU & POOH TO 30m @RT.	24.0	8.50	0.00	4208	2024.11.04	1403.08.14
Resume Milling PKR F/3722 to 3722.2 m, chase & push down 7" PKR to 4000 m 2024/11/05 23:00 to 2024/11/07 16:00	Milling			3939		41.00	1.7	13.7	0.0	41.0	1.71	13.7	CONT.POOH 6" M.M. J.MILL F/2000 TO SURF. P/U & M/U NEW 6" M.M.J MILL [5* 15/32" PORT),RIH W/ PREVIOUS MILLING BHA TO 3722 M, TAG 7" PKR, CONT. MILLING 7" PKR FROM 3722 M TO 3722.20M W/NL-NG @R.T.	24.0	9.50	0.00	4208	2024.11.05	1403.08.15
POOH 6" J. Mill to surface. 2024/11/07 16:00 to 2024/11/08 05:00	Trip			3939		13.00	0.5	14.2	0.0	13.0	0.54	14.2	MILLING 7" PKR FROM 3722 TO 3722.20 M W/ NL-NG. "CONT TRY TO MAKE PROGRESS IN MILLING OPERATION SUDDENLY RELEASE THE 7" PKR & MOVE DOWN PKR TO 3756M & PUSH DOWN F/ 3756 TO 4000 M , TOOK WEIGHT, TRY TO PUSH DOWN NO SUCC. CONT MILLING 7" PKR F/4000M TRY TO MAKE PROGRESS IN MILLING OPERATION WHILE APPLYING DIFFERENT PARAMETERS @R.T.	24.0	10.50	0.00	4208	2024.11.06	1403.08.16
M/U 2" * 4" taper Tap & RIH to 4000.15 m, Tag TOF, Sting in inside fish, POOH to surface. 2024/11/08 05:00 to 2024/11/10 07:00	Trip			3939		50.00	2.1	16.3	0.0	50.0	2.08	16.3	MOVE DOWN PKR FROM 3722.20 TO 3756M & PUSH DOWN F/3756 TO 4000 M , TOOK WEIGHT, TRY TO PUSH DOWN NO SUCC. CONT MILLING 7" PKR F/4000 TO 4000.15 M W/NL-NG. TRY TO MAKE PROGRESS IN MILLING OPERATION; NO SUCC. POOH F/4000.15 TO SURF & L/D 6" M.M.J.MILL (100 % USED) ,M/U & RIH W/ 2"-4" TAPER TAP & FISHING BHA TO 50M @R.T	24.0	11.50	0.00	4208	2024.11.07	1403.08.17
P/U & M/U 6" M.M.J.Mill & RIH to 4011 m. 2024/11/10 07:00 to 2024/11/11 02:00	Trip			3939		19.00	0.8	17.1	0.0	19.0	0.79	17.1	POOH TO SURF & L/D 6" M.M.J.MILL (100 % USED), M/U & RIH W/ 2" * 4-1/4" TAPER TAP (CYLINDER5421, S/N: CS6670) & FISHING BHA TO 4000.15M, TAG TOP OF FISH. CIRC. WITH HIGH F.R TO CLEAN TOP OF FISH, TAP IN FISH (10 RPM, 5KLB.FT TQ). APPLY 15KLBS WEIGHT. RELEASE TQ, P/U STRING; ENGAGED WITH FISH AND STUCK WORK ON STUCK W/ MAX 40KLBS OVER PULL, GOT FREE, POOH F/ 4000.15M TO 3778M W/ CONTINUS 10KLBS OVER PULL AND STUCK AGINE, WORK ON STUCK W/ MAX 30KLBS OVER PULL; NO SUCC@R.T.	24.0	12.50	0.00	4208	2024.11.08	1403.08.18
Commence Milling & clean out F/4011 to 4095.8 m 2024/11/11 02:00 to 2024/11/14 13:30	Milling			3939		83.50	3.5	20.6	0.0	83.5	3.48	20.6	CONT WORK ON STUCK@4000.15 M ; GOT FREE, POOH TO 3778M W/ CONTINUS 10KLBS DRAG. OBS. UNABLE TO PASS THIS POINT. CHECK DOWNWARD MOVEMENT; FREE. WORK ON STRING ; SUCCESSFULLY PASSED 3778M. CONT. POOH TO SURF., OBS RECOVER FISH ON SURF INCLUDING : (3-1/2" MULE SHOE + 3-1/2" BTM NO GO (PRONG & PLUG IN NO GO) + 1 JT TUBING 3-1/2", 10.2#, L-80,HSM3 + 1 JT PUP JOINT 3-1/2", 10.2#,HSM3 + 7" PKR + SMALL AMOUNT COIL TUBING IN MULE SHOE) @R.T.	24.0	13.50	0.00	4208	2024.11.09	1403.08.19

POOH to surface, P/U & M/U & RIH with new 6" M.M.J Mill to 4095.8 m 2024/11/14 13:30 to 2024/11/16 11:00	Trip			3939		45.50	1.9	22.5	0.0	45.5	1.90	22.5	CONT. POOH TO SURF , OBS RECOVERED FISH, P/U & M/U 6" M.M.JUNK MILL & BHA MILLING TO 4008 M TOOK WEIGHT (T.O.F) PUSH DOWN TO 4011M TRY TO PUSH DOWN, NO SUCC,'COMMENCE MILLING W/ 6" M.M.J.MILL F/ 4011 TO 4016 M W/NL-NG @R.T.	24.0	14.50	0.00	4208	2024.11.10	1403.08.20
Resume Milling & clean out inside 7" LNR F/4095.8 to 4112.8 m, string got stuck 2024/11/16 11:00 to 2024/11/18 11:00	Milling			3939		48.00	2.0	24.5	0.0	48.0	2.00	24.5	CONT.RIH W/ 6" M.M.JUNK MILL TO 4008M. PUSH DOWN TO 4011M. PERFORM MILLING AND CLEAN OUT F/ 4011 TO 4077 M. DUE TO OBS. GAS CUT MUD ON SHAKER & DEC MW TO 90 PCF, CIRC. AND UNIFORM MW IN & OUT ON 106 PCF.CONT. MILLING AND CLEAN OUT F/ 4077 TO 4079 M W/NL-NG WHILE OBS. FORMATION SAMPLE ON SHAKER @R.T.	24.0	15.50	0.00	4208	2024.11.11	1403.08.21
Work on string stuck 2024/11/18 11:00 to 2024/11/25 02:00	Fishing			3939		159.00	6.6	31.1	0.0	159.0	6.63	31.1	CONT. MILLING AND CLEAN OUT F/ 4077 TO 4080.40M W/NL-NG DUE TO FAILURE WEIGHT INDICATOR SENSOR , HKLD SENSATOR),POOH TO 4020M, CIRC MUD THRU STRING & REPAIR HKLD SENSATOR, RUN BACK FROM 4020 TO 4080.4M,CONT MILLING AND CLEAN OUT TO 4081.80M & RIH W/ WASHDOWN & REAM F/4081.80M TO 4088.70M,CONT. MILLING AND CLEAN OUT F/4088.70M TO 4092.2 M & PUMP HI.VIS PILL PERIODICALLY W/NL-NG @R.T.	24.0	16.50	0.00	4208	2024.11.12	1403.08.22
R/U wire line & RIH wire line as dummy run for electrical back off	Logging			3939		6.00	0.3	31.3	0.3	6.60	0.3	31.4	CONT MILLING OPERATION FROM 4091.20 TO 4092.90M,DUE TO STRING STALL AND TORQUE FLUCTUATION, DRESS 4091M TO 4092.90M INTERVAL SEVERAL,CONT MILLING OPERATION F/4092.90 TO 4095.50 M WHILE WHILE OBS STRING STALL AND TORQUE FLUCTION W/NL-NG@R.T.	24.0	17.50	0.00	4208	2024.11.13	1403.08.23
RIH w/ electrical back off Assy, perform back off string, confirm back off depth with CCL, POOH wire line to surface & R/D same	Logging			3939		24.00	1.0	32.3	1.1	26.40	1.1	32.5	CONT MILLING OPERATION FROM 4094.2M TO 4095.8MW/NL-NG, DUE TO STRING STALL AND TORQUE FLUCTUATION, DRESS INTERVAL 4090M TO 4095.80M SEVERAL TIMES,, POOH TO SURF WHILE FLOW CHECK, WELL @ BHA STATIC.P/U & M/U 6" M.M.JUNK MILL (5*15/32" PORTS,) & MILLING BHA TO 300 M WHILE FILL UP STRING EACH 10 STD W/NL-NG @R.T.	24.0	18.50	0.00	4208	2024.11.14	1403.08.24
POOH string to surface.	Trip			3939		16.00	0.7	33.0	0.7	17.60	0.7	33.2	CONT. POOH 6" MILLING BHA F/ 881M TO SURF , CHECK THE MILL CONDITION (70% USED), M/U & RIH NEW 6" MILL AND MILLING BHA TO 1500 M, PERFORM SLIP & CUT DRLG LINE, CONT. RIH W/ 6" MILLING BHA TO 3900M ON ELEVATOR, CONN. TDS AND CONT. RIH W/ 6" MILLING BHA W/ WASH DOWN F/ 3900 TO 4093M, OBS. TOOK WT @ 4093M, RESUME MILLING & CLEAN OUT OPERATION F/4093 TO 4094.5M, OBS. TQ FLUCTUATION & STRING STALL, DRESS IT,DUE TO TDS SAVER SUB FAILURE POOH TO 4079, WORK ON TDS,OK,'RIH BACK & CONT. DRESSING F/ 4093 TO 4094.5M W/NL-NG@R.T.	24.0	19.50	0.00	4208	2024.11.15	1403.08.25
RIH with 3 1/2" or 2 7/8" Open End DPs .	Trip			3939		24.00	1.0	34.0	1.1	26.40	1.1	34.3	WORK ON TDS,OK.DRESSING F/4093 TO 4094.5M OBS STALL STRG, DUE TO TDS SAVER SUB FAILURE POOH TO 4079, WORK ON TDS,OK, RIH BACK & CONT. DRESSING F/ 4093 TO 4095.80M ,PUMP HI-VIS PILL CHECK DITCH MAGNET RECOVERED (METAL-LIMESTON-ASPHALT), RESUME MILLING & CLEAN OUT INSIDE 7" LNR F/ 4095.8 TO 4107 M WHILE PUMP HI-VIS PILL PERODICALLY W/ NL-NG @R.T.	24.0	20.50	0.00	4208	2024.11.16	1403.08.26
Set 15 bbl CMT Balance plug job (Estimated TOC: 3900m)	CMT			3939		8	0.3	34.3	0.4	8.80	0.4	34.7	CONT. MILLING AND CLEAN OUT INSIDE 7" LNR F/ 4103.8 TO 4109.7M, STRING GOT STUCK @ 4109.7M, WORK ON STUCK AND MAKE IT FREE, CONT. HARD MILLING & CLEAN OUT INSIDE 7" LNR F/ 4109.7 TO 4112.2M, WHILE OBS. STRG STALL @ 4109.7M SEV. TIMES, PUMP HI-VIS PILL AND CLEAN DITCH MAGNET PERIODICALLY W/NL-NG @R.T.	24.0	21.50	0.00	4208	2024.11.17	1403.08.27
POOH 10 std. Flush string, Cont. POOH to surface.	Trip			3939		24	1.0	35.3	1.1	26.40	1.1	35.8	CONT. MILLING AND CLEAN OUT INSIDE 7" LNR F/ 4110.8 TO 4112.2M, STRING GOT STUCK , WORK ON STUCK W/ MAX. 10KLBS.FT TQ, 150KLBS DOWNWARD WT. & 170KLBS OVERPULL, NO SUCCESS, PREPARE 65BBL HI-VIS PILL (10% LUBRICANT) AND CIRC. OUT TILL HI-VIS REACH ANNULUS, CONT. WORK ON STUCK W/ MAX. WITH SAME PARAMETERS IRC. THRU STRING WITH 100 GPM, 1200PSI MEANWHILE PREPARE 40 BBL PIPELAX PILL 'PUMP 15 BBL PIPELAX PILL (5%) & CIRC. OUT TILL 1 BBL OF PIPELAX OUT OF MILL,CONT. WORK ON STUCK WITH SAME PARAMETERS MEANWHILE PUMP 1 BBL INTO STRING EVERY HALF AN HOUR, CLOSE ANNULAR BOP & APPLY 1000PSI IN ANNULUS, OBS. PRESSURE DROP TO ZERO DUE TO INJECTION INTO FORMATION, NO SUCCESS TO RELEASE THE STUCK@R.T	24.0	22.50	0.00	4208	2024.11.18	1403.08.28
P/U & M/U 6" Tri Cone Bit & D/O BHA & RIH to TOC,	D/O			3939		20.00	0.8	36.2	0.9	22.00	0.9	36.7	CONT.WORK ON STUCK PIPES @4112.5M BY SLACK OFF 100 KIPS WT AS DOWNWARD & 170 KIPS OVERPULL ALSO APPLY MAX 10 kft.lbs TORQUE IN STRING WHILE SLACK OFF 20 KIPS WT & 30 KIPS OVERPULL W/NO RESULT(DURING OPERATION PUMP 15 BBL PIPELAX PILL (5%) & CIRC. OUT TILL 1 BBL OF PIPELAX OUT OF MILL, HESITATE 1 BBL EVERY HALF AN HOUR & WORK ON STUCK, CLOSE ANNULAR BOP & APPLY 1000PSI IN ANNULUS, OBS. PRESSURE DROP TO ZERO DUE TO INJECTION INTO FORMATION)	24.0	23.50	0.00	4208	2024.11.19	1403.08.29
D/O CMT to 3945 m	Circ.			3939		8.00	0.3	36.5	0.4	8.80	0.4	37.0	CONT.WORK ON STUCK PIPES @4112.5M BY SLACK OFF 100 KIPS WT AS DOWNWARD & 170 KIPS OVERPULL ALSO APPLY MAX 10 kft.lbs TORQUE IN STRING WHILE SLACK OFF 20 KIPS WT & 30 KIPS OVERPULL W/NO RESULT, R/U SEALAND WIRE LINE EQUIP., RIH W/ 2-1/8" CCL AS DUMMY RUN TO 1722.5M, OBS. CABLE TENSION DROP, TRY TO PASS W/NO SUCCESS, POOH & RUN BACK W/1-11/16" CCL TO 4100M, POOH & L/D TOOLS WHILE CIRC. C.W.HD, NL-NG.	24.0	24.50	0.00	4208	2024.11.20	1403.08.30
Perform C.B.U to sweep the well.	Circ.			3939		4.00	0.2	36.7	0.2	4.40	0.2	37.2	PERFORM FREE POINT OPERATION AS FOLLOW: DUMMY RUN W/ 1-11/16" TOOL STRING TO 4100M, POOH. RIH W/ 1-3/8" FPIT STRING TO 4108M AND CHECK 13 POINTs (APPLY STRECH & TORQUE), RESULT:4078M (FREE), 4088(90% FREE), 4098 (95% STUCK), 4107(100% STUCK), POOH AND L/D TOOLS, R/D LOGGING EQUIP., CONT. WORK ON STUCK W/ APPLYING MAX. 80 KIPS DOWNWARD WT. & 150 KIPS OVERPULL WHILE CIRC. THRU. STRG W/NO SUCCESS & WAIT ON RECIEVE EXPLOSION MATERIALS, NL-NG.	24.0	25.50	0.00	4208	2024.11.21	1403.09.01
POOH 1 Std, Perform Positive Pressure Test CMT Plug w/ 2000 psi.	Testing			3939		3.00	0.1	36.8	0.1	3.30	0.1	37.4	CONT. WORK ON PIPE STUCK @4112M W/ APPLYING MAX. 80 KIPS WT AS DOWNWARD & 150 KIPS OVERPULL WHILE CIRC. THRU. STRG (F.R: 100GPM, SPP:1200PSI), SPOT 15 BBL CITRIC ACID SOLUTION (30 PPB MIX W/WATER, PH: 4.5) & WORK ON STUCK TO MAKE STRING FREE W/NO RESULT, CIRC. OUT ACID SOLUTION W/NL-NG. CONT. WORK ON PIPE STUCK & WAIT ON RECIEVE EXPLOSION MATERIALS	24.0	26.50	0.00	4208	2024.11.22	1403.09.02
Cont. POOH to surface. =	Trip			3939		24.00	1.0	37.8	1.1	26.40	1.1	38.5	CONT. WORK ON PIPE STUCK @4112M W/ APPLYING MAX. 80 KIPS WT AS DOWNWARD & 150 KIPS OVERPULL WHILE CIRC. THRU. STRG (F.R: 110GPM, SPP:1100PSI) W/NO SUCC. & WAIT ON RECIEVE EXPLOSION MATERIALS TOTALLY 57 hrs), NL-NG.	24.0	27.50	0.00	4208	2024.11.23	1403.09.03
P/U & M/U 6" Tri cone bit & 7" Scraper, RIH to 3945 m while scrap whipstock depth interval	Trip			3939		24.00	1.0	38.8	1.1	26.40	1.1	39.6	CONT. WORK ON PIPE STUCK @4112M W/ APPLYING MAX. 80 KIPS WT AS DOWNWARD & 150 KIPS OVERPULL W/NO SUCC. & WAIT ON RECIEVE EXPLOSIVE MATERIALS (TOTALLY 70 hrs), RECEIVE SAME @ 19:00 OCLOCK. WAIT DAY ON DAY LIGHT, DISPLACE STRING W/ FRESH MUD, RIH W/ 1-11/16" CCL +WT BAR TO 4100M AS DUMMY RUN, POOH IN PROGRESS WHILE CIRC. C.W.H, NL-NG	24.0	28.50	0.00	4208	2024.11.24	1403.09.04
Perform C.B.U to sweep the well.	Circ.			3939		4.00	0.2	39.0	0.2	4.40	0.2	39.7	RIH W/ 1-11/16" CCL +WT BAR TO 4100M AS DUMMY RUN, POOH, DISPL. STRING W/ FRESH MUD, RIH W/1-11/16" CHT+CCL + WT BAT+ SHOOT BAR (ARMED W/12 STRANDS) TO 4074M, APPLY LEFT-HAND TORQUE BY ROTARY TABLE (11 TURNS, MAX TQ: 9KLBS.FT, MAX PULL: 325KLBS), FIRE THE SHOOT BAR & NO OBVIOUS EFFECT ON STRING, DECIDED TO POOH TOOLS STRING, OBS. SHOOTING BAR (LEN: 2.2M) LEFT IN STRING, L/D TOOLS & TRY TO CIRC. INSIDE STRING W/NO SUCC., STRING PLUGGED. PERFORM MECHANICAL BACK OFF (13.5TURNS IN LEFT, MAX TQ: 10KLBS.FT, MAX PULL: 380KLBS), OBS. EFFECT ON STRING, P/U STRING W/DRAG. R/D WIRELINE EQUIP. AND POOH 6" MILLING BHA F/ 4086 TO 2361M WHILE CIRC. C.W.HD, NL-NG.	24.0	29.50	0.00	4208	2024.11.25	1403.09.05
POOH to surface, L/D 6" Bit & 7"scraper	Trip			3939		18.00	0.8	39.7	0.8	19.80	0.8	40.6	START POOH 6" MILLING STRING F/ 4086M TO SURF., OBS. STRING BACK OFF @4074M AND 6" M.M.J.MILL +4-3/4" BIT SUB +4 JTS 4-3/4" D.C LEFT IN THE HOLE. (TOF-4074.7M, LENGTH:37.3M), PERFORM BOP TEST AS NIOC POLICY W/ 7500PSI (HYDRIL W/ 3500PSI), OK, RIH W/14 JTS 2-7/8" DPS (1T BY JT) AS OPEN END TO 125M W/NL-NG @R.T.	24.0	30.50	0.92	4208	2024.11.26	1403.09.06
Perform BOP Test as per NIOC Policy.	BOP Test			3939		6.00	0.3	40.0	0.3	6.60	0.3	40.8	CONT. BOP TEST AS NIOC POLICY W/ 7500PSI, OK, RIH W/14 JTS 2-7/8" DPs & 68 STDs 3 1/2" DP FOLLOWED BY 5" DPs AS OPEN END TO 4042M WHILE CLEAN AND PASS RABBIT THRU. EVERY JT & BREAK CIRC. EVERY 7JTS W/NL-NG. CIRC. THRU. STRING & WORK ON MUD PROPERTIES WHILE WAIT ON RECEIVE CMT & ADD & PUMP UNIT @RT.	24.0	31.50	1.21	4208	2024.11.27	1403.09.07
P/U & M/U & R.I.H. with 7" permanent hydraulic set Whipstock (Suitable for 7" LNR, 29#) include UBHO sub, align whipface to UBHO (gyro sub). RIH to setting depth at 3939 m.	Side Track			3939		30	1.3	41.2	1.4	33.00	1.4	42.2	CONT. RIH W/DPs AS OPEN END TO 4042M, CIRC. THRU. STRING WHILE WAIT ON RECEIVE CMT & PUMP UNIT. RECEIVE CMU UNIT & ADDITIVE @17:00 OCLOCK, RIH TO 4070M, R/U SURF. LINE & TEST SAME TO 3000 PSI,OK. PERFORM CMT PLUG JOB AS BALANCE (S.W:118 PCF, S.V:26 BBL), POOH F/4070 TO 3800M & FLUSH STRING & CBU, CONT. POOH TO 2600M WHILE F/U HOLE W/NL-NG @RT.	24.0	32.50	2.04	4208	2024.11.28	1403.09.08
R/U wireline, Run gyro, Orient whipface and adjust toolface. POOH gyro, L/D wireline	Side Track			3939		16	0.7	41.9	0.7	17.60	0.7	43.0	POOH F/4070 TO 3800M & CBU, CONT. POOH TO SURF., RIH W/6 1/8" M.T BIT (OPEN, USED) & CLEAN OUT ASSY. TO 2300M W/NL-NG @RT.	24.0	33.50	2.04	4208	2024.11.29	1403.09.09

Table 3-1: AZNS-122 WorkOver Time Breakdown

Side – Track & Completion Section

De-Complete, Re-Complete Operation TBD of Well: AZNS-122 Work-over (Side Tracking)	IADC Code	Interval (meters)	Formation	Depth (meters)	ROP	Time Duration (Hours)	Time Duration (Days)	Total Duration (Days)	Contingency (%) 10	Time Duration w/ contingency (Hours)	Time Duration w/ contingency (Days)	Total Duration w/ contingency (Days)	Operation DESCRIPTION	Actual Hour	Cumm Time. Days	NORM TIMES	Depth (m)	TIME	TIME
Work-over																			
Set whipstock packer (as per procedure) and check. Pull string upward and shear mill pins	Side Track			3939		6.00	0.3	42.1	0.3	6.60	0.3	43.2	CONT RIH W/6-1/8" M.T BIT & CLEAN OUT ASSY. F/1030 TO 3857M, TAG CMT. START D/O HARD CMT FROM 3857 TO 3940M WHILE PUMP HI-VIS PILL PERIODICALLY W/NL-NG @RT.	24.0	34.50	2.08	3857	2024.11.30	1403.09.10
Start opening window in 7" LNR and drill to 3m inside formation. Check window condition.	Side Track	3	Fah.	3942	1	48.00	2.0	44.1	2.2	52.80	2.2	45.4	CONT. D/O HARD CMT FROM 3910 TO 3945M, CBU TILL SHAKER CLEAN, POOH TO 3938M. PRESSURIZED ANNULUS AS POSITIVE TEST OF CMT PLUG TO 1900 PSI/15 MIN OK. POOH TO SURF., RIH W/6-1/8" M.T BIT (OPEN) +7" SCRAPER TO 900M @R.T.	24.0	35.50	2.08	3945	2024.12.01	1403.09.11
POOH to surface & L/D Mill	Trip		Fah.	3942		24	1.0	45.1	1.1	26.40	1.1	46.5	CONT POOH F/212 M TO SURF., RUN BACK W/6-1/8" M.T BIT & 7" SCRAPER TO 3645M, CONT. LOWERING F/3645 TO 3945M (TOC) WHILE PERFORM SCRAP TWO TIME'S EACH STAND, PUMP 40 BBL HI VIS PILL & CBU W/FRESH MUD (INCLUDED FER-O-BAR) IN PROGRESS W/NL-NG	24.0	36.50	3.00	3945	2024.12.02	1403.09.12
P/U & M/U 6" Tri-cone Bit & Directional BHA, Perform shallow hole test & toolface alignment.	Trip		Fah.	3942		8	0.3	45.5	0.4	8.80	0.4	46.9	CONT RIH F/ 3830 TO 3945M (TOC) WHILE PERFORM SCRAPE SEVERAL TIME'S EACH STAND'S, PUMP 40 BBL HI-VIS PILL, CBU TILL UNIFORM TOTAL MUD SYSTEM (FRESH MUD INCLUDED FE-RO-BAR), SPOT 30 BBL HI-VIS PILL, POOH 6 1/8" M.TOOTH BIT & 7" SCRAPER F/ 3945M TO SURF, NL-NG @ RT	24.0	37.50	3.88	3945	2024.12.03	1403.09.13
RIH 6" Dir. Drlg BHA to BTM, Perform Break Circ.	Trip		Fah.	3942		24	1.0	46.5	1.1	26.40	1.1	48.0	RIH 7" WHIPSTOCK ASSY. (INCLUDE: 4 3/4" RUNNING TOOLS, 6 1/8" TRI-MILL, HYDRAULIC WHIPFACE, HYDRAULIC PKR) & RELATED BHA TO 528M, SET & R/U WIRELINE LOGGING EQUIPMENT, RIH GYRO TOOLS AS DUMMY RUN TO 372M, TOOK WEIGHT, TRY TO PASS THIS POINT SEVERAL TIMES, NO SUCC, POOH GYRO TOOLS TO SURF, POOH STRING TO 20M MEANWHILE CHECK BHA @ SEVERAL TIMES WITH RUN GYRO TOOLS WHILE L/D 6 JTS 4-3/4" D.C, RESUME RIH WHIPSTOCK ASSY. F/ 20 TO 2144M, NL-NG @ RT	24.0	38.50	4.58	3945	2024.12.04	1403.09.14
Start D.Drilling to 3990 m (+/- 50m below KOP)	Drilling	50	Fah.	3990	2	25.00	1.0	47.5	1.1	27.50	1.1	49.1	CONT POOH W/ WHIPSTOCK ASSY. F/ 145 TO 20M MEANWHILE CHECK BHA @ SEVERAL TIMES WITH RUN GYRO TOOLS WHILE L/D TOTALLY 6 JTS 4-3/4" D.C, RESUME RIH WHIPSTOCK ASSY. F/ 20 TO 3228M, NL-NG @ RT	24.0	39.50	5.25	3945	2024.12.05	1403.09.15
Perform CBU to sweep the well	Circ.		Fah.	3990		3	0.1	47.6	0.1	3.30	0.1	49.3	CONT RUN WHIPSTOCK ASSY. (HPOGC) F/ 2557 TO 3942M, RIH W/ GYRO TOOLS TO 3922M (GYRO SUB DEPTH), LATCH IN & TRY TO RECEIVE SIGNAL, NO SUCC, NO REAL DATA @ 3922M TEMPERATURE (120 °C), POOH GYRO TOOLS TO SURF, L/U CMT LINES, TRY TO SHEARING PIN HFBPV WITH PUMP TRUCK (SPAD ENERGY CO.), NO SUCCESS, SHEARING PIN HFBPV BY RIG PUMP WITH SPP: 2500PSI / F.RATE : 300GPM, OK. TRY TO SET WHIPSTOCK ACCORDING PROCEDURE BY WHIPSTOCK SUPERVISOR (HPOGC) @ 3942M BY PUMP TRUCK @ 3 STEPS TO MAX 6000PSI, NO SUCC, POOH WHIPSTOCK ASSY. (HPOGC) F/ 3942 TO 3788M, NL-NG @ RT	24.0	40.50	5.79	3945	2024.12.06	1403.09.16
POOH to 3900 m,	Trip		Fah.	3990		2	0.1	47.7	0.1	2.20	0.1	49.4	CONT TRY TO SET WHIPSTOCK ACCORDING PROCEDURE BY WHIPSTOCK SUPERVISOR (HPOGC) @ 3942M BY PUMP TRUCK @ 3 STEPS TO MAX 6000PSI, NO SUCC, POOH WHIPSTOCK ASSY. (HPOGC) F/ 3942 TO 100M, NL-NG @ RT	24.0	41.50	5.79	3945	2024.12.07	1403.09.17
Observe the well	Well Control		Fah.	3990		1	0.0	47.8	0.0	1.10	0.0	49.4	CONT POOH WHIPSTOCK ASSY. (HPOGC) F/ 1255M TO SURF, OBS HFBPV IS PLUGGED WITH DEBRIS, RIH STRING AS OPEN END BHA TO 3945M (CMT TOP), CBU, SPOT 30 BBL HI-VIS PILL, POOH TO 3200M, NL-NG @ RT	24.0	42.50	5.79	3945	2024.12.08	1403.09.18
Cont. POOH to surface, L/D Tri Cone Bit	Trip		Fah.	3990		18.0	0.8	48.5	0.8	19.80	0.8	50.2	CBU @ 3945M (CMT TOP), SPOT 30 BBL HI-VIS PILL, POOH OPEN END BHA F/ 3945M TO SURF, RIH 7" HYDRO-MECHANICAL SET WHIPSTOCK ASSY. & RELATED BHA TO 1955M, NL-NG @ RT	24.0	43.50	5.79	3945	2024.12.09	1403.09.19
Perform BOP Test as per NIOC policy	BOP Test		Fah.	3990		6.0	0.3	48.8	0.3	6.60	0.3	50.5	CONT RIH 7" WHIPSTOCK ASSY. (HYDRO-MECHANICAL SET, HPOGC) F/ 760 TO 3945M (TOC), L/U PUMP TRUCK. SET 7" HYDRO-MECHANICAL WHIPSTOCK AS: APPLY 25KLBS WEIGHT, SHEARED SHEARING PIN HFBPV, OK. SET HYDRO WHIPSTOCK PKR @ 3944M W/ 3500 PSI. BLEED OFF PRESS TO ZERO & THEN SHEAR THE SHEAR SCREW ON THE RUGBY MILL, BREAKING RUGBY MILL PLUGGED NOZZLE W/ ROTATE STRING, OK. COMMENCE OPEN THE WINDOW ON 7"LNR AS MILLING TO SIDE TRACKING F/ 3938.9 TO 3939M, NL-NG @ RT	24.0	44.50	5.79	3945	2024.12.10	1403.09.20
P/U & M/U 6" PDC Bit & D. Drilling BHA, Perform shallow hole test	Trip		Fah.	3990		8.0	0.3	49.1	0.4	8.80	0.4	50.9	L/U PUMP TRUCK. SET 7" HYDRO-MECHANICAL WHIPSTOCK AS: APPLY 25KLBS WEIGHT, SHEARED SHEARING PIN HFBPV, OK. SET HYDRO WHIPSTOCK PKR @ 3944M W/ 3500 PSI. BLEED OFF PRESS TO ZERO & THEN SHEAR THE SHEAR SCREW ON THE RUGBY MILL, BREAKING RUGBY MILL PLUGGED NOZZLE W/ ROTATE STRING, OK. COMMENCE OPEN THE WINDOW ON 7"LNR AS MILLING TO SIDE TRACKING THE WELL F/ 3938.9 TO 3941.5M (KOP), COMMENCE DRLG 6 1/8" H.S TO SIDE TRACKING THE WELL F/ 3941.5 TO 3944M, NL-NG @ RT	24.0	45.50	6.58	3942.6	2024.12.11	1403.09.21
RIH 6" Dir. Drlg BHA to BTM, Perform Break Circ.	Trip		Fah.	3990		24.0	1.0	50.1	1.1	26.40	1.1	52.0	CONT DRLG 6 1/8" H.S W/ TRI MILL TO SIDE TRACKING THE WELL F/ 3942.6 TO 3945M, DRESS & SMOOTH WINDOW OPENED & DRILLED INTERNAL SEVERAL TIMES, OK, PUMP 30BBL HI-VIS PILL, CBU, POOH WHIPSTOCK RUNNING TOOLS & TRI MILL F/ 3945 TO 350M, NL-NG @ RT	24.0	46.50	7.58	3945	2024.12.12	1403.09.22
Resume D.Drilling 6" hole section f/ 3990 m to section TD @ 4208 m.	Drilling	218	Fah.	4208	2	109.0	4.5	54.6	5.0	119.90	5.0	57.0	CONT POOH WHIPSTOCK RUNNING TOOLS & TRI MILL F/ 2295M TO SURF MEANWHILE MAKE STDS 15JTS 3 1/2" HWDP, PERFORM 13 5/8"-10K BOP PRESS TEST AS NIOC POLICY AFTER WORK ON SEVERAL LEAKAGES TO RECTIFY, OK., CONT MAKE 3 1/2" HWDP STDS, CLEAN & PASS RABBIT & R/B SAME., M/U 6-1/8" DIR. DRLG BHA INCLUDING: 6-1/8" INSERT BIT (NEW, OPEN, 537) + 4-3/4" PDM (AKO:1.5 DEG) IS IN PROGRESS, NL-NG @ RT	24.0	47.50	8.29	3945	2024.12.13	1403.09.23
Perform CBU to sweep the well	Circ.		Fah.	4208		4.0	0.2	54.8	0.2	4.40	0.2	57.2	CONT MAKE 3 1/2" HWDP STDS: CLEAN & PASS RABBIT & R/B SAME., M/U 6-1/8" INSERT BIT (NEW, OPEN, 537) + 4-3/4" PDM (AKO:1.5 DEG) + MWD, RIH TO 3945M (BTM), BREAK CIRC IS IN PROGRESS, NL-NG @ RT	24.0	48.50	9.21	3945	2024.12.14	1403.09.24
POOH as Condition trip to 3940 m	Trip		Fah.	4208		8.0	0.3	55.1	0.4	8.80	0.4	57.5	CONT RIH 6-1/8" INSERT BIT (NEW, 537, OPEN) & DIR. DRLG BHA (AKO:1.5DEG) F/ 2891 TO 3945M (BTM), CBU MEANWHILE ADDED LIMESTONE MUD 104PCF (APPROX 150BBL) TO ACTIVE MUD SYS. SLOWLY, MIX & UNIFORM SAME, RESUME DIR. DRLG 6 1/8" H.S AS ROTATION MODE TO SIDE TRACK THE WELL F/ 3945 TO 3961.5M, NL-NG @ RT	24.0	49.50	10.21	3956	2024.12.15	1403.09.25

Observe the well	Well Control		Fah.	4208		0.0	0.0	55.1	0.0	0.00	0.0	57.5	CONT DIR. DRLG 6 1/8" H.S AS ROTATION MODE TO SIDE TRACK THE WELL F/ 3956 TO 3968M, DUE TO LOW ROP & MWD SIGNAL WAS LOST, DECIDED TO POOH: POOH 6 1/8" INSERT BIT & DIR. DRLG BHA F/ 3968M TO SURF, NL-NG @ RT	24.0	50.50	10.71	3966	2024.12.16	1403.09.26
RIH back to BTM	Trip		Fah.	4208		8.0	0.3	55.5	0.4	8.80	0.4	57.9	CONT POOH F/ 3968M TO SURF., L/D DHM & BIT & MWD TOOLS (MWD FAILED), CHANGE SAME W/NEW ONE, P/U 6-1/8" NEW DHM (7/8,6 STAGE,0.37 rev/gal,AKO:1.5)+ 4-3/4" F.SUB+ 4-3/4" UBHO + 4-3/4" NFMDC, SURF. TEST,OK. P/U & M/U 6-1/8" PDC BIT (NEW, OPEN, BESTE, IADC: M323) AND CONT. RIH W/ 34JTS 3-1/2" H.W.D.P + 4-3/4" JAR + 1JT 3-1/2" H.W.D.P TO 345M, CONT. LOWERING FOLLOWED BY 3-1/2" & 5" DPs TO 2000M WHILE PERFORM SHALLOW TEST@ 520 & 1502 & 1908M (OK) W/ N.L-N.G.	24.0	51.50	10.71	3966	2024.12.17	1403.09.27
Perform CBU to sweep the well	Circ.		Fah.	4208		4.00	0.2	55.6	0.2	4.40	0.2	58.1	CONT RIH W/6 1/8" PDC BIT & DIR.BHA (AKO:1.5) FOLLOWED BY DPs F/1356 TO 3949M. WASH DOWN F/3949 TO 3968M (BTM), RESUME DIR. DRLG AS ROTATING MODE F/3966 TO 3988M WHILE DECREASE MW F/106 TO 105 PCF DUE TO POM & SPP LIMITATION (PDM OPERATIONAL PRESS. IS HIGHER THAN NORMAL SITUATION) W/ N.L-N.G.	24.0	52.50	11.04	3988	2024.12.18	1403.09.28
POOH to surface, L/D 6" PDC Bit & Dir. Drig BHA	Trip		Fah.	4208		30.00	1.3	56.9	1.4	33.00	1.4	59.5	CONT. DIR. DRLG AS SLIDE & ROTATING MODE F/3988 TO 4042M WHILE DECREASE MW F/105 TO 103 PCF DUE TO PDM & SPP LIMITATION (PDM OPERATIONAL PRESS. IS HIGHER THAN NORMAL SITUATION) W/ N.L-N.G.	24.0	53.50	12.04	4042	2024.12.19	1403.09.29
R/U 4 1/2" LRN running equipment.	CSG Running		Fah.	4208		4.00	0.2	57.0	0.2	4.40	0.2	59.6	CONT. DIR. DRLG AS SLIDE & ROTATING MODE F/4042 TO 4094M WHILE TAKE SURVEY EACH 30M & PUMP HI-VIS PILL PERIODICAL W/ N.L-N.G.	24.0	54.50	13.04	4094	2024.12.20	1403.09.30
Run +/-360 m of 4 1/2" LNR, 18 ppf, L-80, M/U Liner Hanger Assy, and connect to DP	CSG Running		Fah.	4208		10.00	0.4	57.5	0.5	11.00	0.5	60.1	CONT. DIR. DRLG AS SLIDE & ROTATING MODE F/4094 TO 4127M WHILE W&R EACH STD & PUMP HI-VIS PILL PERIODICAL W/ N.L-N.G.	24.0	55.50	14.04	4127	2024.12.21	1403.10.01
P/U DP stands and run liner to section depth, Set liner hanger (TOL = +/-3840 m)	CSG Running		Fah.	4208		24.0	1.0	58.5	1.1	26.40	1.1	61.2	CONT. DIR. DRLG AS SLIDE & ROTATING MODE F/4127 TO 4177.5M WHILE W&R EACH STD & PUMP HI-VIS PILL PERIODICAL W/1-2 BPH LOSSES	24.0	56.50	15.04	4178	2024.12.22	1403.10.02
Perform Cement job as per program	CMT		Fah.	4208		16	0.7	59.1	0.7	17.60	0.7	61.9	CONT. DIR. DRLG AS ROTATING MODE F/4177.5 TO 4208M (TD), CBU & POOH AS BACK REAM F/4208 TO 3939M & RUN BACK TO BTM WHILE WORK ON TIGHT SPOTs (3967-3977M & 4121-4208M), CBU W/1 BPH LOSS.	24.0	57.50	16.04	4208	2024.12.23	1403.10.03
POOH Setting Tools (10 stand) flush string,	Trip		Fah.	4208		6	0.3	59.4	0.3	6.60	0.3	62.2	CBU & POOH AS PUMP OUT F/4208 (TD) TO 4147M & CONT. POOH (ON ELEVATOR) F/4147M TO SURF. IN GOOD HOLE CONDITION, L/D 6-1/8" PDC BIT & DIR. TOOLS. CHANGE TOP RAMS, INSTALL LOGGING BOP ON SHOOTING NIPPLE & TEST SAME.OK. R/U SEALAND LOGGING EQUIPS W/1 BPH LOSS.	24.0	58.50	14.04	4208	2024.12.24	1403.10.04
POOH to surface while L/D excess 3 1/2" DPs	Trip		Fah.	4208		24	1.0	60.4	1.1	26.40	1.1	63.3	RIH W/CDR/GR LOGGING TOOLS TO 4209M. START LOG UP TO 4130M, LOG DOWN F/ 4130 TO 4134M TO REPEAT DATA, TOOLS HELD UP, ATTEMPT TO PULL OUT TOOLS W/MAX 7200 LBs TENSION W/NO RESULT & TOOLS STUCK @ 4134M, WORK ON STUCK W/MAX 8000 LBs TENSION, SUDDENLY OBS. RELEASE 15/32" WIRE LINE F/CABLE HEAD & LOGGING TOOLS LEFT IN HOLE, RECOVER ALL OF WIRE ON DRUM. R/D LOGGING EQUIP., RIH W/ 5-1/2" OVERSHOT TO 2900M W/D-1 BPH LOSS.	24.0	59.50	17.54	4208	2024.12.25	1403.10.05
P/U & M/U 6" Tri cone Bit & clean out BHA & RIH to 4 1/2" L.Lap	Trip		Fah.	4208		18.00	0.8	61.1	0.8	19.80	0.8	64.1	CONT. RIH W/ 5-1/2" LOGGING OVERSHOT TO 4134M (TOF), TRY TO CATCH FISH IN SEVERAL TIMES W/NO SUCC. & OBS. DROP THE FISH, CHASE THE FISH TO BTM, WORK ON FISH TO CATCH W/MAX 360PS WT, POOH FOR CHECK OVERSHOT, NO RECOVER THE FISH, L/D OVERSHOT. SLIP & CUT DRILLING LINE W/D-1 BPH LOSS	24.0	60.50	17.54	4208	2024.12.26	1403.10.06
Perform CBU to sweep the well	Circ.		Fah.	4208		6	0.3	61.4	0.3	6.60	0.3	64.4	RIH W/5-1/4" OVERSHOT (DRESSED W/ 3-5/8" SPIRAL GRAPPLE) TO 4173M, TOOK WEIGHT & STUCK PIPES, WORK ON STUCK W/MAX 120 KIPS OVERPULL & JARRING, GOT FREE. RUN IN HOLE TO 4202M, ENGAGED WITH MAX 340PS WEIGHT ON FISH (OBSERVE INCREASE PRESSURE), CHECK SAME AS STICK UP & 10KIPS ABNORMAL DRAG. POOH FOR CHECKING STRING F/4202 TO 2664M WHILE CIRC. ACROSS W.HD & 1 BPH LOSS	24.0	61.50	17.54	4208	2024.12.27	1403.10.07
POOH to surface	Trip		Fah.	4208		18.00	0.8	62.1	0.8	19.80	0.8	65.2	CONT. POOH FOR CHECKING STRING F/2664M TO SURF., L/D 5 1/4" OVER SHOT, OBS. BREAK OUT SPIRAL GRAPPLE & RECOVER 1.1M OF FISH, RUN BACK W/PREVIOUS BHA AS 5-1/4" OVERSHOT (DRESSED W/ 3-5/8" SPIRAL GRAPPLE) TO 2830M & D-1 BPH LOSS @RT.	24.0	62.50	17.54	4208	2024.12.28	1403.10.08
P/U & M/U 3 1/2" PDC Bit & 2 7/8" DPs & RIH w/ clean out BHA to POB depth,	Trip		Fah.	4208		48.00	2.0	64.1	2.2	52.80	2.2	67.4	CONT. RIH W/5-1/4" OVERSHOT TO 4101.5M, ENGAGE W/FISH, TRY TO PULL OUT W/NO. SUCC., STRING STUCK, WORK ON STUCK W/ MAX 80KIPS OVER & APPLY TORQUE (MAX 7 Kft.lbs), GOT FREE, POOH TO SURF., NO. RECOVER THE FISH W/1 BPH LOSS	24.0	63.50	17.54	4208	2024.12.29	1403.10.09
D/O POB	D/O		Fah.	4208		6	0.3	64.4	0.3	6.60	0.3	67.7	RUN 4 1/2" LNR STRING (15.2#,T-95,TPCQ, PPA-TOTALLY 32 JTs) TO 358M (FASTEN SPIROLIZER Each 5 JTs), M/U 4-1/2" ROTATING LNR HGR W/TOP PKR (TIE BACK ID:5 1/4", LENGTH: 363.8M), CONT. RUN 4-1/2" LNR STRING FOLLOWED BY DPs TO 3113M WHILE PASS RABBIT THROUGH DPs & FILL UP STRING EACH 10 STANDS W/1 BPH LOSS.	24.0	64.50	18.54	4208	2024.12.30	1403.10.10
Cont. RIH w/ clean out BHA to +/- 10 m below perforation Interval	Trip		Fah.	4208		10	0.4	64.8	0.5	11.00	0.5	68.2	CONT RUN 4-1/2" LNR STRING FOLLOWED BY DPs F/ 3113 TO 3915M WHILE PASS RABBIT THROUGH DPs, CIRCULATE MUD AS A CAPACITY STRING, CONT RUN 4 1/2" LNR STRING FOLLOWED BY DPs TO 3991M WHILE PASS DRIFT ALL DPs, TOOK WT, TRY TO PASS AS PUMPAGE (60gpm, 400psi) TO 3993M WHILE SLACK OFF MAX 80KIPS, WORK ON TIGHT SPOT W/ RECIPROCATING & PUMPAGE, NO SUCC, DECIDED TO POOH: POOH 4 1/2" LNR STRING F/ 3993 TO 66M, D-1BPH LOSS @ RT	24.0	65.50	19.10	4208	2024.12.31	1403.10.11
Perform CBU to sweep the well	Trip		Fah.	4208		5.00	0.2	65.0	0.2	5.50	0.2	68.4	CONT POOH 4 1/2" LNR STRING F/ 1000M TO SURF MEANWHILE L/D ROTATIONAL HYD. LINER HANGER & ALL 4 1/2" LINER (32 JTS), RIH USED 6 1/8" INSERT BIT & RELATED BHA (W/OUT DRLG JAR) AS COND. TRIP TO 3938M, WASH DOWN TO 3991M, TOOK WEIGHT, WASH & REAM F/ 3991 TO 4085M, D-2BPH LOSSES @ RT	24.0	66.50	19.10	4208	2025.01.01	1403.10.12
Spot Non-Solid perforation fluid in front of perforation zone	Circ.		Fah.	4208		6.00	0.3	65.3	0.3	6.60	0.3	68.7	CONT RIH USED 6 1/8" INSERT BIT AS COND. TRIP TO 3991M, TOOK WEIGHT, WASH & PUSH OBSTACLE (CHASE FISH PROBABLY) F/ 3991 TO 4085M, OBS INCREASE VOLUME OF MUD TANKS, STOP OPERATION, SHUT IN THE WELL, MONITOR & CHECK THE WELL (SICP: ZERO), CIRC MUD ON WIDE-OPEN CH.MANIFOLD, GET 70BBL CUT MUD WEIGHT (MINIMUM WEIGHT 73 PCF), CBU TO BALANCE MUD WEIGHT IN & OUT (103 PCF), OPEN THE WELL, RESUME RIH AS WASH & PUSH OBSTACLE (CHASE FISH PROBABLY) F/ 4085 TO TO 4201.5M, NOTICED OBSTRUCTION & DIDN'T GO LOWER (FISH LENGTH APPROX 7M/, BTM WELL DEPTH: 4208M), CBU, POOH USED 6 1/8" INSERT BIT F/ 4201 (TOF) TO 2000M, 0-1BPH LOSS @ RT	24.0	67.50	19.10	4208	2025.01.02	1403.10.13
POOH to above 4 1/2" L.Lap	Trip		Fah.	4208		8.00	0.3	65.6	0.4	8.80	0.4	69.0	CONT POOH USED 6 1/8" INSERT BIT F/ 3941.5M (KOP) TO SURF, RUN 4 1/2" LNR STRING (15.2#, T-95, TPCQ, ALL ACC. P.P.A, TOTALLY 32 JTS. LENGTH: 358.15M) & M/U 5 3/4" HYD. MECHANICAL SET LNR HGR ASSY. INCLUDE TOP PKR AS PER TALLY SHEET TO 364M, RIH 4 1/2" LNR STRING FOLLOWED BY 3 1/2" & 5" DPs TO 3140M WHILE PASS RABBIT THRU DRILL PIPES & FILL UP STRING EVERY 10 STANDS, NL-NG @ RT	24.0	68.50	19.10	4208	2025.01.03	1403.10.14
Perform Positive pressure test of 4 1/2" L.Lap with 2000 psi	Testing		Fah.	4208		4.00	0.2	65.8	0.2	4.40	0.2	69.2	CONT RUN 4 1/2" LNR STRING & ACC. F/ 1756 TO 3993M WHILE PASS RABBIT TRU ALL DRILL PIPES, TOOK WT @ 3993M, TRY TO PASS AS PUMPAGE (400psi) WHILE SLACK OFF MAX 30KIPS, WORK ON TIGHT SPOT W/ RECIPROCATING & PUMPAGE SEVERAL TIMES, NO SUCC, POOH 4 1/2" LNR STRING & ACC. F/ 3993M TO SURF, INSTALL 11" PLUG TESTER IN THS & PREPARE FOR BOP PRESS TEST @ RT	24.0	69.50	19.10	4208	2025.01.04	1403.10.15
Cont. POOH to surface.¤	Trip		Fah.	4208		24.00	1.0	66.8	1.1	26.40	1.1	70.3	CONT POOH 4 1/2" LNR STRING & ACC. F/ 710M TO SURF, PERFORM BOP PRESS TEST AS NIOC POLICY, OK., RIH USED 6 1/8" PDC BIT (6 BLADE, BESTE, M1665, 3 OPEN NZL) & RELATED BHA AS COND. TRIP TO 3990M, TOOK WEIGHT, W&R TO 4000M MEANWHILE CHECK STRING WITH B/R EVERY 2-5M SEVERAL TIMES, NL-NG @ RT	24.0	70.50	19.10	4208	2025.01.05	1403.10.16
Install shooting nipple, R/U WL Logging Eq. Perform CMT quality Logging (RBT/CCL/GR) of 4 1/2" LNR from TOC to 4 1/2" L.Lap	Logging		Fah.	4208		48.00	2.0	68.8	2.2	52.80	2.2	72.5	CONT RIH USED 6 1/8" PDC BIT AS COND. TRIP TO 3990M, TOOK WEIGHT, W&R TO 4006M, NOTICED RETURN GAS CUT MUD WEIGHT (MINIMUM WEIGHT 96PCF), SHUT IN THE WELL, CIRC MUD ON WIDE-OPEN CH.MANIFOLD & CBU TO BALANCE MUD WEIGHT (103 PCF), OPEN THE WELL, HARD W&R F/ 4006 TO 4110M, NOTICED STUCK STRING AFTER STD CONNECTION, WORK ON STUCK STRING (MAX UPWARD: 150KIPS, DOWNWARD: 40KIPS & 9KLB.FT TQ) MEANWHILE PUMP 50BBL SALT WATER, STRING GOT FREE, POOH TO 3920M, WHILE CBU TO CIRC OUT SALT WATER, NOTICED GAS CUT MUD IN RETURN WHILE BTM'S UP, SHUT IN THE WELL, SICP: ZERO, CIRC W/ 103 PCF MUD THRU CHOCK MANIFOLD WIDE-OPEN, GOT 160 BBL GAS CUT MUD (MINIMUM MW: 80 PCF), CONT CBU TO BALANCED MW @ 103 PCF, OPEN THE WELL, FLOW CHECK THE WELL (30 MIN), STATIC, RIH F/ 3920 TO 4005M WITH NORMAL HOLE CONDITION. POOH ON ELEVATOR TO 3920M, FLOW CHECK THE WELL (30 MIN), STATIC, CONT POOH USED 6 1/8" PDC BIT F/ 3920 TO 2820M, NL-NG @ RT	24.0	71.50	19.10	4208	2025.01.06	1403.10.17
RIH CCL & Dummy Gun, POOH, prepare for perforation, RIH String (Firing head & shooting ,CCL+Guns),Correlate Depth,Shooting the gun,POOH String & RIH again to Perforate all the Depths then Rig Down	Perforation		Fah.	4208		295.00	12.3	81.0	13.5	324.50	13.5	86.0	CONT CIRC W/ 103 PCF MUD THRU CHOCK MANIFOLD WIDE-OPEN, GOT 160 BBL GAS CUT MUD (MINIMUM MW: 80 PCF), CONT CBU TO BALANCED MW @ 103 PCF, OPEN THE WELL, FLOW CHECK THE WELL (30 MIN), STATIC, RIH F/ 3920 TO 4005M WITH NORMAL HOLE CONDITION. POOH ON ELEVATOR TO 3920M, FLOW CHECK THE WELL (30 MIN), STATIC, CONT POOH USED 6 1/8" PDC BIT F/ 3920M TO SURF, RUN 4 1/2" LNR STRING (15.2#, T-95, TPCQ, ALL ACC. P.P.A, TOTALLY 29JTS, LENGTH: 324.55M) & M/U 5 3/4" HYD. MECHANICAL SET LNR HGR ASSY. (REDRESSED ROTATIONAL ABILITY) INCLUDE TOP PKR (TIE BACK ID: 5 1/4") TO 332M, RIH 4 1/2" LNR STRING FOLLOWED BY 3 1/2" & 5" DPs TO 2483M WHILE PASS RABBIT THRU DRILL PIPES & FILL UP STRING, NOTICED INCREASE VOL. MUD TANKS (10 BBL GAIN), SHUT-IN THE WELL, SICP: 600 PSI, CIRC MUD 103 PCF MUD THRU CH.MANIFOLD & POORBOY DEGASSER W/ APPLY 1000 PSI BACK PRESSURE & MIN RETURN MW 52 PCF (GASSED MUD) MEANWHILE MADE 110 PCF MUD, START CIRC W/ 90 BBL 110 PCF MUD & 1000 PSI BACK PRESSURE (SPP: 1000-1120 PSI), RETURN: GASSED CUT MUD W/ MIN MW: 57 PCF, STOP OPERATION, MADE 200BBL MUD 110PCF & RESUME CIRC MUD (110 PCF) (SICP: 950PSI, SIDP: 950PSI) MIN RETURN MW 55PCF (GASSED MUD) & THE LAST RETURN MUD WEIGHT 68PCF (GASSED MUD), DECIDED TO MAKE MUD (120 PCF): START MAKING LIMESTONE-FEROBAR MUD (120PCF) & PUMP 108BL MUD 110PCF IN STRING AS DIRECT PERIODICALLY TO PREVENT THE POSSIBILITY OF STRING PLUGGAGE & MONITOR THE WELL (SICP: 1240PSI, SIDP: 1000PSI) (TOTALLY MADE 600BBL 120PCF LIMESTONE-FEROBAR MUD) IS IN PROGRESS @ RT	24.0	72.50	19.10	4208	2025.01.07	1403.10.18
Rig Up WL & Pressure Test,RIH CCL & Dummy Gun to cross checking perforated intervals,POOH & Rig Down.	Logging		Fah.	4208		24.00	1.0	82.0	1.1	26.40	1.1	87.1	CONT RUN 4 1/2" LNR STRING (15.2#, T-95, TPCQ, ALL ACC. P.P.A, TOTALLY 29JTS, LENGTH: 324.55M) & M/U 5 3/4" HYD. MECHANICAL SET LNR HGR ASSY. (REDRESSED ROTATIONAL ABILITY) INCLUDE TOP PKR (TIE BACK ID: 5 1/4") TO 332M, RIH 4 1/2" LNR STRING FOLLOWED BY 3 1/2" & 5" DPs TO 2483M WHILE PASS RABBIT THRU DRILL PIPES & FILL UP STRING, NOTICED INCREASE VOL. MUD TANKS (10 BBL GAIN), SHUT-IN THE WELL, SICP: 600 PSI, CIRC MUD 103 PCF MUD THRU CH.MANIFOLD & POORBOY DEGASSER W/ APPLY 1000 PSI BACK PRESSURE & MIN RETURN MW 52 PCF (GASSED MUD) MEANWHILE MADE 110 PCF MUD, START CIRC W/ 90 BBL 110 PCF MUD & 1000 PSI BACK PRESSURE (SPP: 1000-1120 PSI), RETURN: GASSED CUT MUD W/ MIN MW: 57 PCF, STOP OPERATION, MADE 200BBL MUD 110PCF & RESUME CIRC MUD (110 PCF) (SICP: 950PSI, SIDP: 950PSI) MIN RETURN MW 55PCF (GASSED MUD) & THE LAST RETURN MUD WEIGHT 68PCF (GASSED MUD), DECIDED TO MAKE MUD (120 PCF): START MAKING LIMESTONE-FEROBAR MUD (120PCF) & PUMP 108BL MUD 110PCF IN STRING AS DIRECT PERIODICALLY TO PREVENT THE POSSIBILITY OF STRING PLUGGAGE & MONITOR THE WELL (SICP: 1240PSI, SIDP: 1000PSI) (TOTALLY MADE 600BBL 120PCF LIMESTONE-FEROBAR MUD) IS IN PROGRESS @ RT	24.0	73.50	19.10	4208	2025.01.08	1403.10.19
P/U and M/U 3 1/2" Mill & 2 7/8" DPs & 7" Scraper. RIH to smooth Perforation depth meanwhile Scrap 7" PKR setting depth interval, CBU. Displace well volume with CaBr2 Completion fluid.	Trip		Fah.	4208		72.00	3.0	85.0	3.3	79.20	3.3	90.4	CONT MAKING LIMESTONE-FEROBAR MUD (120PCF) & MONITOR THE WELL (SICP: 1240PSI, SIDP: 1000PSI) (TOTALLY MADE 700BBL 120PCF LIMESTONE-FEROBAR MUD), START KILL THE WELL AS WAIT & WEIGHT METHOD @ 2483M BY 120PCF MUD (TOTALLY 700BBL 120PCF MUD PUMPED & THE LAST RETURN MUD WEIGHT 111PCF, SICP: ZERO, SIDP: 1000PSI), OPEN THE WELL, FLOW CHECK, STATIC., CONT RIH 4 1/2" LNR STRING & ASSY. F/ 2483 TO 3058M, SHUT IN THE WELL, PUMPAGE 160BBL 111PCF LIMESTONE-FEROBAR MUD, RETURN GASSED MUD (MINIMUM 96PCF, SICP: ZERO), OPEN THE WELL, FLOW CHECK, STATIC, CONT RIH 4 1/2" LNR STRING & ASSY. TO 3771M, NOTICED INCREASE VOL. MUD TANKS (108BL GAIN), SHUT IN THE WELL, SICP: 100PSI MEANWHILE PREPARE & MAKING 108PCF LIMESTONE-FEROBAR MUD (MADE TOTALLY 900BBL 108PCF LIMESTONE-FEROBAR MUD) & MONITOR THE WELL (SICP: 800PSI, SIDP: 70PSI), RESUME KILL THE WELL AS WAIT & WEIGHT METHOD @ 3771M BY 108PCF MUD (TOTALLY 330BBL 108PCF MUD PUMPED & THE LAST RETURN MUD WEIGHT 63PCF, SICP: 800, SIDP: 1300PSI) @ RT	24.0	74.50	19.10	4208	2025.01.09	1403.10.20

POOH to surface while L/D all Tubulars.	Trip		Fah.	4208		96.00	4.0	89.0	4.4	105.60	4.4	94.8	WHILE SHUT-IN THE WELL PREPARE & MAKING 108PCF LIMESTONE-FEROBAR MUD (MADE TOTALLY 900BBL 108PCF LIMESTONE-FEROBAR MUD) (SICP: 800PSI, SIDP: 70PSI), RESUME KILL THE WELL AS WAIT & WEIGHT METHOD @ 3771M BY 108PCF MUD (TOTALLY 900BBL 108PCF MUD PUMPED & THE LAST RETURN MUD WEIGHT 101PCF, SICP: 1200, SIDP: 1300PSI), CONT CIRC AS WIDE-OPEN CH.MANIFOLD, OPEN THE WELL, FLOW CHECK, STATIC, CONT RIH 4 1/2" LNR & ASSY. TO 3914M, SHUT IN THE WELL, CONT KILL THE WELL AS WAIT & WEIGHT METHOD @ 3914M BY 108PCF MUD (TOTALLY 520BBL 108PCF MUD PUMPED & THE LAST RETURN MUD WEIGHT 90PCF, SICP: 400, SIDP: 1200PSI), STOP OPERATION DUE TO FINISHED PUMPABLE MUD, PREPARE & MAKING 900BBL 112PCF LIMESTONE-FERROBAR MUD (SICP: 800PSI, SIDP: 1200PSI), RESUME KILL THE WELL AS WAIT & WEIGHT METHOD @ 3914M BY 112PCF MUD (TOTALLY 700BBL 112PCF MUD PUMPED, MINIMUM RETURN MW 85PCF & THE LAST RETURN MUD WEIGHT 106PCF, SICP: ZERO, SIDP: 1450PSI), CONT CIRC MUD @ 3914M AS WIDE-OPEN CH.MANIFOLD TO BALANCE MW IN & OUT (110PCF), OK., NL-NG @ RT	24.0	75.50	19.10	4208	2025.01.10	1403.10.21
BOP Test.	BOP Test		Fah.	4208		6.00	0.3	89.3	0.3	6.60	0.3	95.1	RESUME KILL THE WELL AS WAIT & WEIGHT METHOD @ 3914M BY 112PCF MUD THRU CH.MANIFOLD & POORBOY DEGASSER (TOTALLY 700BBL 112PCF MUD PUMPED, MINIMUM RETURN MW 85PCF & THE LAST RETURN MUD WEIGHT 106PCF, SICP: ZERO, SIDP: 1450PSI), CONT CIRC MUD @ 3914M AS WIDE-OPEN CH.MANIFOLD TO BALANCE MW IN & OUT (110PCF), OK., OPEN THE WELL, CONT CIRC MUD (2 CYCLE) @ 3914M (110 PCF BALANCED) & UNIFORM, OK., FLOW CHECK "STATIC", POOH 4 1/2" LNR & ASSY. F/ 3914M TO SURF (TOTALLY 29JTS) MEANWHILE L/D 5-3/4" LNR HGR ASSY. (OBS. WIPER PLUG IS STUCK IN NEXT 4-1/2" LNR JT & 4-1/2" F.COLLAR WAS DAMAGED), RIH 6-1/8" INSERT BIT (K.DREAM, OPEN, IADC: 537, USED) & CONDITION BHA TO 868M, NL-NG @ RT	24.0	76.50	19.10	4208	2025.01.11	1403.10.22
Run 10K completion string as per program. NOTE: Annulus pressure test during completion operation is related to corrosion log result.	Trip		Fah.	4208		0.00	0.0	89.3	0.0	0.00	0.0	95.1	CONT POOH 4 1/2" LNR & ASSY. F/ 133M TO SURF (TOTALLY 29JTS) (OBS. 4-1/2" F.COLLAR WAS DAMAGED), RIH USED 6-1/8" INSERT BIT (537, OPEN) & CONDITION BHA TO 3936M (5M ABOVE 6 1/8" WINDOW), CIRC. MUD MEANWHILE ADDED SOLUTION TO ACTIVE MUD SYS. FOR DEC. MUD WEIGHT SYS. TO 105PCF & WORK ON MUD PROPERTIES, OK., CONT RIH TO 3939M, W&R TO 3990M, HARD W&R TO 4014M MEANWHILE CHECK STRING WITH B/R EVERY 1JT WITH OR WITHOUT PUMPAGE SEVERAL TIMES, NL-NG @ RT	24.0	77.50	19.10	4208	2025.01.12	1403.10.23
Set BPV inside TBH, N/D BOP's	Trip		Fah.	4208		46.00	1.9	91.2	2.1	50.60	2.1	97.2	CONT RIH USED 6-1/8" INSERT BIT AS COND. TRIP AS WASH & REAM F/ 3966 TO 3990M, HARD WASH & REAM TO 4176M MEANWHILE CHECK STRING WITH B/R EVERY 1JT WITH OR WITHOUT PUMPAGE SEVERAL TIMES, NL-NG @ RT	24.0	78.50	19.10	4208	2025.01.13	1403.10.24
Install new 10K XMT.		Fah.	4208		12	46.00	1.9	93.1	2.1	50.60	2.1	99.3	CONT RIH W/USED 6-1/8" INSERT BIT AS HARD WASH & REAM F/ 4146 TO 4200M, POOH AS SOFT BACK REAM F/4200 TO 3942M (KOP) & CONT. POOH TO 1144M WHILE CIRC. ACROSS W.HD W/NL-NG,	24.0	79.50	19.10	4208	2025.01.14	1403.10.25
Retrive BPV, install TWCV and Pressure test the XMT.	CSG		Fah.	4208		24	1.0	94.1	1.1	26.40	1.1	100.4	CONT. POOH F/1144M TO SURF. WHILE CIRC. ACROSS W.HD W/NL-NG, L/D BIT. RUN A 1/2" LNR STRING (15.2#,T-95,TPCQ, ALL ACC. PPA-TOTALLY 29 JTs) TO 324M (FASTEN SPIROLIZER Each 5 JTs), M/U 4-1/2" ROTATING LNR HGR W/TOP PKR (TIE BACK ID:5 1/4", LENGTH: 330M), CONT. RUN 4-1/2" LNR STRING FOLLOWED BY DPs TO 3140M W/NL-NG	24.0	80.50	19.10	4208	2025.01.15	1403.10.26
Secure the well by set BPV in TBG Hanger, close all X-mas Tree valves except BMV, and Release the Rig.	CSG		Fah.	4208		6	0.3	94.4	0.3	6.60	0.3	100.7	CONT. RUN 4-1/2" LNR STRING TO 4201M, SET LNR HGR W/1800 PSI, SHEAR LDC W/2600 PSI, RELEASE SETTING TOOLS, PERFORM CMT JOB AS PROG. (40 BBL 118 PCF) & DISPLACE W/166 BBL MUD (OBS. SHEARING W/6000 PSI & BUMPING W/3000 PSI/10MIN,OK), BLEED OFF PRESS., CHECK BACK FLOW,OK. POOH F/ 4-1/2" L.LAP (3873M) TO 3600M W/5-10KIPS ABNORMAL DRAG (NO WET) AS FAST AS POSSIBLE TO AVOID STRING STUCKING IN CMT, FLUSH STRING AND CONT. POOH TO 2007M WHILE CBU @3222M W/ NL-N.G	24.0	81.50	19.77	4208	2025.01.16	1403.10.27
Retrieve TWCV,R/U Slick Line, Set protection sleeve, retrieve plug & prong from NO GO landing nipple, POOH.	Completion		Fah.	4208		Rig Less	0.00	94.4	0.0	0.00	0.0	100.7	CONT. POOH F/2007M TO SURF., L/D SETTING TOOLS, RIH W/6 1/8" USED BIT (537,OPEN) & CLEAN OUT BHA TO 5765M, TOOK WEIGHT, TRY TO WASH CMT (200 GPM, 8 KIPS WT) W/NO SUCC., START D/O HARD CMT F/5765 TO 3813M (ROP:10 MPH) W/ NL-N.G.	24.0	82.50	20.77	4208	2025.01.17	1403.10.28
RIH with CT to bottom, displace the well with diesel or nitrogen & observ well, POOH.	Completion		Fah.	4208		Rig Less	0.00	94.4	0.0	0.00	0.0	100.7	CONT. D/O HARD CMT F/3813 TO 3871M (ROP:9 MPH), CONFIRM 4 1/2" LAP LNR @3871M, SLACK OFF 40 KIPS WT ON LAP LNR SLOWLY TO SET 4 1/2" LNR TOP PKR, CBU & POOH W/NL-NG, L/D 6 1/8" TCI BIT & EXTERA 6 1/2" DCs, PERFORM BOP TEST TO 7500 PSI (HYDRIL TO 3500PSI),OK.	24.0	83.50	21.65	4208	2025.01.18	1403.10.29
R/U SL, RIH & retrieve protection sleeve, POOH, R/D SL.	Completion		Fah.	4208		Rig Less	0.00	94.4	0.0	0.00	0.0	100.7	CONT. BOP TEST TO 7500 PSI,OK. RIH W/3 1/2" NEW J.MILL (M.M) & CLEAN OUT BHA TO 2501M , STRING PLUGGED, POOH & UNPLUG MILL, RUN BACK W/SAME CLEAN OUT ASSY. TO 2999M WHILE PASS RABBIT & BREAK CIRC. EVERY 15 STDs W/NL-NG	24.0	84.50	22.31	4208	2025.01.19	1403.10.30
Flow the well as pre-acid clean up till acceptable BSW & reading stable flow rate on 2 different choke size for 72 hrs.	Completion		Fah.	4208		Rig Less	0.00	94.4	0.0	0.00	0.0	100.7	CONT. RIH W/3 1/2" J.MILL & CLEAN OUT ASSY. F/2996 TO 3511M., OBS. STRING PLUGGED, UNPLUG STRING THEN CONT. LOWERING TO 3554M AS WASH DOWN TO AVOID OF PLUGGING (DUE TO SETTLING & IMPROPER MUD RHEOLOGY), STRING GOT PLUG AGAIN, WORK ON SAME & UNPLUGGED, RESUME RIH F/ 3554 TO 3874M AS WASH DOWN, TAG POB @3874M, D/O 4 1/2" POB THEN CONT. LOWERING AS WASH DOWN TO 4005M & SOFT TO MED. WASH & REAM DOWN F/4005 TO 4028M WHILE DECREASE MW F/105 TO 103 PCF W/NL-NG.	24.0	85.50	23.15	4208	2025.01.20	1403.11.01
R/U & RIH S.L, Set protection sleeve, POOH & R/D S.L RIH with C/T & perform acid wash as per program, POOH to surface. RIH w/SL and retrieve protection sleeve	Completion		Fah.	4208		Rig Less	0.00	94.4	0.0	0.00	0.0	100.7	CONT. SOFT TO MED. REAM DOWN AS CLEAN OUT INSIDE 4 1/2" LNR F/4028 TO 4140M WHILE RECIPROCETE EACH STD BEFOR CONNECTION W/PUMPAGE & NL-NG.	24.0	86.50	24.15	4208	2025.01.21	1403.11.02
Flow the well as post-acid clean-up till acceptable BSW & reading stable flow rate on 2 different choke size for min 96 hrs. Note 1: The time is only for flowing duration (R/U, R/D & preparation time is excluded), Note 2: Acidizing & post-acid clean-up maybe perform as rig less job upon contractor request & client approval but in case of any failure in well integrity the contractor should provide drilling rig & required services in own responsibility & fix the problem.	Completion		Fah.	4208		Rig Less	0.00	94.4	0.0	0.00	0.0	100.7	CONT. REAM DOWN AS CLEAN OUT INSIDE 4 1/2" LNR F/4140 TO 4177.5 M. TAG TOP OF 4 1/2" LDC & PLUGs @4177.5M. CBU & SPOT 20 BBL OF TREATED MUD SYS. (103 PCF, GEL:10/15, SOLID:24%) W/NL-NG.	24.0	87.50	25.15	4208	2025.01.22	1403.11.03
RIH with S/L, set protection Sleeve, POOH & R/D SL.	Completion		Fah.	4208		Rig Less	0.00	94.4	0.0	0.00	0.0	100.7	CONT. SPOT 20 BBL OF TREATED MUD SYS. (103 PCF, GEL:10/15, SOLID:24%) & THEN POOH TO 3870M (4 1/2" LNR LAP), SPOT 100 BBL OF SAME MUD THAT SPOT IN BTM, POOH & L/D 3 1/2" J.MILL (GREEN), R/U SEALAND LOGGING EQUIP., RIH W/ 2 7/8" BLANK GUN (2 JTs) AS DUMMY RUN TO 4145M, STRING HELD UP, TRY TO PASS GRADUALLY & DIFFICULTLY STEP BY STEP F/4145 TO 4170M (RECIPROCATING TOOLS STRING SEVERAL TIMES EACH 2M TO PASSING), NL-NG	24.0	88.50	26.15	4208	2025.01.23	1403.11.04
RIH with C/T to bottom & displace the well with diesel, POOH.	Completion		Fah.	4208		Rig Less	0.00	94.4	0.0	0.00	0.0	100.7	POOH F/4170M TO SURF., L/D 2 7/8" GUNs, ASSEMBLE & RIH W/1 11/16" RBT/VDL/CCL/GR TOOLS TO 4172M, START LOG UP TO 3860M, RUN BACK AS REPEAT LOG TO 3871M, TOOLS HELD UP, TRY TO PASS SEVERAL TIMES, NO SUCC., POOH, RUN BACK AS REPEAT LOG W/SAME LOGGING TOOLS (CHANGE CENTRALIZER) TO 3874M, TOOLS HELD UP, TRY TO PASS W/ NO SUCC., POOH	24.0	89.50	26.65	4208	2025.01.24	1403.11.05
RIH with S/L, install plug & prong into NO GO landing nipple, POOH.	Completion		Fah.	4208		Rig Less	0.00	94.4	0.0	0.00	0.0	100.7	CONT. POOH F/2500M TO SURF., L/D RBT LOGGING TOOLS. RIH W/ 2 7/8" BLANK GUN (2 JTs) AS DUMMY RUN TO 4140M DIFFICULTLY WHILE RECIPROCATING TOOLS F/3871 TO 4141M, POOH, PSM, RUN 2 7/ 8" HSD GUN ASSY. TO 4102M, (DEPTH CORRELATION & THEN SHOOTING THE GUN (INTERVAL:4096.8 - 4101.8M), POOH & OBS. SHOOT ALL BULLET, WAIT ON DAY LIGHT	24.0	90.50	27.52	4208	2025.01.25	1403.11.06
RIH with S/L, retrieve protection sleeve.	Completion		Fah.	4208		Rig Less	0.00	94.4	0.0	0.00	0.0	100.7	CONT. PERFORATING AS RUN 2 7/ 8" HSD GUN ASSY. (6 SPF, 3 RUN) & PERFORATION JOB SUCCESSFULLY INTERVALs:4086.8 - 4096.8M & 4077.3 - 4073.3M), OBS. SHOOT ALL BULLET, WAIT ON DAY LIGHT	24.0	91.50	28.52	4208	2025.01.26	1403.11.07
Secure the well by set BPV in TBG Hanger, close all X-mas Tree valves except BMV.	Completion		Fah.	4208		Rig Less	0.00	94.4	0.0	0.00	0.0	100.7	CONT. PERFORATING AS RUN 2 7/ 8" HSD GUN ASSY. (6SPF, 2 RUN) & PERFORATION JOB SUCCESSFULLY INTERVALs:4069.8 - 4073.3M & 4051.5 - 4056.5M), OBS. SHOOT ALL BULLETs, WAIT ON DAY LIGHT	24.0	92.50	29.52	4208	2025.01.27	1403.11.08
Total Duration of 5-7/8" Hole Section:							*94.4*	*94.4*			*100.7*	*100.7*	CONT. PERFORATING AS RUN 2 7/ 8" HSD GUN ASSY. (6SPF, 3 RUN) & PERFORATION JOB SUCCESSFULLY INTERVALs:4051.5 - 4046.5M & 4026.2 - 4023.2m,4006.6 - 4001.6m), OBS. SHOOT ALL BULLETs, WAIT ON DAY LIGHT WHILE RIH W/ 2 7/8" BLANK GUN/CCL AS DUMMY TO 3995 M, POOH & L/D GUNs W/NL-NG.@R.T.	24.0	93.50	30.52	4208	2025.01.28	1403.11.09
NOTE:													WAIT ON DAY LIGHT WHILE RIH W/ 2 7/8" BLANK GUN/CCL AS DUMMY TO 3995 M, POOH & L/D GUNs .CONT. PERFORATING AS RUN 2 7/ 8" HSD GUN ASSY. (6SPF, 3 RUN) & PERFORATION JOB SUCCESSFULLY INTERVALs:4001.6-3996.6M &3996.6-3992.1M & 3978.1 - 3976.1M), OBS. SHOOT ALL BULLETs, SLIP & CUT 125FT DRILLING LINE. CHANGE TOP RAMS AND TEST IT, OK. P/U & M/U 3 1/2" JUNK MILL& BHA TO1650 M W/ NL-NG. @R.T.	24.0	94.50	31.52	4208	2025.01.29	1403.11.10
Total Duration for Cut & Slip DL in all hole section.	Cut & Slip			4200		6	0.25	94.6	0.3	6.6	0.28	101.0	CONT.RIH W/ 3 1/2" JUNK MILL& BHA,FOLLOWED BY 3-1/2" & 5 " DP TO 4178 (LDC) WITH PUMPING & ROTATION TO GOOD CASE HOLE CONDITION IN PERFORATED INTERVAL .OK,CIR BTM'S UP. SPOT 20 BBL COMPLETION FLUID (CABR2 102.5 PCF) 'POOH ON ELEVATOR FROM 4178M TO 3700 M @R.T.	24.0	95.50	32.52	4208	2025.01.30	1403.11.11
Total Duration for Rig Service (Consider 0.5hr per day) in all hole section.	Rig Service			4200		50	2.10	96.7	2.3	55.4	2.31	103.3	SPOT 20 BBL COMPLETION FLUID (CABR2 102.5 PCF) 'POOH ON ELEVATOR FROM 4178M TO SURF, L/D 24 JTS 2-7/8" D.P+ 15 JTS 3-1/8" D.C MEANWHILE F.CHECK @ 3871M &1950M , WELL STATIC.P/U & M/U 6-1/8" B.BIT (OPEN, 537, K.DREAM, USED) &7" SCRAPER TO 2400 M WHILE FILL UP STRING EACH 15 STD @ R.T.	24.0	96.50	33.52	4208	2025.02.01	1403.11.12
Total Duration of AZNS-122 Work-over Well:								96.7				103.3	CONT RIH W/6-1/8" B.BIT & 7" SCRAPER F/396 TO 3400 M, SCRAP F/3400 TO 3540 M W/NL-NG, CONT RIH TO 3864 M.CIRC BTM'S UP OBS WELL FLOW W/ 10 BBL GAIN , CLOSE HYDRIL, CONT DISPLACE THE WELL THROUGH CHOKE MANIFOLD W/ 500 PSI BACK PRESS, RETURN GAS CUT MUD 61-70 PCF, CLOSE THE WELL TO MAKE MUD (MUD MADE TOTALLY 460 BBL 103 PCF) .WHILE PUMP 5 BBL MUD 103 PCF IN STRING AS DIRECT PERIODICALLY TO PREVENT THE POSSIBILITY OF STRING PLUGGAGE & MONITOR THE WELL (SICP: 800PSI, SIDP: 500 PSI) IS IN PROGRESS @R.T.	24.0	97.50	34.04	4208	2025.02.02	1403.11.13

CONT SHUT IN THE WELL & MAKING MUD TOTALLY 950 BBL 105 PCF WHILE PUMP 5 BBL MUD IN STRING AS DIRECT PERIODICALLY TO PREVENT THE POSSIBILITY OF STRING PLUGGAGE & MONITOR THE WELL (SICP: 920PSI, SIDP: 680 PSI),RESUME KILL THE WELL @3865 M BY 105 PCF MUD &MINIMUM RETURN MUD WEIGHT 70 PCF, & LAST RETURN MW 103 PCF , BALANCE MW IN & OUT (105 PCF), OK, THEN CONT CIRC 105 PCF MUD IN PROGRESS W/NL-NG @R.T.	24.0	98.50	34.04	4208	2025.02.03	1403.11.14
CONT. KILL THE WELL BY 105 PCF MUD & LAST RETURN MW 103 PCF , BALANCE MW IN & OUT (105 PCF), OK, OBSERVE THE WELL, STATIC. OPEN THE WELL, CONTINUE NORMAL CIRC MUD W/NL-NG. WAIT ON REC COMPL ACCESSORIES & COMPL FLUID WHILE CIRCMUD INSID STRING @3865 M W/NL-NG@R.T.	24.0	99.50	34.04	4208	2025.02.04	1403.11.15
CONT.WAIT ON REC COMPL ACCESSORIES & COMPL FLUID WHILE CIRCMUD INSID STRING @3865 M W/NL-NG@R.T.	24.0	100.50	34.04	4208	2025.02.05	1403.11.16
CONT.WAIT ON REC COMPL ACCESSORIES & COMPL FLUID WHILE CIRCMUD INSID STRING @3865 M W/NL-NG@R.T.	24.0	101.50	34.04	4208	2025.02.06	1403.11.17
CONT.WAIT ON REC COMPL ACCESSORIES & COMPL FLUID WHILE CIRCMUD INSID STRING @3865 M W/NL-NG@R.T.	24.0	102.50	34.04	4208	2025.02.07	1403.11.18
CONT.WAIT ON REC COMPL ACCESSORIES & COMPL FLUID WHILE CIRCMUD INSID STRING @3865 M W/NL-NG@R.T.	24.0	103.50	34.04	4208	2025.02.08	1403.11.19
CONT.WAIT ON REC COMPL ACCESSORIES & COMPL FLUID WHILE CIRCMUD INSID STRING @3865 M W/NL-NG@R.T.	24.0	104.50	34.04	4208	2025.02.09	1403.11.20
CONT.WAIT ON REC COMPL ACCESSORIES & COMPL FLUID WHILE CIRCMUD INSID STRING @3865 M W/NL-NG@R.T.	24.0	105.50	34.04	4208	2025.02.10	1403.11.21
CONT.WAIT ON REC COMPL ACCESSORIES WHILE CIRC MUD INSIDE STRING @3861 M W/NL-NG.	24.0	106.50	34.04	4208	2025.02.11	1403.11.22
CONT.WAIT ON REC COMPL ACCESSORIES WHILE CIRC MUD INSIDE STRING @3861 M W/NL-NG.	24.0	107.50	34.04	4208	2025.02.12	1403.11.23
CONT.WAIT ON REC COMPL ACCESSORIES WHILE CIRC MUD INSIDE STRING @3861 M W/NL-NG.	24.0	108.50	34.04	4208	2025.02.13	1403.11.24
CONT. WAIT ON REC. COMPL. ACCESSORIES WHILE CIRC. MUD INSIDE STRING @3861M (10M ABOVE 4 1/2" LAP LNR) W/NL-NG, L/U SURF. LINES F/SOLUTION TANKS & PUMP UNIT TO THE WELL, DISPLACE HOLE F/3868M W/COMPL. FLUID IN PROGRESS.	24.0	109.50	34.04	4208	2025.02.14	1403.11.25
DISPLACE MUD IN HOLE F/3868M (3M ABOVE 4 1/2" LAP LNR) W/COMPL. FLUID (CABR2 MIXED W/ADD. AS PROGRAM, 104.5 PCF), STATIC FLOW CHECK,OK. POOH F/3868 TO 880M WHILE L/D PIPES & F/U HOLE AS TRIP TANK W/NL-NG.	24.0	110.50	35.04	4208	2025.02.15	1403.11.26
CONT. POOH F/880M TO SURF. WHILE L/D PIPES W/NL-NG. L/D 6 1/8" BIT & 7" SCRAPER & ALL PIPES ON DERRICK. PERFORM BOP TEST TO 7500 PSI (HYDRIL TO 3500 PSI), OK. RUN 3 1/2" 10K COMPLETION STRING (WEIQIXIN, 10.2#, HSM-3, 110KSI ,13CR) TO 12M	24.0	111.50	36.04	4208	2025.02.16	1403.11.27
CONT. RUN 3 1/2" 10K (WXN) COMPL. STRING W/22Jts 3-1/2"TBG 10.2#, L-80, HSM-3 TO 241M WHILE USE THREAD SEAL COMPOUND & TORQUE/TURN MONITORING SYSTEM AND CROSS COUPLING PROTECTORS ALSO HOLD PRESSURE IN BOTH CILS AND CIRC. C.W.HD BY TRIP TANK W/ N.L-N.G.	24.0	112.50	37.04	4208	2025.02.17	1403.11.28
CONT. RUN COMPL. STRING W/TOTALLY: 139JTS 3-1/2"TBG 10.2#, L-80, HSM-3 TO 1350M WHILE HOLD PRESSURE IN BOTH CILS (1200 PSI) ALSO TEST STRING TO 7000PSI @857M,OK W/ N.L-N.G.	24.0	113.50	38.04	4208	2025.02.18	1403.11.29
CONT. RUN 3 1/2"*4 1/2" 10K WQN COMPLETION STRING (TOTALLY 176 JTS 3-1/2"TBG +XOS + 72 JTS 4 -1/2" TBG) TO 2384M WHILE PRESS. TEST STRING@1700M TO 7000 PSI/15MIN,OK ALSO RUN 2.8" GUGE RING AS SLICK LINE TO TOP OF SSD W/ N.L-N.G.	24.0	114.50	39.04	4208	2025.02.19	1403.11.30
CONT. RUN 3 1/2"*4 1/2" 10K WQN COMPLETION STRING (TOTALLY 176 JTS 3-1/2"TBG 10.2#, L-80, HSM-3 +XOS 3-1/2"*4-1/2" HSM-3 + 183 JTS 4 -1/2" TBG 18.9#, L-80, HSM-3) TO 3430M W/ N.L-N.G	24.0	115.50	40.04	4208	2025.02.20	1403.12.01
CONT. RUN 3 1/2"*4 1/2" 10K WQN COMPLETION STRING (TOTALLY 176 JTS 3-1/2"TBG +XOS+ 195 JTS 4 -1/2" TBG) TO 3550M W/ N.L-N.G. P/U & M/U TRSCSSSV ASSY., PERFORM RELATED TEST,OK. CONT. LOWERING W/5 JTS 4 1/2" TBG TO 3608M, RUPTURED CILs. P/U & M/U 4 1/2" F.SWAGE & TBG HGR, LAND TBG HGR, STICK UP 1.5M, PRESSURIZED STRING TO 7000 PSI/15MIN,OK. PERFORM SLICK LINE OPERATION IN PROGRESS	24.0	116.50	41.04	4208	2025.02.21	1403.12.02
SET 7"PERM. PKR TO 7000 PSI/15MIN,OK. PULL TEST OF PKR W/15 KIPS OVERPULL, SHEARING EXP. JT W/SLACK OFF 25 KIPS WT, LAND TBG HGR IN THS, TIGHTEN ALL TIE DOWN SCREW & TEST TO 2000 PSI/15MIN,OK. TEST FINAL COMPL. STRING TO 5000 PSI/15 MIN,OK. TEST PKR & 9 5/8" ANNULUS TO 2000 PSI (NO GO PLUG IN),OK. RETRIEVE PROTECTION SLEEVE F/SSSV, BACK OFF & L/D L.JT. INSTALL 4" TWO WAY IN TBG HGR. TEST TWO WAY W/5000 PSI,OK. N/D BOP STACK IN PROGRESS	24.0	117.50	41.71	4208	2025.02.22	1403.12.03
N/D BOP STACK, N/U BTM MASTER VALVE & TEST M.SEAL W/8000PSI, OK. TEST BETWEEN LOWER S.SEAL & CAVITY W/8000PSI, OK. TEST BETWEEN NECK OF HGR S.SEAL & CAVITY W/ 8000PSI, OK. TEST C/L TO 8000PSI & CILS TO 2000PSI, OK. NIPPLE-UP SOLID BLOCK, TEST X-MAS TREE BODY WITH 8000PSI/15MIN, OK. RETRIEVE 2WCV. INSTALL XMAS TREE CAP AND CLOSE ALL VALVES EXCEPT BOTTOM MASTER VALVE. RIG RELEASE @ 1403.12.04 24:00 O'CLOCK. (NO GO PLUG IN)	24.0	118.50	42.71	4208	2025.02.23	1403.12.04
CANCEL RELEASING THE RIG BY CONTRACTOR. WAIT ON REC. CTU FOR DISPLACE CABR2 INSIDE COMPL. STRING W/BRINE. RIG RELEASE @1403.12.05 @ 24:00 O'CLOCK. (NO-GO PLUG IN)	24.0	119.50	42.71	4208	2025.02.24	1403.12.05
WAIT ON REC. CTU FOR DISPLACE CABR2 INSIDE COMPL. STRING W/BRINE. R/U SLICK LINE, SET PROTECTION SLEEVE IN SSSV, R/U CTU, TEST CTU BOP & LUBRICATOR & RISER TO 4000PSI,OK WHILE PREPARE 200BBL SALT WTR (74PCF, PH:10 WITH OUT CORR. INHIBBITOR)	24.0	120.50	42.71	4208	2025.02.25	1403.12.06
TEAR OUT THE RIG IN PROG. CONT. RIH W/ CT TO 3619M (TOP OF NO-GO), DISPLACE CABR2 INSIDE COMP STRING W/ BRINE (74 PCF HI PH, NO CORR. INHIBBITOR), POOH CT TO SURF, RET 3SV PROTECTION SLEEVE, CLOSE ALL X-MAS TREE VALVE EXCEPT BMV. RELEASE THE RIG IN 1403.12.07 @ 24:00 O'CLOCK.	24.0	121.50	42.71	4208	2025.02.26	1403.12.07

Table 3-2: AZNS-122 Side – Track & Completion Time Breakdown

3.3 NPT Break-Down

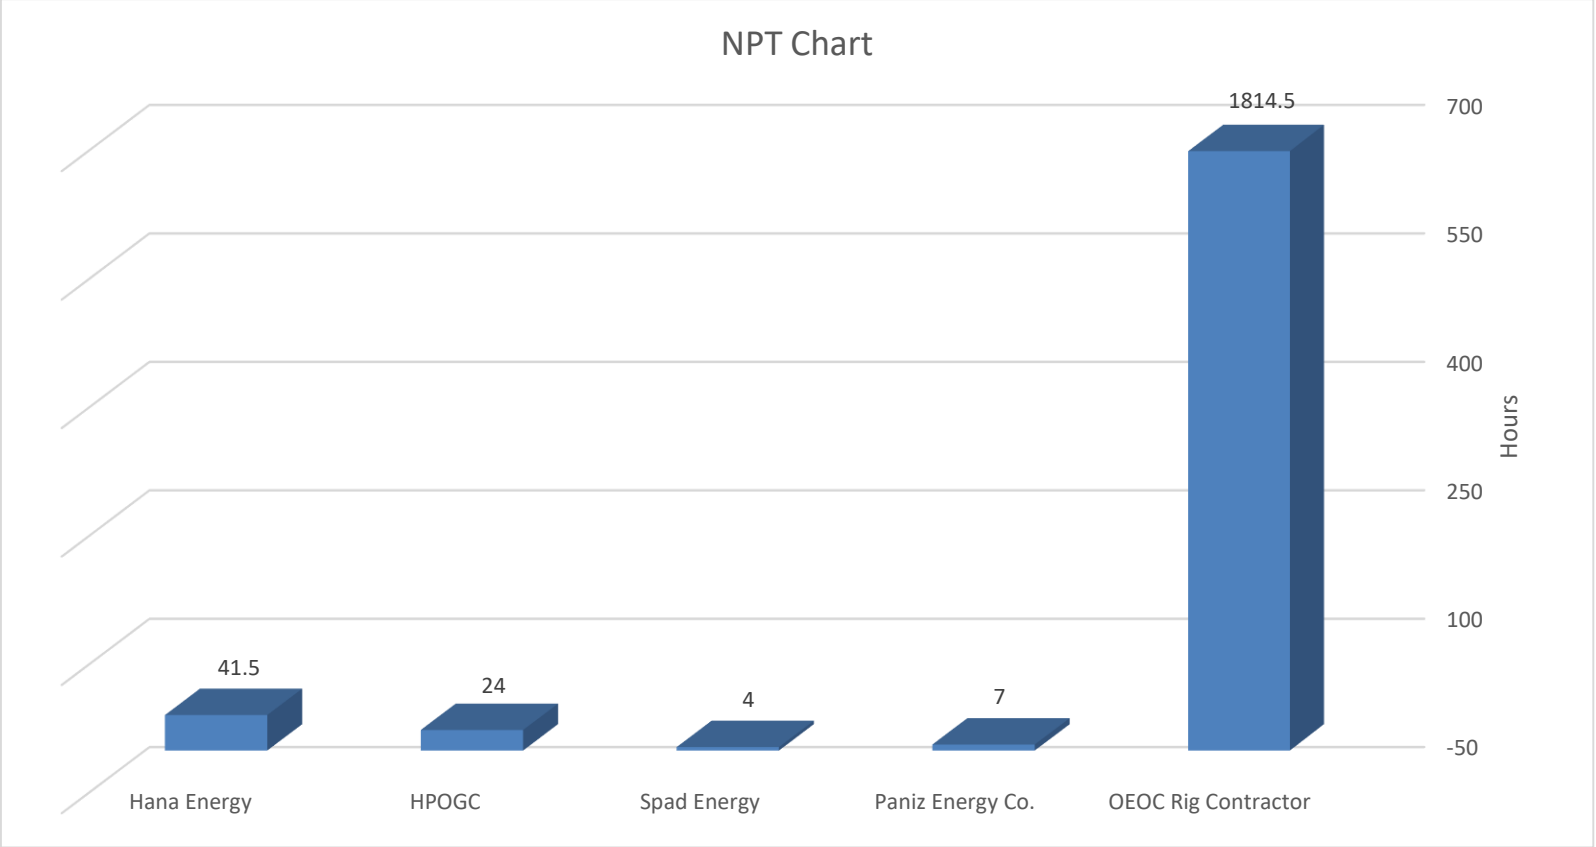


Figure 3-2: AZNS-122 NPT Break-Down Chart

Item	Company	Date	Problem event	Lost Time (hrs)
1	OEOC Rig	1403. 08. 06	NPT due to completion	12
2		1403. 08. 07		24
3		1403. 08. 08		24
4		1403. 08. 09		24
5		1403. 08. 10		24
6		1403. 08. 11		24
7		1403. 08. 12		24
8		1403. 08. 13		24
9		1403. 08. 14		24
10		1403. 08. 15		24
11		1403. 08. 16		24
12		1403. 08. 17		24
13		1403. 08. 18		24
14		1403. 08. 19		24
15		1403. 08. 20		24
16		1403. 08. 21		24
17		1403. 08. 22		24
18		1403. 08. 23		24
19		1403. 08. 24		24

20		1403. 08. 25		24
21		1403. 08. 26		24
22		1403. 08. 27		24
23		1403. 08. 28		24
24		1403. 08. 29		24
25		1403. 08. 30		24
25		1403. 09. 01		24
26		1403. 09. 02		24
27		1403. 09. 03		24
28		1403. 09. 04		24
29		1403. 09. 05		24
30		1403. 09. 06		24
31		1403. 09. 07		2
32		1403. 09. 08	NPT due to wait on Rec. CMT service	17
33		1403. 09. 09	Delay on D/O CMT	4
34		1403. 09. 10		24
35		1403. 09. 11		23
36		1403. 09. 12		2
37		1403. 09. 13	Delay in operation due to low efficiency mud pumps	1.5
38			Work on TDS	1.5
39		1403. 09. 14	POOH string due to not pass gyro inside string	7

40		1403. 09. 15		5
41			Stop operation due to rabit stucked in 2 STDs 3-1/2" DP	3
42	Paniz Energy Co.	1403. 09. 16	Due to not Rec. signal gyro tools	7
43	Spad Energy Co.		Due to inability pump truck to continuous increase pressure in operation	4
44	HPOGC	1403. 09. 17	POOH string due to not set whipstock	24
45	OEOC Rig	1403. 09. 18	Obs. HFBPV is plugged with debris	24
46		1403. 09. 19	Delay in operation to set whipstock	24
47		1403. 09. 20		24
48		1403. 09. 21		5
49		1403. 09. 23	Delay in making STDs	1
50			Delay in trip	2
51			Delay in BOP pressure tests	2
52			Delay in making STDs	2
53		1403. 09. 24		2
54	Hana Energy Co.	1403. 09. 26	MWD tools was failed	1.5
55	OEOC Rig		POOH due to low ROP & MWD signal was lost	10.5
56	Hana Energy Co.	1403. 09. 27	MWD tools was failed	24
57		1403. 09. 28		16
58	OEOC Rig	1403. 10. 05	Fishing logging tools due to stuck & release wire from cable head as weak point	12
59		1403. 10. 06	Fishing logging tools	24
60		1403. 10. 07		24

61		1403. 10. 08		24
62		1403. 10. 09		24
63		1403. 10. 11	Due to bad hole condition lead to POOH 4-1/2” LNR	10.5
64		1403. 10. 12	Due to bad hole condition lead to Con. Trip & delay in operation (run 4-1/2” LNR)	24
65		1403. 10. 13		24
66		1403. 10. 14		24
67		1403. 10. 15	Due to bad hole condition lead to POOH 4-1/2” LNR	24
68		1403. 10. 16	Due to bad hole condition lead to Con. Trip & delay in operation (run 4-1/2” LNR)	24
69		1403. 10. 17		24
70		1403. 10. 18		24
71		1403. 10. 19		24
72		1403. 10. 20		24
73		1403. 10. 21		24
74		1403. 10. 22		24
75		1403. 10. 23		24
76		1403. 10. 24		24
77		1403. 10. 25		24
78		1403. 10. 26		24
79		1403. 10. 27		8
80		1403. 10. 29	Stop operation due to work on TDS	3
81		1403. 10. 30	Round trip due to work on unplug string	8

82		1403. 11. 01	Work on unplug string while trip in	4
83		1403. 11. 05	Due to improper fluid in hole, try to pass logging tools w/ no succ.	12
84		1403. 11. 06		3
85		1403. 11. 13	Due to pumping of $CaBr_2$ 102.5^{pcf} @perforation interval, the well flowed	11.5
86		1403. 11. 14		24
87		1403. 11. 15		24
88		1403. 11. 16	Wait on Rec. Com. ACC. & Com. Fluid	24
89		1403. 11. 17		24
90		1403. 11. 18		24
91		1403. 11. 19		24
92		1403. 11. 20		24
93		1403. 11. 21		24
94		1403. 11. 22		24
95		1403. 11. 23		24
96		1403. 11. 24		24
97		1403. 11. 25		24
98		1403. 12. 03	Work on fix leakage of 2way in TBG HGR	8
99		1403. 12. 05	Wait ob Rec. CUT for Disp.	24
100		1403. 12. 06		24
101		1403. 12. 17	Delay in Disp. Com. fluid & retrieve protection sleeve from 3SV	24
Total NPT (hrs.)				1891

Total NPT (days)	**78.8**


Table 3-3: AZNS-122 NPT Time BreakDown


4. Geological Reports

4.1 Logging and Testing Reports

Item	Log	Date	Interval (m)
1	RBT/VDL/CCL/GR	24 – 01 – 2025	4173 – 3871
2	CDR/GR	25 – 12 – 2024	4206 – 4130

Tool Sketch

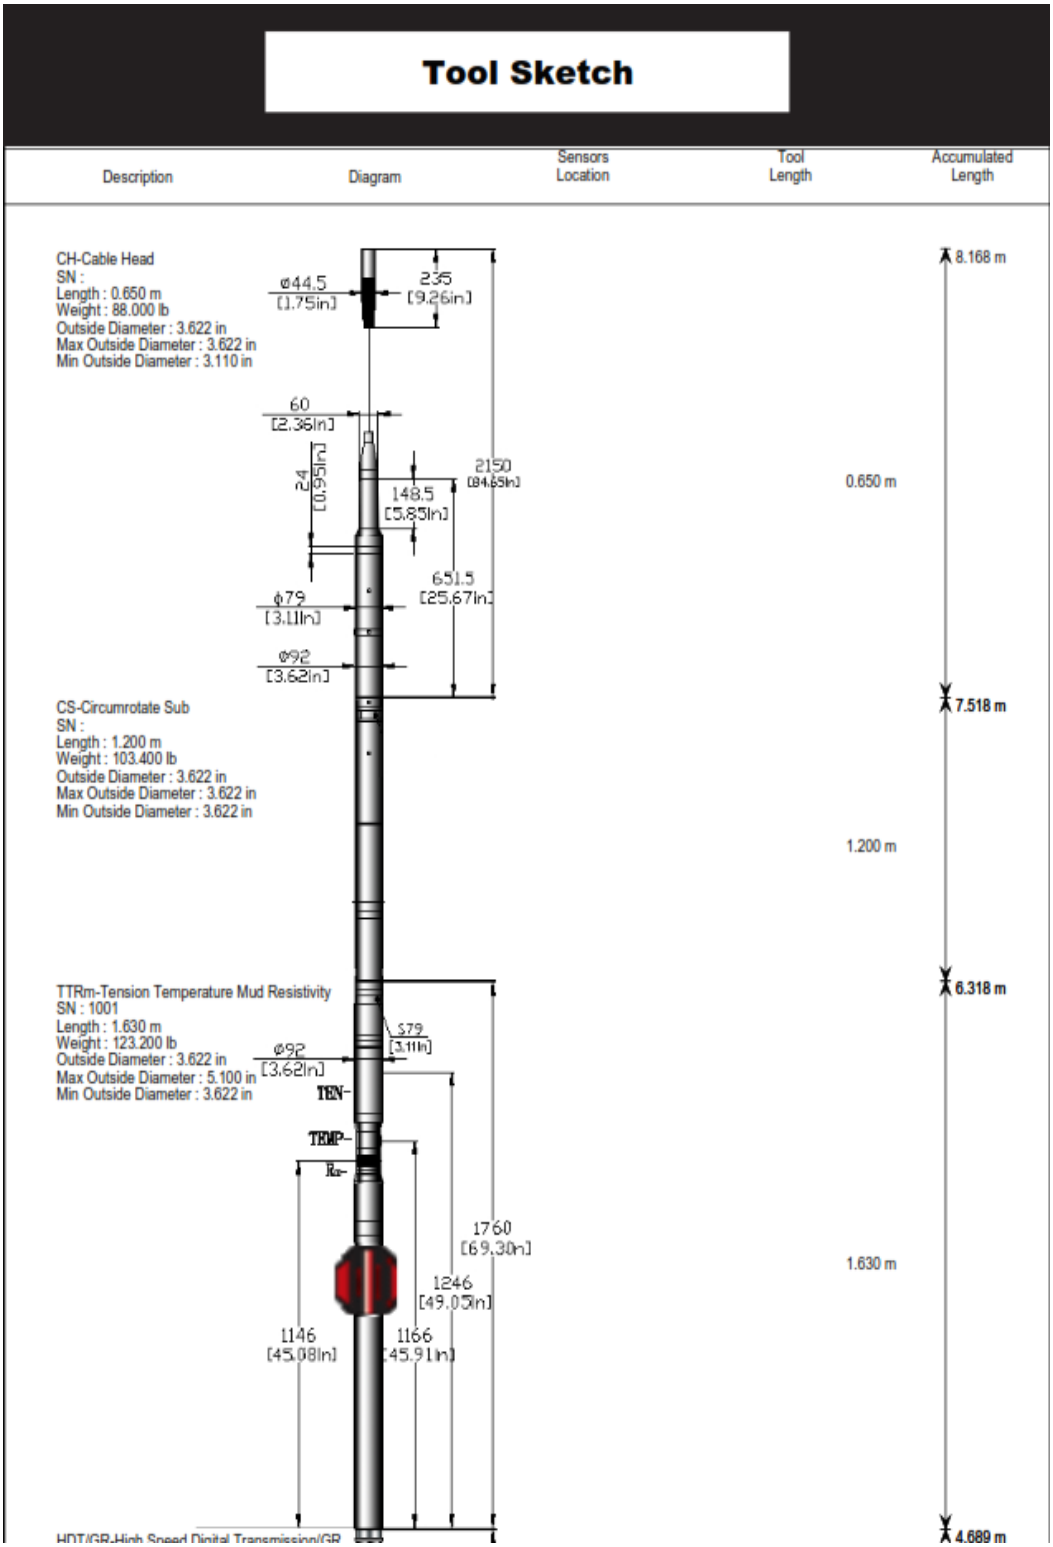
Description
Diagram
Sensors Location
Tool Length
Accumulated Length
CH-Cable Head
SN :
Length : 0.650 m
Weight : 88.000 lb
Outside Diameter : 3.622 in
Max Outside Diameter : 3.622 in
Min Outside Diameter : 3.110 in
ø44.5 [1.75in]
235 [9.26in]
60 [2.36in]
24 [0.95in]
2150 [84.65in]
148.5 [5.85in]
651.5 [25.67in]
ø79 [3.11in]
ø92 [3.62in]
0.650 m
8.168 m
CS-Circumrotate Sub
SN :
Length : 1.200 m
Weight : 103.400 lb
Outside Diameter : 3.622 in
Max Outside Diameter : 3.622 in
Min Outside Diameter : 3.622 in
1.200 m
7.518 m
TTRm-Tension Temperature Mud Resistivity
SN : 1001
Length : 1.630 m
Weight : 123.200 lb
Outside Diameter : 3.622 in
Max Outside Diameter : 5.100 in
Min Outside Diameter : 3.622 in
ø92 [3.62in]
ø79 [3.11in]
TEN-
TEMP-
Rm-
1760 [69.30in]
1246 [49.05in]
1146 [45.08in]
1166 [45.91in]
1.630 m
6.318 m
4.689 m

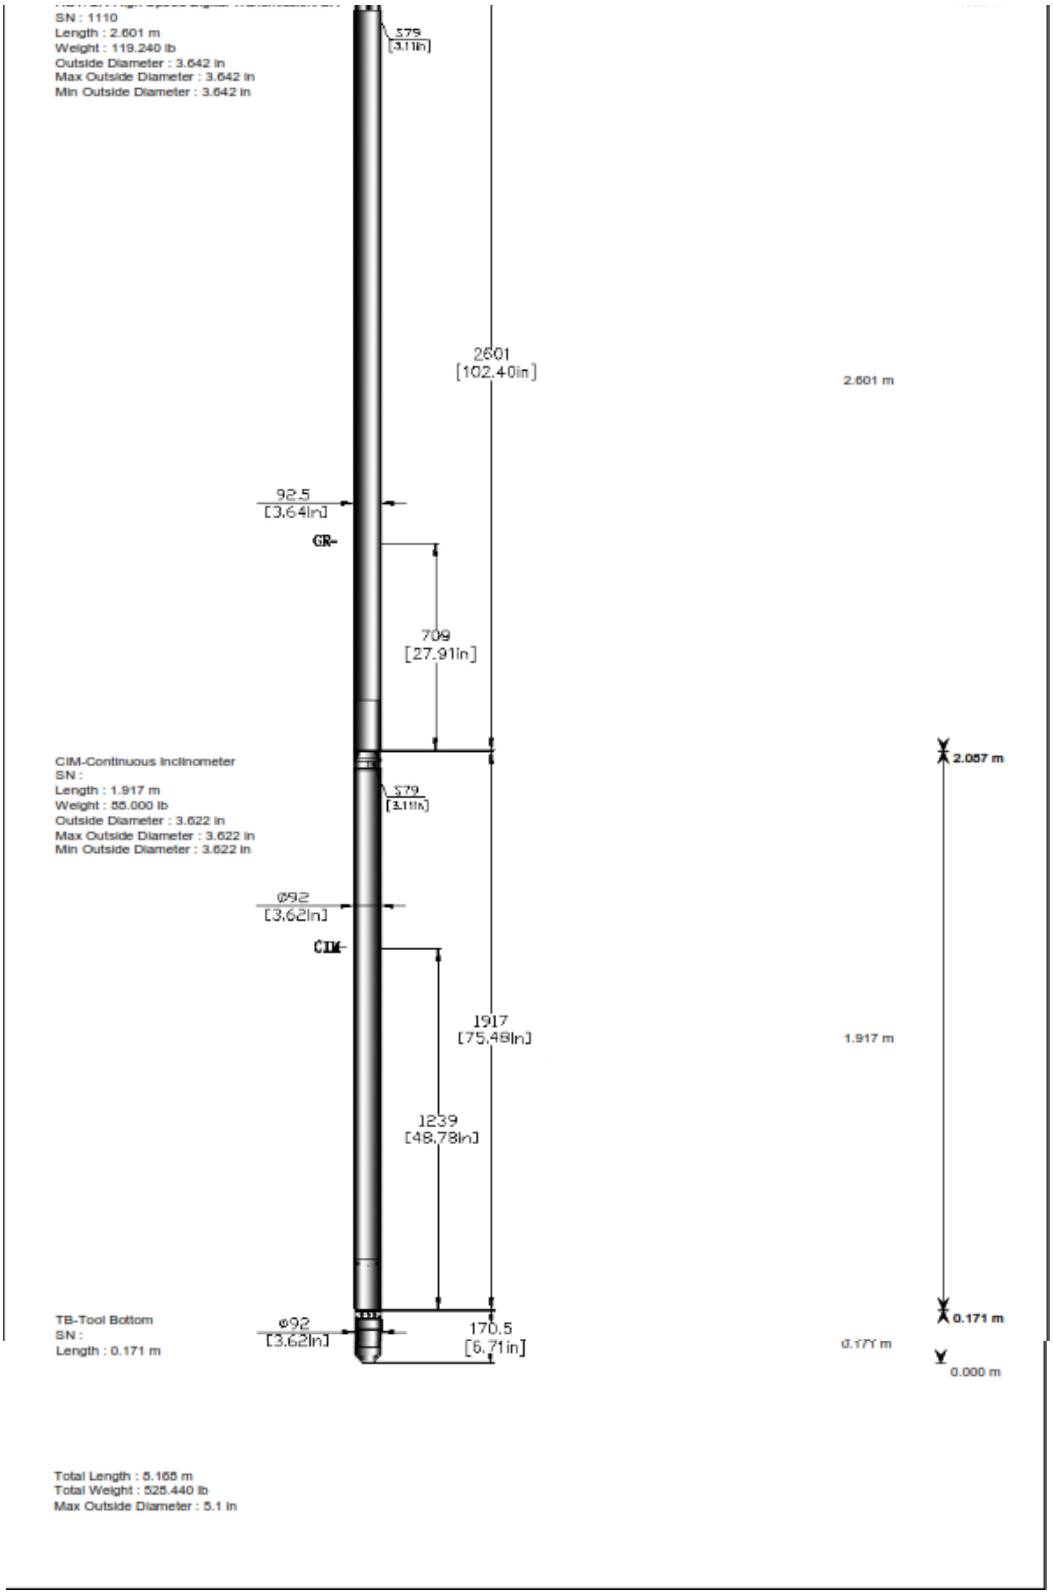
SN : 1110
Length : 2.601 m
Weight : 119.240 lb
Outside Diameter : 3.642 in
Max Outside Diameter : 3.642 in
Min Outside Diameter : 3.642 in
2601
[102.40in]
2.601 m
92.5
[3.64in]
GR
709
[27.91in]
CIM-Continuous Inclinometer
SN :
Length : 1.917 m
Weight : 55.000 lb
Outside Diameter : 3.622 in
Max Outside Diameter : 3.622 in
Min Outside Diameter : 3.622 in
2.057 m
Ø92
[3.62in]
CIM
1917
[75.48in]
1.917 m
1239
[48.78in]
TB-Tool Bottom
SN :
Length : 0.171 m
Ø92
[3.62in]
170.5
[6.71in]
0.171 m
0.000 m
Total Length : 5.165 m
Total Weight : 525.440 lb
Max Outside Diameter : 5.1 in

NO.	MD (m)	TVD (m)	DEVI (deg)	AZIM (deg)	GR (gAPI)
1	3920.00	3920.00	0.45	140.41	47.75
2	3925.00	3925.00	0.42	207.64	60.57
3	3930.00	3930.00	0.47	100.55	51.44
4	3935.00	3935.00	0.41	90.93	31.15
5	3940.00	3940.00	0.44	100.24	17.61
6	3945.00	3945.00	0.45	114.50	34.01
7	3950.00	3950.00	1.72	17.57	45.33
8	3955.00	3955.00	2.29	126.61	57.35
9	3960.00	3960.00	2.46	136.30	21.96
10	3965.00	3965.00	2.34	137.65	31.42
11	3970.00	3970.00	2.09	135.30	34.77
12	3975.00	3975.00	2.45	135.55	32.44
13	3980.00	3980.00	2.29	133.22	23.59
14	3985.00	3985.00	2.03	135.40	21.55
15	3990.00	3990.00	2.34	142.30	25.49
16	3995.00	3995.00	2.54	139.69	25.95
17	4000.00	4000.00	2.45	136.25	7.33
18	4005.00	4005.00	2.43	129.59	15.04
19	4010.00	4010.00	2.74	115.79	19.19
20	4015.00	4015.00	2.59	118.05	20.72
21	4020.00	4020.00	3.33	122.43	46.03
22	4025.00	4025.00	3.53	116.79	47.55
23	4030.00	4029.99	4.12	111.57	33.33
24	4035.00	4034.95	4.43	111.30	25.91
25	4040.00	4039.96	5.15	112.15	32.51
26	4045.00	4044.94	5.63	111.16	35.35
27	4050.00	4049.91	6.63	109.21	24.61
28	4055.00	4054.87	7.41	109.73	22.95
29	4060.00	4059.83	8.42	107.95	47.24
30	4065.00	4064.77	9.22	105.25	44.62
31	4070.00	4069.70	9.99	105.57	36.03
32	4075.00	4074.62	10.14	107.25	39.51

33	4050.00	4079.54	10.15	107.05	25.43
34	4055.00	4084.46	9.54	106.44	14.71
35	4060.00	4089.39	9.54	107.77	24.49
36	4065.00	4094.32	9.91	107.51	15.66
37	4100.00	4099.24	9.75	107.55	15.14
38	4105.00	4104.17	9.59	107.35	23.24
39	4110.00	4109.11	9.31	107.63	30.20
40	4115.00	4114.04	9.34	109.16	15.45
41	4120.00	4115.97	9.23	110.09	17.62
42	4125.00	4123.91	5.94	110.60	21.24
43	4130.00	4128.85	5.95	111.64	16.54
44	4135.00	4133.79	5.76	111.55	24.49
45	4140.00	4138.73	5.70	111.42	24.00
46	4145.00	4143.67	5.69	111.62	25.31
47	4150.00	4148.62	5.96	112.45	15.54
48	4155.00	4153.56	5.74	112.12	14.37
49	4160.00	4158.50	5.67	110.56	34.61
50	4165.00	4163.44	5.71	112.22	23.40
51	4170.00	4168.35	5.72	110.63	22.15
52	4175.00	4173.32	5.72	111.52	26.12
53	4180.00	4178.26	5.66	110.92	25.51
54	4185.00	4183.20	5.71	110.69	30.64
55	4190.00	4188.14	5.62	110.55	25.60
56	4195.00	4193.09	5.96	105.52	20.05
57	4198.55	4196.54	5.63	111.35	21.67

5. Bottom Hole Assembly Record

Tool Description	Length (m)	Cum. Length (m)
BHA No. #1		
6" mill	0.93	0.93
4 – 3/4" bit sub	1.07	2.00
4 – 3/4" DC	216.93	218.93
3 – 1/2" HWDP	55.66	274.59
Total Length (m)		**274.59**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-
Flow (gpm)		-
Mw (pcf)		106.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #2		
2 * 4" Taper Tap	0.97	0.97
4 – 3/4" bit sub	1.07	2.04
4 – 3/4" DC	9.34	11.38
Fishing Jar	3.95	15.33

4 – 3/4" DC	8.80	24.13
3 – 1/2" HWDP	55.66	79.79
Total Length (m)		**79.79**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-
Flow (gpm)		-
Mw (pcf)		106.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #3		
6" mill	0.93	0.93
4 – 3/4" bit sub	1.07	2.00
4 – 3/4" DC	216.93	218.93
3 – 1/2" HWDP	55.66	274.59
Total Length (m)		**274.59**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-

Flow (gpm)		-
Mw (pcf)		106.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #4		
6 – 1/8" MT bit	0.17	0.17
4 – 3/4" bit sub	1.05	1.22
4 – 3/4" DC	136.2	137.42
3 – 1/2" HWDP	55.66	193.08
Total Length (m)		**193.08**
Drilling & Mud Properties		
WOB (lb)		8 – 12
RPM		50 – 60
Torque (klb)		1 – 4
SPP (psi)		1700 – 2500
Flow (gpm)		230 – 270
Mw (pcf)		106.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #5		
6 – 1/8" MT bit	0.17	0.17
7" Scraper	1.01	1.18
4 – 3/4" bit sub	1.05	2.23
4 – 3/4" DC	54.60	56.83

3 – 1/2" HWDP	55.66	112.49
Total Length (m)		**112.49**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-
Flow (gpm)		-
Mw (pcf)		106.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #6		
7" Whipstock	5.14	5.14
6 – 1/8" Tri-mill	2.96	8.10
4 – 3/4" running tools	1.04	9.14
3 – 1/2" DP	9.68	18.82
HFBPV	1.15	19.97
Gyro sub	0.56	20.53
4 – 3/4" DC	109.07	129.60
Total Length (m)		**129.60**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-

Torque (klb)		-
SPP (psi)		-
Flow (gpm)		-
Mw (pcf)		106.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #7		
7" Hyd.Mech. Whipstock	5.98	5.98
6 – 1/8" Tri-mill	2.96	8.94
4 – 3/4" running tools	1.04	9.98
3 – 1/2" DP	9.68	19.66
HFBPV	1.15	20.81
4 – 3/4" DC	109.07	129.88
Total Length (m)		**129.88**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-
Flow (gpm)		-
Mw (pcf)		106.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #8		

6 – 1/8" TriCone	0.18	0.18
4 – 3/4" PDM Motor	6.90	7.08
4 – 3/4" F. sub	0.40	7.48
4 – 3/4" UBHO	0.92	8.40
4 – 3/4" NFMDC	8.80	17.20
3 – 1/2" HWDP	231.00	248.20
4 – 3/4" D. Jar	4.40	252.60
3 – 1/2" HWDP	9.12	261.72
Total Length (m)		**261.72**
Drilling & Mud Properties		
WOB (lb)		6 – 18
RPM		10 – 40
Torque (klb)		2 – 4
SPP (psi)		2550 – 2750
Flow (gpm)		180 – 200
Mw (pcf)		106.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #9		
6 – 1/8" PDC bit	.023	.023
4 – 3/4" PDM Motor	6.94	7.17
4 – 3/4" F. sub	0.40	7.57
4 – 3/4" UBHO	0.92	8.49

4 – 3/4" NFMDC	8.80	17.29
3 – 1/2" HWDP	305.6	322.89
4 – 3/4" D. Jar	4.40	327.29
3 – 1/2" HWDP	8.90	336.19
Total Length (m)		**336.19**
Drilling & Mud Properties		
WOB (lb)		8 – 12
RPM		35 – 40
Torque (klb)		3 – 5
SPP (psi)		2700 – 2750
Flow (gpm)		190 – 200
Mw (pcf)		105.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #10		
5 – 1/2" overshot	8.90	8.90
4 – 3/4" DC	8.70	17.60
4 – 3/4" D. Jar	3.97	21.60
3 – 1/2" HWDP	305.40	327.00
Total Length (m)		**327.00**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-

Torque (klb)	-
SPP (psi)	-
Flow (gpm)	-
Mw (pcf)	103.00

Tool Description	Length (m)	Cum. Length (m)
BHA No. #11		
5 – 1/4" overshot	2.06	2.06
3 – 1/2" HWDP	9.12	11.18
4 – 3/4" D. Jar	3.97	15.15
3 – 1/2" HWDP	305.75	320.90
Total Length (m)		**320.90**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-
Flow (gpm)		-
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #12		
6 – 1/8" Tri-cone	0.18	0.18
Bit Sub	1.05	1.23

3 – 1/2" HWDP	305.75	306.98
Total Length (m)		**306.98**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-
Flow (gpm)		-
Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #13		
6 – 1/8" PDC Bit	0.23	0.23
4 – 3/4" Bit Sub	1.05	1.28
4 – 3/4" DC	162.92	28.80
3 – 1/2" HWDP	83.64	247.84
Total Length (m)		**247.84**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-
Flow (gpm)		-

Mw (pcf)		103.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #14		
6 – 1/8" PDC Bit	0.20	0.20
4 – 3/4" Bit Sub	1.05	1.25
4 – 3/4" DC	52.50	54.75
3 – 1/2" HWDP	233.00	277.75
Total Length (m)		**277.75**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-
Flow (gpm)		-
Mw (pcf)		103.00
BHA No. #15		
6 – 1/8" PDC Bit	0.18	0.18
4 – 3/4" Bit Sub	1.05	1.23
4 – 3/4" DC	107	108.23
3 – 1/2" HWDP	233.00	331.23
Total Length (m)		**331.23**
Drilling & Mud Properties		

WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-
Flow (gpm)		-
Mw (pcf)		105.00
BHA No. #16		
3 – 1/2" mill	0.43	0.43
3 – 1/8" Bit Sub	0.99	1.42
3 – 1/8" DC	140	141.42
2 – 7/8" HWDP	228	369.42
Total Length (m)		**369.42**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-
Flow (gpm)		-
Mw (pcf)		105.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #17		
3 – 1/2" J. mill	0.43	0.43

3 – 1/8" bit sub	0.99	1.42
3 – 1/8" DC	139.46	140.88
Total Length (m)		**140.88**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-
Flow (gpm)		-
Mw (pcf)		105.00
Tool Description	**Length (m)**	**Cum. Length (m)**
BHA No. #18		
6 – 1/8" Tri-cone	0.18	0.18
7" scraper	1.00	1.18
6 – 1/4" bit sub	1.05	2.23
3 – 1/2" HWDP	222.28	224.51
Total Length (m)		**224.51**
Drilling & Mud Properties		
WOB (lb)		-
RPM		-
Torque (klb)		-
SPP (psi)		-

Flow (gpm)	-
Mw (pcf)	105.00

6. Casing Information

Casing Spec.	20"	K – 55, 94#, BTC	0 – 155m
	13 – 3/8"	N – 80, 68#, BTC	0 – 2169m
	9 – 5/8"	C – 110, 47#, TPCQ	0 – 3909.5m
	7"	110 – SS, 29#, TPCQ	3778 – 4208m
	7" Tie-Back	L – 80, 29#, TPCQ	1998 – 3775.4m
	4 – 1/2”	T – 95, 15.2#, TPCQ	3871.3 – 4201.5

Table 6-1: AZNS-122 Final Casing Data

7. Cement Job Report

7.1 4 – 1/2" Liner Cement Job Report

JOB SUMMARY

Client:	MSA	Rig No:	201	JOB PERIOD DATE	
Service Company:	Spad Energy	Well No:	AZNS-122	From:	16 Jan 2025
Field:	AZADEGAN	Hole Section:		To:	16 Jan 2025
Service Requested:	Call Out for 4 1/2" Liner Cementing				

JOB LOG

Date	Time	Volume (bbl)	Density (pcf)	Rate (bpm)	Pressure (psi)	Description
16-Jan-24	13:45					Tool box meeting
16-Jan-24	14:00					Rig-up equipment
16-Jan-24	14:40				3000	test the line W3000psi
16-Jan-24	15:00	15	62.4	1		Pumping 15 bbl Chemical wash by Cmt Unit
16-Jan-24	15:15	40	118	4	1000	Start mix and pump cement slurry 118 pcf
16-Jan-24	15:25	40	118	4	1000	End of pumping cement slurry 118 pcf after 10 bbl
16-Jan-24	15:30	166		4	2000-3000	Start to Displace by Cmt Unit
16-Jan-24	16:15	166		4	2000-3000	End of Displace after 78 bbl by Cmt Unit
16-Jan-24	16:30					End of job and washing CMT unit

CHEMICAL WASH

Consume			Mixing Information		
Materials	Unit	QTY	Total Mixing Water in Mud Tanks	Total Chemical Wash Volume	15 bbl
Chemical Wash (SE-CW10)	gal	75		Chemical Wash Density	62.4 pcf
Anti-Foam (SE-A20)	gal	3	Total Mixing Fluid in Mud Tanks		
			Total Dead Volume 0 bbl		

CEMENT SLURRY

Consume			Mixing Information		
Materials			Mixing Information		
Class-G Cement	sacks	143	Total Mixing Water in Mud Tanks	Total CMT Slurry Volume	45 bbl
Silica flour	lb	5,236	22.9 bbl	CMT Slurry Density	118 pcf
Retarder (SE-R02)	lb	150	Total Mixing Fluid in Mud Tanks	Yield	1.7676 cu ft/sx
Dispersant (SE-D01)	lb	3	25.1 bbl	Mixing Water	6.7352 gal/sx
Anti-gas migration	gal	72		Mixing Fluid	7.3685 gal/sx
Anti-Foam (SE-A20)	gal	4			
			Total Dead Volume 0 bbl		

Client Representative:

تایید نهایی منوط به تایید دکتر [illegible]

Spad Energy Representative:

ماهان صنعت آریا

Drilling Supervisor

South Azadegan Project

Rig No:

CONTRACTOR Date:

Figure 7-1: AZNS-122 Liner Cement Job Report

8. Completion Report

8.1 Completion Tubing Information

Tubing Size (in)	Weight (ppf)	Grade	Ultimate Strengths	Connection	Collapse Pressure (psi)	Burst Pressure (psi)	Interval (m)
4 – 1/2	18.9	L – 80	233^{klb}	HSM3	13830	13380	0 – 1908.98
3 – 1/2	10.2	L – 80	440^{klb}	HSM3	12120	11560	1908.98 – 3620.06

Table 8-1: AZNS-122 Tubing Data

8.2 Completion Tools Specification Checklist

Item	Equipment Description	
1	**CONTROL LINE "WEIQIXIN":**	
	THINKNESS:	0.065"
	WORK PRESSURE:	15000 PSI
	O.D.:	0.25"
	TYPE:	SEAMLESS
	MATERIAL:	INC 825
	LENGTH:	120m/Roll
2	**UPPER FLOW COUPLING " WEIQIXIN" :**	
	OD:	**5.5"**
	ID:	3.640"
	THREADS:	4-1/2" 18.9 PPF, HSM3
	WORKING PRESSURE:	10000 PSI
	LENGTH:	6 FT
	MATERIAL:	13CR-110KSI
	LOWER FLOW COUPLING " WEIQIXIN" :	
	OD:	5.550"
	ID:	3.640"
	THREADS:	4-1/2" 18.9 PPF, HSM3
	WORKING PRESSURE:	10000 PSI
	LENGTH:	4 FT
	MATERIAL:	13CR-110KSI
3	**TUBING RETRIEVABL SAFETY VALVE " WEIQIXIN" :**	
	SETTING DEPTH:	60.852^{m}
	WORKING PRESSURE:	10000 PSI
	TEMPERATURE:	325 DEG F

	MAX O.D.:	7.5"
	MIN. I.D.:	3.437"
	PROFILE:	AF
	SELF-EQUALIZING FEATURE	HYDRAULIC CONTROL
	MATERIAL:	13CR-110KSI
	THREADS:	4-1/2" 18.9 PPF HSM3
	PROTECTION SLEEVE	
	PROFILE	AF
	MIN ID	2.9"
4	**TRAVELING JOINT " WEIQIXIN" :**	
	STROKE LENGTH	10 FT
	SHEAR PIN SET:	15000LB
	ELASTOMER:	AFLAS
	WORKING PRESSURE:	10000 psi
	TEMPERATURE:	300 DEG F
	TOOL OD:	5.315"
	TOOL ID:	2.922"
	THREADS:	3-1/2" 10.20 PPF HSM3 B*P
	MATERIAL:	13CR-110KSI
	TRANSFER TORQUE FEATURE	YES
5	**SLIDING SIDE DOOR " WEIQIXIN" :**	
	PROFILE:	X
	MAX.OD:	4.551"
	MIN ID:	2.750"
	PRESSURE RATING:	10000 PSI
	TEMPERATURE:	300 DEG F
	THREADS:	3-1/2" 10.20 PPF HSM3 B*P
	MATERIAL:	13CR-110KSI
	OPEN METHOD	DOWNWARD OPEN
6	**COMPLETION PACKER " WEIQIXIN" :**	
	TYPE:	PERMANENT
	CASING :	7" 32 PPF
	OD:	5.689"
	ID:	2.922"
	WORKING PRESSURE:	10000 PSI
	TEMPERATURE:	300 DEG F
	THREADS:	3-1/2" 10.20 PPF HSM3 B*P
	MATERIAL:	13CR-110KSI
	ELEMENT MATERIAL:	AFLAS
	4.0" ANCHOR SEAL	
	MAX OD (PACKING):	4"
	ID:	2.922"
	WORKING PRESSURE:	10000PSI
	TEMPERATURE:	300 DEG F
	THREADS:	3-1/2" 10.20 PPF HSM3 B
	TYPE:	RATCH LATCH

7	**LANDING NIPPLE " WEIQIXIN" :**	
	PROFILE TYPE:	XN
	WORKING PRESSURE:	10000 PSI
	MAX O.D.:	4.5"
	SEAL BORE:	2.75”
	MIN ID:	2.635"
	THREADS:	3-1/2" 10.20 PPF HSM3 B*P
	TEMPERATURE:	300 DEG F
	MATERIAL:	13CR-110KSI
8	**RE-ENTRY GUIDE SHOE " WEIQIXIN" :**	
	OD:	4.5"
	MIN ID:	2.922"
	TOP CONNECTION	3-1/2" 10.20 PPF HSM3 BOX
	MATERIAL:	13CR-110KSI
9	**3-1/2" CHEMICAL INJECTION" WEIQIXIN" :**	
	TYPE	TUBING RETRIVABLE
	MAX OD	5.00"
	MIN ID	2.922"
	MATERIAL:	13CR-110KSI
	TEMPERATURE	300 DEG F
	CONNECTION	3-1/2" 10.20 PPF HSM3 B*P
	CIV CONNECTION	NPT 3/8" BOX FOR CIV
	1.00"CIV VALVE	
	TYPE	DUAL CHECK VALVE WITH RUPTURE DISC
	WORKING PRESSURE	15000PSI
	MARERIAL	13CR-110KSI
	TEMPERATURE:	300 DEG F
	TOP CONNECTION	3/8" AUTOCLAVE
	BOTTOM CONNECTION	3/8" NPT
	RUPTURE DISC PRESSURE	6000PSI

Table 8-2: AZNS-122 Equipment Checklist

Item	Name	Description
1	**Tubing Hanger**	11" BOWL x 4-1/2" 18.9 PPF BOX TPCQ-EX CONNECTION BOTTOM & 4-1/2" 4-2G ACME BOX TOP WITH 4-1/2" EXTENDED NECK, WITH ONE CONTINUOUS 1/4" NPT C.LINE EXIT FOR SSSV, ONE 1/4" LINE EXIT FOR DHPG, INSTALLATION COMPLETE WITH RELATED FITTINGS AND PLUGS, WITH TWO CHANNEL FOR 3/8" CHEMICAL, C/W ALIGNMENT PREPATION FOR ESP. BPV: 4" TYPE H THREAD PREPARATION, THREE FS SEAL TO PACK OFF THE UPPER NECK AND TWO S SEAL TO PACK OFF THE BODY OF HANGER, MATERIAL: 410SS. M.C: FF-0.5 T.C: U PSL:3G PR:2 COMPANY: MSP
2	**Fluted Adaptor**	4 1/2" 18.9 PPF, L-80 HSM3 PIN * TPCQ EX PIN, OD: 5.5'' ID: 3.64'' SLOTS: 6 * 1 INCH WIDTH


Table 8-3: AZNS-122 Equipment Checklist

8.3 Assembling Test Report

WEIQIXIN PETROLEUM MACHINERY(TIANJIN)CO.LTD


惟其信 WEIQIXIN

SCSSV Test Report

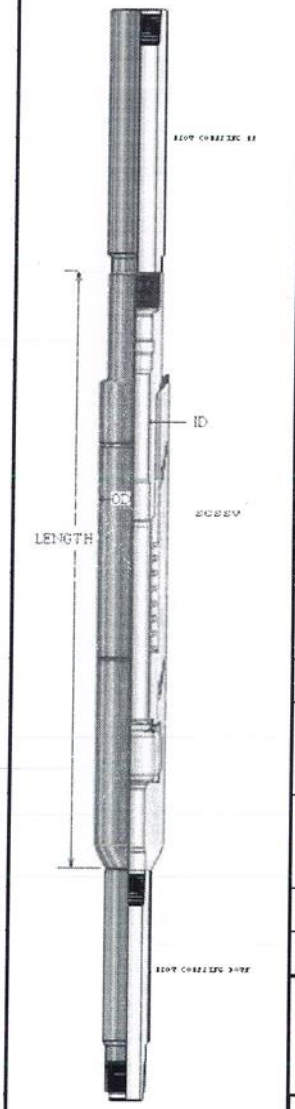


Type:	210W 343-AF04	
Serial Number:	08/24 24104-01	
Connection Size:	4-1/2" 18.90 PPF HSM3 BOX × PIN	
Working Pressure	10,000Psi	
OD:	7.500"	
ID:	3.437"	
Length:	1.783 m	
Material:	S13CR-110 KSI	
Hydraulic Control Pressure	Full Open	Full Closed
	1800 Psi	800 Psi
8,000 Psi Hydraulic Control Pressure No Drop in 15 Minutes	ok	
8,000 Psi Pressure No Drop in 15 Minutes	ok	
8,000 Psi flapper Pressure No Drop in 15 Minutes	ok	
Top Connection	Length:	1.623 m
Top Flow Coupling:	Serial Number:	08/24 Y240712-02
	Length:	1.724 m
Bottom Flow Coupling:	Serial Number:	09/24 Y240713-02
	Length:	1.116 m
Bottom Connection:	Length:	1.624m
Well Name and Location:	AZNS-122	
MSA Project Manager: Name/Title: Date:		
WQX: Name/Title: Date:	2025.2.15	


Figure 8-1: AZNS-122 TRSSSV Test Report

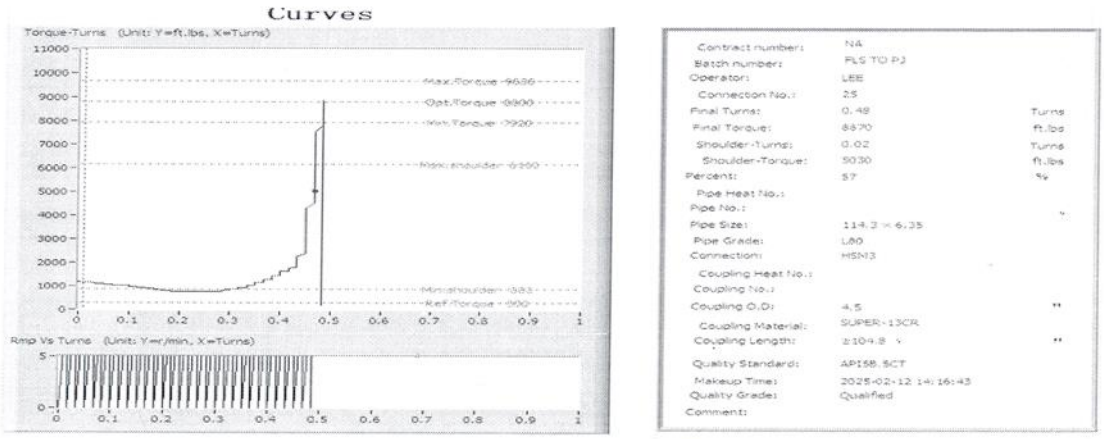


Top pup joint – top flow coupling

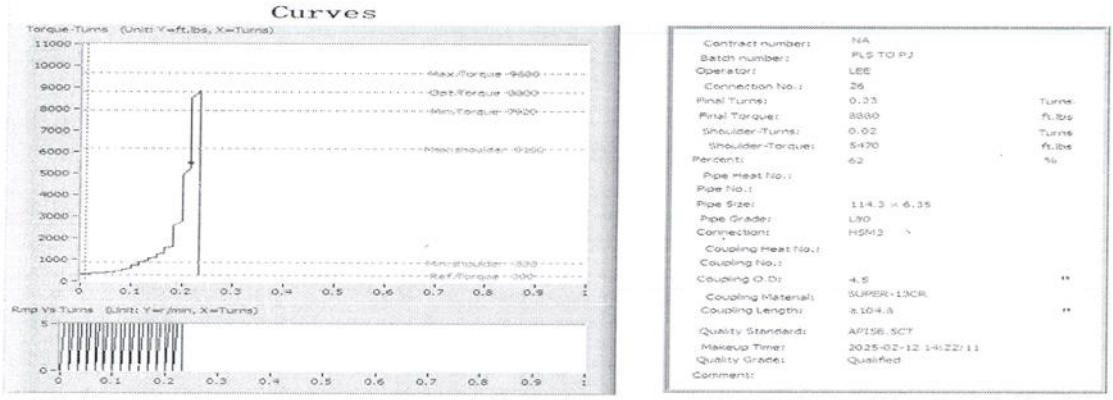


Top flow coupling – 3SV

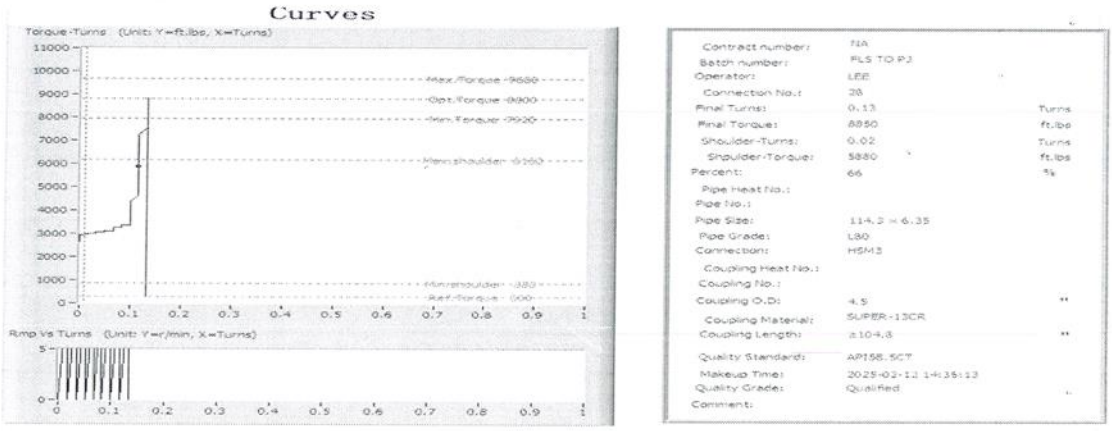

3SV - bottom flow coupling

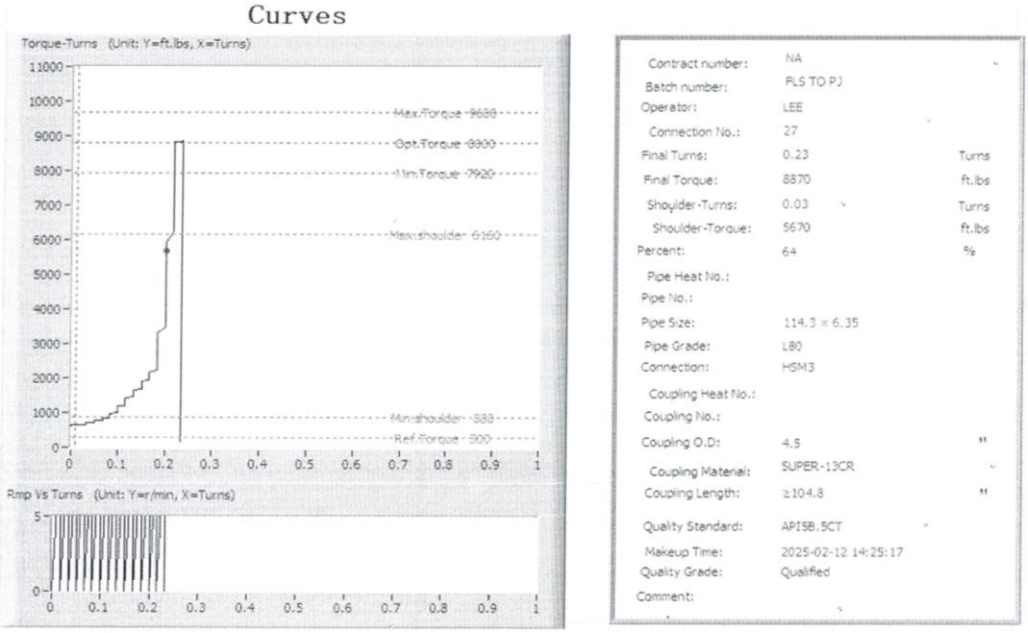

Bottom flow coupling - bottom pup joint

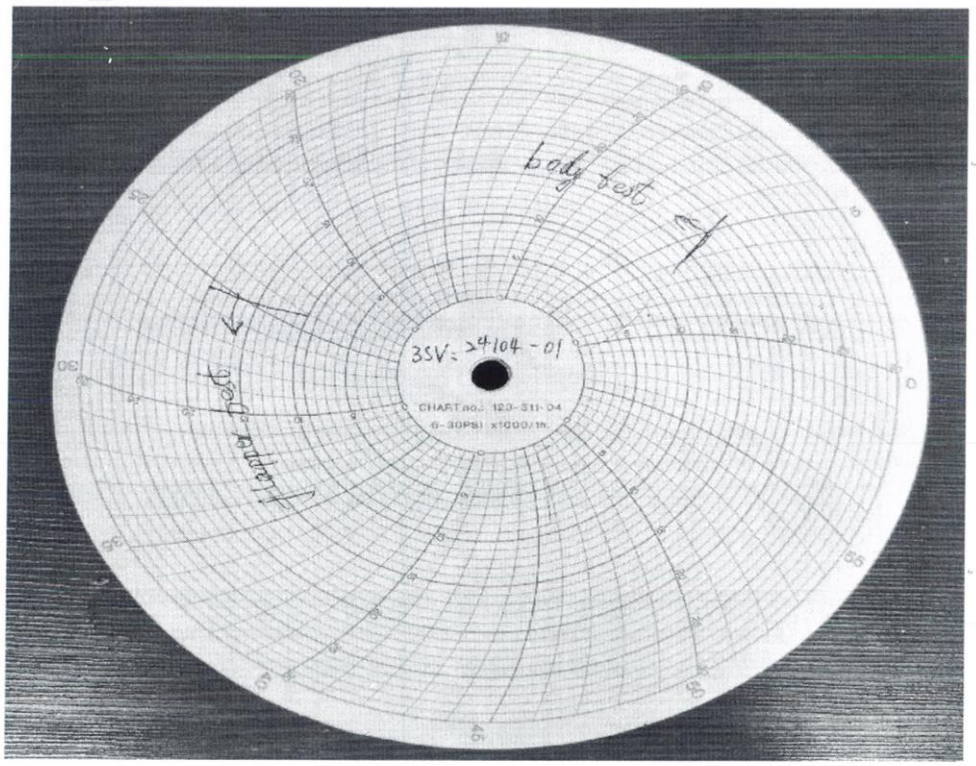


Pressure test curve

Figure 8-2: AZNS-122 TRSSSV Connections & Test Graph

惟其信 WEIQIXIN

WSDP Hydraulic Set Permanent Packer Test Report

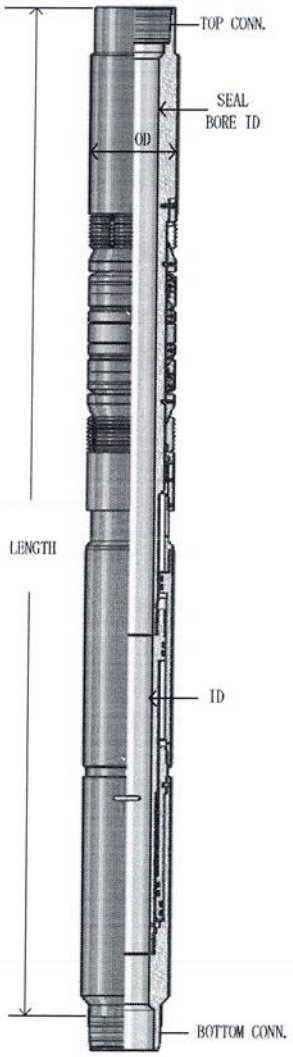

Type:	336W150-000	
Serial Number:	01/25 24198-01	
Connection Size:	LEFT HAND X 3-1/2" 10.20 PPF HSM3 PIN	
Working Pressure	10,000 Psi	
OD:	5.910"	
ID:	2.922"	
Length:	4.342m	
Material:	S13CR-110KSI	
Temperature:	300 DEG F	
Element :	Aflas	
Setting Pressure:	3,500 Psi	
Seal Bore Size:	Upper Seal Bore ID:4.00" & Lower Seal Bore ID:2.922"	
Top Connection:	Length:	2.019m
Bottom Connection:	Length:	1.999 m
Well Name and Location:	AZNS-122	

MSA Project Manager:
Name/Title:
Date:


WQX:
Name/Title:
Date: 2025.2.15

Figure 8-3: AZNS-122 Permanent Packer Test Report

WEIQIXIN PETROLEUM MACHINERY(TIANJIN)CO.LTD

惟其信 WEIQIXIN

WSDP Hydraulic Set Permanent Packer Test Report

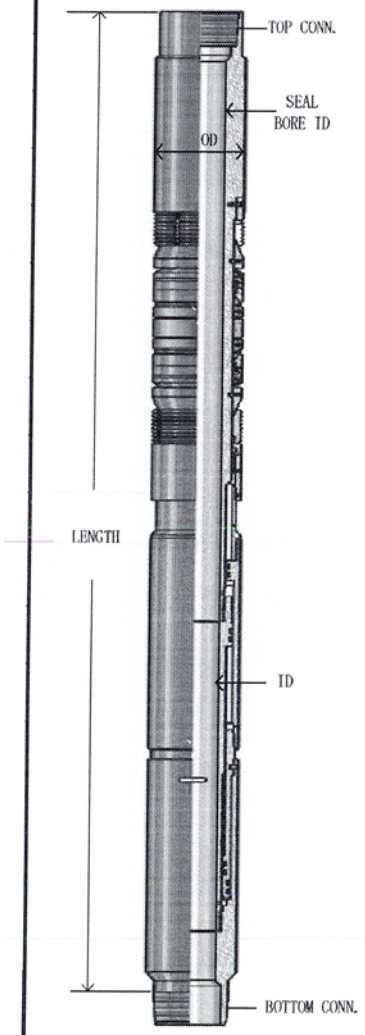


Type:	336W150-000	
Serial Number:	01/25 24198-01	
Connection Size:	LEFT HAND X 3-1/2" 10.20 PPF HSM3 PIN	
Working Pressure	10,000 Psi	
OD:	5.910"	
ID:	2.922"	
Length:	4.342m	
Material:	S13CR-110KSI	
Temperature:	300 DEG F	
Element :	Aflas	
Setting Pressure:	3,500 Psi	
Seal Bore Size:	Upper Seal Bore ID:4.00" & Lower Seal Bore ID:2.922"	
Top Connection:	Length:	2.019m
Bottom Connection:	Length:	1.999 m
Well Name and Location:	AZNS-122	


MSA Project Manager:
Name/Title:
Date:

WQX:
Name/Title:
Date: 2025.2.15


Figure 8-4: AZNS-122 Anchor Tubing Seal Test Report

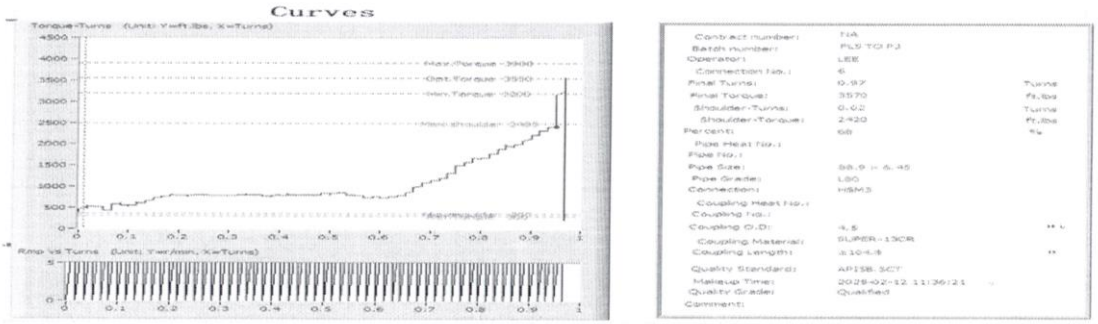

Top pup joint – anchor seal

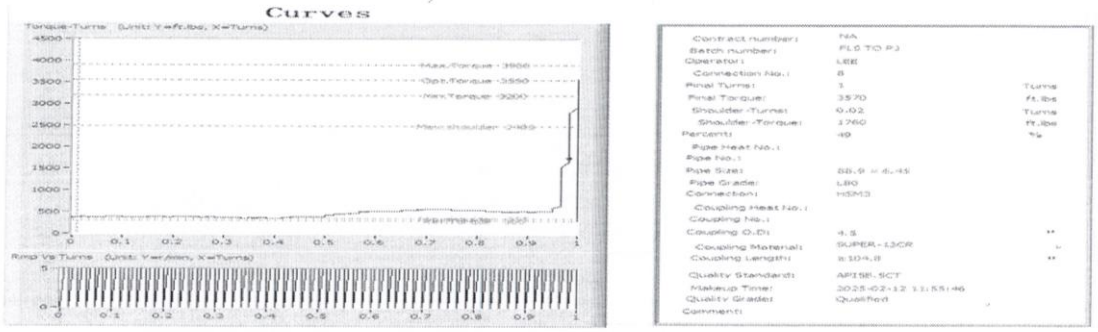

Packer – bottom pup joint

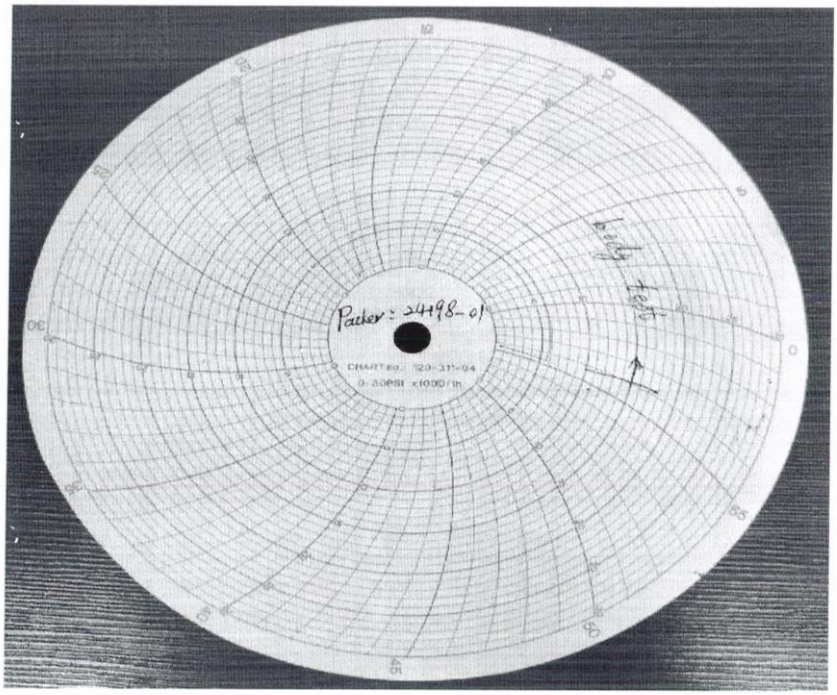


Pressure test curve

Figure 8-5: AZNS-122 Packer Connections & Test Graph

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

惟其信 WEIQIXIN

Sliding Side Door Test Report

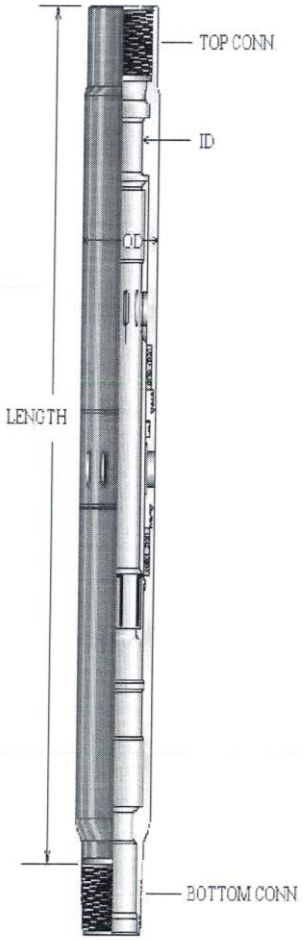


Type:	750W275-X39	
Serial Number:	08/24 24141-01	
Connection Size:	3-1/2" 10.20 PPF HSM3 BOX × PIN	
Working Pressure	10,000 Psi	
OD:	4.551"	
ID:	2.750"	
Seal Bore ID :	2.750"	
Length:	1.195m	
Temperature	300 DEG F	
Material:	S13CR-110KSI	
Profile:	X	
Shifting Direction:	DOWNWARD OPEN	
Top Connection:	Length:	2.010 m
Bottom Connection:	Length:	2.024 m
8,000 Psi Pressure No Drop in 15 Minutes	Ok	
8,000 Psi blanking plug Pressure No Drop in 15 Minutes	Ok	
Well Name and Location:	AZNS-122	


MSA Project Manager:
Name/Title:
Date:

WQX:
Name/Title:
Date: 2025.2.15


Figure 8-6: AZNS-122 SSD Test Report

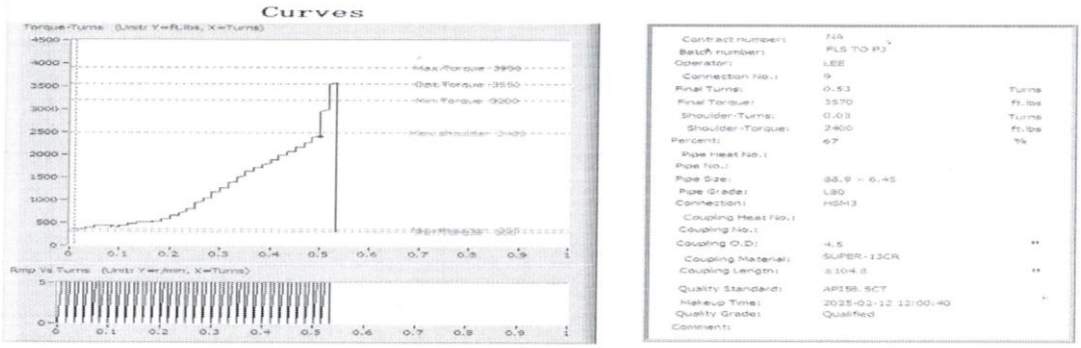

Top pup joint – SSD

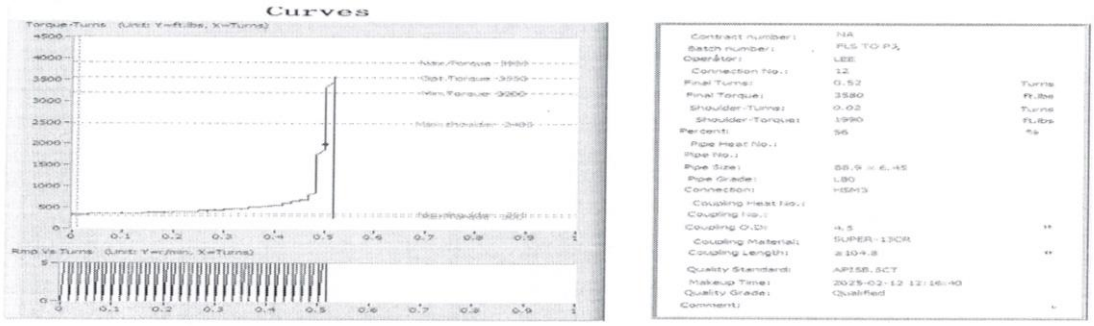

SSD – bottom joint

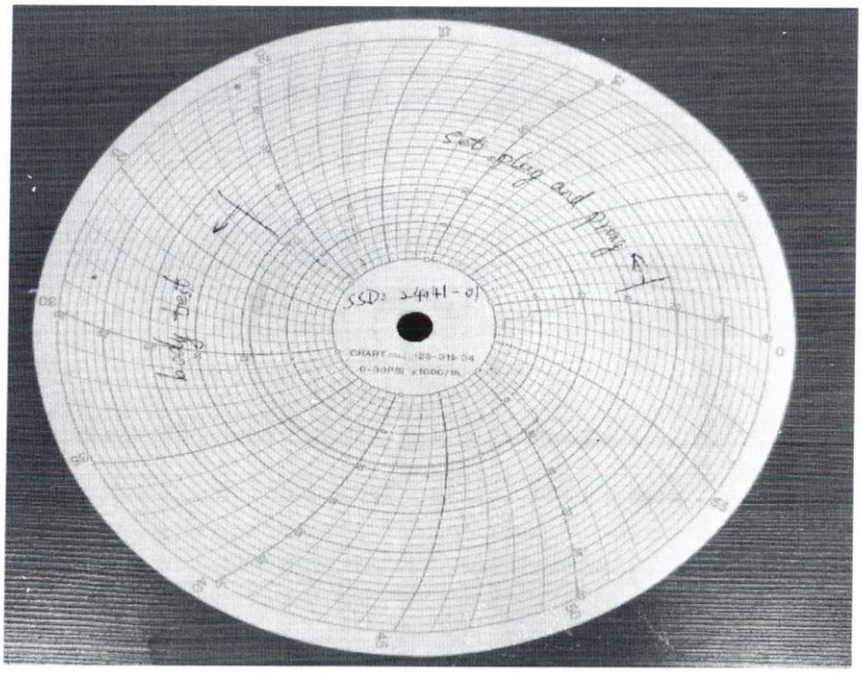


Pressure test curve

Figure 8-7: AZNS-122 SSD Connections & Test Graph

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

惟其信 WEIQIXIN

Expansion Joint Test Report

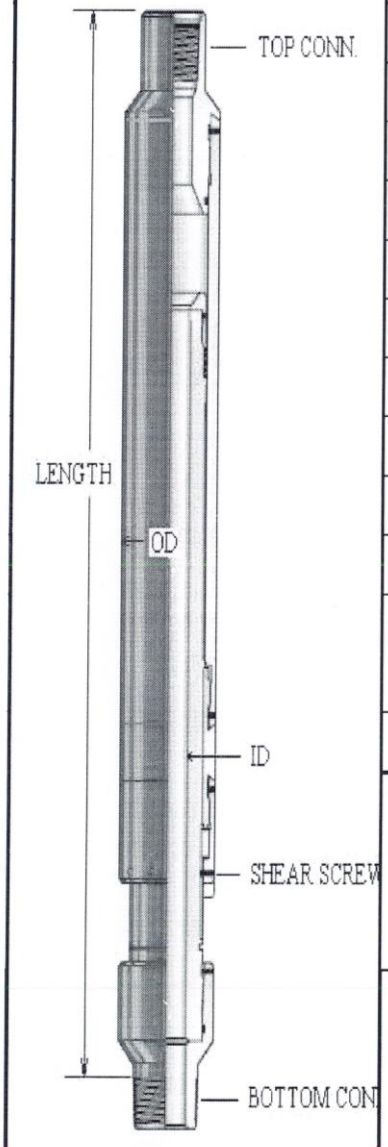


Type:	370W350-030	
Serial Number:	09/24 24107-01	
Connection Size:	3-1/2" 10.20 PPF HSM3 BOX× PIN	
Working Pressure	10,000 Psi	
OD:	5.315"	
ID:	2.922"	
Length:	7.305 m	
Material	S13CR-110KSI	
Share Screw:	3	
Top Connection:	Length:	2.027 m
Bottom Connection:	Length:	2.018 m
8,000 Psi Pressure No Drop in 15 Minutes	ok	
Well Name and Location:	AZNS-122	


MSA Project Manager:
Name/Title:
Date:

WQX:
Name/Title:
Date: 2015.2.15


Figure 8-8: AZNS-122 EX Jt Test Report

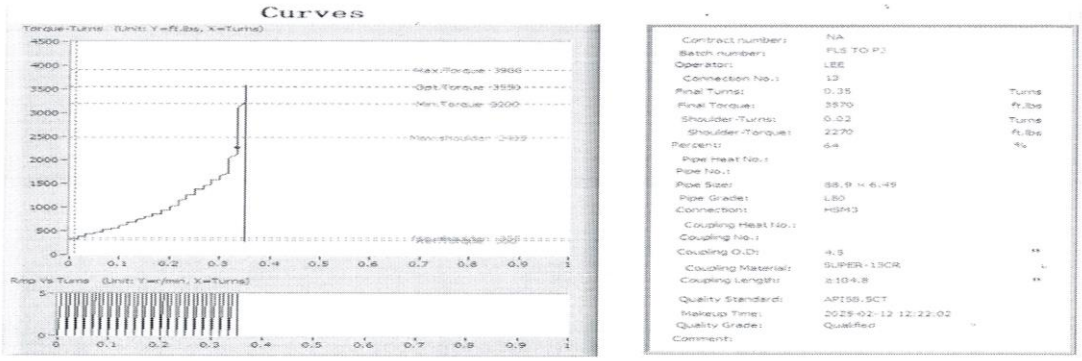

Top pup joint – EX.J

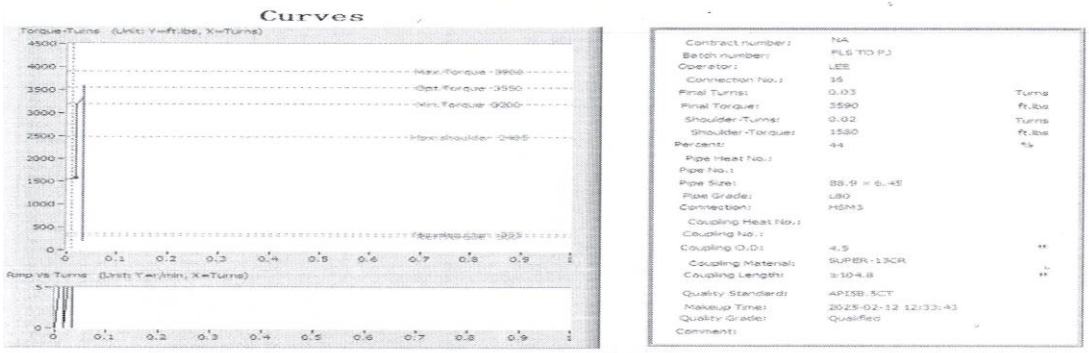

EX.J – bottom pup joint

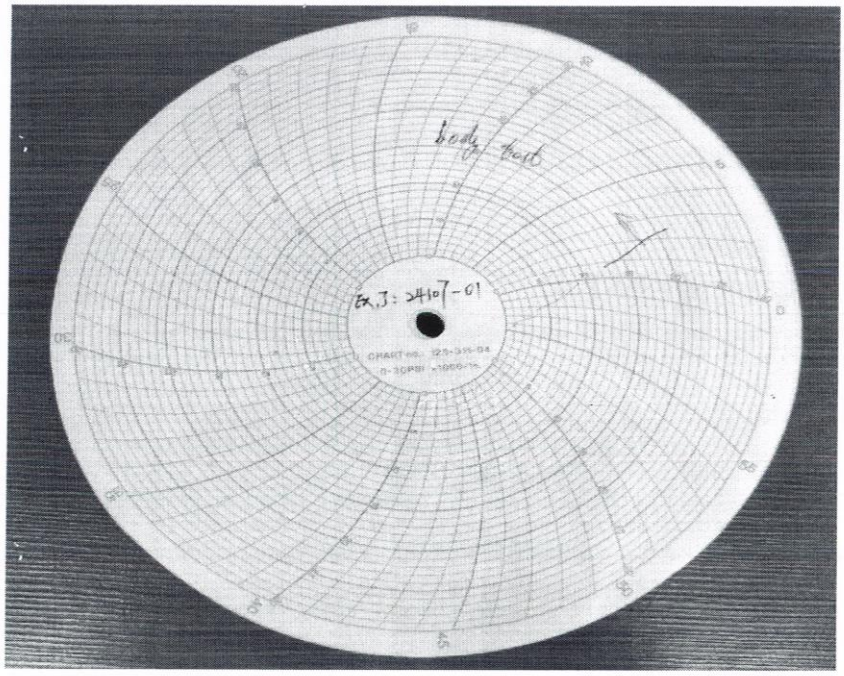


Pressure test curve

Figure 8-9: AZNS-122 EX Jt Connections & Test Graph

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

惟其信 WEIQIXIN

Landing Nipple Test Report

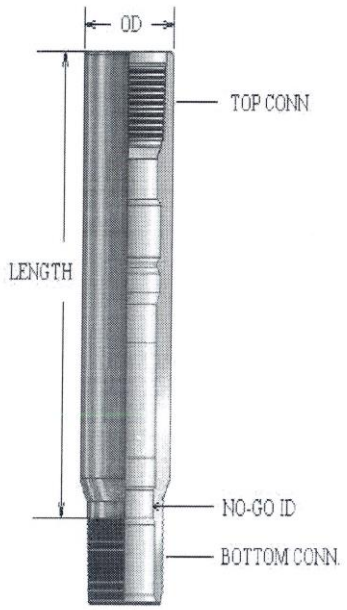


Type:	706W256-N18	
Serial Number:	08/24 Y240714-02	
Connection Size:	3-1/2"10.22 PPF HSM3 BOX × PIN	
OD:	4.500"	
ID:	2.562"	
NO-GO ID:	2.442"	
Length:	0.392m	
Material:	S13CR-110 KSI	
Top Connection:	Length:	2.010m
8,000 Psi blanking plug Pressure No Drop in 15 Minutes	Ok	
Well Name and Location	AZNS-122	


MSA Project Manager:
Name/Title:
Date:

WQX:
Name/Title:
Date: 2025. 2. 15


Figure 8-10: AZNS-122 Landing Nipple Test Report

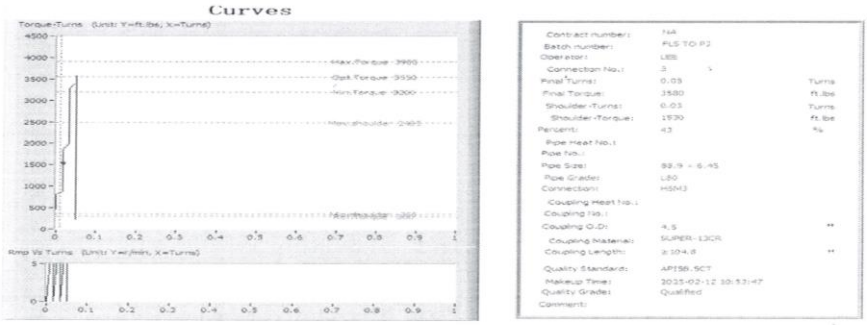

Top point – L.N

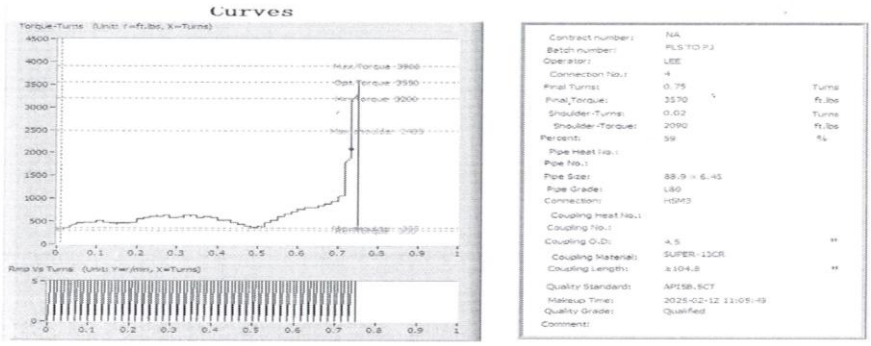

L.N – Muleshoe

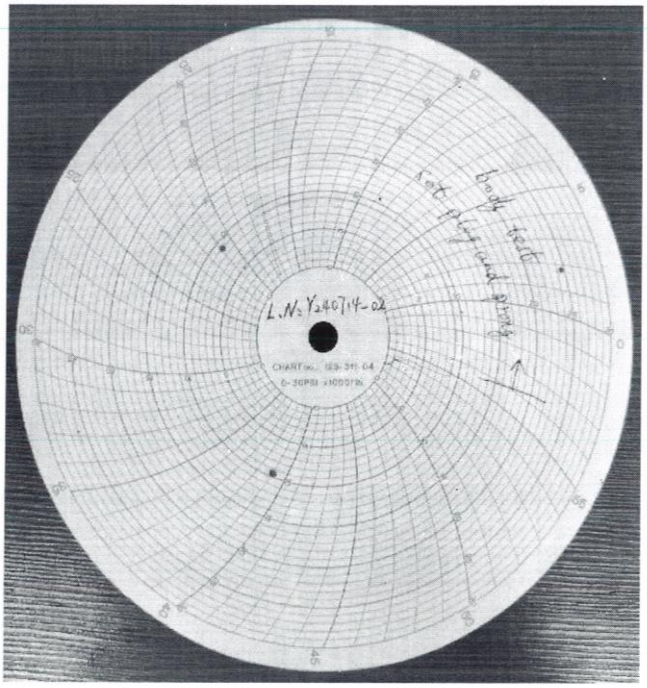

Pressure test curve

Figure 8-11: AZNS-122 Landing Nipple – Mule Shoe Connections & Test Graph

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

惟其信 WEIQIXIN

Chemical Injection Valve Test Report



Type:	802W100-601
Serial Number:	09/24 24129-01
Connection Size:	3/8" JAM NUT BOX x 3/8" NPT PIN
OD:	1"
ID:	0.299"
Rupture DISK:	6000Psi
Spring open pressure:	500Psi
Length:	310mm
Material:	S13CR-110 KSI
8,000 Psi Pressure No Drop in 15 Minutes	Ok
Well Name and Location	AZNS-122


MSA Project Manager:
Name/Title:
Date:

WQX:
Name/Title:
Date: 2005.2.15

Figure 8-12: AZNS-122 First CIV Test Report

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

Chemical Injection Mandrel Test Report

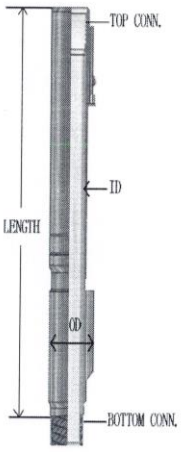


Type:	800W350-028	
Serial Number:	09/24 Y240720-03	
Connection Size:	3-1/2" 10.2PPF HSM3 BOX × PIN	
OD:	5.000"	
ID:	2.922"	
Working pressure:	15,000Psi	
Temperature:	300 DEG F	
Length:	0.728 m	
Top Connection:	Length:	2.002 m
Bottom Connection:	Length:	2.014 m
Material:	S13CR-110KSI	
8,000 Psi Pressure No Drop in 15 Minutes	Ok	
Well Name and Location	AZNS-122	


MSA Project Manager:
Name/Title:
Date:

WQX:
Name/Title:
Date: 2025.2.15


Figure 8-13: AZNS-122 First CIM Test Report

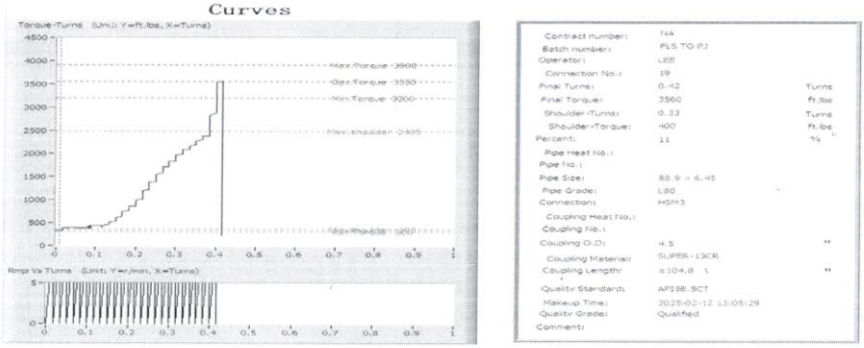

Top pup joint - CIM

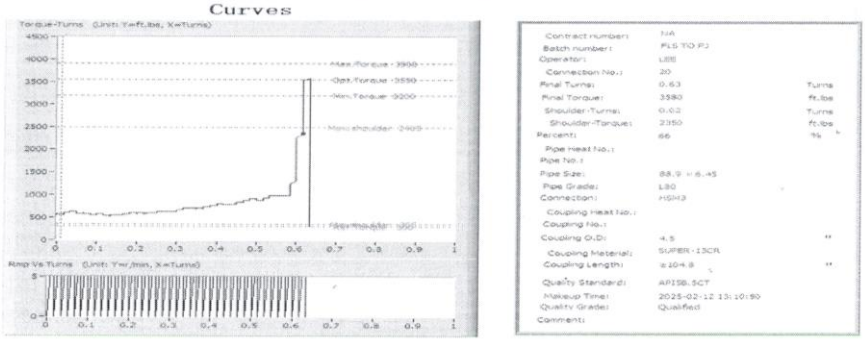

CIM – bottom joint

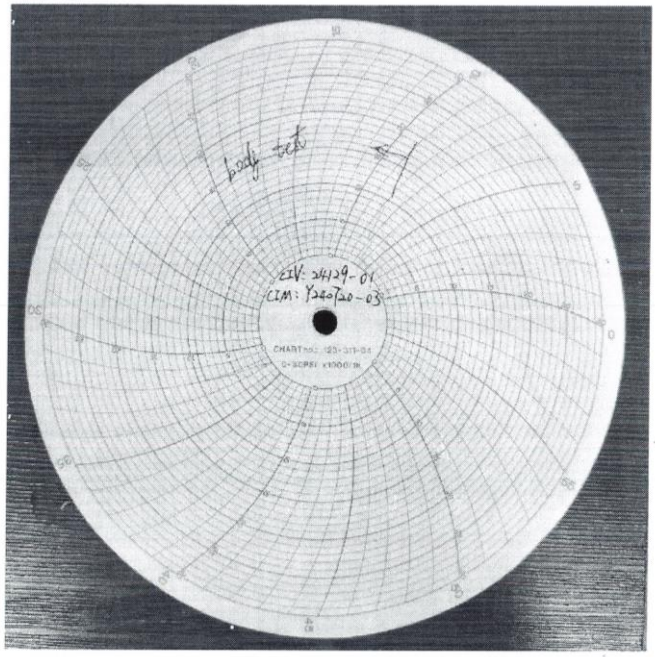

Pressure test curve

Figure 8-14: AZNS-122 CIM #1 Connections & Test Graph

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

惟其信 WEIQIXIN

Chemical Injection Valve Test Report



Type:	802W100-601
Serial Number:	09/24 24129-02
Connection Size:	3/8" JAM NUT BOX x 3/8" NPT PIN
OD:	1"
ID:	0.299"
Rupture DISK:	6000Psi
Spring open pressure:	500Psi
Length:	310mm
Material:	S13CR-110 KSI
8,000 Psi Pressure No Drop in 15 Minutes	Ok
Well Name and Location	AZNS-122

MSA Project Manager:
Name/Title:
Date:


WQX:
Name/Title:
Date: 2015.2.15

Figure 8-15: AZNS-122 Second CIV Test Report

WEIQIXIN PETROLEUM MACHINERY(TIANJIN) CO.LTD

惟其信 WEIQIXIN

Chemical Injection Mandrel Test Report

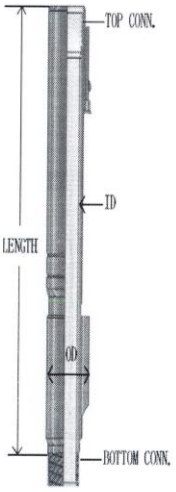


Type:	800W350-028	
Serial Number:	09/24 Y240720-01	
Connection Size:	3-1/2" 10.2PPF HSM3 BOX × PIN	
OD:	5.000"	
ID:	2.922"	
Working pressure:	15,000Psi	
Temperature:	300 DEG F	
Length:	0.728 m	
Top Connection:	Length:	2.017 m
Bottom Connection:	Length:	2.010 m
Material:	S13CR-110KSI	
8,000 Psi Pressure No Drop in 15 Minutes	Ok	
Well Name and Location	AZNS-122	


MSA Project Manager:
Name/Title:
Date:

WQX:
Name/Title:
Date: 2015.2.15


Figure 8-16: AZNS-122 Second CIM Test Report

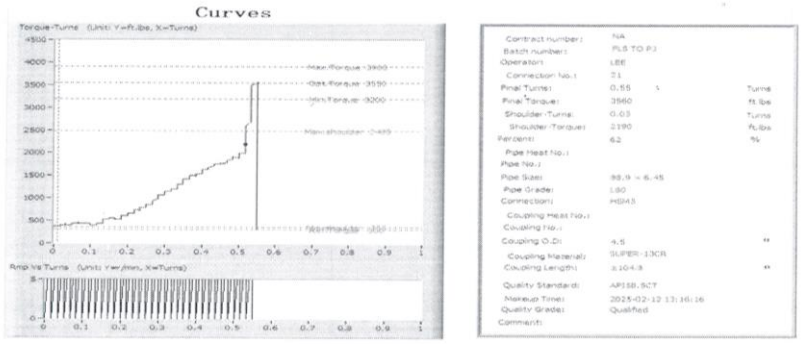

Top pup joint - CIM

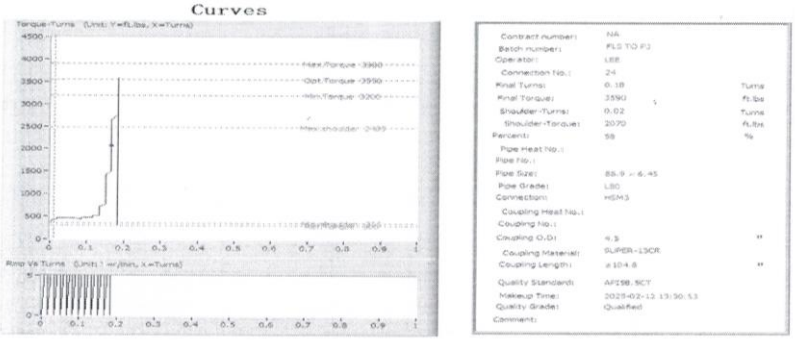

CIM – bottom joint

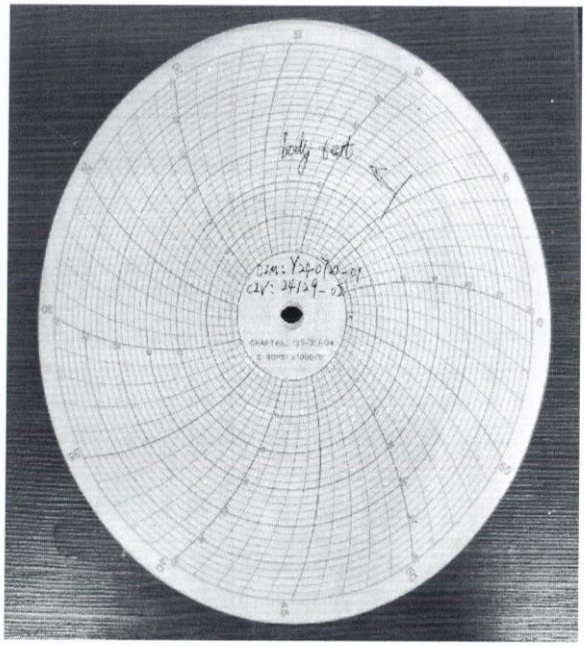

Pressure test curve

Figure 8-17: AZNS-122 CIM #2 Connections & Test Graph

8.4 Completion Operation Checklist

Item	Operation Name	Remark	Check Mark✓
1	Scraper Trip	Packer depth should be scraped	√
2	Pre-job preparation	Pre-connection All Down Hole Equipment With Upper & Lower Pup Joints On Confirmed Thread-makeup at Workshop, And Pressure Test Prior To Being Transported To Well Site.	√
		Retrieve Wear Bushing, M/U Jet Sub And Flush Bop Stack & Well Head With Fresh Water.	√
		All Crossovers, Pup Joints For Space Out Measured Put In Right Place.	√
		Lift Control Line And Protectors On Rig Floor.	√
		Hold A Pre-Job Safety Meeting For Running Upper Completion String.	√
3	Assembling and RIH	M/U 3-1/2" Re-entry Guide Shoe And 3-1/2" BTM No Go Landing Nipple	√
		Check The Conditions Landing Nipple To Make Sure There Is No Damage, Observe There Is No Any Trash Trapped Inside.	√
		Assemble Landing Nipple.	√
		RIH 1 Joint Tubing As Per Tally	√
		P/U And M/U Hydraulic-Set PERMANENT Production Packer.	√
		Much More Care Should Be Taken When Packer Is Passing Well Head And Liner Hanger While RIH,	√
		Assemble Ratch Latch If Packer	-
		Slack Off Packer Assembly, Double Check The Quantity Of Shear Pins,	√

		Remove The Tape On The Element, Check If Any Damages On It.	
		RIH 1 Joint Tubing As Per Tally	√
		M/U Pup Joint And SSD (close Position) To Tubing String With check valve Inside.	√
		Pressure Test Tubing String 7000psi/15min Every 50 JTs.	√
		RIH Completion String and M/U traveling joint as per running tally.	√
		M/U 2 NO. CIV as per running tally& Press Test to 2000 Psi.	-
		Cont. Running Tubing as per Tally while Install Cross protector for the 2 NO. 3/8"control line.	-
		M/U TRSSSV	√
		Install control line to TRSSSV and pressure test control line 8000psi x 15mins. And then keep 5000psi pressure while running to ensure TRSSSV open. Install TRSSSV protector for the 1/4" control line. Continue to run 4-1/2" tubing as per running tally.	√
4	M/U and Space out Tubing Hanger	Pick up & M/U tubing hanger with double pin crossover. M/U landing joint. Check string weight upward and downward.	√
		Roughly cut control line about 2 meters above tubing hanger, wrap 2-3 turns and then feed through Tubing Hanger.	√
		Check string weight upward and downward and Space out Tubing Hanger 1.5 m (Half stroke) above tubing head spool	√
Item	**Operation Name**	**Remark**	**Check Mark✓**
5	Set production	R/Up Slick Line. Remove Check valve inside SSD	√
		RIH and Set check vlve in Landing Nipple. POOH to surface.	√


	packer	Pressurize inside tubing to 500psi to ensure traveling joint is full open. Increase Pressure gradually to SET PACKER. Increase pressure to 7000 Psi to Test String.	√
7	Land Tubing hanger	Move down completion string and apply required weight to shear traveling joint load pins and Land Tubing hanger in T.H.S. Slack off completely & Record the weight.	√
		Drain the BOP stack through the gate valves of tubing head before landing hanger in THS. Leave the valves open.	√
		Tie Down Screws on THS should be fully open before Operation	√
8	N/D BOP & N/U X-mas tree	Tighten tie down screws.	√
		Test inside string w/ 5000 psi, 15 min.	√
		R/Up Slick Line. RIH with slick line and Ret. Check valve from Landing Nipple. POOH to surface.	√
		Test Annulus w/ 2000 Psi 15min.	√
		Close BOP ram and test above tubing hanger (annulus between BOP and landing joint) to 1000psi.	√
		B/O & L/D landing joint.	√
		Set 4” 2Way in TBG Hanger & Test it, Back off and L/D Running Tool.	√
		N/D BOP.	√
		Feed control line, through head bonnet.	√
		Check hanger for any damage and pressure test control line to 5000psi	√
		Pressure test chemical injection line & rapture the disc after installing	-

		Bonnet.	
		N/U x-mass tree as program.(Bottom Master)	√
		Perform required tests for X-mass tree. (Bottom Master)	√
		Connect from X-mass tree production valve to the pump unit & well test choke manifold with T-type connection & test all lines to 7500 Psi.	√
		Remove 4" two way, install 4" one way	√
		Close TRSSSV	√
		Release the rig. Clean the well site.	√

Table 8-4: AZNS-122 Operation Checklist

8.5 Completion Sketch & Tally

Field	AZADEGAN	Description	7"Liner	4 1/2" Liner	4 1/2" Tubing	3 1/2" Tubing	7'' Liner Lap:	1998
Well Number:	AZNS-122	OD[in]	7.00	4.50	4.50	3.50	7'' Liner Shoe:	3778
Rig :	201-OEOC	Nominal weight [lb/ft]	29.00	15.20	18.90	10.20	4.5'' Liner Lap:	3871.3
RTE-GLE	14.45	Grade	L-80	T-95	L-80	L-80	4.5" Liner Shoe:	4201.5
RTE-THF	10/2	Thread	TPCQ	TPCQ	HSM3	HSM3	Total Depth:	4208
Rig Spudded Date :		Inside diameter [in]	6.184	3.826	3.640	2.922	X-mass Tree:	MSP-T Type
End of Operation		API Drift Diameter	6.059	3.701	3.515	2.797	Size & Rating:	4-1/16" 10K

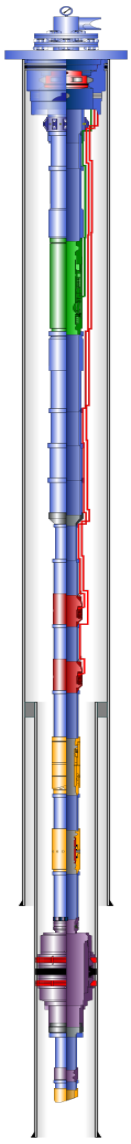Schematic		Description	Max OD	Min ID	Length(m)	BTM(m) F/ RTE	TOP(m) F/ RTE
	1	Elevation (Floor - TBG Head Flange) + Running			11.748	10.251	9.701
	2	TBG HANGER MSP, 10K, 11" * 4 1/2'' ACME Box up * 4 1/2'' TPCQ-EX Box Down , M/C: FF-0.5 T/C: UPSL: 3G PR: 2, 4" Type ''H'' Two Way	5.118	3.64	0.520	10.251	9.701
	3	4-1/2" FLUTED SWAGE ADAPTER D/P, 18.9# TPCQ-EX PIN ON TOP X HSM3 PIN ON DOWN* Super 13CR-110KSI, Weiqixin Co	6.1	3.64	0.964	10.771	10.251
	4	5 JOINTs TUBING 4 1/2",HSM3 ,18.9#, L-80, Type-1	5.118	3.64	47.595	49.821	10.771
	5	PUP JOINT 4 1/2",HSM3 ,18.9#, L-80, Type-1	5.118	3.64	1.522	59.330	49.821
	6	4-1/2" FLOW COUPLING,18.9#,Super 13CR-110KSI,HSM3 , 6 FT, Weiqixin Co	5.5	3.64	1.623	60.852	59.330
	7	TRSSV-10 TBG Retrievable Saftey Valve, 4 1/2", 18.9# W/ 3.437" Seal bore,HSM3 , Super 13CR-110KSI, 10K WP With AF Profile, Flapper Type, Weiqixin Co	7.5	3.437	1.682	62.475	60.852
	8	4-1/2" FLOW COUPLING, 18.9#,Super 13CR-110KSI,HSM3 , 4' FT, Weiqixin Co	5.5	3.64	1.016	64.157	62.475
	9	PUP JOINT 4 1/2",HSM3 ,18.9#, L-80, Type-1	5.118	3.64	1.625	65.173	64.157
	10	195 JOINTs TUBING 4-1/2"HSM3 18.9#, L-80	5.118	3.64	1851.720	1908.989	65.173
	11	X-over 4-1/2"HSM3, 18.9# BOX * 3-1/2"HSM3 , 10.2# PIN,	5.118	2.922	1.099	1918.518	1908.989
	12	176 JOINTs TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	1617.967	3528.070	1918.518
	13	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	2.01	3537.584	3528.070
	14	3 1/2" CIV TBG Retrievable Chemical Injection Mandrel, HSM3 , 10.2#,Super 13CR-110KSI w/ check valve, dual type & rupture disc, Weiqixin Co	5	2.922	0.728	3539.594	3537.584
	13	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.934	3540.322	3539.594
	15	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.054	3542.256	3539.594
	16	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	2.014	3551.310	3542.256
	17	3 1/2" CIV TBG Retrievable Chemical Injection Mandrel, HSM3 , 10.2#,Super 13CR-110KSI w/ check valve, dual type & rupture disc, Weiqixin Co	5	2.922	0.728	3553.324	3551.310
	19	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.926	3554.052	3553.324
	18	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.514	3555.978	3553.324
	19	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	2.12	3565.492	3555.978
	20	3-1/2" EXP. Joint,HSM3 , Super 13CR-110KSI, 10'STK (Half Open) Splind Rotational Lock System Any Position, Shear Pin Set 20,000 lbs, Weiqixin Co	5.135	2.922	5.760	3567.612	3565.492
	21	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	2.044	3573.372	3567.612
	22	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.529	3575.416	3573.372
	23	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.934	3584.945	3575.416
	24	3-1/2" Non-Elastomeric Sliding Side Door, Super 13CR-110KSI, HSM3 With Type X Selective Profile (Profile: 2.750" X, Downward open), Weiqixin Co	4.551	2.75	1.196	3586.879	3584.945
	26	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	2.044	3588.075	3586.879
	25	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.509	3590.119	3586.879
	26	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	2.01	3599.628	3590.119
	27	3-1/2" Anchor seal assembly,HSM3, 10.2#,Super 13CR-110KSI, 4" Packing OD, Weiqixin Co	4/00	2.922	0.230	3601.638	3599.628
	28	7' Hydraulic set permanent production PKR, model WSDP to be run in 7.00" 29-32 PPF CSG, Super 13CR-110KSI, UPPER SEAL BORE: 4", Weiqixin Co	5.689	2.922	4.340	3601.868	3601.638
	29	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.250	2.922	2.024	3606.208	3601.868
	30	1 JOINT TUBING 3-1/2"HSM3 , 10.2#, L-80.Type-1	4.25	2.922	9.504	3608.232	3606.208
	31	3-1/2" PUP JOINT,HSM3 , 10.2#, L-80, Type-1	4.25	2.922	1.934	3617.736	3608.232
	32	3-1/2" Bottom No-Go Landing,HSM3 , 10.2#, Super 13CR-110KSI W/ Seal Bore 2.75" Type XN, Weiqixin Co	4.5	2.562	0.39	3619.670	3617.736
	33	3-1/2" Wirline Re-entry guide, 10.2 #,HSM3 Con,Super 13CR-110KSI, Weiqixin Co	4.25	2.922	0.240	3620.060	3619.670
		END OF COMPLETION STRING					3620.060

TR3SV	62.475	60.852
Traveling Joint	3567.612	3565.492
CIV 1	3539.594	3537.584
CIV 2	3553.324	3551.310
SSD	3586.879	3584.945
7'' HYDRAULIC SET PERMANENT PRODUCTION PACKER	3601.868	3601.638
NO-GO Landing Nipple	3619.670	3617.736
Entry Guide	3620.060	3619.670
End of String	3620.060	

Figure 8-18: AZNS-122 Completion Sketch

MSA

Field :	S.Azadegan	Well NO:	AZNS122	Rig NO:	OEOC201	Drig CO:	OEOC
PEDEC, PPL		Completion String					

Grade	ID "	Drift "	Weight lb/ft	Burst psi	Collaspse psi	Yield klbs	Coupling "	TQ ft x lb	Nominal Dia. OD
L-80	2.922	2.797	10.2	11,560.0	12,120.0	233	3.962	3200-3550-3900	3-1/2"
L-80	3.640	3.515	18.9	13,380.0	13,820.0	440	5.137	7920-8800-9680	4-1/2"

BTM NO GO Depth:	3619.67	Formation Name :	Fahliyan	Hook Weight :	68 k lb
BTM of String		Formation Top :	3989	VOLUME (TOTAL)	127.25
Packer Depth :	3601.87			Mud Weight (pcf) :	105

Number on jt	Grade	Run In No.	Jt Length (m)	Cum Length (m)	Dist to RT (m)	M/D weight (Klbs)	VOL(BBL)	Remarks	
								joint no	IN / OUT
					3620.3	68.00			
3-1/2" Wirline Re-entry guide, 10.2 #,HSM3 Con,Super 13CR-110KSI, Weiqixin Co	3-1/2" Mule Shoe		0.240	0.24	3620.060	96.26	0.01		
3-1/2" Bottom No-Go Landing,HSM3 , 10.2#, Super 13CR-110KSI W/ Seal Bore 2.75" Type XN, Weiqixin Co	3-1/2" BTM NO GO		0.39	0.63	3619.670	142.18	0.02		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		1.934	2.56	3617.736	369.89	0.07		
1	TBG 3-1/2", 10.2#, L-80,HSM3	1	9.504	12.07	3608.232	1488.89	0.33		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		2.024	14.09	3606.208	1727.20	0.38		
7" Hydraulic set permanent production PKR, model WSDP to be run in 7.00" 29-32 PPF CSG, Super 13CR-110KSI, UPPER SEAL BORE: 4", Weiqixin Co	PKR		4.340	18.43	3601.868	2238.19	0.50		
3-1/2" Anchor seal assembly,HSM3, 10.2#,Super 13CR-110KSI, 4" Packing OD, Weiqixin Co	Ratch Lach		0.230	18.66	3601.638	2265.27	0.51		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		2.01	20.67	3599.628	2501.93	0.56		
2	TBG 3-1/2", 10.2#, L-80,HSM3		9.509	30.18	3590.119	3621.53	0.82		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	0.00		2.044	32.23	3588.075	3621.53	0.82		
3-1/2" Non-Elastomeric Sliding Side Door, Super 13CR-110KSI, HSM3 With Type X Selective Profile (Profile: 2.750" X, Downward open), Weiqixin Co	SSD		1.196	33.42	3586.879	3762.34	0.85		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		1.934	35.36	3584.945	3990.05	0.91		
3	TBG 3-1/2", 10.2#, L-80,HSM3		9.529	44.88	3575.416	5112.00	1.17		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		2.044	46.93	3573.372	5352.66	1.22		
3-1/2" EXP. Joint,HSM3 , Super 13CR-110KSI, 10'STK (Half Open) Splind Rotational Lock System Any Position, Shear Pin Set 20,000 lbs, Weiqixin Co	Traveling Jt		5.760	52.69	3567.612	6030.85	1.38		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		2.12	54.81	3565.492	6280.46	1.44		
4	TBG 3-1/2", 10.2#, L-80,HSM3		9.514	64.32	3555.978	7400.64	1.69		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	0.00		1.926	66.25	3554.052	7400.64	1.69		
3 1/2" CIV TBG Retrievable Chemical Injection Mandrel, HSM3 , 10.2#,Super 13CR-110KSI w/ check valve, dual type & rupture disc, Weiqixin Co	CIV #1		0.728	66.98	3553.324	7486.36	1.71		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		2.014	68.99	3551.310	7723.49	1.77		
5	TBG 3-1/2", 10.2#, L-80,HSM3		9.054	78.04	3542.256	8789.51	2.02		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	0.00		1.934	79.98	3540.322	8789.51	2.02		
3 1/2" CIV TBG Retrievable Chemical Injection Mandrel, HSM3 , 10.2#,Super 13CR-110KSI w/ check valve, dual type & rupture disc, Weiqixin Co	CIV #2		0.728	80.71	3539.594	8875.22	2.04		
3-1/2" Pup Jt,HSM3 , 10.2#, L-80, Type-1	Pup Jt 3-1/2", 10.2#,HSM3		2.01	82.72	3537.584	9111.88	2.09		Protector

6	TBG 3-1/2", 10.2#, L-80,HSM3	6	9.514	92.23	3528.070	10232.06	2.35	6	Protector
7	TBG 3-1/2", 10.2#, L-80,HSM3	7	9.544	101.77	3518.526	11355.78	2.61	7	Protector
8	TBG 3-1/2", 10.2#, L-80,HSM3	8	9.514	111.29	3509.012	12475.96	2.87	8	Protector
9	TBG 3-1/2", 10.2#, L-80,HSM3	9	9.054	120.34	3499.958	13541.98	3.11	9	Protector
10	TBG 3-1/2", 10.2#, L-80,HSM3	10	9.504	129.85	3490.454	14660.99	3.37	10	Protector
11	TBG 3-1/2", 10.2#, L-80,HSM3	11	9.514	139.36	3480.940	15781.17	3.63	11	Protector
12	TBG 3-1/2", 10.2#, L-80,HSM3	12	9.444	148.80	3471.496	16893.11	3.89	12	Protector
13	TBG 3-1/2", 10.2#, L-80,HSM3	13	9.514	158.32	3461.982	18013.30	4.15	13	Protector
14	TBG 3-1/2", 10.2#, L-80,HSM3	14	9.514	167.83	3452.468	19133.48	4.41	14	Protector
15	TBG 3-1/2", 10.2#, L-80,HSM3	15	8.954	176.79	3443.514	20187.73	4.65	15	Protector
16	TBG 3-1/2", 10.2#, L-80,HSM3	16	9.504	186.29	3434.010	21306.73	4.91	16	Protector
17	TBG 3-1/2", 10.2#, L-80,HSM3	17	9.504	195.79	3424.506	22425.74	5.17	17	Protector
18	TBG 3-1/2", 10.2#, L-80,HSM3	18	9.514	205.31	3414.992	23545.92	5.43	18	Protector
19	TBG 3-1/2", 10.2#, L-80,HSM3	19	9.514	214.82	3405.478	24666.10	5.69	19	Protector
20	TBG 3-1/2", 10.2#, L-80,HSM3	20	9.444	224.27	3396.034	25778.05	5.94	20	Protector
21	TBG 3-1/2", 10.2#, L-80,HSM3	21	9.514	233.78	3386.520	26898.23	6.20	21	Protector
22	TBG 3-1/2", 10.2#, L-80,HSM3	22	9.524	243.30	3376.996	28019.59	6.46	22	Protector
23	TBG 3-1/2", 10.2#, L-80,HSM3	23	9.054	252.36	3367.942	29085.61	6.71	23	Protector
24	TBG 3-1/2", 10.2#, L-80,HSM3	24	9.524	261.88	3358.418	30206.97	6.97	24	Protector
25	TBG 3-1/2", 10.2#, L-80,HSM3	25	9.514	271.40	3348.904	31327.15	7.22	25	Protector
26	TBG 3-1/2", 10.2#, L-80,HSM3	26	9.514	280.91	3339.390	32447.34	7.48	26	Protector
27	TBG 3-1/2", 10.2#, L-80,HSM3	27	9.519	290.43	3329.871	33568.11	7.74	27	Protector
28	TBG 3-1/2", 10.2#, L-80,HSM3	28	9.519	299.95	3320.352	34688.88	8.00	28	Protector
29	TBG 3-1/2", 10.2#, L-80,HSM3	29	9.504	309.45	3310.848	35807.89	8.26	29	Protector
30	TBG 3-1/2", 10.2#, L-80,HSM3	30	9.524	318.98	3301.324	36929.25	8.52	30	Protector
31	TBG 3-1/2", 10.2#, L-80,HSM3	31	9.519	328.50	3291.805	38050.02	8.78	31	Protector
32	TBG 3-1/2", 10.2#, L-80,HSM3	32	9.514	338.01	3282.291	39170.20	9.04	32	Protector
33	TBG 3-1/2", 10.2#, L-80,HSM3	33	9.534	347.54	3272.757	40292.74	9.30	33	Protector
34	TBG 3-1/2", 10.2#, L-80,HSM3	34	9.064	356.61	3263.693	41359.94	9.54	34	Protector
35	TBG 3-1/2", 10.2#, L-80,HSM3	35	9.514	366.12	3254.179	42480.12	9.80	35	Protector
36	TBG 3-1/2", 10.2#, L-80,HSM3	36	9.439	375.56	3244.740	43591.47	10.06	36	Protector
37	TBG 3-1/2", 10.2#, L-80,HSM3	37	9.514	385.07	3235.226	44711.66	10.32	37	Protector
38	TBG 3-1/2", 10.2#, L-80,HSM3	38	9.524	394.60	3225.702	45833.02	10.58	38	Protector
39	TBG 3-1/2", 10.2#, L-80,HSM3	39	9.524	404.12	3216.178	46954.38	10.84	39	Protector
40	TBG 3-1/2", 10.2#, L-80,HSM3	40	9.519	413.64	3206.659	48075.15	11.10	40	Protector
41	TBG 3-1/2", 10.2#, L-80,HSM3	41	9.524	423.17	3197.135	49196.51	11.35	41	Protector
42	TBG 3-1/2", 10.2#, L-80,HSM3	42	9.524	432.69	3187.611	50317.87	11.61	42	Protector
43	TBG 3-1/2", 10.2#, L-80,HSM3	43	9.509	442.20	3178.102	51437.46	11.87	43	Protector
44	TBG 3-1/2", 10.2#, L-80,HSM3	44	9.514	451.71	3168.588	52557.65	12.13	44	Protector
45	TBG 3-1/2", 10.2#, L-80,HSM3	45	9.364	461.08	3159.224	53660.17	12.39	45	Protector
46	TBG 3-1/2", 10.2#, L-80,HSM3	46	9.519	470.60	3149.705	54780.94	12.65	46	Protector
47	TBG 3-1/2", 10.2#, L-80,HSM3	47	9.524	480.12	3140.181	55902.30	12.90	47	Protector
48	TBG 3-1/2", 10.2#, L-80,HSM3	48	9.509	489.63	3130.672	57021.89	13.16	48	Protector
49	TBG 3-1/2", 10.2#, L-80,HSM3	49	9.504	499.13	3121.168	58140.90	13.42	49	Protector
50	TBG 3-1/2", 10.2#, L-80,HSM3	50	9.524	508.66	3111.644	59262.26	13.68	50	Protector
51	TBG 3-1/2", 10.2#, L-80,HSM3	51	9.514	518.17	3102.130	60382.44	13.94	51	Protector
52	TBG 3-1/2", 10.2#, L-80,HSM3	52	9.514	527.68	3092.616	61502.63	14.20	52	Protector
53	TBG 3-1/2", 10.2#, L-80,HSM3	53	9.519	537.20	3083.097	62623.40	14.46	53	Protector
54	TBG 3-1/2", 10.2#, L-80,HSM3	54	9.514	546.72	3073.583	63743.58	14.72	54	Protector
55	TBG 3-1/2", 10.2#, L-80,HSM3	55	9.524	556.24	3064.059	64864.94	14.98	55	Protector
56	TBG 3-1/2", 10.2#, L-80,HSM3	56	9.514	565.76	3054.545	65985.12	15.24	56	Protector
57	TBG 3-1/2", 10.2#, L-80,HSM3	57	9.509	575.26	3045.036	67104.72	15.49	57	Protector
58	TBG 3-1/2", 10.2#, L-80,HSM3	58	8.954	584.22	3036.082	68158.97	15.74	58	Protector
59	TBG 3-1/2", 10.2#, L-80,HSM3	59	9.514	593.73	3026.568	69279.15	16.00	59	Protector
60	TBG 3-1/2", 10.2#, L-80,HSM3	60	9.504	603.24	3017.064	70398.15	16.26	60	Protector

61	TBG 3-1/2", 10.2#, L-80,HSM3	61	9.504	612.74	3007.560	71517.16	16.51	61	Protector
62	TBG 3-1/2", 10.2#, L-80,HSM3	62	9.509	622.25	2998.051	72636.75	16.77	62	Protector
63	TBG 3-1/2", 10.2#, L-80,HSM3	63	9.044	631.29	2989.007	73701.60	17.02	63	Protector
64	TBG 3-1/2", 10.2#, L-80,HSM3	64	9.514	640.81	2979.493	74821.78	17.28	64	Protector
65	TBG 3-1/2", 10.2#, L-80,HSM3	65	9.524	650.33	2969.969	75943.14	17.54	65	Protector
66	TBG 3-1/2", 10.2#, L-80,HSM3	66	9.204	659.54	2960.765	77026.83	17.79	66	Protector
67	TBG 3-1/2", 10.2#, L-80,HSM3	67	9.519	669.05	2951.246	78147.60	18.05	67	Protector
68	TBG 3-1/2", 10.2#, L-80,HSM3	68	9.509	678.56	2941.737	79267.19	18.31	68	Protector
69	TBG 3-1/2", 10.2#, L-80,HSM3	69	9.509	688.07	2932.228	80386.79	18.56	69	Protector
70	TBG 3-1/2", 10.2#, L-80,HSM3	70	9.509	697.58	2922.719	81506.38	18.82	70	Protector
71	TBG 3-1/2", 10.2#, L-80,HSM3	71	9.514	707.10	2913.205	82626.56	19.08	71	Protector
72	TBG 3-1/2", 10.2#, L-80,HSM3	72	9.514	716.61	2903.691	83746.75	19.34	72	Protector
73	TBG 3-1/2", 10.2#, L-80,HSM3	73	9.524	726.13	2894.167	84868.11	19.60	73	Protector
74	TBG 3-1/2", 10.2#, L-80,HSM3	74	9.504	735.64	2884.663	85987.11	19.86	74	Protector
75	TBG 3-1/2", 10.2#, L-80,HSM3	75	9.524	745.16	2875.139	87108.47	20.12	75	Protector
76	TBG 3-1/2", 10.2#, L-80,HSM3	76	9.514	754.68	2865.625	88228.65	20.38	76	Protector
77	TBG 3-1/2", 10.2#, L-80,HSM3	77	9.514	764.19	2856.111	89348.84	20.64	77	Protector
78	TBG 3-1/2", 10.2#, L-80,HSM3	78	9.514	773.70	2846.597	90469.02	20.89	78	Protector
79	TBG 3-1/2", 10.2#, L-80,HSM3	79	9.514	783.22	2837.083	91589.20	21.15	79	Protector
80	TBG 3-1/2", 10.2#, L-80,HSM3	80	9.514	792.73	2827.569	92709.39	21.41	80	Protector
81	TBG 3-1/2", 10.2#, L-80,HSM3	81	9.514	802.25	2818.055	93829.57	21.67	81	Protector
82	TBG 3-1/2", 10.2#, L-80,HSM3	82	9.054	811.30	2809.001	94895.59	21.92	82	Protector
83	TBG 3-1/2", 10.2#, L-80,HSM3	83	9.514	820.81	2799.487	96015.77	22.18	83	Protector
84	TBG 3-1/2", 10.2#, L-80,HSM3	84	9.514	830.33	2789.973	97135.96	22.44	84	Protector
85	TBG 3-1/2", 10.2#, L-80,HSM3	85	9.514	839.84	2780.459	98256.14	22.69	85	Protector
86	TBG 3-1/2", 10.2#, L-80,HSM3	86	9.524	849.37	2770.935	99377.50	22.95	86	Protector
87	TBG 3-1/2", 10.2#, L-80,HSM3	87	9.514	858.88	2761.421	100497.68	23.21	87	Protector
88	TBG 3-1/2", 10.2#, L-80,HSM3	88	9.474	868.35	2751.947	101613.16	23.47	88	Protector
89	TBG 3-1/2", 10.2#, L-80,HSM3	89	9.504	877.86	2742.443	102732.16	23.73	89	Protector
90	TBG 3-1/2", 10.2#, L-80,HSM3	90	9.514	887.37	2732.929	103852.34	23.99	90	Protector
91	TBG 3-1/2", 10.2#, L-80,HSM3	91	9.514	896.89	2723.415	104972.53	24.25	91	Protector
92	TBG 3-1/2", 10.2#, L-80,HSM3	92	9.504	906.39	2713.911	106091.53	24.51	92	Protector
93	TBG 3-1/2", 10.2#, L-80,HSM3	93	9.514	915.90	2704.397	107211.72	24.76	93	Protector
94	TBG 3-1/2", 10.2#, L-80,HSM3	94	9.509	925.41	2694.888	108331.31	25.02	94	Protector
95	TBG 3-1/2", 10.2#, L-80,HSM3	95	9.524	934.94	2685.364	109452.67	25.28	95	Protector
96	TBG 3-1/2", 10.2#, L-80,HSM3	96	9.054	943.99	2676.310	110518.69	25.53	96	Protector
97	TBG 3-1/2", 10.2#, L-80,HSM3	97	9.524	953.51	2666.786	111640.05	25.79	97	Protector
98	TBG 3-1/2", 10.2#, L-80,HSM3	98	9.514	963.03	2657.272	112760.24	26.05	98	Protector
99	TBG 3-1/2", 10.2#, L-80,HSM3	99	9.504	972.53	2647.768	113879.24	26.30	99	Protector
100	TBG 3-1/2", 10.2#, L-80,HSM3	100	9.514	982.05	2638.254	114999.42	26.56	100	Protector
101	TBG 3-1/2", 10.2#, L-80,HSM3	101	9.514	991.56	2628.740	116119.61	26.82	101	Protector
102	TBG 3-1/2", 10.2#, L-80,HSM3	102	9.514	1001.07	2619.226	117239.79	27.08	102	Protector
103	TBG 3-1/2", 10.2#, L-80,HSM3	103	9.414	1010.49	2609.812	118348.20	27.34	103	Protector
104	TBG 3-1/2", 10.2#, L-80,HSM3	104	9.524	1020.01	2600.288	119469.56	27.60	104	Protector
105	TBG 3-1/2", 10.2#, L-80,HSM3	105	9.514	1029.53	2590.774	120589.74	27.86	105	Protector
106	TBG 3-1/2", 10.2#, L-80,HSM3	106	9.504	1039.03	2581.270	121708.75	28.11	106	Protector
107	TBG 3-1/2", 10.2#, L-80,HSM3	107	9.504	1048.53	2571.766	122827.75	28.37	107	Protector
108	TBG 3-1/2", 10.2#, L-80,HSM3	108	9.514	1058.05	2562.252	123947.94	28.63	108	Protector
109	TBG 3-1/2", 10.2#, L-80,HSM3	109	9.514	1067.56	2552.738	125068.12	28.89	109	Protector
110	TBG 3-1/2", 10.2#, L-80,HSM3	110	9.514	1077.08	2543.224	126188.30	29.15	110	Protector
111	TBG 3-1/2", 10.2#, L-80,HSM3	111	9.514	1086.59	2533.710	127308.48	29.41	111	Protector
112	TBG 3-1/2", 10.2#, L-80,HSM3	112	9.434	1096.02	2524.276	128419.25	29.67	112	Protector
113	TBG 3-1/2", 10.2#, L-80,HSM3	113	9.524	1105.55	2514.752	129540.61	29.92	113	Protector
114	TBG 3-1/2", 10.2#, L-80,HSM3	114	9.524	1115.07	2505.228	130661.97	30.18	114	Protector
115	TBG 3-1/2", 10.2#, L-80,HSM3	115	9.524	1124.60	2495.704	131783.33	30.44	115	Protector

116	TBG 3-1/2", 10.2#, L-80,HSM3	116	9.504	1134.10	2486.200	132902.33	30.70	116	Protector
117	TBG 3-1/2", 10.2#, L-80,HSM3	117	9.514	1143.61	2476.686	134022.52	30.96	117	Protector
118	TBG 3-1/2", 10.2#, L-80,HSM3	118	9.504	1153.12	2467.182	135141.52	31.22	118	Protector
119	TBG 3-1/2", 10.2#, L-80,HSM3	119	9.524	1162.64	2457.658	136262.88	31.48	119	Protector
120	TBG 3-1/2", 10.2#, L-80,HSM3	120	9.524	1172.17	2448.134	137384.24	31.74	120	Protector
121	TBG 3-1/2", 10.2#, L-80,HSM3	121	9.514	1181.68	2438.620	138504.43	32.00	121	Protector
122	TBG 3-1/2", 10.2#, L-80,HSM3	122	9.514	1191.19	2429.106	139624.61	32.26	122	Protector
123	TBG 3-1/2", 10.2#, L-80,HSM3	123	9.519	1200.71	2419.587	140745.38	32.51	123	Protector
124	TBG 3-1/2", 10.2#, L-80,HSM3	124	9.514	1210.23	2410.073	141865.56	32.77	124	Protector
125	TBG 3-1/2", 10.2#, L-80,HSM3	125	9.524	1219.75	2400.549	142986.92	33.03	125	Protector
126	TBG 3-1/2", 10.2#, L-80,HSM3	126	9.514	1229.27	2391.035	144107.11	33.29	126	Protector
127	TBG 3-1/2", 10.2#, L-80,HSM3	127	9.514	1238.78	2381.521	145227.29	33.55	127	Protector
128	TBG 3-1/2", 10.2#, L-80,HSM3	128	9.444	1248.22	2372.077	146339.23	33.81	128	Protector
129	TBG 3-1/2", 10.2#, L-80,HSM3	129	9.514	1257.74	2362.563	147459.41	34.07	129	Protector
130	TBG 3-1/2", 10.2#, L-80,HSM3	130	9.514	1267.25	2353.049	148579.60	34.33	130	Protector
131	TBG 3-1/2", 10.2#, L-80,HSM3	131	9.434	1276.69	2343.615	149690.36	34.58	131	Protector
132	TBG 3-1/2", 10.2#, L-80,HSM3	132	9.504	1286.19	2334.111	150809.37	34.84	132	Protector
133	TBG 3-1/2", 10.2#, L-80,HSM3	133	9.514	1295.70	2324.597	151929.55	35.10	133	Protector
134	TBG 3-1/2", 10.2#, L-80,HSM3	134	9.504	1305.21	2315.093	153048.55	35.36	134	Protector
135	TBG 3-1/2", 10.2#, L-80,HSM3	135	9.524	1314.73	2305.569	154169.91	35.62	135	Protector
136	TBG 3-1/2", 10.2#, L-80,HSM3	136	9.504	1324.24	2296.065	155288.92	35.88	136	Protector
137	TBG 3-1/2", 10.2#, L-80,HSM3	137	9.144	1333.38	2286.921	156365.54	36.12	137	Protector
138	TBG 3-1/2", 10.2#, L-80,HSM3	138	9.524	1342.90	2277.397	157486.90	36.38	138	Protector
139	TBG 3-1/2", 10.2#, L-80,HSM3	139	9.424	1352.33	2267.973	158596.49	36.64	139	Protector
140	TBG 3-1/2", 10.2#, L-80,HSM3	140	9.504	1361.83	2258.469	159715.49	36.90	140	Protector
141	TBG 3-1/2", 10.2#, L-80,HSM3	141	9.514	1371.35	2248.955	160835.67	37.16	141	Protector
142	TBG 3-1/2", 10.2#, L-80,HSM3	142	9.404	1380.75	2239.551	161942.91	37.41	142	Protector
143	TBG 3-1/2", 10.2#, L-80,HSM3	143	9.524	1390.27	2230.027	163064.27	37.67	143	Protector
144	TBG 3-1/2", 10.2#, L-80,HSM3	144	9.514	1399.79	2220.513	164184.45	37.93	144	Protector
145	TBG 3-1/2", 10.2#, L-80,HSM3	145	9.514	1409.30	2210.999	165304.63	38.19	145	Protector
146	TBG 3-1/2", 10.2#, L-80,HSM3	146	9.504	1418.81	2201.495	166423.64	38.45	146	Protector
147	TBG 3-1/2", 10.2#, L-80,HSM3	147	9.524	1428.33	2191.971	167545.00	38.71	147	Protector
148	TBG 3-1/2", 10.2#, L-80,HSM3	148	9.514	1437.84	2182.457	168665.18	38.97	148	Protector
149	TBG 3-1/2", 10.2#, L-80,HSM3	149	9.504	1447.35	2172.953	169784.19	39.23	149	Protector
150	TBG 3-1/2", 10.2#, L-80,HSM3	150	9.504	1456.85	2163.449	170903.19	39.48	150	Protector
151	TBG 3-1/2", 10.2#, L-80,HSM3	151	9.054	1465.91	2154.395	171969.21	39.73	151	Protector
152	TBG 3-1/2", 10.2#, L-80,HSM3	152	9.524	1475.43	2144.871	173090.57	39.99	152	Protector
153	TBG 3-1/2", 10.2#, L-80,HSM3	153	9.469	1484.90	2135.402	174205.46	40.25	153	Protector
154	TBG 3-1/2", 10.2#, L-80,HSM3	154	9.524	1494.42	2125.878	175326.82	40.51	154	Protector
155	TBG 3-1/2", 10.2#, L-80,HSM3	155	9.504	1503.93	2116.374	176445.82	40.77	155	Protector
156	TBG 3-1/2", 10.2#, L-80,HSM3	156	9.054	1512.98	2107.320	177511.85	41.01	156	Protector
157	TBG 3-1/2", 10.2#, L-80,HSM3	157	9.524	1522.50	2097.796	178633.21	41.27	157	Protector
158	TBG 3-1/2", 10.2#, L-80,HSM3	158	9.514	1532.02	2088.282	179753.39	41.53	158	Protector
159	TBG 3-1/2", 10.2#, L-80,HSM3	159	9.514	1541.53	2078.768	180873.57	41.79	159	Protector
160	TBG 3-1/2", 10.2#, L-80,HSM3	160	9.427	1550.96	2069.341	181983.51	42.05	160	Protector
161	TBG 3-1/2", 10.2#, L-80,HSM3	161	9.504	1560.46	2059.837	183102.52	42.30	161	Protector
162	TBG 3-1/2", 10.2#, L-80,HSM3	162	9.054	1569.52	2050.783	184168.54	42.55	162	Protector
163	TBG 3-1/2", 10.2#, L-80,HSM3	163	9.504	1579.02	2041.279	185287.55	42.81	163	Protector
164	TBG 3-1/2", 10.2#, L-80,HSM3	164	9.504	1588.53	2031.775	186406.55	43.07	164	Protector
165	TBG 3-1/2", 10.2#, L-80,HSM3	165	9.434	1597.96	2022.341	187517.31	43.32	165	Protector
166	TBG 3-1/2", 10.2#, L-80,HSM3	166	9.054	1607.01	2013.287	188583.34	43.57	166	Protector
167	TBG 3-1/2", 10.2#, L-80,HSM3	167	9.504	1616.52	2003.783	189702.34	43.83	167	Protector
168	TBG 3-1/2", 10.2#, L-80,HSM3	168	9.054	1625.57	1994.729	190768.36	44.08	168	Protector
169	TBG 3-1/2", 10.2#, L-80,HSM3	169	9.514	1635.09	1985.215	191888.55	44.34	169	Protector
170	TBG 3-1/2", 10.2#, L-80,HSM3	170	9.054	1644.14	1976.161	192954.57	44.58	170	Protector
171	TBG 3-1/2", 10.2#, L-80,HSM3	171	9.514	1653.65	1966.647	194074.75	44.84	171	Protector
172	TBG 3-1/2", 10.2#, L-80,HSM3	172	9.414	1663.07	1957.233	195183.16	45.10	172	Protector
173	TBG 3-1/2", 10.2#, L-80,HSM3	173	9.524	1672.59	1947.709	196304.52	45.36	173	Protector
174	TBG 3-1/2", 10.2#, L-80,HSM3	174	9.524	1682.12	1938.185	197425.88	45.61	174	Protector
175	TBG 3-1/2", 10.2#, L-80,HSM3	175	9.514	1691.63	1928.671	198546.06	45.87	175	Protector
176	TBG 3-1/2", 10.2#, L-80,HSM3	176	9.054	1700.68	1919.617	199612.09	46.12	176	Protector

X-over 4-1/2"HSM3, 18.9# BOX * 3-1/2"HSM3 , 10.2# PIN,	TBG 4-1/2", 18.9#, L-80,HSM3	0	1.099	1701.78	1918.518	199742.11	46.17	0	Protector
1	TBG 4-1/2", 18.9#, L-80,HSM3	1	9.529	1711.31	1908.989	200869.46	46.57	1	Protector
2	TBG 4-1/2", 18.9#, L-80,HSM3	2	9.519	1720.83	1899.470	201995.62	46.97	2	Protector
3	TBG 4-1/2", 18.9#, L-80,HSM3	3	9.519	1730.35	1889.951	203121.79	47.37	3	Protector
4	TBG 4-1/2", 18.9#, L-80,HSM3	4	9.519	1739.87	1880.432	204247.96	47.77	4	Protector
5	TBG 4-1/2", 18.9#, L-80,HSM3	5	9.519	1749.39	1870.913	205374.13	48.18	5	Protector
6	TBG 4-1/2", 18.9#, L-80,HSM3	6	9.403	1758.79	1861.510	206486.57	48.57	6	Protector
7	TBG 4-1/2", 18.9#, L-80,HSM3	7	9.519	1768.31	1851.991	207612.74	48.98	7	Protector
8	TBG 4-1/2", 18.9#, L-80,HSM3	8	9.529	1777.84	1842.462	208740.09	49.38	8	Protector
9	TBG 4-1/2", 18.9#, L-80,HSM3	9	9.519	1787.36	1832.943	209866.25	49.78	9	Protector
10	TBG 4-1/2", 18.9#, L-80,HSM3	10	9.519	1796.88	1823.424	210992.42	50.18	10	Protector
11	TBG 4-1/2", 18.9#, L-80,HSM3	11	9.559	1806.44	1813.865	212123.32	50.59	11	Protector
12	TBG 4-1/2", 18.9#, L-80,HSM3	12	9.519	1815.95	1804.346	213249.49	50.99	12	Protector
13	TBG 4-1/2", 18.9#, L-80,HSM3	13	9.529	1825.48	1794.817	214376.84	51.39	13	Protector
14	TBG 4-1/2", 18.9#, L-80,HSM3	14	9.529	1835.01	1785.288	215504.19	51.79	14	Protector
15	TBG 4-1/2", 18.9#, L-80,HSM3	15	9.549	1844.56	1775.739	216633.91	52.20	15	Protector
16	TBG 4-1/2", 18.9#, L-80,HSM3	16	9.519	1854.08	1766.220	217760.07	52.60	16	Protector
17	TBG 4-1/2", 18.9#, L-80,HSM3	17	9.519	1863.60	1756.701	218886.24	53.00	17	Protector
18	TBG 4-1/2", 18.9#, L-80,HSM3	18	9.519	1873.12	1747.182	220012.41	53.40	18	Protector
19	TBG 4-1/2", 18.9#, L-80,HSM3	19	9.519	1882.64	1737.663	221138.57	53.80	19	Protector
20	TBG 4-1/2", 18.9#, L-80,HSM3	20	9.509	1892.15	1728.154	222263.56	54.21	20	Protector
21	TBG 4-1/2", 18.9#, L-80,HSM3	21	9.519	1901.67	1718.635	223389.73	54.61	21	Protector
22	TBG 4-1/2", 18.9#, L-80,HSM3	22	9.519	1911.18	1709.116	224515.89	55.01	22	Protector
23	TBG 4-1/2", 18.9#, L-80,HSM3	23	9.523	1920.71	1699.593	225642.53	55.41	23	Protector
24	TBG 4-1/2", 18.9#, L-80,HSM3	24	9.519	1930.23	1690.074	226768.70	55.81	24	Protector
25	TBG 4-1/2", 18.9#, L-80,HSM3	25	9.519	1939.75	1680.555	227894.87	56.22	25	Protector
26	TBG 4-1/2", 18.9#, L-80,HSM3	26	9.519	1949.26	1671.036	229021.04	56.62	26	Protector
27	TBG 4-1/2", 18.9#, L-80,HSM3	27	9.519	1958.78	1661.517	230147.20	57.02	27	Protector
28	TBG 4-1/2", 18.9#, L-80,HSM3	28	9.519	1968.30	1651.998	231273.37	57.42	28	Protector
29	TBG 4-1/2", 18.9#, L-80,HSM3	29	9.519	1977.82	1642.479	232399.54	57.82	29	Protector
30	TBG 4-1/2", 18.9#, L-80,HSM3	30	9.519	1987.34	1632.960	233525.70	58.23	30	Protector
31	TBG 4-1/2", 18.9#, L-80,HSM3	31	9.510	1996.85	1623.450	234650.81	58.63	31	Protector
32	TBG 4-1/2", 18.9#, L-80,HSM3	32	9.511	2006.36	1613.939	235776.03	59.03	32	Protector
33	TBG 4-1/2", 18.9#, L-80,HSM3	33	9.511	2015.87	1604.428	236901.25	59.43	33	Protector
34	TBG 4-1/2", 18.9#, L-80,HSM3	34	9.509	2025.38	1594.919	238026.23	59.83	34	Protector
35	TBG 4-1/2", 18.9#, L-80,HSM3	35	9.511	2034.89	1585.408	239151.45	60.23	35	Protector
36	TBG 4-1/2", 18.9#, L-80,HSM3	36	9.512	2044.40	1575.896	240276.79	60.64	36	Protector
37	TBG 4-1/2", 18.9#, L-80,HSM3	37	9.519	2053.92	1566.377	241402.96	61.04	37	Protector
38	TBG 4-1/2", 18.9#, L-80,HSM3	38	9.511	2063.43	1556.866	242528.18	61.44	38	Protector
39	TBG 4-1/2", 18.9#, L-80,HSM3	39	9.519	2072.95	1547.347	243654.35	61.84	39	Protector
40	TBG 4-1/2", 18.9#, L-80,HSM3	40	9.529	2082.48	1537.818	244781.70	62.24	40	Protector
41	TBG 4-1/2", 18.9#, L-80,HSM3	41	9.527	2092.01	1528.291	245908.81	62.65	41	Protector
42	TBG 4-1/2", 18.9#, L-80,HSM3	42	9.519	2101.53	1518.772	247034.98	63.05	42	Protector

44	TBG 4-1/2", 18.9#, L-80,HSM3	43	9.419	2110.95	1509.353	248149.31	63.45	43	Protector
45	TBG 4-1/2", 18.9#, L-80,HSM3	44	9.309	2120.26	1500.044	249250.64	63.84	44	Protector
46	TBG 4-1/2", 18.9#, L-80,HSM3	45	9.519	2129.77	1490.525	250376.80	64.24	45	Protector
47	TBG 4-1/2", 18.9#, L-80,HSM3	46	9.529	2139.30	1480.996	251504.16	64.64	46	Protector
48	TBG 4-1/2", 18.9#, L-80,HSM3	47	9.519	2148.82	1471.477	252630.32	65.05	47	Protector
49	TBG 4-1/2", 18.9#, L-80,HSM3	48	9.409	2158.23	1462.068	253743.48	65.44	48	Protector
50	TBG 4-1/2", 18.9#, L-80,HSM3	49	9.529	2167.76	1452.539	254870.83	65.84	49	Protector
51	TBG 4-1/2", 18.9#, L-80,HSM3	50	9.509	2177.27	1443.030	255995.81	66.25	50	Protector
52	TBG 4-1/2", 18.9#, L-80,HSM3	51	9.519	2186.79	1433.511	257121.98	66.65	51	Protector
53	TBG 4-1/2", 18.9#, L-80,HSM3	52	9.559	2196.35	1423.952	258252.88	67.05	52	Protector
54	TBG 4-1/2", 18.9#, L-80,HSM3	53	9.519	2205.87	1414.433	259379.04	67.45	53	Protector
55	TBG 4-1/2", 18.9#, L-80,HSM3	54	9.519	2215.39	1404.914	260505.21	67.86	54	Protector
56	TBG 4-1/2", 18.9#, L-80,HSM3	55	9.519	2224.90	1395.395	261631.38	68.26	55	Protector
57	TBG 4-1/2", 18.9#, L-80,HSM3	56	9.519	2234.42	1385.876	262757.55	68.66	56	Protector
58	TBG 4-1/2", 18.9#, L-80,HSM3	57	9.519	2243.94	1376.357	263883.71	69.06	57	Protector
59	TBG 4-1/2", 18.9#, L-80,HSM3	58	9.522	2253.46	1366.835	265010.24	69.46	58	Protector
60	TBG 4-1/2", 18.9#, L-80,HSM3	59	9.519	2262.98	1357.316	266136.40	69.87	59	Protector
61	TBG 4-1/2", 18.9#, L-80,HSM3	60	9.519	2272.50	1347.797	267262.57	70.27	60	Protector
62	TBG 4-1/2", 18.9#, L-80,HSM3	61	9.520	2282.02	1338.277	268388.86	70.67	61	Protector
63	TBG 4-1/2", 18.9#, L-80,HSM3	62	9.540	2291.56	1328.737	269517.51	71.07	62	Protector
64	TBG 4-1/2", 18.9#, L-80,HSM3	63	9.149	2300.71	1319.588	270599.90	71.46	63	Protector
65	TBG 4-1/2", 18.9#, L-80,HSM3	64	9.579	2310.29	1310.009	271733.17	71.86	64	Protector
66	TBG 4-1/2", 18.9#, L-80,HSM3	65	9.142	2319.43	1300.867	272814.73	72.25	65	Protector
67	TBG 4-1/2", 18.9#, L-80,HSM3	66	9.519	2328.95	1291.348	273940.90	72.65	66	Protector
68	TBG 4-1/2", 18.9#, L-80,HSM3	67	9.151	2338.10	1282.197	275023.53	73.04	67	Protector
69	TBG 4-1/2", 18.9#, L-80,HSM3	68	9.562	2347.66	1272.635	276154.78	73.44	68	Protector
70	TBG 4-1/2", 18.9#, L-80,HSM3	69	9.518	2357.18	1263.117	277280.83	73.84	69	Protector
71	TBG 4-1/2", 18.9#, L-80,HSM3	70	9.509	2366.69	1253.608	278405.82	74.25	70	Protector
72	TBG 4-1/2", 18.9#, L-80,HSM3	71	9.519	2376.21	1244.089	279531.98	74.65	71	Protector
73	TBG 4-1/2", 18.9#, L-80,HSM3	72	9.519	2385.73	1234.570	280658.15	75.05	72	Protector
74	TBG 4-1/2", 18.9#, L-80,HSM3	73	9.519	2395.25	1225.051	281784.32	75.45	73	Protector
75	TBG 4-1/2", 18.9#, L-80,HSM3	74	9.511	2404.76	1215.540	282909.54	75.85	74	Protector
76	TBG 4-1/2", 18.9#, L-80,HSM3	75	9.519	2414.28	1206.021	284035.71	76.26	75	Protector
77	TBG 4-1/2", 18.9#, L-80,HSM3	76	9.543	2423.82	1196.478	285164.71	76.66	76	Protector
78	TBG 4-1/2", 18.9#, L-80,HSM3	77	9.459	2433.28	1187.019	286283.78	77.06	77	Protector
79	TBG 4-1/2", 18.9#, L-80,HSM3	78	9.529	2442.81	1177.490	287411.13	77.46	78	Protector
80	TBG 4-1/2", 18.9#, L-80,HSM3	79	9.549	2452.36	1167.941	288540.85	77.86	79	Protector
81	TBG 4-1/2", 18.9#, L-80,HSM3	80	9.432	2461.79	1158.509	289656.72	78.26	80	Protector
82	TBG 4-1/2", 18.9#, L-80,HSM3	81	9.519	2471.31	1148.990	290782.89	78.66	81	Protector
83	TBG 4-1/2", 18.9#, L-80,HSM3	82	9.549	2480.86	1139.441	291912.61	79.07	82	Protector
84	TBG 4-1/2", 18.9#, L-80,HSM3	83	9.539	2490.40	1129.902	293041.14	79.47	83	Protector
85	TBG 4-1/2", 18.9#, L-80,HSM3	84	9.519	2499.92	1120.383	294167.31	79.87	84	Protector
86	TBG 4-1/2", 18.9#, L-80,HSM3	85	9.519	2509.44	1110.864	295293.47	80.27	85	Protector
87	TBG 4-1/2", 18.9#, L-80,HSM3	86	9.519	2518.95	1101.345	296419.64	80.68	86	Protector
88	TBG 4-1/2", 18.9#, L-80,HSM3	87	9.519	2528.47	1091.826	297545.81	81.08	87	Protector
89	TBG 4-1/2", 18.9#, L-80,HSM3	88	9.519	2537.99	1082.307	298671.98	81.48	88	Protector
90	TBG 4-1/2", 18.9#, L-80,HSM3	89	9.523	2547.52	1072.784	299798.62	81.88	89	Protector
91	TBG 4-1/2", 18.9#, L-80,HSM3	90	9.509	2557.02	1063.275	300923.60	82.28	90	Protector
92	TBG 4-1/2", 18.9#, L-80,HSM3	91	9.539	2566.56	1053.736	302052.13	82.69	91	Protector
93	TBG 4-1/2", 18.9#, L-80,HSM3	92	9.519	2576.08	1044.217	303178.30	83.09	92	Protector
94	TBG 4-1/2", 18.9#, L-80,HSM3	93	9.519	2585.60	1034.698	304304.47	83.49	93	Protector
95	TBG 4-1/2", 18.9#, L-80,HSM3	94	9.509	2595.11	1025.189	305429.45	83.89	94	Protector
96	TBG 4-1/2", 18.9#, L-80,HSM3	95	9.509	2604.62	1015.680	306554.44	84.29	95	Protector
97	TBG 4-1/2", 18.9#, L-80,HSM3	96	9.519	2614.14	1006.161	307680.60	84.70	96	Protector
98	TBG 4-1/2", 18.9#, L-80,HSM3	97	9.533	2623.67	996.628	308808.43	85.10	97	Protector


99	TBG 4-1/2", 18.9#, L-80,HSM3	98	9.552	2633.22	987.076	309938.50	85.50	98	Protector
100	TBG 4-1/2", 18.9#, L-80,HSM3	99	9.559	2642.78	977.517	311069.40	85.91	99	Protector
101	TBG 4-1/2", 18.9#, L-80,HSM3	100	9.523	2652.31	967.994	312196.04	86.31	100	Protector
102	TBG 4-1/2", 18.9#, L-80,HSM3	101	9.529	2661.83	958.465	313323.39	86.71	101	Protector
103	TBG 4-1/2", 18.9#, L-80,HSM3	102	9.529	2671.36	948.936	314450.74	87.11	102	Protector
104	TBG 4-1/2", 18.9#, L-80,HSM3	103	9.559	2680.92	939.377	315581.64	87.52	103	Protector
105	TBG 4-1/2", 18.9#, L-80,HSM3	104	9.529	2690.45	929.848	316708.99	87.92	104	Protector
106	TBG 4-1/2", 18.9#, L-80,HSM3	105	9.522	2699.97	920.326	317835.51	88.32	105	Protector
107	TBG 4-1/2", 18.9#, L-80,HSM3	106	9.529	2709.50	910.797	318962.86	88.72	106	Protector
108	TBG 4-1/2", 18.9#, L-80,HSM3	107	9.529	2719.03	901.268	320090.21	89.13	107	Protector
109	TBG 4-1/2", 18.9#, L-80,HSM3	108	9.529	2728.56	891.739	321217.56	89.53	108	Protector
110	TBG 4-1/2", 18.9#, L-80,HSM3	109	9.519	2738.08	882.220	322343.73	89.93	109	Protector
111	TBG 4-1/2", 18.9#, L-80,HSM3	110	9.529	2747.61	872.691	323471.08	90.33	110	Protector
112	TBG 4-1/2", 18.9#, L-80,HSM3	111	9.519	2757.13	863.172	324597.25	90.73	111	Protector
113	TBG 4-1/2", 18.9#, L-80,HSM3	112	9.551	2766.68	853.621	325727.20	91.14	112	Protector
114	TBG 4-1/2", 18.9#, L-80,HSM3	113	9.389	2776.07	844.232	326837.99	91.53	113	Protector
115	TBG 4-1/2", 18.9#, L-80,HSM3	114	9.409	2785.48	834.823	327951.14	91.93	114	Protector
116	TBG 4-1/2", 18.9#, L-80,HSM3	115	9.519	2795.00	825.304	329077.31	92.33	115	Protector
117	TBG 4-1/2", 18.9#, L-80,HSM3	116	9.392	2804.39	815.912	330188.45	92.73	116	Protector
118	TBG 4-1/2", 18.9#, L-80,HSM3	117	9.522	2813.91	806.390	331314.97	93.13	117	Protector
119	TBG 4-1/2", 18.9#, L-80,HSM3	118	9.519	2823.43	796.871	332441.14	93.53	118	Protector
120	TBG 4-1/2", 18.9#, L-80,HSM3	119	9.519	2832.95	787.352	333567.31	93.94	119	Protector
121	TBG 4-1/2", 18.9#, L-80,HSM3	120	9.519	2842.47	777.833	334693.47	94.34	120	Protector
122	TBG 4-1/2", 18.9#, L-80,HSM3	121	9.519	2851.99	768.314	335819.64	94.74	121	Protector
123	TBG 4-1/2", 18.9#, L-80,HSM3	122	9.519	2861.50	758.795	336945.81	95.14	122	Protector
124	TBG 4-1/2", 18.9#, L-80,HSM3	123	9.519	2871.02	749.276	338071.98	95.54	123	Protector
125	TBG 4-1/2", 18.9#, L-80,HSM3	124	9.519	2880.54	739.757	339198.14	95.95	124	Protector
126	TBG 4-1/2", 18.9#, L-80,HSM3	125	9.529	2890.07	730.228	340325.49	96.35	125	Protector
127	TBG 4-1/2", 18.9#, L-80,HSM3	126	9.519	2899.59	720.709	341451.66	96.75	126	Protector
128	TBG 4-1/2", 18.9#, L-80,HSM3	127	9.539	2909.13	711.170	342580.19	97.15	127	Protector
129	TBG 4-1/2", 18.9#, L-80,HSM3	128	9.529	2918.66	701.641	343707.54	97.56	128	Protector
130	TBG 4-1/2", 18.9#, L-80,HSM3	129	9.529	2928.19	692.112	344834.89	97.96	129	Protector
131	TBG 4-1/2", 18.9#, L-80,HSM3	130	9.529	2937.72	682.583	345962.25	98.36	130	Protector
132	TBG 4-1/2", 18.9#, L-80,HSM3	131	9.529	2947.25	673.054	347089.60	98.76	131	Protector
133	TBG 4-1/2", 18.9#, L-80,HSM3	132	9.399	2956.64	663.655	348201.57	99.16	132	Protector
134	TBG 4-1/2", 18.9#, L-80,HSM3	133	9.409	2966.05	654.246	349314.72	99.56	133	Protector
135	TBG 4-1/2", 18.9#, L-80,HSM3	134	9.409	2975.46	644.837	350427.87	99.95	134	Protector
136	TBG 4-1/2", 18.9#, L-80,HSM3	135	9.409	2984.87	635.428	351541.03	100.35	135	Protector
137	TBG 4-1/2", 18.9#, L-80,HSM3	136	9.369	2994.24	626.059	352649.45	100.75	136	Protector
138	TBG 4-1/2", 18.9#, L-80,HSM3	137	9.419	3003.66	616.640	353763.78	101.14	137	Protector
139	TBG 4-1/2", 18.9#, L-80,HSM3	138	9.399	3013.06	607.241	354875.75	101.54	138	Protector
140	TBG 4-1/2", 18.9#, L-80,HSM3	139	9.399	3022.46	597.842	355987.72	101.94	139	Protector
141	TBG 4-1/2", 18.9#, L-80,HSM3	140	9.519	3031.98	588.323	357113.89	102.34	140	Protector
142	TBG 4-1/2", 18.9#, L-80,HSM3	141	9.519	3041.50	578.804	358240.06	102.74	141	Protector
143	TBG 4-1/2", 18.9#, L-80,HSM3	142	9.519	3051.01	569.285	359366.23	103.14	142	Protector
144	TBG 4-1/2", 18.9#, L-80,HSM3	143	9.519	3060.53	559.766	360492.39	103.55	143	Protector
145	TBG 4-1/2", 18.9#, L-80,HSM3	144	9.519	3070.05	550.247	361618.56	103.95	144	Protector
146	TBG 4-1/2", 18.9#, L-80,HSM3	145	9.519	3079.57	540.728	362744.73	104.35	145	Protector
147	TBG 4-1/2", 18.9#, L-80,HSM3	146	9.519	3089.09	531.209	363870.89	104.75	146	Protector
148	TBG 4-1/2", 18.9#, L-80,HSM3	147	9.519	3098.61	521.690	364997.06	105.15	147	Protector
149	TBG 4-1/2", 18.9#, L-80,HSM3	148	9.519	3108.13	512.171	366123.23	105.56	148	Protector
150	TBG 4-1/2", 18.9#, L-80,HSM3	149	9.519	3117.65	502.652	367249.40	105.96	149	Protector
151	TBG 4-1/2", 18.9#, L-80,HSM3	150	9.519	3127.17	493.133	368375.56	106.36	150	Protector
152	TBG 4-1/2", 18.9#, L-80,HSM3	151	9.509	3136.68	483.624	369500.55	106.76	151	Protector
153	TBG 4-1/2", 18.9#, L-80,HSM3	152	9.519	3146.19	474.105	370626.72	107.16	152	Protector


154	TBG 4-1/2", 18.9#, L-80,HSM3	153	9.519	3155.71	464.586	371752.88	107.57	153	Protector
155	TBG 4-1/2", 18.9#, L-80,HSM3	154	9.519	3165.23	455.067	372879.05	107.97	154	Protector
156	TBG 4-1/2", 18.9#, L-80,HSM3	155	9.519	3174.75	445.548	374005.22	108.37	155	Protector
157	TBG 4-1/2", 18.9#, L-80,HSM3	156	9.519	3184.27	436.029	375131.38	108.77	156	Protector
158	TBG 4-1/2", 18.9#, L-80,HSM3	157	9.509	3193.78	426.520	376256.37	109.17	157	Protector
159	TBG 4-1/2", 18.9#, L-80,HSM3	158	9.519	3203.30	417.001	377382.54	109.58	158	Protector
160	TBG 4-1/2", 18.9#, L-80,HSM3	159	9.519	3212.82	407.482	378508.70	109.98	159	Protector
161	TBG 4-1/2", 18.9#, L-80,HSM3	160	9.519	3222.34	397.963	379634.87	110.38	160	Protector
162	TBG 4-1/2", 18.9#, L-80,HSM3	161	9.509	3231.85	388.454	380759.85	110.78	161	Protector
163	TBG 4-1/2", 18.9#, L-80,HSM3	162	9.519	3241.36	378.935	381886.02	111.18	162	Protector
164	TBG 4-1/2", 18.9#, L-80,HSM3	163	9.519	3250.88	369.416	383012.19	111.59	163	Protector
165	TBG 4-1/2", 18.9#, L-80,HSM3	164	8.549	3259.43	360.867	384023.60	111.95	164	Protector
166	TBG 4-1/2", 18.9#, L-80,HSM3	165	9.509	3268.94	351.358	385148.58	112.35	165	Protector
167	TBG 4-1/2", 18.9#, L-80,HSM3	166	9.509	3278.45	341.849	386273.57	112.75	166	Protector
168	TBG 4-1/2", 18.9#, L-80,HSM3	167	9.519	3287.97	332.330	387399.73	113.15	167	Protector
169	TBG 4-1/2", 18.9#, L-80,HSM3	168	9.519	3297.49	322.811	388525.90	113.55	168	Protector
170	TBG 4-1/2", 18.9#, L-80,HSM3	169	9.549	3307.04	313.262	389655.62	113.96	169	Protector
171	TBG 4-1/2", 18.9#, L-80,HSM3	170	9.529	3316.57	303.733	390782.97	114.36	170	Protector
172	TBG 4-1/2", 18.9#, L-80,HSM3	171	9.549	3326.12	294.184	391912.68	114.76	171	Protector
173	TBG 4-1/2", 18.9#, L-80,HSM3	172	9.549	3335.66	284.635	393042.40	115.17	172	Protector
174	TBG 4-1/2", 18.9#, L-80,HSM3	173	9.519	3345.18	275.116	394168.57	115.57	173	Protector
175	TBG 4-1/2", 18.9#, L-80,HSM3	174	9.549	3354.73	265.567	395298.28	115.97	174	Protector
176	TBG 4-1/2", 18.9#, L-80,HSM3	175	9.519	3364.25	256.048	396424.45	116.37	175	Protector
177	TBG 4-1/2", 18.9#, L-80,HSM3	176	9.509	3373.76	246.539	397549.44	116.77	176	Protector
178	TBG 4-1/2", 18.9#, L-80,HSM3	177	9.509	3383.27	237.030	398674.42	117.18	177	Protector
179	TBG 4-1/2", 18.9#, L-80,HSM3	178	9.509	3392.78	227.521	399799.40	117.58	178	Protector
180	TBG 4-1/2", 18.9#, L-80,HSM3	179	9.509	3402.29	218.012	400924.39	117.98	179	Protector
181	TBG 4-1/2", 18.9#, L-80,HSM3	180	9.509	3411.80	208.503	402049.37	118.38	180	Protector
182	TBG 4-1/2", 18.9#, L-80,HSM3	181	9.509	3421.31	198.994	403174.36	118.78	181	Protector
183	TBG 4-1/2", 18.9#, L-80,HSM3	182	9.519	3430.82	189.475	404300.52	119.18	182	Protector
184	TBG 4-1/2", 18.9#, L-80,HSM3	183	9.519	3440.34	179.956	405426.69	119.59	183	Protector
185	TBG 4-1/2", 18.9#, L-80,HSM3	184	9.519	3449.86	170.437	406552.86	119.99	184	Protector
186	TBG 4-1/2", 18.9#, L-80,HSM3	185	9.509	3459.37	160.928	407677.84	120.39	185	Protector
187	TBG 4-1/2", 18.9#, L-80,HSM3	186	9.519	3468.89	151.409	408804.01	120.79	186	Protector
188	TBG 4-1/2", 18.9#, L-80,HSM3	187	9.519	3478.41	141.890	409930.18	121.19	187	Protector
189	TBG 4-1/2", 18.9#, L-80,HSM3	188	9.519	3487.93	132.371	411056.34	121.60	188	Protector
190	TBG 4-1/2", 18.9#, L-80,HSM3	189	9.519	3497.45	122.852	412182.51	122.00	189	Protector
191	TBG 4-1/2", 18.9#, L-80,HSM3	190	9.389	3506.84	113.463	413293.30	122.39	190	Protector
192	TBG 4-1/2", 18.9#, L-80,HSM3	191	9.539	3516.38	103.924	414421.83	122.80	191	Protector
193	TBG 4-1/2", 18.9#, L-80,HSM3	192	8.949	3525.32	94.975	415480.56	123.17	192	Protector
194	TBG 4-1/2", 18.9#, L-80,HSM3	193	9.399	3534.72	85.576	416592.53	123.57	193	Protector
195	TBG 4-1/2", 18.9#, L-80,HSM3	194	9.359	3544.08	76.217	417699.77	123.97	194	Protector
196	TBG 4-1/2", 18.9#, L-80,HSM3	195	9.419	3553.50	66.798	418814.11	124.36	195	Protector


Pup Jt 4 1/2",HSM3 ,18.9#, L-80, Type-1	TBG 4-1/2", 18.9#, L-80,HSM3	0	1.625	3555.13	65.173	419006.36	124.43	0	
4-1/2" FLOW COUPLING, 18.9#,Super 13CR-110KSI,HSM3 , 4' FT, Weiqixin Co	TBG 4-1/2", 18.9#, L-80,HSM3	0	1.016	3556.14	64.157	419126.56	124.48	0	
TRSSV-10 TBG Retrievable Saftey Valve, 4 1/2", 18.9# W/ 3.437" Seal bore,HSM3 , Super 13CR-110KSI, 10K WP With AF Profile, Flapper Type, Weiqixin Co	TBG 4-1/2", 18.9#, L-80,HSM3	0	1.682	3557.82	62.475	419325.55	124.55	0	
4-1/2" FLOW COUPLING,18.9#,Super 13CR-110KSI,HSM3 , 6 FT, Weiqixin Co	TBG 4-1/2", 18.9#, L-80,HSM3	0	1.623	3559.45	60.852	419517.56	124.62	0	
Pup Jt 4 1/2",HSM3 ,18.9#, L-80, Type-1	TBG 4-1/2", 18.9#, L-80,HSM3	0	1.522	3560.97	59.330	419697.63	124.68	0	
220	TBG 4-1/2", 18.9#, L-80,HSM3	197	9.509	3570.48	49.821	420822.61	125.08	197	Protector
221	TBG 4-1/2", 18.9#, L-80,HSM3	198	9.519	3580.00	40.302	421948.78	125.48	198	Protector
222	TBG 4-1/2", 18.9#, L-80,HSM3	199	9.529	3589.53	30.773	423076.13	125.89	199	Protector
223	TBG 4-1/2", 18.9#, L-80,HSM3	200	9.509	3599.04	21.264	424201.11	126.29	200	Protector
224	TBG 4-1/2", 18.9#, L-80,HSM3	201	9.529	3608.56	11.735	425328.46	126.69	201	Protector
4-1/2" FLUTED SWAGE ADAPTER D/P, 18.9# TPCQ-EX PIN ON TOP X HSM3 PIN ON DOWN* Super 13CR-110KSI, Weiqixin Co	Fluted Swage	0	0.964	3609.53	10.771	425442.51	126.73	0	
TBG HANGER MSP, 10K, 11" * 4 1/2" ACME Box up * 4 1/2" TPCQ-EX Box Down , M/C: FF-0.5 T/C: UPSL: 3G PR: 2, 4" Type "H" Two Way	TBG HGR	0	0.520	3610.05	10.251	425504.03	126.75	0	
TBG Hanger Running Tool + TBG NECK	TBG Hanger Running Tool	0	0.550	3610.60	9.701	425569.10	126.78	0	
L/Joint	L/Joint	0	11.198	3621.80	-1.497	426893.91	127.25	0	

Table 8-5: AZNS-122 Completion Tally

8.6 Completion String Pressure Test

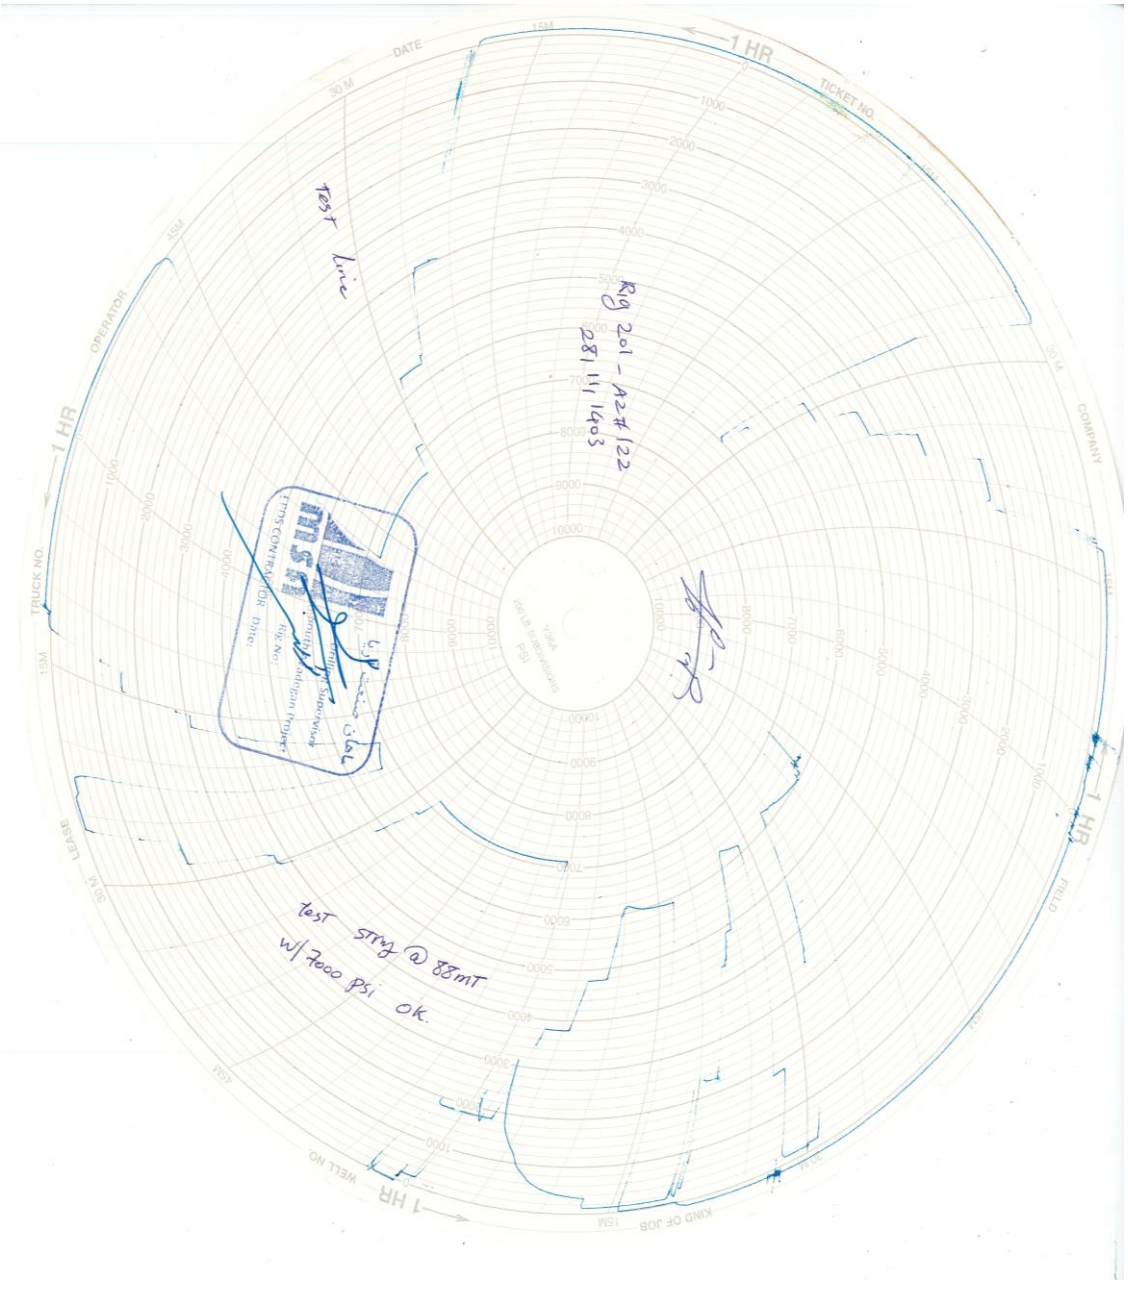

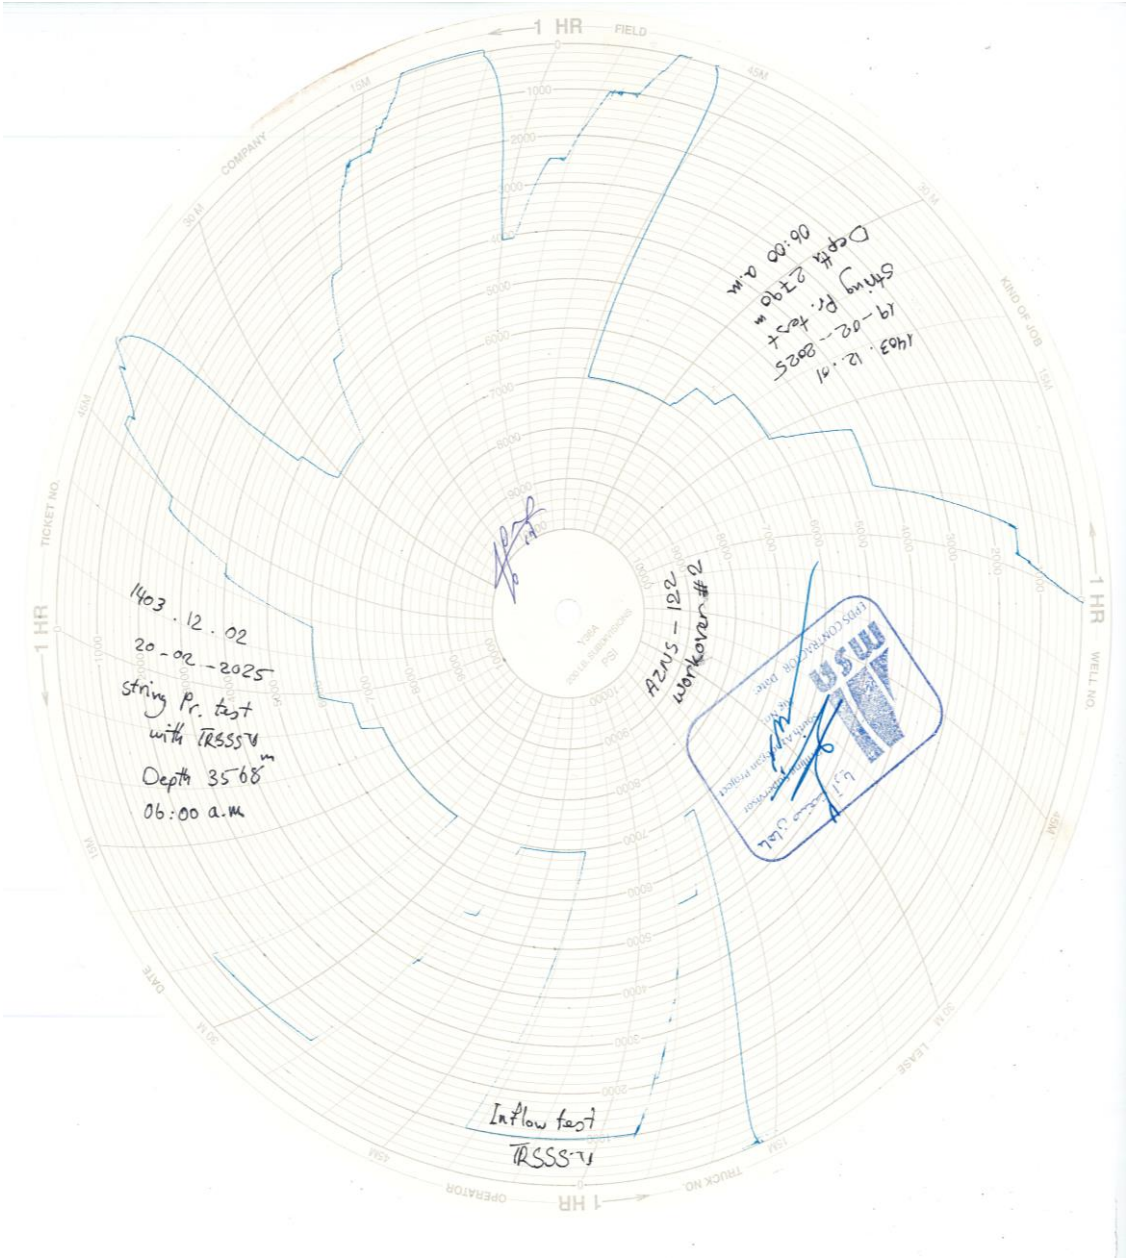
1403 . 12 . 02
20 - 02 - 2025
String Pr. test
with TRSSSV
Depth 3568 m
06:00 a.m
AZNS - 122
Workover #02
Inflow test
TRSSSV

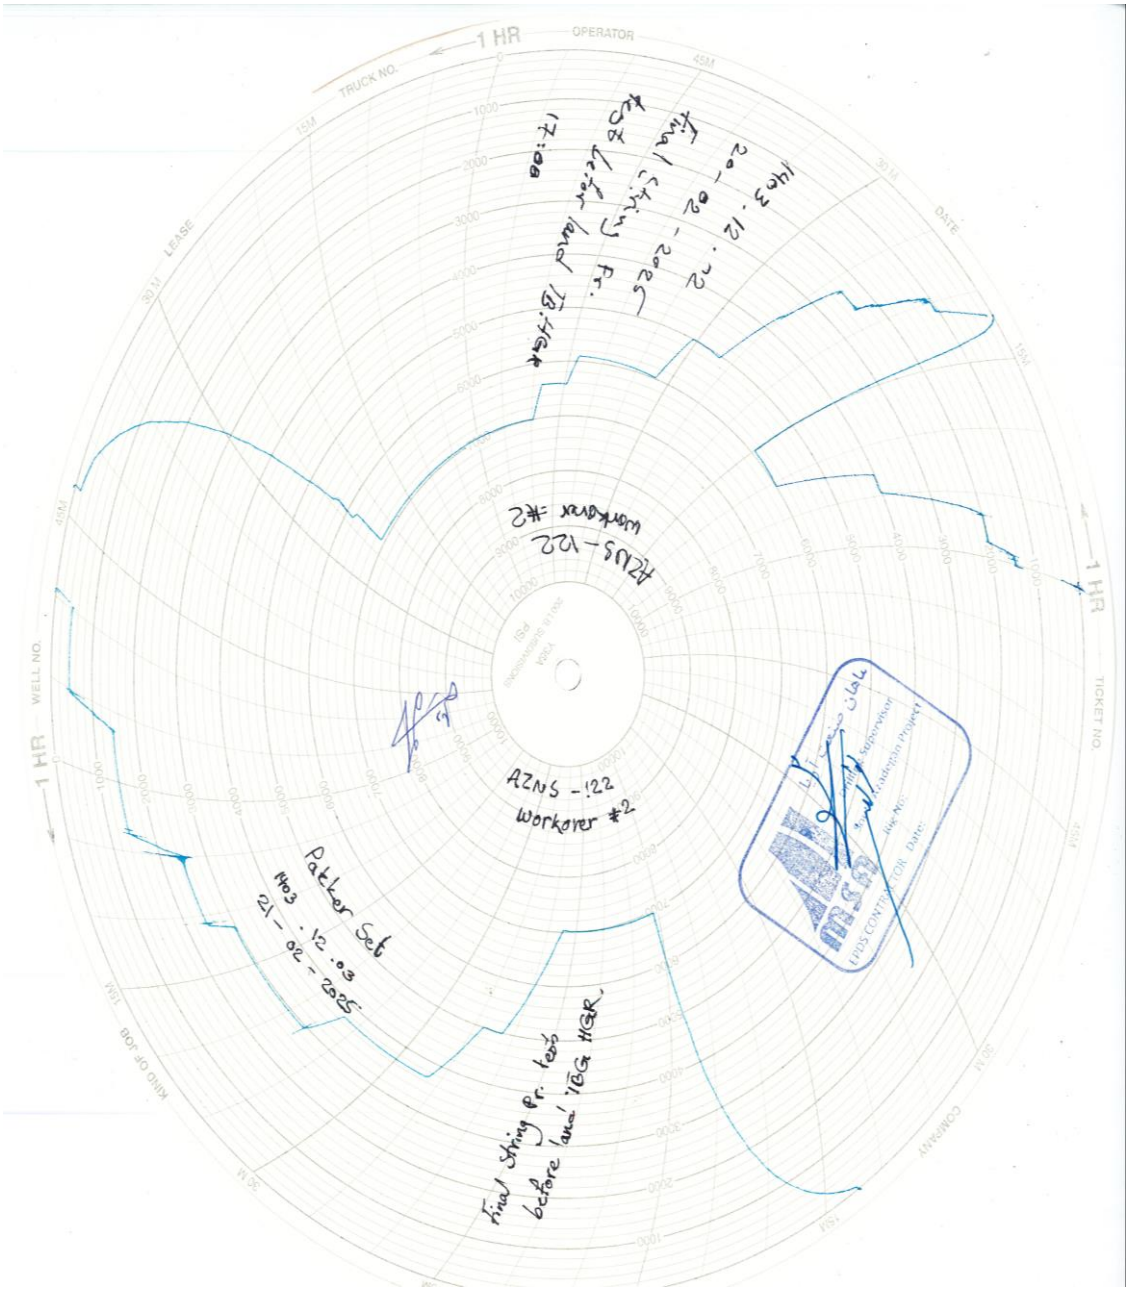
1 HR
OPERATOR
TRUCK NO.
LEASE
DATE
WELL NO.
TICKET NO.
COMPANY
AZNS -122
Workover #2
Packer Set
No3 - 12.03
21 - 02 - 2025
final String Pr. test
before Lan. TBG HGR.

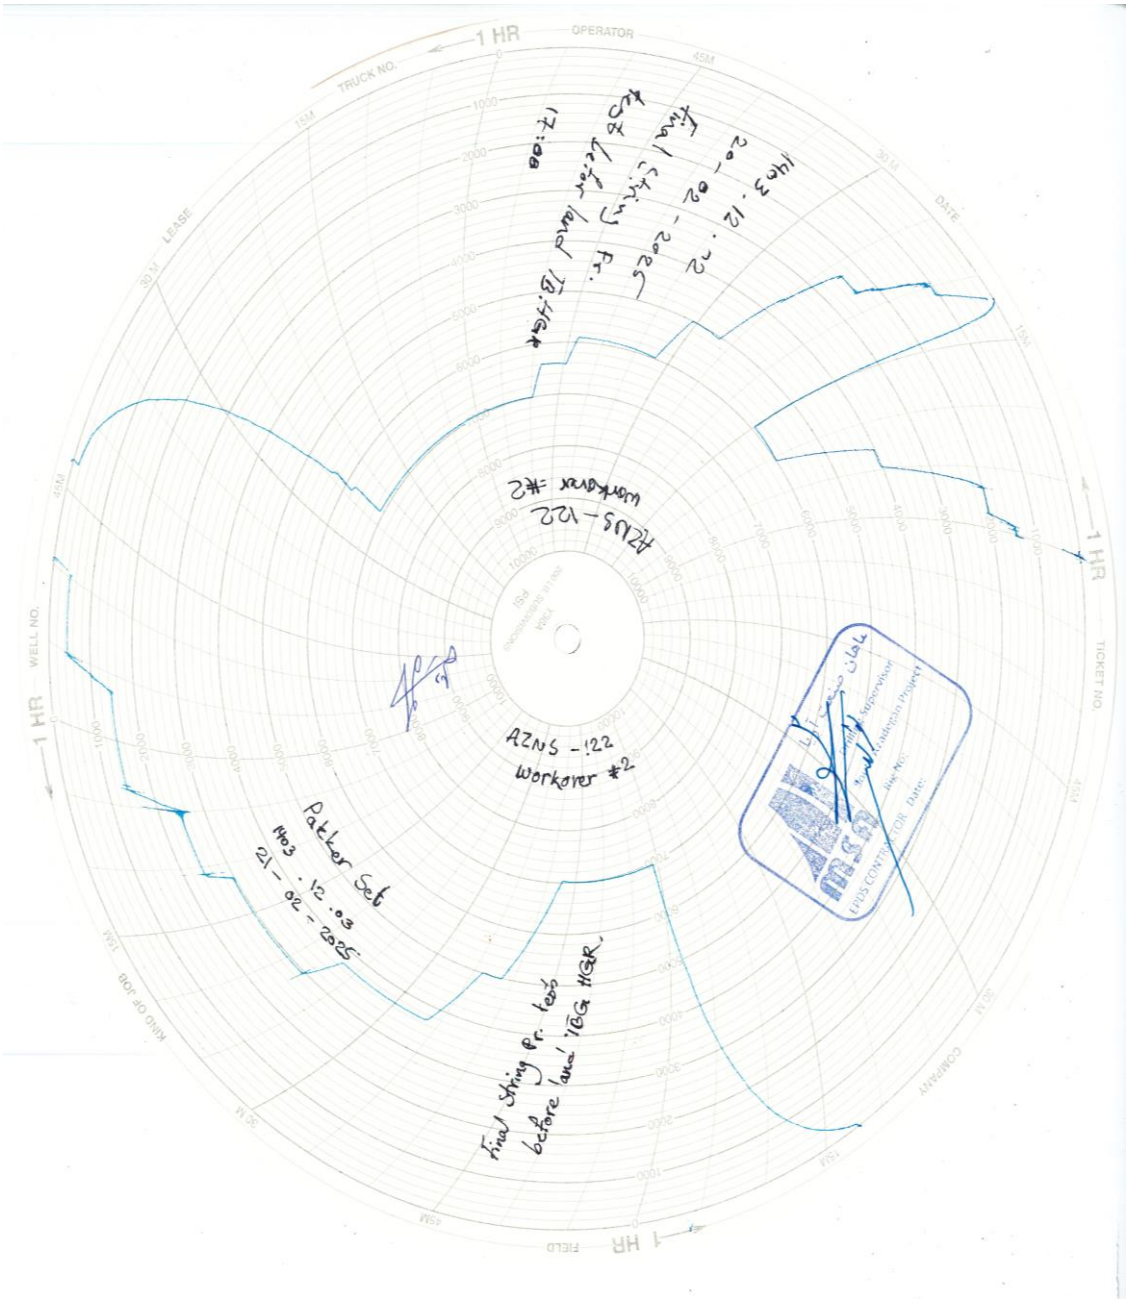


Figure 8-19: AZNS-122 Completion String Pressure Test Graph

9. Wellhead Report

9.1 Final Well Status

Well Head

Item	Specification (size, pressure rating, M/C)	Test Pressure	Test Duration
C.H.H	20-3/4'' 3K, DD-0.5 PSL1, PR1	Already Installed	
C.H.S	20-3/4'' 3K * 13-5/8'' 5K , DD-0.5, PSL1, PR1	Already Installed	
MSP Drilex T.H.S.	13-5/8'' 5K * 11''-10K, FF-0.5, PSL3, PR2	Already Installed	
MSP Drilex X-MASS TREE(BTM)	4-1/16''-10K, FF-0.5, PSL3G, PR2	8000 psi	15 MIN

Wellbore Completion Fluids

Well bore	Fluid Type	Weight (pcf)
Cased Hole	$CaBr_2$	103-104

Well Head Pressure Recor

Annulus	Pressure (psi)	Date / Time
Wellhead	0	1403.12.04
Tubing- 9 5/8"	0	1403.12.04
9 5/8" – 13 3/8"	0	1403.12.04
13 3/8" – 20"	0	1403.12.04

Barriers

Barrier Type	Depth	Pressure Test	Date Tested
Close TRSSSV	60.852^{m}	500 psi (inflow test after finish flow the well)	1403.12.02

Temporary Installed Equipment:

After Completing the well, Plug & Prong have been installed in No-Go landing nipple

Table 9-1: AZNS-122 Final Well Status

9.2 Wellhead & X-mass tree Specification

Well Type	Specification	Check and Remark
MSP Drilex Well Head 10,000 Psi for Fahliyan Wells	**TUBING HEAD ADAPTOR** BOTTOM STUDDED FLANGE 11", 10000 PSI, BX158 TOP STUDDED FLANGE 4-1/16" 10000 PSI BX155 FULL BORE PREPARED WITH TWO S-SEAL AND ONE METAL TO METAL SEAL TO PACK TOP NECK OF TUBING HANGER C/W RELATED TEST AND INJECTION PORTS PREPARTION. C/W TWO CONTINUOUS FEED THROUGH TYPE 1/4" NPT CONTROL LINE EXITS PREPARTION (ONE FOR 1/4" TRSSSV CL AND ONE FOR 1/4" DOWNHOLE PRESSURE GAUGE) AND TWO 3/8" NPT CONTINUOUS FEED THROUGH TYPE LINE PORTS FOR CHEMCIAL INJECTION LINE EXIT INCLUDING RELATED SWAGE LOCK FITTINGS C/WITH ONE 4-1/16", 10K WP FULL BORE MANUAL GATE VALVE FORGED BODY AND BONNET, ALLOY STAINLESS STEEL 410SS GATE & SEAT AISI 410 COATED WITH TUNGSTEN CARBIDE USING HVOF METHOD STEM: INCONEL 718 WITH BACK SEAT CAPABILITY, NON RISING STEM METAL TO METAL SEAL BETWEEN SEAT AND GATE C/W HAND WHEEL FORGED BODY ALLOY STEEL AISI 410 MAXIMUM HEIGHT: 800MM M/C:FF-0.5 T/C:U PSL:3G PR:2 CROSS T-TYPE SOLID BLOCK CROSS T-TYPE SOLID BLOCK, BOTTOM FLANGED 4-1/16" API 10000 PSI WP TOP FLANGED STUDDED 4-1/16" API 10000 PSI WP FOR TREE CAP WITH TWO STUDDED SIDE OUTLETS 4-1/16" 10000PSI WP ELEVATED AT 900 DEG AND TWO 4-1/16", 10000 PSI MANUAL GATE VALVE AT THE TOP AND BOTTOM AND ONE 4-1/16", 10000 PSI WP SAFETY VALVE EQUIPPED WITH HYDRAULIC WIRE CUT	

	ACTUATOR AS UPPER MASTER VALVE MATERIAL OF BODY,BONNET: AISI 410 SEAT, GATE: AISI 410SS HARD FACED WITH TUNGSTEN CARBIDE UASING HVOP METHOD MATERIAL OF STEM: INCONEL 718 M/C:FF-0.5 T/C:U PSL:3G PR:2G. MANUAL GATE VALVE API 4-1/16" 10000 PSI WP. FLANGED ENDS AND FULL BORE METAL TO METAL SEAL BETWEEN BODY/SEAT/GATE WITH BACK SEAT CAPABILITY, NON RISING STEM C/W HANDWHEELS MATERIAL OF BODY,BONNET,SEAT,GATE: AISI 410SS MATERIAL OF STEM: INCONEL 718 GATE&SEAT HARD FACED WITH TUNGSTEN CARBIDE BY HOVF METHOD M/C:FF-0.5 T/C:U PSL:3G PR:2 X-MAS TREE CAP 4-1/16" API 10000 PSI WP, FLANGED BOTTOM (4-1/16", BORE) 8-3/8"-4ACME-2G THREAD TOP, BLANKING PLUG TAPPED WITH 1/2" NPT THREAD, FORGED BODY, MATERIAL: STAINLESS STEEL 410 M/C:FF-0.5 T/C:U PSL:3G PR:2	

Table 9-2: AZNS-122 Equipment Specification

9.3 Wellhead Schematic

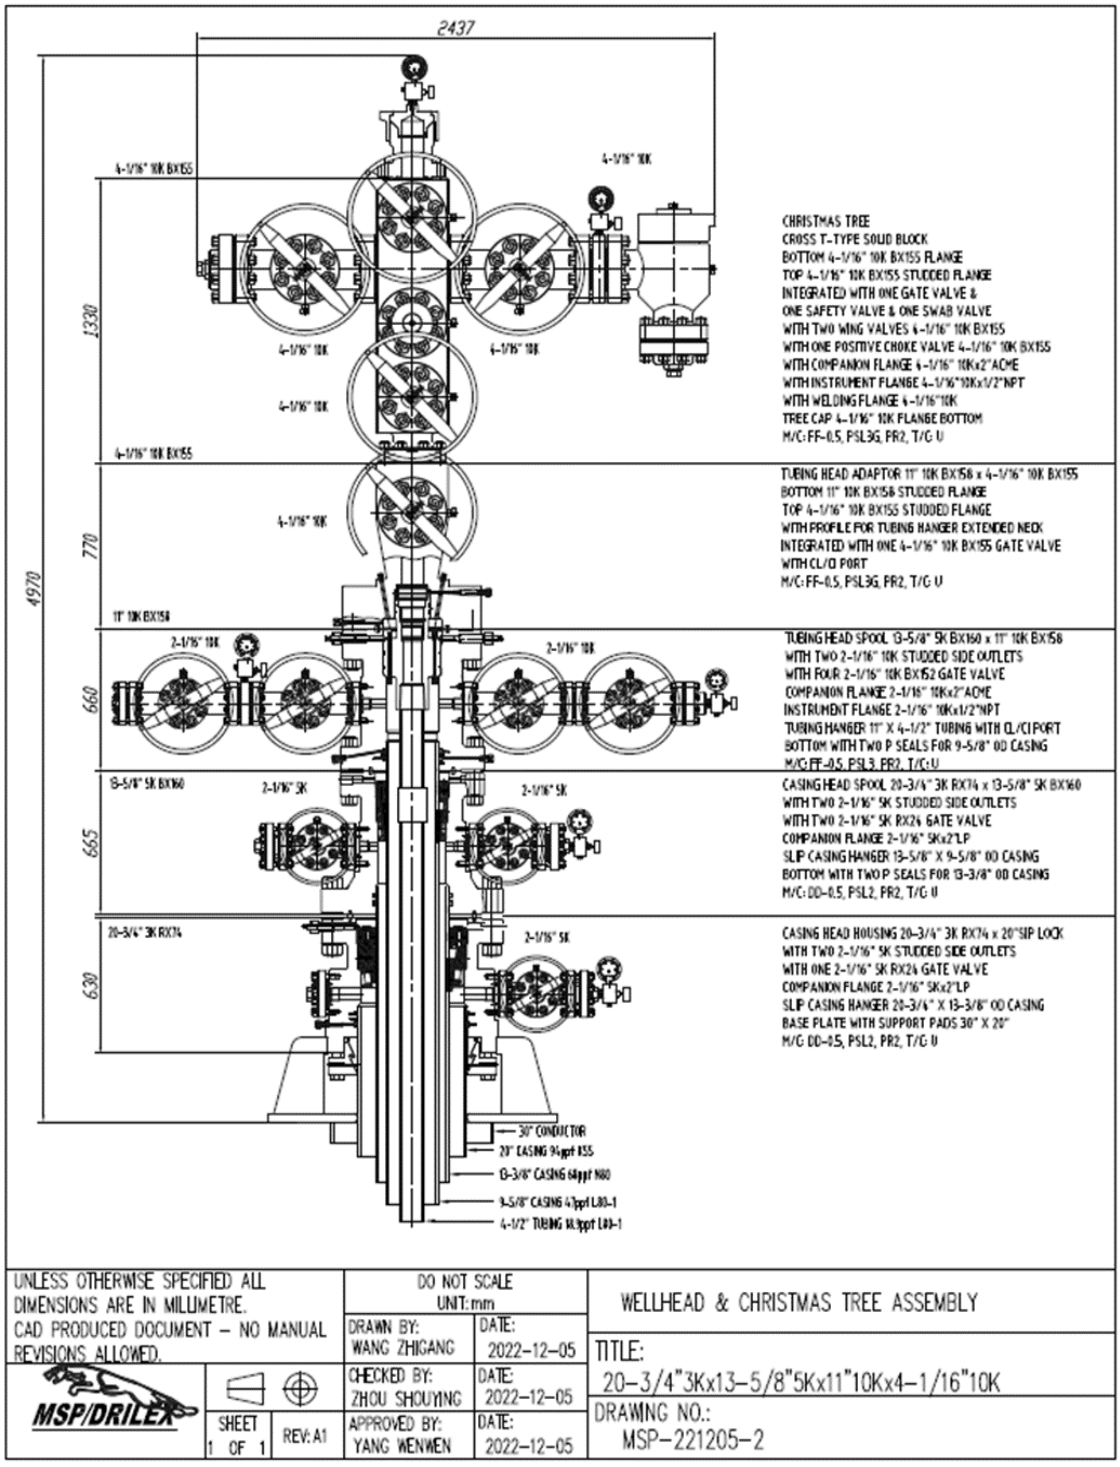


Figure 9-1: AZNS-122 Wellhead Sketch

9.4 X-mass Tree Specification (Section D)

Item	Equipment	M/C	T/C	PSL	Qty
1	BTM Master Valve 11” * 4 1/16” 10K	FF-0.5	U	3G	1
2	TOP Master Valve 4 1/16” 10K	FF-0.5	U	3G	1
3	Surface Safety Valve 4 1/16” 10K	FF-0.5	U	3G	1
4	Deeping Valve 4 1/16” 10K	FF-0.5	U	3G	1
5	Wing gate valve-1 (Kill Valve) 4 1/16" 10K	FF-0.5	U	3G	1
6	Wing gate valve-2 (production valve) 10K	FF-0.5	U	3G	1
7	41/16" Choke valve 4 1/16" 10K	FF-0.5	U	3G	1
8	Christ Mas Tree	FF-0.5	U	3G	1

Table 9-3: AZNS-122 Section "D" Specification

9.5 X-mass Tree Pressure Test Report (Section D – befor install)

Item	Test	Check Mark and Result
1	Pressure test for the kill Valve W/ 1000 & 8000 Psi / 15 min	OK
2	Pressure test for the SSV W/ 1000 & 8000 Psi / 15 min	OK
3	Pressure test for the top master valve W/ 1000 & 8000 Psi / 15 min	OK
4	Pressure test for Swab valve W/ 1000 & 8000 Psi / 15 min	OK
5	Pressure test for the Production valve W/ 1000 & 8000 Psi / 15 min	OK

Table 9-4: AZNS-122 Section "D" Test Report Befor Installation

9.6 X-mass Tree Pressure Test Report (Section D – after install)

Item	Test	Check mark and Result
1	Pressure test X-MAS TREE solid block and bottom section W/1000 &8000 psi for 15min	OK
2	Pressure test for the SSV Exit block W/ 8000 Psi / 15 min	OK
3	Pressure test neck of tubing hanger metal seal W/1000 &8000 psi for 15min	OK

4	Pressure test for Swab valve W/ 4500 Psi / 15 min	OK
5	Pressure test for Production valve W/4500 Psi / 15 min	OK
6	Pressure test cavity of FS.seal and Ring Gasket W 8000 Psi / 15 min	OK
7	Pressure test CIV line to 2000psi	OK

Table 9-5: AZNS-122 Section "D" Test Report After Installation

9.7 Wellhead Related Test Reports

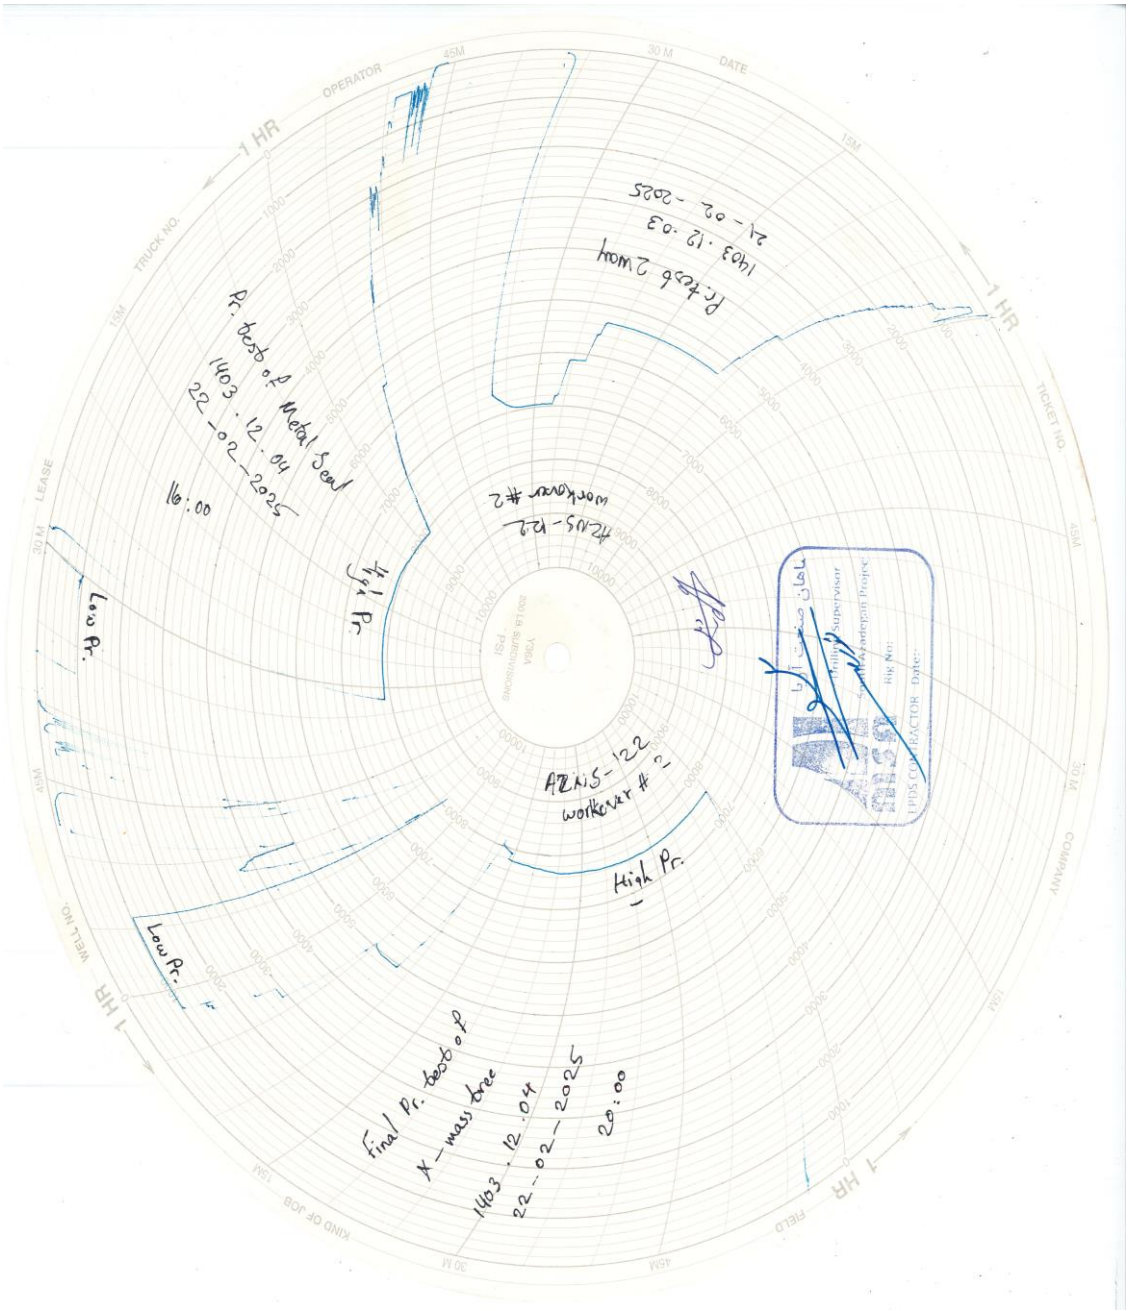


Figure 9-2: AZNS-122 X-Mass Tree Body Pressure Test Graph Before Installation

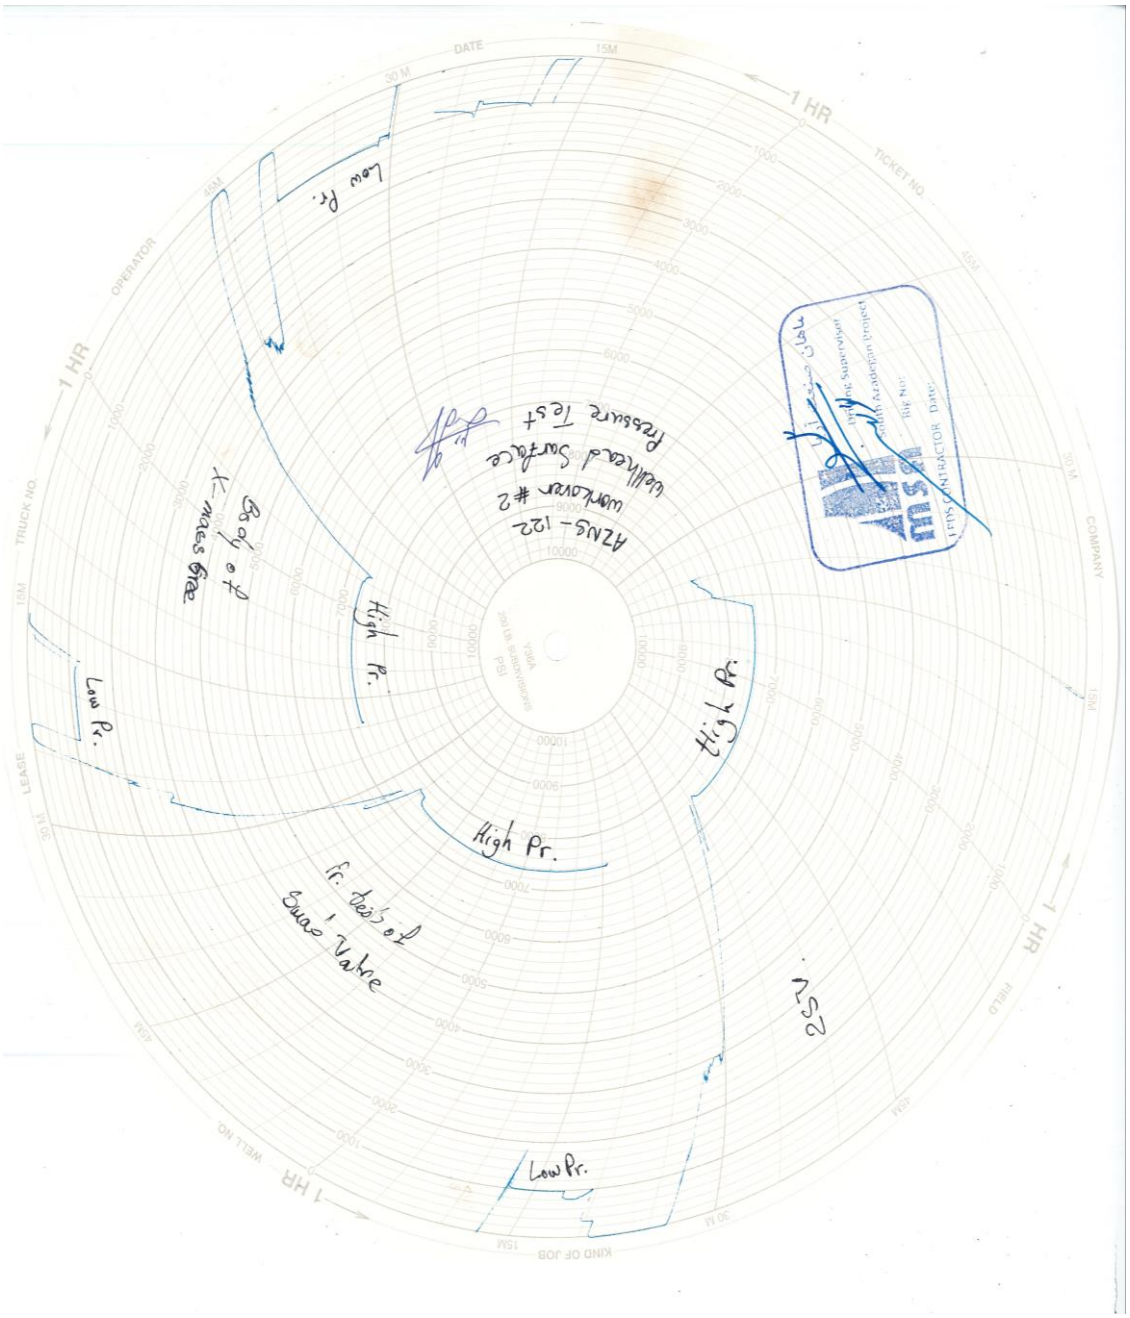


Figure 9-3: AZNS-122 X-Mass Tree Body Pressure Test Graph After Installation

تاریخ: 1403/12/04
پیوست: دارد

بسمه تعالی

موضوع: صورتجلسه تست سطحی تاج چاه **122** آزادگان جنوبی قبل از نصب در دکل **201** عملیات اکتشاف نفت

بدینوسیله در مورخه 1403/12/01 تست‌های سطحی تاج چاه X-Mass Tree Solid Block "T" Type 4-1/16" 10k, MSP Drilex مرتبط به چاه شماره **122** آزادگان جنوبی با حضور نماینده محترم کارفرما در محل دستگاه **201** عملیات اکتشاف نفت قبل از نصب بر روی تاج چاه به شرح ذیل انجام پذیرفت:

- Body Pressure Test of X-Mass Tree Solid Block w/ 1000^{psi}, 5min & 8000^{psi}, 15min "OK". S/N: 0269167CN180005
- Inflow Pressure Test of 4-1/16" Production (WING) valve w/ 1000^{psi}, 5min & 8000^{psi}, 15min "OK". S/N: 002929BS210012
- Inflow Pressure Test of 4-1/16" Dipping (SWAB) valve w/ 1000^{psi}, 5min & 8000^{psi}, 15min "OK". S/N: 008929KN180005
- Inflow Pressure Test of 4-1/16" Kill valve w/ 1000^{psi}, 5min & 8000^{psi}, 15min "OK". S/N: 002929BS210012
- Inflow Pressure Test of 4-1/16" Surface Safety valve w/ 1000^{psi}, 5min & 8000^{psi}, 15min "OK". S/N: 09604-01 N180007
- Inflow Pressure Test of 4-1/16" Top Master Valve w/ 1000^{psi}, 5min & 8000^{psi}, 15min "OK". S/N: 008929LN180005

- گراف مربوط به تست فشار پیوست صورتجلسه گردید.

ناظر عملیات حفاری
ماهان صنعت آریا

نماینده محترم تکمیل چاه کارفرما
شرکت نفت کیش

Figure 9-4: AZNS-122 Wellhead MOM Befor Installation

تاریخ: 1403/12/04
پیوست: دارد

بسمه تعالی

موضوع: صورتجلسه تست‌های تاج و ولهد چاه **122** آزادگان جنوبی پس از نصب در دکل **201** عملیات اکتشاف نفت

بدینوسیله در مورخه 1403/12/04 تست‌های تاج چاه X-Mass Tree Solid Block "T" Type 4-1/16" 10k, MSP Drilex و ولهد مرتبط به چاه شماره **122** آزادگان جنوبی با حضور نماینده محترم کارفرما و نماینده عملیات حفاری ماهان صنعت آریا در محل دستگاه **201** عملیات اکتشاف نفت پس از نصب بر روی چاه به شرح ذیل انجام پذیرفت:

- Body Pressure Test of X-Mass Tree Solid Block w/ 10k, 11" * 4-1/16" 10k Tubing Head Adaptor (Bottom Master Valve) 10k MSP Drilex w/ 8000^{psi}, 15min "OK". S/N: 0269167CN180005
- Pressure Test TBG HGR Metal Seal to 800^{psi} for 5min & 8000^{psi} for 15min, "OK".
- Pressure Test F-Seal & Ring Gasket between T.H.S & T.H.A (BMV) to 8000^{psi} for 15min, "OK".
- Pressure Test Neck of TBG HGR F-Seal to 8000^{psi} for 15min, "OK".
- Pressure Test ¼" Control Line (CL) to 8000^{psi} for 15min, "OK".
- Pressure Test 3/8" Chemical Injection Lines (CIL) to 2000^{psi}, "OK".

- فشار تمامی دالیزها بررسی گردید که فشار آنها صفر بود.
- بعد از اتمام نصب تاج چاه درون آویزه لوله مغزی Two Way Check Valve (TWCV) جهت انگیزش چاه خارج گردید.
- خروجی کنترل لاین شیر ایمنی درون چاهی در جهت شیر اصلی پایینی می‌باشد و همچنین CIV شماره یک در جهت ویست‌پیت و CIV شماره دو در خلاف جهت ویست‌پیتمی‌باشند. همچنین بر روی دو CIV و کنترل لاین پلاگ‌کپ نصب گردید.
- گراف مربوط به تست فشار پیوست صورتجلسه گردید.

ماهان صنعت آریا
Drilling Supervisor
Rig No:
Date:

ناظر عملیات حفاری
ماهان صنعت آریا

نماینده محترم تکمیل چاه کارفرما
شرکت نفت کیش

Figure 9-5: AZNS-122 Wellhead MOM After Installation

10. Drilling Fluid Information

10.1 Interval Remark

Operation Remark

Made up 5" and 3-1/2" drill pipe stands joint by joints and ran back in The Derrick then Checked the 3SV Depth with 3.3" Gauge Cutter and the results was satisfactory then POOH to Surface.
RIH with Protection Sleeve and set That then POOH to Surface. RIH with 2.5" Gauge Cutter to Check and Pass No-Go with satisfactory then POOH to Surface. RIH with 2.8" Gauge Cutter to Check and Pass SSD with satisfactory results then POOH to surface.
RIH with Plug and set in NO-GO then POOH to Surface. RIH with Prong and set in Plug after that POOH to surface. RIH with Shifting Tools and were making SSD Open While were pressuring Completion string then POOH to Surface and Performed Displacing The Well with Mud 101pcf and Circulated Till Uniformed In and Out Mud.
RIH with GS Pulling and Retrieve Protection Sleeve after that POOH to Surface. Reamed down Slick Line Then Closed 3SV and set TWCV in tubing hanger and Performed Pressure Test with satisfactory result. N/D X-Mass Tree Is In Progress and nipple up BOP then Performed BOP Test with satisfactory result Opened Tie-Downs and Performed BOP Test with satisfactory result after that Retrieved TWCV then reamed up casing Running equipment and Retrieving completion string is in progress meanwhile circulated C.W.H and Monitored The Well with NL-NG
Made up and RIH with 6.5” BHA To 1998m (7" Liner Lap) then Took Weight and Pump 30 BBL high viscosity Pill after that circulated bottoms up therefor POOH to surface.
Made up 6" M.M.Junk Mill (5*15/32" Ports, S/N: 445) and Milling BHA To 1635m then observed that string Plugged therefor Worked On String To Unplugging but didn’t success then POOH to 1270m after that Checked String and observed stand #36 was plugged then laid down it and Started Normal Circulation Mud then observed good hole condition therefor Ran Back To 1635m(Same Depth) and Continued RIH with 6" M.M.Junk Mill On Elevator to 1870m While Filled Up String Every 10 stand therefor continued RIH to 3721m then Took weight (Top of the 7" Packer) therefor circulated mud to balanced 104pcf mud weight in and output then Started Milling The Packer from 3721 to 3721.5m after that observed Trace of oil on the shaker and Detected H2S therefor decreased mud weight to 72pcf then Closed Hydrill and continued circulation Through Chock manifold to Burning line with back pressure meanwhile increased Surface system mud weight to 106pcf Till Balanced mud weight to 106 PCF then continued Milling to 3722m But it was not according to progress therefor POOH For Change 7" Mill To 2000 to surface.

Changed 7" Mill then RIH With Same BHA Milling TO 3722m after that Commenced Milling 7" packer From 3722m In progress and in 3722.2m tried to make progress in milling operation but didn't successes then continued milling to 4000.15m with NL-NG also tried to make progress in milling operation but didn't successes therefor POOH To surface.
Laid down 6" M. M. J. Mill (100 % Used) then made up and RIH with 2" * 4" Taper Tap To 4000.15m after that Tagged top of fish therefor circulated with high flow rate to cleaning top of fish then Recorded off bottom parameters after that Tapped in fish (10 RPM, 5klb.ft TQ) and Applied 15klbs weight then Released TQ after that picked up string that engaged with fish and stuck then Worked on stuck to got it free after that POOH To 3778m with 10klbs drag then observed Unable to pass this point therefor Checked downward movement that be Free then Worked on string and we can successfully Passed 3778m after that continued POOH to surface then observed that Fish was recovered successfully.
Made up 6" M. M. Junk Mill and BHA Milling To 4008m and Held up then Pushed down to 4011m after that Performed Milling and cleaned out From 4011m to 4077 then Due to Observed Gas cut mud and Oil Show on shaker, Circulated and uniformed mud weight after that continued Milling Operation From 4077m To 4095.8m meanwhile Pumped high viscosity Pill Periodically Due To String Stalling and Torque Fluctuation, Dressed Interval 4090m to 4095.80m Several Times and Pumped high viscosity Pill and circulated bottoms up Till went Out The high viscosity Pill then POOH To Surface meanwhile circulated C.W.H and Monitored The Well with NL-NG after that Checked The Mill Condition (70% Used).
Made up New 6" Mill and RIH with Milling BHA and RIH To 1420m then Performed Slip and Cut drilling Line after that Resumed RIH w/ 6" Milling BHA To 3900m On Elevator meanwhile filled up string Every 10 stand then connected TDS and Continued RIH with 6" Milling BHA with Wash down from 3900 To 4093m then observed Holding Up string weight at 4093m with NL-NG therefor Worked On TDS then Dressed interval from 4093m to 4094.5m after that POOH To 4079m and Worked On TDS therefor RIH Back To 4093m and Continued Dressing From 4093m To 4095.8m after that Resumed Milling and Cleaned out inside 7" liner from 4095.8m To 4110.8m meanwhile Pumped high viscosity Pill and cleaned Ditch Magnet Periodically with NL-NG but String got Stuck at 4109.7m therefor Worked on Stuck and made it free then continued Hard Milling and Cleaned Out inside 7" liner from 4109.7 To 4110.8m meanwhile observed string Stalled at 4109.7m several Times and Pumped high viscosity Pill and cleaned Ditch Magnet Periodically with NL-NG after that continued milling and cleaned out inside 7" liner from 4110.8m To 4112.8m but String got Stuck at 4112.8m therefor Worked on Stuck and made it free with maximum 10klbs.ft TQ then applied 150klbs Downward WOB and 170klbs Over pull but this operation didn't success therefor Prepared 65bbl high viscosity Pill (10% Lubricant) and Circulated out till high viscosity reached annulus then Continued Worked on stuck with Maximum 10klbs.ft TQ and applied 150klbs Downward WOB and 170klbs Over pull but this operation didn't success after that continued Working on Stuck with Maximum

10klbs.ft TQ and applied 150klbs Downward WOB and 170klbs Over pull but this operation didn't success with NL-NG in All the time then Pumped 15 BBL pipe lax pill (5%) and Circulated Out till 1 BBL of pipe lax out of mill after that Continued Working on stuck with Maximum 10klbs.ft TQ and applied 150klbs Downward weight and 170klbs Over pull but this operation didn't success therefor Continued Working On Stuck with Maximum 10Klbs.ft TQ and applied 150Klbs Downward weight and 170Klbs Over pull To Made string Free meanwhile Circulated Thought string but this operation didn't success after that Received Wire line Crew and equipment then Ran up Wireline equipment according to the Progress then RIH with 2-1/8" Tool String As Dummy Run and observed Cable Tension Dropped at 1722.5m(X.O.S 3-1/2" * 5" Depth) therefor POOH To Surface.

RIH with 2-1/8" Tool String as Dummy Run To 4100m then POOH To Surface. RIH with 1-3/8" Tool

String to Perform FPIT then FPIT Resumed was as:

Follow:1800m,2000m,2500m,3000m,3500m,3800m,3900m,3940m,4053m,4078m(All Free), 4088m(95% Free), 4098m(95% Stuck), 4107m(100% Stuck) then POOH 1-3/8" Tool String To Surface.

Reamed down Wireline equipment then Continued Working On Stuck with Maximum 80klbs Downward weight and applied 150klbs Over pull therefor this operation didn't success then Prepared and Mixed 30bbl Citric Acid + 30bbl Water (PH: 4.5) as Acid Solution and worked on stuck to made it free but this operation didn't success after that displaced String Cap with Fresh Mud and performed Back off Wire line Operation as follow:

RIH with 1-11/16" Tool String as Dummy Run to 4100m with good hole condition therefor POOH to surface.

Due to Cloudy and Rainy Weather was Not possible to worked with explosives close to surface therefor Tighten up String Joints with Applying Right-hand Torque then Applied Left-hand Back off Torque (11.5Turns, Max TQ: 9lbs.ft, Max Pull: 325klbs) Fire the Back off shot then observed no obvious effect on String therefor POOH to surface and observed Shooting Bar (Len: 2.2m) left in String Attempt to Performed Mechanical Back off as follow:

Tighten up String Joints with Applying Right-hand Torque and Applied Left-hand Back off after that POOH 6" Milling BHA To Surface On Elevator with Speed Control to check string then observed String is Backed off according to planned Back-off depth and 6" M. M. J. Mill + 4-3/4" BIT SUB + 4 joints 4-3/4" drill collar left in the hole after that Performed BOP Test that was in progress then Prepared for RIH with OEDP and SLM all Received 2-7/8" drill pipes therefor Changed Handling tools and RIH with 22 joints 2-7/8" drill pipes meanwhile Cleaned and Passed Rabbit through Them after that Changed Handling equipment and Continued RIH with 68 stands 3-1/2" drill pipes meanwhile Passed Rabbit through Every stand and Checked all Connections then filled up String and Break Circulation Every 7 stands after that Changed Handling equipment and Continued RIH with 5" drill pipes To 3250m meanwhile Passed Rabbit through Every stand and Checked all Connections then filled up String and Break

Circulation Every 7 stands with NL-NG then POOH To Surface and laid down 22 joints, 2-7/8" drill pipes.
Made up and Ran in hole With 6-1/8" M. T to 1030 m Meanwhile Filled up and break Circulation Every 7 stands with NL.NG at 3857m took weight (Tag cement) then Started Drilling out cement from 3857m to 3910m meanwhile Pumped high viscosity pill Periodically and Checked String with Movement Up and Down String therefor continued Drilled out cement to 3945m then Circulated bottoms up after that Performed Positive Pressure Test cement Plug with 2000 psi and satisfactory result then POOH to surface.
RIH with 7" scraper to 3645m then scraped from 3645m to 3945m several times then Pumped 40 BBL high viscosity Pill and Circulated bottoms Up till uniformed total mud system therefor Spot 30bbl high viscosity Pill and POOH from 3945m to surface then laid down Bit and 7" Scraper.
Made up and RIH with 7" Whip stock BHA to 528m then Rig up wireline logging crew and Equipment, Run Gyro tools as Dummy to 372m after that Tried to pass this depth but didn't success then POOH to surface and laid down 1 joint 4-3/4" drill collar after that Continued checking BHA several times with Run Gyro Tools and Performed Short circulation mud.
Commenced RIH with 3-1/2" drill pipe to 474m meanwhile passed rabbit through and break circulation every 10 stands after that Continued RIH with 3-1/2" drill pipe and followed by 5" drill pipe to 2557m after that RIH with 7" whip stock to 3922m then RIH With Gyro to 3922 and tried to took data but this operation didn't success therefor POOH with gyro and continued RIH to 3943m (set position whip stock) then tried to shearing pin's HFBPV with satisfactory result after that Tried to setting packer Whip stock several times but didn't successes therefor POOH to 2414m then Slipped and Cut drilling line after that Continued POOH to surface and laid down BHA then Observed 4-13/16" HFBPV is plugged whit debris.
RIH by Open End BHA to 3945m then circulated bottoms up and Spotted 30BBl high viscosity Pill after that POOH.
RIH with 7" Whip stock BHA to 3945m after that Set whip stock according procedure then Started open window on 7" liner from 3938.9m to 3945m to side track the well While got 100% Formation Sample in interval 3942m-3945m, Dressed and Smoothed The Opened Window With and Without Rotation and Pumped out Several Times with satisfactory result in all situations then Pumped 30bbl high viscosity Pill as Well and Hole Sweep therefor POOH 7" Side-Tracking BHA From 3945m To 3960m On Elevator after that Static Flow Checked at 3600m and the well was static then Continued POOH 7" Side-Tracking BHA From 3960m To surface On Elevator meanwhile Circulated C.W.H with NL-NG.
Made up 15 joints Heavy weight drill pipes then performed BOP Test and made up 15 joints heavy weight drill pipes, 6-1/8" Directional BHA,11 joints 3-1/2" Heavy weight drill pipes and reamed back in the Derrick that was in progress.
RIH w/ 6-1/8" Directional BHA from 260m to 3945m and performed Shallow Tests while RIH after that displaced In-Hole Mud with Limestone Mud and Circulated Till

uniformed the In and Out Mud Properties then Directional Drilling as Rotational Mode from 3945m To 3956m meanwhile well was monitoring with NL-NG then continued RIH from 3956m To 3963m after that for Attempt to Checking shot and observed MWD Signal is lost then Worked on the same issue to made it fix but didn't success therefor Continued RIH from 3963m To 3966m but Due to MWD Signal lost decided to POOH 6-1/8" Directional BHA to Surface and Monitored The Well as Static Flow Check then well was static with NL-NG after that laid down 6-1/8" Directional BHA. Made up 6-1/8" Back-up DHM then Performed Shallow Test after that reamed down the same and Waited on receiving Back-up 4-3/4" DHM From HANA Energy Company then Performed Shallow Test with 200GPM and got 1200psi Differential Pressure therefor Set DHM AKO to 1.5Deg and continued RIH with 33 joints 3- 1/2" H.W.D.P + 4-3/4" Jar + 1Jt 3-1/2" H.W.D.P and RIH to 345m then Continued RIH with 6-1/8" Directional BHA From 345m To 1502m Followed by 3-1/2" drill pipes after that Performed Functional Tests but MWD Signal was lost after that Fixed the same and Continued RIH with 6-1/8" Directional BHA From 1502m to 3949m then connected TDS and Continued RIH with 6-1/8" Directional Drilling BHA with Washed down from 3949m To 3966m then Held up string Weight at 3966m after that Continued Directional Drilling with 6-1/8" Directional BHA as Rotating Mode from 3966m To 3988m that took Survey during Directional Drilling [MD: 3956.5m, Inclined: 2.55Deg] then Pumped high viscosity Pill Periodically and before each Connection after that back reamed and reamed down the last drilled stand with NL-NG therefor continued Directional Drilling with 6-1/8" Directional BHA as Rotating and Sliding Mode from 3988m To 4208m While decreased mud weight to 103pcf then took Survey during Directional Drilling after that back reamed and reamed down the drilled interval and monitored the Well with NL-NG then Performed high Rate circulation bottoms up at 4208m after that back reamed with 6-1/8" Directional Drilling BHA to Condition the drilled hole from 4208m To 3919m then RIH Back with 6-1/8" Directional Drilling BHA from 3919m To 3967m On Elevator and Observed string was Hold Up weight at 3967m after that Connected TDS and Continued RIH with 6-1/8" Directional Drilling BHA with Wash Down from 3967m To 3977m therefor Continued RIH Back with 6-1/8" Directional Drilling BHA from 3977m To 4121m On Elevator then Observed the string was Hold Up weight at 4121m after that Connected TDS and Continued RIH with 6-1/8" Directional drilling BHA then circulated bottoms up with High Rate till high viscosity pill went out to Sweep the hole after that POOH 6-1/8" Directinal Drilling BHA from 4208m to surface and laid down 6-1/8" PDC Bit, 4-3/4" DHM and MWD Tools and rest of BHA.

R/U Sea Land Wire Line equipment that was in progress then RIH with CDR/GR Logging 4206m and Recorded Data with Logging up with Wire Line Tools from 4206m to 4130m then Logged Down from 4130m to 4135m to repeated pass then Observed 100lb Cable Tension Dropping after that Attempt to Logged up and Observed Wire line Tools get stuck at 4134m therefor worked on stuck to made Wire Line Tool String free several Times but didn't Success therefor Applied 8000lb Tension on Wire line using Wire Line unit winch then POOH Wire Line Tool String to

surface to check the same and Observed All Wire Line Tool String except cable Head is left in the hole therefor reamed down Wire Line equipment and set Wear Bushing. Made up 5-1/4" Fishing BHA and RIH to 2900m While Circulation C.W.H and Monitored the Well then RIH to trying to catch the fish several time after that POOH for checking overshot to surface and observed without any indication on overshot and laid down it then slipped and cut 100FT drilling line after that RIH with fishing BHA (5-1/4" overshot) to 4202m then catch the fish and Stock string therefor worked on string and got it free therefor POOH to surface for checking string then Observed the recovered 1.13m of the fish.

RIH with fishing BHA to 4201.5m and Worked on fish then catch indication fish after that POOH to surface but observed that no recovered fish meanwhile observed broken 3-5/8" Spiral grapple and 3-5/8 Spiral grapple control therefor laid down Fishing BHA and Retrieved wear bushing.

Running 4-1/2" liner totally 32 joints then made up liner hanger assembly with top packer to 4-1/2" liner after that were continued running liner with follow by 3-1/2" and 5" drill pipe to 3993m while were passed rabbit through the drill pipes and fill up string every 10 stands then Observed that stopped string at 3993m therefor Tried to passing this depth by pumping and applied max 30klb weight on it several times but didn't success then POOH to surface therefor laid down liner hanger + 32 joint 4-1/2" liner + F. shoe + F. collar + LDC and Circulated mud Cross well head.

RIH to 4201.5m while washed and reamed several Point and Pushed Down the Obstruction after that Circulated bottoms up then POOH to surface with Normal condition.

Ran 4-1/2" liner to 3993m then Tried to pass this depth with Pump and weight several times but didn't success therefor POOH from 3993m to surface.

Performed BOP test as Per NIOC Policy after that RIH with 4-3/4" drill collar + 3-1/2" HWDP to 1000m then Slipped and cut 102ft drilling line after that Continued RIH to 3990m then Took weight therefor washed and reamed to 4004m after that observed Gas cut mud therefor Shut the well while S-trip in Hydril and observed that the well was safe then Continued washing and reaming to 4110m but String Stuck therefor Worked on it to be free then washed and b. reamed to 4062m after that POOH on elevator to 3920m then observed Gas Cut mud therefor Shut the well and circulated mud through Chock manifold wide open after that POOH TO Surface.

Ran 4-1/2" liner to 211m then follow by 3-1/2" and 5" drill Pipe to 2482m after that Observed 10bbl Gain therefor Shut the well and worked on Killing the well but didn't success then Prepared 120pcf Killing Mud and broke Circulation Every hour through Choke Manifold and Poor boy Degasser to making sure string was not plug then Circulated 500bbl 120pcf Killing Mud in two steps through Choke Manifold and Poor boy Degasser then Got 111pcf Mud in Return therefor Opened the Well and Resumed RIH with 4-1/2" liner from 2480m To 3056m While were full up string and Closed the Well and Circulated with 110pcf Mud through Choke Manifold and Poor boy Degasser and Got 95pcf Mud in Return therefor Performed Static Flow Check at 3056m and the Well was Static after that Opened the Well and Resumed RIH with 4-1/2" liner from

3056m To 3771m then observed U-Tube at 3771m due to Unbalance mud weight in string and Annulus after that Closed the Well and Monitored SICP and SIDP ,Respectively 0psi, 800psi While Periodically Breaking Circulation with 110pcf Mud through Choke Manifold and Poor boy Degasser after that Prepared 108 and 110pcf Mud that was in progress.
Attempt to Killing the Well using Single Circulation Method with 700bbl 108pcf and 153bbl 110pcf in two steps through Choke Manifold and Poor boy Degasser then Opened the Well and Continued RIH with 4-1/2" liner from 3771m To 3914m Followed by 5" drill pipe On Elevator after that Continued Mud Circulation with 526bbl 108pcf Mud through Choke Manifold and Poor boy Degasser therefor Decided to Stopping operation and Preparing 110pcf Mud the well closed then Monitored SICP and SIDP ,Respectively 1300psi, 750psi, While Periodically Broke Circulation with 110pcf Mud through Choke Manifold and Poor boy Degasser to making sure string was not plug and Got 95pcf Mud in Return then Prepared 110pcf Mud.
Killed the Well at 3771m using W&W method with 654bbl 110pcf Mud in two steps through Choke Manifold and Poor boy Degasser with SPP: 1350psi, CP: 650-250psi and Got Min. 86pcf Gas-Cut Mud in Return therefor Continued Mud Circulation with 150bbl 110pcf Mud with SPP: 1350psi and Wide Open Choke after that Open the Well at 3771m and Continued Circulation with Flo rate: 121gpm, SPP: 1200-1300psi till uniformed the In and Out mud weight then well checked at 3771m and it was static after that POOH 4-1/2" liner Assembly From 3771m To 1951m then flow checked 1951m at and it was static therefor Continued POOH 4-1/2" liner Assembly From 1951m To 332m then flow checked at 322m and well was static.
Ran up Casing Running equipment and Changed Handling Tools then B/O and L/D 5-3/4" liner hanger Assembly after that Continued B/O and L/D 4-1/2" liner joints from 322m to to Surface and L/D them While the well were Monitor then Circulated C.W.H with NL-NG While were Check 4-1/2" F. Shoe, F. Collar and LDC (4-1/2" F. Collar was damaged).
Made up 6-1/8" Condition BHA and RIH to 3936m after that Decreased mud weight to 105pcf then Circulated To Balance Mud weight after that Continued RIH with Washing and Reaming down from 3936m to 4202m with NL-NG then POOH 6-1/8" Condition BHA with Back Reaming and Pumping out from 4202m to 3941m after that POOH 6-1/8" Condition BHA from 3941m to surface On Elevator with NL-NG therefor Rested of BHA.
Made up 4-1/2" liner assembly and RIH to 4201.5m On Elevator While were full up string and Broke Circulation Every 10 stands with NL-NG then Set Liner hanger after that performed cement Job with NL-NG then circulated bottoms up at 3322m after that POOH liner hanger setting tools from 3322m to surface On Elevator and Surface sample after 8 hours was hard While were Circulate C.W.H with NL-NG.
Made up 6-1/8" Clean out BHA and RIH with 6-1/8" Clean out BHA to 3739m followed by 3-1/2" and 5" drill pipe then Connected TDS and Continued RIH with 6-1/8" Cleaned out BHA with Washing down from 3739m to 3765m then Held up string Weight at 3765m therefor Started drilling out cement with 6-1/8" Clean out BHA from

3765m to 3871m While were Back Ream and were Ream down Every stand before Connection with NL-NG after that Set Top packer and circulated bottoms up then POOH 6-1/8" Clean out BHA to surface after that performed BOP Test according to progress.
Made up 3-1/2" Clean out BHA and RIH to 250m, Attempt to Filling out string observed string was plug then Decided to POOH, Install Secondary Fingerboard for 2-7/8" drill pipes and 3-1/8" drill collars therefor POOH 3-1/2" Clean out BHA from 250m to surface.
B/O 3-1/2" Mill Clean and Unplug 3-1/2" Mill in addition made up 3-1/2" Clean out BHA and RIH to 3310m While were full up string and Broke Circulation Every 15 stands with NL-NG then at 3310m observed string was plugged therefor Worked on string and made it unplugged after that Resumed RIH with 3-1/2" Clean out BHA from 3310m to 3511m and Attempt to Performing Broke Circulation at 3511m observed that string was plugged therefor Worked on string and made it unplugged after that Resumed RIH with 3-1/2" Clean out BHA from 3511m to 3554m with Washing down followed by 5" drill pipe then string got plugged while RIH therefor Worked on string and made it unplugged after that Broke Circulation for a while then Resumed RIH with 3-1/2" Clean out BHA from 3874m with Washing down then Held up string at 3874m after that drilled out cement inside 4-1/2" liner with soft to medium then Washing and Reaming down from 4028m to 4178m then pumped 20bbl low viscosity pill at this depth after that circulated bottoms up till pill went out on shaker then pumped 20bbl $CaCl_2$ solution at 4178m as balancing and chasing with 103pcf mud to spot it in 4-1/2" liner that was in progress after that spotted 20bbl Brine with 103pcf Mud at 4178m to Spotting it in 4-1/2" liner then POOH 3-1/2" Clean out BHA to surface On Elevator and Performed Positive Test at 3870m with 1000psi with satisfactory result.
Changed top rams then removed wear bushing and install shooting nipple after that installed wireline logging BOP and test it with satisfactory result then RIH with 2-7/8" Dummy (Run 1) to 4150m
DMR 9 POOH wireline logging tools (RBT/VDL/CCL/GR) to Surface therefor laid down it.
RIH with 2 No. 2-7/8" B. Gun + CCL As Dummy Run to 4165m after that POOH to surface and laid down it then Performed Run#1 Perforation according to Program While Wait on Daylight to Run 2 No. 2-7/8" B. Gun + CCL As Dummy with NL.NG after that continued perforation with 12 runs after that Slipped and Cut 125ft Drilling Line then Changed Top Rams and Test it with satisfactory result.
Made up 3-1/2" Clean Out BHA Including : 3-1/2" Junk Mill + 3-1/8" Bit Sub + 5 stands 3-1/8" drill collars to 4178m with NL-NG while were fill up string and circulated bottoms up then Spotted 20 BBL Completion fluid (CaBr2 102.5 PCF) after that POOH on Elevator from 4178m to Surface.
RIH with 7" Scraper BHA Including: 7" Scraper + 6 1/4" Bit Sub + 8 stands 3-1/2" H.W.D.P and Follow by 3-1/2" drill pipe to 3871.3m While were Scrape from 3400m to 3540m several times While were wait on Receiving Completion String and circulated mud with NL-NG after that 10 BBL Gain While bottoms Up (50bbl

Remaining To Finished) therefor Closed the well and SICP: ZERO after that Mud Circulated Through Chock Manifold with NL-NG but Return mud weight was 70 PCF therefor Stopped Circulation and Closed the well to made mud While were wait on Receiving Completion String and Completion Fluid therefor Continued making mud and Circulated mud with 105 PCF Through choke Manifold with NL-NG then Return minimum mud weight was 70PCf and Last return mud Weight was 103 PCF then Continued Circulation with 105pcf mud Through choke Manifold after that Get 105 PCF Mud in Return and Observed The Well was Static therefor Opened The well and Continued Direct Circulation mud with flow Rate: 220 GPM, SPP: 2000Psi with NL-NG While worked on mud properties.
Waited on Receiving Completion String and Completion Fluid in addition Continued Direct Circulation Mud with NL-NG after that R/U Chick san Pipes and Line up the same on 5" drill pipes and Pumped Unit of Dana Energy Company then Connected Hose from Solution Tanks to Pump Unit and Performed Displacement of Completion Fluid as follow: Pumped 30bbl high viscosity Pill as Spacer + Pump 675bbl Completion Fluid according to progress.

Drilling Fluid Remark

The 103 - 106 PCF KCl/Polymer mud was used for starting this section.

it was tried to control mud properties by using all available solid control equipment such as shale shakers was applied as per requirement in order to control MW.

The MW increased up to by adding Limestone & Hematite Powder up to 106 PCF at end of this section.

SCE such as Shakers and centrifuges were running to discard LGS while drilling this section.

Treated frequently with essential chemical such as lime as Alkalinity controller to adjust pH, Starch LV & HT for control FL, Soda Ash for control hardness & Xanthan gum as Viscosifier.

10.2 Drilling Fluid type

FLUID PROPERTIES RECAP					
		Drilling start	Range		Drilling End
MW (min)	pcf	106	103	106.0	103.0
Funnel Viscosity	sec/qt	49	49	56	56
PV	cps	42	40	42	40
YP	lb/100sq.ft	14	13	14	14
API Fluid loss	cc	2.9	2.6	2.9	2.6
pH		9.5	9.5	9.6	9.6
Solid	%	32	32	32	32
Cl (NaCl)	mg/L	170,000	170,000	185,000	180,000
Total Hardness	mg/L	2,000	2,160	2,160	2,160
Ca Hardness	mg/L	1,800	1,800	1,960	1,960

Figure 10-1: AZNS-122 Fluid Properties Table

10.3 Material Consumption Analysis

Products	Units Used	Unit wt lbs	Total wt		Effective Concentration	
Caustic Soda	24	55	1,320	lbs	0.18	ppb
Hematite	142	3,300	468,600	lbs	64.67	ppb
Limestone	814	2,200	1,790,800	lbs	247.14	ppb
Pipe Lax	2	55	110	gal	0.02	gpb
Bentonite	1	2,200	2,200	lbs	0.30	ppb
Citric acid	19	55	1,045	lbs	0.14	ppb
KCL	1	2,200	2,200	lbs	22.00	ppb
Starch LV	999	55	54,945	lbs	7.58	ppb
Sodium Bicarb	9	55	495	lbs	0.07	ppb
Xantan gum	45	55	2,475	lbs	0.34	ppb
Salt (NACL)	236	2,200	519,200	lbs	71.65	ppb
Soda Ash	52	55	2,860	lbs	0.39	ppb
Lime	331	55	18,205	lbs	2.51	ppb

Initial Volume	0.0	bbl
Total Volume Built	7,246.0	bbl
Volume received	0.0	bbl
Volume Returned	432.0	bbl
Total Volume Consumed	5,398	bbl
Volume Transfer to Next Section	1,416.0	bbl
Meter Drilled	260.0	m

Figure 10-2: AZNS-122 Material Consumption Analysis Table

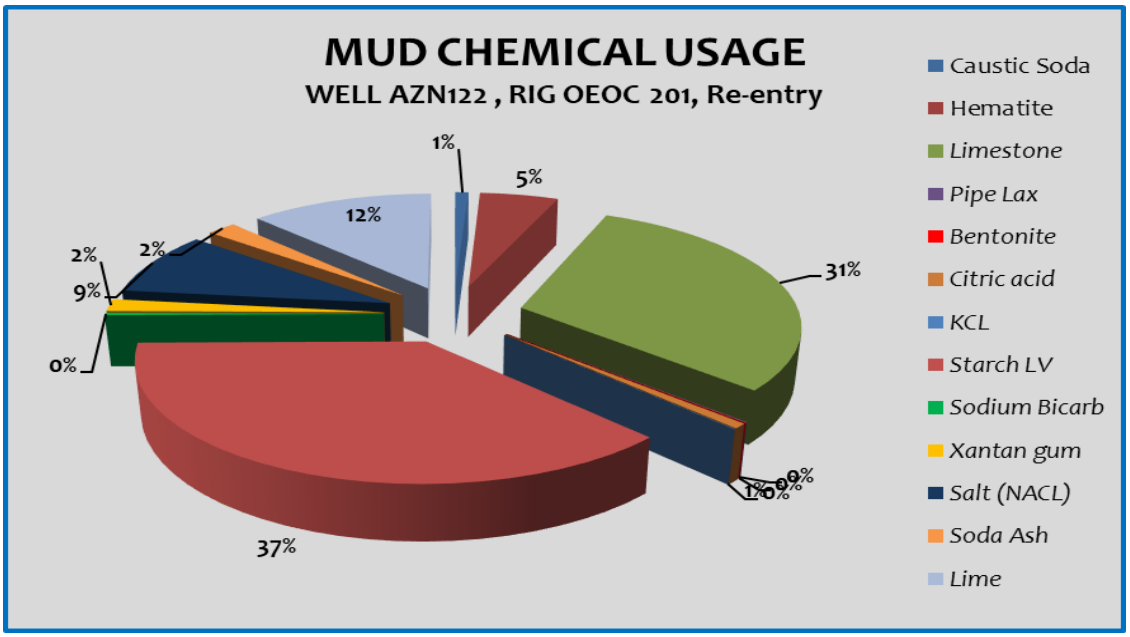


Figure 10-3: AZNS-122 Mud Chemical Usage

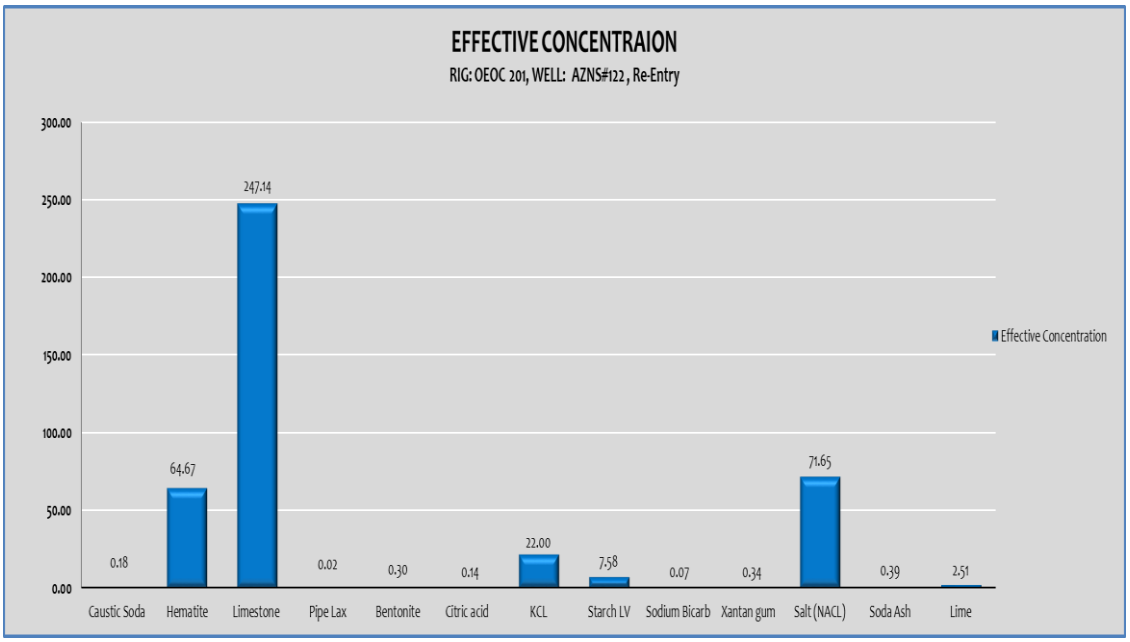


Figure 10-4: AZNS-122 Effective Concentration

10.4 Volume Analysis

RIG: OEOC 201, WELL: AZNS#122 , Re-Entry VOLUME ANALYSIS		
Initial Volume	bbls	0.0
Received Volume	bbls	0.0
Volume Return	bbls	432.0
Volume Built	bbls	7,246.0
Surface Losses/Dumped	bbls	5,134.0
Formation Losses	bbls	264.0
Total Losses	bbls	5,398.0
Volume Transfer Out	bbls	1,416

Figure 10-5: AZNS-122 Volume Analysis Table

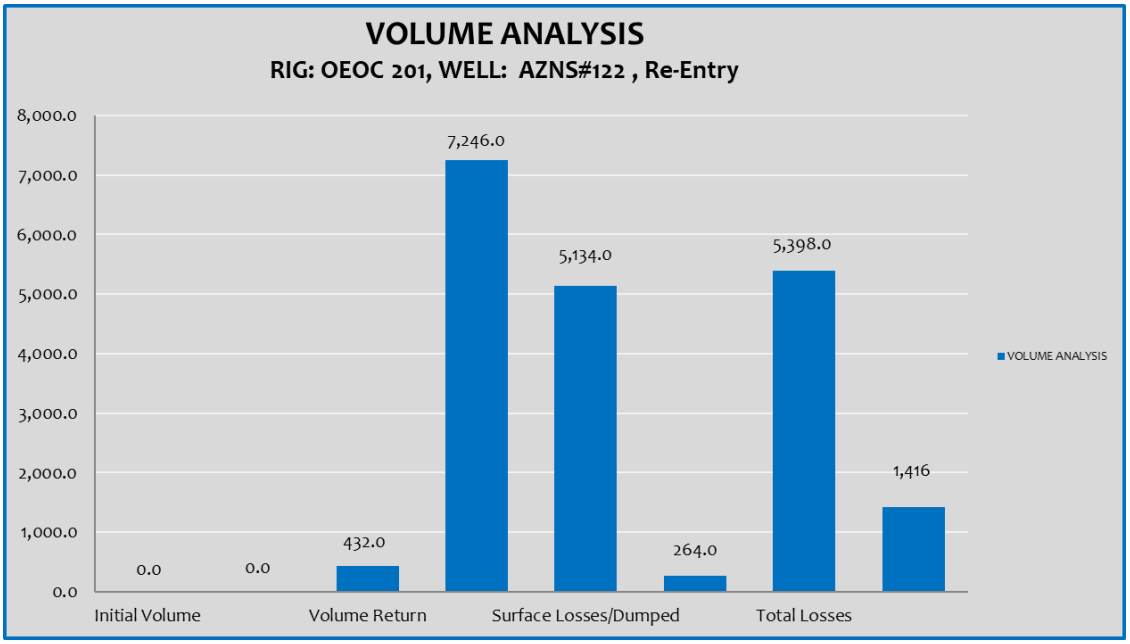


Figure 10-6: AZNS-122 Volume Analysis Chart

10.5 Daily volume Breakdown

Date/DMR.N		Volume of Built	Surface Losses	Formation Losses
25-Oct-24	1	171.4	0	0
26-Oct-24	2	505.1	0	0
27-Oct-24	3	504.9	0	0
28-Oct-24	4	154.2	60	0
29-Oct-24	5	2.3	18	0
30-Oct-24	6	0.0	51	0
31-Oct-24	7	0.0	14	0
1-Nov-24	8	0.1	0	0
2-Nov-24	9	178.8	16	0
3-Nov-24	10	200.7	100	0
4-Nov-24	11	142.9	118	0
5-Nov-24	12	36.0	9	0
6-Nov-24	13	2.2	8	0
7-Nov-24	14	7.7	0	0
8-Nov-24	15	0.2	40	0
9-Nov-24	16	0.0	30	0
10-Nov-24	17	6.7	10	0
11-Nov-24	18	70.2	41	0
12-Nov-24	19	4.8	26	0
13-Nov-24	20	1.3	24	0
14-Nov-24	21	18.0	46	0
15-Nov-24	22	0.1	8	0
16-Nov-24	23	0.3	31	0
17-Nov-24	24	2.2	45	0
18-Nov-24	25	170.6	36	0
19-Nov-24	26	40.4	8	0
20-Nov-24	27	70.4	16	0
21-Nov-24	28	0.1	11	0
22-Nov-24	29	1.4	0	0
23-Nov-24	30	16.8	0	0
24-Nov-24	31	130.3	4	0
25-Nov-24	32	167.5	42	0
26-Nov-24	33	163.8	74	0
27-Nov-24	34	11.6	0	0
28-Nov-24	35	0.0	4	0
29-Nov-24	36	147.1	25	0
30-Nov-24	37	0.0	9	0

1-Dec-24	38	117.0	102	0
2-Dec-24	39	416.9	312	0
3-Dec-24	40	0.0	215	0
4-Dec-24	41	1.7	25	0
5-Dec-24	42	0.0	5	0
6-Dec-24	43	0.0	0	0
7-Dec-24	44	6.9	132	0
8-Dec-24	45	207.5	40	0
9-Dec-24	46	0.5	20	0
10-Dec-24	47	0.0	366	0
11-Dec-24	48	24.6	31	0
12-Dec-24	49	0.4	90	0
13-Dec-24	50	0.0	110	0
14-Dec-24	51	314.6	40	0
15-Dec-24	52	2.2	65	0
16-Dec-24	53	0.0	100	0
17-Dec-24	54	130.8	10	0
18-Dec-24	55	176.7	0	0
19-Dec-24	56	2.9	15	0
20-Dec-24	57	115.7	0	0
21-Dec-24	58	0.8	0	0
22-Dec-24	59	2.6	0	26
23-Dec-24	60	1.1	26	26
24-Dec-24	61	0.3	105	30
25-Dec-24	62	0.0	36	0
26-Dec-24	63	123.6	10	26
27-Dec-24	64	114.9	62	24
28-Dec-24	65	0.0	34	24
29-Dec-24	66	47.3	50	24
30-Dec-24	67	0.0	0	24
31-Dec-24	68	0.0	15	24
1-Jan-25	69	97.8	0	24
2-Jan-25	70	33.4	20	0
3-Jan-25	71	0.0	45	0
4-Jan-25	72	0.1	23	12
5-Jan-25	73	0.0	5	0
6-Jan-25	74	169.2	25	0
7-Jan-25	75	200.2	30	0
8-Jan-25	76	253.6	420	0
9-Jan-25	77	434.4	280	0
10-Jan-25	78	205.8	162	0
11-Jan-25	79	0.6	80	0
12-Jan-25	80	86.6	10	0

13-Jan-25	81	2.2	39	0
14-Jan-25	82	0.5	140	0
15-Jan-25	83	0.0	15	0
16-Jan-25	84	0.3	65	0
17-Jan-25	85	0.6	15	0
18-Jan-25	86	1.0	152	0
19-Jan-25	87	100.4	64	0
20-Jan-25	88	0.0	0	0
21-Jan-25	89	0.0	0	0
22-Jan-25	90	96.2	0	0
23-Jan-25	91	0.0	60	0
24-Jan-25	92	0.0	0	0
25-Jan-25	93	0.0	0	0
26-Jan-25	94	0.0	11	0
27-Jan-25	95	0.0	0	0
28-Jan-25	96	0.0	0	0
29-Jan-25	97	0.0	13	0
30-Jan-25	98	0.0	30	0
31-Jan-25	99	0.0	100	0
1-Feb-25	100	343.6	259	0
2-Feb-25	101	450.6	20	0
3-Feb-25	102	0.4	0	0
4-Feb-25	103	0.1	0	0
5-Feb-25	104	0.2	25	0
6-Feb-25	105	0.2	0	0
7-Feb-25	106	0.1	16	0
8-Feb-25	107	0.2	0	0
9-Feb-25	108	0.1	0	0
10-Feb-25	109	4.9	60	0
11-Feb-25	110	13.0	10	0
12-Feb-25	111	0.1	0	0
13-Feb-25	112	10.5	0	0
Total (bbl)		Volume of Built	Surface Losses	Formation Losses
		7,246	5,134	264

Figure 10-7: AZNS-122 Daily Volume Break Down Table

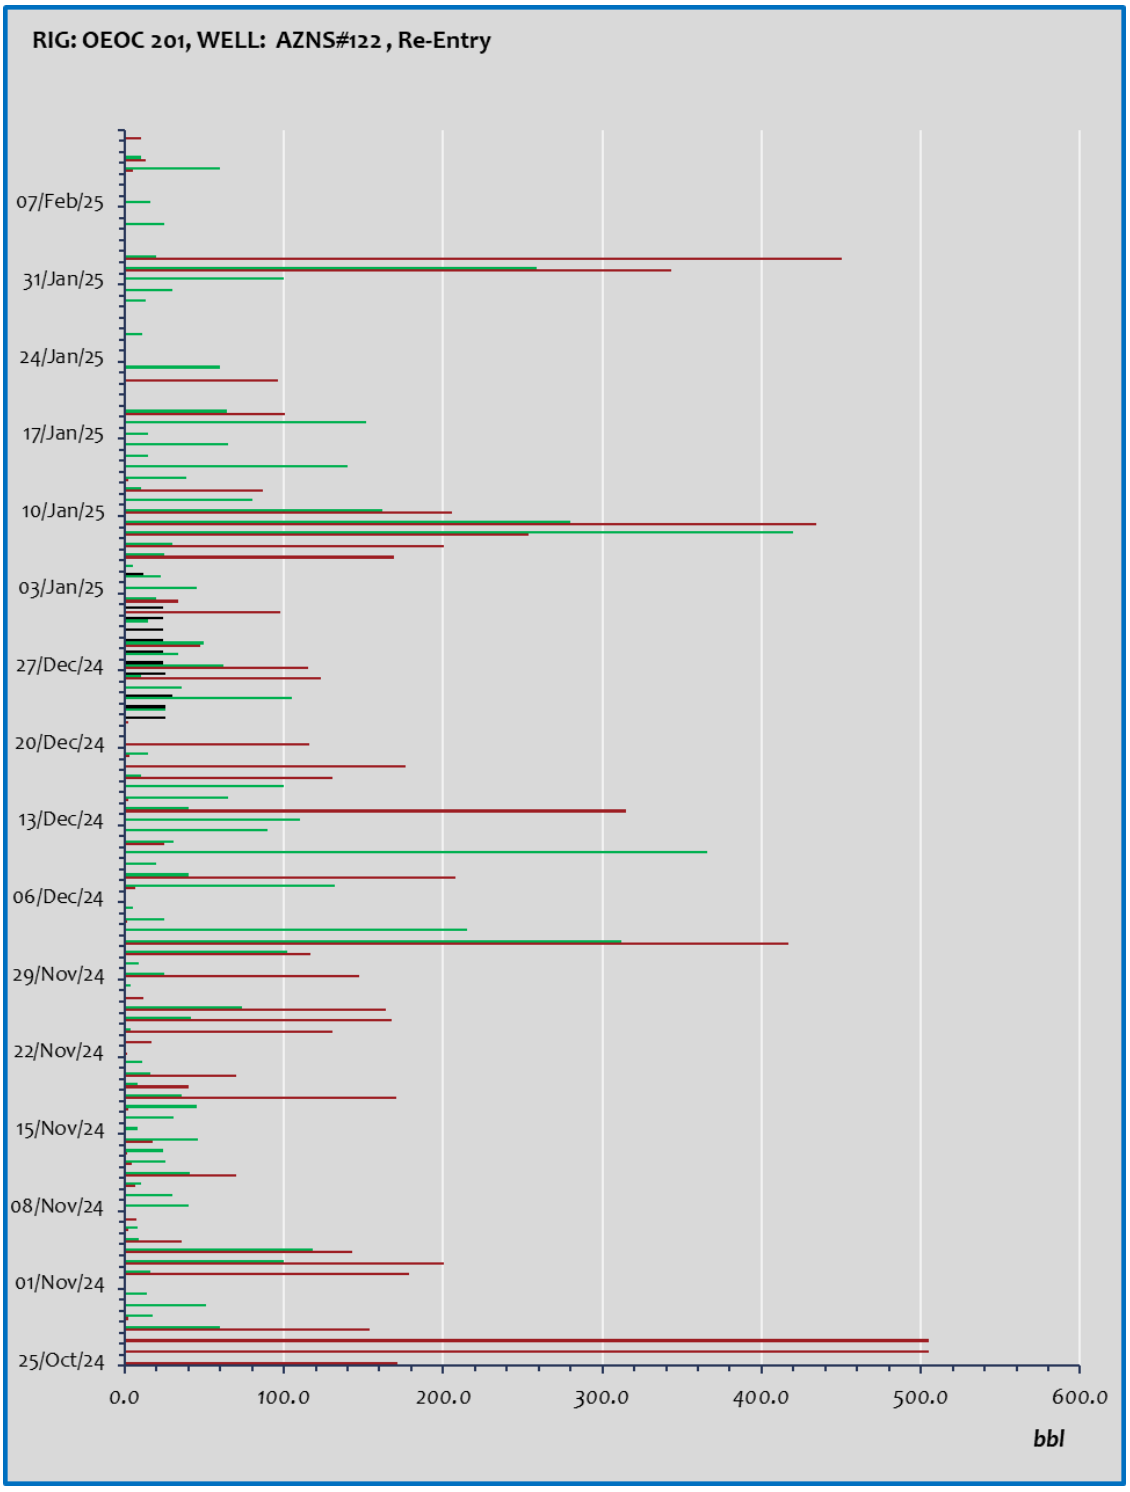


Figure 10-8: AZNS-122 Daily Volume Break Down Chart

10.6 Loss Distribution

Date/DMR.N		Volume of Built	Dump/Contamination	Shakers	Evaporation	Centrifuge	Trip	Mud cleaner	Pit Cleaning	Formation	Other
25-Oct-24	1	171.4	0	0	0	0	0	0	0	0	0
26-Oct-24	2	505.1	0	0	0	0	0	0	0	0	0
27-Oct-24	3	504.9	0	0	0	0	0	0	0	0	0
28-Oct-24	4	154.2	60	0	0	0	0	0	0	0	0
29-Oct-24	5	2.3	0	0	2	0	0	0	0	0	16
30-Oct-24	6	0	0	0	0	0	51	0	0	0	0
31-Oct-24	7	0	0	0	0	0	14	0	0	0	0
1-Nov-24	8	0.1	0	0	0	0	0	0	0	0	0
2-Nov-24	9	178.8	0	0	0	0	16	0	0	0	0
3-Nov-24	10	200.7	0	0	0	0	0	0	0	0	100
4-Nov-24	11	142.9	0	0	0	0	0	0	0	0	118
5-Nov-24	12	36.0	0	0	0	0	0	0	9	0	0
6-Nov-24	13	2.2	0	0	0	0	0	0	0	0	8
7-Nov-24	14	7.7	0	0	0	0	0	0	0	0	0
8-Nov-24	15	0.2	0	0	0	0	15	0	20	0	5
9-Nov-24	16	0	0	0	0	0	30	0	0	0	0
10-Nov-24	17	6.7	0	0	0	0	5	0	0	0	5
11-Nov-24	18	70.2	0	5	0	0	0	0	0	0	36
12-Nov-24	19	4.8	0	8	0	0	0	0	0	0	18
13-Nov-24	20	1.3	0	6	0	0	0	0	0	0	18
14-Nov-24	21	18.0	0	3	0	0	10	0	18	0	15
15-Nov-24	22	0.1	0	3	0	0	0	0	0	0	5
16-Nov-24	23	0.3	0	5	0	0	0	0	8	0	18
17-Nov-24	24	2.2	0	0	0	0	0	0	20	0	25
18-Nov-24	25	170.6	0	5	0	0	0	0	15	0	16
19-Nov-24	26	40.4	0	0	0	0	0	0	0	0	8
20-Nov-24	27	70.4	0	4	0	0	0	0	12	0	0
21-Nov-24	28	0.1	0	3	0	0	0	0	0	0	8
22-Nov-24	29	1.4	0	0	0	0	0	0	0	0	0
23-Nov-24	30	16.8	0	0	0	0	0	0	0	0	0
24-Nov-24	31	130.3	0	4	0	0	0	0	0	0	0
25-Nov-24	32	167.5	0	3	0	0	0	0	39	0	0
26-Nov-24	33	163.8	0	2	0	0	52	0	0	0	20
27-Nov-24	34	11.6	0	0	0	0	0	0	0	0	0
28-Nov-24	35	0.0	0	4	0	0	0	0	0	0	0
29-Nov-24	36	147.1	0	0	0	0	20	0	0	0	5
30-Nov-24	37	0	0	4	0	0	0	0	0	0	5

1-Dec-24	38	117.0	0	18	0	0	19	0	30	0	35
2-Dec-24	39	416.9	307	0	0	0	0	0	0	0	5
3-Dec-24	40	0.0	170	0	0	0	20	0	0	0	25
4-Dec-24	41	1.7	0	0	0	0	25	0	0	0	0
5-Dec-24	42	0	0	0	0	0	5	0	0	0	0
6-Dec-24	43	0	0	0	0	0	0	0	0	0	0
7-Dec-24	44	6.9	0	0	0	0	62	0	0	0	70
8-Dec-24	45	207.5	0	0	0	0	30	0	0	0	10
9-Dec-24	46	0.5	0	0	0	0	20	0	0	0	0
10-Dec-24	47	0.0	356	0	0	0	0	0	0	0	10
11-Dec-24	48	24.6	0	6	0	0	0	0	0	0	25
12-Dec-24	49	0.4	0	0	0	0	35	0	25	0	30
13-Dec-24	50	0.0	50	0	0	0	40	0	0	0	20
14-Dec-24	51	314.6	0	0	0	0	0	0	0	0	40
15-Dec-24	52	2.2	0	20	0	0	0	0	0	0	45
16-Dec-24	53	0.0	0	0	0	0	85	0	0	0	15
17-Dec-24	54	130.8	0	0	0	0	10	0	0	0	0
18-Dec-24	55	176.7	0	0	0	0	0	0	0	0	0
19-Dec-24	56	2.9	0	15	0	0	0	0	0	0	0
20-Dec-24	57	115.7	0	0	0	0	0	0	0	0	0
21-Dec-24	58	0.8	0	0	0	0	0	0	0	0	0
22-Dec-24	59	2.6	0	0	0	0	0	0	0	26	0
23-Dec-24	60	1.1	0	0	0	0	26	0	0	26	0
24-Dec-24	61	0.3	0	30	0	0	60	0	0	30	15
25-Dec-24	62	0	0	0	0	0	36	0	0	0	0
26-Dec-24	63	123.6	0	0	0	0	10	0	0	26	0
27-Dec-24	64	114.9	0	0	0	0	62	0	0	24	0
28-Dec-24	65	0.0	0	0	0	0	34	0	0	24	0
29-Dec-24	66	47.3	0	0	0	0	50	0	0	24	0
30-Dec-24	67	0	0	0	0	0	0	0	0	24	0
31-Dec-24	68	0	0	0	0	0	15	0	0	24	0
1-Jan-25	69	97.8	0	0	0	0	0	0	0	24	0
2-Jan-25	70	33.4	0	0	0	0	20	0	0	0	0
3-Jan-25	71	0	0	0	0	0	45	0	0	0	0
4-Jan-25	72	0.1	0	0	0	0	23	0	0	12	0
5-Jan-25	73	0	0	0	0	0	5	0	0	0	0
6-Jan-25	74	169.2	0	0	0	0	5	0	0	0	20
7-Jan-25	75	200.2	0	0	0	0	30	0	0	0	0
8-Jan-25	76	253.6	420	0	0	0	0	0	0	0	0
9-Jan-25	77	434.4	220	0	0	0	0	0	0	0	60
10-Jan-25	78	205.8	100	0	0	0	0	0	0	0	62
11-Jan-25	79	0.6	0	0	0	0	40	0	0	0	40
12-Jan-25	80	86.6	0	10	0	0	0	0	0	0	0

13-Jan-25	81	2.2	0	24	0	0	0	0	0	0	15
14-Jan-25	82	0.5	0	30	0	0	85	0	0	0	25
15-Jan-25	83	0	0	0	0	0	15	0	0	0	0
16-Jan-25	84	0.3	0	10	0	0	40	0	15	0	0
17-Jan-25	85	0.6	0	0	0	0	15	0	0	0	0
18-Jan-25	86	1.0	0	0	0	0	15	0	137	0	0
19-Jan-25	87	100.4	0	0	0	0	10	0	0	0	54
20-Jan-25	88	0	0	0	0	0	0	0	0	0	0
21-Jan-25	89	0	0	0	0	0	0	0	0	0	0
22-Jan-25	90	96.2	0	0	0	0	0	0	0	0	0
23-Jan-25	91	0.0	0	0	0	0	40	0	0	0	20
24-Jan-25	92	0.0	0	0	0	0	0	0	0	0	0
25-Jan-25	93	0	0	0	0	0	0	0	0	0	0
26-Jan-25	94	0	0	0	0	0	0	0	11	0	0
27-Jan-25	95	0	0	0	0	0	0	0	0	0	0
28-Jan-25	96	0	0	0	0	0	0	0	0	0	0
29-Jan-25	97	0	0	0	0	0	0	0	13	0	0
30-Jan-25	98	0	0	0	0	0	20	0	0	0	10
31-Jan-25	99	0	0	0	0	0	100	0	0	0	0
1-Feb-25	100	343.6	259	0	0	0	0	0	0	0	0
2-Feb-25	101	450.6	0	0	0	0	0	0	0	0	20
3-Feb-25	102	0.4	0	0	0	0	0	0	0	0	0
4-Feb-25	103	0.1	0	0	0	0	0	0	0	0	0
5-Feb-25	104	0.2	0	0	0	0	0	0	0	0	25
6-Feb-25	105	0.2	0	0	0	0	0	0	0	0	0
7-Feb-25	106	0.1	0	10	6	0	0	0	0	0	0
8-Feb-25	107	0.2	0	0	0	0	0	0	0	0	0
9-Feb-25	108	0.1	0	0	0	0	0	0	0	0	0
10-Feb-25	109	4.9	0	10	0	0	0	0	0	0	50
11-Feb-25	110	13.0	0	10	0	0	0	0	0	0	0
12-Feb-25	111	0.1	0	0	0	0	0	0	0	0	0
13-Feb-25	112	10.5	0	0	0	0	0	0	0	0	0

Total (bbl)	Volume of Built	Dump/Contaminate	Shakers	Evaporation	Centrifuge	Trip	Mud cleaner	Pit Cleaning	Formation	Other
	7,246.0	1,942	252	8	0	1,365	0	372	264	1195.0

Figure 10-9: AZNS-122 Loss Distribution

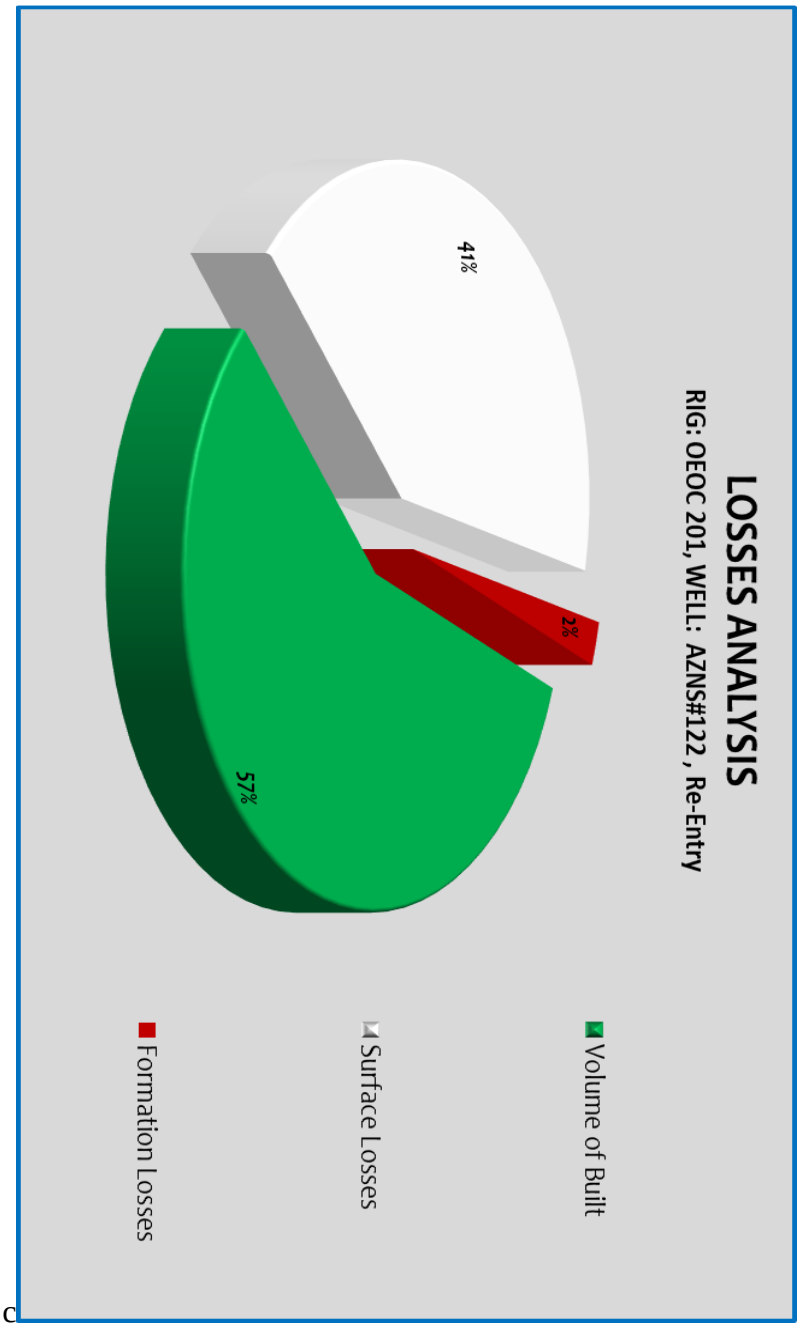


Figure 10-10: AZNS-122 Loss Analysis

10.7 Interval Fluid Properties Recap

Date	DEPTH	Density	VIS	PV	YP	Water Loss	pH	Solid %	Chloride	Calcium	Total Hardness	Mud Type
25-Oct-24	4208	101	55	27	16	N.C	8.5		180000	600	720	SALT/POL MUD
26-Oct-24	4208	101	45	27	14	N.C	9.4		180000	600	720	SALT/POL MUD
27-Oct-24	4208	101	45	27	14	N.C	9.5		180000	600	720	SALT/POL MUD
28-Oct-24	4208	101	45	27	14	N.C	9.5	26	180000	600	720	SALT/POL MUD
29-Oct-24	4208	101	45	27	14	N.C	9.5	26	180000	600	720	SALT/POL MUD
30-Oct-24	4208	101	45	27	14	N.C	9.5	26	180000	600	720	SALT/POL MUD
31-Oct-24	4208	101	45	27	14	N.C	9.5	26	180000	600	720	SALT/POL MUD
1-Nov-24	4208	101	45	27	14	N.C	9.5	26	180000	600	720	SALT/POL MUD
2-Nov-24	4208	101	45	27	14	N.C	9.6	26	180000	600	720	SALT/POL MUD
3-Nov-24	4208	106	49	30	15	N.C	9.5	26	180000	600	720	SALT/POL MUD
4-Nov-24	4208	106	48	30	15	N.C	9.5	29	180000	600	720	SALT/POL MUD
5-Nov-24	4208	106	48	31	17	N.C	9.5	29	180000	720	840	SALT/POL MUD
6-Nov-24	4208	106	48	32	17	N.C	9.6	29	180000	720	840	SALT/POL MUD
7-Nov-24	4208	106	48	32	17	N.C	9.6	29	180000	720	840	SALT/POL MUD
8-Nov-24	4208	106	48	32	17	N.C	9.5	29	180000	720	840	SALT/POL MUD
9-Nov-24	4208	106	48	32	17	N.C	9.5	29	180000	720	840	SALT/POL MUD
10-Nov-24	4208	106	48	32	17	N.C	9.5	29	180000	720	840	SALT/POL MUD
11-Nov-24	4208	106	48	32	17	N.C	9.6	29	180000	720	840	SALT/POL MUD
12-Nov-24	4208	106	48	32	17	N.C	9.6	29	180000	720	840	SALT/POL MUD
13-Nov-24	4208	106	48	32	17	N.C	9.5	29	180000	720	840	SALT/POL MUD
14-Nov-24	4208	106	48	32	17	N.C	9.6	29	180000	720	840	SALT/POL MUD
15-Nov-24	4208	106	48	32	17	N.C	9.5	29	180000	720	840	SALT/POL MUD
16-Nov-24	4208	106	48	32	17	N.C	9.5	29	180000	720	840	SALT/POL MUD
17-Nov-24	4208	106	50	34	19	N.C	9.5	29	180000	720	840	SALT/POL MUD
18-Nov-24	4208	106	52	37	21	N.C	9.5	29	180000	760	880	SALT/POL MUD
19-Nov-24	4208	106	51	35	19	N.C	9.4	29	180000	760	880	SALT/POL MUD
20-Nov-24	4208	106	51	35	19	N.C	9.4	29	175000	880	1040	SALT/POL MUD
21-Nov-24	4208	106	51	35	19	N.C	9.4	29	175000	880	1040	SALT/POL MUD
22-Nov-24	4208	106	51	35	19	N.C	9.5	29	175000	880	1040	SALT/POL MUD
23-Nov-24	4208	106	51	35	19	N.C	9.4	29	175000	880	1040	SALT/POL MUD
24-Nov-24	4208	106	52	35	19	N.C	9.4	29	175000	880	1040	SALT/POL MUD
25-Nov-24	4208	106	53	35	19	N.C	9.3	29	175000	880	1040	SALT/POL MUD
26-Nov-24	4208	106	53	35	19	N.C	9.1	29	175000	880	1040	SALT/POL MUD
27-Nov-24	4208	106	53	35	19	N.C	9	29	175000	880	1040	SALT/POL MUD
28-Nov-24	4208	106	53	35	19	N.C	9	29	175000	880	1040	SALT/POL MUD
29-Nov-24	4208	106	53	35	19	N.C	9	29	175000	880	1040	SALT/POL MUD
30-Nov-24	4208	106	54	38	21	N.C	10.6	30	175000	1080	1200	SALT/POL MUD

1-Dec-24	3939	106	42	27	10	N.C	11	29	175000	1160	1240	SALT/POL MUD
2-Dec-24	3945	106	42	27	10	N.C	11	29	175000	1160	1240	SALT/POL MUD
3-Dec-24	3945	106	45	30	14	10	9.5	26	170000	1800	2000	SALT/POL MUD
4-Dec-24	3945	106	47	30	14	10	9.5	29	170000	1800	2000	SALT/POL MUD
5-Dec-24	3945	106	47	30	14	10	9.5	29	170000	1800	2000	SALT/POL MUD
6-Dec-24	3945	106	47	30	14	10	9.5	29	170000	1800	2000	SALT/POL MUD
7-Dec-24	3945	106	47	30	14	10	9.5	29	170000	1800	2000	SALT/POL MUD
8-Dec-24	3945	106	47	30	14	10	9.5	29	170000	1800	2000	SALT/POL MUD
9-Dec-24	3945	106	47	30	14	10	9.5	29	170000	1800	2000	SALT/POL MUD
10-Dec-24	3945	106	47	30	14	10	9.5	29	170000	1800	2000	SALT/POL MUD
11-Dec-24	3945	106	47	30	14	10	9.5	29	170000	1800	2000	SALT/POL MUD
12-Dec-24	3945	106	47	30	14	10	9.5	29	170000	1800	2000	SALT/POL MUD
13-Dec-24	3945	106	47	30	14	10	9.5	29	170000	1800	2000	SALT/POL MUD
14-Dec-24	3945	106	47	30	14	10	9.5	29	170000	1800	2000	SALT/POL MUD
15-Dec-24	3945	106	47	38	14	7	9.5	32	170000	1800	2000	SALT/POL MUD
16-Dec-24	3966	106	49	42	14	2.9	9.5	32	170000	1800	2000	SALT/POL MUD
17-Dec-24	3966	106	49	42	14	2.9	9.5	32	170000	1800	2000	SALT/POL MUD
18-Dec-24	3988	105	52	40	14	2.9	9.5	32	170000	1800	2000	SALT/POL MUD
19-Dec-24	3988	103	51	40	13	2.9	9.5	32	170000	1800	2000	SALT/POL MUD
20-Dec-24	3988	103	56	41	13	2.8	9.5	32	185000	1880	2120	SALT/POL MUD
21-Dec-24	4125	103	56	41	13	2.8	9.5	32	185000	1880	2120	SALT/POL MUD
22-Dec-24	4177	103	56	40	14	2.6	9.6	32	180000	1960	2160	SALT/POL MUD
23-Dec-24	4208	103	56	40	14	2.6	9.6	32	180000	1960	2160	SALT/POL MUD
24-Dec-24	4208	103	56	40	14	2.6	9.6	32	180000	1960	2160	SALT/POL MUD
25-Dec-24	4208	103	56	40	14	2.6	9.6	32	180000	1960	2160	SALT/POL MUD
26-Dec-24	4208	103	56	40	14	2.6	9.6	32	180000	1960	2160	SALT/POL MUD
27-Dec-24	4208	103	56	40	14	2.6	9.6	32	180000	1960	2160	SALT/POL MUD
28-Dec-24	4208	103	56	40	14	2.6	9.6	32	180000	1960	2160	SALT/POL MUD
29-Dec-24	4208	103	56	40	14	2.6	9.6	32	180000	1960	2160	SALT/POL MUD
30-Dec-24	4208	103	56	40	14	2.6	9.6	32	180000	1960	2160	SALT/POL MUD
31-Dec-24	4208	103	56	40	14	2.6	9.6	32	180000	1960	2160	SALT/POL MUD
1-Jan-25	4208	103	56	40	14	2.6	9.6	32	180000	1960	2160	SALT/POL MUD
2-Jan-25	4208	103	59	42	15	2.8	9.5	32	180000	1960	2160	SALT/POL MUD
3-Jan-25	4208	103	59	42	15	2.8	9.5	32	180000	1960	2160	SALT/POL MUD
4-Jan-25	4208	103	59	42	15	2.8	9.5	32	180000	1960	2160	SALT/POL MUD
5-Jan-25	4208	103	59	42	15	2.8	9.5	32	180000	1960	2160	SALT/POL MUD
6-Jan-25	4208	103	59	42	15	2.9	9.5	24	175000	1960	2160	SALT/POL MUD
7-Jan-25	4208	103	59	42	15	2.9	9.5	24	175000	1960	2160	SALT/POL MUD
8-Jan-25	4208	112	68	47	17	2.8	9.5	29	175000	1960	2160	SALT/POL MUD
9-Jan-25	4208	108	88	57	25	2.8	9.5	27	175000	1960	2120	SALT/POL MUD

10-Jan-25	4208	110	89	58	26	2.9	9.5	28	175000	1960	2120	SALT/POL MUD
11-Jan-25	4208	110	64	51	20	2.8	9.5	28	175000	1960	2120	SALT/POL MUD
12-Jan-25	4208	105	59	41	12	2.8	9.5	24	175000	1960	2120	SALT/POL MUD
13-Jan-25	4208	105	59	41	12	2.8	9.5	24	175000	1960	2120	SALT/POL MUD
14-Jan-25	4208	105	61	41	13	2.8	9.5	24	175000	1960	2120	SALT/POL MUD
15-Jan-25	4208	105	59	41	12	2.8	9.5	24	175000	1960	2120	SALT/POL MUD
16-Jan-25	4208	105	59	41	12	2.8	9.5	24	175000	1960	2120	SALT/POL MUD
17-Jan-25	4208	105	62	43	13	N.C	10	24	175000	2400	2640	SALT/POL MUD
18-Jan-25	4208	105	62	43	13	N.C	10	24	175000	2400	2640	SALT/POL MUD
19-Jan-25	4208	105	62	38	18	N.C	10	24	175000	2400	2640	SALT/POL MUD
20-Jan-25	4208	103	54	40	14	N.C	9.5	24	175000	2400	2640	SALT/POL MUD
21-Jan-25	4208	103	51	22	17	N.C	11.2	24	175000	3400	3680	SALT/POL MUD
22-Jan-25	4208	103	51	22	17	N.C	11.3	24	175000	3400	3680	SALT/POL MUD
23-Jan-25	4208	103	51	22	17	N.C	11.3	24	175000	3400	3680	SALT/POL MUD
24-Jan-25	4208	103	51	22	17	N.C	11.3	24	175000	3400	3680	SALT/POL MUD
25-Jan-25	4208	103	47	22	17	N.C	11.3	24	175000	3400	3680	SALT/POL MUD
26-Jan-25	4208	103	47	22	17	N.C	11.3	24	175000	3400	3680	SALT/POL MUD
27-Jan-25	4208	103	47	22	17	N.C	11.3	24	175000	3400	3680	SALT/POL MUD
28-Jan-25	4208	103	47	22	17	N.C	11.3	24	175000	3400	3680	SALT/POL MUD
29-Jan-25	4208	103	47	22	17	N.C	11.3	24	175000	3400	3680	SALT/POL MUD
30-Jan-25	4208	103	57	33	15	N.C	11.1	24	175000	3400	3680	SALT/POL MUD
31-Jan-25	4208	103	47	22	10	N.C	11.1	24	175000	3400	3680	SALT/POL MUD
1-Feb-25	4208	103	47	22	10	N.C	11	24	175000	3400	3680	SALT/POL MUD
2-Feb-25	4208	105	52	24	12	N.C	9.6	24	175000	2400	2680	SALT/POL MUD
3-Feb-25	4208	105	52	32	16	N.C	9.6	24	175000	1960	2120	SALT/POL MUD
4-Feb-25	4208	105	52	32	16	N.C	9.6	24	175000	1960	2120	SALT/POL MUD
5-Feb-25	4208	105	52	32	16	N.C	9.6	24	175000	1960	2120	SALT/POL MUD
6-Feb-25	4208	105	52	32	16	N.C	9.6	24	175000	1960	2120	SALT/POL MUD
7-Feb-25	4208	105	52	32	16	N.C	9.6	24	175000	1960	2120	SALT/POL MUD
8-Feb-25	4208	105	52	32	16	N.C	9.6	24	175000	1960	2120	SALT/POL MUD
9-Feb-25	4208	105	52	32	16	N.C	9.6	24	175000	1960	2120	SALT/POL MUD
10-Feb-25	4208	105	52	32	16	N.C	9.6	24	175000	1960	2120	SALT/POL MUD
11-Feb-25	4208	105	52	32	16	N.C	9.6	24	175000	1960	2120	SALT/POL MUD
12-Feb-25	4208	105	52	32	16	N.C	9.6	24	175000	1960	2120	SALT/POL MUD
13-Feb-25	4208	105	52	32	16	N.C	9.6	24	175000	1960	2120	SALT/POL MUD
Drilling Start												
Drilling End												

Figure 10-11: AZNS-122 Fluid Properties Recap

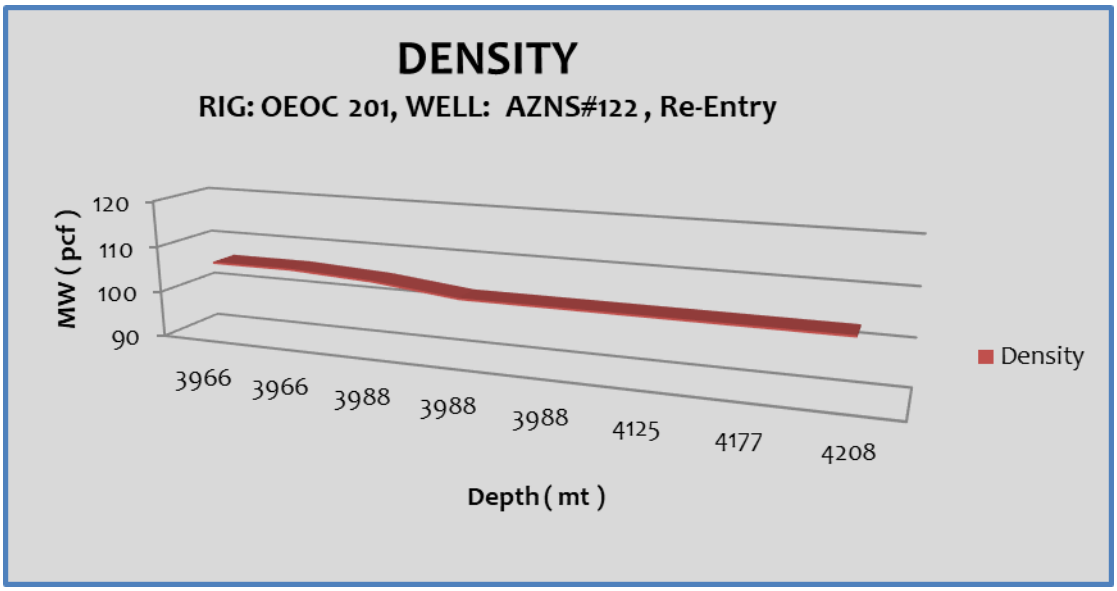


Figure 10-12: AZNS-122 Fluid Density Chart

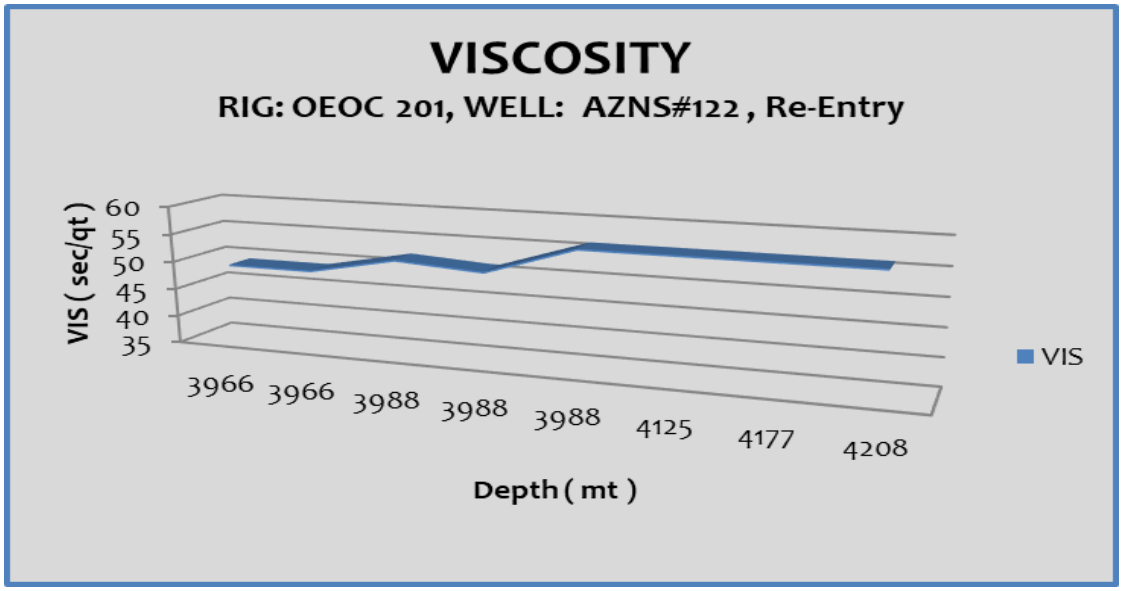


Figure 10-13: AZNS-122 Fluid Viscosity Chart

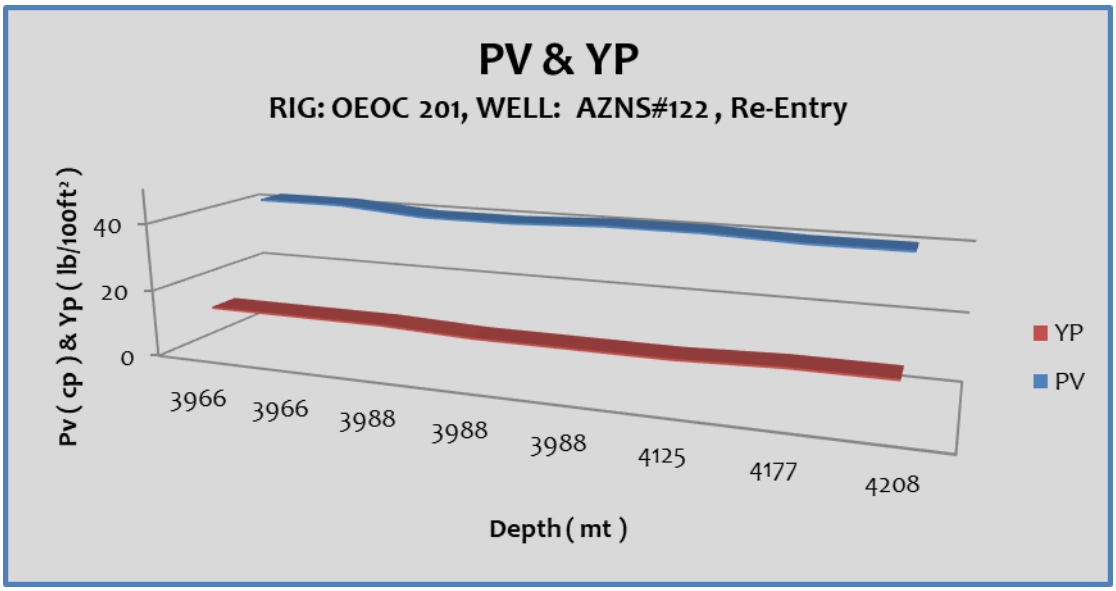


Figure 10-14: AZNS-122 Fluid PV & YP Chart

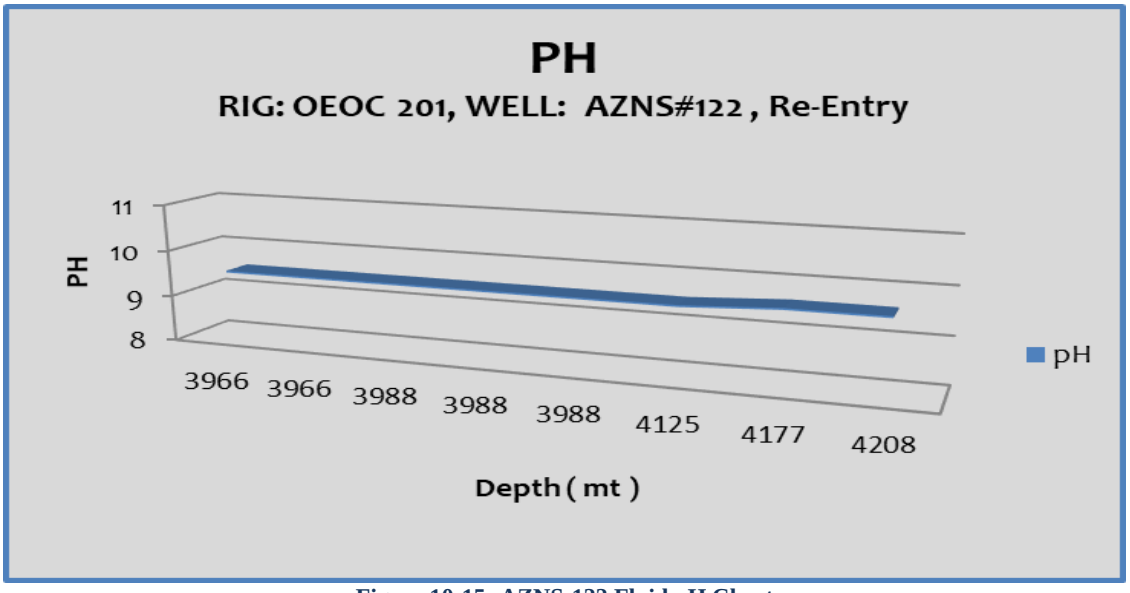


Figure 10-15: AZNS-122 Fluid pH Chart

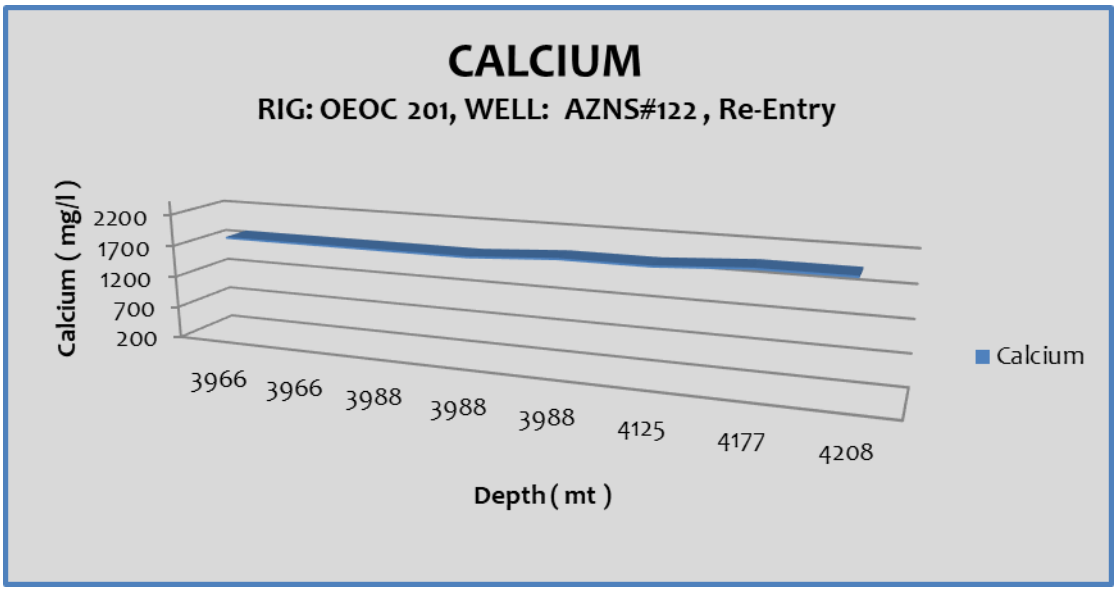


Figure 10-16: AZNS-122 Fluid Calcium Chart

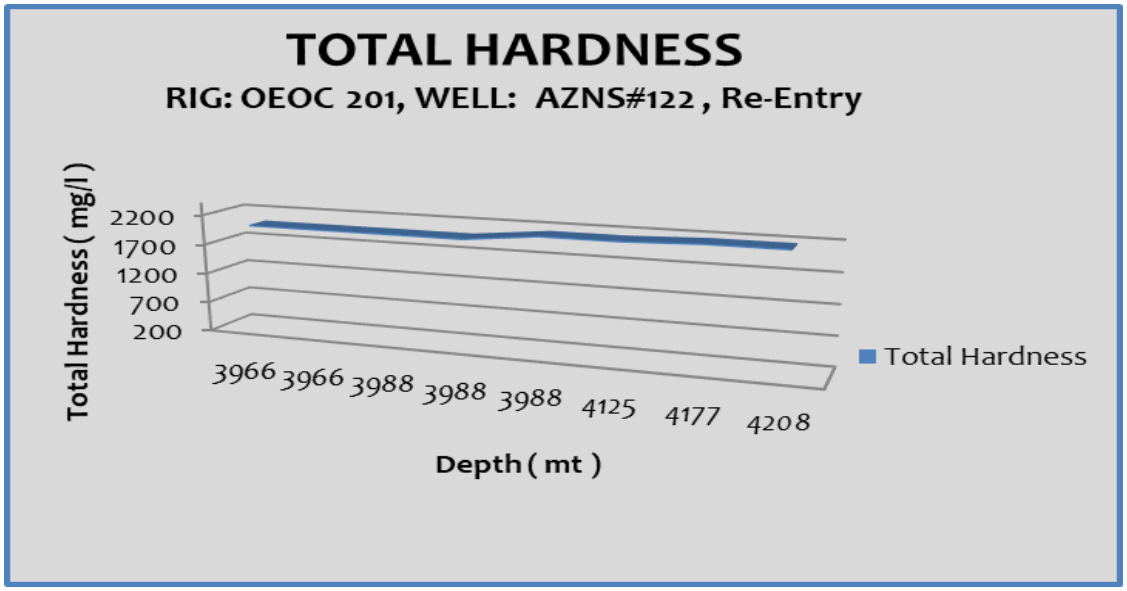


Figure 10-17: AZNS-122 Fluid Total Hardness Chart

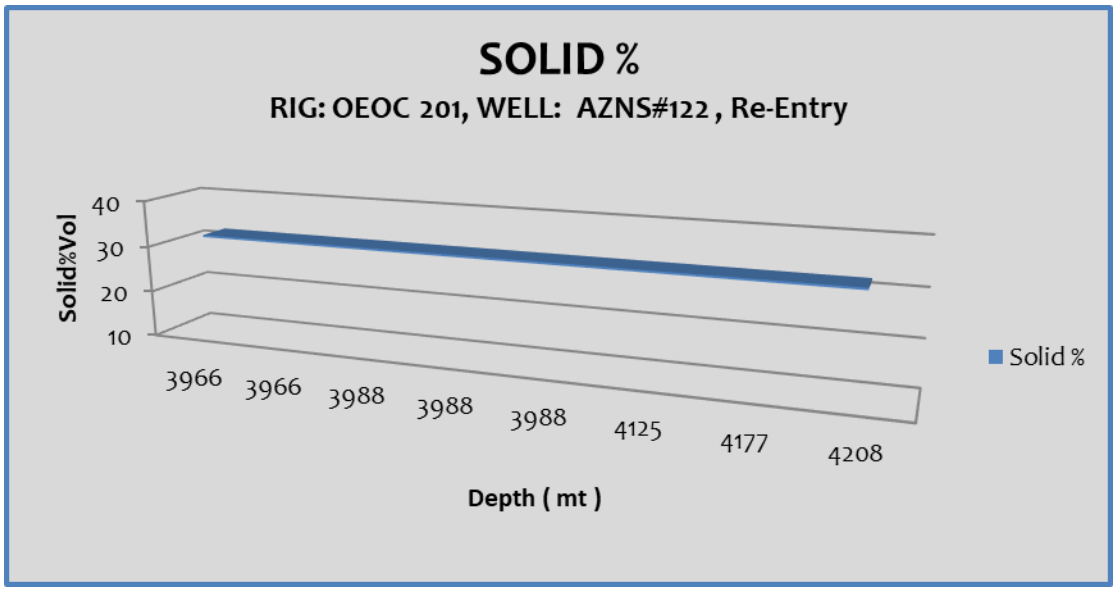


Figure 10-18: AZNS-122 Fluid Solid Chart

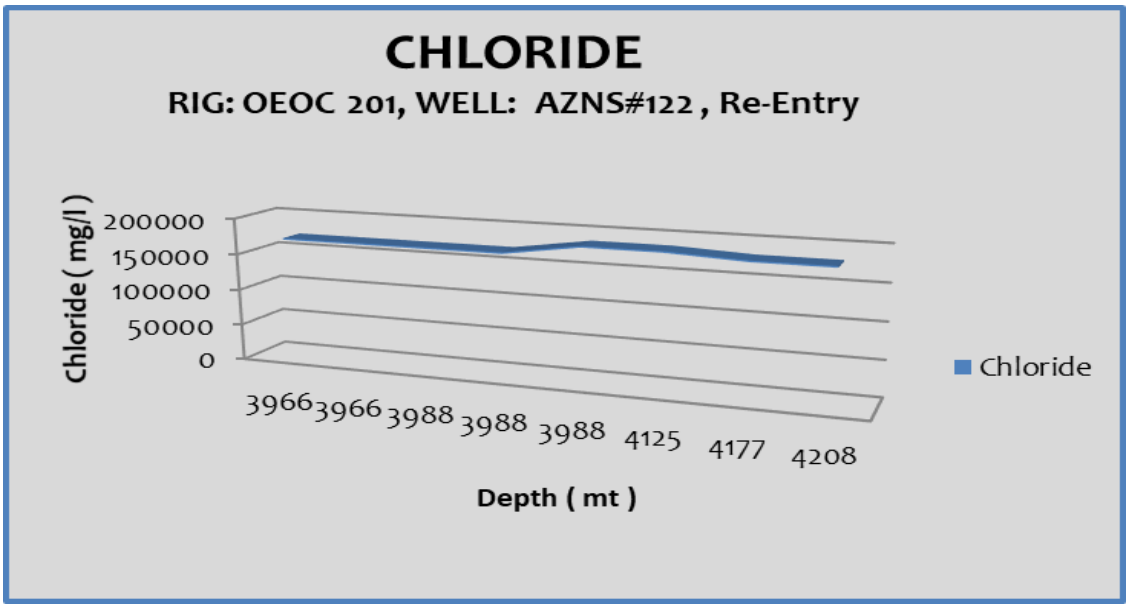


Figure 10-19: AZNS-122 Fluid Chloride Chart

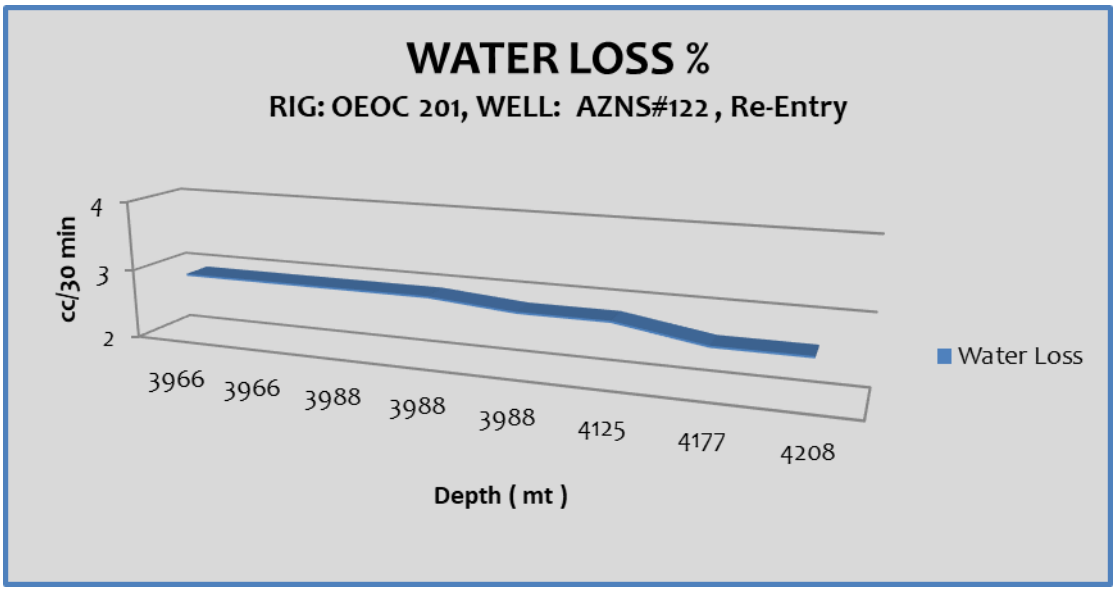


Figure 10-20: AZNS-122 Fluid Water Loss Chart

10.8 Solid Control Disscusion

Rig OEOC 208 has 3 shale shakers were dressed with:

Shaker#1: 140 Mesh Screen

Shaker#2: 140 Mesh Screen

Shaker#3: 140 Mesh Screen

RIG: OEOC 201, WELL: AZNS#122 , Re-Entry Solid Control Equipment Working Hr.s	
Derrick Shaker #1	641
Derrick Shaker #2	1303
Derrick Shaker #3	118
Derrick Mud cleaner #4	0

RIG: OEOC 201, WELL: AZNS#122 , Re-Entry Solid Control Equipment Working Hr.s	
Derrick Shaker #1	641
Derrick Shaker #2	1303
Derrick Shaker #3	118
Derrick Mud cleaner #4	0

Figure 10-21: AZNS-122 Solid Control Desscusion

10.9 Interval Completion Section

The completion fluid for this section will be CaBr2 brine treated with a scavenger, inhibitor.

Completion						
Products	Units Used	Unit wt lbs	Total wt		Effective Concentration	
700 bbls CaBr2 Completion fluid has been made						
CaBr2	700	BBL	28910	gals	41.30	gpb
Corrision Inhibitor	4	55 Gal	220	gals	0.31	gpb
O2 Scavenger	2	55 Gal	110	gals	0.16	gpb
H2S Scavenger	2	55 Gal	110	gals	0.16	gpb
Cacl2 Brine			61.4			
MW :			104.5			*pcf*
Initial Volume :			0.0			*bbl*
Total Volume Built (Completion Fluid) :			700.0			*bbl*

Figure 10-22: AZNS-122 volume & Material Consumption

11. List of Contractors

Item	Service Item	Contractor
1	Drilling Rig, Mobilization and Demobilization the Rig, Rig Move Between Well Pads	OEOC
2	Drilling Fluids and Completion Fluids	VIRA
3	Waste Management	Pars Haffaran Arvand
4	Electrical Logging and Perforation	PANIZ
5	Mud Logging	MAPSA KISH
6	Directional Drilling (MWD)	VIRA
7	H2S Monitoring and Control	MAPSA KISH BONYAN IMEN
8	Casing and Tubing Running	OEOC
9	Cementing	SPAD ENERGY & Mehran
10	Dry Test, DST and RTTS	OEOC
11	Slick Line	OEOC
12	Stimulation (Coiled Tubing and Acidizing and Nitrogen Lifting)	OEOC
13	Surface Well Testing	OEOC
14	Liner Hanger	PARS POOLAD
15	Well Head	OEOC

Table 11-1: AZNS-122 Contractors Involved

12. Appendix

12.1 DDR Summary

Item	Date	Remark
1	25 – October	Preform Press. Recording on Comp. String & Annulus, Obs. 2400psi On Comp. Strg & 0psi On Annulus, Close the Top Master Valve and Then Release the Pressure, Conn. Well Killing Stuff on T.H.S & X-Mass Tree, Press Test on Burning Line, Ok, Work on Drawworks, Stand Back 5" DPs is in progress (Totally 46Stds) @ M.N.
2	26 – October	Cont. P/U & M/U 5" & 3-1/2" DP Stds Jt by Jts and R/B in The Derrick. (Totally: 75 Stds 5" DPs, 43Stds 3-1/2" DPs)
3	27 – October	Cont. P/U & M/U 5" & 3-1/2" DP Stds Jt by Jts and R/B in The Derrick. (Totally: 75 Stds 5" DPs, 75Stds 3-1/2" DPs), Record Wellhead Press. , Both Ann. & Comp. Strg Pressure: 0psi, Check the 3SV Depth w/ 3.3" Gauge Cutter, Ok, POOH to Surface, Open 3SV, RIH w/ Protection Sleeve & Set That, POOH to Surface, RIH w/ 2.5" Gauge Cutter to Check No-Go L.Nipple Depth, Ok, POOH to Surface, RIH w/ 2.8" Gauge Cutter to Check SSD Depth, Ok, POOH to surface is in progress.
4	28 – October	Cont. POOH to Surface, RIH w/ Plug and Set in NO-GO, POOH to Surface, RIH w/ Prong and Set in Plug, POOH to surface, RIH w/ Shifting Tools and Make SSD Open, While Pressurize Comp. Strg POOH to Surface and Perform Disp. The Well w/ Mud 101pcf and Circ. Till Uniform In/Out Mud, Monitor The Well, Ok, RIH w/ GS Pulling and Retrieve Protection Sleeve, POOH to Surface, R/D Slick Line, Close 3SV, Set TWCV In TBG HGR and Perform Press. Test Against That, Ok, N/D X-Mass Tree Is In Progress @ R.T
5	29 – October	Cont. N/D X-Mass Tree and N/U BOP, Perform BOP Test, Ok, Open Tie-Downs and Press. Test, Ok, Retrieve TWCV, R/U CSG Running Eqp. , Retrieving Comp. Strg is in progress

		at M.N.
6	30 – October	Cont. Retrieving Comp. Strg While Clean TBG Body, Threads & Cross Coupling Cable Protectors, and Spool Both 3/8" CILs On Reels, , Circ. C.W.H and Monitor The Well, w/ N.L-NG. Totally 165 Jts TBG 4-1/2", 18.9#, L-80,HSM3 were retrieved Till M.N.
7	31 – October	Cont. Retrieving Comp. Strg While Clean TBG Body, Threads & Cross Coupling Cable Protectors, and Spool Both 3/8" CILs On Reels, , Circ. C.W.H and Monitor The Well, w/ N.L-NG. Totally 205 Jts TBG 4-1/2", 18.9#, L-80,HSM3 + 143 Jts 3-1/2" 10.2#, L-80,HSM3 were retrieved Till M.N.
8	01 – Nov.	Cont. Retrieving Comp. Strg While Clean TBG Body, Threads & Cross Coupling Cable Protectors, and Spool Both 3/8" CILs On Reels, , Circ. C.W.H and Monitor The Well, w/ N.L-NG. Totally 184 Jts 3-1/2" 10.2#, L-80,HSM3 + CIV NO #1 & #2 + T.JOINT + SSD + A.SEAL were retrieved, M/U & RIH W/ 8-1/2" TCI Bit To 1998m (7" L.Lap) Took Weight , Pump 30 BBL Hi.Vis Pill, Circ BTM's UP Till M.N.
9	02 – Nov.	POOH W/ 8-1/2" TCI Bit From 1998 (7" L Lap) To Surf, P/U & M/U 6" M.M.Junk Mill (5*15/32" Ports, S/N: 445, T.S.E.KH.Co) & Milling BHA To 1635m, Obs. String Plug. Work On String To Unplug , No Succ. POOH to 1270m, Check String, Obs. STD #36 Is Pluged, L/D It, Start Normal Circ. Mud, Ok. Run Back To 1635m(Same Depth). Cont RIH W/6" M.M.Junk Mill On Elavator to 1870m While Fill Up String Every 10 Std Till M.N.
10	03 – Nov.	Cont RIH W/6" M.M. J.Millto 3721m Took weight (Top of the 7" Packer), Circ. Mud to balance MWt input & output @104pcf. Start Milling The Packer F/3721 to 3721.5m, Obs. Trace of oil on the shaker & Detected H2S , Dec. Mwt to 72pcf, Close Hydrill , Cont. Circ. Through Chockmanifold to Burning line W/back pressure While Inc. Surface Sys Mwt to 106pcf Till M.N.
11	04 – Nov.	Cont Circ Mud Tll Balance MWt to 106 PCF, Cont Milling to 3722m, Obs, No Progress, POOH For Change 7" Mill To 2000

		Till M.N.
12	05 – Nov.	POOH For Change 7" Mill To Surf. Change 7" Mill , RIH With Same BHA Milling TO 3722m, Commence Miliing 7" PKR From 3722m In progress Till M.N.
13	06 – Nov.	Miliing 7" PKR From 3722 to 3722.2m, NL-NG. Try to make progress in milling operation; No Succ.
14	07 – Nov.	Milling 7" PKR From 4000 to 4000.15m, NL-NG. Try to make progress in milling operation; No Succ. POOH To 1375m.
15	08 – Nov.	POOH To Surf & L/D 6" M.M.J.Mill (100 % Used), M/U & RIH W/ 2" * 4" Taper Tap & Fishing BHA To 4000.15m. Tap in fish (10 RPM, 5klb.ft TQ). P/U string; engaged with fish and stuck @ M.N.
16	09 – Nov.	Cont Work on stuck; got free, POOH To 3778m w/ Continues 10klbs drag. Obs. Unable to pass this point. Check downward movement; Free. Work on string ; successfully Passed 3778m. Cont. POOH to 570m Till M.N.
17	10 – Nov.	Cont. POOH to Surf , Obs Fish recovered successfully, RIH w/ 6" M.M.Junk Mill To 3965m Till M.N.
18	11 – Nov.	Cont. RIH w/ 6" M.M.Junk Mill To 4008m. Held up. Push down to 4011m. Perform Milling and clean out F/ 4011m to 4077. Due to Obs. Gas cut mud and Oil Show on shaker, Circ. And uniform MW. Obs. Considerable amount of Formation sample on shaker while Circulation.
19	12 – Nov.	Cont Milling Operation From 4077m To 4091.2m While Pump Hi.Vis Pill Periodically.
20	13 – Nov.	Cont Milling Operation From 4092.10m To 4094.20m While Pump Hi.Vis Pill Periodically.
21	14 – Nov.	Cont Milling Operation From 4094.2m To 4095.8m While Pump Hi.Vis Pill Periodically, Due To String Stall And Torque Fluctuation, Dress Interval 4090m to 4095.80m

		Several Times, Pump Hi-Vis Pill and CBU Till Shakering Out The Hi-Vis Pill, POOH To 3998m, Flow Check, Well Static, Cont. POOH 6" Milling BHA F/ 3998 To 881m, While Circ. C.W.H and Monitor The Well, w/ NL-NG.
22	15 – Nov.	Cont. POOH 6" Milling BHA F/ 881m To Surface , Check The Mill Condition (100% Used), P/U & M/U New 6" Mill and RIH w/ Milling BHA and RIH To 1420m, Perform Slip & Cut Drlg Line, Resume RIH w/ 6" Milling BHA To 3900m on Elevator, While F/U Strg Every 10Stds, Conn. TDS and Cont. RIH w/ 6" Milling BHA w/ Wash Dn F/ 3900 To 4093m, Obs. Holding Up Strg Wt. @ 4093m, w/ NL-NG.
23	16 – Nov.	Work On TDS, Dress Interval 4093 to 4094.5m, POOH To 4079m, Work On TDS, RIH Back To 4093m and Cont. Dressing F/ 4093 To 4095.8m, Resume Milling and Clean out inside 7" LNR F/ 4095.8 To 4103.8m, While Pump Hi-Vis Pill and clean Ditch Magnet Periodically, NL-NG.
24	17 – Nov.	Cont. Milling and Clean out inside 7" LNR F/ 4103.8 To 4110.8m, String got Stuck @ 4109.7m, Work on Stuck and make it free, Cont. Hard Milling & Clean Out inside 7" LNR F/ 4109.7 To 4110.8m, While Obs. Strg Stall @ 4109.7m Sev. Times, Pump Hi-Vis Pill and clean Ditch Magnet Periodically, NL-NG.
25	18 – Nov.	Cont. Milling and Clean out inside 7" LNR F/ 4110.8 To 4112.8m, String got Stuck @ 4112.8m, Work on Stuck W/ Max. 10klbs.ft TQ, 150klbs Downward Wt. & 170klbs Overpull, No Success, Prepare 65bbl Hi-Vis Pill (10% Lubricant) and Circ. out till Hi-Vis reach annulus, Cont. Work on stuck W/ Max. 10klbs.ft TQ, 150klbs Downward Wt. & 170klbs Overpull, No Success.
26	19 – Nov.	Cont. Work on Strg Stuck @ 4112.8m W/ Max. 10klbs.ft TQ, 150klbs Downward Wt. & 170klbs Overpull, No Success, 15 bbl pipelax pill (5%) & Circ. Out till 1 bbl of pipelax out of mill,, Cont. Work on stuck W/ Max. 10klbs.ft TQ, 150klbs Downward Wt. & 170klbs Overpull, No Success.

27	20 – Nov.	Cont. Work on Stuck W/ Applying Max. 10 Klbs.ft TQ, 150 Klbs Downward Wt & 170 Klbs Overpull To Make Strg free, While Circ. Thru. Strg, No Success, Rec. Wire line Crew & Eqp. , R/U Wireline Eqp. is in progress.
28	21 – Nov.	R/U Wireline Eqp. , Attempt to Perform RIH w/ 2-1/8" Tool String as Dummy Run, Obs. Cable Tension Drop @ 1722.5m (X.O.S 3-1/2" × 5" Depth), POOH to surface, RIH w/ 2-1/8" Tool String as Dummy Run to 4100m, POOH to surface, RIH W/ 1-3/8" Tool String to perform FPIT, FPIT Result is as follow: 1800m, 2000m, 2500m, 3000m, 3500m, 3800m, 3900m, 3940m, 4053m, 4078m (All Free), 4088(95% Free), 4098 (95% Stuck), 4107(100% Stuck), POOH 1-3/8" Tool String to surface, R/D Wire Line Eqp. ,Cont. Work on stuck W/ Max. 80klbs Downward Wt. & 150klbs Overpull to make string free is in progress.
29	22 – Nov.	Cont. Work on stuck W/ Max. 80klbs Downward Wt. & 150klbs Overpull to make string free is in progress, Meanwhile Prepare & Mix 30PPB Citric Acid + 30bbl Water (Solution PH: 4.5) as Acid Solution and work on stuck to make it free, no success.
30	23 – Nov.	Cont. Work on stuck W/ Max. 80klbs Downward Wt. & 150klbs Overpull to make string free is in progress, no success.
31	24 – Nov.	Cont. Work on stuck W/ Max. 80klbs Downward Wt. & 150klbs Overpull to make string free is in progress, no success, Receive Explosive Material @ 19:00, Wait Day On Daylight,
32	25 – Nov.	Wait On Daylight, Disp. String Cap W/ Fresh Mud, Perform Back off Wire line Operation as follow: RIH W/ 1-11/16" Tool String as Dummy Run to 4100m, Ok, POOH to surface, Due to Cloudy and Rainy Weather,Not possible to work with explosives close to surface, Tighten up String Joints W/ Applying Right-hand Torque, RIH W/ 1-11/16" B/O Tool String to 4074m,Apply Left-hand Backoff Torque (11.5Turns, Max Tq: 9lbs.ft, Max Pull: 325klbs) Fire the Backoff shot, no

		obvious effect on String, POOH, Obs. Shooting Bar (Len: 2.2m) left in String, Perform Mechanical Back off as follow: Tighten up String Joints W/ Applying Right-hand Torque, Apply Left-hand B/O Torque W/ Parameters, Obs. Effect on String, Upward Weight (295klbs), Then POOH to 4086m while having Drag R/D Wireline Eqp. And Prepare to POOH in progress.
33	26 – Nov.	POOH 6" Milling BHA To Surface On Elevator W/ Speed Control to check Strg, Obs. String is Backed off according to planned Back-off depth 4074m and 6" M.M.J.Mill + 4-3/4" BIT SUB + 4 Jts 4-3/4" D.C left in the hole, Perform BOP Test is in progress.
34	27 – Nov.	Cont. BOP Test is in progress, Prepare for RIH w/ OEDP, SLM all Received 2-7/8" DPs, Change Handling tools, RIH w/ 22Jts 2-7/8" DPs, While Clean and Pass Rabbit Thru. Them, Change Handling Eqp. & Cont. RIH w/ 68Stds 3-1/2" DPs, While Pass Rabbit Thru. Every Std and Check all Connections, F/U String & Break Circ. Every 7Stds, Change Handling Eqp. & Cont. RIH w/ 5" DPs To 3250m, While Pass Rabbit Thru. Every Std and Check all Connections, F/U String & Break Circ. Every 7Stds, NL-NG.
35	28 – Nov.	RIH With CMT BHA String to 4070m, Perform CMT Balance Plug Job According Program Till M.N.
36	29 – Nov.	POOH To Surf, L/D 22 JTS's 2-7/8" D.P , M/U & Run in hole With 6-1/8" M.T to 1030 m Meanwhile Fill up & break Circ Every 7 Std's . NL.NG Till M.N.
37	30 – Nov.	Cont RIH TO 3857m, Took weight (Tag CMT), Start D/O CMT from 3857m to 3910m meanwhile Pumping Hi-Vis pill Periodically & Check String with Movement Up & Down String Till M.N.
38	01 – Dec.	Cont Drill out CMT to 3945m, Circ BTM's up, Perform Positive Pressure Test CMT Plug with 2000 psi , ok. POOH TO 212m Till M.N.

39	02 – Dec.	Pull out of hole, Run in hole with 7" scraper to 3645m, scrape from 3645 to 3830m several time's till M.N.
40	03 – Dec.	Cont Scrape from 3830 to 3945m, Pump 40 BBl Hi-Vis Pill , Circulate BTM's Up till uniform total mud system, Spot 30 bbl Hi-Vis Pill. POOH from 3945m to 1973m.
41	04 – Dec.	POOH To surf, L/D Bit & 7" Scraper, P/U and Run in hole with 7" Whipstock BHA to 528m, Rig up wireline logging crew & Eqiupment, Run Gyro tools as Dummy to 372m, Try to pass this depth, No success, Pull out of hole gyro tools & Pull out of hole string on BHA and check BHA with Run Gyro Tools while L/D 1 Jts 4-3/4" D.C Till M.N.
42	05 – Dec.	Run In hole with 7" whipstock to 2557m Till M.N.
43	06 – Dec.	Run In hole with 7" whipstock to 3922m, RIH With Gyro to 3922 & try to take data, No succ, pull out of hole with gyro, cont run in hole to 3943m (set position whipstock) try to shearing pin's HFBPV, OK. Till M.N.
44	07 – Dec.	Try to set packer Whipstock & several time, No success, POOH to 2414m, Slips & Cut Drling line, Cont POOH to 1255m Till M.N.
45	08 – Dec.	continue POOH to surface and lay down BHA, Obseve 4-13/16" HFBPV is plugged whit debris, Run in hole by Open End BHA to 3945m Till M.N.
46	09 – Dec.	Circ Btm's up , Spot 30 BBl Hi-vis Pill, pull out of hole, run in hole with 7" Whipstock BHA to 760m Till M.N.
47	11 – Dec.	Set whipstock according procedure, Start open window on 7" LNR from 3938.9 to 3942.6m to side track the well Till M.N.
48	12 – Dec.	Cont. Side Track Drilling Formation F/ 3942.6 To 3945m, While got 100% Formation Sample in interval 3942-3945m, Dress & Smooth The Opened Window, Attempt to Check the Window ConditionWith & Without Rotation and Pump out Sev. Times, Ok in all situations, Pump 30bbl Hi-Vis Pill as Well & Hole Sweep, POOH 7" Side-Tracking BHA F/ 3945

		To 3960m On Elevator, Static Flow Check @ 3600m, Well Static, Cont. POOH 7" Side-Tracking BHA F/ 3600 To 2295m On Elevator, While Circ. C.W.H, w/ N.L-N.G.
49	13 – Dec.	Cont. POOH 7" Side-Tracking BHA F/ 2295m To Surface, P/U & M/U 15Jts 3-1/2" H.W.D.P, BOP Test, P/U & M/U 11Jts 3-1/2" H.W.D.P is in progress at M.N.
50	14 – Dec.	Cont. P/U & M/U 11Jts 3-1/2" H.W.D.P and R/B in the Derrick, P/U & M/U 6-1/8" Directional BHA, (DHM Evaluations: Bearing Gap: 1-2mm, Shallow Test w/ F.R: 200gpm, Got Diff. Press on SSP: 580psi, Set AKO: 1.5Deg, Shallow Test after M/U NFMDC and MWD Tools w/ 200gpm, Got Diff. Press on SSP: 750psi), Cont. RIH w/ 6-1/8" Directional BHA F/ 261 to 2891m, Shallow Tests while RIH [Depth: 520m, F.R: 207gpm, SPP: 1400psi, Depth: 1500m, F.R: 190, SPP: 1870psi, Depth: 2500m, F.R: 200, SPP: 2500psi]
51	15 – Dec.	Cont. RIH w/ 6-1/8" Directional BHA F/ 2891 To 3945m, Disp. In-Hole Mud w/ Limestone Mud and Circ. Till unirofm the In/Out Mud Properties, Directional Drilling as Roational Mode F/ 3945 To 3956m, while Monitor the Well, w/ N.L-N.G.
52	16 – Dec.	Cont. RIH w/ 6-1/8" Directional BHA F/ 3956 To 3963m, Attempt to Check shot, Obs. MWD Signal is lost, Work on the same issue to make it fixed, No Success, Cont. RIH w/ 6-1/8" Directional BHA F/ 3963 To 3966m, Due to MWD Signal lost, decided to POOH 6-1/8" Directional BHA to Surface, Monitor The Well as Static Flow Check for a while, Well Static, POOH 6-1/8" Directional BHA F/ 3966 To 1060m, w/ N.L-N.G.
53	17 – Dec.	Cont. POOH 6-1/8" Directional BHA F/ 1060 to surface, Shallow Test 4-3/4" DHM w/ 200GPM, got 850psi Diff. Pressure, L/D 6-1/8" Directional BHA, P/U 6-1/8" Back-up DHM, Perform Shallow Test w/ 200GPM, got 1200psi Diff. Pressure, R/D the same and Wait on receive Back-up 4-3/4" DHM F/ HANA Energy Co. Warehouse, Perform Shallow

		Test w/ 200GPM, got 1200psi Diff. Pressure, Set DHM AKO to 1.5Deg and Cont. RIH w/ 6-1/8" PDC Bit (Used, BESTE, S/N: 255421, IADC: M1665) + 34Jts 3-1/2" H.W.D.P + 4-3/4" Jar + 1Jt 3-1/2" H.W.D.P and RIH to 345m, Cont. RIH w/ 6-1/8" Directional BHA F/ 345 To 1356m Followed by 3-1/2"DPs, Perform Functional Tests during RIH [Depth: 520m, F.R: 207gpm, SPP: 1820psi], w/ N.L-N.G.
54	18 – Dec.	Cont. RIH w/ 6-1/8" Directional BHA F/ 1356 To 1502m Followed by 3-1/2"DPs On Elevator, MWD Signal was lost, Fix the same and Cont. RIH w/ 6-1/8" Directional BHA F/ 1502 to 3949m, Conn. TDS and Cont. RIH W/ 6-1/8" Dir. Drilling BHA W/ Wash Dn F/ 3949 To 3966m, Held up Strg Weight @ 3966m, Cont. Directional Drilling w/ 6-1/8" Directional BHA as Rotating Mode F/ 3966 To 3988m, While take Survey during Dir. Drilling, Pump Hi-Vis Pill Periodically & before each Conn. and B/R & R/D the last drilled Std and decrease MW to 105pcf, w/ N.L-N.G.
55	19 – Dec.	Cont. Directional Drilling w/ 6-1/8" Directional BHA as Rotating & Sliding Mode F/ 3988 To 4042m, While decrease MW to 103pcf, take Survey during Dir. Drilling, B/R & R/D the drilled interval and monitor the Well, w/ N.L-N.G.
56	20 – Dec.	Cont. Directional Drilling w/ 6-1/8" Directional BHA as Rotating & Sliding Mode F/ 4042 To 4094m, While take Survey during Dir. Drilling, B/R & R/D the drilled interval and monitor the Well, w/ N.L-N.G.
57	21 – Dec.	Cont. Directional Drilling w/ 6-1/8" Directional BHA as Rotating & Sliding Mode F/ 4094 To 4127m, While take Survey during Dir. Drilling, B/R & R/D the drilled interval and monitor the Well, w/ N.L-N.G.
58	22 – Dec.	Cont. Directional Drilling w/ 6-1/8" Directional BHA as Rotating & Sliding Mode F/ 4127 To 4177.5m, While take Survey during Dir. Drilling, B/R & R/D the drilled interval and monitor the Well, 1-2BPH Loss.
59	23 – Dec.	Cont. Directional Drilling w/ 6-1/8" Directional BHA as Rotating & Sliding Mode F/ 4177.5 To 4208m (TD Depth),

		While take Survey during Dir. Drilling, B/R & R/D the drilled interval and monitor the Well, 1-2BPH Loss, Perform Hi-Rate CBU @ 4208m, B/R w/ 6-1/8" Dir. Drilling BHA to Condition the drilled hole F/ 4208 To 3919m, RIH Back w/ 6-1/8" Dir. Drilling BHA F/ 3919 To 3967m On Elevator, Obs. Held Up Strg Wt. @ 3967m, Conn. TDS and Cont. RIH w/ 6-1/8" Dir. Drilling BHA w/ Wash Dn F/ 3967 To 3977m, Cont. RIH Back w/ 6-1/8" Dir. Drilling BHA F/ 3977 To 4121m On Elevator, Obs. Held Up Strg Wt. @ 4121m, Conn. TDS and Cont. RIH w/ 6-1/8" Dir. Drilling BHA w/ Wash Dn F/ 4121 To 4208m,Pump 30 Hi-Vis Pill and Hi-Rate CBU till Shakering out the Hi-Vis Pill to Sweep the hole, While Monitor the Well, 0/5-1BPH Loss is in progress at M.N.
60	24 – Dec.	Cont. Hi-Rate CBU till Shakering out the Hi-Vis Pill to Sweep the hole, POOH 6-1/8" Dir. Drilling BHA F/ 4208m to surface, L/D 6-1/8" PDC Bit, 4-3/4" DHM and MWD Tools and rest of BHA, R/U SeaLand Wire Line Eqp. Is in progress at R.T.
61	25 – Dec.	Cont. R/U SeaLand Wire Line Eqp. And RIH w/ CDR/GR Logging 4206m, Record Data w/ Logging up w/ Wire Line Tools F/ 4206 to 4130m, Log Down F/ 4130 to 4135m to repeat pass, Obs. 100lb Cable Tension Drop, Attempt to Log up, Obs. Wire line Tools is stuck at 4134m, work on stuck to make Wire Line Tool String free Sev Times, No Success, Apply 8000lb Tension on Wire line using Wire Line unit winch, POOH Wire Line Tool String to surface to check the same, Obs. All Wire Line Tool String except Cable Head is left in the hole, R/D Wire Line Eqp. , Change Top Ram F/ 7" Fix to 2-7/8"- 5" VBR and Press. Test on Same, Ok, set Wear Bushing, and P/U & M/U 5-1/2" Fishing BHA and RIH to 2900m, While Circ. C.W.H & Monitor the Well, 0/5-1BPH Loss.
62	26 – Dec.	Run in hole , try to catch the fish @ several time, pull out of hole for check overshot to surface whitout observe any indication on overshot, lay down it, slip & cut 100FT drilling line till M.N.

63	27 – Dec.	Run in hole with fishing BHA (5-1/4" overshot) to 4202m , catch the fish , Stock string , work on string & got free, pull out of hole to 2664m for check string Till M.N.
64	28 – Dec.	Pull out of hole with fishing BHA (5-1/4" overshot) to surface. Observe recovered 1.13m of the fish , Run back in the well with fishing BHA to 2834m Till M.N.
65	29 – Dec.	Run in hole with fishing BHA to 4201.5m, Work on fish , Observe catch indication fish, pull out of hole to surface, observe no recover fish meanwhile observe broken 3-5/8" Sprial grapple & 3-5/8 Sprial grapple control . Lay down Fishing BHA. Retrieve wear bushing Till M.N.
66	30 – Dec.	Running 4-1/2" liner totally 32 jts, P/U & M/U liner hanger assembly with top packer to 4-1/2" liner, continue running liner with follow by 3-1/2" & 5" drill pipe to 3113m while pass rabbit through the drill pipes & fill up string every 10 stands w/ 0.5 BPH loss Till M.N.
67	31 – Dec.	Continue run 4-1/2" LNR to 3993m while pass rabbit through the drill pipes & fill up string each 10 stands w/ 0.5 BPH loss. Observed stopped string @ 3993m and Try to passing this depth by pumping & apply max 30 klb weight on it several times, no success. POOH To 1000m till M.N.
68	01 – Jan	POOH to surface, L/D liner hanger + 32 joint 4-1/2" liner + F.shoe + F.coller + LDC & Circulate mud Cross well head with 0.5 BPH loss.
69	02 – Jan	RIH to 4201.5m while wash and ream @ several Point And Push Down the Obstruction, Circ BTM's up, Pull out of hole to 3941.5m (K.O.P) with Normal condition till M.N.
70	03 – Jan	POOH to surface & L/D 6-1/8 Tri-cone bit, Run 4-1/2" LNR to 1756m Till M.N.
71	04 – Jan	Run 4-1/2" LNR to 3993m, Try to pass this depth with Pump & weight @ several time, No succ. Start Pull out of hole from 3993m to 710m with 0.5 BPH loss Till M.N.

72	05 – Jan	POOH to surface & Perform BOP test as Per NIOC Policy. P/U & RIH with 6-1/8" PDC Bit used to 1000m, Slip & cut 102ft DRLG line. Cont RIH to 3305m Till M.N.
73	06 – Jan	Run in hole to 3990m, Took weight and W&R to 4004m, obs Gas cut mud , Shut the well while S-trip in Hydril, Safe the well, Cont W&R to 4110m, String Stuck, Work on it & To be free string, wash & b.ream to 4062m, pooh on elevator to 3920m, obs Gas Cut mud , Shut the well & circ mud thru Chockmanifold wide open Till M.N.
74	07 – Jan	POOH TO Surface, P/U & Run 4-1/2" liner to 211m Till M.N.
75	08 – Jan	Continue Run 4-1/2" LNR & follow by 3-1/2" & 5" D.Pipe to 2482m, Observe 10 bbl Gain, Shut the well & work on Kill the well No. Succ Till M.N.
76	09 – Jan	Cont. Prepare 120pcf Kill Mud, whiel Break Circ. Every hour Thru. Choke Manifold and Poorboy Degasser to make sure Strg is not plugged, Circ. 500 bbl 120 pcf Kill Mud in two steps Thru. Choke Manifold & Poorboy Degasser & Got 111pcf Mud in Return, Open the Well and Resume RIH w/ 4-1/2" LNR F/ 2480 To 3056m, While To F/U Strg, Close the Well and Circ. w/ 110pcf Mud Thru. Choke Manifold & Poorboy Degasser & Got 95pcf Mud in Return, Perform Static Flow Check @ 3056m, Well Static, Open the Well and Resume RIH w/ 4-1/2" LNR F/ 3056 To 3771m, Obs. U-Tube @ 3771m due to Unbalance MW in Strg and Annulus, Close the Well and Monitor SICP & SIDP, Respectively 0psi, 800psi, While Periodically Break Circ. w/ 110pcf Mud Thru. Choke Manifold & Poorboy Degasser, and Prepare 108 & 110pcf Mud is in progress @ M.N.
77	10 – Jan	Cont. Monitor SICP & SIDP, Respectively 0psi, 800psi, While Periodically Break Circ. Every hour Thru. Choke Manifold and Poorboy Degasser to make sure Strg is not plugged, Attempt to Kill the Well using Single Circulation Method w/ 700bbl 108pcf & 153bbl 110pcf in two steps Thru. Choke Manifold & Poorboy Degasser, Open the Well and Cont. RIH w/ 4-1/2" LNR F/ 3771 To 3914m Followed by

		5"DPs On Elevator, Cont. Mud Circ. w/ 526bbl 108pcf Mud Thru. Choke Manifold & Poorboy Degasser, Decided to Stop Op. & Prepare 110pcf Mud, Close the Well and Monitor SICP & SIDP, Respectively 1300psi, 750psi, While Periodically Break Circ. w/ 110pcf Mud Thru. Choke Manifold & Poorboy Degasser to make sure Strg is not plugged & Got 95pcf Mud in Return, and Prepare 110pcf Mud.
78	11 – Jan	Kill the Well @ 3914m using W&W method w/ 654bbl 110pcf Mud in two steps Thru. Choke Manifold & Poorboy Degasser w/ SPP: 1350psi, CP: 650-250psi and Got Min. 86pcf Gas-Cut Mud in Return, Cont. Mud Circ. w/ 150bbl 110pcf Mud w/ SPP: 1350psi & Wide Open Choke, Open the Well @ 3914 and Cont. Circ. w/ F.R: 121gpm, SPP: 1200-1300psi till uniform the In/Out MW, Ok, Static Flow Check @ 3914m, Well Static, POOH 4-1/2" LNR Assy. F/ 3914 To 1951m, Static Flow Check @ 1951m, Well Static, Cont. POOH 4-1/2" LNR Assy. F/ 1951 To 332m, Static Flow Check @ 322m, Well Static, R/U Casing Running Eqp. & Change Handling Tools, B/O & L/D 5-3/4" LNR HGR Assy. , Cont. B/O & L/D 4-1/2" LNR Jts F/ 322 to 133m, While Monitor the Well and Circ. C.W.H, w/ N.L-N.G.
79	12 – Jan	Cont. B/O & L/D 4-1/2" LNR Jts F/ 133m to Surface (Totally 29Jts), While Check 4-1/2" F.Shoe, F.Collar, and LDC (4-1/2" F.Collar was damaged), P/U & M/U 6-1/8"Condition BHA and RIH to 3936m, Decrease MW to 105pcf, Circ. To Balance Mud MW, Cont. RIH w/ Wash & Ream Dn F/ 3936 to 3966m, w/ N.L-N.G @ M.N.
80	13 – Jan	Cont. RIH w/ Wash & Ream Dn F/ 3966 to 4146.5m, w/ N.L-N.G @ M.N.
81	14 – Jan	Cont. RIH w/ 6-1/8" Condition BHA w/ Wash & Ream Dn F/ 4146.5 to 4202m, POOH 6-1/8" Condition BHA w/ Back Ream & Pump out F/ 4202 to 3947m, Then POOH 6-1/8" Condition BHA F/ 3947 to 1144m On Elevator, w/ N.L-N.G @ M.N.
82	15 – Jan	Cont. POOH 6-1/8" Condition BHA to surface, L/D 6-1/8"

		Tri-Cone Bit [Dull: 1-2-CT-A-E-I-WT-TD] & Rest of BHA, P/U & M/U 4-1/2" LNR Assy. and RIH to 3140m On Elevator, While F/U Strg and Break Circ. Every 10Stds , w/ N.L-N.G. @ M.N.
83	16 – Jan	Cont. RIH w/ 4-1/2" LNR Assy. to 4201.5m, Set 4-1/2" Hyd. Mech. Rot. LNR HGR, perform CMT Job [Pumped 15 bbl Fresh Water W/ Chemical Wash as Spacer Ahead + Mixed and pumped Class "G" Delijan Blend CMT W/ Slurry Weight: 118 pcf, Slurry Volume: 40 bbl, Dropped Pump-Down Plug and displaced W/ 152bbl Mud, observed bumping at 3000 psi, hold for 10 minutes, checked backflow, result OK. (N.L-N.G. during cement job), CBU @ 3322m, POOH LNR HGR setting tools F/ 3322 to 2007m On Elevator, Surface sample after 8 hours: hard, While Circ. C.W.H, w/ N.L-N.G.
84	17 – Jan	Cont. POOH LNR HGR setting tools to surface, Ok, P/U & M/U 6-1/8" Clean out BHA and Cont. RIH w/ 6-1/8" Clean out BHA F/ 330 to 3739m followed by 3-1/2" & 5" DPs, Conn. TDS and Cont. RIH w/ 6-1/8" Clean out BHA w/ Wash Dn f/ 3739 to 3765m, Held up Strg Weight @ 3765m, Start D/O CMT w/ 6-1/8" Clean out BHA f/ 3765 to 3812.9m, While Back Ream & Ream Dn Every Std before Connection, w/ N.L-N.G.
85	18 – Jan	Cont. D/O CMT inside 7" LNR to 3871m, Set Top PKR, CBU, POOH 6-1/8" Clean out BHA to surface, BOP Test in progress @ M.N.
86	19 – Jan	Cont. BOP Test, P/U & M/U 3-1/2" Clean out BHA and RIH to 250m, Attempt to F/U BHA & Break Circ. @ 250m, Obs. Strg is plugged, Decided to POOH, Install Secondary Fingerboard for 2-7/8"DPs & 3-1/8"DCs, POOH 3-1/2" Clean out BHA f/ 250m to surface, B/O 3-1/2" Mill Clean and Unplug 3-1/2" Mill, P/U & M/U 3-1/2" Clean out BHA and RIH to 2996m, While F/U Strg & Break Circ. Every 15Stds, w/N.L-N.G.
87	20 – Jan	Cont. RIH w/ 3-1/2" Clean out BHA f/ 2996 to 3310m, Attempt to Perform Break Circ. @3310m, Obs. Strg is

		plugged, Work on Strg and make it unplugged, Resume RIH w/ 3-1/2" Clean out BHA f/ 3310 to 3511m, Attempt to Perform Break Circ. @3511m, Obs. Strg is plugged, Work on Strg and make it unplugged, Resume RIH w/ 3-1/2" Clean out BHA f/ 3511 to 3554m w/ Wash Dn followed by 5" DPs, Strg got plugged while RIH, Work on Strg and make it unplugged, Break Circ. for a while, Resume RIH w/ 3-1/2" Clean out BHA f/ 3874m w/ Wash Dn, , Held up Strg @ 3874m, D/O CMT inside 4-1/2" LNR & Packoff Bushing f/ 3874 to 4005m, Cont. RIH w/ 3-1/2" Clean out BHA W/ Soft Wash & Ream Dn f/ 4005 to 4028m, while Cut MW f/ 105 to 103pcf, w/ N.L-N.G.
88	21 – Jan	Cont. RIH w/ 3-1/2" Clean out BHA W/ Soft to Med. Wash & Ream Dn f/ 4028 to 4140.7m, w/ N.L-N.G.
89	22 – Jan	Cont. RIH w/ 3-1/2" Clean out BHA W/ Soft to Med. Wash & Ream Dn f/ 4140.7 to 4178m, Pump 20bbl Low-Vis Pill @ 4178m and CBU till Shakering out that, Pump 20bbl CaCl2 solution @ 4178m as Balance and chase w/ 103pcf Mud to Spot it in 4-1/2" LNR in progress at M.N, w/ N.L-N.G.
90	23 – Jan	spod 20bbl Brine w/ 103pcf Mud @ 4178m to Spot it in 4-1/2" LNR, POOH 3-1/2" Clean out BHA to 3870m On Elevator, Perform Positive Test @ 3870m w/ 1000psi, Ok, cont POOh to surf, Change top rams and & install shooting nipple. R/U & install wireline BOP, test it, OK. (SEALAND), R/U wireline tools and Perform Wireline Operation: Run#1: Assemble 2 No. 2-7/8" B.Gun + CCL As Dummy Run to 4150m till M.N.
91	24 – Jan	spod 20bbl Brine w/ 103pcf Mud @ 4178m to Spot it in 4-1/2" LNR, POOH 3-1/2" Clean out BHA to 3870m On Elevator, Perform Positive Test @ 3870m w/ 1000psi, Ok, cont POOh to surf, Change top rams and & install shooting nipple. R/U & install wireline BOP, test it, OK. (SEALAND), R/U wireline tools and Perform Wireline Operation: Run#1: Assemble 2 No. 2-7/8" B.Gun + CCL As Dummy Run to 4150m till M.N.
92	25 – Jan	pull out wireline logging tools (RBT/VDL/CCL/GR) to Surface, L/D it . run in hole with : 2 No. 2-7/8" B.Gun + CCL

		As Dummy Run to 4165m, Pull out of hole to surface and L/D it. Perform Run#1 Perforation according Program. While Wait on Daylight Run 2 No. 2-7/8" B.Gun + CCL As Dummy. NL.NG @ M.N.
93	26 – Jan	Continue perforation Operation according procedure : Run 2# : Armed W/ 99 Bullets (OK) , Run 3# : Armed W/ 99 Bullets (OK), Run 4# : Armed W/ 80 Bullets (OK), While Wait on Daylight Run 2 No. 2-7/8" B.Gun + CCL As Dummy. NL.NG @ M.N.
94	27 – Jan	Continue perforation Operation according procedure : Run 5# : Armed W/ 70 Bullets (OK) , Run 6# : Armed W/ 99 Bullets (OK), Wait on Daylight. NL.NG @ M.N.
95	28 – Jan	Continue perforation Operation according procedure : Run 7# : Armed W/ 99 Bullets (OK) , Run 8# : Armed W/ 60 Bullets (OK), Run 9# : Armed W/ 99 Bullets (OK), Wait on Daylight. NL.NG @ M.N.
96	29 – Jan	Continue perforation Operation according procedure : Run 10# : Armed W/ 99 Bullets (OK) , Run 11# : Armed W/ 89 Bullets (OK), Run 12# : Armed W/ 40 Bullets (OK), Slip & Cut 125ft Drilling Line. Change Top Rams and Test it, OK. P/U & M/U 3-1/2" Clean Out BHA Including : 3 1/2" Junk Mill + 3 1/8" Bit Sub + 5 STDs 3 1/8" DC to 140m - NL.NG. Till M.N.
97	30 – Jan	Continue run in hole to 4178m (LDC) While Fill up string
98	31 – Jan	Continue Circulate BTM's Up. Spot 20 BBL Completion fluid (CaBr2 102.5 PCF), POOH on Elevator from 4178m to Surface, Run in hole with 7" Scraper BHA Including : 6-1/8" Tri.cone + 7" Scraper + 6 1/4" Bit Sub + 8 STDs 3-1/2" H.W.D.P & Follow by 3-1/2" D.P to 396m Till M.N.
99	01 – Feb	Continue Run in hole to 3871.3m (4-1/2" LNR) While Scrape from 3400 to 3540m several times. While wait on Received Completion String, mud Circulate w/ NL-NG , Noticed 10 BBL Gain While BTM's Up, Close the well, SICP: ZERO, Mud Circ Thru Chock Manifold with NL-NG , Min Return

		MW : 70 PCF, Stop Circ & Close the well to make mud Till M.N.
100	02 – Feb	While wait on Received Completion String & Completion Fluid, Continue making mud & Circulate mud with 105 PCF Thru chocke Manifold with NL.NG. Return minimum mud weight 70 PCf & Last return mud Weight 103 PCF Till M.N.
101	03 – Feb	While wait on Received Completion String & Completion Fluid, Cont Circ 105 pcf mud Thru chocke Manifold, Get 105 PCF Mud in Return, Observe The Well, Static. Open The well, Continue Direct Circ mud with F.Rate: 220 GPM, SPP: 2000Psi, NL.NG While work on mud properties.
102	04 – Feb	While wait on Received Completion String & Completion Fluid, Circ mud with F.Rate: 230 GPM, SPP: 2250Psi, NL.NG While work on mud properties.
103	05 – Feb	While wait on Received Completion String, Circ mud with F.Rate: 220 GPM, SPP: 2150Psi, NL.NG While work on mud properties.
104	06 – Feb	While wait on Received Completion String, Circ mud with F.Rate: 220 GPM, SPP: 2150Psi, NL.NG.
105	07 – Feb	While wait on Received Completion String, Circ mud with F.Rate: 220 GPM, SPP: 2150Psi, NL.NG.
106	08 – Feb	While wait on Receive Completion String, Circ mud with F.Rate: 220 GPM, SPP: 2150Psi, NL.NG.
107	09 – Feb	While wait on Receive Completion String, Circ mud with F.Rate: 220 GPM, SPP: 2150Psi, NL.NG.
108	10 – Feb	While wait on Receive Completion String, Circ mud with F.Rate: 220 GPM, SPP: 2150Psi, NL.NG.
109	11 – Feb	While wait on Receive Completion String, Circ mud with F.Rate: 220 GPM, SPP: 2150Psi, NL.NG.
110	12 – Feb	While wait on Receive Completion String, Circ mud with

		F.Rate: 220 GPM, SPP: 2150Psi, NL.NG.
111	13 – Feb	While wait on Receive Completion String, Circ. mud with F.Rate: 220 GPM, SPP: 2150Psi, R/U Chicksan Pipes and Line up the same on 5"DPs & Pump Unit of Dana Energy Co. , Conn. Hose f/ Solution Tanks to Pump Unit, Perform Displacement of Comp. Fluid as follow: Pump 30bbl Hi-Vis Pill as Spcaer + Pump 675bbl Comp. Fluid is in progress at M.N.
112	14 – Feb	Cont. Pumping Comp. Fluid till getting Hi-Vis Pill and then 104.5 pcf Comp. fluid on Sh.Shakers, Stop Pumping, Flow Check at 3869m for 1Hr. , Well Static, Start POOH 6-1/8" BHA F/ 3869 to 3529m, While L/D Tubulars, due to inability to fill up the well using the trip tank hose caused by a leakage in the hose, change Trip Tank Hose, Resume POOH 6-1/8" BHA F/ 3529 to 878m On Elevator, While L/D Tubular Jt by Jt, Monitor and Fill up the Well by Trip Tank, W/ N.L-N.G.
113	15 – Feb	POOH 6-1/8" BHA F/ 878m to surface, L/D rest of BHA & Bit w/ same condition, Perform BOP Test as per NIOC Policy, R/U NDCO LNR Running Tools, RIH 7" Comp. Strg to 12m as follow: 3-1/2" Mule Shoe + 3-1/2" BTM NO GO + Pup Jt 3-1/2", 10.2#,HSM3 + 1Jt TBG 3-1/2", 10.2#, L-80,HSM3, While Circ. C.W.H by Trip Tank, W/ N.L-N.G till M.N.
114	16 – Feb	Cont. RIH w/ 7" Completion Strg f/ 12 to 30m, R/U Slick Line Tools and RIH 2.700" Guage Ring to Top of NO-GO L.Nipple, Ok, POOH to surface, Cont. RIH w/ 7" Completion Strg f/ 30 to 82m, R/U Slick Line Tools and RIH 2.80" Guage Ring to Top of SSD, Ok, Perform Comp. Strg Press. Test at 82m w/ 7000psi, 15min, Ok, Cont. RIH w/ 7" Completion Strg f/ 82 to 241m,
115	17 – Feb	Cont. RIH Completion Strg f/ 241 to 857m, Perform Comp. Strg Press. Test at 857m w/ 7000psi, 15min, Ok, Cont. RIH Completion Strg f/ 857 to 1350m, while Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G.
116	18 – Feb	Cont. RIH Completion Strg f/ 1350 to 1700m, R/U Slick Line Tools, Assemble 2.800" Guage Ring Tool Strg, RIH to Top of

		SSD, Ok, POOH to surface, L/D Slick Line Tools, Perform Comp. Strg Press. Test at 1700m w/ 7000psi, 15min, Ok, Cont. RIH Completion Strg f/ 1700 to 2384m, while Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G.
117	19 – Feb	Cont. RIH Completion Strg f/ 2384 to 2680m, Perform Comp. Strg Press. Test at 2680m w/ 7000psi, 15min, Ok, Cont. RIH Completion Strg f/ 2680 to 3430m, while Circ. C.W.H by Trip Tank & Monitor the Well, W/ N.L-N.G.
118	20 – Feb	Cont. RIH Completion Strg to 3620.3m while Perform Comp. Strg Press. Test at 3553m w/ 7000psi, 15min, Ok, W/ N.L-N.G. RIH W/Slick Line According Procedure, Install 3.437 Protection Sleeve, Retrieve 2.75" Check.V F/SSD, Set. 2.562" Plug in NO-GO L.N. Set prong in NO GO, Run with shifting tool to confirm SSD is full close in Progress, NL.NG, Till M.N.
119	21 – Feb	Set PKR (Set PKR Depth : 3601.86m), Land tubing hanger in Tubing Head Spool, Tighten all Tie-Down screws. Perform All of Test Comp. String as Program, Ok. N/D BOP Stack in Progress till M.N.
120	22 – Feb	N/D BOP, N/U X-Mas Tree According Plan & Test it, OK. Open X-Mas Tree cap and Retrieve 2WCV. Install Xmas tree cap and close all valves Except bottom master valve.
121	23 – Feb	Prepare To Displace complition Fluid (CaBr2 Sloution) in String with salt water Till M.N.
122	24 – Feb	Prepare To Displace complition Fluid (CaBr2 Sloution) in String with salt water. N/U Coiled Tubing BOP & R/U Slick Line & Set Protection Sleeve in 3SV, R/U Coiled Tubing Equip. (Lubricator + Injector Head), Perform Press. Test Coiled Tubing BOP, Ok. Till M.N.
123	25 – Feb	Cont. run in string w/ C.T: 1-3/4" nozzle (5 port 6/32") + 1-1/2" double flapper + roll-on connector to to 3619^{m} (top of plug & prong in NO-GO L.N), Start displace completion fluid ($CaBr_2$ solution) in string with pump 15^{bbl} hi vis pill as spacer, Cont. pump salt water added 1% corrosion inhibitor (pH:10)

		,pull out C.T to surface. Lay down & flush coiled tubing line. Rig up slick line, retrieve protection sleeve from 3SV, R/D slick line, close all X-mas tree valve except BTM master valve. Release the rig in 1403.12.07 @ 24:00 o'clock.

Table 12-1: AZNS-122 Daily Drilling Report Summary

13. Comments & Revision

Drilling Engineering							
۱	**2.1 Well information:** • TD depth must be corrected based on client DDR. (4205.5 m) • Actual/plan rig days must be corrected based on client DDR.	10	CM	• اصلاح گردید. • اصلاح گردید.	با توجه به عدم دریافت نسخه نهایی برنامه تعمیری ۲ #چاه شماره ۱۲۲، این مشاور تعداد روز های مورد تایید برنامه مذکور را نمی‌تواند بررسی کند، بنابراین منوط به تایید کارفرما باشد. می		AN
2	**2.1 Well information:** • 7” liner depth and grade must be corrected based on client DDR. (7”: 3778-4208 110SS) • 4-1/2 S.T depth must be corrected based on client DDR. (3871-4201 m)	10	CM	• اصلاح شد. • اصلاح شد.	Approved		AP
3	**AZNS-122 Well History** • 7” liner depth and grade must be corrected based on client DDR. (7”: 3778-4208 110SS)	11	CM	• اصلاح شد.	Approved		AP
4	**Summary of Workover #2 Operation:**	13,32	CM	• اصلاح شد. • اصلاح شد.	Approved		AP

	• Operation date (de-complete, re-complete and rig release, ...) must be compatible with client DDR. • Operation performed on 1403/12/06 and 1403/12/07 must be added to the workover #2 summary.						
5	• 7” liner depth and grade must be corrected based on client DDR. (7”: 3778-4208 110SS)	59	CM	• اصلاح شد.	Approved		AP
6	• Due to the fact that TEC does not receive any document related to the completion tools test in the presence of client’s representative, hence the contractor must submit them for TEC’s approval.		CM	• مدارک تست تجهیزات رشته تکمیلی به صورت جداگانه در فایل Final Well Handover Booklet ارائه گردیده است.	Approved		AP
7	۱۲,۱ **DDR Summary:** DDR summary must be completely compatible with client’s daily drilling report. Moreover, the rig was released on 1403-12-07, hence the operation must be added to DDR summary and summary of workover #2 operation.	144	CM	• اصلاح شد.	Approved		AP

8	**3.2 Total Time Break-Down of Operation:** • Header must be added to time break-down table. • Time break-down must be completely compatible with approval work-over#2 program. (including plan and actual)	36	CM	• اصلاح شد.	با توجه به عدم دریافت نسخه نهایی برنامه تعمیری #۲ چاه شماره ۱۲۲، این مشاور تعداد روز های مورد تایید و عملیات برنامه مذکور را نمی‌تواند بررسی کند، بنابراین منوط به تایید باشد. کارفرما می		AN
9	**8.5 Completion sketch & tally:** • 4-1/2” liner ID must be corrected based on liner running report. • 3-1/2 tubing ID must be corrected. • Completion tools grade must be added to the table.	87	CM	• اصلاح شد.	Approved		AP
Fluid Engineering							
1	گزارش مورد تایید است.		AP				
Geology							
1	Figure 1-2 has very low quality and the well survey directions are not correct. Need to be replaced.		CM	• اصلاح شد.	Approved		AP

2	The operation includes drilling (side tracking) and CDR log obtained in the hole but well survey is not reported in the document. The survey should be reported.		CM	• اضافه گردید.	Approved		AP