SERVICE BULLETIN

SB-2026-047 Lowering valve check


SB-2026-047
Issued Sep 30, 2026

ITEM	DETAIL
Machine	JLG 1930ES electric scissor lift
Applies to	FL-112, FL-113, FL-118
Priority	Complete at next service or within 30 days
Labor	0.5 h per unit
Part if needed	JLG-4120-402 Lowering valve, solenoid

Reason

Some lowering valves may not seat fully after long idle periods. The platform can then drift down slowly with a load on it. This check confirms the valve seats and holds pressure.

Affected component

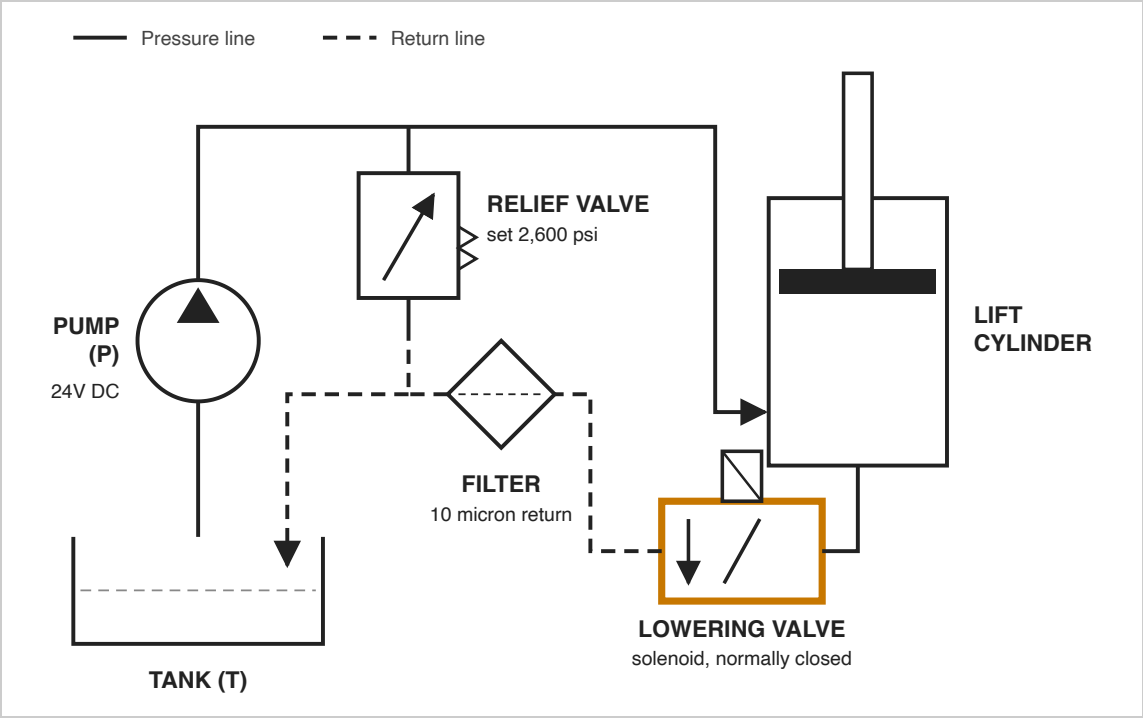

Procedure

1. Park on firm, level ground. Load the platform with 300 lb of test weight.
2. Raise the platform to 6 ft and turn the key switch off.
3. Mark the rod position. Wait 10 minutes.
4. If the platform drifts less than 0.5 in, the valve passes. Record the result below.
5. If it drifts more, replace the lowering valve with JLG-4120-402 and repeat the check.
6. Return the machine to service and close the work order.

Record

UNIT	DRIFT (IN)	RESULT	TECHNICIAN	DATE
FL-112				
FL-113				
FL-118				

ITEM	PART NUMBER	DESCRIPTION	QTY
1	JLG-4120-402	Lowering valve, solenoid	1
2	JLG-4120-415	Hydraulic return filter	1